

THE ENVIRONMENTAL SOLUTION

# **GREATER CLARK COUNTY SCHOOLS**

# **RIVER VALLEY MIDDLE SCHOOL**

# AHERA

# ASBESTOS MANAGEMENT PLAN

#### DESIGNATED PERSON TRUTH AND CORRECT STATEMENT

Local Education Agency –	Greater Clark County Schools 2112 Utica-Sellersburg Road Jeffersonville, Indiana 47130
Designated Person -	Alliance Environmental Group, Inc. Sandra Shadley 5153 Commerce Square Drive, Suite E Indianapolis, Indiana 46237

This Truth and Correct Statement, as outlined in 40 CFR 763.93(i), certifies that the general, local education agency responsibilities, as stipulated by 40 CFR 763.84, have been or will be met. These responsibilities include:

- 1. Ensure that the activities of any persons who perform inspections, reinspections, and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with 40 CFR 763 Subpart E.
- 2. Ensure all custodial and maintenance employees are properly trained as required by 40 CFR 763 Subpart E and other applicable Federal and/or State regulations (e.g., the Occupational Safety and Health Administration Asbestos Standard for Construction, the EPA Worker Protection Rule, or applicable State regulations).
- 3. Ensure that workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress.
- 4. Ensure that short-term workers (e.g., telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.
- 5. Ensure that warning labels are posted in accordance with Section 763.95.
- 6. Ensure management plans are available for inspection and notification of such availability has been provided as specified in the management plan under Section 763.93(g).
- 7. The undersigned person designated by the LEA pursuant to Section 763.84(g) (1) has received adequate training as stipulated in Section 763.84(g) (2).
- 8. The LEA has and will consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under Part 763.

Shadlee )and Date: November 6, 2016 Signature:

Sandra S. Shadley

#### ASBESTOS PROGRAM MASTER INDEX

The following volumes are part of the Asbestos Program for the **GREATER CLARK COUNTY SCHOOLS**:

- A. Original Asbestos Management Plan for each school building.
- B. Asbestos Management Plan Supplement for each school building.
  - 1. Amendments to Management Plan
  - 2. Remaining Materials Report
  - 3. Surveillance, Reinspection and Additional Bulk Sampling Information
  - 4. Annual Notifications, Accreditations and Training Records
  - 5. Operations and Maintenance Records
  - 6. Asbestos Removal Projects
  - 7. Short Term Worker Program

Copies of both volumes are found in the respective buildings. The Administration Building also contains duplicate copies of both volumes for each building in their entirety.

# GREATER CLARK COUNTY SCHOOLS RIVER VALLEY MIDDLE SCHOOL

### TABLE OF CONTENTS

AMENDMENTS TO MANAGEMENT PLAN	1
REMAINING MATERIALS REPORT	2
SURVEILLANCE, REINSPECTION AND ADDITIONAL BULK SAMPLING INFORMATION	3
ANNUAL NOTIFICATIONS, ACCREDITATIONS, AND TRAINING	4
OPERATIONS AND MAINTENANCE RECORDS	5
ASBESTOS REMOVAL PROJECTS	6
SHORT TERM WORKER INFORMATION	7

C

.

AMENDMENTS TO THE MANAGEMENT PLAN

.

#### GREATER CLARK COUNTY SCHOOLS RIVER VALLEY MIDDLE SCHOOL

#### LEA RESPONSIBILITY CERTIFICATION

LEA Designated Person - ALLIANCE INDIANA, INC.

Signature - Bruce Wallace, President/CEO

<u>May 1, 1995</u> Date

#### **ACCREDITATION STATEMENT**

The Greater Clark County Schools ensures that the following items will be carried out:

Activities of any persons who perform inspections, reinspections, and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with Subpart E of this part.

All custodial and maintenance employees are properly trained as required by this Subpart E and other applicable Federal and/or State regulations (e.g., the OSHA asbestos standard for construction, the EPA worker protection rule, or applicable State regulations).

Workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, and post response action activities, including periodic reinspection and surveillance activities that are planned or in progress.

Short-term workers (e.g., telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.

Warning labels are posted in accordance with 763.95.

Management plans are available for inspection and notification of such availability has been provided as specified in the management plan under 763.93(g).

Designate a person to ensure that requirements under this section are properly implemented.

Designated person receives adequate training to perform duties assigned under this section. Such training shall provide, as necessary, basic knowledge of:

Health effects of asbestos

Detection, identification, and assessment of ACM

Options for controlling ACBM

Asbestos management programs

Relevant Federal and State regulations concerning asbestos, including those in this Subpart E and those of the OSHA, U.S. Department of Labor, the U.S. Department of Transportation and the u.S. Environmental Protection Agency.

Consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under this subpart.

Greater Clark County Schools

**Responsibility Statement** 

Greater Clark County Schools

LEA Name -

**Building** -River Valley Middle School

Subject -LEA Designated Person Change

> Effective May 1, 1995 the Designated Person for the Greater Clark County Schools is:

Alliance Indiana, Inc. 1433 Sadlier Circle West Drive Indianapolis, Indiana 46239 (317) 351-5600

Management Planner: Rex Gaddis Accreditation No. 192218025

y Suddes

Signature

May 1, 1995 Date

Amendment

## AMENDMENT TO THE AHERA MANAGEMENT PLAN

Building - River Valley Middle School

Subject- New material

Reference - HA A Cove Base

Original Assessment - No assessment in original inspection.

Amended Assessment - The cove base in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

**Rex Gaddis** 

Indiana Department of Environmental Management Accreditation

192218025

But Xtaddas

Signature

9/5/95

Date

Alliance Indiana, Inc.\_

Indianapolis, Indiana

## AMENDMENT TO THE AHERA MANAGEMENT PLAN

Building - River Valley Middle School

Subject- New material

Reference - HA B Cove Base Mastic

Original Assessment - No assessment in original inspection.

Amended Assessment - The cove base mastic in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

**Rex Gaddis** 

Indiana Department of Environmental Management Accreditation

192218025

Bex X haddes

Signature

9/5/95

Date

Greater Clark County Schools

Amendments

## AMENDMENT TO THE AHERA MANAGEMENT PLAN

Building - River Valley Middle School

Subject- New material

Reference - HA C Shock Joint Material

Original Assessment - No assessment in original inspection.

Amended Assessment - The shock joint material on the air handlers in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

**Management Planner** 

**Rex Gaddis** 

192218025

Indiana Department of Environmental Management Accreditation

ix Xhodos

Signature

9/5/95

Date

Greater Clark County Schools

Amendments

#### <u>AHERA</u>

#### AMENDMENT TO MANAGEMENT PLAN

Building Name - (Now Former) Administration Building, W.E. Wilson Elementary School, Thomas Jefferson Elementary School, Jeffersonville High School, River Valley Middle School, Corden Porter Center, Corden Porter Building #3, Corden Porter Building #4, and the Service Center/Bus Garage

Subject - Typographical Error

Amendment -

t - A typographical error was made on the paperwork for the Periodic Surveillance that was conducted in December 2001. The pages in the Management Plan Supplement which are dated 12/10/2002 should read 12/10/2001.

Management Planner: George Wm. Ogle

Accreditation Number: 191523030

U. Signature

ennam Date

Amendment

**Building Name -River Valley Middle School** 

Subject -Removal of Material from Management Plan

Amendment -Homogeneous area designation "C" covering shock joints in the 2nd floor mechanical room will be removed from the Management Plan. This material has been removed non-friable.

Management Planner: George Wm. Ogle

Accreditation Number: 191523030

Signature

anwary I Date

Building Name - River Valley Middle School

Subject - Removal of Materials from Management Plan

Amendment - Homogeneous area designation "C" covering the shock joint material located on the 2<sup>nd</sup> floor mechanical room, will be removed from the Management Plan. The material currently in place is vinyl and therefore not subject for asbestos content.

Management Planner: George Wm. Ogle

Accreditation Number: 191523030

Signature

mari

Greater Clark County Schools Amendment

Greater Clark County Schools

LEA Name -

Subject - LEA Designated Person Change

Amendment -

Effective March 2005, the Designated Person for the Greater Clark County Schools is:

Alliance Environmental Group, Inc. 5340 Commerce Circle, Suite E Indianapolis, Indiana 46237 (317) 865-3400

Personnel contributing to this Management Plan are licensed in according with 40 CFR 763.93(e)(12).

Management Planner: Sandra S. Shadley

Accreditation Number: 19A002720

ad Signature

Date

Amendment

Building Name - River Valley Middle School

Subject - Addition of Homogeneous Area D

Amendment - Fire doors that were not assessed in the initial inspection. They are suspect material and are being added to the management plan until proper sampling has been completed.

Management Planner: Sandra Shadley

Accreditation Number: 19A002720

adles. anature

cember 4, 2010 Date

<u>AHERA</u>

Greater Clark County Schools

Building Name - River Valley Middle School

Subject - Addition of Homogeneous Area E

Amendment - Stage light wiring in the stage area was not noted in the initial inspection. This is suspect material and is being added to the management plan until proper sampling has been completed.

Management Planner: Sandra Shadley

Accreditation Number: 19A002720

'adley ignature

ecenber Date

Alliance Indiana, Inc.

C

**REMAINING MATERIALS** 

.

Greater Clark County Schools

C

AHERA Program

**Remaining Materials Report** 

## 4/23/2020

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
River Val	lley Middle School					
04	Mastic	Approx. 9564	SF	Assumed	Throughout building	O&M
A	Cove Base	Unquantified	LF	Assumed	Throughout the building (Light gray in locker rooms by gym)	O&M
В	Cove Base Mastic	Approx. 750	SF	Assumed	Throughout building	O&M
D	Fire Doors	Unquantified	Unit(s)	Assumed	Fire doors throughout the building	O&M
E	Stage light wiring	Unquantified	LF	Assumed	Stage	O&M
F	Orange vinyl stair trends	Unquantified	LF	Assumed	Gym Stairs	O&M
G	Stair tread mastic	Unquantified	LF	Assumed	Gym Stairs	O&M
н	Black stair tread	528	SF	Assumed	North end of building	O&M
Ι	Stair tread mastic under black tread	528	SF	Assumed	North end of building	O&M

**Remaining Materials Report** 

## 1/14/2020

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
River Val	ley Middle School					
04	Mastic	Approx. 9564	SF	Assumed	Throughout building	O&M
A	Cove Base	Unquantified	LF	Assumed	Throughout the building (Light gray in locker rooms by gym)	O&M
В	Cove Base Mastic	Approx. 750	SF	Assumed	Throughout building	O&M
D	Fire Doors	Unquantified	Unit(s)	Assumed	Fire doors throughout the building	O&M
E	Stage light wiring	Unquantified	LF	Assumed	Stage	O&M
F	Orange vinyl stair trends	Unquantified	LF	Assumed	Gym Stairs	O&M
G	Stair tread mastic	Unquantified	LF	Assumed	Gym Stairs	O&M
Н	Black stair tread	528	SF	Assumed	North end of building	O&M
I	Stair tread mastic under black tread	528	SF	Assumed	North end of building	O&M

**Remaining Materials Report** 

## 5/16/2019

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
River Vall	ey Middle School					
04	Mastic	Approx. 9564	SF	Assumed	Throughout building	0&M
A	Cove Base	Unquantified	LF	Assumed	Throughout the building (Light gray in locker rooms by gym)	0&M
В	Cove Base Mastic	Approx. 750	SF	Assumed	Throughout building	0&M
D	Fire Doors	Unquantified	Unit(s)	Assumed	Fire doors throughout the building	0&M
E	Stage light wiring	Unquantified	LF	Assumed	Stage	0&M
F	Orange vinyl stair trends	Unquantified	LF	Assumed	Gym Stairs	0&M
G	Stair tread mastic	Unquantified	LF	Assumed	Gym Stairs	0&M
Н	Black stair tread	528	SF	Assumed	North end of building	0&M
I	Stair tread mastic under black tread	528	SF	Assumed	North end of building	0&M

**Remaining Materials Report** 

## 11/13/2018

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
<u>River Val</u>	lley Middle School					
04	Mastic	Approx. 9564	SF	Assumed	Throughout building	0&M
А	Cove Base	Unquantified	LF	Assumed	Throughout the building (Light gray in locker rooms by gym)	0&M
В	Cove Base Mastic	Approx. 750	SF	Assumed	Throughout building	0&M
D	Fire Doors	Unquantified	Unit(s)	Assumed	Fire doors throughout the building	0&M
E	Stage light wiring	Unquantified	LF	Assumed	Stage	O&M
F	Orange vinyl stair trends	Unquantified	LF	Assumed	Gym Stairs	O&M
G	Stair tread mastic	Unquantified	LF	Assumed	Gym Stairs	0&M
н	Black stair tread	528	SF	Assumed	North end of building	0&M
Ι	Stair tread mastic under black tread	528	SF	Assumed	North end of building	0&M

**Remaining Materials Report** 

## 5/2/2018

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
River Val	lley Middle School					
04	Mastic	Approx. 9564	SF	Assumed	Throughout building	O&M
A	Cove Base	Unquantified	LF	Assumed	Throughout the building (Light gray in locker rooms by gym)	O&M
В	Cove Base Mastic	Approx. 750	SF	Assumed	Throughout building	O&M
D	Fire Doors	Unquantified	Unit(s)	Assumed	Fire doors throughout the building	O&M
E	Stage light wiring	Unquantified	LF	Assumed	Stage	O&M
F	Orange vinyl stair trends	Unquantified	LF	Assumed	Gym Stairs	O&M
G	Stair tread mastic	Unquantified	LF	Assumed	Gym Stairs	O&M
н	Black stair tread	528	SF	Assumed	North end of building	O&M
I	Stair tread mastic under black tread	528	SF	Assumed	North end of building	0&M

**Remaining Materials Report** 

## 10/18/2017

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
River Val	lley Middle School					
04	Mastic	Approx. 9564	SF	Assumed	Throughout building	O&M
A	Cove Base	Unquantified	LF	Assumed	Throughout the building (Light gray in locker rooms by gym)	O&M
В	Cove Base Mastic	Approx. 750	SF	Assumed	Throughout building	O&M
D	Fire Doors	Unquantified	Unit(s)	Assumed	Fire doors throughout the building	O&M
E	Stage light wiring	Unquantified	LF	Assumed	Stage	O&M
F	Orange vinyl stair trends	Unquantified	LF	Assumed	Gym Stairs	O&M
G	Stair tread mastic	Unquantified	LF	Assumed	Gym Stairs	O&M
Н	Black stair tread	528	SF	Assumed	North end of building	O&M
I	Stair tread mastic under black tread	528	SF	Assumed	North end of building	0&M

### **Remaining Materials Report**

## 4/13/2017

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
River Val	lley Middle School					
04	Mastic	Approx. 9564	SF	Assumed	Throughout building	O&M
A	Cove Base	Unquantified	LF	Assumed	Throughout the building (Light gray in locker rooms by gym)	0&M
В	Cove Base Mastic	Approx. 750	SF	Assumed	Throughout building	O&M
D	Fire Doors	Unquantified	Unit(s)	Assumed	Fire doors throughout the building	O&M
E	Stage light wiring	Unquantified	LF	Assumed	Stage	O&M
F	Orange vinyl stair trends	Unquantified	LF	Assumed	Gym Stairs	O&M
G	Stair tread mastic	Unquantified	LF	Assumed	Gym Stairs	O&M
Н	Black stair tread	528	SF	Assumed	North end of building	O&M
I	Stair tread mastic under black tread	528	SF	Assumed	North end of building	0&M

# **Remaining Materials Report**

## 11/3/2016

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
River Val	lley Middle School					
04	Mastic	Approx. 9564	SF	Assumed	Throughout building	0&M
A	Cove Base	Unquantified	LF	Assumed	Throughout the building (Light gray in locker rooms by gym)	0&M
В	Cove Base Mastic	Approx. 750	SF	Assumed	Throughout building	O&M
D	Fire Doors	Unquantified	Unit(s)	Assumed	Fire doors throughout the building	0&M
E	Stage light wiring	Unquantified	LF	Assumed	Stage	0&M
F	Orange vinyl stair trends	Unquantified	LF	Assumed	Gym Stairs	0&M
G	Stair tread mastic	Unquantified	LF	Assumed	Gym Stairs	0&M
Н	Black stair tread	528	SF	Assumed	North end of building	0&M
I	Stair tread mastic under black tread	528	SF	Assumed	North end of building	0&M

**Remaining Materials Report** 

## 4/28/2016

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
River Val	lley Middle School					
04	Mastic	Approx. 9564	SF	Assumed	Throughout building	O&M
A	Cove Base	Unquantified	LF	Assumed	Throughout the building (Light gray in locker rooms by gym)	0&M
В	Cove Base Mastic	Approx. 750	SF	Assumed	Throughout building	O&M
D	Fire Doors	Unquantified	Unit(s)	Assumed	Fire doors throughout the building	O&M
E	Stage light wiring	Unquantified	LF	Assumed	Stage	O&M
F	Orange vinyl stair trends	Unquantified	LF	Assumed	Gym Stairs	O&M
G	Stair tread mastic	Unquantified	LF	Assumed	Gym Stairs	O&M
н	Black stair tread	528	SF	Assumed	North end of building	O&M
I	Stair tread mastic under black tread	528	SF	Assumed	North end of building	O&M

**Remaining Materials Report** 

## 10/20/2015

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
River Val	lley Middle School					
04	Mastic	Approx. 9564	SF	Assumed	Throughout building	O&M
A	Cove Base	Unquantified	LF	Assumed	Throughout the building (Light gray in locker rooms by gym)	0&M
В	Cove Base Mastic	Approx. 750	SF	Assumed	Throughout building	O&M
D	Fire Doors	Unquantified	Unit(s)	Assumed	Fire doors throughout the building	O&M
E	Stage light wiring	Unquantified	LF	Assumed	Stage	O&M
F	Orange vinyl stair trends	Unquantified	LF	Assumed	Gym Stairs	O&M
G	Stair tread mastic	Unquantified	LF	Assumed	Gym Stairs	O&M
н	Black stair tread	528	SF	Assumed	North end of building	O&M
I	Stair tread mastic under black tread	528	SF	Assumed	North end of building	O&M

## Greater Clark County Schools Remaining Materials Report April 22, 2015

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>River Va</u>	alley Middle School				
04	Mastic	Approx. 9,564 SF	А	Throughout the building	O & M
A	Cove base	Unquantified LF	A	Throughout the building (Light gray locker rooms by gym)	in Remove
В	Cove base mastic	Approx. 750 SF	А	Throughout the building	O & M
D	Fire doors	Unquantified Eac	А	Fire doors throughout the building	O & M
Е	Stage light wiring	Unquantified LF	А	Stage	O & M
F	Orange vinyl stair trends	Unquantified LF	А	Gym Stairs	O & M
G	Stair tread mastic	Unquantified LF	А	Gym stairs	O & M
Н	Black stair tread	528 SF	А	North end of building	O & M
I	Stair tread mastic under black tread	528 SF	А	North end of building	O & M

## Greater Clark County Schools Remaining Materials Report October 23, 2014

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>River V</u>	alley Middle School				
04	Mastic	Approx. 9,564 SF	А	Throughout the building	O & M
A	Cove base	Unquantified LF	А	Throughout the building (Light gray locker rooms by gym)	in Remove
В	Cove base mastic	Approx. 750 SF	А	Throughout the building	O & M
D	Fire doors	Unquantified Eac	А	Fire doors throughout the building	O & M
Е	Stage light wiring	Unquantified LF	А	Stage	O & M
F	Orange vinyl stair trends	Unquantified LF	А	Gym Stairs	O & M
G	Stair tread mastic	Unquantified LF	А	Gym stairs	O & M
Н	Black stair tread	528 SF	А	North end of building	O & M
I	Stair tread mastic under black tread	528 SF	А	North end of building	O & M

## Greater Clark County Schools Remaining Materials Report April 21, 2014

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>River V</u>	alley Middle School				
04	Mastic	Approx. 9,564 SF	A	Throughout the building	O & M
A	Cove base	Unquantified LF	А	Throughout the building (Light gray locker rooms by gym)	in Remove
В	Cove base mastic	Approx. 750 SF	А	Throughout the building	O & M
D	Fire doors	Unquantified Eac	А	Fire doors throughout the building	O & M
E	Stage light wiring	Unquantified LF	А	Stage	O & M
F	Orange vinyl stair trends	Unquantified LF	А	Gym Stairs	O & M
G	Stair tread mastic	Unquantified LF	А	Gym stairs	O & M
н	Black stair tread	528 SF	А	North end of building	O & M
I	Stair tread mastic under black tread	528 SF	А	North end of building	O & M

## Greater Clark County Schools Remaining Materials Report October 24, 2013

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
Riv <u>er V</u>	alley Middle School				
04	Mastic	Approx. 9,564 SF	А	Throughout the building	O & M
٩	Cove base	Unquantified LF	Α	Throughout the building (Light gray locker rooms by gym)	in Remove
в	Cove base mastic	Approx. 750 SF	А	Throughout the building	O & M
כ	Fire doors	Unquantified Eac	А	Fire doors throughout the building	O & M
	Stage light wiring	Unquantified LF	А	Stage	O & M
=	Orange vinyl stair trends	Unquantified LF	А	Gym Stairs	O & M
3	Stair tread mastic	Unquantified LF	А	Gym stairs	O & M
1	Black stair tread	528 SF	Α	North end of building	O & M
	Stair tread mastic under black tread	528 SF	Α	North end of building	O & M

## Greater Clark County Schools Remaining Materials Report April 24, 2013

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>River V</u>	alley Middle School				
04	Mastic	Approx. 9,564 SF	А	Throughout the building	O & M
٩	Cove base	Unquantified LF	Α	Throughout the building (Light gray locker rooms by gym)	in Remove
В	Cove base mastic	Approx. 750 SF	А	Throughout the building	O & M
C	Fire doors	Unquantified Eac	А	Fire doors throughout the building	O & M
	Stage light wiring	Unquantified LF	А	Stage	O & M
-	Orange vinyl stair trends	Unquantified LF	А	Gym Stairs	O & M
3	Stair tread mastic	Unquantified LF	Α	Gym stairs	O & M
1	Black stair tread	528 SF	Α	North end of building	O & M
	Stair tread mastic under black tread	528 SF	А	North end of building	O & M

.

## Greater Clark County Schools Remaining Materials Report October 24, 2012

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>River V</u>	alley Middle School				
04	Mastic	Approx. 9,564 SF	А	Throughout the building	O & M
Α	Cove base	Unquantified LF	Α	Throughout the building (Light gray locker rooms by gym)	in Remove
В	Cove base mastic	Approx. 750 SF	Α	Throughout the building	O & M
D	Fire doors	Unquantified Eac	Α	Fire doors throughout the building	O & M
E	Stage light wiring	Unquantified LF	Α	Stage	O & M
F	Orange vinyl stair trends	Unquantified LF	А	Gym Stairs	O & M
G	Stair tread mastic	Unquantified LF	А	Gym stairs	O & M
Н	Black stair tread	528 SF	Α	North end of building	O & M
I.	Stair tread mastic under black tread	528 SF	А	North end of building	O & M

## Greater Clark County Schools Remaining Materials Report June 25, 2012

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>River V</u>	alley Middle School				
04	Mastic	Approx. 9,564 SF	A	Throughout the building	0 & M
A	Cove base	Unquantified LF	А	Throughout the building (Light gray locker rooms by gym)	in Remove
В	Cove base mastic	Approx. 750 SF	А	Throughout the building	O & M
D	Fire doors	Unquantified Eac	А	Fire doors throughout the building	0 & M
Ε	Stage light wiring	Unquantified LF	А	Stage	0 & M
=	Orange vinyl stair trends	Unquantified LF	A	Gym Stairs	0 & M
G	Stair tread mastic	Unquantified LF	A	Gym stairs	0 & M
H	Black stair tread	528 SF	A	North end of building	0 & M
	Stair tread mastic under black tread	528 SF	A	North end of building	0 & M

## Greater Clark County Schools Remaining Materials Report December 15, 2011

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>River V</u>	alley Middle School				
04	Mastic	Approx. 9,564 SF	А	Throughout the building	O & M
A	Cove base	Unquantified LF	Α	Throughout the building (Light gray locker rooms by gym)	in Remove
В	Cove base mastic	Approx. 750 SF	А	Throughout the building	O & M
D	Fire doors	Unquantified Eac	Α	Fire doors throughout the building	O & M
Ξ	Stage light wiring	Unquantified LF	А	Stage	O & M
	Orange vinyl stair trends	Unquantified LF	А	Gym Stairs	O & M
G	Stair tread mastic	Unquantified LF	Α	Gym stairs	O & M
4	Black stair tread	528 SF	А	North end of building	O & M
	Stair tread mastic under black tread	528 SF	А	North end of building	O & M

## Greater Clark County Schools Remaining Materials Report June 27, 2011

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>River V</u>	alley Middle School				
04	Mastic	Approx. 9,564 SF	А	Throughout the building	O & M
В	Cove base mastic	Approx. 750 SF	А	Throughout the building	O & M
D	Fire doors	Unquantified Eac	А	Fire doors throughout the building	O & M
E	Stage light wiring	Unquantified LF	А	Stage	O & M
F	Orange vinyl stair trends	Unquantified LF	А	Gym Stairs	O & M
G	Stair tread mastic	Unquantified LF	А	Gym stairs	O & M

# Greater Clark County Schools Remaining Materials Report December 6, 2010

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
River \	/alley Middle School				
04	Mastic	Approx. 9,564 SF	Α	Throughout the building	O & M
A	Cove base	2,200 LF	Α	Throughout the building	0 & M
В	Cove base mastic	Approx. 750 SF	А	Throughout the building	O & M
D	Fire doors	Unquantified Eac	А	Fire doors throughout the building	O & M

# Greater Clark County Schools Remaining Materials Report June 30, 2010

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>River V</u>	/alley Middle School				
04	Mastic	9,564 SF	А	Throughout the building	0 & M
A	Cove base	2,200 LF	Α	Throughout the building	O & M
B	Cove base mastic	Approx. 750 SF	А	Throughout the building	O & M
D	Fire doors	Unquantified Eac	А	Fire doors throughout the building	0 & M

### Greater Clark County Schools Remaining Materials Report December 7, 2009

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>River \</u>	/alley Middle School				
04	Mastic	9,564 SF	А	Throughout the building	O & M
A	Cove base	2,200 LF	Α	Throughout the building	O & M
В	Cove base mastic	Approx. 750 SF	А	Throughout the building	O & M

### Greater Clark County Schools Remaining Materials Report June 10, 2009

Material	Quantity	ACBM Y/A	Location	Planned Activities
/alley Middle School				
Mastic	9,564 SF	А	Throughout the building	O & M
Cove base	2,200 LF	Α	Throughout the building	O & M
Cove base mastic	Approx. 750 SF	Α	Throughout the building	O & M
	<u>/alley Middle School</u> Mastic Cove base	Valley Middle SchoolMastic9,564 SFCove base2,200 LF	<u>Valley Middle School</u> Mastic 9,564 SF A Cove base 2,200 LF A	Valley Middle School   Mastic 9,564 SF A Throughout the building   Cove base 2,200 LF A Throughout the building

## Greater Clark County Schools Remaining Materials Report December 10, 2008

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>River V</u>	alley Middle School				
04	Mastic	9,564 SF	А	Throughout the building	O & M
4	Cove base	2,200 LF	Α	Throughout the building	O & M
В	Cove base mastic	Approx. 750 SF	Α	Throughout the building	O & M

## Greater Clark County Schools Remaining Materials Report June 30, 2008

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>River \</u>	Valley Middle School				
04	Mastic	9,564 SF	А	Throughout the building	O & M
A	Cove base	2,200 LF	А	Throughout the building	O & M
В	Cove base mastic	Approx. 750 SF	Α	Throughout the building	O & M



HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>River \</u>	Valley Middle School				
04	Mastic	9,564 SF	А	Throughout the building	O & M
Α	Cove base	2,200 LF	Α	Throughout the building	O & M
В	Cove base mastic	Approx. 750 SF	Α	Throughout the building	O & M

## Greater Clark County Schools Remaining Materials Report August 1, 2007

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>River \</u>	/alley Middle School				
04	Mastic	9,564 SF	А	Throughout the building	O & M
A	Cove base	2,200 LF	Α	Throughout the building	O & M
В	Cove base mastic	Approx. 750 SF	Α	Throughout the building	O & M

# Greater Clark County Schools Remaining Materials Report July 9, 2007

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>River \</u>	Valley Middle School				
04	Mastic	9,564 SF	А	Throughout the building	O & M
Α	Cove base	2,200 LF	Α	Throughout the building	O & M
В	Cove base mastic	Approx. 750 SF	Α	Throughout the building	O & M

# Greater Clark County Schools Remaining Materials Report December 18, 2006

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>River \</u>	/alley Middle School				
04	Mastic	9,564 SF	А	Throughout the building	O & M
A	Cove base	2,200 LF	А	Throughout the building	O & M
В	Cove base mastic	Approx. 750 SF	Α	Throughout the building	O & M

# Greater Clark County Schools Remaining Materials Report June 28, 2006

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
River \	Alley Middle School				
4	Mastic	9,564 SF	А	Throughout the building	O & M
λ	Cove base	2,200 LF	Α	Throughout the building	O & M
В	Cove base mastic	Approx. 750 SF	Α	Throughout the building	0 & M

### Greater Clark County Schools Remaining Materials Report January 25, 2006

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>River \</u>	/alley Middle School				
04	Mastic	9,564 SF	Α	Throughout the building	O & M
A	Cove base	2,200 LF	Α	Throughout the building	O & M
В	Cove base mastic	Approx. 750 SF	Α	Throughout the building	O & M

### Greater Clark County Schools Remaining Materials Report July 20, 2005

HA#	Material	Quantity		АСВМ У/А	Location	Planned Activities
<u>River V</u>	alley Middle School					
04	Mastic	9,564	SF	А	Throughout the building	O & M
A	Cove base	2,200	LF	Α	Throughout the building	O & M
В	Cove base mastic	Approx. 750	SF	А	Throughout the building	O & M

### Greater Clark County Schools Remaining Materials Report December 9, 2004

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>River V</u>	alley Middle School					
04	Mastic	9,564	SF	А	Throughout the building	O & M
A	Cove base	2,200	LF	А	Throughout the building	O & M
В	Cove base mastic	Approx. 750	SF	А	Throughout the building	O & M

.

### Greater Clark County Schools Remaining Materials Report July 2, 2004

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>River V</u>	alley Middle School					
04	Mastic	9,564	SF	Α	Throughout the building	O & M
A	Cove base	2,200	LF	А	Throughout the building	O & M
В	Cove base mastic	Approx. 750	SF	Α	Throughout the building	O & M

# Greater Clark County Schools Remaining Materials Report December 9, 2003

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>River V</u>	alley Middle School					
04	Mastic	9,564	SF	А	Throughout the building	O & M
A	Cove base	2,200	LF	А	Throughout the building	O & M
В	Cove base mastic	Approx. 750	SF	А	Throughout the building	O & M

# Greater Clark County Schools Remaining Materials Report June 13, 2003

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>River V</u>	alley Middle School					
04	Mastic	9,564	SF	А	Throughout the building	O & M
A	Cove base	2,200	LF	А	Throughout the building	O & M
В	Cove base mastic	Approx. 750	SF	Α	Throughout the building	O & M
С	Shock joints	Approx. 50	SF	Α	2nd floor mechanical room	O & M

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>River V</u>	alley Middle School					
04	Mastic	9,564	SF	А	Throughout the building	O & M
A	Cove base	2,200	LF	Α	Throughout the building	O & M
В	Cove base mastic	Approx. 750	SF	Α	Throughout the building	O & M
С	Shock joints	Approx. 50	SF	Α	2nd floor mechanical room	O & M

# Greater Clark County Schools Remaining Materials Report June 19, 2002

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
River V	alley Middle School					
04	Mastic	9,564	SF	Α	Throughout the building	O & M
A	Cove base	2,200	LF	Α	Throughout the building	O & M
В	Cove base mastic	Approx. 750	SF	Α	Throughout the building	O & M
С	Shock joints	Approx. 50	SF	Α	2nd floor mechanical room	O & M

# Greater Clark County Schools Remaining Materials Report December 12, 2001

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>River V</u>	alley Middle School					
04	Mastic	9,564	SF	А	Throughout the building	O & M
A	Cove base	2,200	LF	Α	Throughout the building	O & M
В	Cove base mastic	Approx. 750	SF	Α	Throughout the building	O & M
С	Shock joints	Approx. 50	SF	Α	2nd floor mechanical room	O & M

÷.

# Greater Clark County Schools Remaining Materials Report July 12, 2001

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>River V</u>	alley Middle School					
04	Mastic	9,564	SF	А	Throughout the building	O & M
٩	Cove base	2,200	LF	А	Throughout the building	O & M
3	Cove base mastic	Approx. 750	SF	Α	Throughout the building	O & M
С	Shock joints	Approx. 50	SF	Α	2nd floor mechanical room	O & M

# Greater Clark County Schools Remaining Materials Report January 11, 2001

HA#	Material	Quantity	-	ACBM Y/A	Location	Planned Activities
<u>River V</u>	alley Middle School					
04	Mastic	9,564	SF	Α	Throughout the building	O & M
A	Cove base	2,200	LF	Α	Throughout the building	O & M
В	Cove base mastic	Арргох. 750	SF	Α	Throughout the building	O & M
С	Shock joints	Approx. 50	SF	А	2nd floor mechanical room	O & M

# Greater Clark County Schools Remaining Materials Report June 29, 2000

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>River V</u>	alley Middle School					
04	Mastic	9,564	SF	Α	Throughout the building	O & M
A	Cove Base	Unquantified	LF	Α	Throughout building	O & M
В	Cove Base Mastic	Unquantified	LF	Α	Throughout building	O & M
С	Shock Joints	Unquantified	SF	Α	2nd Floor Mechanical Room	O & M

## Greater Clark County Schools Remaining Materials Report February 23, 2000

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>River V</u>	alley Middle School				72.7 CT	
04	Mastic	9564	SF	А	Throughout the building	O & M
A	Cove Base	Unquantified	LF	А	Throughout building	O & M
в	Cove Base Mastic	Unquantified	LF	А	Throughout building	O & M
С	Shock Joints	Unquantified	SF	А	2nd Floor Mechanical Room	O & M

 $n_{\pm}$ 

12

# Greater Clark County Schools Remaining Materials Report July 6, 1999

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
River Va	alley Middle School					
04	Mastic	9564	SF	А	Throughout the building	O & M
A	Cove Base	Unquantified	LF	Α	Throughout building	O & M
В	Cove Base Mastic	Unquantified	LF	Α	Throughout building	O & M
С	Shock Joints	Unquantified	SF	А	2nd Floor Mechanical Room	O & M

Alliance Indiana, Inc.

AHERA Program

PERIODIC SURVEILLANCE REINSPECTION ADDITIONAL BULK SAMPLING INFORMATION

Greater Clark County Schools

AHERA Program

#### ASSESSMENTS FOR AHERA

- 1. Damaged or significantly damaged thermal systems insulation.
- 2. Damaged friable surfacing ACM.
- 3. Significantly damaged friable surfacing ACM.
- 4. Damaged or significantly damaged friable miscellaneous ACM.
- 5. ACBM with potential for damage.
- 6. ACBM with potential for significant damage.
- 7. Any remaining friable ACBM or friable suspected ACBM.

If a material is non-friable, it does not require an assessment rating under AHERA.

Due to the differences in what is required of the LEA for damaged material compared to significantly damaged material, Alliance has modified the assessment scale to the following:

- 1A. Significantly damaged thermal systems insulation.
- 1B. Damaged thermal systems insulation.
- 4A. Significantly damaged friable miscellaneous ACM.
- 4B. Damaged friable miscellaneous ACM.

# PERIODIC SURVEILLANCES

.

AHERA Program

# SURVEILLANCE INFORMATION PERIODIC SURVEILLANCE PLAN

# **GREATER CLARK COUNTY SCHOOLS**

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

DATE PLANNED	DATE COMPLETED	COMPLETED BY
October 2014	October 22, 2014	Binjan (Ho
<u>April 2015</u>	April 22, 2015	Binjan (Kee
October 2015	October 20, 2016	Boiyain (Kea
<u>April 2016</u>	RE-INSPECTION	Reizen (for
October 2016	November 3, 2016	D-AA-C
<u>April 2017</u>	April 13, 2017	Gane 35kan.
October 2017	October 18, 2017	D-JAC
<u>April 2018</u>	May 2, 2018	Brigan Ho
October 2018	November 13, 2018	Beijan (De
<u>April 2019</u>	<b>RE-INSPECTION</b>	562
October 2019	January 14, 2020	Mulil Les
<u>April 2020</u>	April 23, 2020	Null Les Null Les
October 2020		

# SURVEILLANCE INFORMATION

# PERIODIC SURVEILLANCE PLAN

# **GREATER CLARK COUNTY SCHOOLS**

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

<u>April 2021</u>		
October 2021		
<u>April 2022</u>	RE-INSPECTION	
October 2022		
<u>April 2023</u>		
October 2023		
<u>April 2024</u>		
October 2024		
<u>April 2025</u>	RE-INSPECTION	
October 2025		
<u>April 2026</u>		
October 2026		

#### SURVEILLANCE INFORMATION

### PERIODIC SURVEILLANCE PLAN SCHEDULE

#### **GREATER CLARK COUNTY SCHOOLS**

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

### DATE PLANNED

# DATE COMPLETED

COMPLETED BY

JUNE 2009

DECEMBER 2009

JUNE 2010

DECEMBER 2010

JUNE 2011

DECEMBER 2011

JUNE 2012

DECEMBER 2012

JUNE 2013

RE 14 JUNE 200

DECEMBER 2013

### PERIODIC SURVEILLANCE PLAN

#### **GREATER CLARK COUNTY SCHOOLS**

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by-law.-

Records of each reinspection will be maintained in this binder.

DATE PLANNED

### DATE COMPLETED

COMPLETED BY

JUNE 2003

**DECEMBER 2003** 

JUNE 2004

DECEMBER 2004

\_JUNE 2005

DECEMBER 2005

JUNE 2006

DECEMBER 2006

JUNE 2007

DECEMBER 2007

JUNE 2008

DECEMBER 2008

100-03

REINSPECTION

01

bull


06

d REINSPECTION

CApacks Apacks

ucks



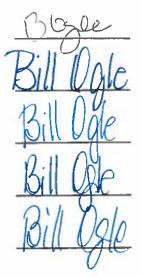

Alliance Indiana, Inc.

( )

#### PERIODIC SURVEILLANCE PLAN

#### **GREATER CLARK COUNTY SCHOOLS**

#### **RIVER VALLEY MIDDLE SCHOOL**

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long they remain in the building. This inspection will be conducted semi-annually.

The following table outlines the dates on which these inspections should take place in this school building.

#### PERIODIC SURVEILLANCE SCHEDULE

DATE PLANNED	DATE COMPLETED
DECEMBER 1995	12-95
JUNE 1996	6-96
DECEMBER 1996	12-96
JUNE 1997	7-97
DECEMBER 1997	1-98
JUNE 1998	REINSPECTION
DECEMBER 1998	12-98
JUNE 1999	June '99
DECEMBER 1999	Dec. '99
JUNE 2000	June 2000
DECEMBER 2000	Jan. '01
JUNE 2001	REINSPECTION
DECEMBER 2001	Dec '01
JUNE 2002	June '02
DECEMBER 2002	Dec: OZ

COMPLETED BY <u>Alliance</u> <u>All</u>

Greater Clark County Schools

Surveillance Schedule

# Periodic Surveillance

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	04	
HA Description	Mastic	
НА Туре	Miscellaneous Material	
HA Location	Throughout building	
Quantity	Approx. 9564 SF	
Comments	There was no mastic exposed to inspect. Old carpeting was removed and the old mastic was coated with a sealant. Ceramic wall tile in bathrooms was intact and mastic was not visible to inspect.	
Asbestos	Assumed	
Friable	No	
Original Inspection	6/1/1995	
Current Inspection	4/23/2020	

# **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

# **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact

**Vibration** 

<u>Air</u> Low/None

Low/None

Low/None

Planned Response Action 0&M

%

Mili

Inspector

Michael J. Ardis

State IN Accreditation Number 19A007304

# Periodic Surveillance

LEA Name	Greater Clark County School Corporation		
<b>Building Name</b>	River Valley Middle School		
Building Number	20		
HA ID	A		
HA Description	Cove Base		
НА Туре	Miscellaneous Material		
HA Location	Throughout the building (Light gray in locker rooms by gym)		
Quantity	Unquantified LF		
Comments	The material was removed nonfriable from the main hallway on the first floor		
	and replaced with black cove base. Most of the old cove base was removed during		
	the		
	summer of 2010. Remaining material was not in poor condition.		
Asbestos	Assumed		
Friable	No		
Original Inspection	5/31/1995		
<b>Current Inspection</b>	4/23/2020		

# **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

# **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Nil

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	В	
HA Description	Cove Base Mastic	
НА Туре	Miscellaneous Material	
HA Location	Throughout building	
Quantity	Approx. 750 SF	
Comments	This material was not visible to inspect.	
Asbestos	Assumed	
Friable	No	
<b>Original Inspection</b>	5/31/1995	
Current Inspection	4/23/2020	

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Mil.

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation
Building Name	River Valley Middle School
Building Number	20
HA ID	D
HA Description	Fire Doors
НА Туре	Miscellaneous Material
HA Location	Fire doors throughout the building
Quantity	Unquantified Unit(s)
Comments	Not assessed in original inspection. Will be added to management plan until properly sampled as they are suspect material.
Asbestos	Assumed
Friable	No
Original Inspection	6/30/2010
Current Inspection	4/23/2020

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation
Building Name	River Valley Middle School
Building Number	20
HA ID	E
HA Description	Stage light wiring
НА Туре	Miscellaneous Material
HA Location	Stage
Quantity	Unquantified LF
Comments	This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled.
Asbestos	Assumed
Friable	No
<b>Original Inspection</b>	6/27/2011
Current Inspection	4/23/2020

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation
Building Name	River Valley Middle School
Building Number	20
HA ID	F
<b>HA Description</b>	Orange vinyl stair trends
НА Туре	Miscellaneous Material
HA Location	Gym Stairs
Quantity	Unquantified LF
Comments	This material was noted during the June 2011 6 month surveillance and will
	remain in the management plan until properly sampled. This material has some chipped
	and
	cracked edges, but overall not in poor condition.
Asbestos	Assumed
Friable	No
<b>Original Inspection</b>	6/27/2011
<b>Current Inspection</b>	4/23/2020

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Nil

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation
Building Name	River Valley Middle School
Building Number	20
HA ID	G
HA Description	Stair tread mastic
НА Туре	Miscellaneous Material
HA Location	Gym Stairs
Quantity	Unquantified LF
Comments	This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled.
Asbestos	Assumed
Friable	No
Original Inspection	6/27/2011
Current Inspection	4/23/2020

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation
Building Name	River Valley Middle School
Building Number	20
HA ID	н
HA Description	Black stair tread
НА Туре	Miscellaneous Material
HA Location	North end of building
Quantity	528 SF
Comments	This material is assumed to be positive and will be treated as ACM until it is properly
	sampled. This material was not in poor condition.
Asbestos	Assumed
Friable	No
<b>Original Inspection</b>	12/15/2011
Current Inspection	4/23/2020

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation
Building Name	River Valley Middle School
Building Number	20
HA ID	I
HA Description	Stair tread mastic under black tread
НА Туре	Miscellaneous Material
HA Location	North end of building
Quantity	528 SF
Comments	This material is assumed to be positive and will be treated as ACM until it is
	properly sampled. This material was not in poor condition.
Asbestos	Assumed
Friable	No
<b>Original Inspection</b>	12/15/2011
<b>Current Inspection</b>	4/23/2020

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation
Building Name	River Valley Middle School
Building Number	20
HA ID	04
HA Description	Mastic
НА Туре	Miscellaneous Material
HA Location	Throughout building
Quantity	Approx. 9564 SF
Comments	There was no mastic exposed to inspect. Old carpeting was removed and the old mastic was coated with a sealant. Ceramic wall tile in bathrooms was intact and mastic was not visible to inspect.
Asbestos	Assumed
Friable	No
Original Inspection	6/1/1995
Current Inspection	1/14/2020

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

#### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None **Vibration** 

Low/None

<u>Air</u> Low/None

Planned Response Action O&M

%

Mili

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation
Building Name	River Valley Middle School
Building Number	20
HA ID	A
HA Description	Cove Base
НА Туре	Miscellaneous Material
HA Location	Throughout the building (Light gray in locker rooms by gym)
Quantity	Unquantified LF
Comments	The material was removed nonfriable from the main hallway on the first floor
	and replaced with black cove base. Most of the old cove base was removed during
	the
	summer of 2010. Remaining material was not in poor condition.
Asbestos	Assumed
Friable	No
<b>Original Inspection</b>	5/31/1995
<b>Current Inspection</b>	1/14/2020

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Nil

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	В	
HA Description	Cove Base Mastic	
НА Туре	Miscellaneous Material	
HA Location	Throughout building	
Quantity	Approx. 750 SF	
Comments	This material was not visible to inspect.	
Asbestos	Assumed	
Friable	No	
<b>Original Inspection</b>	5/31/1995	
<b>Current Inspection</b>	1/14/2020	

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Mile.

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation
Building Name	River Valley Middle School
Building Number	20
HA ID	D
HA Description	Fire Doors
НА Туре	Miscellaneous Material
HA Location	Fire doors throughout the building
Quantity	Unquantified Unit(s)
Comments	Not assessed in original inspection. Will be added to management plan until properly sampled as they are suspect material.
Asbestos	Assumed
Friable	No
<b>Original Inspection</b>	6/30/2010
Current Inspection	1/14/2020

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation
<b>Building Name</b>	River Valley Middle School
Building Number	20
HA ID	E
HA Description	Stage light wiring
НА Туре	Miscellaneous Material
HA Location	Stage
Quantity	Unquantified LF
Comments	This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled.
Asbestos	Assumed
Friable	No
Original Inspection	6/27/2011
Current Inspection	1/14/2020

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	F	
HA Description	Orange vinyl stair trends	
НА Туре	Miscellaneous Material	
HA Location	Gym Stairs	
Quantity	Unquantified LF	
Comments	This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled. This material has some chipped and cracked edges, but overall not in poor condition.	
Asbestos	Assumed	
Friable	No	
<b>Original Inspection</b>	6/27/2011	
<b>Current Inspection</b>	1/14/2020	

### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

**Good Condition** 

**Physical Contact** Low/None

**Vibration** Low/None

<u>Air</u> Low/None

**Planned Response Action** 

%

0&M

Nil

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation	
<b>Building Name</b>	River Valley Middle School	
Building Number	20	
HA ID	G	
HA Description	Stair tread mastic	
НА Туре	Miscellaneous Material	
HA Location	Gym Stairs	
Quantity	Unquantified LF	
Comments	This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled.	
Asbestos	Assumed	
Friable	No	
Original Inspection	6/27/2011	
<b>Current Inspection</b>	1/14/2020	

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	н		
<b>HA Description</b>	Black stair tread		
НА Туре	Miscellaneous Material		
HA Location	North end of building		
Quantity	528 SF		
Comments	This material is assumed to be positive and will be treated as ACM until it is properly		
	sampled. This material was not in poor condition.		
Asbestos	Assumed		
Friable	No		
<b>Original Inspection</b>	12/15/2011		
<b>Current Inspection</b>	1/14/2020		

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	I		
HA Description	Stair tread mastic under black tread		
НА Туре	Miscellaneous Material		
HA Location	North end of building		
Quantity	528 SF		
Comments	This material is assumed to be positive and will be treated as ACM until it is		
	properly sampled. This material was not in poor condition.		
Asbestos	Assumed		
Friable	No		
<b>Original Inspection</b>	12/15/2011		
<b>Current Inspection</b>	1/14/2020		

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	04	
HA Description	Mastic	
НА Туре	Miscellaneous Material	
HA Location	Throughout building	
Quantity	Approx. 9564 SF	
Comments	Mastic appears to be mostly removed. Flooring completely updated in 2018 on 2nd floor hallways and classroom. First floor 75% completed, some hallways and rooms not complete	
Asbestos	Assumed	
Friable	No	
Original Inspection	6/1/1995	
<b>Current Inspection</b>	11/13/2018	

#### **Material Assessment**

Assessment Rating 5 ACBM

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

% Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	A	
HA Description	Cove Base	
НА Туре	Miscellaneous Material	
HA Location	Throughout the building (Light gray in locker rooms by gym)	
Quantity	Unquantified LF	
Comments	The material was removed nonfriable from the main hallway on the first floor	
	and replaced with black cove base. Most of the old cove base was removed during	
	the	
	summer of 2010. Remaining material was not in poor condition.	
Asbestos	Assumed	
Friable	No	
Original Inspection	5/31/1995	
<b>Current Inspection</b>	11/13/2018	

## **Material Assessment**

Assessment Rating 5

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

#### State IN

Accreditation Number 19A001039

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	В	
HA Description	Cove Base Mastic	
НА Туре	Miscellaneous Material	
HA Location	Throughout building	
Quantity	Approx. 750 SF	
Comments	This material was not visible to inspect.	
Asbestos	Assumed	
Friable	No	
<b>Original Inspection</b>	5/31/1995	
<b>Current Inspection</b>	11/13/2018	

#### **Material Assessment**

Assessment Rating 5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged	%	Good Condition	
Physical Co	ontact	<u>Vibration</u>	<u>Air</u>
Low/No	one	Low/None	Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	D	
<b>HA Description</b>	Fire Doors	
НА Туре	Miscellaneous Material	
HA Location	Fire doors throughout the building	
Quantity	Unquantified Unit(s)	
Comments	Not assessed in original inspection. Will be added to management plan until properly sampled as they are suspect material.	
Asbestos	Assumed	
Friable	No	
Original Inspection	6/30/2010	
<b>Current Inspection</b>	11/13/2018	

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

% Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	E		
HA Description	Stage light wiring		
НА Туре	Miscellaneous Material		
HA Location	Stage		
Quantity	Unquantified LF		
Comments	This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled.		
Asbestos	Assumed		
Friable	Νο		
Original Inspection	6/27/2011		
<b>Current Inspection</b>	11/13/2018		

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	F	
HA Description	Orange vinyl stair trends	
НА Туре	Miscellaneous Material	
HA Location	Gym Stairs	
Quantity	Unquantified LF	
Comments	This material was noted during the June 2011 6 month surveillance and will	
	remain in the management plan until properly sampled. This material has some chipped	
	and	
	cracked edges, but overall not in poor condition.	
Asbestos	Assumed	
Friable	No	
Original Inspection	6/27/2011	
<b>Current Inspection</b>	11/13/2018	

## **Material Assessment**

Assessment Rating 5 ACBM

%

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

#### State IN

Accreditation Number 19A001039

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	G		
HA Description	Stair tread mastic		
НА Туре	Miscellaneous Material		
HA Location	Gym Stairs		
Quantity	Unquantified LF		
Comments	This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/27/2011		
Current Inspection	11/13/2018		

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
<b>Building Name</b>	River Valley Middle School		
Building Number	20		
HA ID	н		
HA Description	Black stair tread		
НА Туре	Miscellaneous Material		
HA Location	North end of building		
Quantity	528 SF		
Comments	This material is assumed to be positive and will be treated as ACM until it is properly sampled. This material was not in poor condition.		
Asbestos	Assumed		
Friable	No		
Original Inspection	12/15/2011		
Current Inspection	11/13/2018		

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	I		
HA Description	Stair tread mastic under black tread		
НА Туре	Miscellaneous Material		
HA Location	North end of building		
Quantity	528 SF		
Comments	This material is assumed to be positive and will be treated as ACM until it is properly sampled. This material was not in poor condition.		
Asbestos	Assumed		
Friable	No		
Original Inspection	12/15/2011		
Current Inspection	11/13/2018		

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
<b>Building Name</b>	River Valley Middle School		
<b>Building Number</b>	20		
HA ID	04		
HA Description	Mastic		
НА Туре	Miscellaneous Material		
HA Location	Throughout building		
Quantity	Approx. 9564	SF	
Comments	There was no mastic exposed to inspect. Old carpeting was removed and the old mastic was coated with a sealant. Ceramic wall tile in bathrooms was intact and mastic was not visible to inspect.		
Asbestos	Assumed		
Friable	No		
<b>Original Inspection</b>	6/1/1995		
<b>Current Inspection</b>	5/2/2018		

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

#### **Damage Assessment and Potential for Damage**

Low/None

Percent Damaged %

Good Condition

Physical Contact Low/None **Vibration** 

<u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	A		
HA Description	Cove Base		
НА Туре	Miscellaneous Material		
HA Location	Throughout the building (Light gray in locker rooms by gym)		
Quantity	Unquantified LF		
Comments	The material was removed nonfriable from the main hallway on the first floor		
	and replaced with black cove base. Most of the old cove base was removed during		
	the		
	summer of 2010. Remaining material was not in poor condition.		
Asbestos	Assumed		
Friable	No		
Original Inspection	5/31/1995		
<b>Current Inspection</b>	5/2/2018		

### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

#### State IN

Accreditation Number 19A001039

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	В		
HA Description	Cove Base Mastic		
НА Туре	Miscellaneous Material		
HA Location	Throughout building		
Quantity	Approx. 750 SF		
Comments	This material was not visible to inspect.		
Asbestos	Assumed		
Friable	No		
<b>Original Inspection</b>	5/31/1995		
<b>Current Inspection</b>	5/2/2018		

### **Material Assessment**

Assessment Rating 5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged	%	Good Condition	
Physical Co	<u>ontact</u>	<b>Vibration</b>	<u>Air</u>
Low/No	one	Low/None	Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	D		
HA Description	Fire Doors		
НА Туре	Miscellaneous Material		
HA Location	Fire doors throughout the building		
Quantity	Unquantified Unit(s)		
Comments	Not assessed in original inspection. Will be added to management plan until properly sampled as they are suspect material.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/30/2010		
Current Inspection	5/2/2018		

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	E		
HA Description	Stage light wiring		
НА Туре	Miscellaneous Material		
HA Location	Stage		
Quantity	Unquantified LF		
Comments	This material was noted during the June 2011 6 month surveillance and will remain in		
	the management plan until properly sampled.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/27/2011		
<b>Current Inspection</b>	5/2/2018		

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	F		
HA Description	Orange vinyl stair trends		
НА Туре	Miscellaneous Material		
HA Location	Gym Stairs		
Quantity	Unquantified LF		
Comments	This material was noted during the June 2011 6 month surveillance and will		
	remain in the management plan until properly sampled. This material has some chipped		
	and		
	cracked edges, but overall not in poor condition.		
Asbestos	Assumed		
Friable	No		
<b>Original Inspection</b>	6/27/2011		
<b>Current Inspection</b>	5/2/2018		

### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

#### State IN

Accreditation Number 19A001039

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	G		
HA Description	Stair tread mastic		
НА Туре	Miscellaneous Material		
HA Location	Gym Stairs		
Quantity	Unquantified LF		
Comments	This material was noted during the June 2011 6 month surveillance and will		
	remain in the management plan until properly sampled.		
Asbestos	Assumed		
Friable	No		
<b>Original Inspection</b>	6/27/2011		
<b>Current Inspection</b>	5/2/2018		

### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation			
<b>Building Name</b>	River Valley Middle School			
Building Number	20			
HA ID	н			
HA Description	Black stair tread			
НА Туре	Miscellaneous Material			
HA Location	North end of building			
Quantity	528 SF			
Comments	This material is assumed to be positive and will be treated as ACM until it is properly sampled. This material was not in poor condition.			
Asbestos	Assumed			
Friable	No			
<b>Original Inspection</b>	12/15/2011			
Current Inspection	5/2/2018			

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation			
Building Name	River Valley Middle School			
Building Number	20			
HA ID	1			
<b>HA Description</b>	Stair tread mastic under black tread			
НА Туре	Miscellaneous Material			
HA Location	North end of building			
Quantity	528 SF			
Comments	This material is assumed to be positive and will be treated as ACM until it is			
	properly sampled. This material was not in poor condition.			
Asbestos	Assumed			
Friable	No			
<b>Original Inspection</b>	12/15/2011			
<b>Current Inspection</b>	5/2/2018			

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation			
Building Name	River Valley Middle School	River Valley Middle School		
Building Number	20			
HA ID	04			
HA Description	Mastic			
НА Туре	Miscellaneous Material			
HA Location	Throughout building			
Quantity	Approx. 9564 S	5F		
Comments	•	o inspect. Old carpeting was removed and the old of. Ceramic wall tile in bathrooms was intact and		
Asbestos	Assumed			
Friable	No			
<b>Original Inspection</b>	6/1/1995			
<b>Current Inspection</b>	10/18/2017			
Material Assessment				

**Assessment Rating** 5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Low/None

Percent Damaged %

Good Condition

Physical Contact Low/None

**Vibration** 

<u>Air</u> Low/None

Planned Response Action 0&M

ŀ

Inspector

**Dustin Hawkins** 

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	A		
HA Description	Cove Base		
НА Туре	Miscellaneous Material		
HA Location	Throughout the building (Light gray in locker rooms by gym)		
Quantity	Unquantified LF		
Comments	The material was removed nonfriable from the main hallway on the first floor		
	and replaced with black cove base. Most of the old cove base was removed during		
	the		
	summer of 2010. Remaining material was not in poor condition.		
Asbestos	Assumed		
Friable	No		
<b>Original Inspection</b>	5/31/1995		
<b>Current Inspection</b>	10/18/2017		

### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

ŀ.

Inspector

**Dustin Hawkins** 

#### State IN

Accreditation Number 19A007194

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	В		
HA Description	Cove Base Mastic		
НА Туре	Miscellaneous Material		
HA Location	Throughout building		
Quantity	Approx. 750 SF		
Comments	This material was not visible to inspect.		
Asbestos	Assumed		
Friable	No		
<b>Original Inspection</b>	5/31/1995		
<b>Current Inspection</b>	10/18/2017		

### **Material Assessment**

Assessment Rating 5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged	%	Good Condition	
Physical Co	<u>ontact</u>	<u>Vibration</u>	Air
Low/No	one	Low/None	Low/None

Planned Response Action 0&M

X-C

Inspector

**Dustin Hawkins** 

LEA Name	Greater Clark County School Corporation		
<b>Building Name</b>	River Valley Middle School		
<b>Building Number</b>	20		
HA ID	D		
HA Description	Fire Doors		
НА Туре	Miscellaneous Material		
HA Location	Fire doors throughout the building		
Quantity	Unquantified Unit(s)		
Comments	Not assessed in original inspection. Will be added to management plan until properly sampled as they are suspect material.		
Asbestos	Assumed		
Friable	No		
<b>Original Inspection</b>	6/30/2010		
Current Inspection	10/18/2017		

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

**Dustin Hawkins** 

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	E		
HA Description	Stage light wiring		
НА Туре	Miscellaneous Material		
HA Location	Stage		
Quantity	Unquantified LF		
Comments	This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/27/2011		
Current Inspection	10/18/2017		

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Dustin Hawkins

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	F		
HA Description	Orange vinyl stair trends		
НА Туре	Miscellaneous Material		
HA Location	Gym Stairs		
Quantity	Unquantified LF		
Comments	This material was noted during the June 2011 6 month surveillance and will		
	remain in the management plan until properly sampled. This material has some chipped		
	and		
	cracked edges, but overall not in poor condition.		
Asbestos	Assumed		
Friable	No		
<b>Original Inspection</b>	6/27/2011		
<b>Current Inspection</b>	10/18/2017		

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

ŀ.

Inspector

**Dustin Hawkins** 

#### State IN

Accreditation Number 19A007194

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	G		
HA Description	Stair tread mastic		
НА Туре	Miscellaneous Material		
HA Location	Gym Stairs		
Quantity	Unquantified LF		
Comments	This material was noted during the June 2011 6 month surveillance and will remain in		
	the management plan until properly sampled.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/27/2011		
Current Inspection	10/18/2017		

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

**Dustin Hawkins** 

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	н		
<b>HA Description</b>	Black stair tread		
НА Туре	Miscellaneous Material		
HA Location	North end of building		
Quantity	528 SF		
Comments	This material is assumed to be positive and will be treated as ACM until it is		
	properly sampled. This material was not in poor condition.		
Asbestos	Assumed		
Friable	No		
Original Inspection	12/15/2011		
<b>Current Inspection</b>	10/18/2017		

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

**Dustin Hawkins** 

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	I		
HA Description	Stair tread mastic under black tread		
НА Туре	Miscellaneous Material		
HA Location	North end of building		
Quantity	528 SF		
Comments	This material is assumed to be positive and will be treated as ACM until it is		
	properly sampled. This material was not in poor condition.		
Asbestos	Assumed		
Friable	No		
Original Inspection	12/15/2011		
<b>Current Inspection</b>	10/18/2017		

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

**Dustin Hawkins** 

LEA Name	Greater Clark County School Corporation			
<b>Building Name</b>	River Valley Middle School			
Building Number	20			
HA ID	04			
HA Description	Mastic			
НА Туре	Miscellaneous	Material		
HA Location	Throughout bu	uilding		
Quantity	Approx. 9564		SF	
Comments	There was no mastic exposed to inspect. Old carpeting was removed and the old mastic was coated with a sealant. Ceramic wall tile in bathrooms was intact and mastic was not visible to inspect.			
Asbestos	Assumed			
Friable	No			
<b>Original Inspection</b>	6/1/1995			
<b>Current Inspection</b>	4/13/2017			
		Material A	Assessm	<u>ent</u>
Assessment Rating 5 ACBM with potential for damage				
Da	amage Asse	essment a	nd Poter	ntial for Damage
Percent Damag	<u>ed</u> %	Good Condit	ion	
<u>Phy</u>	sical Contact	<u>Vib</u>	<u>ration</u>	Air
Low/None Low/None Low/None		Low/None		
Planned Response Action O&M				
Inspector	Janie d			
	lamie H	locior		

Jamie Hosier

LEA Name	Greater Clark County School Corporation		
<b>Building Name</b>	River Valley Middle School		
Building Number	20		
HA ID	A		
HA Description	Cove Base		
НА Туре	Miscellaneous Material		
HA Location	Throughout the building (Light gray in locker rooms by gym)		
Quantity	Unquantified LF		
Comments	The material was removed nonfriable from the main hallway on the first floor		
	and replaced with black cove base. Most of the old cove base was removed during		
	the		
	summer of 2010. Remaining material was not in poor condition.		
Asbestos	Assumed		
Friable	No		
<b>Original Inspection</b>	5/31/1995		
<b>Current Inspection</b>	4/13/2017		

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Janie Attain

Inspector

Jamie Hosier

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	В		
HA Description	Cove Base Mastic		
НА Туре	Miscellaneous Material		
HA Location	Throughout building		
Quantity	Approx. 750 SF		
Comments	This material was not visible to inspect.		
Asbestos	Assumed		
Friable	No		
<b>Original Inspection</b>	5/31/1995		
<b>Current Inspection</b>	4/13/2017		

### **Material Assessment**

Assessment Rating 5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged	%	Good Condition	
Physical Co	ontact	<u>Vibration</u>	<u>Air</u>
Low/No	one	Low/None	Low/None

Planned Response Action 0&M

Janie Attain

Inspector

Jamie Hosier

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	D		
HA Description	Fire Doors		
НА Туре	Miscellaneous Material		
HA Location	Fire doors throughout the building		
Quantity	Unquantified Unit(s)		
Comments	Not assessed in original inspection. Will be added to management plan until properly sampled as they are suspect material.		
Asbestos	Assumed		
Friable	No		
<b>Original Inspection</b>	6/30/2010		
<b>Current Inspection</b>	4/13/2017		

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged %

Physical Contact

Good Condition

hysical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Janie Attain

Inspector

Jamie Hosier

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	E		
HA Description	Stage light wiring		
НА Туре	Miscellaneous Material		
HA Location	Stage		
Quantity	Unquantified LF		
Comments	This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled.		
Asbestos	Assumed		
Friable	No		
<b>Original Inspection</b>	6/27/2011		
Current Inspection	4/13/2017		

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

**Good Condition** 

Percent Damaged %

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Janie Attain

Inspector

Jamie Hosier

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	F		
HA Description	Orange vinyl stair trends		
НА Туре	Miscellaneous Material		
HA Location	Gym Stairs		
Quantity	Unquantified LF		
Comments	This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled. This material has some chippe		
	and cracked edges, but overall not in poor condition.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/27/2011		
<b>Current Inspection</b>	4/13/2017		

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Janie Attain

Inspector

Jamie Hosier

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	G		
HA Description	Stair tread mastic		
НА Туре	Miscellaneous Material		
HA Location	Gym Stairs		
Quantity	Unquantified LF		
Comments	This material was noted during the June 2011 6 month surveillance and w		
	remain in the management plan until properly sampled.		
Asbestos	Assumed		
Friable	No		
<b>Original Inspection</b>	6/27/2011		
<b>Current Inspection</b>	4/13/2017		

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

**Good Condition** 

Percent Damaged %

Physical Contact

Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Janie Attain

Inspector

Jamie Hosier

LEA Name	Greater Clark County School Corporation	
<b>Building Name</b>	River Valley Middle School	
Building Number	20	
HA ID	н	
HA Description	Black stair tread	
НА Туре	Miscellaneous Material	
HA Location	North end of building	
Quantity	528 SF	
Comments	This material is assumed to be positive and will be treated as ACM until it is properly sampled. This material was not in poor condition.	
Asbestos	Assumed	
Friable	No	
Original Inspection	12/15/2011	
Current Inspection	4/13/2017	

#### **Material Assessment**

Assessment Rating 5 ACBM

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

**Good Condition** 

Percent Damaged %

Contact

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Janie Attain

Inspector

Jamie Hosier

LEA Name	Greater Clark County School Corporation	
<b>Building Name</b>	River Valley Middle School	
Building Number	20	
HA ID	I	
HA Description	Stair tread mastic under black tread	
НА Туре	Miscellaneous Material	
HA Location	North end of building	
Quantity	528 SF	
Comments	This material is assumed to be positive and will be treated as ACM until it is properly	
	sampled. This material was not in poor condition.	
Asbestos	Assumed	
Friable	No	
Original Inspection	12/15/2011	
<b>Current Inspection</b>	4/13/2017	

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

**Percent Damaged** %

Physical Contact

**Good Condition** 

Low/None

**Vibration** Low/None

Air Low/None

Planned Response Action 0&M

Janie Attain

Inspector

Jamie Hosier

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	G		
HA Description	Stair tread mastic		
НА Туре	Miscellaneous Material		
HA Location	Gym Stairs		
Quantity	Unquantified LF		
Comments	This material was noted during the June 2011 6 month surveillance and will remain in		
	the management plan until properly sampled.		
Asbestos	Assumed		
Friable	Νο		
<b>Original Inspection</b>	6/27/2011		
Current Inspection	11/3/2016		

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

**Dustin Hawkins** 

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	н		
HA Description	Black stair tread		
НА Туре	Miscellaneous Material		
HA Location	North end of building		
Quantity	528 SF		
Comments	This material is assumed to be positive and will be treated as ACM until it is properly sampled. This material was not in poor condition.		
Asbestos	Assumed		
Friable	No		
Original Inspection	12/15/2011		
<b>Current Inspection</b>	11/3/2016		

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

**Dustin Hawkins** 

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	I		
HA Description	Stair tread mastic under black tread		
НА Туре	Miscellaneous Material		
HA Location	North end of building		
Quantity	528 SF		
Comments	This material is assumed to be positive and will be treated as ACM until it is properly sampled. This material was not in poor condition.		
Asbestos	Assumed		
Friable	Νο		
Original Inspection	12/15/2011		
Current Inspection	11/3/2016		

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

**Dustin Hawkins** 

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	04		
HA Description	Mastic		
НА Туре	Miscellaneous Material		
HA Location	Throughout building		
Quantity	Approx. 9564	SF	
Comments	There was no mastic exposed to inspect. Old carpeting was removed and the old mastic was coated with a sealant. Ceramic wall tile in bathrooms was intact and mastic was not visible to inspect.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/1/1995		
<b>Current Inspection</b>	11/3/2016		

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged %

Good Condition

Physical Contact

Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

ŀ

Inspector

Dustin Hawkins

LEA Name	Greater Clark County School Corporation
Building Name	River Valley Middle School
Building Number	20
HA ID	A
HA Description	Cove Base
НА Туре	Miscellaneous Material
HA Location	Throughout the building (Light gray in locker rooms by gym)
Quantity	Unquantified LF
Comments	The material was removed nonfriable from the main hallway on the first floor
	and replaced with black cove base. Most of the old cove base was removed during
	the
	summer of 2010. Remaining material was not in poor condition.
Asbestos	Assumed
Friable	No
<b>Original Inspection</b>	5/31/1995
<b>Current Inspection</b>	11/3/2016

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

ŀ.

Inspector

**Dustin Hawkins** 

#### State IN

Accreditation Number 19A007194

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	В	
HA Description	Cove Base Mastic	
НА Туре	Miscellaneous Material	
HA Location	Throughout building	
Quantity	Approx. 750 SF	
Comments	This material was not visible to inspect.	
Asbestos	Assumed	
Friable	No	
<b>Original Inspection</b>	5/31/1995	
<b>Current Inspection</b>	11/3/2016	

## **Material Assessment**

Assessment Rating 5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged	%	Good Condition	
Physical Co	ontact	<u>Vibration</u>	Air
Low/No	one	Low/None	Low/None

Planned Response Action 0&M

X-C

Inspector

**Dustin Hawkins** 

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	D	
HA Description	Fire Doors	
НА Туре	Miscellaneous Material	
HA Location	Fire doors throughout the building	
Quantity	Unquantified Unit(s)	
Comments	Not assessed in original inspection. Will be added to management plan until properly	
	sampled as they are suspect material.	
Asbestos	Assumed	
Friable	No	
Original Inspection	6/30/2010	
Current Inspection	11/3/2016	

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Dustin Hawkins

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	E	
HA Description	Stage light wiring	
НА Туре	Miscellaneous Material	
HA Location	Stage	
Quantity	Unquantified LF	
Comments	This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled.	
Asbestos	Assumed	
Friable	No	
<b>Original Inspection</b>	6/27/2011	
Current Inspection	11/3/2016	

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

**Dustin Hawkins** 

LEA Name	Greater Clark County School Corporation
Building Name	River Valley Middle School
Building Number	20
HA ID	F
HA Description	Orange vinyl stair trends
НА Туре	Miscellaneous Material
HA Location	Gym Stairs
Quantity	Unquantified LF
Comments	This material was noted during the June 2011 6 month surveillance and will
	remain in the management plan until properly sampled. This material has some chipped
	and
	cracked edges, but overall not in poor condition.
Asbestos	Assumed
Friable	No
<b>Original Inspection</b>	6/27/2011
<b>Current Inspection</b>	11/3/2016

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

ŀ.

Inspector

**Dustin Hawkins** 

#### State IN

Accreditation Number 19A007194

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	04	
HA Description	Mastic	
НА Туре	Miscellaneous Material	
HA Location	Throughout building	
Quantity	Approx. 9564 SF	
Comments	There was no mastic exposed to inspect. Old carpeting was removed and the old mastic was coated with a sealant. Ceramic wall tile in bathrooms was intact and mastic was not visible to inspect.	
Asbestos	Assumed	
Friable	No	
<b>Original Inspection</b>	6/1/1995	
<b>Current Inspection</b>	10/20/2015	
Material Assessment		

Assessment Rating 5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Low/None

Percent Damaged %

Good Condition

Physical Contact Low/None **Vibration** 

<u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation
<b>Building Name</b>	River Valley Middle School
Building Number	20
HA ID	A
HA Description	Cove Base
НА Туре	Miscellaneous Material
HA Location	Throughout the building (Light gray in locker rooms by gym)
Quantity	Unquantified LF
Comments	The material was removed nonfriable from the main hallway on the first floor
	and replaced with black cove base. Most of the old cove base was removed during
	the
	summer of 2010. Remaining material was not in poor condition.
Asbestos	Assumed
Friable	No
Original Inspection	5/31/1995
<b>Current Inspection</b>	10/20/2015

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

#### State IN

Accreditation Number 19A001039

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	В		
HA Description	Cove Base Mastic		
НА Туре	Miscellaneous Material		
HA Location	Throughout building		
Quantity	Approx. 750 SF		
Comments	This material was not visible to inspect.		
Asbestos	Assumed		
Friable	No		
<b>Original Inspection</b>	5/31/1995		
Current Inspection	10/20/2015		

### **Material Assessment**

Assessment Rating 5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged	%	Good Condition	
Physical Co	ontact	<u>Vibration</u>	<u>Air</u>
Low/No	one	Low/None	Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	D	
HA Description	Fire Doors	
НА Туре	Miscellaneous Material	
HA Location	Fire doors throughout the building	
Quantity	Unquantified Unit(s)	
Comments	Not assessed in original inspection. Will be added to management plan until properly sampled as they are suspect material.	
Asbestos	Assumed	
Friable	No	
<b>Original Inspection</b>	6/30/2010	
Current Inspection	10/20/2015	

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
<b>Building Name</b>	River Valley Middle School		
<b>Building Number</b>	20		
HA ID	E		
HA Description	Stage light wiring		
НА Туре	Miscellaneous Material		
HA Location	Stage		
Quantity	Unquantified LF		
Comments	This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled.		
Asbestos	Assumed		
Friable	Νο		
<b>Original Inspection</b>	6/27/2011		
Current Inspection	10/20/2015		

### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
<b>Building Name</b>	River Valley Middle School		
Building Number	20		
HA ID	F		
HA Description	Orange vinyl stair trends		
НА Туре	Miscellaneous Material		
HA Location	Gym Stairs		
Quantity	Unquantified LF		
Comments	This material was noted during the June 2011 6 month surveillance and will		
	remain in the management plan until properly sampled. This material has some chipped		
	and		
	cracked edges, but overall not in poor condition.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/27/2011		
<b>Current Inspection</b>	10/20/2015		

## **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

#### State IN

Accreditation Number 19A001039

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	G		
HA Description	Stair tread mastic		
НА Туре	Miscellaneous Material		
HA Location	Gym Stairs		
Quantity	Unquantified LF		
Comments	This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled.		
Asbestos	Assumed		
Friable	Νο		
<b>Original Inspection</b>	6/27/2011		
<b>Current Inspection</b>	10/20/2015		

### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
<b>Building Name</b>	River Valley Middle School		
Building Number	20		
HA ID	н		
HA Description	Black stair tread		
НА Туре	Miscellaneous Material		
HA Location	North end of building		
Quantity	528 SF		
Comments	This material is assumed to be positive and will be treated as ACM until it is properly sampled. This material was not in poor condition.		
Asbestos	Assumed		
Friable	No		
Original Inspection	12/15/2011		
Current Inspection	10/20/2015		

### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
<b>Building Name</b>	River Valley Middle School		
Building Number	20		
HA ID	I		
HA Description	Stair tread mastic under black tread		
НА Туре	Miscellaneous Material		
HA Location	North end of building		
Quantity	528 SF		
Comments	This material is assumed to be positive and will be treated as ACM until it is		
	properly sampled. This material was not in poor condition.		
Asbestos	Assumed		
Friable	No		
Original Inspection	12/15/2011		
<b>Current Inspection</b>	10/20/2015		

### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

## **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County Schools		
Building Name	River Valley Middle School		
HA#	04		
Type of Material	Miscellaneous Material		
Quantity of Material	Approx. 9,564 SF		
Material Location			
Throughout the b	uilding		
Material Description			
Mastic			
Comments			
	stic exposed to inspect. Old carpeting was removed and the old d with a sealant. Ceramic wall tile in bathrooms was intact and mastic inspect.		
Does Material Contain Asbe	estos? Assumed		
Is it Friable?	No		
Original Inspection Date	6/1/1995		
Current Surveillance Date	4/22/2015		
Current Assessment Rating	NR Not Rated		
Cause of Damage	No Damage		
Accessible	No		
Potential for Damage	Low		
Removed	No		
Planned Response Action	O&M Benjanin Acco		
Inspector			
	Benjamin S. Hood		

·

State Accreditation Number

LEA Name	Greater Clark County Sc	hools
Building Name	River Valley Middle Scho	ool
HA#	A	
Type of Material	Miscellaneous Material	
Quantity of Material	Unquantified LF	
Material Location		
Throughout the bu	ilding (Light gray in locke	r rooms by gym)
Material Description		
Cove base		
Comments		
replaced with blac		the main hallway on the first floor and old cove base was removed during the not in poor condition.
Does Material Contain Asbes	tos? Assumed	
Is it Friable?	No	
Original Inspection Date	5/31/1995	
Current Surveillance Date	4/22/2015	
Current Assessment Rating	NR	Not Rated
Cause of Damage	No Damage	
Accessible	Yes	
Potential for Damage	Low	
Removed	Yes	
Planned Response Action	Remove	Benjamin Alto
Inspector		

Benjamin S. Hood

State Accreditation Number

LEA Name	Greater Clark County Schools			
Building Name	River Valley Middle School			
HA#	В			
Type of Material	Miscellaneous Material			
Quantity of Material	Approx. 750 SF			
Material Location				
Throughout the bu	ilding			
Material Description				
Cove base mastic				
Comments				
This material was not visible to inspect.				
Does Material Contain Asbestos?		ssumed		
Is it Friable?	Ν	lo		
Original Inspection Date	5/	/31/1995		
Current Surveillance Date	4,	/22/2015		
Current Assessment Rating	Ν	IR	Not Rated	
Cause of Damage	Ν	lo Damage		
Accessible	Ν	lo		
Potential for Damage	Le	.OW		
Removed	Ν	lo		
Planned Response Action	C	) & M	Benjamin	Has

Inspector

Benjamin S. Hood

State Accreditation Number

LEA Name	Greater Clark County Schools		
Building Name	River Valley Middle School		
HA#	D		
Type of Material	Miscellaneous Material		
Quantity of Material	Unquantified	l Each	
Material Location			
Fire doors through	out the buildi	ng	
Material Description			
Fire doors			
Comments			
Not assessed in o sampled as they a			added to management plan until properly
Does Material Contain Asbes	stos? A	ssumed	
Is it Friable?	Ν	lo	
Original Inspection Date	6	6/30/2010	
Current Surveillance Date	4	/22/2015	
Current Assessment Rating	Ν	IR	Not Rated
Cause of Damage			
Accessible	Y	′es	
Potential for Damage	L	.OW	
Removed	Ν	10	
Planned Response Action	C	D & M	Benjamin Acco
Inspector	_		
			Benjamin S. Hood

State	
Accreditation Number	

LEA Name	Greater Clark County Schools			
Building Name	River Valley Middle School			
HA#	E			
Type of Material	Miscellaneous Material			
Quantity of Material	Unquantified LF			
Material Location				
Stage				
Material Description				
Stage light wiring				
Comments				
	noted during the June 2011 6 month surveillance and will remain in blan until properly sampled.			
Does Material Contain Asbes	stos? Assumed			
Is it Friable?	No			
Original Inspection Date	6/27/2011			
Current Surveillance Date	4/22/2015			
Current Assessment Rating	NA Not Applicable			
Cause of Damage	No Damage			
Accessible	Yes			
Potential for Damage	Low			
Removed	No			
Planned Response Action	O&M Benjamin Acco			
Inspector				
	Benjamin S. Hood			

State
Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	F
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Gym Stairs	

#### **Material Description**

Orange vinyl stair trends

#### Comments

This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled. This material has some chipped and cracked edges, but overall not in poor condition.

Does Material Contain Asbestos?	Assume	d
Is it Friable?	No	
Original Inspection Date	6/27/201	1
Current Surveillance Date	4/22/201	5
Current Assessment Rating	NR	Not Rated
Cause of Damage	Deteriora	aton & Physical Damage
Accessible	Yes	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	Benjanin Acco

Inspector

Benjamin S. Hood

State	
Accreditation Number	

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	G
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Gym stairs	
Material Description	
Stair tread mastic	
Comments	
	noted during the June 2011 6 month surveillance and will remain in lan until properly sampled.
Does Material Contain Asbes	tos? Assumed
Is it Friable?	No
Original Inspection Date	6/27/2011
Current Surveillance Date	4/22/2015
Current Assessment Rating	NA Not Applicable
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O&M Benjani Hoo
Inspector	
	Benjamin S. Hood

State
Accreditation Number

	Orester Clark County Cohesels				
LEA Name	Greater Clark County Schools				
Building Name	River Valley Middle School				
HA#	Н				
Type of Material	Miscellaneous Material				
Quantity of Material	528 SF				
Material Location					
North end of build	ing				
Material Description					
Black stair tread					
Comments					
	sumed to be positive and will be treated as ACM until it is properly terial was not in poor condition.				
Does Material Contain Asbes	stos? Assumed				
Is it Friable?	No				
Original Inspection Date	12/15/2011				
Current Surveillance Date	4/22/2015				
<b>Current Assessment Rating</b>	NR Not Rated				
Cause of Damage	No Damage				
Accessible	Yes				
Potential for Damage	Low				
Removed	No				
Planned Response Action	O&M Benjamin Hoe				
Inspector					
	Benjamin S. Hood				

State	
Accreditation Number	

LEA Name	Greater Clark County Schools			
Building Name	River Valley Middle School			
HA#	I			
Type of Material	Miscellaneous Material			
Quantity of Material	528 SF			
Material Location				
North end of build	ing			
Material Description				
Stair tread mastic	under black tread			
Comments				
	sumed to be positive and will be treated as ACM until it is properly terial was not in poor condition.			
Does Material Contain Asbes	stos? Assumed			
Is it Friable?	No			
Original Inspection Date	12/15/2011			
Current Surveillance Date	4/22/2015			
Current Assessment Rating	NR Not Rated			
Cause of Damage	No Damage			
Accessible	Yes			
Potential for Damage	Low			
Removed	No			
Planned Response Action	O&M Benjani Hos			

Inspector

Benjamin S. Hood

State	
Accreditation	Number

LEA Name	Greater Clark County Schools				
Building Name	River Valley Middle School				
HA#	04				
Type of Material	Miscellaneous Material				
Quantity of Material	Approx. 9,564 SF				
Material Location					
Throughout the bu	uilding				
Material Description					
Mastic					
Comments					
	stic exposed to inspect. Old carpeting was removed and the old d with a sealant. Ceramic wall tile in bathrooms was intact and mastic inspect.				
Does Material Contain Asbe	stos? Assumed				
Is it Friable?	No				
Original Inspection Date	6/1/1995				
Current Surveillance Date	10/23/2014				
<b>Current Assessment Rating</b>	NR Not Rated				
Cause of Damage	No Damage				
Accessible	No				
Potential for Damage	Low				
Removed	No				
Planned Response Action	O&M Denjamen Mile				
Inspector	Benjamin S. Hood				

State Accreditation Number

LEA Name	Greater Cla	ark County Schoo	ols		
Building Name	River Valle	y Middle School			
HA#	A				
Type of Material	Miscellaneo	ous Material			
Quantity of Material	Unquantifie	ed LF			
Material Location					
Throughout the bu	uilding (Light	t gray in locker ro	ooms by gym)		
Material Description					
Cove base					
Comments					
	k cove base	e. Most of the old	main hallway on the first floor and cove base was removed during the in poor condition.		
Does Material Contain Asbes	stos?	Assumed			
Is it Friable?		No			
Original Inspection Date		5/31/1995			
Current Surveillance Date		10/23/2014			
<b>Current Assessment Rating</b>		NR	Not Rated		
Cause of Damage		No Damage			
Accessible		Yes			
Potential for Damage		Low			
Removed		Yes	D		
Planned Response Action		Remove	Benjamen Na		
Inspector					
			Benjamin S. Hood		

State Accreditation Number

LEA Name	Greater Cla	ark County Schools		
Building Name	River Valley Middle School			
HA#	В			
Type of Material	Miscellaneo	ous Material		
Quantity of Material	Approx. 750	50 SF		
Material Location				
Throughout the bu	uilding			
Material Description				
Cove base mastic				
Comments				
This material was	not visible to	to inspect.		
Does Material Contain Asbe	stos?	Assumed		
Is it Friable?		No		
Original Inspection Date		5/31/1995		
Current Surveillance Date		10/23/2014		
<b>Current Assessment Rating</b>		NR Not Rated		
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage		Low		
Removed		No Dan		
Planned Response Action		O&M Benjamen Alex		

Inspector

Benjamin S. Hood

State Accreditation Number

LEA Name	Greater Clark County Schools				
Building Name	River Valley Middle School				
HA#	D				
Type of Material	Miscellane	ous Materia	al		
Quantity of Material	Unquantifie	ed Each			
Material Location					
Fire doors through	nout the buil	ding			
Material Description					
Fire doors					
Comments					
Not assessed in o sampled as they a			be addec	to managem	ent plan until properly
<b>Does Material Contain Asbe</b>	stos?	Assumed			
Is it Friable?		No			
Original Inspection Date		6/30/2010			
Current Surveillance Date		10/23/201	4		
<b>Current Assessment Rating</b>		NR	Ν	lot Rated	
Cause of Damage					
Accessible		Yes			
Potential for Damage		LOW	$\bigcirc$		()
Removed		No	' K	· · ·	A-785
Planned Response Action		O & M	13	enjann	
Inspector					
Inspector			B	enjamin S. Ho	od
State		Indiana			

Accreditation Number

		<b>-</b> · · ·
LEA Name	Greater Clark County	
Building Name	River Valley Middle S	chool
HA#	E	
Type of Material	Miscellaneous Materia	al
Quantity of Material	Unquantified LF	
Material Location		
Stage		
Material Description		
Stage light wiring		
Comments		
	noted during the June blan until properly sam	2011 6 month surveillance and will remain in pled.
<b>Does Material Contain Asbe</b>	stos? Assumed	
Is it Friable?	No	
Original Inspection Date	6/27/2011	
Current Surveillance Date	10/23/201	4
<b>Current Assessment Rating</b>	NA	Not Applicable
Cause of Damage	No Damag	je
Accessible	Yes	
Potential for Damage	Low	
Removed	No	D Dag
Planned Response Action	O & M	Benjamen Nee
Inspector		
		Benjamin S. Hood

State	
Accreditation Number	

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	F
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Gym Stairs	

#### **Material Description**

Orange vinyl stair trends

#### Comments

This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled. This material has some chipped and cracked edges, but overall not in poor condition.

Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	6/27/2011	
Current Surveillance Date	10/23/2014	
Current Assessment Rating	NR	Not Rated
Cause of Damage	Deterioraton	a & Physical Damage
Accessible	Yes	
Potential for Damage	Low	
Removed	No	D
Planned Response Action	O & M	Benjamen Alex

Inspector

Benjamin S. Hood

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	G
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Gym stairs	
Material Description	
Stair tread mastic	
Comments	
	noted during the June 2011 6 month surveillance and will remain in plan until properly sampled.
Does Material Contain Asbe	stos? Assumed
Is it Friable?	No
Original Inspection Date	6/27/2011
Current Surveillance Date	10/23/2014
<b>Current Assessment Rating</b>	NA Not Applicable
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O&M Benjamen Alex
Inspector	
	Benjamin S. Hood

State	
Accreditation Number	

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	Н
Type of Material	Miscellaneous Material
Quantity of Material	528 SF
Material Location	
North end of build	ing
Material Description	
Black stair tread	
Comments	
	sumed to be positive and will be treated as ACM until it is properly terial was not in poor condition.
Does Material Contain Asbes	stos? Assumed
Is it Friable?	No
Original Inspection Date	12/15/2011
Current Surveillance Date	10/23/2014
Current Assessment Rating	NR Not Rated
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	0 & M Denjamen Ma
Inspector	
	Benjamin S. Hood

Accreditation	Number

State

until it is properly

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	I
Type of Material	Miscellaneous Material
Quantity of Material	528 SF
Material Location	
North end of build	ing
Material Description	
Stair tread mastic	under black tread
Comments	
	sumed to be positive and will be treated as ACM terial was not in poor condition.
Does Material Contain Asbes	stos? Assumed
Is it Friable?	No
Original Inspection Date	12/15/2011
Current Surveillance Date	10/23/2014
Current Assessment Rating	NR Not Rated
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	0&M Denjamen
	v

Inspector

State	
Accreditation Number	

Indiana 19A001039 Benjamin S. Hood

LEA Name	Greater Clark C	ounty Schoo	bls
Building Name	River Valley Mid	dle School	
HA#	04		
Type of Material	Miscellaneous M	laterial	
Quantity of Material	Approx. 9,564 S	F	
Material Location			
Throughout the b	uilding		
Material Description			
Mastic			
Comments			
	d with a sealant.		carpeting was removed and the old Il tile in bathrooms was intact and mastic
Does Material Contain Asbe	stos? Assu	med	
Is it Friable?	No		
Original Inspection Date	6/1/1	995	
Current Surveillance Date	4/21/	/2014	
Current Assessment Rating	NR		Not Rated
Cause of Damage	No E	)amage	
Accessible	No		
Potential for Damage	Low		
Removed	No		
Planned Response Action	O &	M	MAB
Inspector		(	$\left( \right) $

Inspector

Jeffrey P. Rechtin

State **Accreditation Number** 

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	A
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Throughout the t	building (Light gray in locker rooms by gym)
Material Description	
Cove base	
Comments	
replaced with bla	s removed nonfriable from the main hallway on the first floor and ack cove base. Most of the old cove base was removed during the . Remaining material was not in poor condition.
Does Material Contain Asb	estos? Assumed
Is it Friable?	No
Original Inspection Date	5/31/1995
Current Surveillance Date	4/21/2014
Current Assessment Rating	g NR Not Rated
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	Yes
Planned Response Action	Remove
Inspector	ABD

Jeffrey P. Rechtin

State **Accreditation Number** 

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	В
Type of Material	Miscellaneous Material
Quantity of Material	Approx. 750 SF
Material Location	
Throughout the bu	ilding
Material Description	
Cove base mastic	
Comments	
This material was	not visible to inspect.
Does Material Contain Asbes	stos? Assumed
Is it Friable?	No
Original Inspection Date	5/31/1995
Current Surveillance Date	4/21/2014
Current Assessment Rating	NR Not Rated
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	0 & M
	ala D

Inspector

410

Jeffrey P. Rechtin

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	D
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified Each
Material Location	
Fire doors through	nout the building
Material Description	
Fire doors	
Comments	
	riginal inspection. Will be added to management plan until properly are suspect material.
Does Material Contain Asbes	stos? Assumed
Is it Friable?	No
Original Inspection Date	6/30/2010
Current Surveillance Date	4/21/2014
Current Assessment Rating	NR Not Rated
Cause of Damage	
Accessible	Yes
Potential for Damage	LOW
Removed	No
Planned Response Action	O&M
F	Jeffrey P. Rechtin

State

Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	E
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Stage	
Material Description	
Stage light wiring	
Comments	
	noted during the June 2011 6 month surveillance and will remain in plan until properly sampled.
Does Material Contain Asbes	tos? Assumed
Is it Friable?	No
Original Inspection Date	6/27/2011
Current Surveillance Date	4/21/2014
Current Assessment Rating	NA Not Applicable
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
Inspector	AND

Jeffrey P. Rechtin

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	F
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Gym Stairs	

#### **Material Description**

Orange vinyl stair trends

#### Comments

This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled. This material has some chipped and cracked edges, but overall not in poor condition.

Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	6/27/2011
Current Surveillance Date	4/21/2014
Current Assessment Rating	NR Not Rated
Cause of Damage	Deterioraton & Physical Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O&M
	CARD
Inspector	(10)

Inspector

Jeffrey P. Rechtin

State **Accreditation Number** 

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	G
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Gym stairs	
Material Description	
Stair tread mastic	
Comments	
	noted during the June 2011 6 month surveillance and will remain in blan until properly sampled.
Does Material Contain Asbes	stos? Assumed
Is it Friable?	No
Original Inspection Date	6/27/2011
Current Surveillance Date	4/21/2014
Current Assessment Rating	NA Not Applicable
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	0 & M
Inspector	ABD

Jeffrey P. Rechtin

State Accreditation Number

LEA Name	Greater Clark C	County Schools	8
Building Name	River Valley Mi	iddle School	
HA#	н		
Type of Material	Miscellaneous	Material	
Quantity of Material	528 SF		
Material Location			
North end of build	ing		
Material Description			
Black stair tread			
Comments			
This material is as sampled. This ma			be treated as ACM until it is properly
Does Material Contain Asbes	stos? Ass	sumed	
Is it Friable?	No		
Original Inspection Date	12/*	15/2011	
Current Surveillance Date	4/21	1/2014	
<b>Current Assessment Rating</b>	NR		Not Rated
Cause of Damage	No	Damage	
Accessible	Yes	6	
Potential for Damage	Low	V	
Removed	No		
Planned Response Action	O &	кM	
Inspector		C	AND

Inspector

Jeffrey P. Rechtin

State Accreditation Number

LEA Name	Greater Cla	ark County Schools	5
Building Name	River Valley Middle School		
HA#	I		
Type of Material	Miscellane	ous Material	
Quantity of Material	528 SF		
Material Location			
North end of build	ing		
Material Description			
Stair tread mastic	under black	tread	
Comments			
This material is as sampled. This ma		•	be treated as ACM until it is properly n.
Does Material Contain Asbes	stos?	Assumed	
Is it Friable?		No	
Original Inspection Date		12/15/2011	
Current Surveillance Date		4/21/2014	
Current Assessment Rating		NR	Not Rated
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage		Low	
Removed		No	

AB

Inspector

Jeffrey P. Rechtin

State Accreditation Number

Planned Response Action

Indiana 19A003594

0 & M

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	04
Type of Material	Miscellaneous Material
Quantity of Material	Approx. 9,564 SF
Material Location	
Throughout the b	building
Material Description	
Mastic	
Comments	
There was no ma mastic was coate was not visible to	astic exposed to inspect. Old carpeting was removed and the old ed with a sealant. Ceramic wall tile in bathrooms was intact and mastic o inspect.
Does Material Contain Asb	estos? Assumed
Is it Friable?	No
<b>Original Inspection Date</b>	6/1/1995
Current Surveillance Date	10/24/2013
Current Assessment Rating	NR Not Rated
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
Inspector	Jeffrey P. Rechtin

State Accreditation Number

 $\sum$ 

\_\_\_\_\_

 $\frac{1}{2}$ 

Indiana 19A003594

----

	LEA Name	Greater Cla	rk County School	s
	Building Name	<b>River Valley</b>	Middle School	
	HA#	A		
	Type of Material	Miscellaneo	us Material	
	Quantity of Material	Unquantified	dLF	
	Material Location	•		
	Throughout the bi	uilding (Light	gray in locker roo	oms by gym)
	Material Description			
	Cove base			
	Comments			
	The material was replaced with blac summer of 2010.	k cove base.	Most of the old	nain hallway on the first floor and cove base was removed during the n poor condition.
	Does Material Contain Asbe	stos? /	Assumed	
	Is it Friable?	l	No	
	Original Inspection Date	(	5/31/1995	
	Current Surveillance Date		10/24/2013	
	Current Assessment Rating	I	NR	Not Rated
ì	Cause of Damage	I	No Damage	
	Accessible	۲	Yes	
	Potential for Damage	1	Low	
	Removed	`	Yes	
	Planned Response Action	l	Remove	
	Inspector			Ap-B-
		-		Leffrey D. Deehtin

Jeffrey P. Rechtin

State Accreditation Number

1

ì

	LEA Name	Greater C	lark County Schoo	bls	
}	Building Name	River Valle	ey Middle School		
	HA#	В			
	Type of Material	Miscellane	ous Material		
	Quantity of Material	Approx. 75	50 SF		
	Material Location Throughout the bu Material Description	uilding			
	Cove base mastic				
	Cove base masue	•			
	This material was	not visible	to inspect.		
	Does Material Contain Asbe		Assumed		
	Is it Friable?	•••••	No		
	Original Inspection Date		5/31/1995		
	Current Surveillance Date		10/24/2013		
	Current Assessment Rating		NR	Not Rated	
	Cause of Damage		No Damage		
	Accessible		No		
1	Potential for Damage		Low		
	Removed		No		
	Planned Response Action		O & M		
	•			- The Part	•

Inspector

AP-1)

----

Jeffrey P. Rechtin

State

Accreditation Number

			1 -
LEA Name		Clark County School	
Building Name	River Vall	ley Middle Schoo	l
HA#	D		
Type of Material	Miscellan	eous Material	
Quantity of Material	Unquantil	lied Each	
Material Location			
Fire doors throug	hout the bu	uilding	
Material Description			
Fire doors			
Comments			
Not assessed in sampled as they	original insp are suspec	pection. Will be a transferred to a transferred to a construction of the second s	added to management plan until properly
Does Material Contain Asb	estos?	Assumed	
Is it Friable?		No	
<b>Original Inspection Date</b>		6/30/2010	
Current Surveillance Date		10/24/2013	
Current Assessment Rating	9	NR	Not Rated
Cause of Damage			
Accessible		Yes	
Potential for Damage		LOW	
Removed		No	
Planned Response Action		O & M	
			Ap-13-
Inspector			

Jeffrey P. Rechtin

State Accreditation Number

÷

~

- --- 1

;

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	E
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location Stage	
Material Description	
Stage light wiring	
Comments	
This material wa the managemen	s noted during the June 2011 6 month surveillance and will remain in plan until properly sampled.
Does Material Contain Asb	estos? Assumed
Is it Friable?	No
<b>Original Inspection Date</b>	6/27/2011
Current Surveillance Date	10/24/2013
Current Assessment Ratin	NA Not Applicable
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
	710-53

Inspector

7

Jeffrey P. Rechtin

State **Accreditation Number** 

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	F
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Gym Stairs	
Material Description	

Orange vinyl stair trends

#### Comments

This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled. This material has some chipped and cracked edges, but overall not in poor condition.

Does Material Contain Asbestos?	Assumed	
ls it Friable?	No	
Original Inspection Date	6/27/2011	
Current Surveillance Date	10/24/2013	
Current Assessment Rating	NR	Not Rated
Cause of Damage	Deteriorator	n & Physical Damage
Accessible	Yes	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	-
		-71, FS

Inspector

C(3, 1)-

Jeffrey P. Rechtin

State Accreditation Number

	LEA Name	Greater Cl	ark County School	İs
<b>Building Name</b> River Valley Middle S			y Middle School	
	HA#	G		
	Type of Material	Miscellane	ous Material	
	Quantity of Material	Unquantifi	ed LF	
	Material Location			
	Gym stairs			
	Material Description			
	Stair tread mastic			
	Comments			
	This material was the management			o month surveillance and will remain in
	Does Material Contain Asbe	stos?	Assumed	
	Is it Friable?		No	
	<b>Original Inspection Date</b>		6/27/2011	
	Current Surveillance Date		10/24/2013	
	<b>Current Assessment Rating</b>		NA	Not Applicable
~	Cause of Damage		No Damage	
	Accessible		No	
	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		O & M	

Inspector

.....

Jeffrey P. Rechtin

State Accreditation Number

	LEA Name	Greater Cl	ark County Schoo	ols	
	Building Name	<b>River Valle</b>	y Middle School		
	HA#	н			
	Type of Material	Miscellane	ous Material		
	Quantity of Material	528 SF			
	Material Location North end of build Material Description	ing			
	Black stair tread				
	Comments				
	This material is as sampled. This ma	ssumed to b terial was n	e positive and wil ot in poor conditio	l be treated as on.	ACM until it is properly
	Does Material Contain Asbe	stos?	Assumed		
	Is it Friable?		No		
	<b>Original Inspection Date</b>		12/15/2011		
	Current Surveillance Date		10/24/2013		
	Current Assessment Rating		NR	Not Rated	
`	Cause of Damage		No Damage		
	Accessible		Yes		
	Potential for Damage		Low		
	Removed		No		
	Planned Response Action		O & M		
					72

Inspector

.

ا س

Jeffrey P. Rechtin

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
-	
HA#	l
Type of Material	Miscellaneous Material
Quantity of Material	528 SF
Material Location	
North end of build	ing
Material Description	
Stair tread mastic	under black tread
Comments	
This material is as sampled. This ma	sumed to be positive and will be treated as ACM until it is properly terial was not in poor condition.
Does Material Contain Asbe	stos? Assumed
Is it Friable?	No
<b>Original Inspection Date</b>	12/15/2011
Current Surveillance Date	10/24/2013
Current Assessment Rating	NR Not Rated
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	0 & M
	CAPA-ED-

Inspector

- -

--`\

 $\overline{)}$ 

 $\mathcal{C}$ 

Jeffrey P. Rechtin

State **Accreditation Number** 

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	04
Type of Material	Miscellaneous Material
Quantity of Material	Approx. 9,564 SF
Material Location	
Throughout the bu	ilding
Material Description	
Mastic	
Comments	
There was no mas mastic was coated was not visible to i	tic exposed to inspect. Old carpeting was removed and the old with a sealant. Ceramic wall tile in bathrooms was intact and mastic nspect.
Does Material Contain Asbes	tos? Assumed
Is it Friable?	No
Original Inspection Date	6/1/1995
Current Surveillance Date	10/24/2012
Current Assessment Rating	NR Not Rated
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
Inspector	CARD D-

Jeffrey P. Rechtin

State Accreditation Number

(

C

LEA Name	Greater C	lark County Sch	ools
Building Name	River Valle	ey Middle Schoo	bl
HA#	A		
Type of Material	Miscellane	eous Material	
Quantity of Material	Unquantifi	ed LF	
Material Location			
Throughout the bi	uilding (Ligh	nt gray in locker	rooms by gym)
Material Description			
Cove base			
Comments			
replaced with blac	k cove base	e. Most of the c	e main hallway on the first floor and old cove base was removed during the ot in poor condition.
Does Material Contain Asbe		Assumed	•
Is it Friable?		No	
Original Inspection Date		5/31/1995	
Current Surveillance Date		10/24/2012	
<b>Current Assessment Rating</b>		NR	Not Rated
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage		Low	
Removed		Yes	
Planned Response Action		Remove	a set and a set of the
			CAM D

Inspector

6-710-

Jeffrey P. Rechtin

State **Accreditation Number** 

LEA Name	Greater Cla	ark County Schoo	ls	
Building Name	River Valle	y Middle School		
HA#	В			
Type of Material	Miscellaneo	ous Material		
Quantity of Material	Approx. 75	0 SF		
Material Location				
Throughout the b	uilding			
Material Description				
Cove base mastic	;			
Comments				
This material was	not visible to	o inspect.		
Does Material Contain Asbe	stos?	Assumed		
ls it Friable?		No		
Original Inspection Date		5/31/1995		
Current Surveillance Date		10/24/2012		
Current Assessment Rating		NR	Not Rated	
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage	]	Low		
Removed	i	No		
Planned Response Action	(	O & M		2.2
			2719	1,2
Inspector			-7777	

Inspector

State **Accreditation Number** 

Indiana 19A003594 Jeffrey P. Rechtin

LEA Name	Greater Clar	rk County Schoo	ls
Building Name	<b>River Valley</b>	Middle School	
HA#	D		
Type of Material	Miscellaneou	us Material	
Quantity of Material	Unquantified	l Each	
Material Location			
Fire doors throug	hout the buildi	ing	
Material Description			
Fire doors			
Comments			
Not assessed in a sampled as they	original inspect are suspect ma	tion. Will be add aterial.	ded to management plan until properly
Does Material Contain Asbe	stos? A	ssumed	
Is it Friable?	Ν	10	
<b>Original Inspection Date</b>	6/	/30/2010	
Current Surveillance Date	10	0/24/2012	
Current Assessment Rating	Ν	IR	Not Rated
Cause of Damage			
Accessible	Y	′es	
Potential for Damage	L	ow	
Removed	N	lo	
Planned Response Action	0	0 & M	
Inspector			CAPA FOR-
			Jeffrey P. Rechtin

State Accreditation Number

LEA Name	Greater Clark County Se	chools
Building Name	River Valley Middle Sch	ool
HA#	E	
Type of Material	Miscellaneous Material	
Quantity of Material	Unquantified LF	
Material Location Stage		
Material Description		
Stage light wiring		
Comments		
	noted during the June 20 plan until properly sample	11 6 month surveillance and will remain in ed.
Does Material Contain Asbe	stos? Assumed	
Is it Friable?	No	
<b>Original Inspection Date</b>	6/27/2011	
Current Surveillance Date	10/24/2012	
Current Assessment Rating	NA	Not Applicable
Cause of Damage	No Damage	
Accessible	Yes	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	
		CAA D

Inspector

-770-

Jeffrey P. Rechtin

State **Accreditation Number** 

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	F
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Gym Stairs	
Material Description	
Orange vinyl stair	trends
Comments	
the management	noted during the June 2011 6 month surveillance and will remain in plan until properly sampled. This material has some chipped and ut overall not in poor condition.
Does Material Contain Asbe	stos? Assumed
Is it Friable?	No
<b>Original Inspection Date</b>	6/27/2011
Current Surveillance Date	10/24/2012
Current Assessment Rating	NR Not Rated
Cause of Damage	Deterioraton & Physical Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
	The Tyme

Inspector

Castrone 11

Jeffrey P. Rechtin

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	G
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Gym stairs	
Material Description	
Stair tread mastic	
Comments	
This material was the management	noted during the June 2011 6 month surveillance and will remain plan until properly sampled.
Does Material Contain Asbe	stos? Assumed
Is it Friable?	No
<b>Original Inspection Date</b>	6/27/2011
Current Surveillance Date	10/24/2012
Current Assessment Rating	NA Not Applicable
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
	CAR TO

Inspector

Jeffrey P. Rechtin

in

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	н
Type of Material	Miscellaneous Material
Quantity of Material	528 SF
Material Location	
North end of build	ing
Material Description	
Black stair tread	
Comments	
This material is as sampled. This ma	sumed to be positive and will be treated as ACM until it is properly terial was not in poor condition.
Does Material Contain Asbe	
Is it Friable?	No
<b>Original Inspection Date</b>	12/15/2011
Current Surveillance Date	10/24/2012
Current Assessment Rating	NR Not Rated
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
	- HA-TY

Inspector

23

1/

Jeffrey P. Rechtin

State Accreditation Number

LEA Name	Greater C	Clark County Sch	ools
Building Name	River Val	ley Middle Schoo	)
HA#	I.		
Type of Material	Miscellan	eous Material	
Quantity of Material	528 SF		
Material Location			
North end of	f building		
Material Description			
Stair tread n	nastic under blad	ck tread	
Comments			
This materia sampled. Th	I is assumed to is material was	be positive and w not in poor condit	vill be treated as ACM until it is properly tion.
<b>Does Material Contain</b>	Asbestos?	Assumed	
Is it Friable?		No	
Original Inspection Da	te	12/15/2011	
Current Surveillance D	ate	10/24/2012	
Current Assessment R	lating	NR	Not Rated
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage		Low	
Removed		No	
Planned Response Act	lion	O & M	
Inspector			CAAD-

Jeffrey P. Rechtin

State Accreditation Number

LEA Name Greater Clark County Schools	
Building Name	River Valley Middle School
HA#	04
Type of Material	Miscellaneous Material
Quantity of Material	Approx. 9,564 SF
Material Location	
Throughout the bu	ilding
Material Description	-
Mastic	
Comments	
There was no mas mastic was coated was not visible to ir	tic exposed to inspect. Old carpeting was removed and the old with a sealant. Ceramic wall tile in bathrooms was intact and mastic nspect.
<b>Does Material Contain Asbes</b>	tos? Assumed
Is it Friable?	No

Does Material Contain Asbestos?	Assumed
ls it Friable?	No
Original Inspection Date	6/1/1995
Current Surveillance Date	6/25/2012
Current Assessment Rating	NR Not Rated
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
	Mand

Inspector

Jeffery P. Rechtin

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	A
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Throughout the b	uilding (Light gray in locker rooms by gym)
Material Description	· · · · · · · · · · · · · · · · · · ·

Cove base

#### Comments

The material was removed nonfriable from the main hallway on the first floor and replaced with black cove base. Most of the old cove base was removed during the summer of 2010. Remaining material was not in poor condition. . . . .

Does Material Contain Asbestos?	Assumed	
ls it Friable?	No	
Original Inspection Date	5/31/1995	
Current Surveillance Date	6/25/2012	
Current Assessment Rating	NR	Not Rated
Cause of Damage	No Damage	
Accessible	Yes	
Potential for Damage	Low	
Removed	Yes	
Planned Response Action	Remove	2
Inspector		Jeffery P. Rechtin

State

**Accreditation Number** 

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	В
Type of Material	Miscellaneous Material
Quantity of Material	Approx. 750 SF
Material Location	
Throughout the b	uilding
Material Description	
Cove base mastic	
Comments	
This material was	not visible to inspect.
Does Material Contain Asbe	
ls it Friable?	No
<b>Original Inspection Date</b>	5/31/1995
Current Surveillance Date	6/25/2012
Current Assessment Rating	NR Not Rated
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
Inspector	Jeffery D. Rechtin

State **Accreditation Number** 

LEA Name	Greater C	ark County Sch	ools
Building Name	River Valle	ey Middle Schoo	bl
HA#	D		
Type of Material	Miscellane	eous Material	
Quantity of Material	Unquantifi	ied Each	
Material Location Fire doors through	nout the bui	ildina	
Material Description			
Fire doors			
Comments			
Not assessed in original inspection. Will be added to management plan until properly sampled as they are suspect material.			
Does Material Contain Asbes	stos?	Assumed	
Is it Friable?		No	
<b>Original Inspection Date</b>		6/30/2010	
Current Surveillance Date		6/25/2012	
<b>Current Assessment Rating</b>		NR	Not Rated
Cause of Damage			
Accessible		Yes	
Potential for Damage		LOW	
Removed		No	
Planned Response Action		O & M	
Inspector			Jeffery P/Rechtin
State		Indiana	

**Accreditation Number** 

19A003594

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	E
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Stage	
Material Description	
Stage light wiring	
Comments	

This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled.

Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	6/27/2011	
Current Surveillance Date	6/25/2012	
Current Assessment Rating	NA	Not Applicable
Cause of Damage	No Damage	
Accessible	Yes	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	7
		11115

Inspector

Jeffery P. Rechtin

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	F
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Gym Stairs	

**Material Description** 

Orange vinyl stair trends

#### Comments

This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled. This material has some chipped and cracked edges, but overall not in poor condition.

Does Material Contain Asbestos?	Assumed		
ls it Friable?	No		
Original Inspection Date	6/27/2011		
Current Surveillance Date	6/25/2012		
Current Assessment Rating	NR	Not Rated	
Cause of Damage	Deterioraton & Physical Damage		
Accessible	Yes		
Potential for Damage	Low		
Removed	No		
Planned Response Action	O & M		

Inspector

Jeffery P Rechtin

State

Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	G
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Gym stairs	
Material Description	
Stair tread mastic	

#### Comments

This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled.

<b>Does Material Contain Asbestos?</b>	Assumed	
Is it Friable?	No	
Original Inspection Date	6/27/2011	
Current Surveillance Date	6/25/2012	
Current Assessment Rating	NA	Not Applicable
Cause of Damage	No Damage	
Accessible	No	
Potential for Damage	Low	
Removed	No	
Planned Response Action	0 & M	1. 11
Inspector		Jeffery P. Rechtin

State **Accreditation Number** 

is properly

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	н
Type of Material	Miscellaneous Material
Quantity of Material	528 SF
Material Location	
North end of build	ing
Material Description	-
Black stair tread	
Comments	
This material is as sampled. This ma	sumed to be positive and will be treated as ACM until it terial was not in poor condition.
Does Material Contain Asbe	
Is it Friable?	No
<b>Original Inspection Date</b>	12/15/2011
Current Surveillance Date	6/25/2012
Current Assessment Rating	NR Not Rated
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	0 & M
Inspector	
(P	Jeffer P. Rechtin

State

**Accreditation Number** 

LEA Name	Greater Clark County Schools	
Building Name	River Valley Middle School	
HA#	1	
Type of Material	Miscellaneous Material	
Quantity of Material	528 SF	
Material Location		
North end of building		

### **Material Description**

Stair tread mastic under black tread

### Comments

This material is assumed to be positive and will be treated as ACM until it is properly sampled. This material was not in poor condition.

Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	12/15/2011	
Current Surveillance Date	6/25/2012	
Current Assessment Rating	NR	Not Rated
Cause of Damage	No Damage	
Accessible	Yes	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	
		NIIP Z

Inspector

Jeffery P. Rechtin

State Accreditation Number

LEA Name	Greater C	lark County Scho	ols	
Building Name	<b>River Vall</b>	ey Middle School		A F
HA#	н			3 3
Type of Material	Miscellane	eous Material		7-7 9-4
Quantity of Material	528 SF			J Z Z Z
Material Location				F B & B F
North end of build	ling			3 ] & +
Material Description				22-055
Black stair tread				mat & o i
Comments				SAR P/
This material is as sampled. This ma				- ASIA
<b>Does Material Contain Asbe</b>	stos?	Assumed		
Is it Friable?		No		
<b>Original Inspection Date</b>		12/15/2011		
Current Surveillance Date		12/15/2011		
Current Assessment Rating		NR	Not F	lequired
Cause of Damage		No Damage		
Accessible		Yes		
Potential for Damage		Low		
Removed		No		
Planned Response Action		O & M		
Inspector		Dan	<u>de</u> Sanc	a Shaaley

State Accreditation Number

 $\bigcirc$ 

C

LEA Name	Greater C	lark County Scho	pols
Building Name	River Valle	ey Middle School	
HA#	I		
Type of Material	Miscellane	eous Material	
Quantity of Material	528 SF		
Material Location	ine		
North end of build Material Description	ing		
Stair tread mastic	under blac	k tread	
Comments			
This material is as sampled. This ma			ill be treated as ACM until it is properly ion.
Does Material Contain Asbe	stos?	Assumed	
Is it Friable?		No	
<b>Original Inspection Date</b>		12/15/2011	
Current Surveillance Date		12/15/2011	
<b>Current Assessment Rating</b>		NR	Not Required
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage		Low	
Removed		No	
Planned Response Action		O & M	
Inspector		$A \sim$	ol. Ihaald
INSPECTOR		1 Z 1 Z W AA	

Inspector

Shaa a м <u>OX</u> 0 Sandra Shadley

State Accreditation Number

	LEA Name	Greater C	lark County Sch	ools		
	Building Name	<b>River Valle</b>	ey Middle Schoo	bl		
	HA#	04	04			
	Type of Material	Miscellane	eous Material			
	Quantity of Material	Approx. 9,	564 SF			
	Material Location					
	Throughout the b	uilding				
	Material Description					
	Mastic					
	Comments					
		d with a sea		d carpeting was removed and the old wall tile in bathrooms was intact and mastic		
	Does Material Contain Asbe	stos?	Assumed			
	Is it Friable?		No			
	<b>Original Inspection Date</b>		6/1/1995			
	Current Surveillance Date		12/15/2011			
	<b>Current Assessment Rating</b>		NR	Not Required		
	Cause of Damage		No Damage			
	Accessible		No			
$\bigcirc$	Potential for Damage		Low			
$\sim$	Removed		No			
	Planned Response Action		O & M			
	Inspector	$\langle$	San	Sandra Shadley		
	State		Indiana			
	Accreditation Number		19A002323			

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	A
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Throughout the bu	uilding (Light gray in locker rooms by gym)
Material Description	
Cove base	
Comments	
The material was	removed nonfriable from the main hallway

way on the first floor and replaced with black cove base. Most of the old cove base was removed during the summer of 2010. Remaining material was not in poor condition.

Does Material Contain Asbestos?	Assumed	
ls it Friable?	No	
Original Inspection Date	5/31/1995	
Current Surveillance Date	12/15/2011	
Current Assessment Rating	NR	Not Required
Cause of Damage	No Damage	
Accessible	Yes	
Potential for Damage	Low	
Removed	Yes	
Planned Response Action	Remove	
	1	

Sandra Shadley Jand

Inspector

......

State **Accreditation Number** 

LEA Name	Greater	Clark County Sch	nools		
Building Name	River Va	River Valley Middle School			
HA#	В				
Type of Material	Miscella	neous Material			
Quantity of Material	Approx.	750 SF			
Material Location Throughout the Material Description	e building				
Cove base ma	stic				
This material w	as not visibl	le to inspect.			
Does Material Contain As		Assumed			
Is it Friable?		No			
<b>Original Inspection Date</b>		5/31/1995			
Current Surveillance Dat	e	12/15/2011			
Current Assessment Rat	ing	NR	Not Re	equired	
Cause of Damage		No Damage			
Accessible		No			
Potential for Damage		Low			
Removed		No			
Planned Response Actio	n	O & M			
		l	1	LA	100

Inspector

C

Us. and la Sandra Shadley

State **Accreditation Number** 

	LEA Name	Greater Cl	lark County S	Schools	
	Building Name	<b>River Valle</b>	ey Middle Sch	hool	
$\mathbf{C}$	HA#	D			
	Type of Material	Miscellane	eous Material	t in the second s	
	Quantity of Material	Unquantifi	ed Each		
	Material Location				
	Fire doors throug	hout the bui	ilding		
	Material Description				
	Fire doors				
	Comments				
	Not assessed in c sampled as they a			be added to management plan until properly	
	Does Material Contain Asbe	stos?	Assumed		
	Is it Friable?		No		
	<b>Original Inspection Date</b>		6/30/2010		
	Current Surveillance Date		12/15/2011		
	<b>Current Assessment Rating</b>		NR	Not Required	
	Cause of Damage				
	Accessible		Yes		
	Potential for Damage		LOW		
$\cup$	Removed		No		
	Planned Response Action		O & M		
	Inspector		Sa	Sandra Shadley	

State **Accreditation Number** 

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	E
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Stage	
Material Description	
Stage light wiring	
Comments	
	noted during the June 2011 6 month surveillance and will remain in plan until properly sampled.
Does Material Contain Asbe	estos? Assumed
Is it Friable?	No
<b>Original Inspection Date</b>	6/27/2011
Current Surveillance Date	12/15/2011
Current Assessment Rating	NA Not Applicable
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
Inspector	Sanala Shadly

Sandra Shadley

Y

State Accreditation Number

C

2

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	F
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Gym Stairs	

**Material Description** 

Orange vinyl stair trends

### Comments

This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled. This material has some chipped and cracked edges, but overall not in poor condition.

<b>Does Material Contain Asbestos?</b>	Assumed
Is it Friable?	No
Original Inspection Date	6/27/2011
Current Surveillance Date	12/15/2011
Current Assessment Rating	NR Not Required
Cause of Damage	Deterioraton & Physical Contact
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
Inspector	Sandra Madle.

Sandra Shadley

•

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	G
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Gym stairs	
Material Description	
Stair tread mastic	
Comments	
This material was the management	noted during the June 2011 6 month surveillance and will remain in plan until properly sampled.
Does Material Contain Asbe	stos? Assumed
Is it Friable?	No
<b>Original Inspection Date</b>	6/27/2011
Current Surveillance Date	12/15/2011
Current Assessment Rating	NA Not Applicable
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
	$-\lambda$ $(100)$

Inspector

C

-

Jead Den øu Ĺ

Sandra Shadley

State Accreditation Number

LEA Name	Greater C	lark County Sch	ools
Building Name	<b>River Vall</b>	ey Middle Schoo	bl
HA#	04		
Type of Material	Miscellane	eous Material	
Quantity of Material	Approx. 9	,564 SF	
Material Location			
Throughout the bi	uilding		
Material Description			
Mastic			
Comments			
There was no ma mastic was coated was not visible to	d with a sea	d to inspect. Ol alant. Ceramic v	d carpeting was removed and the old wall tile in bathrooms was intact and mastic
Does Material Contain Asbe	stos?	Assumed	
Is it Friable?		No	
<b>Original Inspection Date</b>		6/1/1995	
Current Surveillance Date		6/27/2011	
<b>Current Assessment Rating</b>		NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action		O & M	
		1	

Inspector

Sandra Shadly Sandra Shadley

State **Accreditation Number** 

LEA Name	Greater Clark County	Schools		
Building Name	River Valley Middle So			
HA#	A			
Type of Material	Miscellaneous Materia	al		
Quantity of Material	0 L.F			
Material Location				
Throughout the b	uilding			
Material Description				
Cove base				
Comments				
replaced with blac	removed nonfriable fro k cove base. Overall, moved during the sumr plan.	this material was	not in poor co	ndition. All old
<b>Does Material Contain Asbe</b>	stos? Assumed			
Is it Friable?	No			
Original Inspection Date	5/31/1995			
Current Surveillance Date	6/27/2011			
<b>Current Assessment Rating</b>	NR	Not Req	uired	
Cause of Damage	No Damag	e		
Accessible	Yes			
Potential for Damage	Low			
Removed	Yes			
Planned Response Action	Remove			
	X	0	0 0	0.0

Inspector

Sandra Shadley ande 5

State **Accreditation Number** 

LEA Name	Greater C	lark County Scho	pols
Building Name	River Vall	ley Middle School	l
HA#	В		
Type of Material	Miscellan	eous Material	
Quantity of Material	Approx. 7	'50 SF	
Material Location			
Throughout the t	building		
Material Description			
Cove base masti	С		
Comments			
This material was	s not visible	to inspect.	
Does Material Contain Asb	estos?	Assumed	
ls it Friable?		No	
<b>Original Inspection Date</b>		5/31/1995	
Current Surveillance Date		6/27/2011	
Current Assessment Rating	g	NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action		O & M	
		-la	lea thadlo

Inspector

hadry. Ż 7 X Sandra Shadley

State **Accreditation Number** 

LEA Name	Greater Clark County Schools			
Building Name	River Valley Middle School			
HA#	D			
Type of Material	Miscellaneous Material			
Quantity of Material	Unquantified Each			
Material Location				
Fire doors through	nout the building			
Material Description				
Fire doors				
Comments				
Not assessed in original inspection. Will be added to management plan until proper sampled as they are suspect material.				
Does Material Contain Asbe	stos? Assumed			
ls it Friable?	No			
<b>Original Inspection Date</b>	6/30/2010			
Current Surveillance Date	6/27/2011			
Current Assessment Rating	NR Not Required			
Cause of Damage				
Accessible	Yes			
Potential for Damage	LOW			
Removed	No			
Planned Response Action	0 & M			
Inspector	Sandia Shadley			

Sandra Shadley

State **Accreditation Number** 

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	E
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location Stage Material Description	
Stage light wiring	
Comments	
	noted during the June 2011 6 month surveillance and will remain in plan until properly sampled.
Does Material Contain Asbe	stos? Assumed
Is it Friable?	No
Original Inspection Date	6/27/2011
Current Surveillance Date	6/27/2011
<b>Current Assessment Rating</b>	NA Not Applicable
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Inspector

Sandra Shadley Jan Ole

State **Accreditation Number** 

LEA Name	Greater Clark County Sc		
Building Name	River Valley Middle Scho	ol	
HA#	F		
Type of Material	Miscellaneous Material		
Quantity of Material	Unquantified LF		
Material Location Gym Stairs			
Material Description			
Orange vinyl stai	ir trends		
Comments			
	s noted during the June 20 t plan until properly sample	11 6 month surveillance and d.	will remain in
Does Material Contain Asb	estos? Assumed		
Is it Friable?	No		
Original Inspection Date	6/27/2011		
Current Surveillance Date	6/27/2011		
Current Assessment Rating	g NA	Not Applicable	
Cause of Damage	No Damage		
Accessible	Yes		
Potential for Damage	Low		
Removed	No		
Planned Response Action	O & M		
	0		10.

Inspector

Gendley Sandra Shadley hadle

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	G
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Gym stairs	
Material Description	
Stair tread mastic	
Comments	
	noted during the June 2011 6 month surveillance and will remain in plan until properly sampled.
<b>Does Material Contain Asbe</b>	stos? Assumed
Is it Friable?	No
Original Inspection Date	6/27/2011
Current Surveillance Date	6/27/2011
<b>Current Assessment Rating</b>	NA Not Applicable
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
Inspector	Sandra Shady

Sandra Shadley

State Accreditation Number

(

LEA Name	Greater C	lark County Sc	hools
Building Name	<b>River Valle</b>	ey Middle Scho	ol
HA#	04		
Type of Material	Miscellane	ous Material	2
Quantity of Material	Approx. 9,	564 SF	
Material Location Throughout the bu	uildina		
Material Description			
Mastic			
Comments			
There was no mas mastic was coated was not visible to	l with a sea	d to inspect. C alant. Ceramic	Id carpeting was removed and the old wall tile in bathrooms was intact and mastic
Does Material Contain Asbe	stos?	Assumed	
Is it Friable?		No	
<b>Original Inspection Date</b>		6/1/1995	
Current Surveillance Date		12/6/2010	
<b>Current Assessment Rating</b>		NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action		O & M	
Inspector			Paul W. Krick
State		Indiana	
Accreditation Number		197812124	

LEA Name	Greater C	lark County Scho	ols
Building Name	<b>River Vall</b>	ey Middle School	
HA#	А		
Type of Material	Miscellan	eous Material	
Quantity of Material	2,200 LF		
Material Location			
Throughout the b	uilding		
Material Description			
Cove base			
Comments			
replaced with bla	ck cove bas	se. Overall, this m	e main hallway on the first floor and naterial was not in poor condition. All old ng the summer of 2010.
Does Material Contain Asbe	estos?	Assumed	
Is it Friable?		No	
<b>Original Inspection Date</b>		5/31/1995	
Current Surveillance Date		12/6/2010	
Current Assessment Rating	I	NR	Not Required
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage		Low	
Removed .		No	
Planned Response Action		O & M	
		$\left( \right)$	
Inspector			tal Kill
\$ n		<i>B</i> 2	Paul W. Krick
State	1.	Indiana	

**Accreditation Number** 

LEA Name	Greater Cl	lark County Scho	ols	
Building Name	River Valle	ey Middle School		
HA#	В			
Type of Material	Miscellane	eous Material		
Quantity of Material	Approx. 75	50 SF		
Material Location				
Throughout the b	uilding			
Material Description				
Cove base mastic	;			
Comments				
This material was	not visible	to inspect.		
Does Material Contain Asbe	stos?	Assumed		
Is it Friable?		No		
Original Inspection Date		5/31/1995		
Current Surveillance Date		12/6/2010		
<b>Current Assessment Rating</b>		NR	Not Required	
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage		Low		
Removed		No		
Planned Response Action		O & M		
Inspector			Paul W. Krick	2

State Accreditation Number

(

LEA Name	Greater C	lark County S	chools		
Building Name	<b>River Valle</b>	ey Middle Sch	nool		
HA#	D	D			
Type of Material	Miscellaneous Material				
Quantity of Material	Unquantifi	ed Each			
Material Location					
-	oors throughout the building				
Material Description					
Fire doors					
Comments					
Not assessed in c sampled as they a	original insp are suspect	ection. Will b material.	be added to management plan until properly		
Does Material Contain Asbe	stos?	Assumed			
Is it Friable?		No			
<b>Original Inspection Date</b>		6/30/2010			
Current Surveillance Date		12/6/2010			
<b>Current Assessment Rating</b>		NR	Not Required		
Cause of Damage					
Accessible		Yes			
Potential for Damage	Potential for Damage				
Removed		No			
Planned Response Action		0 & M			
Inspector		<+	Paul W. Krick		
			8. D. 7. 21		
State		Indiana			

Accreditation Number

-	LEA Name uilding Name	Greater Clark County Schools River Valley Middle School			
~	HA#	04			
	Type of Material Quantity of Material	Miscellaneo 9,564 SF	ous Material		
	Material Location Throughout the bu Material Description	uilding			
	Mastic				
	Comments				
	There was no ma	stic exposed			
	Does Material Contain Asbe	stos?	Assumed		
	ls it Friable?		No		
	Original Inspection Date		6/1/1995		
	Current Surveillance Date		12/3/2009		
	Current Assessment Rating		NR	Not Required	
	Cause of Damage		No Damage		
	Accessible		Νο		
	otential for Damage		Low		
	Removed		No		
	Planned Response Action		O & M		

Inspector

0

George William Ogle

State Accreditation Number

LEA Name	Great	er Clark County Scho	ools
ilding Name	River	Valley Middle Schoo	I
HA#	А		
Type of Materia	Misce	Ilaneous Material	
Quantity of Ma	terial 2,200	LF	
Material Locati	on		
Thro	ughout the building		
Material Descri	iption		
Cove	base		
Comments			
The repla	material was removiced with black cove	ved non-friable from e base. Overall, this	the main hallway on the first floor and material was not in poor condition.
Does Material	Contain Asbestos?	Assumed	
Is it Friable?		No	
Original Inspe	ction Date	5/31/1995	
Current Surve	illance Date	12/3/2009	
<b>Current Asses</b>	sment Rating	NR	Not Required
Cause of Dam	age	No Damage	
ccessible		Yes	
Potential for D	amage	Low	
Removed		No	
Planned Resp	onse Action	O & M	

Inspector

<u>George</u> William Ogle

State **Accreditation Number** 

C

I.EA	Name	Greater Cla	rk County Schools	i
il	ding Name	River Valley	/ Middle School	
HA#		В		
Тур	e of Material	Miscellaneo	ous Material	
Qua	ntity of Material	Approx. 75	0 SF	
	erial Location Throughout the bi erial Description	uilding		
	Cove base mastic	>		
Соп	nments			
	This material was	not visible t	o inspect.	
Doe	es Material Contain Asbe	estos?	Assumed	
ls it	Friable?		Νο	
Orig	ginal Inspection Date		5/31/1995	
Cur	rent Surveillance Date		12/3/2009	
Cur	rrent Assessment Rating	1	NR	Not Required
Cau	use of Damage		No Damage	
Acc	essible		No	
ot	ential for Damage		Low	
Rei	moved		No	
Pla	nned Response Action		O & M	

Inspector

C

State Accreditation Number Indiana 191003027 *George W Ode* George William Øgle

_	LEA Name	Greater Cla	ark County School	S
	uilding Name	<b>River Valle</b>	y Middle School	
	HA#	04		
	Type of Material	Miscellane		
	Quantity of Material	9,564 SF		
	Material Location			
	Throughout the bu	uilding		
	Material Description			
	Mastic			
	Comments			
	There was no mag	stic exposed	d to inspect.	
	Does Material Contain Asbe	stos?	Assumed	
	ls it Friable?		No	
	Original Inspection Date		6/1/1995	
	Current Surveillance Date		6/10/2009	
	<b>Current Assessment Rating</b>		NR	Not Required
	Cause of Damage		No Damage	
_	Accessible		No	
	otential for Damage		Low	
	Removed		No	
	Planned Response Action		O & M	

Inspector

Genge UP Ogle George William Ogle

State Accreditation Number IN 191003027

LEA Name	Greater Clark County Sch	ools
uilding Name	River Valley Middle School	bl
HA#	Α	
Type of Material	Miscellaneous Material	
Quantity of Material	2,200 LF	
Material Location		
Throughout the bu	uilding	
Material Description		
Cove base		
Comments		
		the main hallway on the first floor and material was not in poor condition.
Does Material Contain Asbe	stos? Assumed	
Is it Friable?	No	
<b>Original Inspection Date</b>	5/31/1995	
Current Surveillance Date	6/10/2009	
Current Assessment Rating	NR	Not Required
Cause of Damage	No Damage	
Accessible	Yes	
Potential for Damage	Low	
Removed	Νο	
Planned Response Action	O & M	
		Real INAI

Inspector

\_\_\_\_\_\_George William gle

State Accreditation Number IN 191003027

-			Clark County Schools		
	uilding Name	River Valle	y Middle School		
-	HA#	В			
	Type of Material	Miscellane	ous Material		
	Quantity of Material	Approx. 75	0 SF		
	Material Location Throughout the bu	uilding			
	Material Description				
	Cove base mastic	:			
	Comments				
	This material was	not visible f	to inspect.		
	<b>Does Material Contain Asbe</b>	stos?	Assumed		
	Is it Friable?		No		
	<b>Original Inspection Date</b>		5/31/1995		
	Current Surveillance Date		6/10/2009		
	Current Assessment Rating		NR	Not Required	
	Cause of Damage		No Damage		
	Accessible		Νο		
	otential for Damage		Low		
-	Removed		No		
	Planned Response Action		O & M		

Inspector

*Jenge // Ale* George William Ogle

State Accreditation Number IN 191003027



LEA Name	Greater Clark County Schools					
Building Name	River Valle	River Valley Middle School				
HA#	04					
Type of Material	Miscellane	eous Material				
Quantity of Material	9,564 SF					
Material Location						
Throughout the b	ouilding					
Material Description						
Mastic						
Comments						
There was no ma	astic expose	d to inspect.				
Does Material Contain Asb	estos?	Assumed				
Is it Friable?		No				
<b>Original Inspection Date</b>		6/1/1995				
Current Surveillance Date		12/10/2008				
Current Assessment Rating	9	NR	Not Required			
Cause of Damage		No Damage				
Accessible		No				
Potential for Damage		Low				
Removed		No				
Planned Response Action		O & M				

Inspector

George William Ogle

State **Accreditation Number** 

-	LEA Name	Greater C	lark County Scho	ools
	Building Name	<b>River Vall</b>	ey Middle Schoo	1
	HA#	А		
	Type of Material	Miscellane	eous Material	
	Quantity of Material	2,200 LF		
	Material Location Throughout the b	uilding		
	Material Description			
	Cove base			
	Comments			
	some have been	replaced. T st floor and	The material was	ouilding, mostly on the 2nd floor, although removed non-friable from the main ack cove base. Overall, this material was
	Does Material Contain Asbe	estos?	Assumed	
	Is it Friable?		No	
	Original Inspection Date		5/31/1995	
	Current Surveillance Date		12/10/2008	
-	Current Assessment Rating	I	NR	Not Required
	Cause of Damage		No Damage	
	Accessible		Yes	
	Potential for Damage		Low	
	Removed		No	3
	Planned Response Action		O & M	
	Inspector			george W Ogle

George William Ogle

State **Accreditation Number** 

C

C

LEA Name	Greater Clark County Schools		
Building Name	River Valley Middle School		
HA#	В		
Type of Material	Miscellane	eous Material	
Quantity of Material	Approx. 750 SF		
Material Location Throughout the building Material Description			
Cove base mastic	•		
Comments			
Where visible, this material was not in poor condition.			
Does Material Contain Asbe	stos?	Assumed	
Is it Friable?		No	
<b>Original Inspection Date</b>		5/31/1995	
Current Surveillance Date		12/10/2008	
Current Assessment Rating		NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action		O & M	

Inspector

Ċ

<u>Alage U. Ole</u> George William Ogle

State Accreditation Number

	LEA Name	Greater Cl	ark County School	S
	Building Name	River Valle	y Middle School	
	HA#	04		
	Type of Material	Miscellane	ous Material	
	Quantity of Material	9,564 SF		
	Material Location Throughout the bu Material Description Mastic	uilding		
	Comments			
	There was no mag	stic expose	d to inspect.	
	Does Material Contain Asbe	stos?	Assumed	
	is it Friable?		No	
	Original Inspection Date		6/1/1995	
	Current Surveillance Date		6/30/2008	
	<b>Current Assessment Rating</b>		NR	Not Required
	Cause of Damage		No Damage	
	Accessible		No	
-	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		O & M	

Inspector

George William Ogle

State **Accreditation Number** 

_						
	LEA Name	Greater Cla	ark County Schoo	ls		
hour -	Building Name	<b>River Valle</b>	y Middle School			
	HA#	A				
	Type of Material	Miscellaneo	ous Material			
	Quantity of Material	2,200 LF				
	Material Location					
	Throughout the bu	uilding				
	Material Description					
	Cove base					
	Comments	Comments				
	some have been i	replaced. This floor and r	he material was r	ilding, mostly on the 2nd floor, although emoved non-friable from the main k cove base. Overall, this material was		
	<b>Does Material Contain Asbe</b>	stos?	Assumed			
	ls it Friable?		No			
	<b>Original Inspection Date</b>		5/31/1995			
_	Current Surveillance Date		6/30/2008			
	<b>Current Assessment Rating</b>		NR	Not Required		
-	Cause of Damage		No Damage			
	Accessible		Yes			
	Potential for Damage		Low			
	Removed		No			
	Planned Response Action		0 & M			
				ann		

Inspector

George William Ogle

State Accreditation Number

-					
	.EA Name	Greater Clark County Schools			
	Building Name	River Valley Middle School			
	HA#	В			
	Type of Material	Miscellaneous Material			
	Quantity of Material	Approx. 75	0 SF		
	Material Location				
	Throughout the building				
	Material Description				
	Cove base mastic	;			
	Comments				
	Where visible, this material was not in poor condition.				
	Does Material Contain Asbe	stos?	Assumed		
	Is it Friable?		Νο		
	<b>Original Inspection Date</b>		5/31/1995		
	Current Surveillance Date		6/30/2008	<i></i>	
	Current Assessment Rating		NR	Not Required	
	Cause of Damage		No Damage		
	Accessible		No		
-	Potential for Damage		Low		
	Removed		No		
	Planned Response Action		O & M		
				Anna INTRIO	
	Inspector			George William Oale	

State Accreditation Number

191003027

	LEA Name	Greater Clark County Schools				
	Building Name	River Valley Middle School				
	HA#	04				
	Type of Material	Miscellane				
	Quantity of Material	9,564 SF				
	Material Location					
	Throughout the building					
Material Description						
	Mastic					
	Comments					
	There was no mastic exposed to inspect.					
	Does Material Contain Asbestos?		Assumed			
	ls it Friable?		No			
	Original Inspection Date		6/1/1995			
	Current Surveillance Date		12/6/2007			
	Current Assessment Rating		NR	Not Required		
	Cause of Damage		No Damage			
	Accessible		No			
2	Potential for Damage		Low			
	Removed		No			
	Planned Response Action		O & M			

Inspector

C

*Genge William* Ogle

State Accreditation Number

	LEA Name	Greater Cla	ark County Scho	ols	
	Building Name	River Valle	y Middle School		
	HA#	Α			
	Type of Material	Miscellaneous Material			
	Quantity of Material	2,200 LF			
	Material Location				
	Throughout the b	uilding			
	Material Description				
	Cove base				
	Comments				
	Many pieces are loose and missing throughout the building, mostly on the 2nd floor. The material was removed non-friable from the main hallway on the first floor and replaced with black cove base. Overall, this material was not in poor condition.				
	Does Material Contain Asbe	stos?	Assumed		
	ls it Friable?		No		
	Original Inspection Date		5/31/1995		
	Current Surveillance Date		12/6/2007		
~	Current Assessment Rating	ł	NR	Not Required	
J	Cause of Damage		No Damage		
	Accessible		Yes		
	Potential for Damage		Low		
	Removed		No		
	Planned Response Action		O & M		

Inspector

C

George William Ogle

State	Indiana
Accreditation Number	191003027

C	LEA Name	Greater Cla	ark County School	s		
	Building Name	<b>River Valle</b>	y Middle School			
	HA#	В				
	Type of Material	Miscellane	ous Material			
	Quantity of Material	Approx. 75	io SF			
	Material Location Throughout the bu Material Description	uilding				
	Cove base mastic					
	Comments					
	Where visible, this material was not in poor condition.					
	Does Material Contain Asbe	stos?	Assumed			
	Is it Friable?		No			
	Original Inspection Date		5/31/1995			
	Current Surveillance Date		12/6/2007			
	<b>Current Assessment Rating</b>		NR	Not Required		
	Cause of Damage		No Damage			
(	Accessible		No			
10	Potential for Damage		Low			
	Removed		No			
	Planned Response Action		0 & M			

Inspector

(

\_\_\_\_\_\_George William Ogle

State Accreditation Number

	LEA Name	Greater Cla	ark County School	S
	Building Name	<b>River Valle</b>	y Middle School	
	HA#	04		
	Type of Material	Miscellane	ous Material	
	Quantity of Material	9,564 SF		
	Material Location			
	Throughout the bu	uilding		
	Material Description			
	Mastic			
	Comments			
	There was no mas	stic exposed	d to inspect.	
	Does Material Contain Asbe	stos?	Assumed	
	Is it Friable?		No	
	Original Inspection Date		6/1/1995	
	Current Surveillance Date		12/18/2006	
	<b>Current Assessment Rating</b>		NR	Not Required
	Cause of Damage		No Damage	
-	Accessible		No	
	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		O & M	
				-

Inspector

C

george William Ogle

State Accreditation Number

0	LEA Name	Greater Cl	ark County Schoo	ls
	Building Name	<b>River Valle</b>	y Middle School	
	HA#	А		
	Type of Material	Miscellane	ous Material	
	Quantity of Material	2,200 LF		
	Material Location			
	Throughout the bi	uilding		
	Material Description			
	Cove base			
	Comments			
	The material was	removed no	on-friable from the	the building, mostly on the 2nd floor. main hallway on the first floor and aterial was not in poor condition.
	<b>Does Material Contain Asbe</b>	stos?	Assumed	
	Is it Friable?		No	
	Original Inspection Date		5/31/1995	
	Current Surveillance Date		12/18/2006	
~	<b>Current Assessment Rating</b>		NR	Not Required
$\cup$	Cause of Damage		No Damage	
	Accessible		Yes	
	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		O & M	
	inspector			George US Dela

George William Qgle

State Accreditation Number

C

	LEA Name	Greater Clark County Sch		Is	
	Building Name	<b>River Valle</b>	y Middle School		
	HA#	В			
	Type of Material	Miscellane	ous Material		
	Quantity of Material	Approx. 75	0 SF		
	Material Location Throughout the bu Material Description	uilding			
	Cove base mastic				
	Comments				
	Where visible, this	s material w	as not in poor cor	ndition.	
	Does Material Contain Asbe	stos?	Assumed		
	Is it Friable?		No		
	Original Inspection Date		5/31/1995		
	Current Surveillance Date		12/18/2006		
	Current Assessment Rating		NR	Not Requi	red
	Cause of Damage		No Damage		
	Accessible		No		
~	Potential for Damage		Low		
	Removed		No		
	Planned Response Action		O & M		
				Λ	112/11

Inspector

C

George William Ogto

State Accreditation Number

	LEA Name	Greater Cl	ark County S	Schools	5	
	Building Name	<b>River Valle</b>	y Middle Sch	loor		
	HA#	04				
	Type of Material	Miscellane	ous Material			
	Quantity of Material	9,564 SF				
	Material Location					
	Throughout the bu	uilding				
	Material Description					
	Mastic					
	Comments					
There was no mastic expose		sed to inspect.				
	Does Material Contain Asbe	stos?	Assumed			
	ls it Friable?		No			
	Original Inspection Date		6/1/1995			
	Current Surveillance Date		6/28/2006			
	Current Assessment Rating		NR		Not Required	
	Cause of Damage		No Damage	•		
	Accessible		No			
	Potential for Damage		Low			
	Removed		No			
	Planned Response Action		O & M		n /	
				NI	1	
	Inspector		/	1 X	A	

Christopher Ames

State

C

Accreditation Number

	Greater Cl	ark County Sch	nole
LEA Name	Greater Clark County Schools River Valley Middle School		
Building Name	River valle	ey Middle Schol	
HA#	А		
Type of Material	Miscellane	ous Material	
Quantity of Material	2,200 LF		
Material Location			
Throughout the b	uilding		
Material Description			
Cove base			
Comments			
Many pieces are loose and missing throughout the building, mostly on the 2nd floor The material was removed non-friable from the main hallway on the first floor and replaced with black cove base. Overall, this material was not in poor condition.			
Does Material Contain Asb	estos?	Assumed	
Is it Friable?		No	
<b>Original Inspection Date</b>		5/31/1995	
Current Surveillance Date		6/28/2006	
Current Assessment Rating	1	NR	Not Required
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage		Low	
Removed		No	
Planned Response Action		O & M	211

Inspector

C

Christopher Ames

State Accreditation Number

C

(

6	LEA Name	Greater Cl	ark County So	hools	
	Building Name	River Valle	ey Middle Scho	ool	
	HA#	В			
	Type of Material	Miscellane	ous Material		
	Quantity of Material	Approx. 75	50 SF		
	Material Location Throughout the b Material Description	uilding			
	Cove base mastic	;			
	Comments				
	Where visible, this	s material w	as not in poor	condition.	
	<b>Does Material Contain Asbe</b>	stos?	Assumed		
	ls it Friable?		No		
	Original Inspection Date		5/31/1995		
	Current Surveillance Date		6/28/2006		
	Current Assessment Rating		NR	Not Required	
	Cause of Damage		No Damage		
<u></u>	Accessible		No		
C	Potential for Damage		Low		
	Removed		No		
	Planned Response Action		O & M	~//	
	Inspector			Christopher Ames	
	State		Indiana		
	Accreditation Number		198612124		

LEA Name	Greater Clark County Schools			
Building Name	River Val	ley Middle School	ł	
HA#	04			
Type of Material	Miscellan	eous Material		
Quantity of Material	9,564 SF			
Material Location				
Throughout the b	uilding			
Material Description				
Mastic				
Comments				
There was no ma	istic expose	ed to inspect.		
Does Material Contain Asbe	estos?	Assumed		
ls it Friable?		No		
<b>Original Inspection Date</b>		6/1/1995		
Current Surveillance Date		1/23/2006		
Current Assessment Rating	\$3) (1)	NR	Not Required	
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage		Low		
Removed		No		
Planned Response Action		O & M		
				2323

Inspector

C

C

<u> Gence</u> Ú Us Seorge William Ogle

State Accreditation Number

	LEA Name	Greater C	lark County Sch	ools	
	Building Name	River Vall	ey Middle Schoo	1	
	HA#	A			
	Type of Material	Miscelland	eous Material		
	Quantity of Material	2,200 LF			
	Material Location				
	Throughout the bu Material Description	uilding			
	Cove base				
	Comments				
	The material was	removed no	on-friable from th	ut the building, mostly on the 2nd floor. ne main hallway on the first floor and naterial was not in poor condition.	
	<b>Does Material Contain Asbes</b>		Assumed		
	Is it Friable?		No		
	Original Inspection Date		5/31/1995		
	Current Surveillance Date		1/23/2006		
	<b>Current Assessment Rating</b>		NR	Not Required	
	Cause of Damage		No Damage		
0	Accessible		Yes		
	Potential for Damage		Low		
	Removed		No		
	Planned Response Action		O & M		
	Increator			An USAI	

Inspector

George William øgle VV Noke

State **Accreditation Number** 


LEA Name	Greater Clark County Schools		
Building Name	River Valley Middle School		
HA#	В		
Type of Material	Miscellaneous Material		
Quantity of Material	Approx. 750 SI		
Material Location			
Throughout the b	uilding		
Material Description			
Cove base mastic	;		
Comments			
Where visible, this	s material was n	ot in poor con	dition.
Does Material Contain Asbe	stos? Ass	umed	
Is it Friable?	No		
<b>Original Inspection Date</b>	5/3	1/1995	
Current Surveillance Date	1/2:	3/2006	
Current Assessment Rating	NR		Not Required
Cause of Damage	No	Damage	
Accessible	No		
Potential for Damage	Low	1	
Removed	No		
Planned Response Action	08	ь <b>М</b>	
			n i ka

Inspector

C

George William Ogle

State Accreditation Number

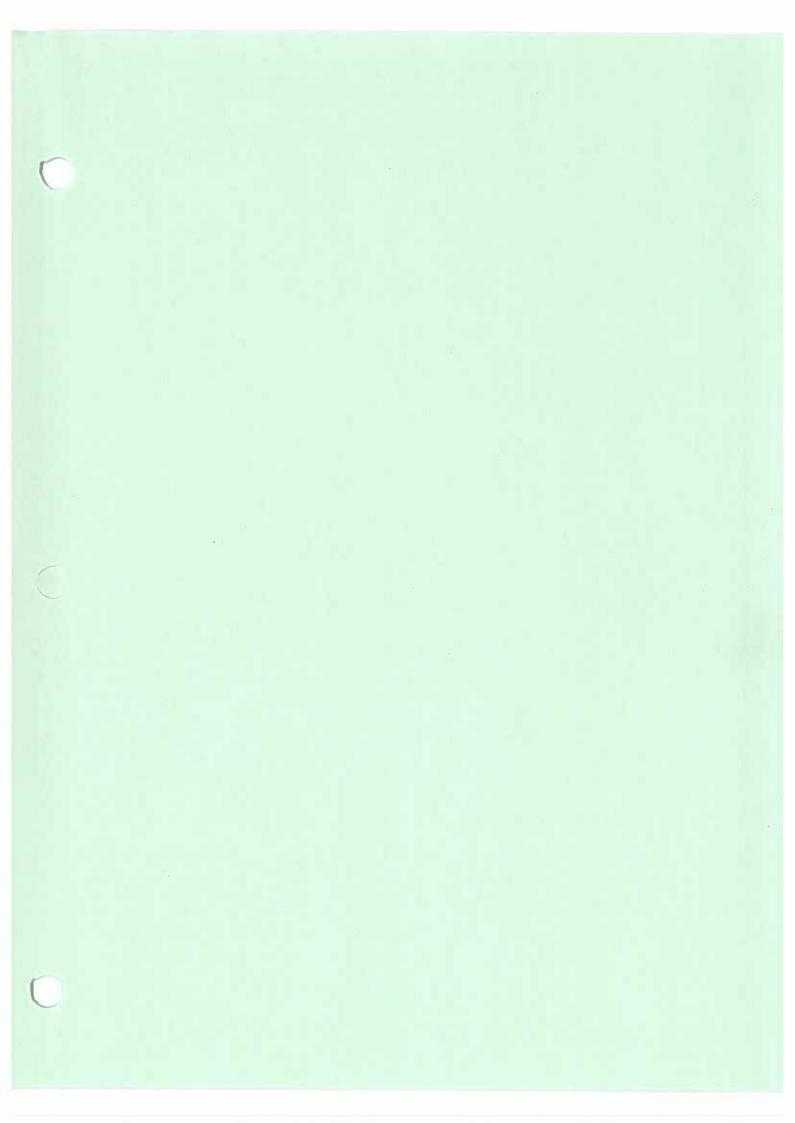

LEA Name	Greater Clark County Schools			
Building Name	River Valley Middle School			
HA#	04			
Type of Material	Miscellane	eous Material		
Quantity of Material	9,564 SF			
Material Location Throughout the b	ouilding			
Material Description Mastic				
Comments No floor tile mast mastic exposed t		ible at the front e	entrance as the area is carpeted.	There was no
Does Material Contain Asbest	tos?	Assumed		
Is it Friable?		No		
Original Inspection Date		6/1/1995		
Current Surveillance Date		7/19/2005		
Current Assessment Rating		NR	Not Required	
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage		Low		
Removed		No		
Planned Response Action		0 & M		
2			2 171	

Inspector

George William Ogle

State Accreditation Number

LEA Name	Greater Cl	ark County Sch	ools
Building Name	River Valle	y Middle Schoo	bl
HA#	Α		
Type of Material	Miscellane	ous Material	
Quantity of Material	2,200 LF		
Material Location Throughout the	building		
Material Description Cove base			
	the main ha	llway on the fir	out the building. The material was removed st floor and replaced with black cove base. tion.
Does Material Contain Asbe	stos?	Assumed	
Is it Friable?		No	
Original Inspection Date		5/31/1995	
<b>Current Surveillance Dat</b>	e	7/19/2005	
Current Assessment Rating		NR	Not Required
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage		Low	
Removed		No	
Planned Response Action		0 & M	
Inspector			Gerge WHe

Inspector

George William Ogle

State

Accreditation Number

LEA Name	Greater Clark County Schools		
Building Name	River Valley Middle School		
HA#	В		
Type of Material	Miscellaneous Material		
Quantity of Material	Approx. 750 SF		
Material Location Throughout the	building		
Material Description Cove base mast	c		
Comments Where visible, th	is material was not in poor condition.		
Does Material Contain Asbes	tos? Assumed		
ls it Friable?	No		
<b>Original Inspection Date</b>	5/31/1995		
Current Surveillance Date	7/19/2005		
Current Assessment Rating	NR Not Required		
Cause of Damage	No Damage		
Accessible	Νο		
Potential for Damage	Low		
Removed	Νο		
Planned Response Action	0 & M		
	A LIZAN		

Inspector

State

0


<u>Jenge 117 Off</u> George William Ogle

Accreditation Number

LEA Name	Greater Clark County Schools		
Building Name	River Valley Middle School		
HA#	С		
Type of Material	Miscellaneous Material		
Quantity of Material	Approx. 50 SF		
Material Location 2nd floor mecha	nical room		
Material Description Shock joints			
shock joint mate	nits were seen during this inspection and it has been observed that all old rial was removed non-friable. The shock joint material currently in place is re not suspect for asbetos content. This material will be removed from the n.		
Does Material Contain Asbes	tos? No		
ls it Friable?	No		
Original Inspection Date	5/31/1996		
Current Surveillance Date	7/19/2005		
Current Assessment Rating	NA Not Applicable		
Cause of Damage	Not Applicable		
Accessible	No		
Potential for Damage	NA		
Removed	Yes		
Planned Response Action	None		
Inspector	George William Øgle		

State

Accreditation Number



LEA Name	Greater C	lark County Sch	ools
Building Name	River Vall	ey Middle Schoo	1
HA#	04		
Type of Material	Miscellan	eous Material	
Quantity of Material	9,564 SF		
Material Location Throughout the I	building		
Material Description Mastic			
Comments Some floor tile n	nastic was	visible at the fro	nt entrance. It was not in poor condition.
Does Material Contain As	bestos?	Assumed	
Is it Friable?		No	
<b>Original Inspection Date</b>		6/1/1995	
Current Surveillance Date	•	12/8/2004	
Current Assessment Ration	ng	NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	/
Planned Response Action	I	0 & M	Alella
Inspector			Christiaan Sparks
State		Indiana	
Accreditation Number		190804103	

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	Α
Type of Material	Miscellaneous Material
Quantity of Material	2,200 LF
Material Location Throughout the b	uilding

#### Material Description Cove base

#### Comments

Many pieces are loose and missing throughout the building. The material was removed non-friable from the main hallway on the first floor and replaced with black cove base. Overall, this material was not in poor condition.

RIVY

Christiaan Sparks

Assumed	
No	
5/31/1995	
12/8/2004	
NR	Not Required
No Damage	
Yes	
Low	
No	/
0 & M	Ada
	No 5/31/1995 12/8/2004 NR No Damage Yes Low No

Inspector

State Accreditation Number

C


LEA Name	Greater Clark County Schools		
Building Name	River Valley Middle School		
HA#	В		
Type of Material	Miscellaneous Material		
Quantity of Material	Approx. 750 SF		
Material Location Throughout the l	building		
Material Description Cove base masti	ic		
Comments Where visible, th	nis material was not in poor condition.		
Does Material Contain As	sbestos? Assumed		
Is it Friable?	No		
Original Inspection Date	5/31/1995		
Current Surveillance Date	12/8/2004		
Current Assessment Ratir	ng NR Not Required		
Cause of Damage	No Damage		
Accessible	No		
Potential for Damage	Low		
Removed	No		
Planned Response Action	O&M		
Inspector	Christian Sparks		
	Christiaan Sparks		
State	Indiana		
Accreditation Number	190804103		

LEA Name	Greater C	Clark County Sch	ools	
Building Name	River Val	River Valley Middle School		
HA#	С	c		
Type of Material	Miscellan	eous Material		
Quantity of Material	Approx. S	50 SF		
Material Location 2nd floor mecha	inical room			
Material Description Shock joints				
shock joint mate	erial was re ore not sus	moved non-friab	inspection and it has been observed that all old le. The shock joint material currently in place is content. This material will be removed from the	
Does Material Contain As	sbestos?	No		
Is it Friable?		No		
<b>Original Inspection Date</b>		5/31/1996		
Current Surveillance Date	в	12/8/2004		
Current Assessment Rati	ng	NA	Not Applicable	
Cause of Damage		Not Applicable		
Accessible		No		
Potential for Damage		NA		
Removed		Yes -	/	
Planned Response Actior	1	None	Atta	
			Christiaan Sparks	

State Accreditation Number

(

0

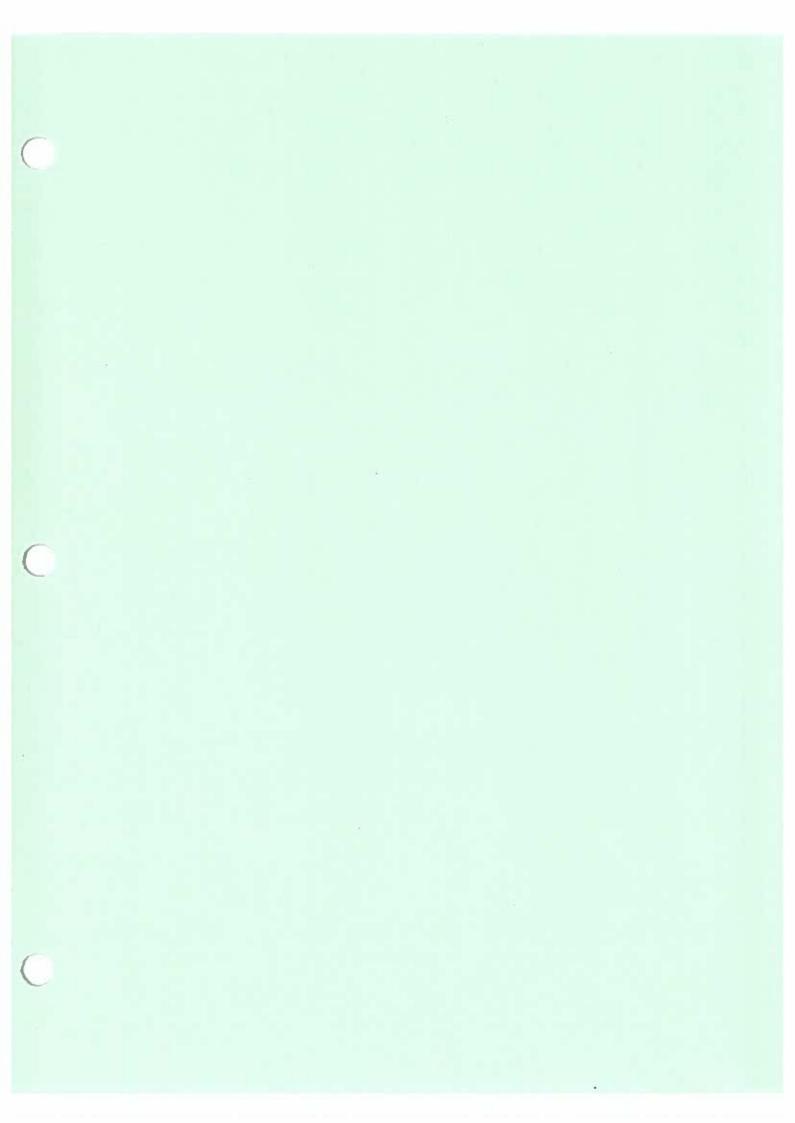

LEA Name	Greater C	Clark County Sch	ools
Building Name	River Val	ley Middle Schoo	bl
HA#	04		
Type of Material	Miscellan	eous Material	
Quantity of Material	9,564 SF	:	
Material Location Throughout the	building		
Material Description Mastic			
Comments Some floor tile r	nastic was	visible at the fro	ont entrance. It was not in poor condition.
Does Material Contain As	sbestos?	Assumed	
Is it Friable?		No	
<b>Original Inspection Date</b>		06/01/1995	
Current Surveillance Date	e	12/08/2003	
Current Assessment Rati	ing	NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	/
Planned Response Action	ו	0 & M	Add
Inspector			Christiaan Sparks
State		Indiana	

Accreditation Number

LEA Name	Greater C	lark County Sch	ools
Building Name	River Vall	ey Middle Scho	bl
HA#	Α		
Type of Material	Miscellan	eous Material	
Quantity of Material	2,200 LF		
Material Location Throughout the	building		
Material Description Cove base			
	the main h	allway on the fi	out the building. The material was removed rst floor and replaced with black cove base. tion.
Does Material Contain As	bestos?	Assumed	
Is it Friable?		No	
<b>Original Inspection Date</b>		05/31/1995	
Current Surveillance Date	:	12/08/2003	
Current Assessment Rati	ng	NR	Not Required
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage		Low	
Removed		No	/
Planned Response Action	I	0 & M	ANT
Inspector			Christiaan Sparks


State Accreditation Number

LEA Name	Greater C	lark County Sch	ools
Building Name	River Valley Middle School		
HA#	В		
Type of Material	Miscellan	eous Material	
Quantity of Material	Approx. 7	750 SF	
Material Location Throughout the	building		
Material Description Cove base mast	ic		
Comments Where visible, th	nis material	was not in poor	condition.
Does Material Contain As	sbestos?	Assumed	
Is it Friable?		Νο	
<b>Original Inspection Date</b>		05/31/1995	
Current Surveillance Date	9	12/08/2003	
Current Assessment Rati	ng	NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		Νο	/
Planned Response Action	I	0 & M	Alen
Inspector			Christiaan Sparks

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	C
Type of Material	Miscellaneous Material
Quantity of Material	Approx. 50 SF
Material Location 2nd floor mechar	nical room
Material Description Shock joints	
shock joint mate	nits were seen during this inspection and it has been observed that all old rial was removed non-friable. The shock joint material currently in place is re not suspect for asbetos content. This material will be removed from the n.
Does Material Contain As	bestos? No
Is it Friable?	No
Original Inspection Date	05/31/1996
Current Surveillance Date	12/08/2003
Current Assessment Ratir	ng NA Not Applicable
Cause of Damage	Not Applicable
Accessible	Νο
Potential for Damage	NA
Removed	Yes
Planned Response Action	None
	Christiaan Sparks

State Accreditation Number

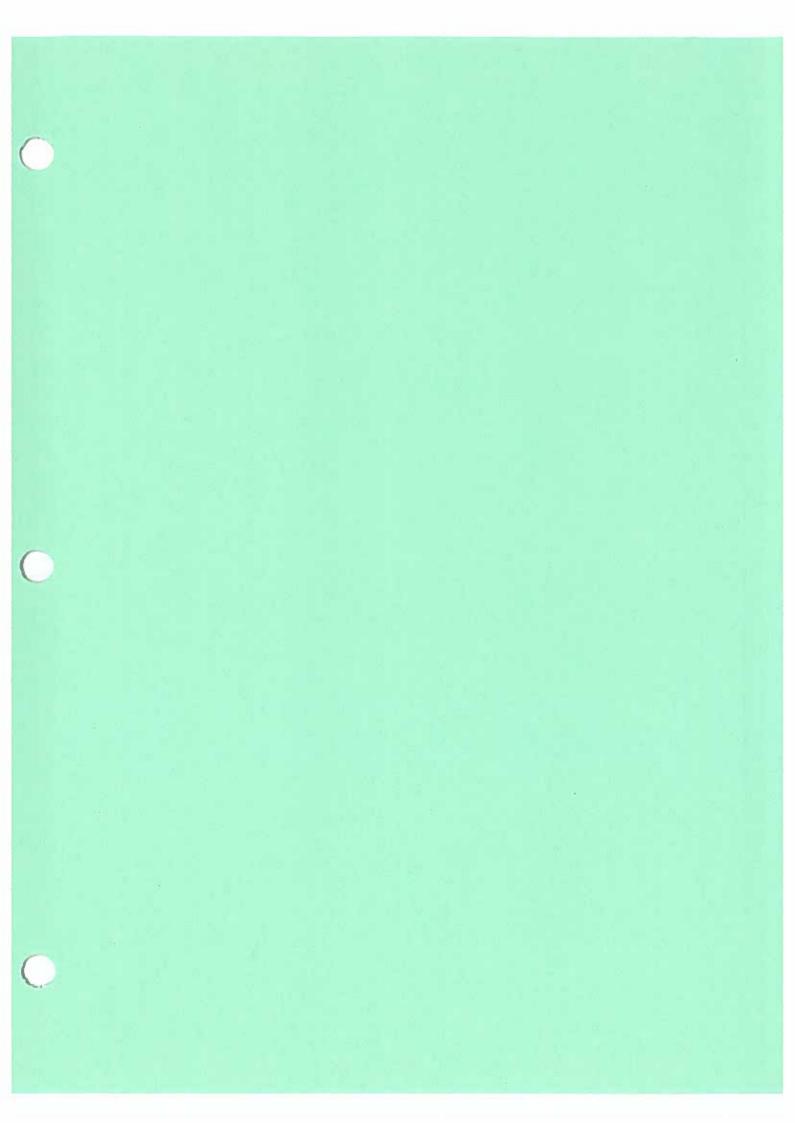

LEA Name	Greater C	lark County Scl	nools	
Building Name	River Vall	ey Middle Scho	ol	
HA#	04			
Type of Material	Miscellan	eous Material		
Quantity of Material	9,564 SF			
Material Location Throughout the I	ouilding			
Material Description Mastic				
Comments This material wa	s not visibl	e to inspect.		
Does Material Contain Asbestos?		Assumed		
Is it Friable?		No		
<b>Original Inspection Date</b>		06/01/1995		
Current Surveillance Date		06/12/2003		
Current Assessment Ratir	ıg	NR	Not Required	
Cause of Damage		No Damage		
Accessible		Νο		
Potential for Damage		Low		
Removed		No	/	
Planned Response Action		0 & M	All	
			Christiaan Sparks	

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	Α
Type of Material	Miscellaneous Material
Quantity of Material	2,200 LF
Material Location Throughout the b	uilding
Material Description Cove base	
is a large chip in	e missing or coming loose in the hallway in front of the art room and there the home ec room. The material was removed non-friable from the main st floor and replaced with black cove base. Overall, this material was not
Does Material Contain Asl	estos? Assumed
Is it Friable?	Νο
Original Inspection Date	05/31/1995
Current Surveillance Date	06/12/2003
Current Assessment Ratin	g NR Not Required
Cause of Damage	Physical Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O&M
Inspector	Christiaan Sparks


State **Accreditation Number** 

LEA Name	Greater C	Clark County Schools		
Building Name	River Valley Middle School			
HA#	В			
Type of Material	Miscellane	eous Material		
Quantity of Material	Approx. 7	'50 SF		
Material Location Throughout the I	building			
Material Description Cove base masti	с			
Comments Where visible, th	is material	was not in poor	condition.	
Does Material Contain Asbestos?		Assumed		
Is it Friable?		No		
Original Inspection Date		05/31/1995		
Current Surveillance Date		06/12/2003		
Current Assessment Rating		NR	Not Required	
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage		Low		
Removed		No	/	
Planned Response Action		0 & M	Add	
Inspector			Christiaan Sparks	
			omotidan oparka	

State Accreditation Number

LEA Name	Greater Clark County Schools			
Building Name	River Valley Middle School			
HA#	C			
Type of Material	Miscellar	Miscellaneous Material		
Quantity of Material	Approx.	50 SF		
Material Location 2nd floor mecha	anical room			
Material Description Shock joints				
<b>Comments</b> The only places material was no			en is on 3 new units tied into old ductwork. All	
Does Material Contain A	sbestos?	Assumed		
Is it Friable?		No		
<b>Original Inspection Date</b>		05/31/1996		
Current Surveillance Date	e	06/12/2003		
Current Assessment Rat	ing	NR	Not Required	
Cause of Damage		No Damage		
Accessible		Yes		
Potential for Damage		Low		
Removed		No	/	
Planned Response Action	n	0 & M	ADD	
Inspector			Christiaan Sparks	

State	
Accreditation	Number

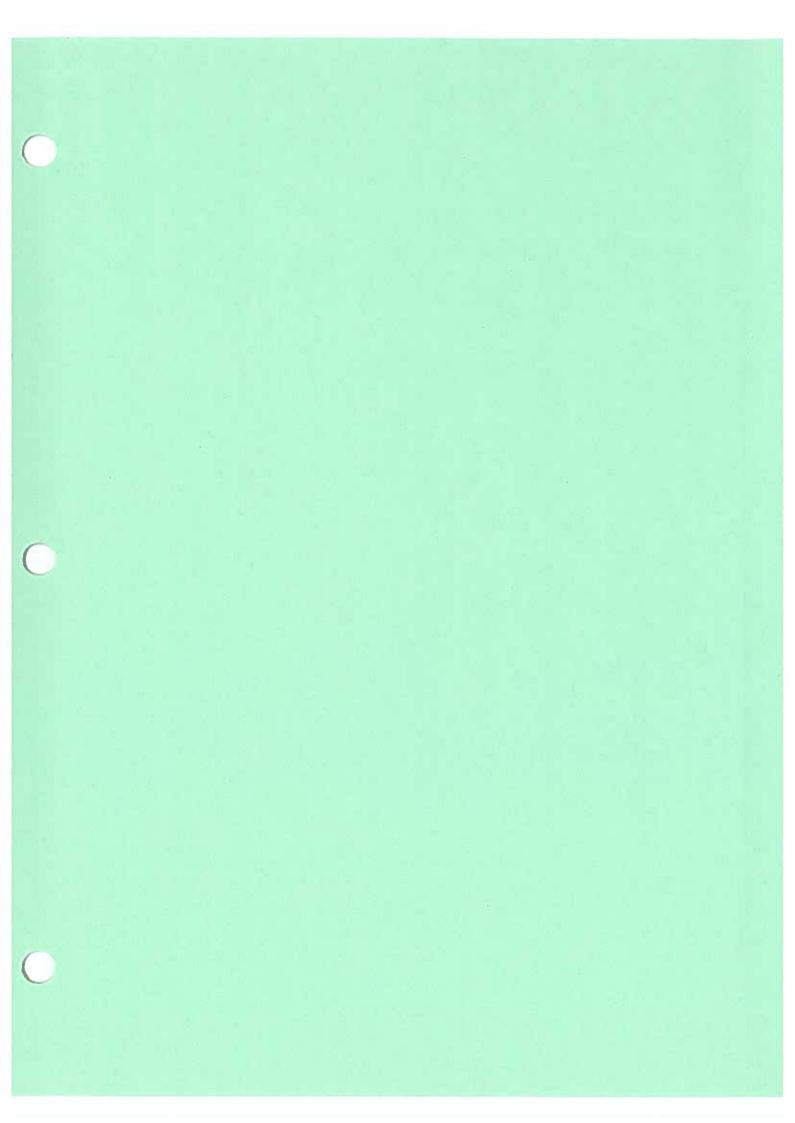

LEA Name	Greater Clark County Schools			
Building Name	River Valley Middle School			
HA#	04			
Type of Material	Miscellane	eous Material		
Quantity of Material	9,564 SF			
Material Location Throughout the b	ouilding			
Material Description Mastic				
Comments This material was not visible to inspect.				
Does Material Contain As	bestos?	Assumed		
Is it Friable?		No		
Original Inspection Date		06/01/1995		
Current Surveillance Date		12/18/2002		
Current Assessment Rating		NR	Not Required	
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage		Low		
Removed		No	/	
Planned Response Action		0 & M	Alth	
113260101			Christiaan Sparks	

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	A
Type of Material	Miscellaneous Material
Quantity of Material	2,200 LF
Material Location Throughout the I	building
Material Description Cove base	
is a large chip in	re missing or coming loose in the hallway in front of the art room and there the home ec room. The material was removed non-friable from the main rst floor and replaced with black cove base. Overall, this material was not
Does Material Contain As	bestos? Assumed
Is it Friable?	Νο
<b>Original Inspection Date</b>	05/31/1995
Current Surveillance Date	12/18/2002
Current Assessment Ratir	ng NR Not Required
Cause of Damage	Physical Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O&M
Inspector	Christiaan Sparks

State Accreditation Number

C

1	LEA Name Greater Cl		ark County Scho	ols	
(	Building Name	River Valle	y Middle School		
	HA#	в			
	Type of Material	Miscellane	ous Material		
	Quantity of Material	Approx. 7	50 SF		
	Material Location Throughout the b	uilding			
	Material Description Cove base mastic	2			
	Comments Where exposed, 1	this materia	al was not in poo	r condition.	
	Does Material Contain Asbestos? Is it Friable?		Assumed		
			No		
	Original Inspection Date		05/31/1995		
	Current Surveillance Date		12/18/2002		
	Current Assessment Rating		NR	Not Required	
	Cause of Damage		No Damage		
	Accessible		No		
5	Potential for Damage		Low		
1	Removed		No	1	
	Planned Response Action		O & M	An	
				Christiaan Sparks	

State Accreditation Number

(

LEA Name	Greater Clark County Schools			
Building Name	River Valley Middle School			
HA#	c			
Type of Material	Miscellaneous Material			
Quantity of Material	Approx.	50 SF		
Material Location 2nd floor mecha	nical room			
Material Description Shock joints				
<b>Comments</b> The only places material was not			een is on 3 new units tied into old ductwork. All	
Does Material Contain As	bestos?	Assumed		
Is it Friable?		No		
<b>Original Inspection Date</b>		05/31/1996		
Current Surveillance Date	1	12/18/2002		
Current Assessment Ratio	ng	NR	Not Required	
Cause of Damage		No Damage		
Accessible		Yes		
Potential for Damage		Low		
Removed		No	(	
Planned Response Action		0 & M	AD/	
Inspector			Christiaan Sparks	

State Accreditation Number

C

C

C

LEA Name	Greater C	ark County Sch	ools
Building Name	River Vall	ley Middle Schoo	bl
HA#	04		
Type of Material	Miscellan	eous Material	
Quantity of Material	9,564 SF	:	
Material Location Throughout the I	building		
Material Description Mastic			
Comments No mastic was e	exposed to	inspect.	
Does Material Contain As	bestos?	Assumed	
Is it Friable?		Νο	
<b>Original Inspection Date</b>		06/01/1995	
Current Surveillance Date		06/19/2002	
Current Assessment Ratin	ng	NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action		0 & M	1 In CA I
Inspector	C	Dùi	Richard D. Calvert
State		Indiana	

**Accreditation Number** 

1

~	LEA Name	Greater C	lark County S	Schools			
	Building Name	River Vall	ey Middle Sc	hool			
	HA#	Α					
	Type of Material	Miscellan	eous Materia	ł			
	Quantity of Material	2,200 LF					
	Material Location Throughout the b	ouilding					
	Material Description Cove base						
	black cove base.	Some da way has pi	mage on 2nd eces missing	floor in . The m	the home ec roon issing pieces in th	evel and replaced with n and the art room. The ne sewing room have been	
	Does Material Contain Asl	bestos?	Assumed				
	Is it Friable?		No				
	Original Inspection Date		05/31/1995	5			
	Current Surveillance Date		06/19/2002				
	Current Assessment Ratin	g	NR	N	ot Required		
$\cap$	Cause of Damage		Physical Da	mage			
	Accessible		Yes				
	Potential for Damage		Low				
	Removed		No				
	Planned Response Action		0 & M	Λ	IDC	a hat	
	Inspector	C		ra Ric	hard D. Calvert		
	State		Indiana				

Accreditation Number

C

C

315989970

1×10-	LEA Name	Greater C	lark County Scho	pols
	Building Name	River Val	ley Middle School	l
	HA#	В		
	Type of Material	Miscellan	eous Material	
	Quantity of Material	Approx. 7	750 SF	
	Material Location Throughout the b	uilding		
	Material Description Cove base mastic	•		
	Comments Material is not in	poor cond	lition where expo	sed.
	Does Material Contain As	pestos?	Assumed	
	Is it Friable?		Νο	
	Original Inspection Date		05/31/1995	
	Current Surveillance Date		06/19/2002	
	Current Assessment Ratin	g	NR	Not Required
	Cause of Damage		No Damage	
	Accessible		No	
	Potential for Damage		Low	
2	Removed		No	
	Planned Response Action		0 & M	1/D n   1
	Inspector	Č	Kich	Richard D. Calvert
	State		Indiana	

Accreditation Number


0

315989970

10	LEA Name Grea		er Clark County Schools				
(	Building Name	River Vall	ey Middle School				
	HA#	С					
	Type of Material	Miscellan	eous Material				
	Quantity of Material	Approx. 5	50 SF				
	Material Location 2nd floor mechar	nical room					
	Material Description Shock joints						
	Comments The only 3 places ductwork. All sh			al was seen is on 3 new units tied into old poor condition.			
	Does Material Contain Asl	pestos?	Assumed				
	Is it Friable?		No				
	Original Inspection Date		05/31/1996				
	Current Surveillance Date		06/19/2002				
	Current Assessment Ratin	g	NR	Not Required			
	Cause of Damage		No Damage				
$\sim$	Accessible		Yes				
	Potential for Damage		Low				
	Removed		No				
	Planned Response Action		0 & M	10011			
	Inspector	C	Nuk	Richard D. Calvert			
	State		Indiana				

**Accreditation Number** 

C

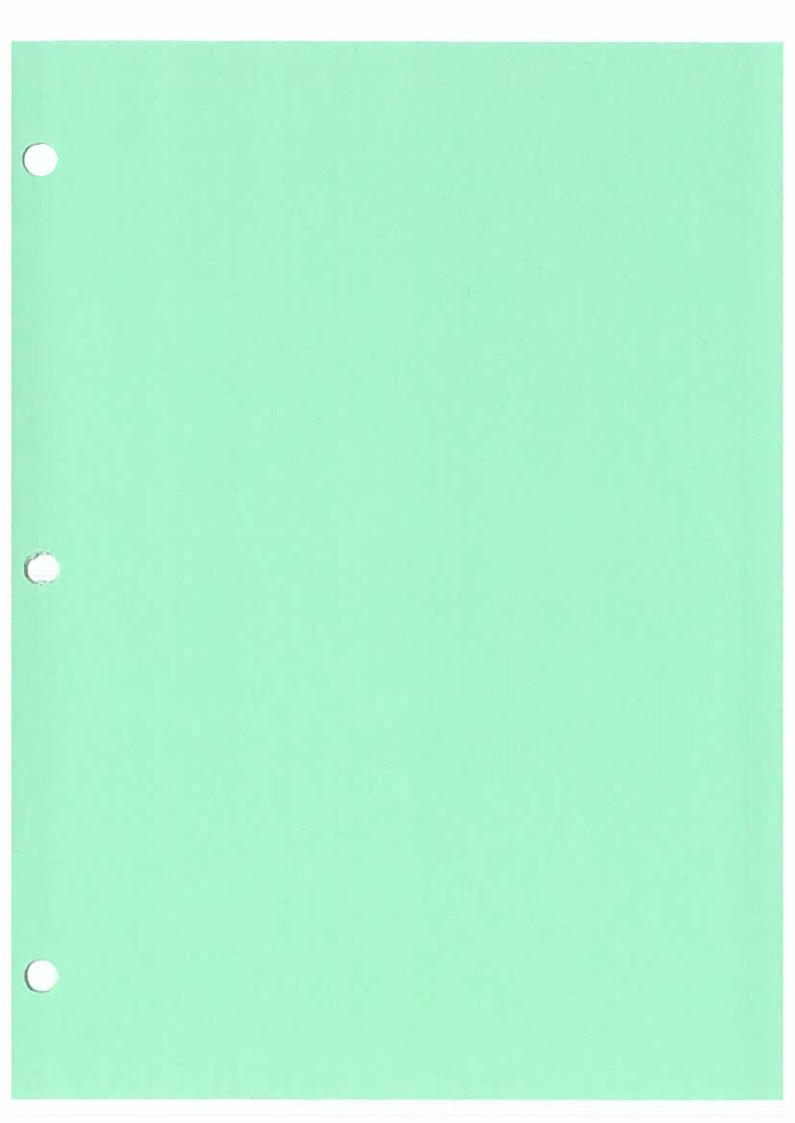

LEA Name	Greater Clark County Schools				
Building Name	River Valley Middle School				
HA#	04				
Type of Material	Miscellan	eous Material			
Quantity of Material	9,564 SF	:			
Material Location Throughout the 1	building				
Material Description Mastic					
Comments No mastic was e	exposed to	inspect.			
Does Material Contain As	bestos?	Assumed			
Is it Friable?		No			
<b>Original Inspection Date</b>		06/01/1995			
Current Surveillance Date		12/10/2002			
Current Assessment Rating		NR Not Required			
Cause of Damage		No Damage			
Accessible		No			
Potential for Damage		Low			
Removed		No			
Planned Response Action					
Inspector		Ateph finbrown Stephen Kimbrough			
State		Indiana			
Accreditation Number		191914122			

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	Α
Type of Material	Miscellaneous Material
Quantity of Material	2,200 LF
Material Location Throughout the b	uilding
Material Description Cove base	
black cove base.	n removed in the main hallway on the first floor level and replaced with Some damage on 2nd floor in the home ec room and the art room. The the second floor hallway have pieces missing. C corridor has new looking
Does Material Contain As	pestos? Assumed
Is it Friable?	No
Original Inspection Date	05/31/1995
Current Surveillance Date	12/10/2002
Current Assessment Ratin	g NR Not Required
Cause of Damage	Physical Damage
Accessible	Yes
Potential for Damage	Low
Removed	Νο
Planned Response Action	
Inspector	Stephen Kimbrough
State	Indiana
Accreditation Number	191914122

 $\sim 2$ 


-	LEA Name	Greater C	lark County Schoo	bls
	Building Name	River Vall	ey Middle School	
	HA#	В		
	Type of Material	Miscellan	eous Material	
	Quantity of Material	Approx. 7	'50 SF	
	Material Location Throughout the b	ouilding		
	Material Description Cove base masti	C		
	Comments Material is not in	poor cond	ition where expos	ed.
	Does Material Contain As	bestos?	Assumed	
	Is it Friable?		Νο	
	<b>Original Inspection Date</b>		05/31/1995	
	Current Surveillance Date		12/10/2002	
	Current Assessment Ratin	g	NR	Not Required
	Cause of Damage		No Damage	
	Accessible		No	
$\frown$	Potential for Damage		Low	
<u> </u>	Removed		No	
	Planned Response Action		O,&M	bung 1
	State		Indiana	Stephen kimbrough
	Accreditation Number		191914122	

C

LEA Name	Greater C	lark County Sch	nools	
Building Name	River Vall	ey Middle Schoo	ol	
HA#	С		34	
Type of Material	Miscellan	eous Material	4	
Quantity of Material	Approx. 5	0 SF		
Material Location 2nd floor mechar	nical room			
Material Description Shock joints				
Comments The only 3 places ductwork. All sh		-	ial was seen is on 3 new units tied into old a poor condition.	I
Does Material Contain Asi	pestos?	Assumed		
Is it Friable?		No		
Original Inspection Date		05/31/1996	*	
Current Surveillance Date		12/10/2002		
Current Assessment Ratin	g	NR	Not Required	
Cause of Damage		No Damage		
Accessible		Yes		
Potential for Damage		Low	-	
Removed		No		
Planned Response Action		0.8M	/	
Inspector		Aleph Ji	Stephen/Kimbrough	

State Accreditation Number

6

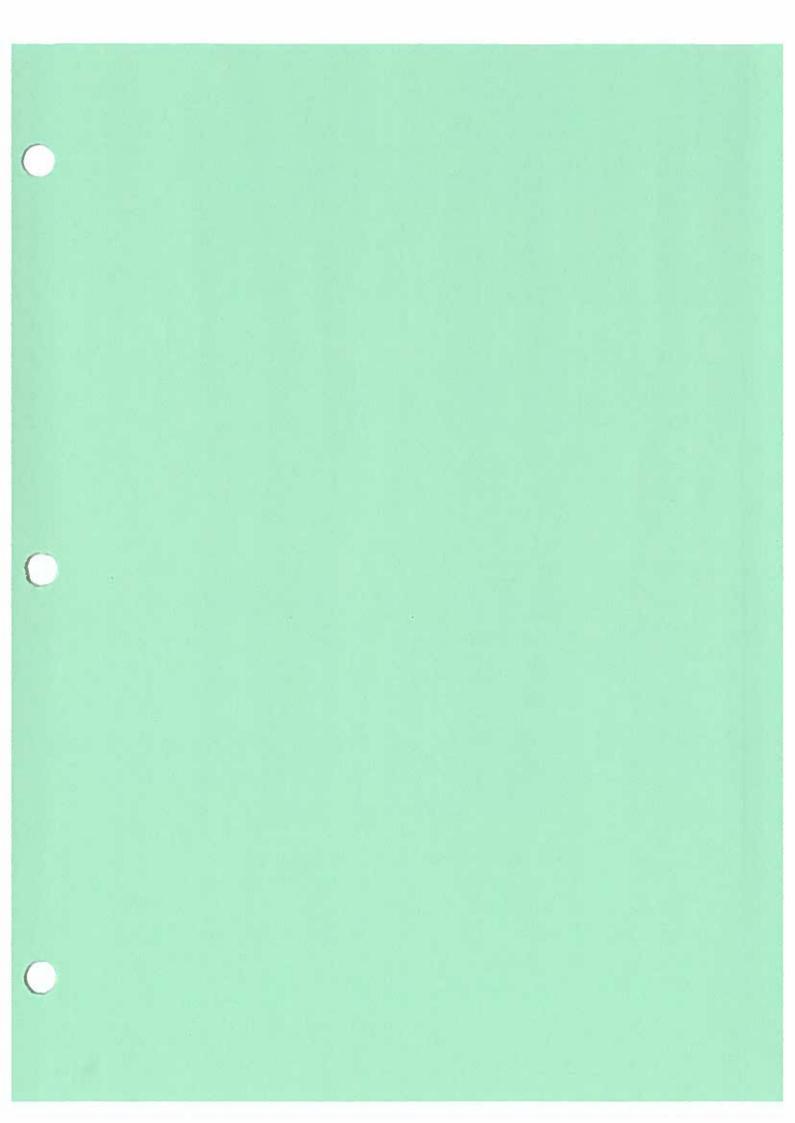

LEA Name	Greater Clark County Schools			
Building Name	River Valley Middle School			
HA#	04			
Type of Material	Miscellaneous Material			
Quantity of Material	9,564 SF			
Material Location Throughout the I	building			
Material Description Mastic				
Comments No mastic was e	exposed to inspect.			
Does Material Contain As	bestos? Assumed			
Is it Friable?	No			
<b>Original Inspection Date</b>	06/01/1995			
Current Surveillance Date	01/09/2001			
Current Assessment Ratio	ng NR Not Required			
Cause of Damage	No Damage			
Accessible	No			
Potential for Damage	Low			
Removed	No			
Planned Response Action	0 & M			
Inspector	CatikaWh			

Patrick E. Wilson

Inspector

State Accreditation Number

C

(

r	LEA Name	Greater C	lark County Sc	hools		
	Building Name	River Valle	ey Middle School			
	HA#	Α				
	Type of Material	Miscellane	eous Material			
	Quantity of Material	2,200 LF				
	Material Location Throughout the b	uilding				
	Material Description Cove base					
	black cove base.	Some dan	nage on 2nd fl	lway on the first floor level and replaced with foor in the home ec room and the art room. The for has new looking black cove base.		
	Does Material Contain Ast	estos?	Assumed			
	Is it Friable?		No			
	Original Inspection Date		05/31/1995			
	Current Surveillance Date		01/09/2001			
	Current Assessment Rating		NR	Not Required		
$\sim$	Cause of Damage		Physical Damage			
	Accessible		Yes			
	Potential for Damage		Low			
	Removed		No			
	Planned Response Action		0 & M			
	Inspector		(	Patrick E. Wilson		
	State		Indiana			
	Accreditation Number		190824065			

5	LEA Name	Greater C	lark County Scho	ols
	Building Name	River Valley Middle School		
	HA#	В		
	Type of Material	Miscellane	eous Material	
	Quantity of Material	Approx. 7	50 SF	
	Material Location Throughout the b	ouilding		
Material Description Cove base mastic				
	Comments Material is in goo	d conditior	n where exposed.	
	Does Material Contain As	bestos?	Assumed	
	Is it Friable?		No	
	Original Inspection Date		05/31/1995	
	Current Surveillance Date		01/09/2001	
	Current Assessment Ratin	g	NR	Not Required
	Cause of Damage		No Damage	
	Accessible		No	
	Potential for Damage		Low	
-2	Removed		No	
	Planned Response Action		0 & M	
	Inspector		C	thewit

 $\omega$ -Patrick E. Wilson

State **Accreditation Number** 

	LEA Name	Greater C	lark County Se	ichools
	Building Name	River Valle	ey Middle Sch	וססר
	HA#	С		
	Type of Material	Miscellane	eous Material	
	Quantity of Material	Approx. 5	0 SF	
	Material Location 2nd floor mecha	nical room		
	Material Description Shock joints			
	Comments The only 3 place All shock joint m			as seen was on 3 new units tied into old ductwork. on.
	Does Material Contain As	bestos?	Assumed	
	Is it Friable?		No	
	Original Inspection Date		05/31/1996	
	Current Surveillance Date		01/09/2001	
	Current Assessment Ratir	ig	NR	Not Required
	Cause of Damage		No Damage	
	Accessible		Yes	
~	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		0 & M	0
	Inspector			PatriceWL

Patrick E. Wilson

State Accreditation Number

C

	LEA Name	Greater C	lark County Schoo	ols
	Building Name	River Valle	ey Middle School	
	HA#	04		
	Type of Material	Miscellane	eous Material	
	Quantity of Material	9,564 SF		
	Material Location Throughout the b	uilding		
	Material Description Mastic			
	Comments No mastic was ex	xposed to i	inspect.	
	Does Material Contain Ast	pestos?	Assumed	
	Is it Friable?		No	
	Original Inspection Date		06/01/1995	
	Current Surveillance Date		06/29/2000	
	Current Assessment Ratin	g	NR	Not Required
	Cause of Damage		No Damage	
	Accessible	3 0	No	
5	Potential for Damage		Low	
2	Removed		No	
	Planned Response Action		0 & M	

Inspector

C

0

T

State Accreditation Number

<u>Jeorge / F. Ble</u> George William Ogle

-	LEA Name Greater		lark County Sc	hools		
(	Building Name	ey Middle School				
	HA#					
	Type of Material	eous Material				
	Quantity of Material	Unquantif	ied LF			
	Material Location Throughout build	ding				
	Material Description Cove Base					
	black cove base.	Some dar	mage on 2nd fl	oor in the h	e first floor level and replaced with ome ec room and the art room. The I looking black cove base.	
	Does Material Contain As	bestos?	Assumed			
	Is it Friable?		No			
	Original Inspection Date		05/31/1995			
	Current Surveillance Date		06/29/2000			
	Current Assessment Rating		NR	Not Red	quired	
0	Cause of Damage		No Damage			
C	Accessible		Yes			
	Potential for Damage		Low			
	Removed		Νο			
	Planned Response Action		0 & M			
	Inspector			Genge George W	What Juliam Ogle	

State

C

**Accreditation Number** 


r.	LEA Name	Greater C	lark County S	Schools	
C	Building Name River		rer Valley Middle School		
	HA#	В			
	Type of Material	Miscellane	eous Material	I	
	Quantity of Material	Unquantif	ied LF		
	Material Location Throughout build	ing			
	Material Description Cove Base Masti	с			
	Comments Material is in goo	d condition	n where expo	sed.	
	Does Material Contain As	bestos?	Assumed		
	Is it Friable?		No		
	Original Inspection Date		05/31/1995	5	
	Current Surveillance Date		06/29/2000		
	Current Assessment Ratin	ig	NR	Not Required	
	Cause of Damage		No Damage		
	Accessible		Νο		
C	Potential for Damage		Low		
C	Removed		No		
	Planned Response Action		0 & M		
	Inspector			Jener UF Ale George William Ogie	

State **Accreditation Number** 

	LEA Name	Greater C	lark County Scho	pols
1	Building Name	River Valle	ey Middle Schoo	1
	HA#	С		
	Type of Material	Miscellane	eous Material	
	Quantity of Material	Unquantif	ied SF	
	Material Location 2nd Floor Mecha	nical Room	I	
	Material Description Shock Joints			
	Comments The only 3 place All shock joint m	•	seen was on 3 new units tied into old ductwork.	
	Does Material Contain As	bestos?	Assumed	
	Is it Friable?		No	
	Original Inspection Date Current Surveillance Date Current Assessment Rating Cause of Damage		05/31/1996	
			06/29/2000	
			NR	Not Required
			No Damage	
6	Accessible		Yes	
L	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		0 & M	
	Inspector			George W Cale

George William Ogle

State **Accreditation Number** 

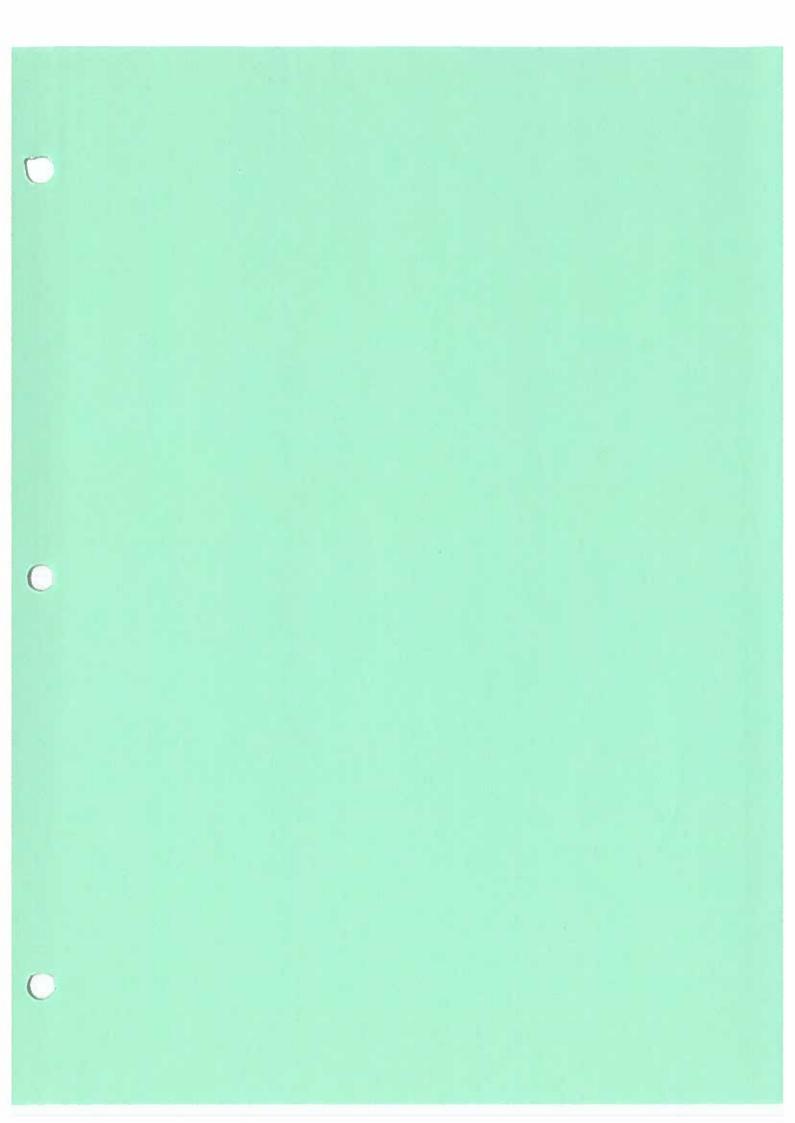

LEA Name	Greater C	lark County Sch	hools		
Building Name	River Valley Middle School				
HA#	04				
Type of Material	Miscellane	eous Material			
Quantity of Material	9564 SF				
Material Location Throughout the I	building				
Material Description Mastic					
Comments Material is cover	ed with car	pet. It is not e	xposed to inspect.		
Does Material Contain Asbestos?		Assumed			
Is it Friable?		No			
Original Inspection Date		06/01/1995			
Current Surveillance Date		12/08/1999			
Current Assessment Ratir	ıg	NR	Not Required		
Cause of Damage		No Damage			
Accessible		No			
Potential for Damage		Low			
Removed		No			
Planned Response Action		0 & M			
1			111 11/2011		

Inspector

battall

Matthew Wallace

State Accreditation Number

191219020

C	LEA Name	Greater C	Clark County Schools			
(	Building Name	River Val	ley Middle School			
	HA# A					
	Type of Material	Miscellan	eous Material			
	Quantity of Material	Unquanti	fied LF			
	Material Location Throughout build	ing				
Le <b>t</b>	Material Description Cove Base					
	black cove base. Some da		mage on 2nd flo	way on the first floor level and replaced with or by the home ec room and the art room. T ridor has some loose and missing pieces.		
	Does Material Contain As	bestos?	Assumed			
	Is it Friable?		No			
	Original Inspection Date		05/31/1995			
	Current Surveillance Date		12/08/1999			
	Current Assessment Ratir	ıg	NR	Not Required		
-	Cause of Damage Accessible Potential for Damage		No Damage			
(			Yes			
~			Low			
	Removed		No			
	Planned Response Action		0 & M			
	Inspector			Matthew Wallace		
	State		Indiana			

Accreditation Number

(

-(

2.00

191219020

.

	LEA Name	Greater C	lark County Sch	ools
(	Building Name	River Vall	ey Middle Schoo	l l
5.157471	HA#	В		
	Type of Material	Miscellan	eous Material	
	Quantity of Material	Unquantif	ied LF	
	Material Location Throughout build	ling		
	Material Description Cove Base Mast	ic		
	Comments Material appears	to be in go	ood condition wh	nere exposed.
	Does Material Contain As	bestos?	Assumed	
	Is it Friable?		No	
	<b>Original Inspection Date</b>		05/31/1995	
	Current Surveillance Date	ł	12/08/1999	
	Current Assessment Ratin	ng	NR	Not Required
	Cause of Damage		No Damage	
	Accessible		No	
C	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		0 & M	
	Inspector			Mattick

Inspector

Matthew Wallace

State **Accreditation Number** 

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	С
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified SF
Material Location 2nd Floor Mecha	nical Room
Material Description Shock Joints	
Comments Material is in goo	od condition.
Does Material Contain As	bestos? Assumed
Is it Friable?	No
<b>Original Inspection Date</b>	05/31/1996
Current Surveillance Date	12/08/1999
Current Assessment Ratin	ng NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	0 & M
	11 Altall

Inspector

MIIMAL Matthew Wallace

State **Accreditation Number** 



LEA Name	Greater C	Greater Clark County Schools				
Building Name	River Valle	ley Middle School				
HA#	04					
Type of Material	Miscellan	eous Material				
Quantity of Material	9564 SF					
Material Location Throughout the	building					
Material Description Mastic						
Comments Material is expos will be covered v			he first floor level It is in good condition. It			
Does Material Contain As	sbestos?	Assumed				
Is it Friable?		No				
<b>Original Inspection Date</b>		06/01/1995				
Current Surveillance Date	•	06/24/1999				
Current Assessment Rati	ng	NR	Not Required			
Cause of Damage		No Damage				
Accessible		No				
Potential for Damage		Low				
Removed		No				
Planned Response Action	ı	0 & M				
Inspector			Matthew Wallace			

State Accreditation Number

1

LEA Name	Greater Cla	ark County Scho	ools
Building Name	River Valle	y Middle School	bi
HA#	Α		
Type of Material	Miscellane	ous Material	
Quantity of Material	Unquantifi	ed LF	
Material Location Throughout build	ing		
Material Description Cove Base			
Comments Material has bee 2nd floor by the			way on the first floor level. Some damage on room.
Does Material Contain As	bestos?	Assumed	
Is it Friable?		No	
Original Inspection Date		05/31/1995	
Current Surveillance Date		06/24/1999	
Current Assessment Ratir	ng	NR	Not Required
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage		Low	
Removed		No	
Planned Response Action		0 & M	1/1 /10 / 1
Inspector			Matthew Wallace

State Accreditation Number

LEA Name	Greater C	lark County Sch	ools
Building Name	River Vall	ey Middle Schoo	bl
HA#	В		
Type of Material	Miscellane	eous Material	
Quantity of Material	Unquantif	ied LF	
Material Location Throughout build	ing		
Material Description Cove Base Masti	с		
Comments Material appears	to be in go	ood condition wh	here exposed.
Does Material Contain As	bestos?	Assumed	
Is it Friable?		No	
Original Inspection Date		05/31/1995	
Current Surveillance Date		06/24/1999	
Current Assessment Ratir	ng	NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action		0 & M	
Inspector			lat hall

inspector

and the second

Matthew Wallace

State Accreditation Number

LEA Name	Greater Clark County Schools	Clark County Schools			
Building Name	River Valley Middle School				
HA#	С				
Type of Material	Miscellaneous Material				
Quantity of Material	Unquantified SF				
Material Location 2nd Floor Mecha	nical Room				
Material Description Shock Joints					
Comments Material is in goo	od condition.				
Does Material Contain As	bestos? Assumed	Assumed			
Is it Friable?	No	No			
<b>Original Inspection Date</b>	05/31/1996				
Current Surveillance Date	06/24/1999				
Current Assessment Ratir	ng NR Not Required				
Cause of Damage	No Damage				
Accessible	Yes				
Potential for Damage	Low				
Removed	No				
Planned Response Action	0 & M				
Inspector	Mattal				

Matthew Wallace

0

State	
Accreditation	Number



LEA Name	Greater Clark County Schools					
Building Name	River Valley Middle School					
HA#	04					
Type of Material Quantity of Material Material Location Throughout the b	9564 SF	eous Material				
Material Description Mastic						
Comments Material is not ex	posed and	is assumed to be in good condition.				
Does Material Contain A	sbestos?	Assumed				
Is it Friable?		No				
Original Inspection Date		06/01/1995				
Current Surveillance Date		12/29/1998				
Current Assessment Rat	ing	NR Not Required				
Cause of Damage		No Damage				
Accessible		No				
Potential for Damage		Low				
Removed		No				
Planned Response Actio	n	O & M				
Inspector		Clint Vates				
State	6	Indiana				

Accreditation Number


LEA Name	Greater Clark County Schools					
Building Name	River Valley Middle School					
HA#	A					
Type of Material Quantity of Material Material Location Throughout build	Miscellaneous Material Unquantified LF ing					
Material Description Cove Base						
Comments Material has som	e damage (	on 2nd floor by the home ec room and the art room.				
Does Material Contain As	sbestos?	Assumed				
Is it Friable?		No				
Original Inspection Date		05/31/1995				
Current Surveillance Dat	e	12/29/1998				
Current Assessment Rat	ing	NR Not Required				
Cause of Damage		No Damage				
Accessible		Yes				
Potential for Damage		Low				
Removed		No				
Planned Response Actio	n	O & M				
Inspector	_	Clint Yates				
State		Indiana				

Accreditation Number

(

LEA Name	Greater Clark County Schools						
Building Name	River Valley Middle School						
HA#	В	-					
Type of Material Quantity of Material Material Location Throughout build	Miscellaneous Material Unquantified LF						
Material Description Cove Base Mast	ic						
Comments Material that is e	xposed on t	the 2nd floor is in good condition.					
Does Material Contain A	sbestos?	Assumed					
Is it Friable?		No					
Original Inspection Date		05/31/1995					
Current Surveillance Dat	te	12/29/1998					
Current Assessment Rat	ing	NR Not Required					
Cause of Damage		No Damage					
Accessible		No					
Potential for Damage		Low					
Removed		No					
Planned Response Actio	n	O & M					
Inspector		Clint Yates					
State	2	Indiana					
Accreditation Number		193804035					

LEA Name	Greater Clark County Schools					
Building Name	River Valley Middle School					
HA#	C					
Type of Material Quantity of Material Material Location 2nd Floor Mechae	Unquantif					
Material Description Shock Joints						
Comments Material is in goo	d condition.					
Does Material Contain As	bestos?	Assumed				
Is it Friable?		No				
Original Inspection Date		05/31/1996				
Current Surveillance Date		12/29/1998				
Current Assessment Rating		NR Not Required				
Cause of Damage		No Damage				
Accessible		Yes				
Potential for Damage		Low				
Removed		No				
Planned Response Action		0 & M				
Inspector		Clint Yates				
State	6	Indiana				
Accreditation Number		193804035				

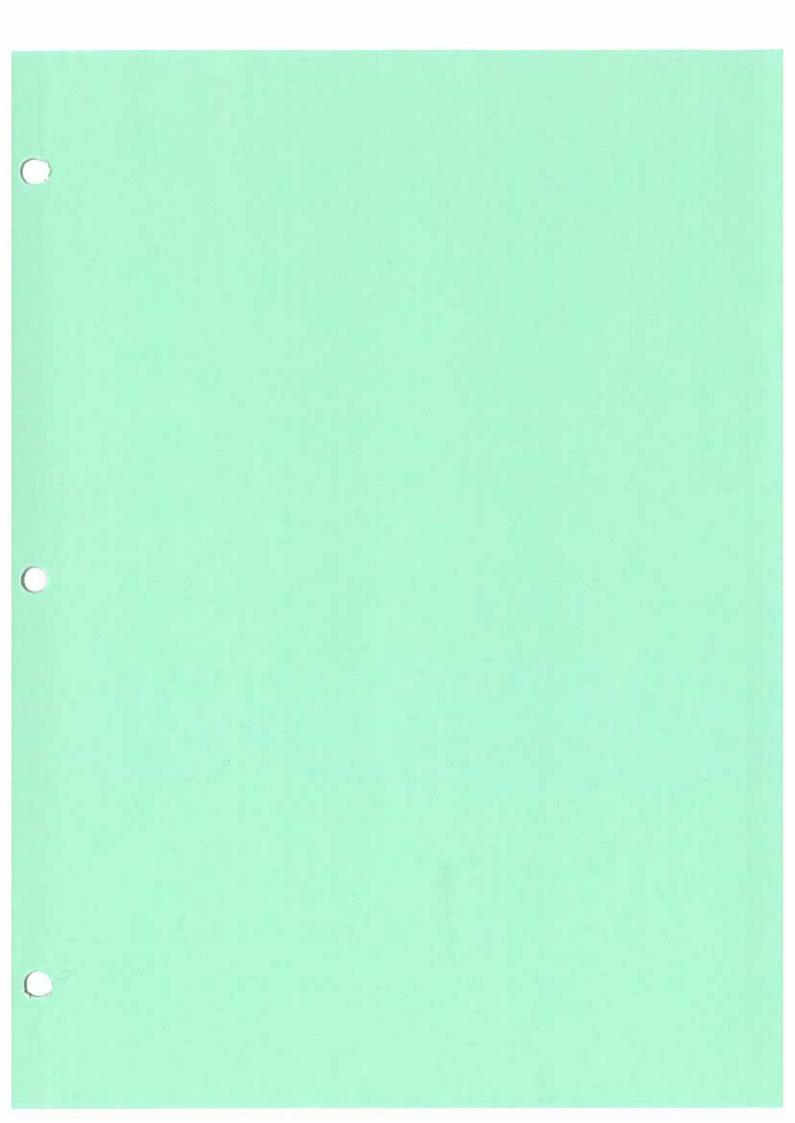

	LEA Name	Greater Clark County Schools						
	Building Name	River Valley Middle School						
	HA#	04						
	Type of Material	Miscellane	ous M	aterial				
	Quantity of Material	9,564 8	SF					
	Material Location Throughout the b	uilding						
	Material Description Mastic							
	Comments Material is not exp	oosed and i	is assu	imed to	be in	good c	ondition.	
Does Material Contain Asbestos?		Assu	med					
	ls it Friable?		No					
	<b>Original Inspection Date</b>		6/ 1/9	95				
	Current Surveillance Date	e	1/14/	98				
	Current Assessment Rati	ng	NR	Not Re	equired			
	Cause of Damage		No D	amage	•			
	Accessible		No					
	Potential for Damage		Low					
	Removed		No					
	Planned Response Action	n	0&1	M				
					(	1		

Inspector

Kapen Jott Karen Foxx

State Accreditation Number

	LEA Name	Greater Clark County Schools				
	Building Name	River Valley Middle School				
	HA#	A				
	Type of Material	Miscellaneous Material				
	Quantity of Material	LF				
	Material Location Throughout build	ing				
Material Description Cove Base						
Comments Material has some damage on 2nd floor by the home ec room and the art room						
Does Material Contain Asbestos?		Assumed				
	Is it Friable?		No			
Original Inspection Date		5/31/95				
Current Surveillance Date		1/14/98				
	Current Assessment Rati	ng	NR	Not Required		
Cause of Damage		No Damage				
Accessible		Yes				
	Potential for Damage		Low			
	Removed		No			
	Planned Response Action	n	0&	Μ		

Inspector

Karen Foxx

State Accreditation Number

	5-2			
1	LEA Name	Greater C	lark C	ounty Schools
	Building Name	<b>River Val</b>	ley Mid	Idle School
	HA#	В		
	Type of Material	Miscellan	eous N	Naterial
	Quantity of Material		LF	
	Material Location Throughout building			
	Material Description Cove Base Mastic	5		
Comments Material that is exposed on th			the 2n	d floor is in good condition.
Does Material Contain Asbestos?		Assu	umed	
	Is it Friable?		No	
	<b>Original Inspection Date</b>		5/31	/95
	Current Surveillance Date	3	1/14	/98
	Current Assessment Rati	ng	NR	Not Required
	Cause of Damage		No [	Damage
	Accessible		No	
	Potential for Damage		Low	
	Removed		No	
	Planned Response Actio	n	0&	Μ

Inspector

Karen Foxx

State Accreditation Number

i. X	LEA Name	Greater Cla	ark Co	ounty Schools
	Building Name	<b>River Valle</b>	y Mid	idle School
	HA#	С		
	Type of Material	Miscellane	ous N	Material
	Quantity of Material	S	SF	
	Material Location 2nd Floor Mechar	nical Room		
	Material Description Shock Joints			
	Comments Material is in good	d condition.		
	Does Material Contain As	bestos?	Assu	umed
	Is it Friable?		No	
	Original Inspection Date		5/31	/96
	Current Surveillance Date	9	1/14	1/98
	<b>Current Assessment Rati</b>	ng	NR	Not Required
	Cause of Damage		No E	Damage
	Accessible		Yes	
	Potential for Damage		Low	,
	Removed		No	
	Planned Response Action	า	0&	М
				C i

Inspector

Karen Foxx

State Accreditation Number

LEA Name	Greater Clark County Schools			
Building Name	River Valley Middle School			
HA#	4			
Type of Material	Miscellan	eous Material		
Quantity of Material	9,564	SF		
Material Location Throughout the b	uilding			
Material Description Mastic				
Comments Material is not exposed and is assumed to be in good condition.				
Does Material Contain Asbestos?		Assumed		
Is it Friable?		No		
Original Inspection Date		6/ 1/95		
Current Surveillance Date		7/ 3/97		
Current Assessment Rating		NR Not Required		
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage		Low		
Removed		Νο		
Planned Response Action		O & M		

Inspector

Karen Fox

State Accreditation Number

LEA Name Greater Cla		lark County Schools
Building Name River Valle		ey Middle School
HA#	A	
Type of Material	Miscellane	eous Material
Quantity of Material	I	LF
Material Location Throughout build	ling	
Material Description Cove Base		
Comments Material has some damage on 2nd floor by the home ec room and the art room.		
Does Material Contain A	sbestos?	Assumed
Is it Friable?		No
Original Inspection Date	:	5/31/95
Current Surveillance Da	te	7/ 3/97
Current Assessment Rat	ting	NR Not Required
Cause of Damage		No Damage
Accessible		Yes
Potential for Damage		Low
Removed		Νο
Planned Response Action	n	O & M

Inspector

(

Karen For Karen Foxx <del>64</del>

State Accreditation Number

LEA Name	Greater C	lark Co	ounty Schools
Building Name			dle School
-			
HA#	В		
Type of Material	Miscellane	eous N	laterial
Quantity of Material		LF	
Material Location Throughout build	ling		
Material Description Cove Base Mast	ic		
Comments Material that is e	exposed on t	the 2nd	d floor is in good condition.
Does Material Contain A	sbestos?	Assu	imed
Is it Friable?		No	
Original Inspection Date	•	5/31/	/95
Current Surveillance Da	te	7/ 3/	97
Current Assessment Rat	ting	NR	Not Required
Cause of Damage		No E	Damage
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Actio	o <b>n</b>	0&	M

Inspector

1

Karen Foxx


State **Accreditation Number** 

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	С
Type of Material	Miscellaneous Material
Quantity of Material	SF
Material Location 2nd Floor Mecha	inical Room
Material Description Shock Joints	
Comments Material is in goo	od condition.
Does Material Contain As	sbestos? Assumed
Is it Friable?	No
Original Inspection Date	5/31/96
Current Surveillance Dat	te 7/ 3/97
Current Assessment Rat	ing NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Actic	on O&M

Inspector

Karen Foxx

State Accreditation Number

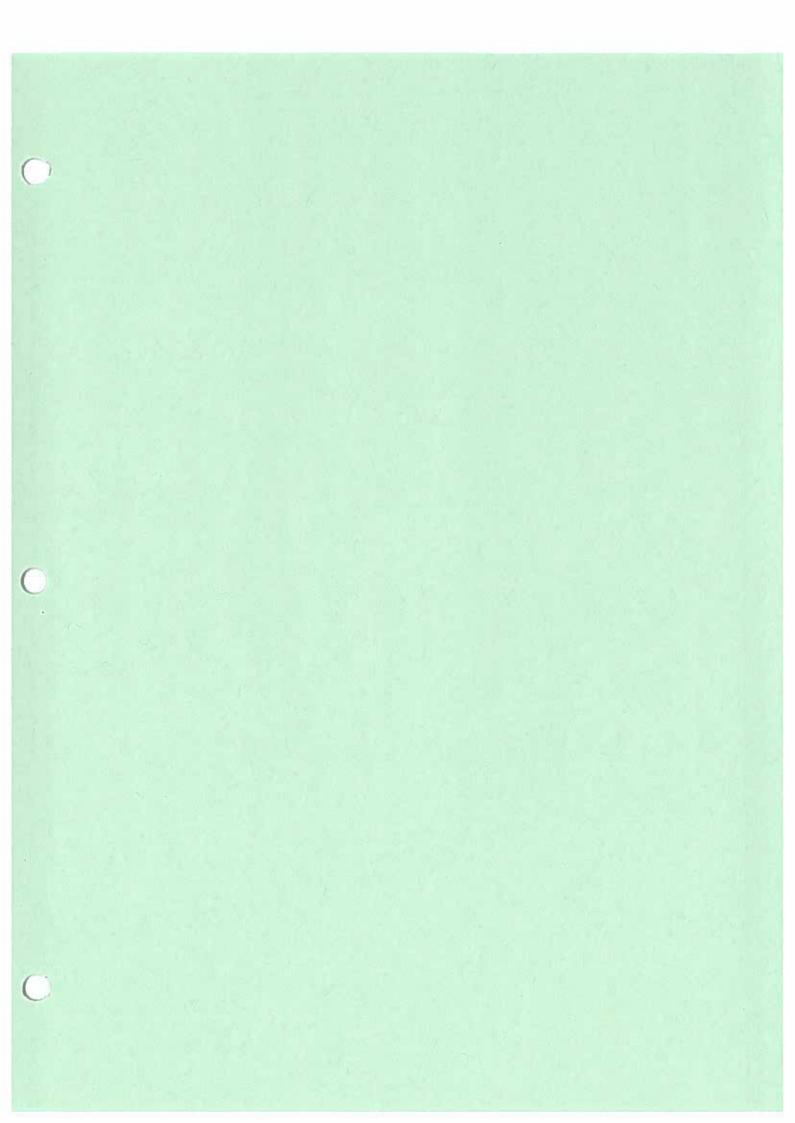

LEA Name	Greater Clark County Schools			
Building Name	River Valley Middle School			
HA#	4			
Type of Material	Miscellaneous Material			
Quantity of Material	9,564 SF			
Material Location Throughout the building				
Material Description Mastic				
Comments				
Material is assumed to be asbestos containing and is in good condition. No change				

Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	6/ 1/95
Current Surveillance Date	12/16/96
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	0 & M

Inspector

\_ Clint Yates

State Accreditation Number

LEA Name Greater Cl		ark County Schools	
Building Name River Valle		y Middle School	
HA#	А		
Type of Material	Miscellane	ous Material	
Quantity of Material	L	F	
Material Location Throughout build	ing		
Material Description Cove Base			
Comments Material is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition.			
Does Material Contain Asbestos?		Assumed	
ls it Friable?		No	
Original Inspection Date		5/31/95	
Current Surveillance Dat	e	12/16/96	
Current Assessment Rating		NR Not Required	
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage		Low	
Removed		No	
Planned Response Actio	n	O & M	

Inspector

Clint Yates

State Accreditation Number

LEA Name	Greater Cla	ark County Schools	
Building Name River V		y Middle School	
HA#	В		
Type of Material	Miscellaneo	ous Material	
Quantity of Material	L	F	
Material Location Throughout build	ing		
Material Description Cove Base Masti	С		
Comments			
Material is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition.			
Does Material Contain Asbestos?		Assumed	
ls it Friable?		No	
Original Inspection Date		5/31/95	
Current Surveillance Date		12/16/96	
Current Assessment Rating		NR Not Required	
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action		O & M	

Inspector

Clint Yates


State Accreditation Number

LEA Name	Greater Clark County Schools		
Building Name	River Valley Middle School		
HA#	С		
Type of Material	Miscellaneous Material		
Quantity of Material	SF		
Material Location 2nd Floor Mecha	nical Room		
Material Description Shock Joints			
Comments			
	Material is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition.		
Does Material Contain A	sbestos? Assumed		
Is it Friable?	No		
Original Inspection Date	5/31/96		
Current Surveillance Da	te 12/16/96		
Current Assessment Rat	ing NR Not Required		
Cause of Damage	No Damage		
Accessible	Yes		
Potential for Damage	Low		
Removed	No		
Planned Response Action	n O&M		

Inspector

Clint Yates

State Accreditation Number

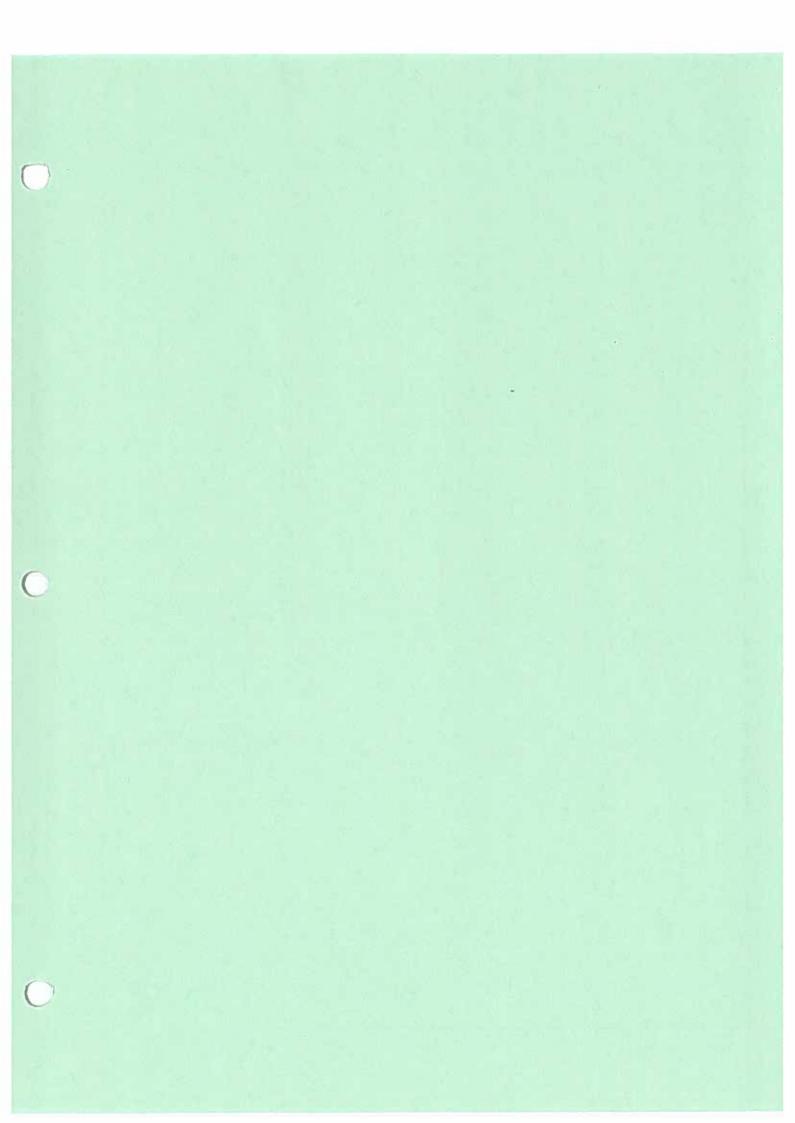

LEA Name	Greater Clark County Schools	
Building Name	River Valley Middle School	
HA#	1	
Type of Material	Miscellaneous Material	
Quantity of Material	1	
Material Location Boiler Room		
Material Description Boiler Gasket		
Comments		
Replaced with nor	n-ACM gasket in 1994.	
Does Material Contain Asl	bestos?	
Is it Friable?	No	
Original Inspection Date		
Current Surveillance Date	6/24/96	
Current Assessment Rating		
Cause of Damage		
Accessible	No	
Potential for Damage		
Removed Planned Response Action	Yes	

Inspector

But Saddis

Rex Gaddis

State Accreditation Number

LEA Name	Greater Clark County Schools			
Building Name	River Valley Middle School			
HA# 4				
Type of Material	Miscellaneous Material			
Quantity of Material	9,564	SF		
Material Location Throughout the building				
Material Description Mastic				
Comments				
Material is assumed to be asbestos containing and is in good condition. No change.				
Does Material Contain Asbestos?		Assumed		
Is it Friable?		No		
Original Inspection Date		6/ 1/95		
Current Surveillance Date		6/24/96		

**Current Assessment Rating** 

Cause of Damage

Accessible

Potential for Damage

Removed Planned Response Action 6/ 1/95 6/24/96 NR Not Required No Damage No Low No O & M

Inspector

N Xhadis

Rex Gaddis

State Accreditation Number

LEA Name	Greater Cl	ark County Schools	
Building Name	River Valley Middle School		
HA#	А		
Type of Material	Miscellane	eous Material	
Quantity of Material	l	_F	
Material Location Throughout buil	ding		
Material Description Cove Base			
Comments Material is assur Material is in go		psitive and will be treated as ACM until it is sampled.	
Does Material Contain A	sbestos?	Assumed	
ls it Friable?		No	
Original Inspection Date	•	5/31/95	
Current Surveillance Da	ite	6/24/96	
Current Assessment Ra	ting	NR Not Required	
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage		Low	
Removed		No	
Planned Response Acti	on	O & M	

Inspector

By Xhoddis

Rex Gaddis

State Accreditation Number

LEA Name	Greater Clark County Schools			
Building Name	River Valley Middle School			
HA#	В			
Type of Material	Miscellane	Miscellaneous Material		
Quantity of Material	LF			
Material Location Throughout building				
Material Description Cove Base Mast	ic			
Comments Material is assun Material is in goo	•	ositive and will be treated as ACM until it is sampled.		
Does Material Contain Asbestos? Assumed		Assumed		
Is it Friable?		No		
Original Inspection Date		5/31/95		
Current Surveillance Date		6/24/96		
Current Assessment Rating		NR Not Required		
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage		Low		
Removed		No		
Planned Response Action	on	O & M		

Inspector

Bed & the

Rex Gaddis

State Accreditation Number


LEA Name	Greater Clark County Schools		
Building Name	River Valley Middle School		
HA#	С		
Type of Material	Miscellaneous Material		
Quantity of Material	SF		
Material Location 2nd Floor Mechanical Room			
Material Description Shock Joints			
Comments			
Material is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition.			
Does Material Contain Asbestos? Assumed			
ls it Friable?	No		
<b>Original Inspection Date</b>	5/31/96		
Current Surveillance Dat	te 6/24/96		
Current Assessment Rat	ting NR Not Required		
Cause of Damage	No Damage		
Accessible	Yes		
Potential for Damage	Low		
Removed	No		
Planned Response Actio	on O&M		

Inspector

Try Xaddus

Rex Gaddis

State Accreditation Number

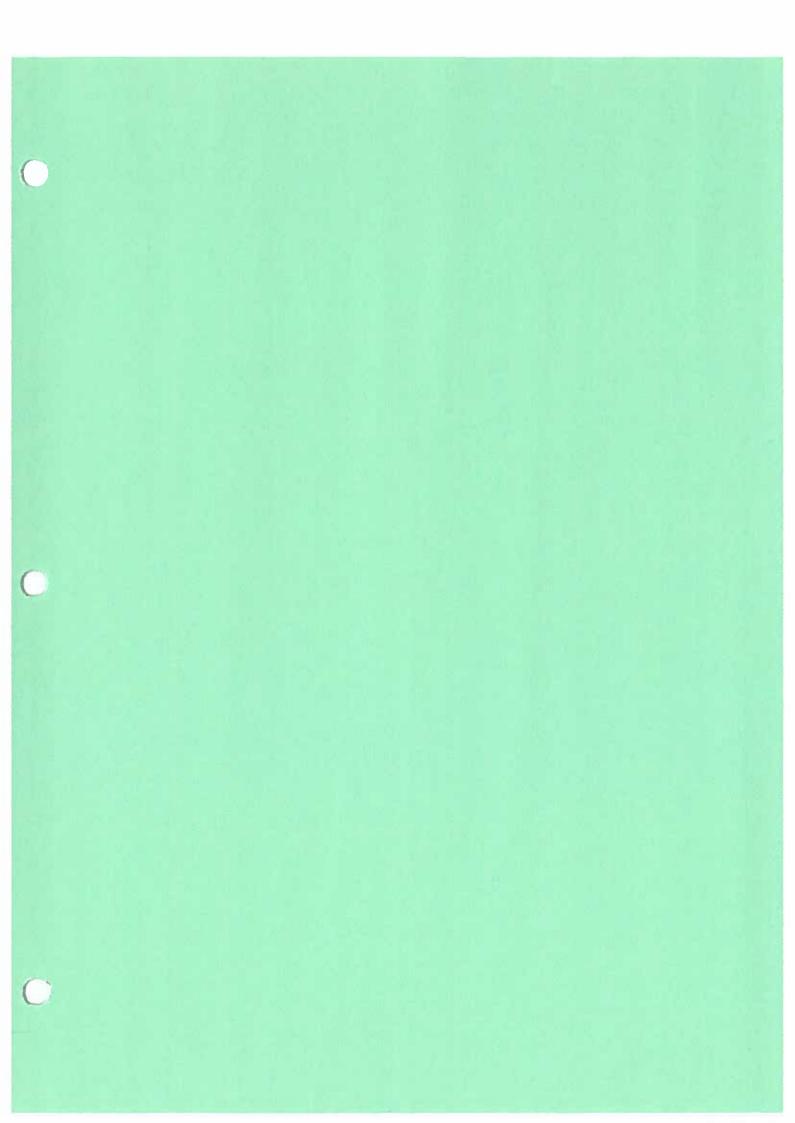

Clint Yates

LEA NAME: Greater Clark County Schools BUILDING NAME: River Valley Middle School HA#: 1 TYPE OF MATERIAL: Miscellaneous Material QUANTITY OF MATERIAL: 1 MATERIAL LOCATION: Boiler Room MATERIAL DESCRIPTION: Boiler Gasket

Replaced with non-ACM gasket in 1994.

IS MATERIAL FRIABLE? NO ORIGINAL INSPECTION DATE: CURRENT SURVEILLANCE DATE: 12/06/95 CURRENT ASSESSMENT RATING: CAUSE OF DAMAGE: ACCESSIBLE: NO POTENTIAL FOR DAMAGE: REMOVED: YES STATE: Indiana

Greater Clark County Schools

River Valley Middle School

LEA NAME:

BUILDING NAME:

HA#:

TYPE OF MATERIAL: Miscellaneous Material

4

QUANTITY OF MATERIAL: 9,564SF

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Mastic

COMMENTS:

Material is assumed to be asbestos containing and is in good condition.

IS MATERIAL FRIABLE?	NO	
ORIGINAL INSPECTION DATE:	06/01/95	
CURRENT SURVEILLANCE DATE:	12/06/95	
CURRENT ASSESSMENT RATING:	NR Not Required	
CAUSE OF DAMAGE:	No Damage	
ACCESSIBLE:	NO	
POTENTIAL FOR DAMAGE:	Low	
REMOVED:	NO	
STATE:	Indiana	

INSPECTOR NAME: Clint Yates

River Valley Middle School

LEA NAME:

Greater Clark County Schools

BUILDING NAME:

HA#:

TYPE OF MATERIAL: Miscellaneous Material

Α

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE?	NO	
ORIGINAL INSPECTION DATE:		
CURRENT SURVEILLANCE DATE:	12/06/95	
CURRENT ASSESSMENT RATING:	NR Not Required	
CAUSE OF DAMAGE:	No Damage	
ACCESSIBLE:	YES	
POTENTIAL FOR DAMAGE:	Low	
REMOVED:	NO	
STATE :	Indiana	

Clint Yates

INSPECTOR NAME:

LEA NAME:

Greater Clark County Schools

River Valley Middle School

BUILDING NAME:

HA#:

TYPE OF MATERIAL: Miscellaneous Material

В

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base Mastic

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE?	NO
ORIGINAL INSPECTION DATE:	
CURRENT SURVEILLANCE DATE:	12/06/95
CURRENT ASSESSMENT RATING:	NR Not Required
CAUSE OF DAMAGE:	No Damage
ACCESSIBLE:	NO
POTENTIAL FOR DAMAGE:	Low
REMOVED:	NO
STATE:	Indiana

INSPECTOR NAME: Clint Yates

LEA NAME:

Greater Clark County Schools

River Valley Middle School

BUILDING NAME:

HA#:

TYPE OF MATERIAL: Miscellaneous Material

C

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

2nd Floor Mechanical Room

MATERIAL DESCRIPTION:

Shock Joints

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-frialbe and does not need an assessment rating at this time.

IS MATERIAL FRIABLE?	NO
ORIGINAL INSPECTION DATE:	
CURRENT SURVEILLANCE DATE:	12/06/95
CURRENT ASSESSMENT RATING:	NR Not Required
CAUSE OF DAMAGE:	No Damage
ACCESSIBLE:	YES
POTENTIAL FOR DAMAGE:	Low
REMOVED:	NO
STATE:	Indiana

INSPECTOR NAME: Clint Yates

THIRD YEAR REINSPECTIONS

Greater Clark County Schools

AHERA Program

#### **REINSPECTION PLAN**

#### **GREATER CLARK COUNTY SCHOOLS**

Reinspection by an accredited building inspector will be scheduled to be performed not more than three years from the date of the original inspection. The reinspection report will then be made a permanent part of this Management Plan. Reinspections will be performed every three years for as long as the building contains ACBM, and will be reinspected once within three years from the date that all ACBM has been removed.

Records of each reinspection should be maintained in this binder.

DATE PLANNED	DATE COMPLETED	COMPLETED BY
JUNE 2007	July 2007	Bill Ogle
_JUNE 2010_	June 2010	Jandy Shadley
<u>JUNE 2013</u>	April 2013	Jeff hechtin
JUNE 2016	April 2016	Brigan ( fee
JUNE 2019	May 2019	
_JUNE 2022		
<u>JUNE 2025</u>		

#### **REINSPECTION PLAN**

#### **GREATER CLARK COUNTY SCHOOLS**

#### **RIVER VALLEY MIDDLE SCHOOL**

The ACBM in this building shall be reinspected every three years to determine any change in the condition of the materials for as long they remain in the building. This reinspection will be conducted tri-annually by an accredited inspector.

The following table outlines the dates on which these inspections should take place in this school building.

**REINSPECTION SCHEDULE** 

DATE PLANNED

DATE COMPLETED

July '01 July '04

COMPLETED BY

JUNE 1992

JUNE 1995

JUNE 1998

JUNE 2001

JUNE 1992

ASBESTECH

<u>Alliance</u> <u>Alliance</u> <u>Y. Wilson</u> <u>C. Spicks</u>

JUNE 2004

**Reinspection Schedule** 

LEA Name	Greater Clark County School Corporation			
Building Name	River Valley Middle School			
Building Number	20			
HA ID	04			
HA Description	Mastic			
НА Туре	Miscellaneous Material			
HA Location	Throughout building			
Quantity	Approx. 9564	SF		
Comments	-	to inspect. Old carpeting was removed and the old ant. Ceramic wall tile in bathrooms was intact and		
Asbestos	Assumed			
Friable	No			
Original Inspection	6/1/1995			
Current Inspection	5/16/2019			

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

#### **Damage Assessment and Potential for Damage**

Percent Damaged %

Good Condition

**Physical Contact** 

Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Sean Stults

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	A		
HA Description	Cove Base		
НА Туре	Miscellaneous Material		
HA Location	Throughout the building (Light gray in locker rooms by gym)		
Quantity	Unquantified LF		
Comments	The material was removed nonfriable from the main hallway on the first floor		
	and replaced with black cove base. Most of the old cove base was removed during		
	the		
	summer of 2010. Remaining material was not in poor condition.		
Asbestos	Assumed		
Friable	No		
Original Inspection	5/31/1995		
<b>Current Inspection</b>	5/16/2019		

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action O&M

%

Inspector

Sean Stults

#### State IN

Accreditation Number 19A007184

LEA Name	Greater Clark County School Corporation		
Building Name	River Valley Middle School		
Building Number	20		
HA ID	В		
HA Description	Cove Base Mastic		
НА Туре	Miscellaneous Material		
HA Location	Throughout building		
Quantity	Approx. 750 SF		
Comments	This material was not visible to inspect.		
Asbestos	Assumed		
Friable	No		
<b>Original Inspection</b>	5/31/1995		
<b>Current Inspection</b>	5/16/2019		

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

#### **Damage Assessment and Potential for Damage**

Percent Damaged	%	Good Condition	
Physical Co	ontact	Vibration	<u>Air</u>
Low/No	ne	Low/None	Low/None

Planned Response Action O&M

Inspector

Sean Stults

LEA Name	Greater Clark County School Corporation
Building Name	River Valley Middle School
Building Number	20
HA ID	D
HA Description	Fire Doors
НА Туре	Miscellaneous Material
HA Location	Fire doors throughout the building
Quantity	Unquantified Unit(s)
Comments	Not assessed in original inspection. Will be added to management plan until properly
	sampled as they are suspect material.
Asbestos	Assumed
Friable	No
Original Inspection	6/30/2010
Current Inspection	5/16/2019

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Inspector

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action O&M

%

Sean Stults

LEA Name	Greater Clark County School Corporation
Building Name	River Valley Middle School
Building Number	20
HA ID	E
HA Description	Stage light wiring
НА Туре	Miscellaneous Material
HA Location	Stage
Quantity	Unquantified LF
Comments	This material was noted during the June 2011 6 month surveillance and will
	remain in the management plan until properly sampled.
Asbestos	Assumed
Friable	No
Original Inspection	6/27/2011
Oliginal hispection	0/2//2011
<b>Current Inspection</b>	5/16/2019

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Inspector

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action O&M

%

Sean Stults

LEA Name	Greater Clark County School Corporation
Building Name	River Valley Middle School
Building Number	20
HA ID	F
HA Description	Orange vinyl stair trends
НА Туре	Miscellaneous Material
HA Location	Gym Stairs
Quantity	Unquantified LF
Comments	This material was noted during the June 2011 6 month surveillance and will
	remain in the management plan until properly sampled. This material has some chipped
	and
	cracked edges, but overall not in poor condition.
Asbestos	Assumed
Friable	No
Original Inspection	6/27/2011
<b>Current Inspection</b>	5/16/2019

### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Sean Stults

#### State IN

Accreditation Number 19A007184

LEA Name	Greater Clark County School Corporation
Building Name	River Valley Middle School
Building Number	20
HA ID	G
HA Description	Stair tread mastic
НА Туре	Miscellaneous Material
HA Location	Gym Stairs
Quantity	Unquantified LF
Comments	This material was noted during the June 2011 6 month surveillance and will
	remain in the management plan until properly sampled.
Asbestos	Assumed
Friable	Νο
<b>Original Inspection</b>	6/27/2011
<b>Current Inspection</b>	5/16/2019

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Inspector

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Sean Stults

LEA Name	Greater Clark County School Corporation
Building Name	River Valley Middle School
Building Number	20
HA ID	н
HA Description	Black stair tread
НА Туре	Miscellaneous Material
HA Location	North end of building
Quantity	528 SF
Comments	This material is assumed to be positive and will be treated as ACM until it is properly
	sampled. This material was not in poor condition.
Asbestos	Assumed
Friable	No
<b>Original Inspection</b>	12/15/2011
Current Inspection	5/16/2019

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Inspector

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Sean Stults

LEA Name	Greater Clark County School Corporation
Building Name	River Valley Middle School
Building Number	20
HA ID	I
HA Description	Stair tread mastic under black tread
НА Туре	Miscellaneous Material
HA Location	North end of building
Quantity	528 SF
Comments	This material is assumed to be positive and will be treated as ACM until it is
	properly sampled. This material was not in poor condition.
Asbestos	Assumed
Friable	No
<b>Original Inspection</b>	12/15/2011
Current Inspection	5/16/2019

#### **Material Assessment**

Assessment Rating

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Inspector

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Sean Stults

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	04	
HA Description	Mastic	
НА Туре	Miscellaneous Material	
HA Location	Throughout building	
Quantity	Approx. 9564 SF	
Comments	There was no mastic exposed to inspect. Old carpeting was removed and the old mastic was coated with a sealant. Ceramic wall tile in bathrooms was intact and mastic was not visible to inspect.	
Asbestos	Assumed	
Friable	No	
<b>Original Inspection</b>	6/1/1995	
<b>Current Inspection</b>	4/27/2016	
Material Assessment		

Assessment Rating 5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged % 0

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation	
<b>Building Name</b>	River Valley Middle School	
Building Number	20	
HA ID	A	
HA Description	Cove Base	
НА Туре	Miscellaneous Material	
HA Location	Throughout the building (Light gray in locker rooms by gym)	
Quantity	Unquantified LF	
Comments	The material was removed nonfriable from the main hallway on the first floor	
	and replaced with black cove base. Most of the old cove base was removed during	
	the	
	summer of 2010. Remaining material was not in poor condition.	
Asbestos	Assumed	
Friable	No	
<b>Original Inspection</b>	5/31/1995	
<b>Current Inspection</b>	4/27/2016	

### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

#### State IN

Accreditation Number 19A001039

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	В	
HA Description	Cove Base Mastic	
НА Туре	Miscellaneous Material	
HA Location	Throughout building	
Quantity	Approx. 750 SF	
Comments	This material was not visible to inspect.	
Asbestos	Assumed	
Friable	No	
<b>Original Inspection</b>	5/31/1995	
<b>Current Inspection</b>	4/27/2016	

### **Material Assessment**

Assessment Rating 5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged	%	Good Condition	
Physical C	<u>ontact</u>	<u>Vibration</u>	<u>Air</u>
Low/No	one	Low/None	Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

Greater Clark County School Corporation	
River Valley Middle School	
20	
D	
Fire Doors	
Miscellaneous Material	
Fire doors throughout the building	
Unquantified Unit(s)	
Not assessed in original inspection. Will be added to management plan until properly sampled as they are suspect material.	
Assumed	
No	
6/30/2010	
4/27/2016	

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	E	
HA Description	Stage light wiring	
НА Туре	Miscellaneous Material	
HA Location	Stage	
Quantity	Unquantified LF	
Comments	This material was noted during the June 2011 6 month surveillance and will remain in	
	the management plan until properly sampled.	
Asbestos	Assumed	
Friable	No	
Original Inspection	6/27/2011	
Current Inspection	4/27/2016	

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation
<b>Building Name</b>	River Valley Middle School
Building Number	20
HA ID	F
HA Description	Orange vinyl stair trends
НА Туре	Miscellaneous Material
HA Location	Gym Stairs
Quantity	Unquantified LF
Comments	This material was noted during the June 2011 6 month surveillance and will remain in
	the management plan until properly sampled. This material has some chipped and
	cracked edges, but overall not in poor condition.
Asbestos	Assumed
Friable	No
<b>Original Inspection</b>	6/27/2011
<b>Current Inspection</b>	4/27/2016

### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

#### State IN

Accreditation Number 19A001039

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	G	
HA Description	Stair tread mastic	
НА Туре	Miscellaneous Material	
HA Location	Gym Stairs	
Quantity	Unquantified LF	
Comments	This material was noted during the June 2011 6 month surveillance and will remain in	
	the management plan until properly sampled.	
Asbestos	Assumed	
Friable	No	
Original Inspection	6/27/2011	
Current Inspection	4/27/2016	

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	н	
HA Description	Black stair tread	
НА Туре	Miscellaneous Material	
HA Location	North end of building	
Quantity	528 SF	
Comments	This material is assumed to be positive and will be treated as ACM until it is properly	
	sampled. This material was not in poor condition.	
Asbestos	Assumed	
Friable	No	
Original Inspection	12/15/2011	
Current Inspection	4/27/2016	

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation	
Building Name	River Valley Middle School	
Building Number	20	
HA ID	I	
HA Description	Stair tread mastic under black tread	
НА Туре	Miscellaneous Material	
HA Location	North end of building	
Quantity	528 SF	
Comments	This material is assumed to be positive and will be treated as ACM until it is	
	properly sampled. This material was not in poor condition.	
Asbestos	Assumed	
Friable	No	
Original Inspection	12/15/2011	
Current Inspection	4/27/2016	
current inspection	7/27/2010	

#### **Material Assessment**

**Assessment Rating** 

5 ACBM with potential for damage

### **Damage Assessment and Potential for Damage**

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	04
Type of Material	Miscellaneous Material
Quantity of Material	Approx. 9,564 SF
Material Location	
Throughout the b	uilding
Material Description	
Mastic	
Comments	
There was no may mastic was coated was not visible to	stic exposed to inspect. Old carpeting was removed and the old d with a sealant. Ceramic wall tile in bathrooms was intact and mastic inspect.
Does Material Contain Asbe	stos? Assumed
ls it Friable?	No
Original Inspection Date	6/1/1995
Current Reinspection Date	4/24/2013
Current Assessment Rating	NR Not Rated
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O&M
Inspector	

Jeffrey P. Rechtin

State Accreditation Number

C

 $\square$ 

1

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	Α
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Throughout the b	uilding (Light gray in locker rooms by gym)
Material Description	
Cove base	
Comments	
i obiaced MITLI DIG	removed nonfriable from the main hallway on the first floor and ok cove base. Most of the old cove base was removed during the Remaining material was not in poor condition.
Does Material Contain Asbe	stos? Assumed
Is it Friable?	No
Original Inspection Date	5/31/1995
<b>Current Reinspection Date</b>	4/24/2013
Current Assessment Rating	NR Not Rated
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	Yes
Planned Response Action	Remove
	CAPA TO-

Inspector

CT 10---

Jeffrey P. Rechtin

State Accreditation Number

LEA Name	Greater Clark County Schools				
Building Name	River Valley Middle School				
HA#	В				
Type of Material	Miscellaneous	Material			
Quantity of Material	Approx. 750 SF				
Material Location					
Throughout the b	uilding				
Material Description	51) 				
Cove base mastic	;				
Comments					
This material was not visible to inspect.					
Does Material Contain Asbe	stos? As:	sumed			
Is it Friable?	No				
<b>Original Inspection Date</b>	5/3	1/1995			
<b>Current Reinspection Date</b>	4/2	4/2013			
Current Assessment Rating	NR		Not Rated		
Cause of Damage		No Damage			
Accessible	No				
Potential for Damage	Lov	v			
Removed	No				
Planned Response Action	08	k M			
			and the second sec		

Inspector

AB-D-

Jeffrey P. Rechtin

State Accreditation Number

LEA Name	Greater Clark County Schools			
Building Name	River Valley Middle School			
HA#	D			
Type of Material	Miscellaneous Material			
Quantity of Material	Unquantified Each			
Material Location				
Fire doors throug	out the building			
Material Description				
Fire doors				
Comments				
Not assessed in sampled as they	riginal inspection. Will be added to management plan until properly re suspect material.			
Does Material Contain Asbe	stos? Assumed			
Is it Friable?	No			
<b>Original Inspection Date</b>	6/30/2010			
<b>Current Reinspection Date</b>	4/24/2013			
Current Assessment Rating	NR Not Rated			
Cause of Damage				
Accessible	Yes			
Potential for Damage	LOW			
Removed	No			
Planned Response Action	O & M			
Inspector	AB-B-			

Jeffrey P. Rechtin

State Accreditation Number

O

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	E
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location Stage	
Material Description	
Stage light wiring Comments	
This material was the management	noted during the June 2011 6 month surveillance and will remain in plan until properly sampled.
Does Material Contain Asbe	stos? Assumed
Is it Friable?	No
<b>Original Inspection Date</b>	6/27/2011
<b>Current Reinspection Date</b>	4/24/2013
Current Assessment Rating	NA Not Applicable
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	0 & M
Inspector	CAN CARD

Jeffrey P. Rechtin

State Accreditation Number

(

C

LEA Name	Greater Clark County Schools			
Building Name	River Valley Middle School			
HA#	F			
Type of Material	Miscellaneous Material			
Quantity of Material	Unquantified LF			
Material Location				
Gym Stairs				
Material Description				
Orange vinyl stair trends				
Comments				

This material was noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled. This material has some chipped and cracked edges, but overall not in poor condition.

#### **Does Material Contain Asbestos?** Assumed

	11000	inica	
Is it Friable?	No		
Original Inspection Date	6/27/	/2011	
<b>Current Reinspection Date</b>	4/24/	/2013	
Current Assessment Rating	NR	Not Rated	
Cause of Damage	Deter	rioraton & Physical Damage	
Accessible	Yes		
Potential for Damage	Low		
Removed	No		
Planned Response Action	0&1	N	
Inspector		ABD -	

Inspector

Jeffrey P. Rechtin

State Accreditation Number

LEA Name	Greater C	ark County Schoo	bls	
Building Name	River Valley Middle School			
HA#	G			
Type of Material	Miscellane	eous Material		
Quantity of Material	Unquantifi	ied LF		
Material Location				
Gym stairs				
Material Description				
Stair tread mastic				
Comments				
This material was the management	noted durir plan until pi	ng the June 2011 ( roperly sampled.	6 month surveillance and will remain in	
Does Material Contain Asbe	stos?	Assumed		
Is it Friable?		No		
<b>Original Inspection Date</b>		6/27/2011		
Current Reinspection Date		4/24/2013		
Current Assessment Rating		NA	Not Applicable	
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage		Low		
Removed		No		
Planned Response Action		O & M	and the second	

Inspector

9

Jeffrey P. Rechtin

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	н
Type of Material	Miscellaneous Material
Quantity of Material	528 SF
Material Location	
North end of build	ding
Material Description	
Black stair tread	
Comments	
This material is a sampled. This ma	ssumed to be positive and will be treated as ACM until it is properly aterial was not in poor condition.
Does Material Contain Asbe	estos? Assumed
Is it Friable?	No
Original Inspection Date	12/15/2011
<b>Current Reinspection Date</b>	4/24/2013
Current Assessment Rating	NR Not Rated
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
Inspector	CARD B

Jeffrey P. Rechtin

State Accreditation Number

C

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	I
Type of Material	Miscellaneous Material
Quantity of Material	528 SF
Material Location	
North end of buil	ding
Material Description	
Stair tread masti	c under black tread
Comments	
This material is a sampled. This ma	ssumed to be positive and will be treated as ACM until it is properly aterial was not in poor condition.
Does Material Contain Asbe	estos? Assumed
ls it Friable?	No
<b>Original Inspection Date</b>	12/15/2011
Current Reinspection Date	4/24/2013
Current Assessment Rating	NR Not Rated
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
Inspector	ATO D

Jeffrey P. Rechtin

State Accreditation Number

(

Ċ

LEA Name	Greater C	lark County So	chools	
Building Name	<b>River Valle</b>	ey Middle Sch	loc	
HA#	04			
Type of Material	Miscellane	ous Material		
Quantity of Material	9,564 SF			
Material Location				
Throughout the bu	uilding			
Material Description				
Mastic				
Comments				
There was no mas mastic was coated	astic exposed to inspect. Old carpeting was removed and the c ed with a sealant.			
Does Material Contain Asbe	stos?	Assumed		
Is it Friable?		No		
<b>Original Inspection Date</b>		6/1/1995		
<b>Current Reinspection Date</b>		6/30/2010		
<b>Current Assessment Rating</b>		NR	Not Required	
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage	12	Low		
Removed		No		
Planned Response Action		O & M		
Inspector	ć	A	dia AA ado	

Sandra Shadley

State

**Accreditation Number** 

IN 19A002323

r	LEA Name	Greate	r Cla	ark County Scho	ools	
	Building Name	River V	alle	y Middle School	1	
	HA#	Α				
	Type of Material	Miscella	ane	ous Material		
	Quantity of Material	2,200 L	F			
	Material Location					
	Throughout the bu	uilding				
	Material Description					
	Cove base					
	Comments					
	replaced with blac	k cove b	ase	e. Overall, this r	he main hallway on the first floor an material was not in poor condition. <i>A</i> ing the summer of 2010.	d All old
	Does Material Contain Asbe	stos?		Assumed		
	Is it Friable?			No		
	Original Inspection Date			5/31/1995		
	Current Reinspection Date			6/30/2010		
	<b>Current Assessment Rating</b>			NR	Not Required	
$\cap$	Cause of Damage			No Damage		
0	Accessible			Yes		
	Potential for Damage			Low		
	Removed			No		
	Planned Response Action			0 & M		
	Inspector	<		Dane	Sandra Shadley	

State

C

C

**Accreditation Number** 

IN 19A002323

LEA Name	Greater Clark County Schools							
Building Name	River Valley Middle School							
HA#	в	В						
Type of Material	Miscellan	Miscellaneous Material						
Quantity of Material	Approx. 7	50 SF						
Material Location								
Throughout the b	uilding	ilding						
Material Description								
Cove base masti	3							
Comments								
This material was	not visible	to inspect.						
Does Material Contain Asbe	stos?	Assumed						
Is it Friable?		No						
Original Inspection Date		5/31/1995						
<b>Current Reinspection Date</b>		6/30/2010						
Current Assessment Rating		NR	Not Required					
Cause of Damage		No Damage						
Accessible		No						
Potential for Damage		Low						
Removed		No						
Planned Response Action		O & M						
Inspector	<	Sand	Sandra Shadley					

State Accreditation Number

0

C

IN 19A002323

LEA Name	Greater C	lark County S	Schools	
Building Name	<b>River Valle</b>	ey Middle Sch	hool	
HA#	D			
Type of Material	Miscellane	ous Material	l	
Quantity of Material	Unquantifi	ed Each		
Material Location				
Fire doors through	nout the bui	ilding		
Material Description				
Fire doors				
Comments				
Not assessed in o sampled as they a	in original inspection. Will be added to management plan ever suspect material.			
<b>Does Material Contain Asbe</b>	stos?	Assumed		
Is it Friable?		No		
Original Inspection Date		6/30/2010		
Current Reinspection Date		6/30/2010		
<b>Current Assessment Rating</b>		NR	Not Required	
Cause of Damage				
Accessible		Yes		
Potential for Damage		LOW		
Removed		No		
Planned Response Action		O & M		
Inspector	$\langle$	San	dia Shadle	

Sandra Shadley

State Accreditation Number

C

1		0		-
	LEA Name	Greater Clark County Schools		
	Building Name	River Valley Middle School		
	HA#	04		
	Type of Material	Miscellane	ous Material	
	Quantity of Material	9,564 SF		
	Material Location			
	Throughout the bu	uilding		
	Material Description			
	Mastic			
	Comments			
	There was no mas	stic exposed	to inspect.	
	Does Material Contain Asbe	stos?	Assumed	
	Is it Friable?		No	
	Original Inspection Date		6/1/1995	
	Current Reinspection Date		7/11/2007	
	<b>Current Assessment Rating</b>		NR	Not Required
	Cause of Damage		No Damage	
ŝ	Accessible		No	
Ż	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		O & M	
				Nac. INKAI

inspector

(

State Accreditation Number

Indiana 191003027 4le

George William Ogle

-	LEA Name	Greater Cl	ark County Schoo	ols			
22	Building Name	River Valle	y Middle School				
	HA#	Α					
	Type of Material	Miscellane	ous Material				
	Quantity of Material	2,200 LF					
	Material Location						
	Throughout the bu	uilding					
	Material Description						
	Cove base						
	Comments						
	The material was	removed no	on-friable from the	t the building, mostly on the 2nd floor. e main hallway on the first floor and aterial was not in poor condition.			
	Does Material Contain Asbe	stos?	Assumed				
	ls it Friable?		No				
	Original Inspection Date		5/31/1995				
	Current Reinspection Date		7/11/2007				
	<b>Current Assessment Rating</b>		NR	Not Required			
	Cause of Damage		No Damage				
~	Accessible		Yes				
	Potential for Damage		Low				
	Removed		No				
	Planned Response Action		O & M				
				a shan a			

Inspector

<u>George</u> William Ogle

State Accreditation Number

	LEA Name	Greater C	ark County Sch	ools		
	Building Name	River Valley Middle School				
	HA#	В				
	Type of Material	Miscellane	ous Material			
	Quantity of Material	Approx. 78	50 SF			
	Material Location Throughout the bu	uilding				
	Material Description					
	Cove base mastic					
	Comments					
	Where visible, this	s material w	/as not in poor o	onditio	ר.	
	Does Material Contain Asbe	stos?	Assumed			
	Is it Friable?		No			
	Original Inspection Date		5/31/1995			
	Current Reinspection Date		7/11/2007			
	<b>Current Assessment Rating</b>		NR	Not	Requ	uired
	Cause of Damage		No Damage			
	Accessible		Νο			
~	Potential for Damage		Low			
	Removed		No			
	Planned Response Action		O & M	÷		
				0		

Inspector

0

George William Øgle

State Accreditation Number

LEA Name	Greater Clark County Schools				
Building Name	River Val	River Valley Middle School			
HA#	04				
Type of Material	Miscellan	eous Material			
Quantity of Material	9,564 SF	=			
Material Location Throughout the	building				
Material Description Mastic					
Comments Some floor tile r	nastic was	visible at the t	front entrance. It was not in poor condition.		
Does Material Contain As	sbestos?	Assumed			
Is it Friable?		No			
<b>Original Inspection Date</b>		6/1/1995			
Current Reinspection Dat	e	7/2/2004			
Current Assessment Rati	ng	NR	Not Required		
Cause of Damage		No Damage			
Accessible		No			
Potential for Damage		Low			
Removed		No	1		
Planned Response Actior	1	0 & M	AAAA		
Inspector		-	Christiaan Sparks		

State Accreditation Number

LEA Name	Greater Cl	ark County Scho	pols		
Building Name	River Valle	ey Middle School			
HA#	Α				
Type of Material	Miscellane	ous Material			
Quantity of Material	2,200 LF				
Material Location Throughout the b	uilding				
Material Description Cove base					
Comments Many pieces are loose and missing throughout the building. The material was remove non-friable from the main hallway on the first floor and replaced with black cove base Overall, this material was not in poor condition.					
Does Material Contain Asl	bestos?	Assumed			
Is it Friable?		No			
<b>Original Inspection Date</b>		5/31/1995			
Current Reinspection Date	•	7/2/2004			
Current Assessment Ratin	g	NR	Not Required		
Cause of Damage		No Damage			
Accessible		Yes			
Potential for Damage		Low			
Removed		No	/		
Planned Response Action		O & M	AAAA		
Inspector			W		

Inspector

Christiaan Sparks

State **Accreditation Number** 


LEA Name	Greater C	lark County Sch	ools		
Building Name	River Valley Middle School				
HA#	8				
Type of Material	Miscellan	eous Material			
Quantity of Material	Approx. 750 SF				
Material Location Throughout the building					
Material Description Cove base mast	ic				
Comments Where visible, th	nis material	was not in poor	condition.		
Does Material Contain As	sbestos?	Assumed			
Is it Friable?		No			
<b>Original Inspection Date</b>		5/31/1995			
<b>Current Reinspection Dat</b>	е	7/2/2004			
Current Assessment Rati	ng	NR	Not Required		
Cause of Damage		No Damage			
Accessible		No			
Potential for Damage		Low			
Removed		No	1		
Planned Response Action	I	O & M	Ath		
mapectur			Christiaan Sparks		

State Accreditation Number

LEA Name	Greater Clark County Sch	ools
Building Name	River Valley Middle Schoo	l .
HA#	С	
Type of Material	Miscellaneous Material	
Quantity of Material	Approx. 50 SF	
Material Location 2nd floor mechar	nical room	
Material Description Shock joints		
shock joint mater	rial was removed non-friable re not suspect for asbetos	nspection and it has been observed that all old e. The shock joint material currently in place is content. This material will be removed from the
Does Material Contain Asl	bestos? No	
Is it Friable?	No	
<b>Original Inspection Date</b>	5/31/1996	
Current Reinspection Date	e 7/2/2004	
Current Assessment Ratin	ng NA	Not Applicable
Cause of Damage	Not Applicable	
Accessible	No	
Potential for Damage	NA	
Removed	Yes	/
Planned Response Action	None	Add
Inspector		Christiaan Sparks

State Accreditation Number

C

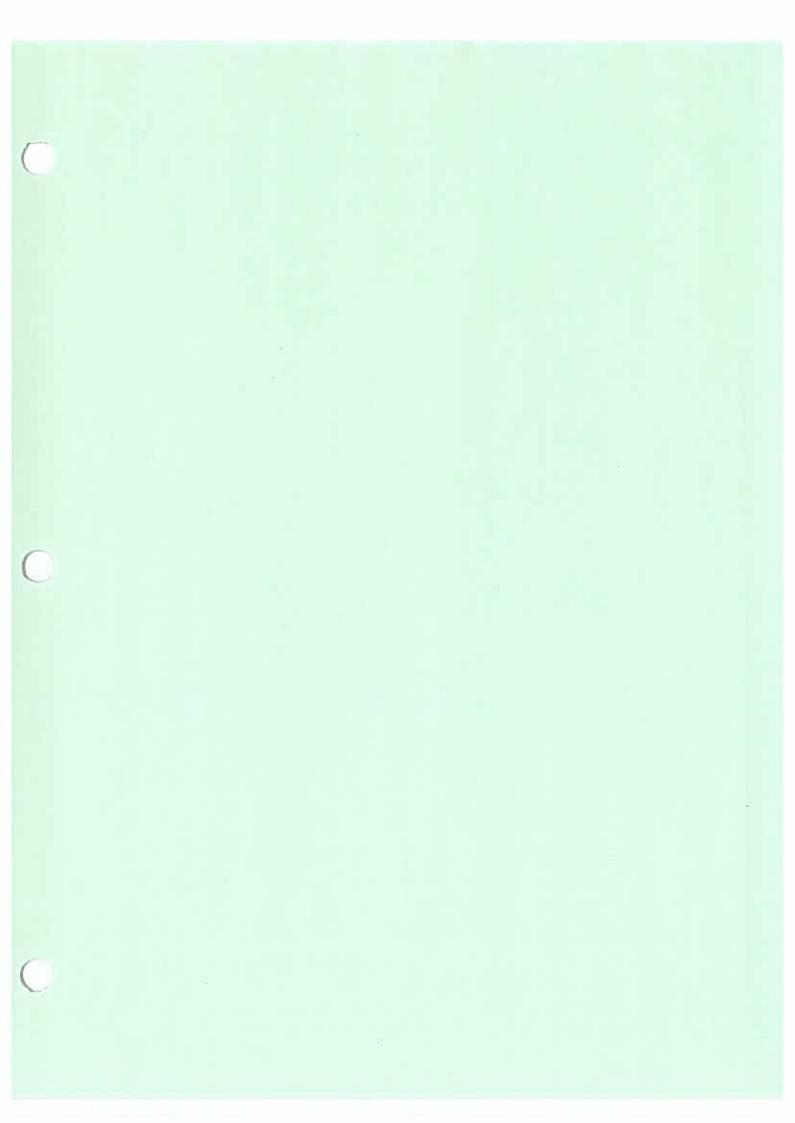

LEA Name	Greater C	Clark County Schools			
Building Name	River Valley Middle School				
HA#	04				
Type of Material	Miscellan	eous Material			
Quantity of Material	9,564 SF				
Material Location Throughout the I	ouilding				
Material Description Mastic					
Comments No mastic was exposed to inspect.					
Does Material Contain Asbestos?		Assumed			
Is it Friable?		No			
<b>Original Inspection Date</b>		06/01/1995			
<b>Current Reinspection Dat</b>	e	07/12/2001			
Current Assessment Ratio	ng	NR	Not Required		
Cause of Damage		No Damage			
Accessible		No			
Potential for Damage		Low			
Removed		No			
Planned Response Action		0 & M			
		1 -			

Inspector

Patrick Wilson 100 Patrick E. Wilson

State **Accreditation Number** 

6	LEA Name	Greater Clark County Schools			
(	Building Name	River Vall			
	HA#	А			
	Type of Material	Miscellan	eous Materia	al	
	Quantity of Material	2,200 LF			
	Material Location Throughout the I	ouilding			
	Material Description Cove base				
	black cove base	Some dan d the secor	mage on 2nd	d floor	ay on the first floor level and replaced with r in the home ec room and the art room. The ave pieces missing. C corridor has new looking
	Does Material Contain As	bestos?	Assumed		
	Is it Friable?		No		
	Original Inspection Date		05/31/199	95	
	<b>Current Reinspection Dat</b>	e	07/12/200	01	
	Current Assessment Rati	ng	NR		Not Required
$\bigcirc$	Cause of Damage		Physical D	amage	e
-	Accessible		Yes		
	Potential for Damage		Low		
	Removed		No		
	Planned Response Action	Ì	0 & M		
	Inspector			Pa	trick Wilson Kw Patrick E. Wilson

State Accreditation Number

 $\bigcirc$ 

	LEA Name	Greater Cl	ark County Schoo	bls	
	Building Name	River Valley Middle School			
	HA#	В			
	Type of Material	Miscellane	eous Material		
	Quantity of Material	Approx. 7	50 SF		
	Material Location Throughout the b	ouilding			
	Material Description Cove base masti	C			
Comments Material is in good conditior			where exposed.		
	Does Material Contain As	bestos?	Assumed		
	Is it Friable?		No		
	Original Inspection Date		05/31/1995		
	<b>Current Reinspection Date</b>	9	07/12/2001		
	Current Assessment Ratir	ng	NR	Not Required	
	Cause of Damage		No Damage		
	Accessible		No		
	Potential for Damage		Low		
	Removed		No		
	Planned Response Action		0 & M		
			$( \land$		

Inspector

Patrick E. Wilson Iw

State **Accreditation Number** 


i.	LEA Name	Greater C	lark County Sch	ools
	Building Name	River Valle		
	HA#	С		
	Type of Material	Miscellane	eous Material	
	Quantity of Material	Approx. 5	0 SF	
	Material Location 2nd floor mechar	nical room		
	Material Description Shock joints			
	Comments The only 3 places All shock joint ma			seen was on 3 new units tied into old ductwork.
	Does Material Contain Asl	bestos?	Assumed	
	Is it Friable?		No	
	Original Inspection Date		05/31/1996	
	Current Reinspection Date	•	07/12/2001	
	Current Assessment Ratin	ıg	NR	Not Required
	Cause of Damage		No Damage	
-	Accessible		Yes	
-1	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		0 & M	
	Inspector		Pa	trick, Wilson ww

Inspector

(

Patrick E. Wilson

State **Accreditation Number** 

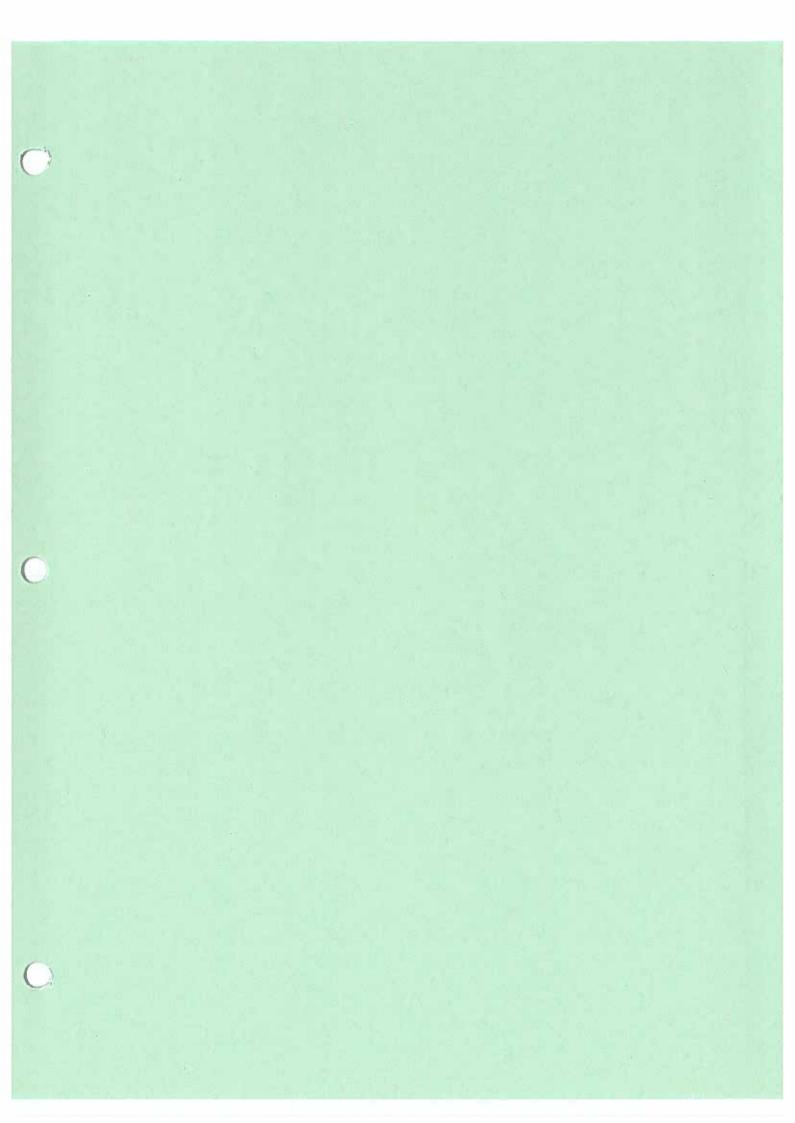

LEA Name	Greater Cl	ark County Schools
Building Name	River Valle	ey Middle School
HA#	04	
Type of Material	Miscellane	ous Material
Quantity of Material	9,564 8	SF
Material Location Throughout the bu	uilding	
Material Description Mastic		
Comments Material is not exp	osed and i	s assumed to be in good condition.
Does Material Contain As	bestos?	Assumed
Is it Friable?		No
Original Inspection Date		6/ 1/95
<b>Current Reinspection Dat</b>	е	6/ 1/98
<b>Current Assessment Ratin</b>	ng	NR Not Required
Cause of Damage		No Damage
Accessible		No
Potential for Damage		Low
Removed		No
Planned Response Action	n	O & M
Inspector	(	Clint Yates

State Accreditation Number

LEA Name	Greater Cl	ark County Schools
Building Name	River Valley Middle School	
HA#	Α	
Type of Material	Miscellane	eous Material
Quantity of Material	1	LF
Material Location Throughout build	ing	
Material Description Cove Base		
Comments Material has some damage on 2nd floor by the home ec room and the art room.		
Does Material Contain As	bestos?	Assumed
Is it Friable?		No
<b>Original Inspection Date</b>		5/31/95
Current Reinspection Da	te	6/ 1/98
Current Assessment Rati	ng	NR Not Required
Cause of Damage		No Damage
Accessible		Yes
Potential for Damage		Low
Removed		No
Planned Response Actio	n	0&M
Inspector	(	Clipit Yates

State Accreditation Number

C

C

LEA Name	Greater Clark County Schools
Building Name	River Valley Middle School
HA#	В
Type of Material	Miscellaneous Material
Quantity of Material	LF
Material Location Throughout buildi	ng
Material Description Cove Base Mastic	C
Comments Material that is ex	posed on the 2nd floor is in good condition.
Does Material Contain As	bestos? Assumed
Is it Friable?	No
<b>Original Inspection Date</b>	5/31/95
Current Reinspection Dat	te 6/ 1/98
Current Assessment Rati	ng NR Not Required
Cause of Damage	No Damage
Accessible	Νο
Potential for Damage	Low
Removed	No
Planned Response Action	n 0&M
	1/

Inspector


Clint Yates

State Accreditation Number

LEA Name	Greater Cl	ark County Schools	
Building Name	River Valle	ey Middle School	
HA#	С		
Type of Material	Miscellane	ous Material	
Quantity of Material	S	SF	**
Material Location 2nd Floor Mecha	nical Room		
Material Description Shock Joints			
Comments Material is in good	d condition.		
Does Material Contain As	bestos?	Assumed	
Is it Friable?		No	
<b>Original Inspection Date</b>		5/31/96	
Current Reinspection Dat	te	6/ 1/98	
Current Assessment Rati	ing	NR Not Required	
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage		Low	
Removed		No	
Planned Response Action	n	0&M	
Inspector	2		Clint Yates

State Accreditation Number

(

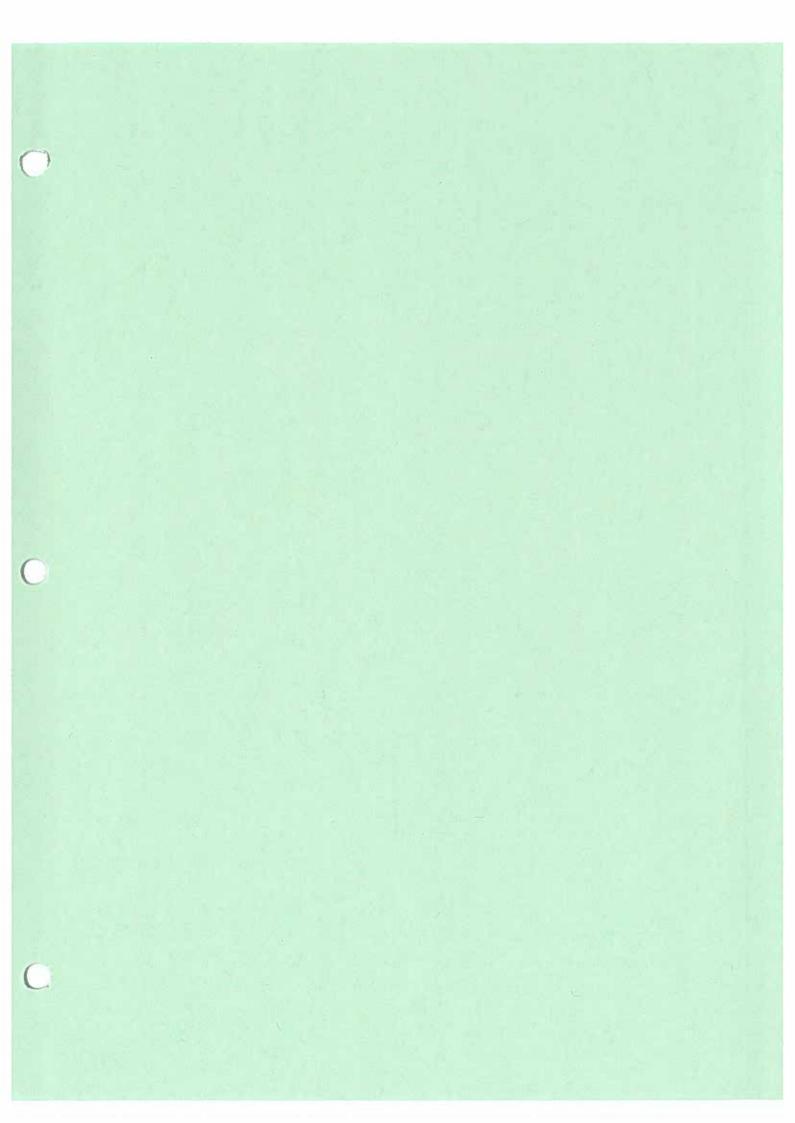

LEA NAME:	Greater Clark County School Corp.
BUILDING NAME:	River Valley Middle School
HA#:	1
TYPE OF MATERIAL:	Miscellaneous Material
QUANTITY OF MATERIAL:	1
MATERIAL LOCATION:	
Boiler Room	
MATERIAL DESCRIPTION:	
Boiler Gasket	
COMMENTS:	
Replaced with 1	non-ACM gasket in 1994.
IS MATERIAL FRIABLE?	NO
ORIGINAL INSPECTION D	ATE:
CURRENT REINSPECTION	DATE: 06/26/95
CURRENT ASSESSMENT RA	TING:
CAUSE OF DAMAGE:	
ACCESSIBLE:	NO
POTENTIAL FOR DAMAGE:	
REMOVED:	NO
CURRENT VIDEO TAPE: (TAPE NO/FOOTAGE)	
INSPECTOR NAME:	Rex Gaddis
STATE:	Indiana
ACCREDITATION NO .:	190908032

LEA NAME:Greater Clark County School Corp.BUILDING NAME:River Valley Middle SchoolHA#:4

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL: 9,564SF

MATERIAL LOCATION:

Throughout Building

#### MATERIAL DESCRIPTION:

Mastic

COMMENTS:

Material is assumed to be asbestos containing and is in good condition.

IS MATERIAL FRIABLE?	NO
ORIGINAL INSPECTION DATE:	06/01/95
CURRENT REINSPECTION DATE:	06/26/95
CURRENT ASSESSMENT RATING:	NR Not Required
CAUSE OF DAMAGE:	No Damage
ACCESSIBLE:	NO
POTENTIAL FOR DAMAGE:	Low
REMOVED:	NO
CURRENT VIDEO TAPE: (TAPE NO/FOOTAGE)	/
INSPECTOR NAME:	Box Xa

Indiana 190908032

ACCREDITATION NO.:

STATE:

LEA NAME:	Greater Clark County School Corp.
BUILDING NAME:	River Valley Middle School
HA# :	A
TYPE OF MATERIAL:	Miscellaneous Material
QUANTITY OF MATERIAL:	
MATERIAL LOCATION:	
Throughout Buil	ding

#### MATERIAL DESCRIPTION:

Cove Base

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is nonfriable and does not need an assessment rating at this time.

NO IS MATERIAL FRIABLE? ORIGINAL INSPECTION DATE: CURRENT REINSPECTION DATE: 06/26/95 NR Not Required CURRENT ASSESSMENT RATING: CAUSE OF DAMAGE: No Damage NO ACCESSIBLE: POTENTIAL FOR DAMAGE: Low NO **REMOVED:** / CURRENT VIDEO TAPE: (TAPE NO/FOOTAGE) INSPECTOR NAME: Indiana STATE: 190908032

ACCREDITATION NO.:

LEA NAME:	Greater Clark County School Corp.
BUILDING NAME:	River Valley Middle School
HA#:	В
TYPE OF MATERIAL:	Miscellaneous Material
QUANTITY OF MATERIAL:	
MATERIAL LOCATION:	

Throughout Building

#### MATERIAL DESCRIPTION:

Cove Base Mastic

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is nonfriable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO ORIGINAL INSPECTION DATE: 06/26/95 CURRENT REINSPECTION DATE: CURRENT ASSESSMENT RATING: NR Not Required CAUSE OF DAMAGE: No Damage NO ACCESSIBLE: Low POTENTIAL FOR DAMAGE: **REMOVED:** NO / CURRENT VIDEO TAPE: (TAPE NO/FOOTAGE) INSPECTOR NAME: Indiana STATE:

190908032

ACCREDITATION NO .:

LEA NAME: Greater Clark County School Corp.

BUILDING NAME: River Valley Middle School

HA#:

TYPE OF MATERIAL: Miscellaneous Material

С

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

2nd Floor Mechanical Room

#### MATERIAL DESCRIPTION:

ACCREDITATION NO.:

Shock Joints

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is nonfrialbe and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO ORIGINAL INSPECTION DATE: 06/26/95 CURRENT REINSPECTION DATE: CURRENT ASSESSMENT RATING: NR Not Required CAUSE OF DAMAGE: No Damage ACCESSIBLE: NO POTENTIAL FOR DAMAGE: Low **REMOVED:** NO CURRENT VIDEO TAPE: / (TAPE NO/FOOTAGE) INSPECTOR NAME: Indiana STATE: 190908032

LEA NAME:	Greater Clark County Schools
BUILDING NAME:	River Valley Middle School
HA#:	1
TYPE OF MATERIAL:	Miscellaneous Material
QUANTITY OF MATERIAL:	1
MATERIAL LOCATION:	
Boiler Room	
MATERIAL DESCRIPTION:	
Boiler Gasket	
COMMENTS:	
Replaced with r	on-ACM gasket in 1994.
IS MATERIAL FRIABLE?	NO
ORIGINAL INSPECTION DA	ATE:
CURRENT REINSPECTION	DATE: 06/26/95
CURRENT ASSESSMENT RA	TING:
CAUSE OF DAMAGE:	
ACCESSIBLE:	NO
POTENTIAL FOR DAMAGE:	
REMOVED:	NO
CURRENT VIDEO TAPE: (TAPE NO/FOOTAGE)	/
INSPECTOR NAME:	Rex Gaddis
STATE:	Indiana

190908032

ACCREDITATION NO.:

C

C

C

LEA NAME:	Greater Clark County Schools
BUILDING NAME:	River Valley Middle School
HA#:	4
TYPE OF MATERIAL:	Miscellaneous Material

QUANTITY OF MATERIAL: 9,564SF

#### MATERIAL LOCATION:

Throughout Building

#### MATERIAL DESCRIPTION:

Mastic

#### COMMENTS:

Material is assumed to be asbestos containing and is in good condition.

IS MATERIAL FRIABLE?	NO
ORIGINAL INSPECTION DATE:	06/01/95
CURRENT REINSPECTION DATE:	06/26/95
CURRENT ASSESSMENT RATING:	NR Not Required
CAUSE OF DAMAGE:	No Damage
ACCESSIBLE:	NO
POTENTIAL FOR DAMAGE:	Low
REMOVED:	NO
CURRENT VIDEO TAPE: (TAPE NO/FOOTAGE)	/
INSPECTOR NAME:	Rex Gaddis
STATE:	Indiana
ACCREDITATION NO .:	190908032

Greater Clark County Schools

LEA NAME:

BUILDING NAME: River Valley Middle School

HA#:

TYPE OF MATERIAL: Miscellaneous Material

Α

QUANTITY OF MATERIAL:

#### MATERIAL LOCATION:

Throughout Building

#### MATERIAL DESCRIPTION:

Cove Base

#### COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is nonfriable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE?	NO
ORIGINAL INSPECTION DATE:	
CURRENT REINSPECTION DATE:	06/26/95
CURRENT ASSESSMENT RATING:	NR Not Required
CAUSE OF DAMAGE:	No Damage
ACCESSIBLE:	YES
POTENTIAL FOR DAMAGE:	Low
REMOVED:	NO
CURRENT VIDEO TAPE: (TAPE NO/FOOTAGE)	/
INSPECTOR NAME:	Rex Gaddis
STATE:	Indiana
A CODEDITERNITION NO	190908032
ACCREDITATION NO.:	T20200012

Greater Clark County Schools

LEA NAME:

BUILDING NAME: River Valley Middle School

HA#:

TYPE OF MATERIAL: Miscellaneous Material

B

QUANTITY OF MATERIAL:

#### MATERIAL LOCATION:

Throughout Building

#### MATERIAL DESCRIPTION:

Cove Base Mastic

#### **COMMENTS:**

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is nonfriable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE?	NO
ORIGINAL INSPECTION DATE:	
CURRENT REINSPECTION DATE:	06/26/95
CURRENT ASSESSMENT RATING:	NR Not Required
CAUSE OF DAMAGE:	No Damage
ACCESSIBLE:	NO
POTENTIAL FOR DAMAGE:	Low
REMOVED:	NO
CURRENT VIDEO TAPE: (TAPE NO/FOOTAGE)	/
INSPECTOR NAME:	Rex Gaddis
STATE:	Indiana
ACCREDITATION NO .:	190908032

Greater Clark County Schools

LEA NAME:

BUILDING NAME: River Valley Middle School

HA#:

TYPE OF MATERIAL: Miscellaneous Material

C

QUANTITY OF MATERIAL:

#### MATERIAL LOCATION:

2nd Floor Mechanical Room

#### MATERIAL DESCRIPTION:

Shock Joints

#### COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is nonfrialbe and does not need an assessment rating at this time.

IS MATERIAL FRIABLE?	NO
ORIGINAL INSPECTION DATE:	
CURRENT REINSPECTION DATE:	06/26/95
CURRENT ASSESSMENT RATING:	NR Not Required
CAUSE OF DAMAGE:	No Damage
ACCESSIBLE:	YES
POTENTIAL FOR DAMAGE:	Low
REMOVED:	NO
CURRENT VIDEO TAPE: (TAPE NO/FOOTAGE)	/
INSPECTOR NAME:	Rex Gaddis
STATE:	Indiana
ACCREDITATION NO .:	190908032

## ADDITIONAL BULK SAMPLES

٤.

Greater Clark County Schools

6

AHERA Program

#### ATC ASSOCIATES INC. **BULK SAMPLE ANALYSIS REPORT NVLAP** Accredited NVLAP Code Number 101265-00

Date: June 17, 1997

Client: Alliance Indiana, Inc.

Project Identification: NHW-03A01 - River Valley Middle School Date Sample Received: June 3, 1997 ATC Lab Batch Number: 970920

Lab <u>ID</u> <u>Client ID</u>	Color / Description	Laver(s)	Asbestos Type	%	Other Fibrou Material	IS <u>%</u>	Non-Fibrous <u>Material</u>
001 RVMS-01	Tan Insulation	1	Chrysotile	50-60	Manmade Cellulose	10-20 5-10	Binder
002 RVMS-02	Tan Insulation	1	Chrysotile	60-70	Cellulose Manmade	5-10 5-10	Binder

Patrick Stanford, Analys Patrick Stanford, Group Leader

- Analytical Methods: EPA 600/M4-82-020, December 82, EPA 600/R-93/116, July 1993 .
- Enclosed test results relates only to items tested.
- This report shall not be reproduced, except in full without written approval of the laboratory.
  - This report can not be used to claim product endorsement by NVLAP or any agency of the U.S. Government,

Method limitations: Analysis of floor tile and other resinously bound materials by Polarized Light Microscopy (PLM) may yield false negative results due to method limitations. In these cases ATC recommends alternative methods of analysis.

For all heterogeneous samples easily separated into sub-samples each component will be analyzed separately. When layers cannot be separated without compromising the layer they will be analyzed as one sample. When a heterogeneous sample contains no asbestos in any layer reported results will be combined in one. When asbestos is detected in a layer or layers of a heterogeneous sample each individual layer will be reported separately.

÷ 7		
ALLIANCE IND 1433 Sadlier O Indianapolis, I 317/351-5600	ircle West Dr.	970920 6/3
Project Name-	RIVER VALLEY	MIDDLE SCHOOL
Project Locatio	on- BOILER RO.	om
City/State-	JOFFERSONVILL	E, INDIANA
Project Numbe	er- MHW-03	5A01 Date- 03 JUNE 1997
Samples Collec	cted By- <u>B/LL OG</u>	KE
SAMPLE I.D. NUMBER	LOCATION OF SAMPLE	DESCRIPTION OF SAMPLE MATERI
RVMS-01	BOILER TO BURNER GASKET	BROWN FIBROUS ROPE
RVMS-02	BETWEEN BOILER SECTIONS	TAN FIBROUS ROPE
RUMS-01	Chr 50	- 60 to the state
02	Ch1 60-	70
	P (*	
	Si ana	
1. 2 * `		
		~
	r an de la constance de la const	- + 14 17

# CHAIN OF CUSTODY

Sample By: BILL OGCE Date: D3 JUNE 1997 Signature: \_\_\_\_\_\_ Date Shipped: 036 in

Received By:
--------------

s,

Date: Signature: Shipped Via:

Recorded By: Date: Log#: Signature: Shipped To: 3

Form F-013

Alliance Indiana, Inc.

ANNUAL NOTIFICATIONS ACCREDITATIONS TRAINING INFORMATION Indiana Department of Environmental Management 100 N. Senate Avenue Mail Code 61-52 IGCN 1003 Indianapolis, IN 46204-2251

## RECEIVED APR 22 2014

April 17, 2014

Benjamin S. Hood Alliance Environmental Group 5340 Commerce Circle, Ste E Indianapolis IN 46237



Based upon the review of your license application, the Office of Air Quality has determined that you have fulfilled the requirements of 326 IAC 18 and are eligible for licensing in the following discipline:

#### Asbestos Inspector

Your Asbestos Inspector license is attached below. The license is waterproof and tear resistant. Please sign your license and do not laminate or alter your license in anyway. Your license must be available for review at all times while implementing an asbestos project. This license may be revoked, pursuant to 326 IAC 18-1-7, if you:

- (1) Violate any requirements of these rules (326 IAC 18), 326 IAC 14-10, or any requirement of the Asbestos-Containing Materials in Schools Rule or any other federal, state, or local regulation pertaining to asbestos in buildings or to asbestos projects.
- (2) Falsify information on your application for licensing.
- (3) Fail to meet any qualifications specified in 326-IAC 18-1-4.
- (4) Conduct asbestos project, or related asbestos handling activity, in a manner which is hazardous to the public health.

Your license is valid effective 05/05/2014, and will expire on 05/05/2015, as indicated on your card. We suggest that you attend the required training and submit an application for license renewal early to insure your license does not lapse. NOTE: 326 IAC 18-1-4(h) and 326 IAC 18-1-6(e) require that any individual who has an eighteen (18) month lapse between any two training courses of the same discipline to attend an initial training course for the discipline in which they are seeking a license. In order to avoid re-taking the initial training course you must have attended a refresher in the discipline you are seeking a license within eighteen (18) months from the date of issuance of your last training course certificate.

Office of Air Quality, Asbestos Licensing Section (317) 233-3861



Indiana Dept. of Environmental Management

Benjamin S. Hood

Asbestos Inspector License #: 19A001039

Effective: 05/05/2014 Birth Date: 04/10/1978 Height: 6-00 Weight: 285 Expiration: 05/05/2015 Gender: M Eye Color: Brown Hair Color: Brown



Alliance Indiana, Inc.

NOTICES

AHERA Program

## **NOTIFICATION LOG**

## GREATER CLARK COUNTY SCHOOLS

#### DATE OF NOTIFICATION

#### COPY IN BOOK

YEAR	(X)
	/
2009	
2010	
2011	
2012	,
2013	
2014	
2015	
2016	
2017	
2018	
2019	
2020	
2021	
2022	
2023	
2024	
2025	
2026	
2027	
2028	
2029	
2030	

### **NOTIFICATION LOG**

LEA Name -

Greater Clark County Schools

Date of Notification	Copy of Notification in Supplemental Book?
1989	
1990	
1991	
1992	
1993	
1994	
1995	
1996	
1997	
1998	
1999	
2000	
2001	
2002	
2003	
2004	
2005	
2006	
2007	
2008	

Greater Clark County Schools

C

Notification Log

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services at River Valley Middle School, which is located at 2220 Veteran's Parkway, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

# Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, Service Center, Corden Porter Storage, Auto Tech Program-Witten Property, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2015/2016 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- \* The required triennial re-inspection will be performed in April 2016.
- \* The required six month periodic surveillance was performed in October 2014.
- \* The required six month periodic surveillance activities are scheduled for April and October each year.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

# Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2220 Veteran's Parkway, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

# Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, Corden Porter Storage, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2014/2015 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- \* The required triennial re-inspection will be performed in April 2013.
- \* The required six month periodic surveillance was performed in October 2013.
- \* The required six month periodic surveillance activities are scheduled for April and October each year.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

# Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

March 2013

#### AHERA ANNUAL NOTICE GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2710 E 10<sup>th</sup> Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, Corden Porter Storage, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2013/2014 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- \* The required triennial re-inspection will be performed in April 2013.
- \* The required six month periodic surveillance was performed in October 2012.
- \* The required six month periodic surveillance activities are scheduled for April and October each year.
- \* Projects completed in 2012: Parkview Middle School.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

March 2012

#### AHERA ANNUAL NOTICE GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2710 E 10<sup>th</sup> Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2012/2013 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- \* The required triennial re-inspection will be performed in June 2013.
- \* The required six month periodic surveillance was performed in December 2011.
- \* The required six month periodic surveillance activities are scheduled for June and December each year.
- \* Projects completed in 2011: Options building and Parkwood Elementary.
- \* Projects scheduled for 2012: Parkview Middle School and Bridgepoint Elementary.
- \* Cordon Porter storage building was sold in 2012.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

#### Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxillary Services building, which is located at 2710 E 10<sup>th</sup> Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, Options and Corden Porter Center Buildings and Alternative School-

- \* The required triennial reinspection will be performed in June 2013.
- \* The required six month periodic surveillance was performed in December 2010.
- \* The next scheduled activity is the required six month periodic surveillance in June 2011.
- \* Charlestown High School asbestos removal project was completed in 2010.
- \* Options Building is under renovation in 2011.
- \* Parkwood Elementary is under renovation in 2011.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free and Riverside Elementary was demolished in 2006. No surveillances or reinspections are required for these buildings.

March 2011

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxillary Services building, which is located at 2710 E 10<sup>th</sup> Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- \* The required triennial reinspection will be performed in June 2010.
- \* The required six month periodic surveillance was performed in December 2009.
- \* The next scheduled activity is the required six month periodic surveillance in December 2010.
- Charlestown High School is an ongoing asbestos removal project which will be complete prior to partial demolition.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free and Riverside Elementary was demolished in 2006. No surveillances or reinspections are required for these buildings.

March 2010

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- \* The required triennial reinspection was performed in June 2007.
- \* The required six month periodic surveillance was performed in December 2008.
- \* The next scheduled activities are the required six month periodic surveillance in June 2009 and Dec 2009. Charlestown High School has undergone an asbestos removal project prior to partial demolition.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free and Riverside Elementary was demolished in 2006. No surveillances or re-inspections are required for these buildings.

April 2009

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number (812)288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- \* The required triennial reinspection was performed in June 2007.
- \* The required six month periodic surveillance was performed in December 2007.
- \* The next scheduled activities are the required six month periodic surveillance in June 2008 and Dec 2008.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free. Riverside Elementary was Demolition in 2006. No surveillances or reinspections are required.

April 2008

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- \* The required six month periodic surveillance was performed in June 2006.
- \* The required six month periodic surveillance was performed in December 2006.
- \* The next scheduled activities are the required six month periodic surveillance in June 2007 and Dec 2007.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -These buildings are asbestos free. Riverside Elementary was Demolition in 2006. No surveillances or reinspections are required.

March 2007

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- \* The required triennial reinspection was performed in June 2005.
- \* The required six month periodic surveillance was performed in December 2005.
- \* The next scheduled activities are the required six month periodic surveillance in June 2006 and Dec 2006.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free. No surveillances or reinspections are required.

March 2006

#### AHERA Annual Notice GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

\* The required triennial reinspection was performed in June 2004.

- \* The required six month periodic surveillance was performed in December 2004.
- \* The next scheduled activities are the required six month periodic surveillance in June 2005 and December 2005.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

\* These buildings are asbestos free. No surveillances or reinspections are required.

April 2005

#### AHERA Annual Notice GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

\* The required six month periodic surveillance was performed in June 2003.

- \* The required six month periodic surveillance was performed in December 2003.
- \* The next scheduled activities are the required triennial reinspection in June 2004 and a required six month periodic surveillance in December 2004.

#### Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

\* These buildings are asbestos free. No surveillances or reinspections are required.

March 2004

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

\* The required six month periodic surveillance was performed in June 2002.

\* The required six month periodic surveillance was performed in December 2002.

\* The next scheduled activity is the required periodic surveillance in June 2003.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

\* These buildings are asbestos free. No surveillances or reinspections are required.

May 2003

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center Buildings -

- \* The required triennial reinspection was performed in July 2001.
- \* The required six month periodic surveillance was performed in December 2001.
- \* The next scheduled activities are the required periodic surveillances in June 2002 and December 2002.

Pleasant Ridge Elementary School and (New) Utica Elementary School -

\* These buildings are asbestos free. No surveillances or reinspections are required.

(Old) Utica Elementary School -

\* In accordance with information collected from the GCCS this building has been deeded to the town of Utica. No further AHERA periodic surveillances or triennial reinspections will be conducted by the designated person.

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, (Old) Utica, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center -

- \* The required six month periodic surveillance was performed in June 2000.
- \* The required six month periodic surveillance was performed in January 2001.
- \* The next scheduled activity is a required triennial reinspection in June 2001.

### Pleasant Ridge Elementary School and (New) Utica Elementary School -

\* This building is asbestos free. No surveillances or reinspections are required.

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, Utica, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center -

- \* The required six month periodic surveillance was performed in June 1999.
- \* The required six month periodic surveillance was performed in December 1999.
- \* The next scheduled activity is a required periodic surveillance in June 2000.

#### Pleasant Ridge Elementary School -

\* This building is asbestos free. No surveillances or reinspections are required.

### AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

#### All school and support buildings where it is required -

- \* The required six month periodic surveillance was performed in June 1998.
- \* The required six month periodic surveillance was performed in December 1998.
- \* The next scheduled activity is a required periodic surveillance in June 1999.

#### Parkwood Elementary School

\* O & M was performed in the boiler room in May 1998.

#### AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- \* The required periodic surveillance was performed in June 1997 and December 1997.
- \* Next activity scheduled activity is a required third year reinspection in June 1998.

#### AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available, should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

\* The required periodic surveillance was performed in June 1996 and December 1996.

\* The next required periodic surveillance will be performed in June 1997 and December 1997.

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Denny Johanson at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

#### All buildings where it is required -

- \* The required third year reinspection was performed in June 1995.
- \* The required periodic surveillance was performed in December 1995.
- \* Next activity scheduled is a periodic surveillance in June 1996.

#### **Charlestown High School -**

\* Transite panels were compliantly removed from the exterior of the building.

#### Corden Porter Building #3 -

\* TSI was compliantly removed from the boiler room.

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available, should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Dennis Johanson at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- \* The required periodic surveillance was performed in June 1995 and December 1995.
- \* The required triennial reinspection was performed in June 1995.
- \* The next required periodic surveillance will be performed in June 1996 and December 1996.

Alliance Indiana, Inc.

ACCREDITATIONS

Greater Clark County Schools

(

AHERA Program



# **Environmental Management Institute**

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846 www.envtlmgmt.org

This confirms that

# Sandy Shadley

Completed the Required Initial Training for Asbestos Accreditation Under TSCA Title II and has passed with a Score of 70 or Greater the Examination for

### **Asbestos Management Planner**

Course Date December 10 - 11, 2009

Examination-Date ecember 11 Jack E. Leonard, President

Certificate: MP(I) 2248 Expires: December 11, 2010

Approved by::

Illinois Department of Public Health Indiana Department of Environmental Management Indiana Department of Environmental Management 100 N. Senate Avenue Mall Code 61-52 IGCN 1003 \*dianapolis, IN 46204-2251

January 21, 2010

RECEIVED JAN 23 2010

Sandra S. Shadley Alliance Environmental Grp 5340 Commerce Circle Ste E Indianapolis IN 46237



### Re: Asbestos Management Planner # 19A002720

Based upon the review of your license application, the Office of Air Quality has determined that you have fulfilled the requirements of 326 IAC 18 and are eligible for licensing in the following discipline:

#### Asbestos Management Planner

Your Asbestos Management Planner license is attached below. The license is waterproof and tear resistant. Please sign your license and do not laminate or alter your license in anyway. Your license must be available for review at all times while implementing an asbestos project. This license may be revoked, pursuant to 326 IAC 18-1-7, if you:

- (1) Violate any requirements of these rules (326 IAC 18), 326 IAC 14-10, or any requirement of the Asbestos-Containing Materials in Schools Rule or any other federal, state, or local regulation pertaining to asbestos in buildings or to asbestos projects.
- (2) Falsify information on your application for licensing.
- (3) Fail to meet any qualifications specified in 326-IAC 18-1-4.
- (4) Conduct asbestos project, or related asbestos handling activity, in a manner which is hazardous to the public health.

Your license is valid effective 01/21/2010, and will expire on 01/21/2011, as indicated on your card. We suggest that you attend the required training and submit an application for license renewal early to insure your license does not lapse. NOTE: 326 IAC 18-1-4(h) and 326 IAC 18-1-6(e) require that any individual who has an eighteen (18) month lapse between any two training courses of the same discipline to attend an initial training course for the discipline in which they are seeking a license. In order to avoid re-taking the initial training course you must have attended a refresher in the discipline you are seeking a license within eighteen (18) months from the date of issuance of your last training course certificate.

Office of Air Quality, Asbestos Licensing Section (317) 233-3861

DEM 4.

Indiana Dept. of Environmental Management

Sandra S. Shadley

Asbestos Management Planner License #: 19A002720

Effective: 01/21/2010 Birth Date: 04/21/1959 Height: 5-08 Weight: 140 Expiration: 01/21/2011 Gender: F Eye Color: Blue Hair Color: Brown



# **Environmental Management Institute**

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846 www.envtlmgmt.org

This confirms that

# George Wm. (Bill) Ogle

Completed the Required Refresher Training for Asbestos Accreditation Under TSCA Title II and has passed with a Score of 70 or Greater the Examination for

### **Asbestos Management Planner**

**Course Date** October 21, 2005

**Examination Date** October 21, 2005

ack E. L Certificate: MP(R) 2897

Expires: October 21, 2006 Illinois Department of Public Health

Approved by 2

Indiana Department of Environmental Management

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE 1435 Sadlier Circle West Drive Indianapolis, Indiana 46239 (317) 352-1270 / (317) 352-06

# GEORGE W<sup>M</sup> (BILL) OGLE 312 - 52 - 2526

Has Successfully Completed The Course Required Under TSCA Title II And Passed The Written Examination With a Score of 70% or Better For

# ASBESTOS MANAGEMENT PLANNER REFRESHER

Accredited by the Indiana Department of Environmental Management.

## Certificate # ES04/MPR058

Course Dates: 09/29/2004 Test Date: 09/29/2004 Expires: 09/29/2005



and stated of the printing of the state of t

ndeleningeneterigeten determenteringeneteri

Shoryn Reyes Instructor

jilden of state of the state of

ussienenentpretenentjäkkenkklantjähkentpläninen persikklaffet

areased of a first first a second

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE 1435 Sadlier Circle West Drive Indianapolis, Indiana 46239 (317) 352-1270 / (317) 352-06

# GEORGE Wm. (BILL) OGLE

Has Successfully Completed The Course Required Under TSCA Title II And Passed The Written Examination With a Score of 70% or Better For

# ASBESTOS MANAGEMENT PLANNER REFRESHER

Accredited by the Indiana Department of Environmental Management.

## Certificate # ES03/MPR045

Course Dates: 09/05/2003 Test Date: 09/05/2003 Expires: 09/05/2004



ei trefe fan et ginne forsternelinen fils en etwerten ferberetter

tibititiis attientienter

5) (S

station and solution of the second

Sharyn Reyes Instructor

	RTMENT OF ENVI ASBESTOS LICE		
Inspector X	Planner X	Designer 🗌	
Supervisor	Worker 🗌	Waste Disp. Mgr	
	George (Bill) V	V. Ogle	
SAFETY	Effective: Expiration:	12/11/2003 12/11/2004	
	BIRTH DATE:	01/17/1949	
RA	SEX: EYE COLOR:	M BRO	
	HAIR COLOR:	BRO	
	HEIGHT:	5-08	
- An Anna Anna	WEIGHT:	155	

S.

1

3**7** 

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE 1435 Sadlier Circle West Drive Indianapolis, Indiana 46239 (317) 352 -1270 / (317) 352 - 0669

## CHRISTIAAN SPARKS 306 - 04 - 2616

Has Successfully Completed The Course Required Under TSCA Title II And Passed The Written Examination With a Score of 70% or Better

For ASBESTOS BUILDING INSPECTOR REFRESHER

Accredited by the Indiana Department of Environmental Management.

### Certificate # ES03/BIR755

Course Dates: 09/26/2003 Test Date: 09/26/2003 Expires: 09/26/2004



Such for Deliver the first of the second state of the second state of the second s

numpholipedisitiennehoudineho

a the sector way was a sector of the sector

Sharyn Reyes Instructor / Manager

and a state of the second of the second s

6

an a second and a second and a second and a second a second second second second second second second second s

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE 1435 Sadlier Circle West Drive Indianapolis, Indiana 46239 (317) 352-1270 / (317) 352-06

# GEORGE Wm. (BILL) OGLE

Has Successfully Completed The Course Required Under TSCA Title II And Passed The Written Examination With a Score of 70% or Better For

# ASBESTOS MANAGEMENT PLANNER REFRESHER

Accredited by the Indiana Department of Environmental Management.

### Certificate # ES03/MPR045

Course Dates: 09/05/2003 Test Date: 09/05/2003 Expires: 09/05/2004



1944 BULLER BULLER BULLER BULLER CONTENDED BULLER BULLER

REAL PROPERTY OF THE PROPERTY

Sharyn Reyés Instructor

**ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE 1435 Sadlier Circle West Drive** Indianapolis, Indiana 46236 (317) 352-1270 / (317) 352 - 0669

weine the second s

.9

and the first of the second state of the second sec

national (nation) (nation) (nation)

## PATRICK E. WILSON 309 - 90 - 6909

Has Successfully Completed The Course Required Under TSCA Title II And Passed The Written Examination With a Score of 70% or Better For

### ASBESTOS BUILDING INSPECTOR REFRESHER

Accredited by the Indiana Department of Environmental Management.

### Certificate # ES00/BIR482

Course Dates: 11/29/2000 Test Date: 11/29/2000 Expires: 11/29/2001

Sharyn Reyes Sharyn Reyes

Instructor

\*

juitentiisiidentiininiteitiiteitiiteitii



# **Environmental Management Institute**

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846 www.spea.iupui.edu/Envtl\_mgmt

This confirms that

George Wm. (Bill) Ogle

Completed the Requisite Initial Training for Asbestos Accreditation Under TSCA Title II and has Passed with a Score of 70 or Greater the Examination for

**Asbestos Management Planner** 

Course date March 2 - 3, 2000

Examination Date March 3, 2000

Jack E. Leonard, President

Certificate: MP(I) 2157 Expires March 3, 2001

Approved by:

Illinois Department of Public Health Indiana Department of Environmental Managemen





**ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE** 1435 Sadlier Circle West Drive Indianapolis, Indiana 46239 (317) 352-1270 / (317) 352-0669

121

していてい いいしている アン

# **CLINT YATES**

316 - 92 - 7065

Has Successfully Completed The Course Required Under TSCA Title II And Passed The Written Examination With a Score of 70% or Better For

## ASBESTOS BUILDING INSPECTOR REFRESHER


Accredited by the Indiana Department of Environmental Management.

Certificate # ES/BIR98/004.

Course Dates: 01/22/98 - 01/22/98 Test Date: 01/22/98 Expires: 01/22/99

Sharyn Reyce Sharyn Reyes

Assistant / Instructor

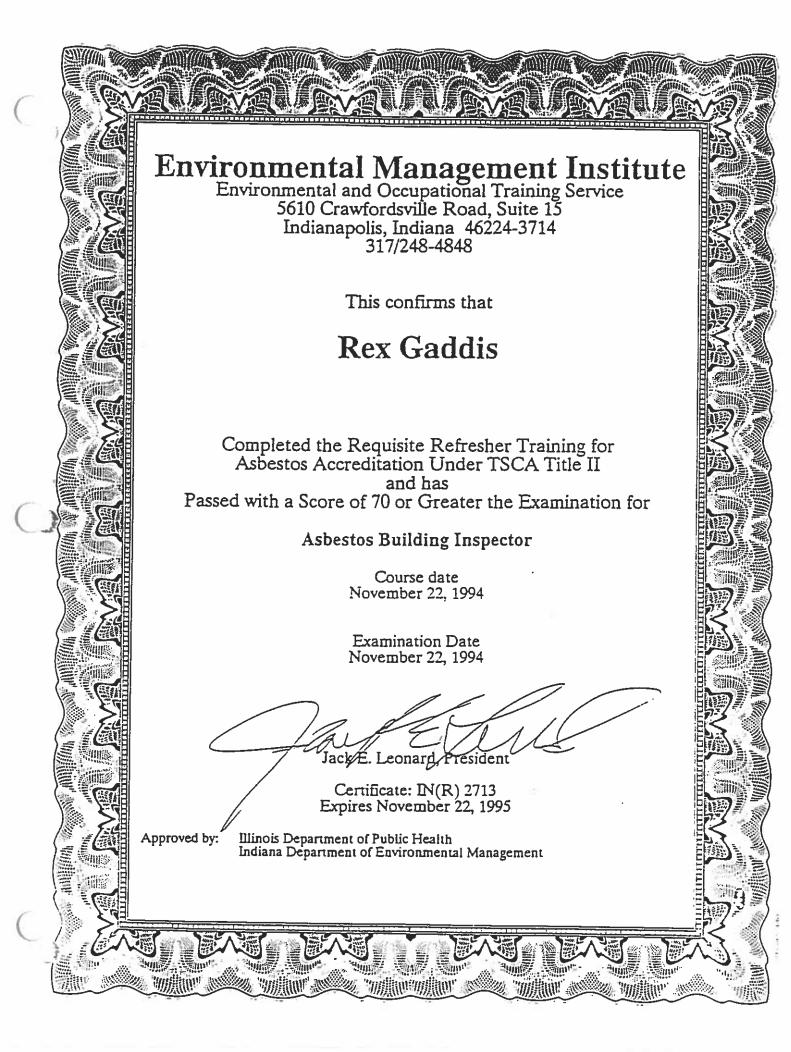

Birnstyle spinospin te i T dependent of the second part of the first ASSESSION OF THE MUSIC OF ACCURATE ON 1022年0025 2/111 198 HENR CERTERS SORRER BIRDHNERE FOLLOWING DISCHARTER SHA NSPECTOR CONTRECTOR TRANSFER SUBBRINSOR : WORKER [] WASTE DISPOSAL WANDAGEN BIRTHDATE SIZEVISZ SEX M INTER EUG HECHIELSON WIECHIE 220 HEAVEL ERO

INDIANA DEPARTMENT OF ENVIRONMENTAL MANAGEMENT ASBESTOS CERTIFICATE OF ACCREDITATION CERTIFICATE # EXPIRATION DATE = 190908032 3/416/96 Rex Gaddis IS CERTIFIED IN THE FOLLOWING DISCIPLINE(S) INSPECTOR PLANNER DESIGNER (\*) SUPERVISOR WORKER (\*) WASTE DISPOSAL MANAGER BIRTHDATE: 3/24/52 SEX: M EYES: BLU HEIGHT: 5-10 WEIGHT: 220 - HAIR: BRO TRAINING

Greater Clark County Schools

1

AHERA Program

### OPERATIONS AND MAINTENANCE INFORMATION

.

Greater Clark County Schools

AHERA Program

### MINOR FIBER RELEASE EPISODE

The local education agency shall ensure that the procedures described below are followed in the event of a minor fiber release episode (i.e., the falling or dislodging of not more than 3 square or linear feet of friable ACBM):

- 1. Thoroughly saturate the debris using wet methods.
- 2. Clean the area using wet methods, protective clothing, HEPAvacuums, mini-enclosures, glove bags, as necessary to inhibit the spread of any released fibers. At a minimum, workers should use air-purifying respirators with HEPA filters.
- 3. Place the asbestos debris in a sealed, leak-tight container, preferably a 6 mil. labeled plastic bag.
- 4. Repair the area of damaged ACM with materials such as asbestosfree spackling, plaster, cement, or insulation, or seal with latex paint or an encapsulant, or immediately have the appropriate response action implemented.
- 5. Each fiber release episode should be documented.

### MAJOR FIBER RELEASE EPISODE

The local education agency shall ensure that the procedures described below are followed in the event of a major fiber release episode (i.e., the falling or dislodging of more than 3 square or linear feet of friable ACBM):

1. Restrict entry into the area and post signs to prevent entry into the area by persons other than those necessary to perform the response action.

2. Shut off or temporarily modify the air-handling system to prevent the distribution of fibers to other areas in the building.

3. AHERA requires that major fiber release episodes be designed by accredited Project Designers. However, the following response procedures should form the basis for response actions.

4. All the procedures recommended by EPA and required by OSHA for large-scale removal of ACM should be used. These include containment barrier, negative pressure ventilation, personal respiratory protection and protective clothing, decontamination facilities, and air testing.

5. Workers should wear "type C" respirators and protective clothing, including a body suit, hood, boots and gloves. Personal air monitoring may be conducted on representative workers, but is not required by OSHA when "type C" respirators are used.

6. Fallen debris should be sprayed with amended water and placed in plastic bags for disposal. Shovels are useful for collecting the debris. The floor should be thoroughly cleaned with a HEPA vacuum cleaner.

7. Walls, ceiling, pipes, boilers, or other surfaces where ACM was damaged or delaminated should be repaired temporarily. This might involve replastering with asbestos-free material, spraying with an encapsulant, or taping with duct tape. In some cases, ACM beyond the immediate area of damage may need to be removed to prevent additional episodes.

8. The air should be tested for asbestos fibers before the plastic barriers are removed and the area reoccupied. Testing should follow guidelines in Chapter 6 of the Purple Book and Chapter 4 of the Silver Book. That is, air should be sampled at the specified number of locations and analyzed by either phase contrast microscopy or transmission electron microscopy. However, sampling should not be done aggressively since the use of blowers and fans may dislodge fibers from the remaining ACM.

9. After the barriers have been taken down, a decontamination of the entire building or a portion of it should be considered. The need for this will depend on how rapidly the response team reacted to the episode and, in particular, how quickly the HVAC system was turned off. A thorough decontamination includes HEPA-vacuuming and/or wet wiping all carpets, furniture, and other surfaces. Decontamination of the HVAC system would involve disassembling and cleaning (HEPA-vacuuming or wet wiping) ducts, ventilators, registers, and other system parts. System filters should also be removed and replaced.

10. All equipment used in the cleanup operation should be washed or wiped with damp cloths. All disposable materials (e.g., cloths, mop heads, filters, coveralls) should be discarded as asbestos wastes.

11. Each fiber release episode should be documented.

### **OPERATIONS AND MAINTENANCE REPORT** (Use only for O&M work less than 3 square or 3 linear feet)

1 81

C

 $\bigcirc$ 

C

AT	E:			
ie i	following inform	nation is provide	ed in accordance wit	h 40 CFR 763.91 and 763.94.
,	Location:			
	Homogeneo	ous Area/Materia	al Description	
	Response:	Clean	Repair	Encapsulation
		Enclosure	Removal	
	Reason:			
	Work Descri	ption:		
	Date:			
	~	Start		Stop
	Date:			
	Date:	Start Start		Stop
	Date: Time:	Start		Stop Stop
	Date: Time: Material: Other:	Start Start Surface	SF SF or	Stop Stop ThermalLF
	Date: Time: Material: Other:	Start	SF SF or Wet Methods	Stop Stop ThermalLF LF HEPA Vacuum
	Date: Time: Material: Other:	Start Start Surface	SF SF or	Stop Stop ThermalLF LF HEPA Vacuum
	Date: Time: Material: Other: Asbestos Co	Start Start Surface ontrol Method:	SF SF or Wet Methods	Stop Stop ThermalLF LF HEPA Vacuum Mini-Enclosure

8.	Equipment Used:					
	Low Vol. Pumps FAM HEPA Vac		High AFD	Vol. Pumps		
	Other:			<u></u>		
9.	Material Used:					
	6 Mil. Disposable Bags Glovebags Duct Tape Disposable Coveralls Sponges		Poly HEPA Filters Spray Glue 3M Pads			
	Encapsulants: Penetrat	ing	Bridging			
	Other:					
10.	Work Personnel:					
	NAME		16 HOUR TE	RAINED - IDEI		REDITED
Super	visor:		YES	NO	YES	NO
Worke	er(s):		YES	NO	YES	NO
			YES	NO	YES	NO
			YES	NO	YES	NO
			YES	NO	YES	NO
			YES	NO	YES	NO
11.	ACBM Disposal: Storage:	YES NO	), If yes, whe	re stored:		
	If no, where disposed:	Landfill:				
12.	Final Visual Inspection Approv	/ed:(LEA [	Designated Pe	rson - Printed	Name)	
	-	(LEA [	Designated Pe	rson - Signatu	re)	

130

(

 $\bigcirc$ 

C

Alliance Indiana, inc.

### REMOVAL PROJECT INFORMATION

Greater Clark County Schools

AHERA Program

SHORT TERM WORKER PROGRAM

Greater Clark County Schools

AHERA Program

### AHERA Program

### Alliance Indiana, Inc.

### **GREATER CLARK COUNTY SCHOOLS**

### SHORT-TERM WORKER SIGN OFF SHEET

This form should be signed each and every time before a "short-term worker" (telephone repair worker, utility worker, etc.) performs work that may cause him to come in contact with ACBM or suspected ACBM assumed to be ACM. One copy of this form should then be forwarded to the LEA designated person, and one copy should be maintained in the school building's copy of the supplemental binder provided by Alliance Indiana, Inc., in order to fulfill the LEA's recordkeeping requirements. The third copy should be forwarded to Alliance Indiana, Inc. for placement in its copy of the supplemental binder.

	School Building Name - J	River Valley N	Middle School		Date
--	--------------------------	----------------	---------------	--	------

I certify that before performing any work which would possibly cause me to come in contact with Asbestos Containing Building Materials (ACBM), I was provided with adequate information regarding the locations of ACBM and suspected ACBM assumed to be ACM in the above-mentioned school building where I performed the work.

Signature			
Company			
Description of wo	rk (including number of a	days on site)	 
		10.11	

Short Term Worker

Alliance Indiana, Inc.

Ł

### **GREATER CLARK COUNTY SCHOOLS**

### SHORT-TERM WORKER SIGN IN LOG

ALL SHORT-TERM WORKERS MUST SIGN THIS LOG CONFIRMING THAT THEY HAVE SIGNED A "SHORT-TERM WORKER SIGN OFF SHEET"

DATE	NIAME (print)	COMPANY	OLONATURE
AIE	NAME(print)	COMPANY	SIGNATURE
		1.00.00.00.00	
			N74
_			
		5	

Greater Clark County Schools

Short Term Worker