

GREATER CLARK COUNTY SCHOOLS

PARKVIEW MIDDLE SCHOOL

AHERA

ASBESTOS MANAGEMENT PLAN

**DESIGNATED PERSON
TRUTH AND CORRECT STATEMENT**

Local Education Agency – Greater Clark County Schools
2112 Utica-Sellersburg Road
Jeffersonville, Indiana 47130


Designated Person - Alliance Environmental Group, Inc.
Sandra Shadley
5153 Commerce Square Drive, Suite E
Indianapolis, Indiana 46237

This Truth and Correct Statement, as outlined in 40 CFR 763.93(i), certifies that the general, local education agency responsibilities, as stipulated by 40 CFR 763.84, have been or will be met.

These responsibilities include:

1. Ensure that the activities of any persons who perform inspections, reinspections, and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with 40 CFR 763 Subpart E.
2. Ensure all custodial and maintenance employees are properly trained as required by 40 CFR 763 Subpart E and other applicable Federal and/or State regulations (e.g., the Occupational Safety and Health Administration Asbestos Standard for Construction, the EPA Worker Protection Rule, or applicable State regulations).
3. Ensure that workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress.
4. Ensure that short-term workers (e.g., telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.
5. Ensure that warning labels are posted in accordance with Section 763.95.
6. Ensure management plans are available for inspection and notification of such availability has been provided as specified in the management plan under Section 763.93(g).
7. The undersigned person designated by the LEA pursuant to Section 763.84(g) (1) has received adequate training as stipulated in Section 763.84(g) (2).
8. The LEA has and will consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under Part 763.

Signature: _____



Date: November 6, 2016

Sandra S. Shadley

ASBESTOS PROGRAM MASTER INDEX

The following volumes are part of the Asbestos Program for the **GREATER CLARK COUNTY SCHOOLS**:

- A. Original Asbestos Management Plan for each school building.
- B. Asbestos Management Plan Supplement for each school building.
 - 1. Amendments to Management Plan
 - 2. Remaining Materials Report
 - 3. Surveillance, Reinspection and Additional Bulk Sampling Information
 - 4. Annual Notifications, Accreditations and Training Records
 - 5. Operations and Maintenance Records
 - 6. Asbestos Removal Projects
 - 7. Short Term Worker Program

Copies of both volumes are found in the respective buildings. The Administration Building also contains duplicate copies of both volumes for each building in their entirety.

GREATER CLARK COUNTY SCHOOLS
PARKVIEW MIDDLE SCHOOL
TABLE OF CONTENTS

AMENDMENTS TO MANAGEMENT PLAN	1
REMAINING MATERIALS REPORT	2
SURVEILLANCE, REINSPECTION AND ADDITIONAL BULK SAMPLING INFORMATION	3
ANNUAL NOTIFICATIONS, ACCREDITATIONS, AND TRAINING	4
OPERATIONS AND MAINTENANCE RECORDS	5
ASBESTOS REMOVAL PROJECTS	6
SHORT TERM WORKER INFORMATION	7

AMENDMENTS TO THE MANAGEMENT PLAN

AMENDMENT TO MANAGEMENT PLAN


Building Name - Parkview Middle School


Subject - Addition of Homogeneous Area D

Amendment - Window caulking that was not assessed in the initial inspection. It was found during an asbestos survey in 2011. The material was sampled by a licensed inspector and found to be an asbestos containing material by an accredited laboratory. Therefore, it is being added to the Management Plan.

Management Planner: Sandra Shadley

Accreditation Number: 19A002720


Signature

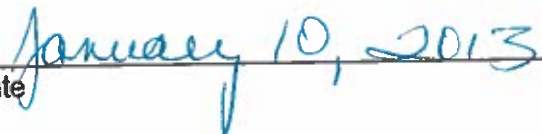
Date

AMENDMENT TO MANAGEMENT PLAN

Building Name - Parkview Middle School


Subject - Removal of Homogeneous Area D

Amendment - This homogeneous area was removed by a licensed contractor during summer renovations in 2012. Therefore, this material is being removed from the Management Plan.

Management Planner: Sandra Shadley

Accreditation Number: 19A002720


Signature

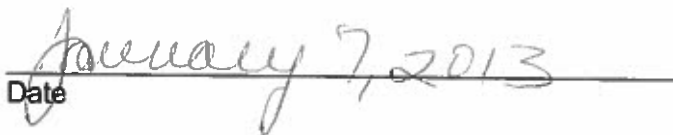
Date

GREATER CLARK COUNTY SCHOOLS
PARKVIEW MIDDLE SCHOOL

LEA RESPONSIBILITY CERTIFICATION

LEA Designated Person - ALLIANCE INDIANA, INC.


Signature - Bruce Wallace, President/CEO

May 1, 1995
Date

ACCREDITATION STATEMENT

The Greater Clark County Schools ensures that the following items will be carried out:

Activities of any persons who perform inspections, reinspections, and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with Subpart E of this part.

All custodial and maintenance employees are properly trained as required by this Subpart E and other applicable Federal and/or State regulations (e.g., the OSHA asbestos standard for construction, the EPA worker protection rule, or applicable State regulations).

Workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, and post response action activities, including periodic reinspection and surveillance activities that are planned or in progress.

Short-term workers (e.g., telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.

Warning labels are posted in accordance with 763.95.

Management plans are available for inspection and notification of such availability has been provided as specified in the management plan under 763.93(g).

Designate a person to ensure that requirements under this section are properly implemented.

Designated person receives adequate training to perform duties assigned under this section. Such training shall provide, as necessary, basic knowledge of:

Health effects of asbestos

Detection, identification, and assessment of ACM

Options for controlling ACBM

Asbestos management programs

Relevant Federal and State regulations concerning asbestos, including those in this Subpart E and those of the OSHA, U.S. Department of Labor, the U.S. Department of Transportation and the U.S. Environmental Protection Agency.

Consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under this subpart.

AMENDMENT TO THE MANAGEMENT PLAN

LEA Name - Greater Clark County Schools

Building - Parkview Middle School

Subject - LEA Designated Person Change

Effective May 1, 1995 the Designated Person for the Greater Clark County Schools is:

Alliance Indiana, Inc.
1433 Sadlier Circle West Drive
Indianapolis, Indiana 46239
(317) 351-5600

Management Planner: Rex Gaddis

Accreditation No. 192218025


Signature

May 1, 1995
Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - Parkview Middle School

Subject- New material

Reference - HA A Cove Base

Original Assessment - No assessment in original inspection.


Amended Assessment - The cove base in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner


Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025



Signature



Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - Parkview Middle School

Subject- New material

Reference - HA B Cove Base Mastic

Original Assessment - No assessment in original inspection.


Amended Assessment - The cove base mastic in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025



Signature



Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - Parkview Middle School

Subject- New material

Reference - HA C Transite Walls

Original Assessment - No assessment in original inspection.

Amended Assessment - Some walls in the gym/balcony area may be transite. This material often contains asbestos. This was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025



Signature



Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - Parkview Middle School

Subject- New material

Reference - HA C Shock Joint Material

Original Assessment - No assessment in original inspection.


Amended Assessment - The shock joint material on the air handlers in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025



Signature

9/5/95

Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - Parkview Middle School

Subject- New material

Reference - HA D Firebrick

Original Assessment - No assessment in original inspection.

Amended Assessment - The firebrick in the incinerator in the boiler room was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025



Signature

9/15/95

Date

AMENDMENT TO MANAGEMENT PLAN

LEA Name - Greater Clark County Schools

Subject - LEA Designated Person Change


Amendment - Effective March 2005, the Designated Person for the Greater Clark County Schools is:

Alliance Environmental Group, Inc.
5340 Commerce Circle, Suite E
Indianapolis, Indiana 46237
(317) 865-3400

Personnel contributing to this Management Plan are licensed in according with 40 CFR 763.93(e)(12).

Management Planner: Sandra S. Shadley

Accreditation Number: 19A002720

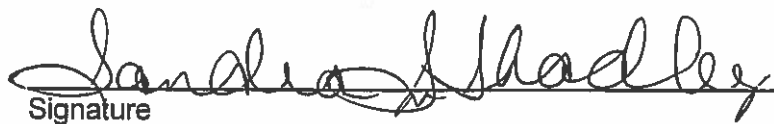
Signature


Date

REMAINING MATERIALS

Greater Clark County School Corporation

Remaining Materials Report

4/23/2020

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action	
<u>Parkview Middle School</u>						
04	Black mastic	Unquantified	SF	Known	Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.	O&M
C	Shock joint on AHU's	Unquantified	SF	Assumed	Shock joint on AHU's	O&M
D	Window Caulking	52	SF	Known	Exterior windows	O&M

Greater Clark County School Corporation

Remaining Materials Report

1/14/2020

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action	
<u>Parkview Middle School</u>						
04	Black mastic	Unquantified	SF	Known	Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.	O&M
C	Shock joint on AHU's	Unquantified	SF	Assumed	Shock joint on AHU's	O&M
D	Window Caulking	0	SF	Known	Exterior windows	Removed

Greater Clark County School Corporation

Remaining Materials Report

5/16/2019

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action	
<u>Parkview Middle School</u>						
04	Black mastic	Unquantified	SF	Known	Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.	O&M
C	Shock joint on AHU's	Unquantified	SF	Assumed	Shock joint on AHU's	O&M
D	Window Caulking	52	SF	Known	Exterior windows	O&M

Greater Clark County School Corporation

Remaining Materials Report

11/13/2018

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action	
<u>Parkview Middle School</u>						
04	Black mastic	Unquantified	SF	Known	Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.	O&M
C	Shock joint on AHU's	Unquantified	SF	Assumed	Shock joint on AHU's	O&M
D	Window Caulking	52	SF	Known	Exterior windows	O&M

Greater Clark County School Corporation

Remaining Materials Report

5/2/2018

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action	
<u>Parkview Middle School</u>						
04	Black mastic	Unquantified	SF	Known	Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.	O&M
C	Shock joint on AHU's	Unquantified	SF	Assumed	Shock joint on AHU's	O&M
D	Window Caulking	52	SF	Known	Exterior windows	O&M

Greater Clark County School Corporation

Remaining Materials Report

10/18/2017

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action
<u>Parkview Middle School</u>					
04	Black mastic	Unquantified SF	Known	Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.	O&M
C	Shock joint on AHU's	Unquantified SF	Assumed	Shock joint on AHU's	O&M
D	Window Caulking	52 SF	Known	Exterior windows	O&M

Greater Clark County School Corporation

Remaining Materials Report

4/13/2017

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action	
<u>Parkview Middle School</u>						
04	Black mastic	Unquantified	SF	Known	Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.	O&M
C	Shock joint on AHU's	Unquantified	SF	Assumed	Shock joint on AHU's	O&M
D	Window Caulking	52	SF	Known	Exterior windows	O&M

Greater Clark County School Corporation

Remaining Materials Report

11/3/2016

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action
<u>Parkview Middle School</u>					
04	Black mastic	Unquantified SF	Known	Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.	O&M
C	Shock joint on AHU's	Unquantified SF	Assumed	Shock joint on AHU's	O&M
D	Window Caulking	52 SF	Known	Exterior windows	O&M

Greater Clark County School Corporation

Remaining Materials Report

4/28/2016

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action	
<u>Parkview Middle School</u>						
04	Black mastic	Unquantified	SF	Known	Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.	O&M
C	Shock joint on AHU's	Unquantified	SF	Assumed	Shock joint on AHU's	O&M
D	Window Caulking	52	SF	Known	Exterior windows	O&M

Greater Clark County School Corporation

Remaining Materials Report

10/20/2015

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action	
<u>Parkview Middle School</u>						
04	Black mastic	Unquantified	SF	Known	Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.	O&M
C	Shock joint on AHU's	Unquantified	SF	Assumed	Shock joint on AHU's	O&M
D	Window Caulking	52	SF	Known	Exterior windows	O&M

**Greater Clark County Schools
Remaining Materials Report
April 22, 2015**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Parkview Middle School</u>					
04	Black mastic	Unquantified SF	Y	Throughout the building except (halls, O & M stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.	
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

**Greater Clark County Schools
Remaining Materials Report
October 22, 2014**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Parkview Middle School</u>					
04	Black mastic	Unquantified SF	Y	Throughout the building except (halls, O & M stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.	
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

**Greater Clark County Schools
Remaining Materials Report
April 21, 2014**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Parkview Middle School</u>					
04	Black mastic	Unquantified SF	Y	Throughout the building except (halls, O & M stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.	
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

**Greater Clark County Schools
 Remaining Materials Report
 October 24, 2013**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Parkview Middle School</u>					
04	Black mastic	Unquantified SF	Y	Throughout the building except (halls, O & M stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.	
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

**Greater Clark County Schools
Remaining Materials Report
April 24, 2013**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Parkview Middle School</u>					
04	Black mastic	Unquantified SF	Y	Throughout the building except (halls, O & M stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.	
C	Shock joint on AHU's	Unquantified SF	A		Auditorium and upper gymnasium

**Greater Clark County Schools
Remaining Materials Report
October 24, 2012**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Parkview Middle School</u>					
04	Black mastic	Unquantified SF	Y	Throughout the building except (halls, O & M stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.	
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

**Greater Clark County Schools
Remaining Materials Report
June 25, 2012**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Parkview Middle School</u>					
04	Black mastic	47,150 SF SF	Y	Throughout the building except (halls, O & M stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.	
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

**Greater Clark County Schools
Remaining Materials Report
December 15, 2011**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Parkview Middle School</u>					
04	Black mastic	47,150 SF SF	Y	Throughout the building except (halls, O & M stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.	
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

Greater Clark County Schools
Remaining Materials Report
December 6, 2010

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Parkview Middle School</u>					
04	Black mastic	11,281 SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

Greater Clark County Schools
Remaining Materials Report
June 30, 2010

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Parkview Middle School</u>					
04	Black mastic	11,281 SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

Greater Clark County Schools
Remaining Materials Report
December 7, 2009

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Parkview Middle School</u>					
04	Black mastic	11,281 SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

Greater Clark County Schools
Remaining Materials Report
June 10, 2009

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
-----	----------	----------	----------	----------	--------------------

Parkview Middle School

04	Black mastic	11,281 SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

**Greater Clark County Schools
Remaining Materials Report
December 10, 2008**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Parkview Middle School</u>					
04	Black mastic	11,281 SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

**Greater Clark County Schools
Remaining Materials Report
June 30, 2008**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Parkview Middle School</u>					
04	Black mastic	11,281 SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

Greater Clark County Schools
Remaining Materials Report
December 14, 2007

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
-----	----------	----------	----------	----------	--------------------

Parkview Middle School

04	Black mastic	11,281 SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

Greater Clark County Schools
Remaining Materials Report
August 1, 2007

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
-----	----------	----------	----------	----------	--------------------

Parkview Middle School

04	Black mastic	11,281 SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

Greater Clark County Schools
Remaining Materials Report
July 9, 2007

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
-----	----------	----------	----------	----------	--------------------

Parkview Middle School

04	Black mastic	11,281 SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

**Greater Clark County Schools
Remaining Materials Report
June 28, 2006**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
------------	-----------------	-----------------	-----------------	-----------------	---------------------------

Parkview Middle School

04	Black mastic	11,281 SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

Greater Clark County Schools
Remaining Materials Report
December 18, 2006

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
-----	----------	----------	----------	----------	--------------------

Parkview Middle School

04	Black mastic	11,281 SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

Greater Clark County Schools
Remaining Materials Report
January 25, 2006

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
-----	----------	----------	----------	----------	--------------------

Parkview Middle School

04	Black mastic	11,281 SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

Greater Clark County Schools
Remaining Materials Report
July 20, 2005

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Parkview Middle School</u>					
04	Black mastic	11,281 SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

Greater Clark County Schools
Remaining Materials Report
December 9, 2004

HA#	Material	Quantity	ACBM	Y/A	Location	Planned Activities
<u>Parkview Middle School</u>						
04	Black mastic	11,281 SF		Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF		A	Auditorium and upper gymnasium	O & M

Greater Clark County Schools
Remaining Materials Report
July 2, 2004

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
-----	----------	----------	----------	----------	--------------------

Parkview Middle School

04	Black mastic	11,281 SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

Greater Clark County Schools
Remaining Materials Report
December 9, 2003

HA#	Material	Quantity	ACBM	Y/A	Location	Planned Activities
<u>Parkview Middle School</u>						
04	Black mastic	11,281 SF		Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF		A	Auditorium and upper gymnasium	O & M

Greater Clark County Schools
Remaining Materials Report
June 13, 2003

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Parkview Middle School</u>					
04	Black mastic	11,281 SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF	A	Auditorium and upper gymnasium	O & M

Greater Clark County Schools
Remaining Materials Report
December 18, 2003

HA#	Material	Quantity	ACBM	Y/A	Location	Planned Activities
<u>Parkview Middle School</u>						
04	Black mastic	11,281	SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified	SF	A	Auditorium and upper gymnasium	O & M

Greater Clark County Schools
Remaining Materials Report
June 19, 2002

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Parkview Middle School</u>					
04	Black mastic	11,281 SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF	A	Auditorium	O & M

Greater Clark County Schools
Remaining Materials Report
December 12, 2001

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Parkview Middle School</u>					
04	Black mastic	11,281 SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF	A	Auditorium	O & M

Greater Clark County Schools
Remaining Materials Report
July 12, 2001

HA#	Material	Quantity	ACBM	Y/A	Location	Planned Activities
<u>Parkview Middle School</u>						
04	Black mastic	11,281 SF		Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF		A	Auditorium	O & M

Greater Clark County Schools
Remaining Materials Report
January 11, 2001

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
-----	----------	----------	----------	----------	--------------------

Parkview Middle School

04	Black mastic	11,281 SF	Y	Throughout the building	O & M
C	Shock joint on AHU's	Unquantified SF	A	Auditorium	O & M

Greater Clark County Schools
Remaining Materials Report
June 29, 2000

HA#	Material	Quantity	ACBM	Y/A	Location	Planned Activities
-----	----------	----------	------	-----	----------	--------------------

Parkview Middle School

04	Black Mastic	11281	SF	Y	Throughout building	O & M
C	Shock Joint on AHU's	Unquantified	SF	A	Auditorium	O & M

Greater Clark County Schools
Remaining Materials Report
February 23, 2000

HA#	Material	Quantity	ACBM	Y/A	Location	Planned Activities
<u>Parkview Middle School</u>						
04	Mastic	11281 SF		Y	Throughout building	O & M
C	Shock Joint on AHV's	Unquantified SF		A	Auditorium	O & M

Greater Clark County Schools
Remaining Materials Report
July 6, 1999

HA#	Material	Quantity	ACBM	Y/A	Location	Planned Activities
-----	----------	----------	------	-----	----------	--------------------

Parkview Middle School

04	Mastic	11281	SF	Y	Throughout building	O & M
C	Shock Joint on AHV's	Unquantified	SF	A	Auditorium	O & M

*PERIODIC SURVEILLANCE
REINSPECTION
ADDITIONAL BULK SAMPLING
INFORMATION*

ASSESSMENTS FOR AHERA

1. Damaged or significantly damaged thermal systems insulation.
2. Damaged friable surfacing ACM.
3. Significantly damaged friable surfacing ACM.
4. Damaged or significantly damaged friable miscellaneous ACM.
5. ACBM with potential for damage.
6. ACBM with potential for significant damage.
7. Any remaining friable ACBM or friable suspected ACBM.

If a material is non-friable, it does not require an assessment rating under AHERA.

Due to the differences in what is required of the LEA for damaged material compared to significantly damaged material, Alliance has modified the assessment scale to the following:













- 1A. Significantly damaged thermal systems insulation.
- 1B. Damaged thermal systems insulation.
- 4A. Significantly damaged friable miscellaneous ACM.
- 4B. Damaged friable miscellaneous ACM.

PERIODIC SURVEILLANCES

SURVEILLANCE INFORMATION
PERIODIC SURVEILLANCE PLAN
GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

DATE PLANNED	DATE COMPLETED	COMPLETED BY
<u>October 2014</u>	October 22, 2014	
<u>April 2015</u>	April 22, 2015	
<u>October 2015</u>	October 20, 2016	
<u>April 2016</u>	RE-INSPECTION	
<u>October 2016</u>	November 3, 2016	
<u>April 2017</u>	April 13, 2017	
<u>October 2017</u>	October 18, 2017	
<u>April 2018</u>	May 2, 2018	
<u>October 2018</u>	November 13, 2018	
<u>April 2019</u>	RE-INSPECTION	
<u>October 2019</u>	January 23, 2020	
<u>April 2020</u>	April 23, 2020	
<u>October 2020</u>		

SURVEILLANCE INFORMATION

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

<u>April 2021</u>	_____	_____
<u>October 2021</u>	_____	_____
<u>April 2022</u>	RE-INSPECTION	_____
<u>October 2022</u>	_____	_____
<u>April 2023</u>	_____	_____
<u>October 2023</u>	_____	_____
<u>April 2024</u>	_____	_____
<u>October 2024</u>	_____	_____
<u>April 2025</u>	RE-INSPECTION	_____
<u>October 2025</u>	_____	_____
<u>April 2026</u>	_____	_____
<u>October 2026</u>	_____	_____

SURVEILLANCE INFORMATION

PERIODIC SURVEILLANCE PLAN SCHEDULE

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>JUNE 2009</u>	<u>JUNE 2009</u>	<u>Bill Ogle</u>
<u>DECEMBER 2009</u>	<u>Dec 2009</u>	<u>Bill Ogle</u>
<u>JUNE 2010</u>	<u>Reinspection</u>	<u>Sandy Shadley</u>
<u>DECEMBER 2010</u>	<u>December 2010</u>	<u>Paul Knick</u>
<u>JUNE 2011</u>	<u>_____</u>	<u>_____</u>
<u>DECEMBER 2011</u>	<u>December 2011</u>	<u>Sandy Shadley</u>
<u>JUNE 2012</u>	<u>June 2012</u>	<u>Jeff Hechtin</u>
<u>DECEMBER 2012</u>	<u>October 2012</u>	<u>Jeff Hechtin</u>
<u>JUNE 2013</u>	<u>Reinspection</u>	<u>Jeff Hechtin</u>
<u>DECEMBER 2013</u>	<u>_____</u>	<u>_____</u>

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each reinspection will be maintained in this binder.

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>JUNE 2003</u>	<u>June '03</u>	<u>C. Sparks</u>
<u>DECEMBER 2003</u>	<u>Dec. '03</u>	<u>C. Sparks</u>
<u>JUNE 2004</u>	<u>REINSPECTION</u>	<u>C. Sparks</u>
<u>DECEMBER 2004</u>	<u>Dec. '04</u>	<u>C. Sparks</u>
<u>JUNE 2005</u>	<u>July '05</u>	<u>J. Ogle</u>
<u>DECEMBER 2005</u>	<u>Jan 05</u>	<u>Bogge</u>
<u>JUNE 2006</u>	<u>June 06</u>	<u>C. Ans</u>
<u>DECEMBER 2006</u>	<u>Dec 06</u>	<u>Bogge</u>
<u>JUNE 2007</u>	<u>July 2007</u> <u>REINSPECTION</u>	<u>Bill Ogle</u>
<u>DECEMBER 2007</u>	<u>December 2007</u>	<u>Bill Ogle</u>
<u>JUNE 2008</u>	<u>June 2008</u>	<u>Bill Ogle</u>
<u>DECEMBER 2008</u>	<u>December 2008</u>	<u>Bill Ogle</u>

PERIODIC SURVEILLANCE PLAN
GREATER CLARK COUNTY SCHOOLS
PARKVIEW MIDDLE SCHOOL

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long they remain in the building. This inspection will be conducted semi-annually.

The following table outlines the dates on which these inspections should take place in this school building.

PERIODIC SURVEILLANCE SCHEDULE

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>DECEMBER 1995</u>	<u>12-95</u>	<u>Alliance</u>
<u>JUNE 1996</u>	<u>6-96</u>	<u>Alliance</u>
<u>DECEMBER 1996</u>	<u>12-96</u>	<u>Alliance</u>
<u>JUNE 1997</u>	<u>7-97</u>	<u>Alliance</u>
<u>DECEMBER 1997</u>	<u>1-98</u>	<u>Alliance</u>
<u>JUNE 1998</u>	<u>REINSPECTION</u>	<u>Alliance</u>
<u>DECEMBER 1998</u>	<u>12-98</u>	<u>Alliance</u>
<u>JUNE 1999</u>	<u>June '99</u>	<u>Alliance</u>
<u>DECEMBER 1999</u>	<u>Dec. '99</u>	<u>Alliance</u>
<u>JUNE 2000</u>	<u>June 2000</u>	<u>Alliance</u>
<u>DECEMBER 2000</u>	<u>Jan. '01</u>	<u>P. F. Wilson</u>
<u>JUNE 2001</u>	<u>REINSPECTION</u>	<u>P. Wilson</u>
<u>DECEMBER 2001</u>	<u>Dec. '01</u>	<u>A. Kimbrough</u>
<u>JUNE 2002</u>	<u>June '02</u>	<u>R. Calvert</u>
<u>DECEMBER 2002</u>	<u>Dec. '02</u>	<u>C. Sparks</u>

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID 04
HA Description Black mastic
HA Type Miscellaneous Material
HA Location Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have
Quantity Unquantified SF
Comments Most of this material was removed during renovations in the Summer of 2012. Remaining material is under floor tile in the office, library, and closets.
Asbestos Known
Friable No
Original Inspection 6/1/1992
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Contact		Vibration	Air
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID C
HA Description Shock joint on AHU's
HA Type Miscellaneous Material
HA Location Shock joint on AHU's

Quantity Unquantified SF

Comments The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID D
HA Description Window Caulking
HA Type Miscellaneous Material
HA Location Exterior windows

Quantity 52 SF
Comments This material was discovered during an asbestos survey in 2011. This material was sampled and found to be asbestos containing. This material was removed during summer renovations in 2012.
Asbestos Known
Friable No
Original Inspection 9/17/2011
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID 04
HA Description Black mastic
HA Type Miscellaneous Material
HA Location Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or
Quantity Unquantified SF
Comments Most of this material was removed during renovations in the Summer of 2012. Remaining material is under floor tile in the office, library, and closets.
Asbestos Known
Friable No
Original Inspection 6/1/1992
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Contact		Vibration	Air
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID C
HA Description Shock joint on AHU's
HA Type Miscellaneous Material
HA Location Shock joint on AHU's

Quantity Unquantified SF

Comments The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID D
HA Description Window Caulking
HA Type Miscellaneous Material
HA Location Exterior windows

Quantity 0 SF
Comments This material was discovered during an asbestos survey in 2011. This material was sampled and found to be asbestos containing. This material was removed during summer renovations in 2012.
Asbestos Known
Friable No
Original Inspection 9/17/2011
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action Removed

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID 04
HA Description Black mastic
HA Type Miscellaneous Material
HA Location Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or
Quantity Unquantified SF
Comments Most of this material was removed during renovations in the Summer of 2012. Remaining material is under floor tile in the office, library, and closets.
Asbestos Known
Friable No
Original Inspection 6/1/1992
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Contact		Vibration	Air
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID C
HA Description Shock joint on AHU's
HA Type Miscellaneous Material
HA Location Shock joint on AHU's

Quantity Unquantified SF
Comments The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage


Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID D
HA Description Window Caulking
HA Type Miscellaneous Material
HA Location Exterior windows

Quantity 52 SF

Comments This material was discovered during an asbestos survey in 2011. This material was sampled and found to be asbestos containing. This material was removed during summer renovations in 2012.

Asbestos Known
Friable No

Original Inspection 9/17/2011
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage


Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID 04
HA Description Black mastic
HA Type Miscellaneous Material
HA Location Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or
Quantity Unquantified SF
Comments Most of this material was removed during renovations in the Summer of 2012. Remaining material is under floor tile in the office, library, and closets.
Asbestos Known
Friable No
Original Inspection 6/1/1992
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition		
<u>Physical Contact</u>		<u>Vibration</u>		<u>Air</u>
Low/None		Low/None		Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID C
HA Description Shock joint on AHU's
HA Type Miscellaneous Material
HA Location Shock joint on AHU's

Quantity Unquantified SF

Comments The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Asbestos Assumed

Friable No

Original Inspection 5/31/1995
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage


Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID D
HA Description Window Caulking
HA Type Miscellaneous Material
HA Location Exterior windows

Quantity 52 SF

Comments This material was discovered during an asbestos survey in 2011. This material was sampled and found to be asbestos containing. This material was removed during summer renovations in 2012.

Asbestos Known
Friable No

Original Inspection 9/17/2011
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN
Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID 04
HA Description Black mastic
HA Type Miscellaneous Material
HA Location Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or
Quantity Unquantified SF
Comments Most of this material was removed during renovations in the Summer of 2012. Remaining material is under floor tile in the office, library, and closets.
Asbestos Known
Friable No
Original Inspection 6/1/1992
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Contact		Vibration	Air
Low/None		Low/None	Low/None
Planned Response Action	O&M		



Inspector _____
Dustin Hawkins

State IN
Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID C
HA Description Shock joint on AHU's
HA Type Miscellaneous Material
HA Location Shock joint on AHU's

Quantity Unquantified SF
Comments The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M



Inspector _____
Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID D
HA Description Window Caulking
HA Type Miscellaneous Material
HA Location Exterior windows

Quantity 52 SF
Comments This material was discovered during an asbestos survey in 2011. This material was sampled and found to be asbestos containing. This material was removed during summer renovations in 2012.
Asbestos Known
Friable No
Original Inspection 9/17/2011
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M



Inspector _____
Dustin Hawkins

State IN
Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID 04
HA Description Black mastic
HA Type Miscellaneous Material
HA Location Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or
Quantity Unquantified SF
Comments Most of this material was removed during renovations in the Summer of 2012. Remaining material is under floor tile in the office, library, and closets.
Asbestos Known
Friable No
Original Inspection 6/1/1992
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID C
HA Description Shock joint on AHU's
HA Type Miscellaneous Material
HA Location Shock joint on AHU's

Quantity Unquantified SF

Comments The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M



Inspector _____
Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID D
HA Description Window Caulking
HA Type Miscellaneous Material
HA Location Exterior windows

Quantity 52 SF

Comments This material was discovered during an asbestos survey in 2011. This material was sampled and found to be asbestos containing. This material was removed during summer renovations in 2012.

Asbestos Known
Friable No

Original Inspection 9/17/2011
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None
<u>Planned Response Action</u>	O&M		



Inspector

Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID 04
HA Description Black mastic
HA Type Miscellaneous Material
HA Location Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or
Quantity Unquantified SF
Comments Most of this material was removed during renovations in the Summer of 2012. Remaining material is under floor tile in the office, library, and closets.
Asbestos Known
Friable No
Original Inspection 6/1/1992
Current Inspection 11/3/2016


Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition		
<u>Physical Contact</u>		<u>Vibration</u>		<u>Air</u>
Low/None		Low/None		Low/None

Planned Response Action O&M

Inspector 

Dustin Hawkins

State IN
Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID C
HA Description Shock joint on AHU's
HA Type Miscellaneous Material
HA Location Shock joint on AHU's

Quantity Unquantified SF
Comments The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID D
HA Description Window Caulking
HA Type Miscellaneous Material
HA Location Exterior windows

Quantity 52 SF
Comments This material was discovered during an asbestos survey in 2011. This material was sampled and found to be asbestos containing. This material was removed during summer renovations in 2012.
Asbestos Known
Friable No
Original Inspection 9/17/2011
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Dustin Hawkins

State IN
Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID 04
HA Description Black mastic
HA Type Miscellaneous Material
HA Location Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or
Quantity Unquantified SF
Comments Most of this material was removed during renovations in the Summer of 2012. Remaining material is under floor tile in the office, library, and closets.
Asbestos Known
Friable No
Original Inspection 6/1/1992
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Contact		Vibration	Air
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID C
HA Description Shock joint on AHU's
HA Type Miscellaneous Material
HA Location Shock joint on AHU's

Quantity Unquantified SF
Comments The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage


Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID D
HA Description Window Caulking
HA Type Miscellaneous Material
HA Location Exterior windows

Quantity 52 SF
Comments This material was discovered during an asbestos survey in 2011. This material was sampled and found to be asbestos containing. This material was removed during summer renovations in 2012.
Asbestos Known
Friable No
Original Inspection 9/17/2011
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage


Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# 04

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.

Material Description

Black mastic

Comments

Most of this material was removed during renovations in the Summer of 2012. Remaining material is under floor tile in the office, library, and closets.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 4/22/2015

Current Assessment Rating NR Not Rated


Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# C

Type of Material Miscellaneous Material


Quantity of Material Unquantified SF

Material Location
Auditorium and upper gymnasium

Material Description
Shock joint on AHU's

Comments
The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 4/22/2015
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# D

Type of Material Miscellaneous Material

Quantity of Material 52 SF

Material Location
Exterior Windows

Material Description
Window Caulking

Comments

This material was discovered during an asbestos survey in 2011. This material was sampled and found to be asbestos containing. This material was removed during summer renovations in 2012.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 9/17/2011

Current Surveillance Date 4/22/2015

Current Assessment Rating NR Not Rated


Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# 04

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.

Material Description

Black mastic

Comments

Most of this material was removed during renovations in the Summer of 2012. Remaining material is under floor tile in the office, library, and closets.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 10/22/2014

Current Assessment Rating NR Not Rated


Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

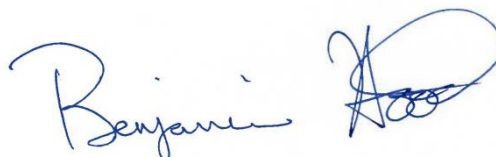

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# C

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Auditorium and upper gymnasium

Material Description

Shock joint on AHU's

Comments

The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 10/22/2014

Current Assessment Rating NR Not Rated


Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

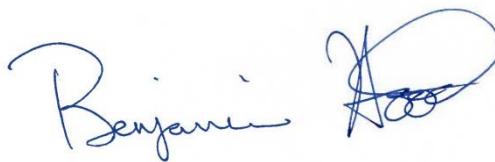

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# D

Type of Material Miscellaneous Material

Quantity of Material 52 SF

Material Location
Exterior Windows

Material Description
Window Caulking

Comments

This material was discovered during an asbestos survey in 2011. This material was sampled and found to be asbestos containing. This material was removed during summer renovations in 2012.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 9/17/2011

Current Surveillance Date 10/22/2014

Current Assessment Rating NR Not Rated


Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

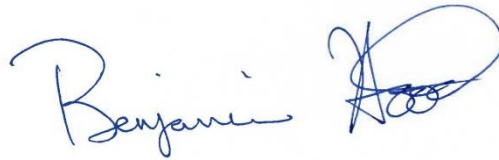

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# 04

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.

Material Description

Black mastic

Comments

Most of this material was removed during renovations in the Summer of 2012. Remaining material is under floor tile in the office, library, and closets.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 4/21/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# C

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location
Auditorium and upper gymnasium

Material Description
Shock joint on AHU's

Comments
The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 4/21/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# D

Type of Material Miscellaneous Material

Quantity of Material 52 SF

Material Location
Exterior Windows

Material Description
Window Caulking

Comments

This material was discovered during an asbestos survey in 2011. This material was sampled and found to be asbestos containing. This material was removed during summer renovations in 2012.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 9/17/2011

Current Surveillance Date 4/21/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location

Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.

Material Description


Black mastic

Comments

Most of this material was removed during renovations in the Summer of 2012. Remaining material is under floor tile in the office, library, and closets.

Does Material Contain Asbestos? Yes
Is It Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Auditorium and upper gymnasium

Material Description
Shock joint on AHU's

Comments

The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# D
Type of Material Miscellaneous Material
Quantity of Material 52 SF
Material Location

Exterior Windows


Material Description

Window Caulking

Comments

This material was discovered during an asbestos survey in 2011. This material was sampled and found to be asbestos containing. This material was removed during summer renovations in 2012.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 9/17/2011
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location

Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.

Material Description

Black mastic

Comments

Most of this material was removed during renovations in the Summer of 2012.
Remaining material is under floor tile in the office, library, and closets.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 10/24/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Auditorium and upper gymnasium

Material Description
Shock joint on AHU's

Comments

The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	5/31/1995	
Current Surveillance Date	10/24/2012	
Current Assessment Rating	NR	Not Rated
Cause of Damage	No Damage	
Accessible	Yes	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# D

Type of Material Miscellaneous Material

Quantity of Material 52 SF

Material Location
Exterior Windows

Material Description
Window Caulking

Comments

This material was discovered during an asbestos survey in 2011. This material was sampled and found to be asbestos containing. This material was removed during summer renovations in 2012.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 9/17/2011

Current Surveillance Date 10/24/2012

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# 04

Type of Material Miscellaneous Material

Quantity of Material 47,150 SF SF

Material Location

Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.

Material Description

Black mastic

Comments

This material is under carpet and floor tile.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 6/25/2012

Current Assessment Rating NR Not Rated

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

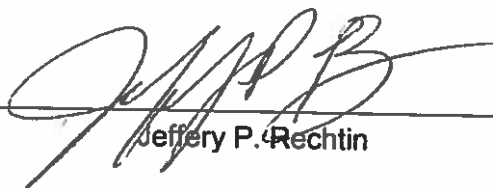
Jeffery P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Auditorium and upper gymnasium

Material Description
Shock joint on AHU's

Comments

The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/25/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Jeffery P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 47,150 SF SF

Material Location

Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.

Material Description

Black mastic

Comments

This material is under carpet and floor tile.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/15/2011
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Auditorium and upper gymnasium

Material Description
Shock joint on AHU's

Comments

The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/15/2011
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF
Material Location
Throughout the building
Material Description
Black mastic
Comments
No mastic was visible to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/6/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Paul W. Krick

State Indiana
Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Auditorium and upper gymnasium


Material Description
Shock joint on AHU's

Comments

The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/6/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Paul W. Krick

State Indiana
Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF
Material Location Throughout the building
Material Description Black mastic
Comments No mastic was visible to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/4/2009
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# C

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location Auditorium and upper gymnasium


Material Description Shock joint on AHU's

Comments

The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	5/31/1995	
Current Surveillance Date	12/4/2009	
Current Assessment Rating	NR	Not Required
Cause of Damage	No Damage	
Accessible	Yes	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	

Inspector

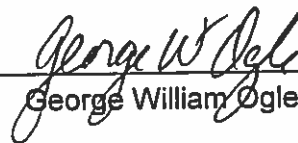
George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF
Material Location
Throughout the building
Material Description
Black mastic
Comments
No mastic was visible to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/10/2009
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

IN

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Auditorium and upper gymnasium

Material Description
Shock joint on AHU's

Comments

The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/10/2009
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



George William Ogle

State IN
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF
Material Location
Throughout the building
Material Description
Black mastic
Comments
No mastic was visible to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/10/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

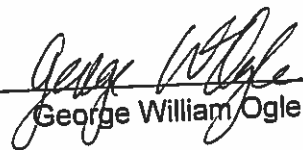
George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location

Auditorium and upper gymnasium

Material Description

Shock joint on AHU's

Comments

The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/10/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State


Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF
Material Location
Throughout the building
Material Description
Black mastic
Comments
No mastic was visible to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/30/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

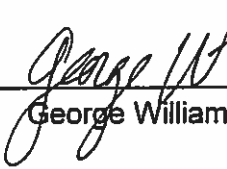Inspector _____

George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Auditorium and upper gymnasium

Material Description
Shock joint on AHU's

Comments

The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/30/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF
Material Location
Throughout the building
Material Description
Black mastic
Comments
No mastic was visible to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/6/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location

Auditorium and upper gymnasium

Material Description

Shock joint on AHU's

Comments

The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/6/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF
Material Location
Throughout the building
Material Description
Black mastic
Comments
No mastic was visible to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 7/11/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Auditorium and upper gymnasium


Material Description
Shock joint on AHU's

Comments

The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 7/11/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

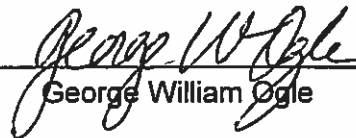
George William Ogilvie

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF
Material Location
Throughout the building
Material Description
Black mastic
Comments
No mastic was visible to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/18/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Auditorium and upper gymnasium


Material Description
Shock joint on AHU's

Comments

The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/18/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

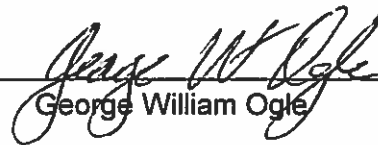
George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF
Material Location
Throughout the building
Material Description
Black mastic
Comments
No mastic was visible to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/28/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector _____

Christopher Ames

State Indiana
Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# C

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Auditorium and upper gymnasium

Material Description

Shock joint on AHU's

Comments

No access was available to the enclosed units above the stage at the time of the last surveillance. Arrangements have to be made for a tall ladder to reach the doors. The material in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 6/28/2006

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Christopher Ames

State Indiana

Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF
Material Location
Throughout the building
Material Description
Black mastic
Comments
No mastic was visible to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 1/23/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

Indiana

Accreditation Number

191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# C

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Auditorium and upper gymnasium

Material Description

Shock joint on AHU's

Comments

No access was available to the enclosed units above the stage. Arrangements have to be made for a tall ladder to reach the doors. The material in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 1/23/2006

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No


Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191523030

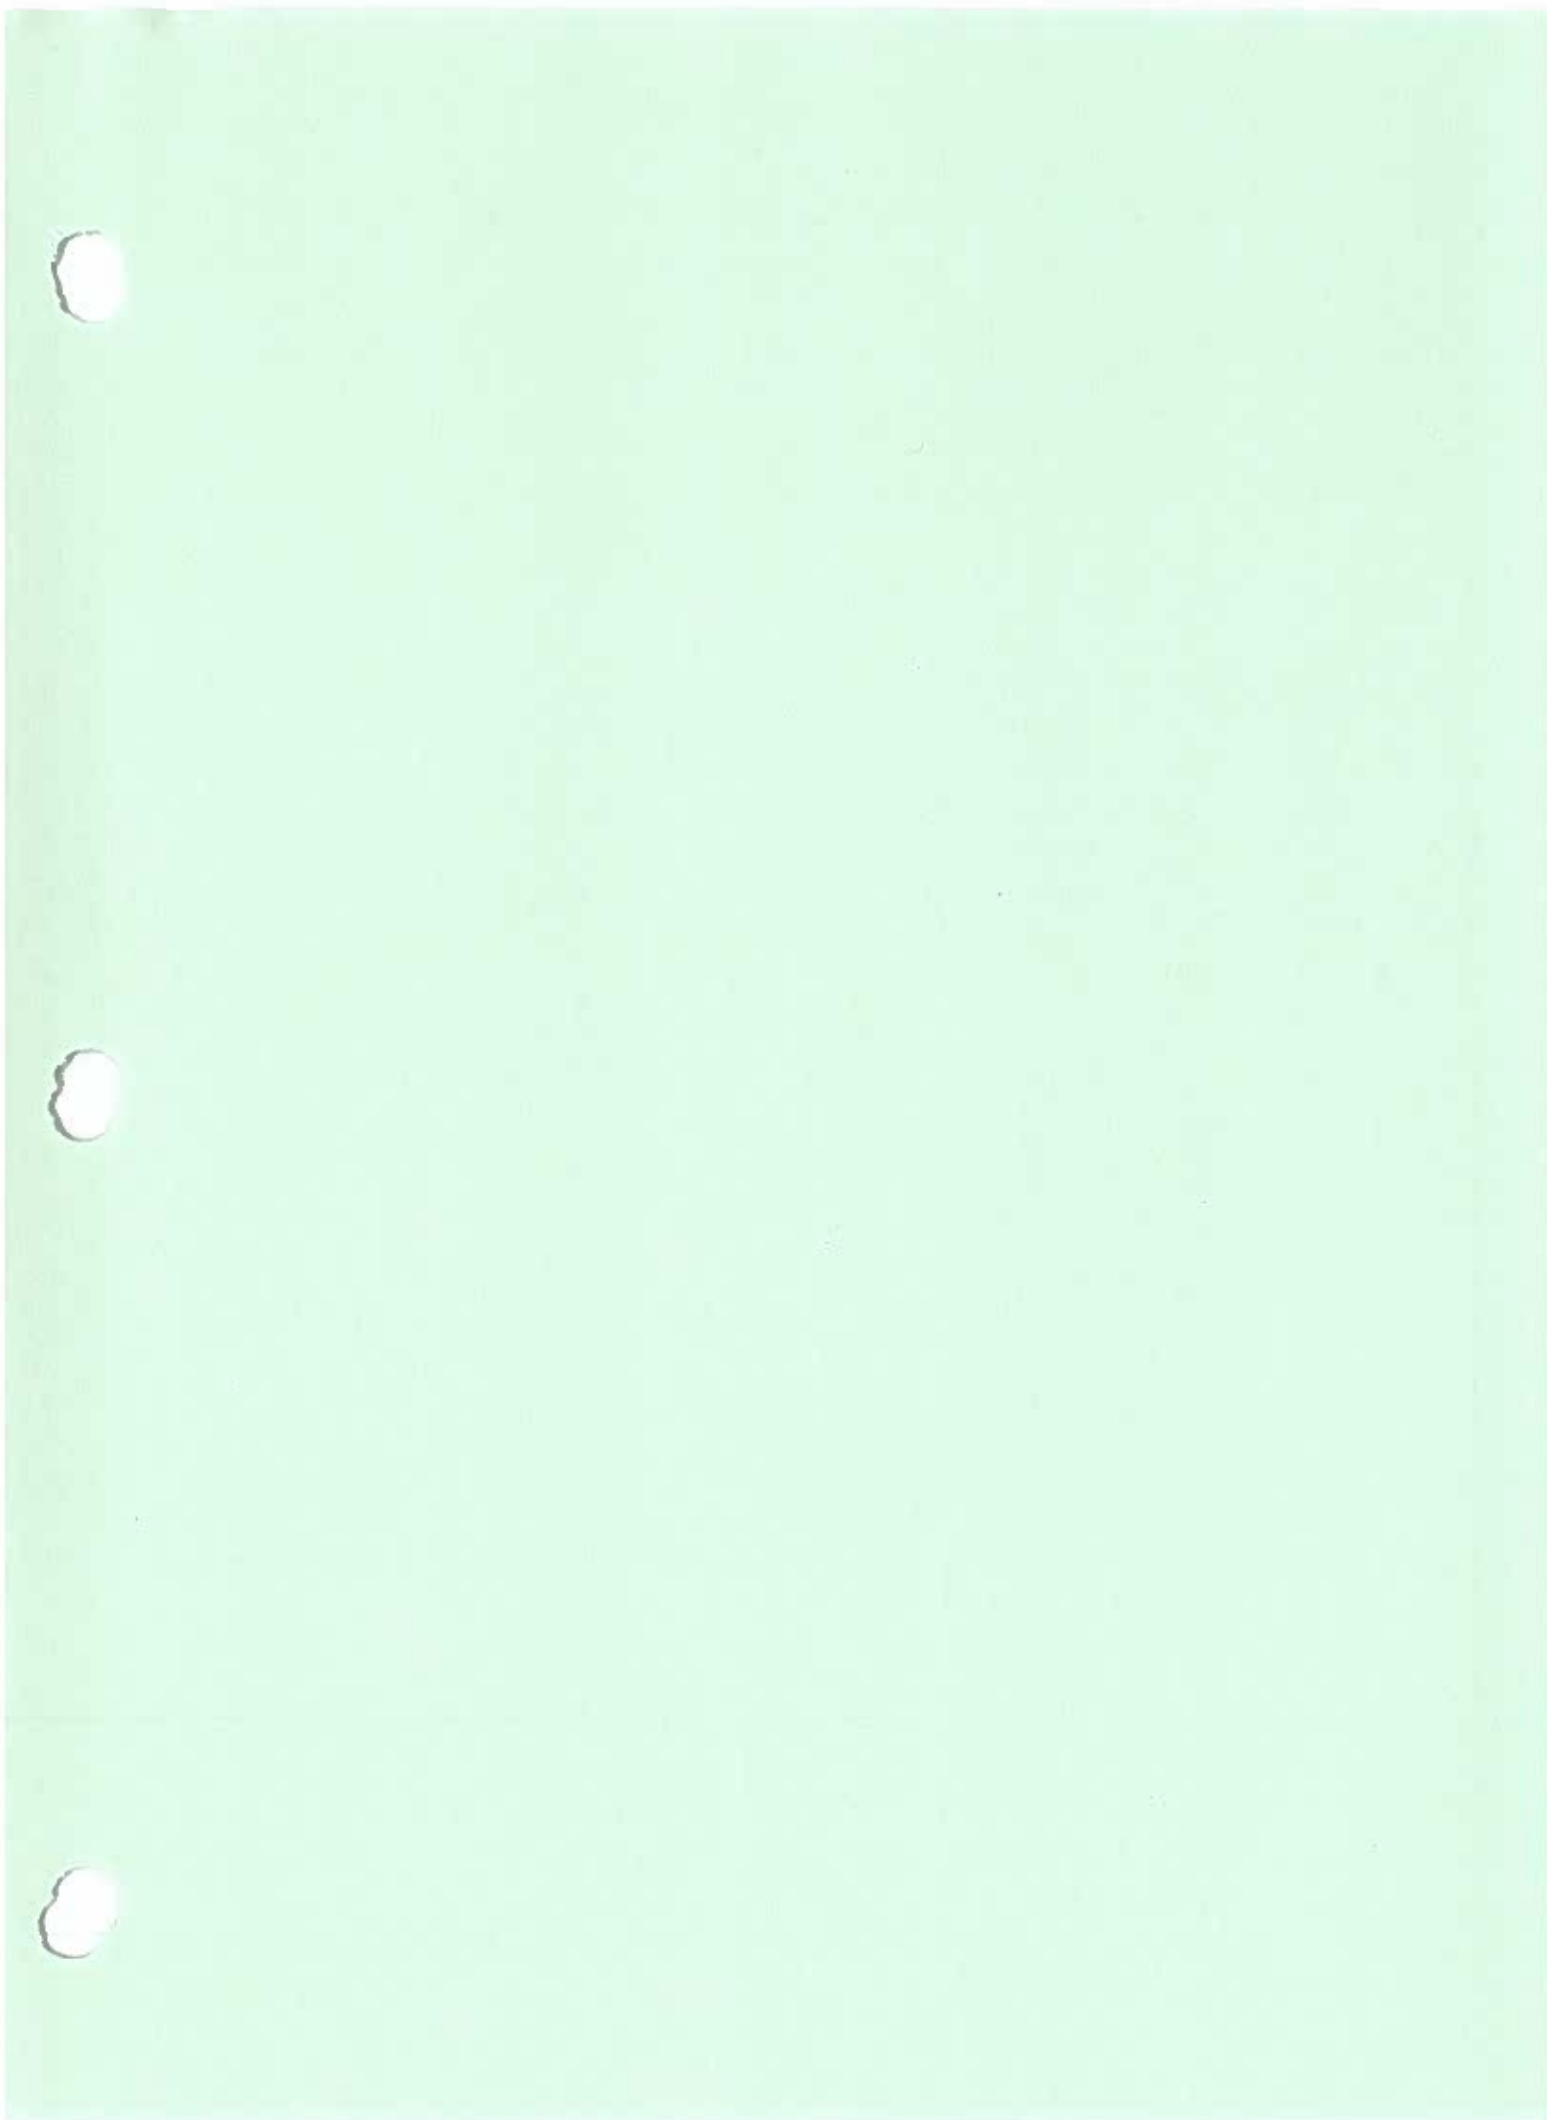

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# 04

Type of Material Miscellaneous Material

Quantity of Material 11,281 SF

Material Location
Throughout the building

Material Description
Black mastic

Comments
No mastic was found to inspect. No access was available to the AH rooms above the stage.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 7/19/2005

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# C

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF


Material Location
Auditorium and upper gymnasium

Material Description
Shock joint on AHU's

Comments
There are air handler units in the upper gymnasium with shock joints on them. They will be assumed ACM until further samples can be collected. The material located in the auditorium appeared to be vinyl. Further investigation is necessary. This material was not in poor condition.


Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	5/31/1995
Current Surveillance Date	7/19/2005
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Inspector

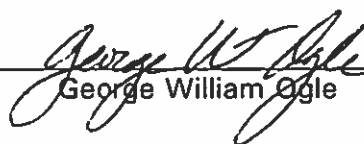
George William Ogle

State Indiana

Accreditation Number 191523030

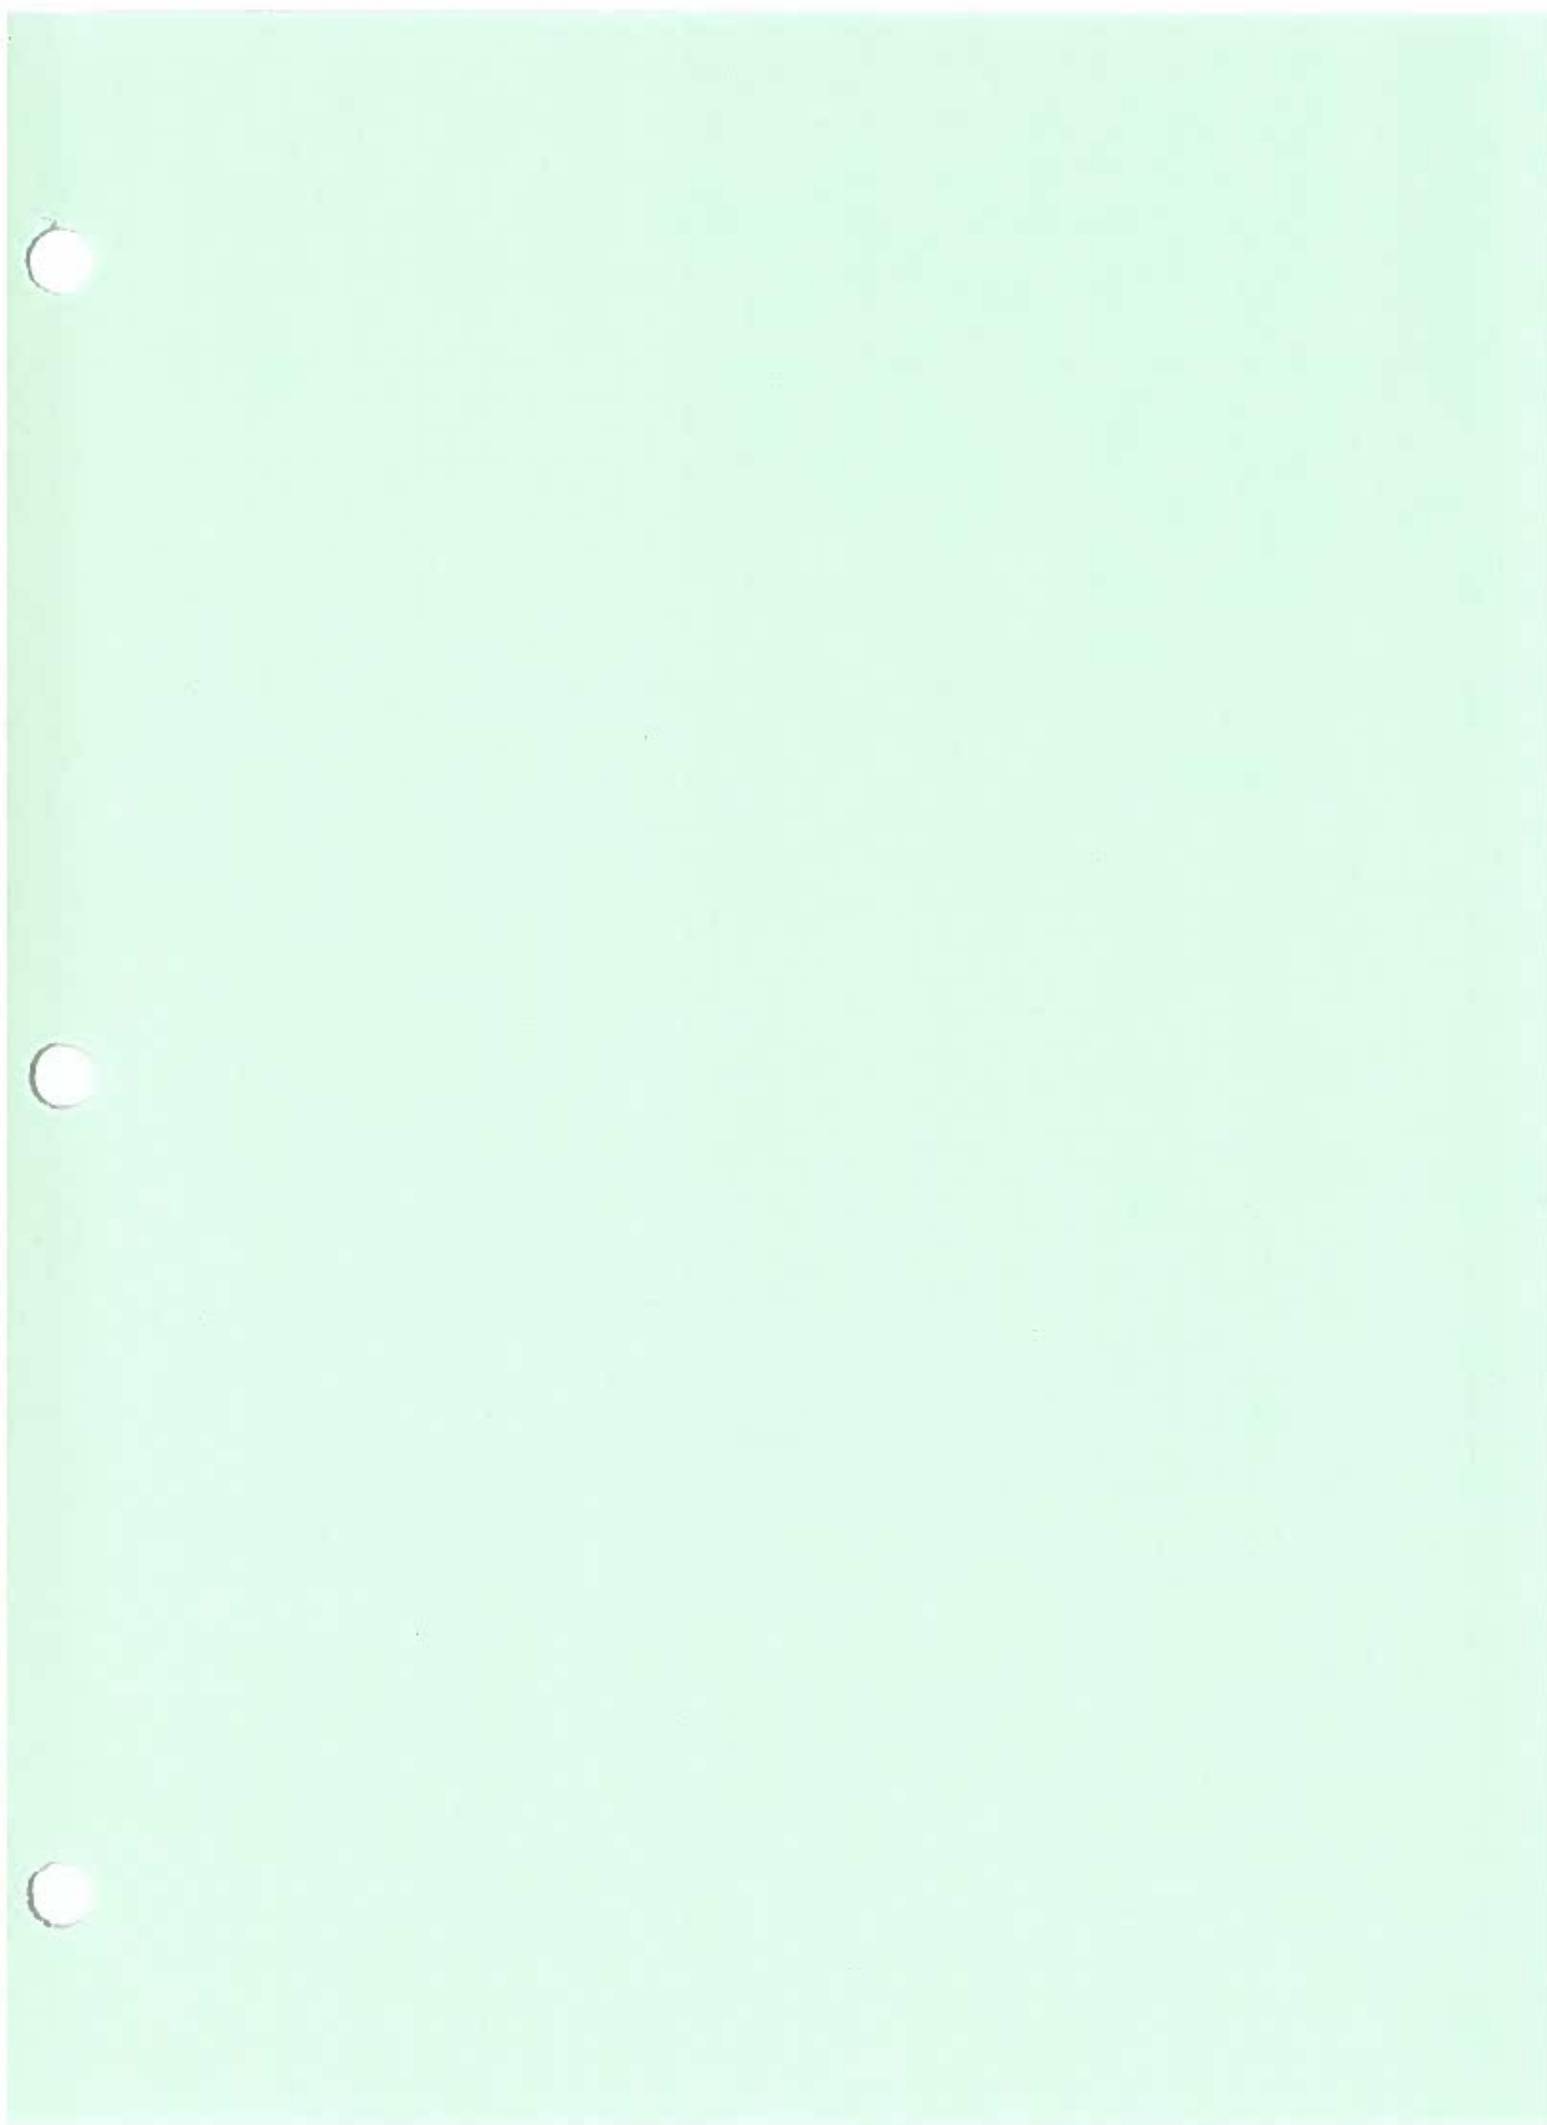

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# 04

Type of Material Miscellaneous Material

Quantity of Material 11,281 SF

Material Location

Throughout the building

Material Description

Black mastic

Comments

About two square feet of mastic was located in both air handler rooms above the stage. It was not in poor condition. No other mastic was exposed to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 12/9/2004

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana

Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# C

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Auditorium and upper gymnasium

Material Description

Shock joint on AHU's

Comments

There are air handler units in the upper gymnasium with shock joints on them. I was unable to tell if they were vinyl or ACM. Therefore, they will be assumed ACM until further samples can be collected. The material located in the auditorium appeared to be vinyl. Further investigation is necessary. This material was not in poor condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 12/9/2004

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M


Inspector



Christiaan Sparks

State Indiana

Accreditation Number 190804103

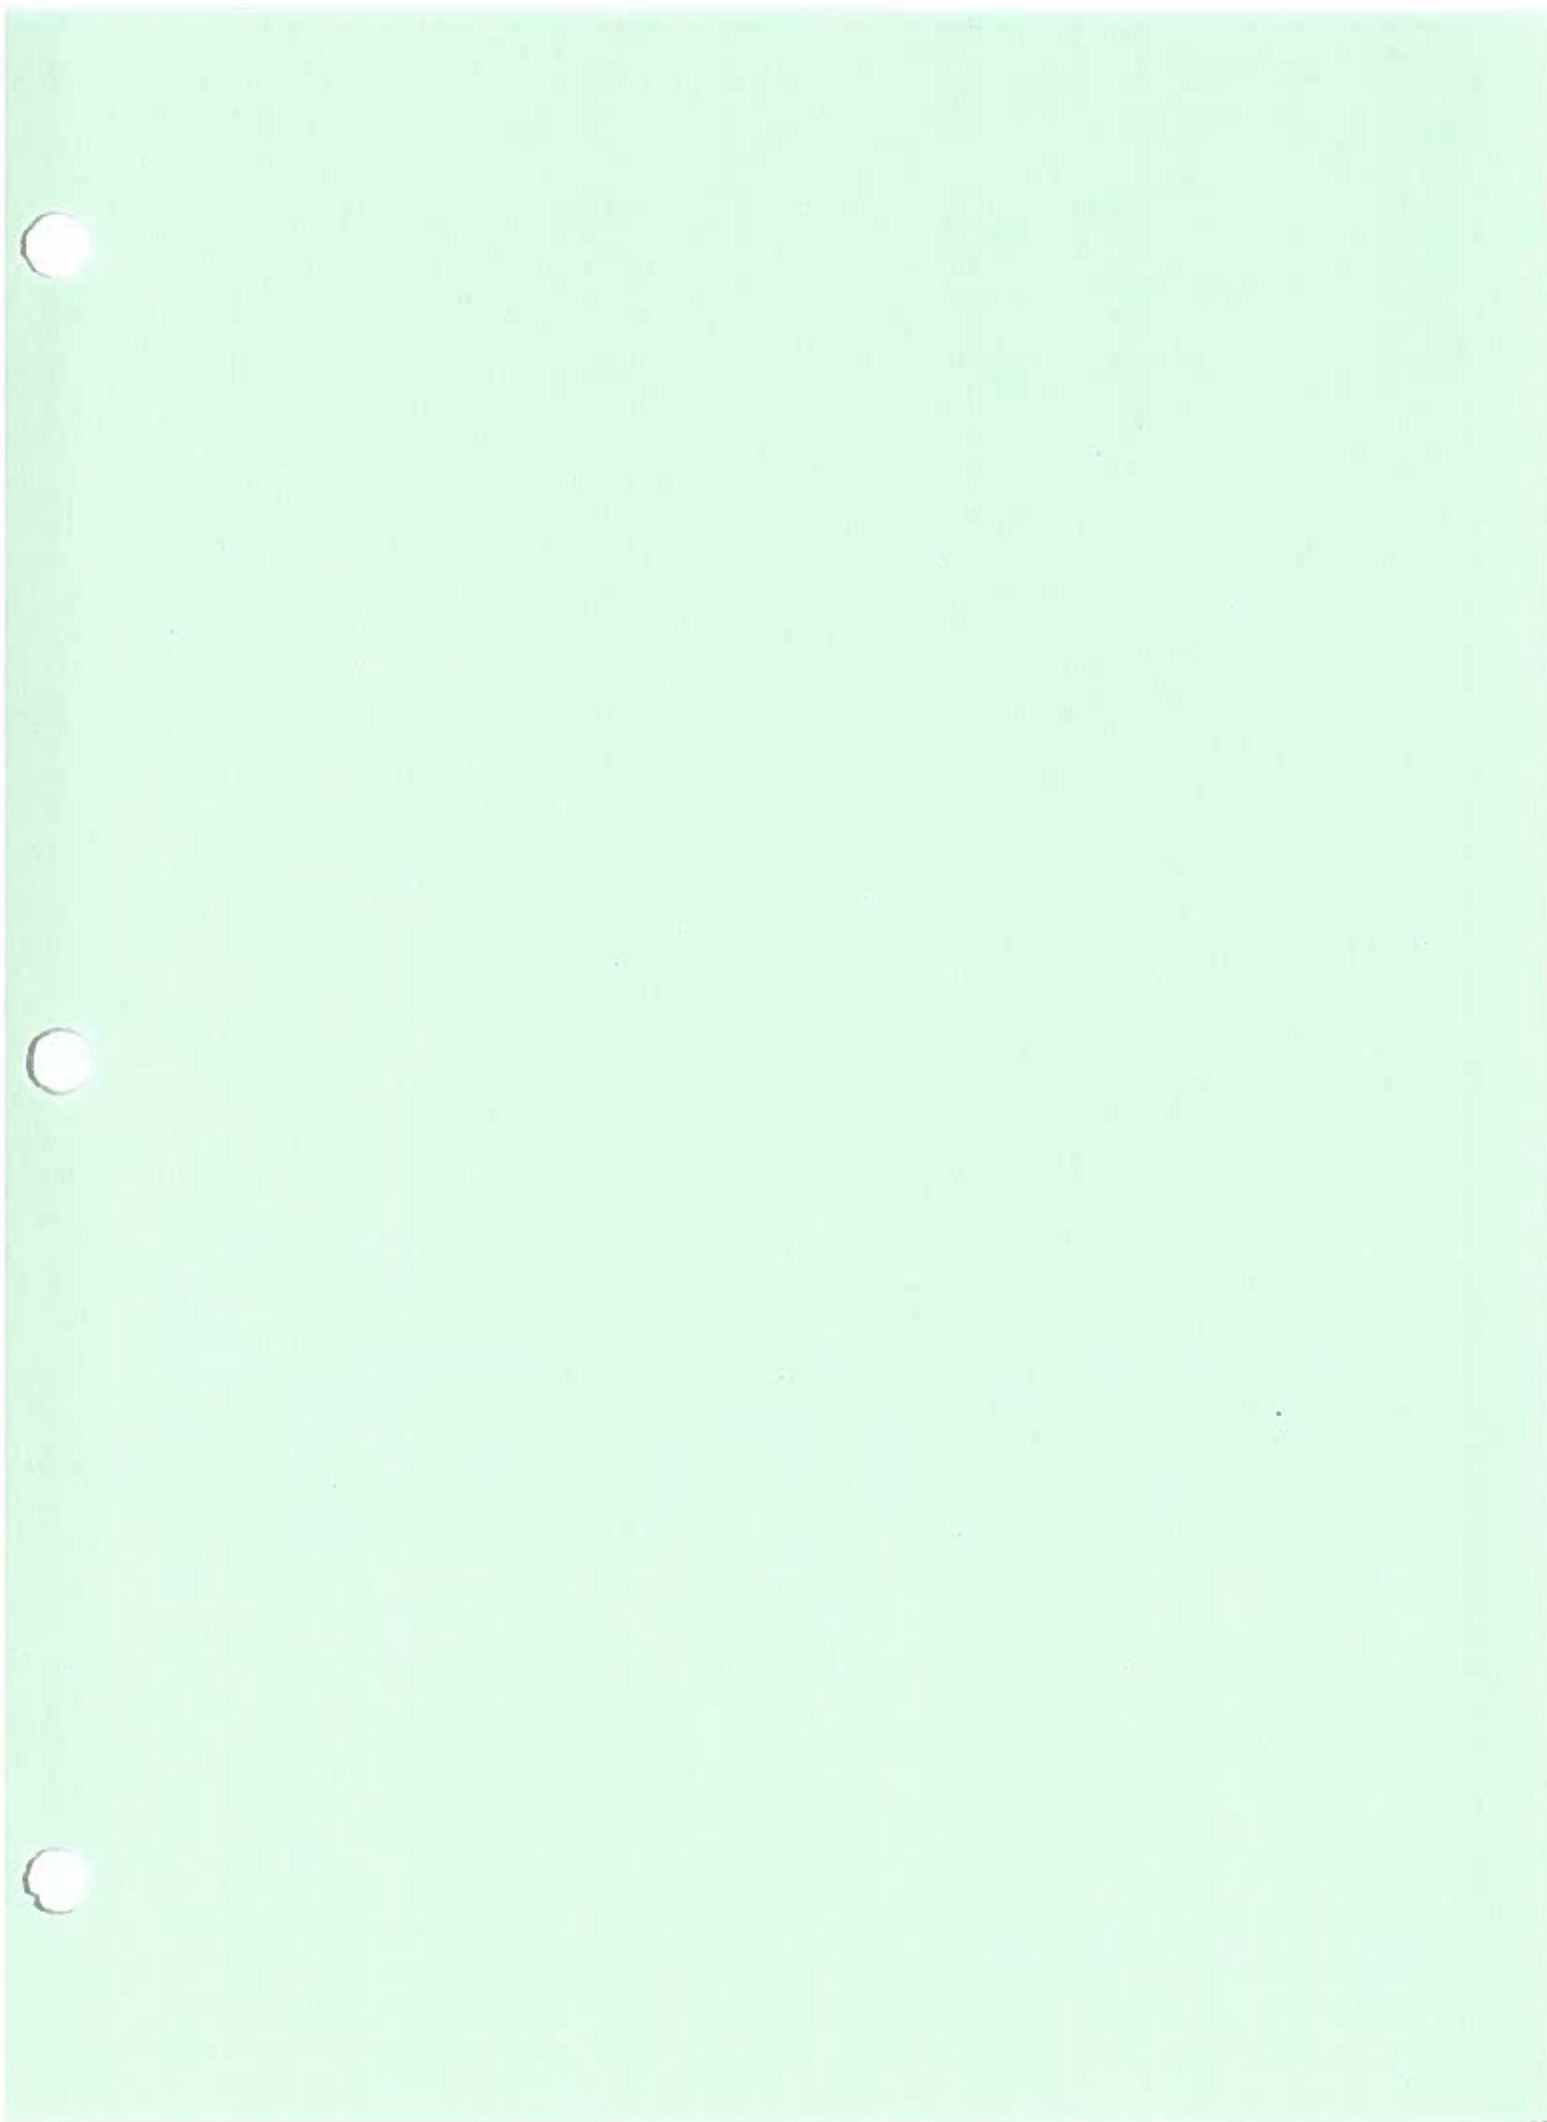

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF

Material Location
Throughout the building


Material Description
Black mastic

Comments

About two square feet of mastic was located in both air handler rooms above the stage. It was not in poor condition. No other mastic was exposed to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/09/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# C

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF


Material Location
Auditorium and upper gymnasium

Material Description
Shock joint on AHU's

Comments
There are air handler units in the upper gymnasium with shock joints on them. I was unable to tell if they were vinyl or ACM. Therefore, they will be assumed ACM until further samples can be collected. The material located in the auditorium appeared to be vinyl. Further investigation is necessary. This material was not in poor condition.

Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	05/31/1995
Current Surveillance Date	12/09/2003
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M


Inspector

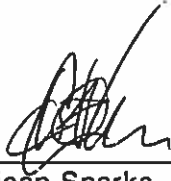

Christiaan Sparks

State Indiana

Accreditation Number 190804103

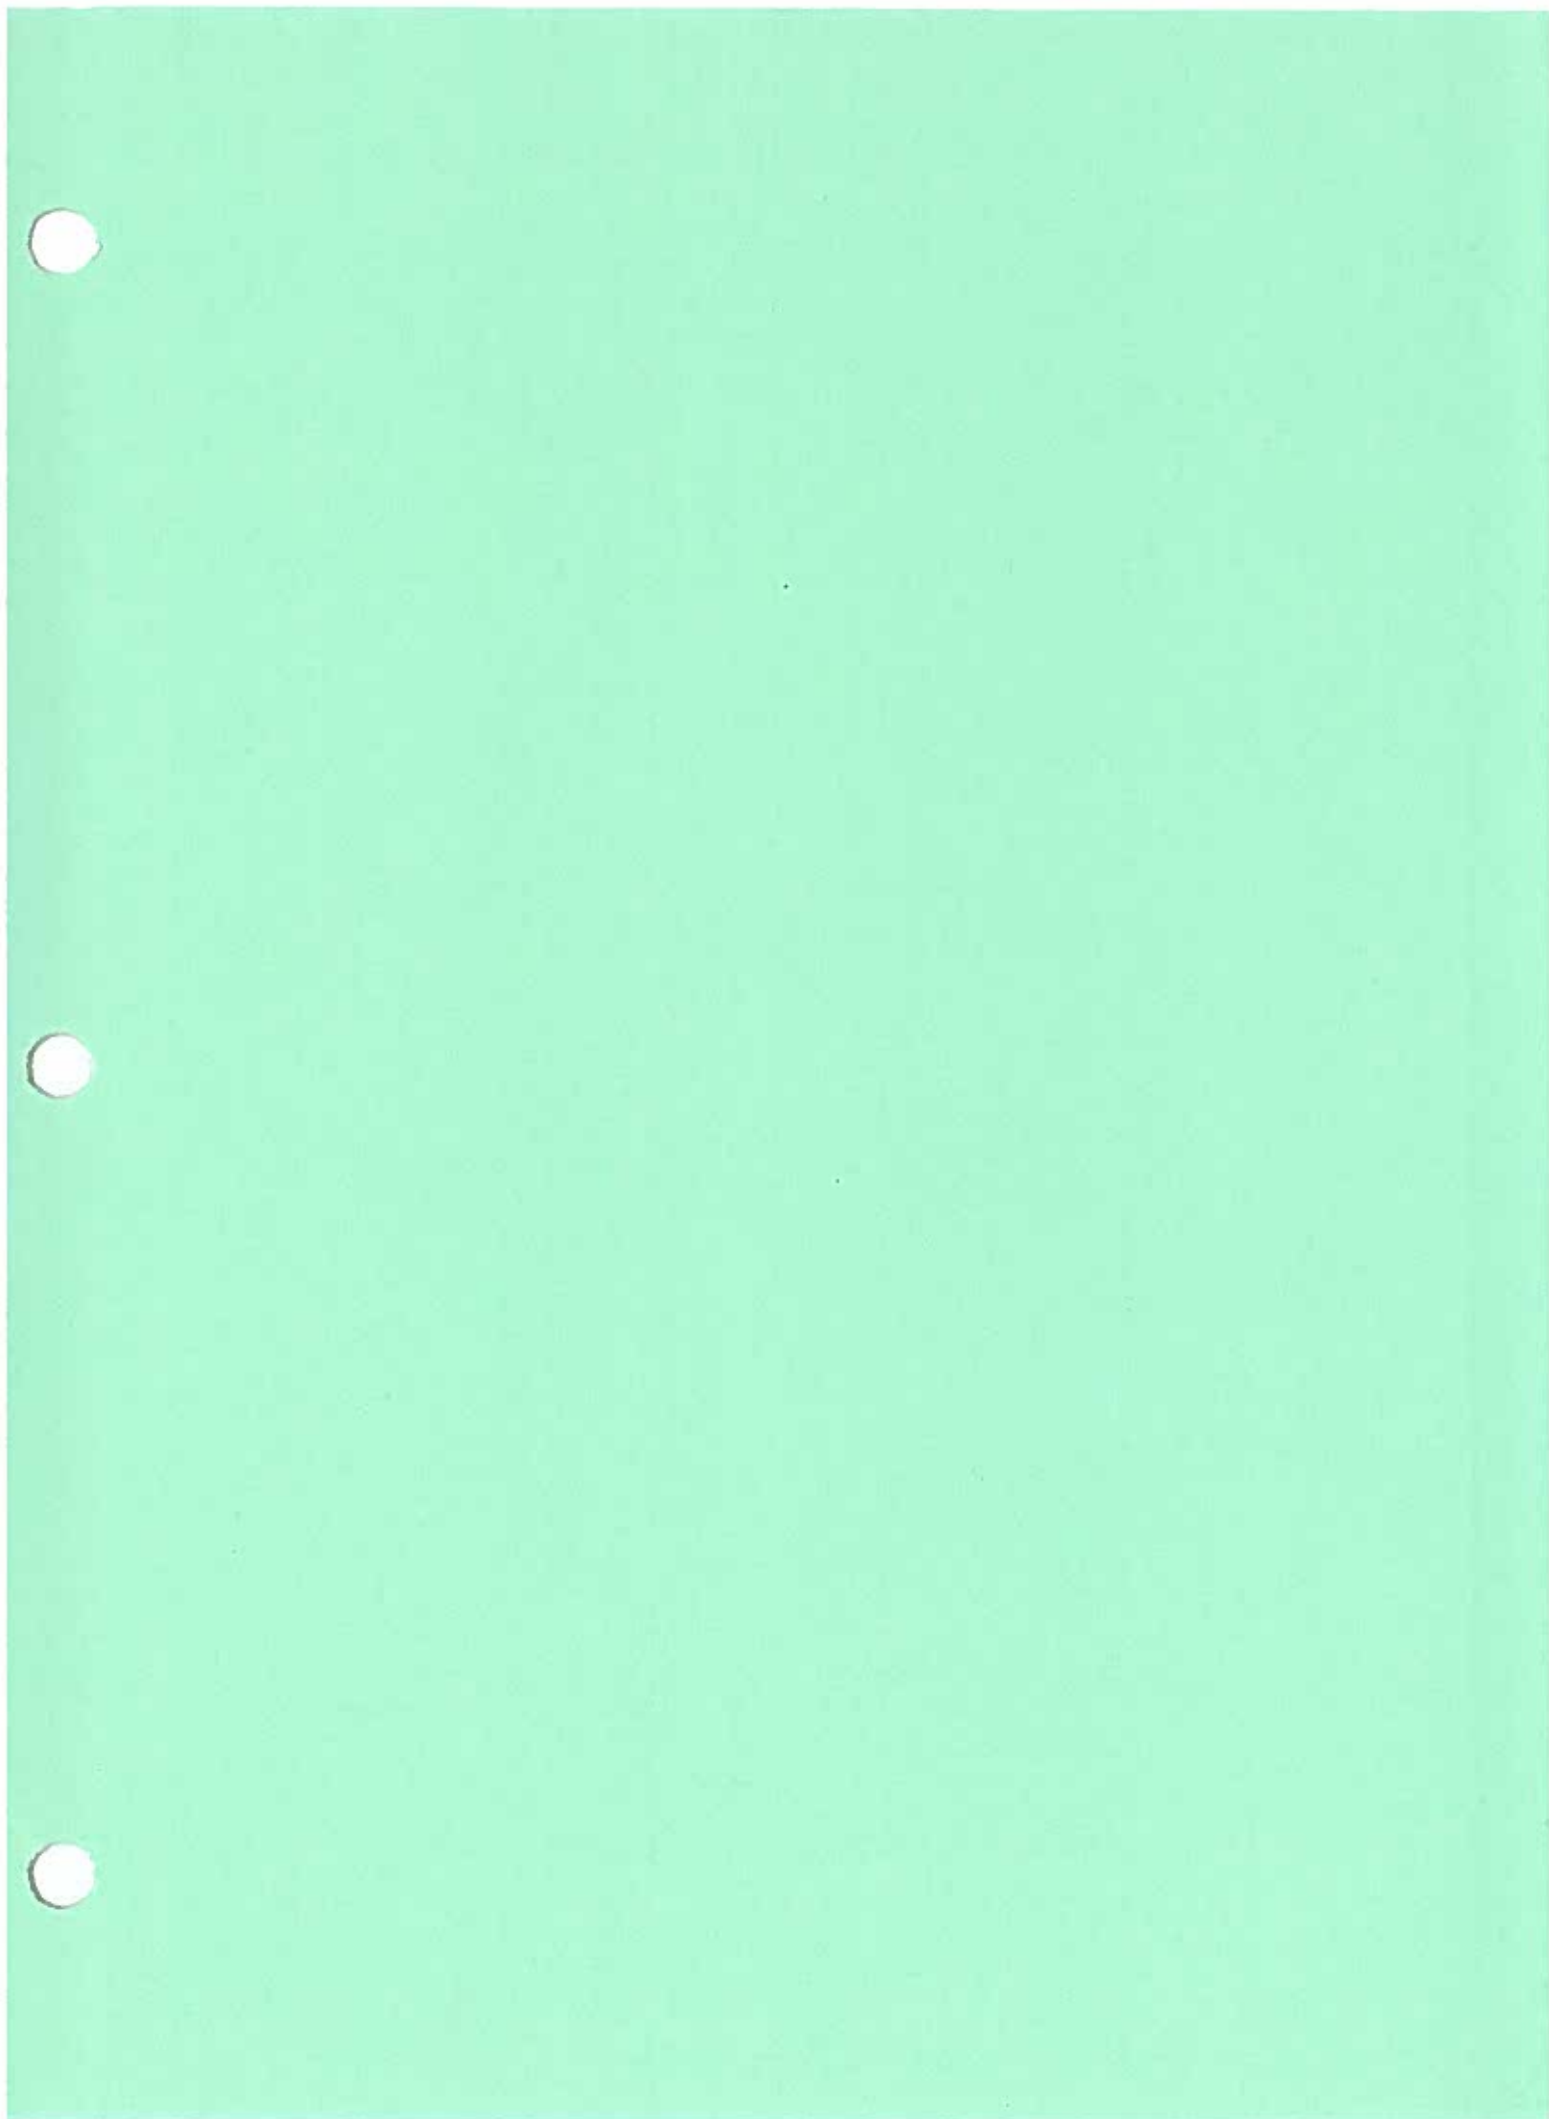

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF

Material Location
Throughout the building

Material Description
Black mastic

Comments

About two square feet of mastic was located in both air handler rooms above the stage. It was not in poor condition. No other mastic was exposed to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/12/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Auditorium and upper gymnasium

Material Description
Shock joint on AHU's

Comments

There are air handler units in the upper gymnasium with shock joints on them. I was unable to tell if they were vinyl or ACM. Therefore, they will be assumed ACM until further samples can be collected. The material located in the auditorium appeared to be vinyl. Further investigation is necessary. This material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/12/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF


Material Location
Throughout the building

Material Description
Black mastic

Comments
Mastic was located in both air handler rooms above the stage. It was not in poor condition.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/17/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christian Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Auditorium and upper gymnasium


Material Description
Shock joint on AHU's

Comments

There are air handler units in the upper gymnasium with shock joints on them. I was unable to tell if they were vinyl or ACM. Therefore, they will be assumed ACM until further samples can be collected. The material located in the auditorium appeared to vinyl. Further investigation is necessary. The materials were not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/17/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christian Sparks

State Indiana
Accreditation Number 190804103



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF
Material Location
Throughout the building
Material Description
Black mastic
Comments
No mastic was exposed to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/18/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M
Inspector

Richard D. Calvert
State Indiana
Accreditation Number 315989970

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# C

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location
Auditorium

Material Description
Shock joint on AHU's

Comments

I was able to enter mechanical room above auditorium to observe AHU shock joints. They are not in poor condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 06/18/2002

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

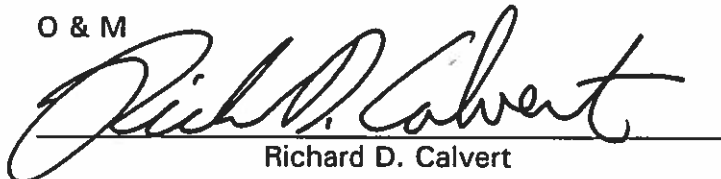
Richard D. Calvert

State Indiana

Accreditation Number 315989970



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# 04

Type of Material Miscellaneous Material

Quantity of Material 11,281 SF

Material Location
Throughout the building

Material Description
Black mastic

Comments
Black mastic was visible in some areas where carpet has been pulled up and tile previously removed. Where visible it is not in poor condition.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 06/01/1992

Current Surveillance Date 12/11/2001

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

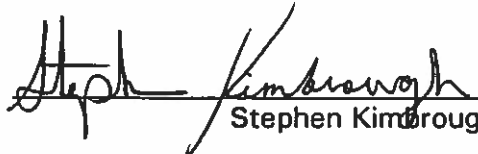

Stephen Kimbrough

State Indiana

Accreditation Number 191914122

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# C

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location
Auditorium

Material Description
Shock joint on AHU's

Comments

I was able to enter mechanical room above auditorium to observe AHU shock joints. They are not in poor condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 12/11/2001

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M


Inspector



Stephen Kimbrough

State Indiana

Accreditation Number 191914122

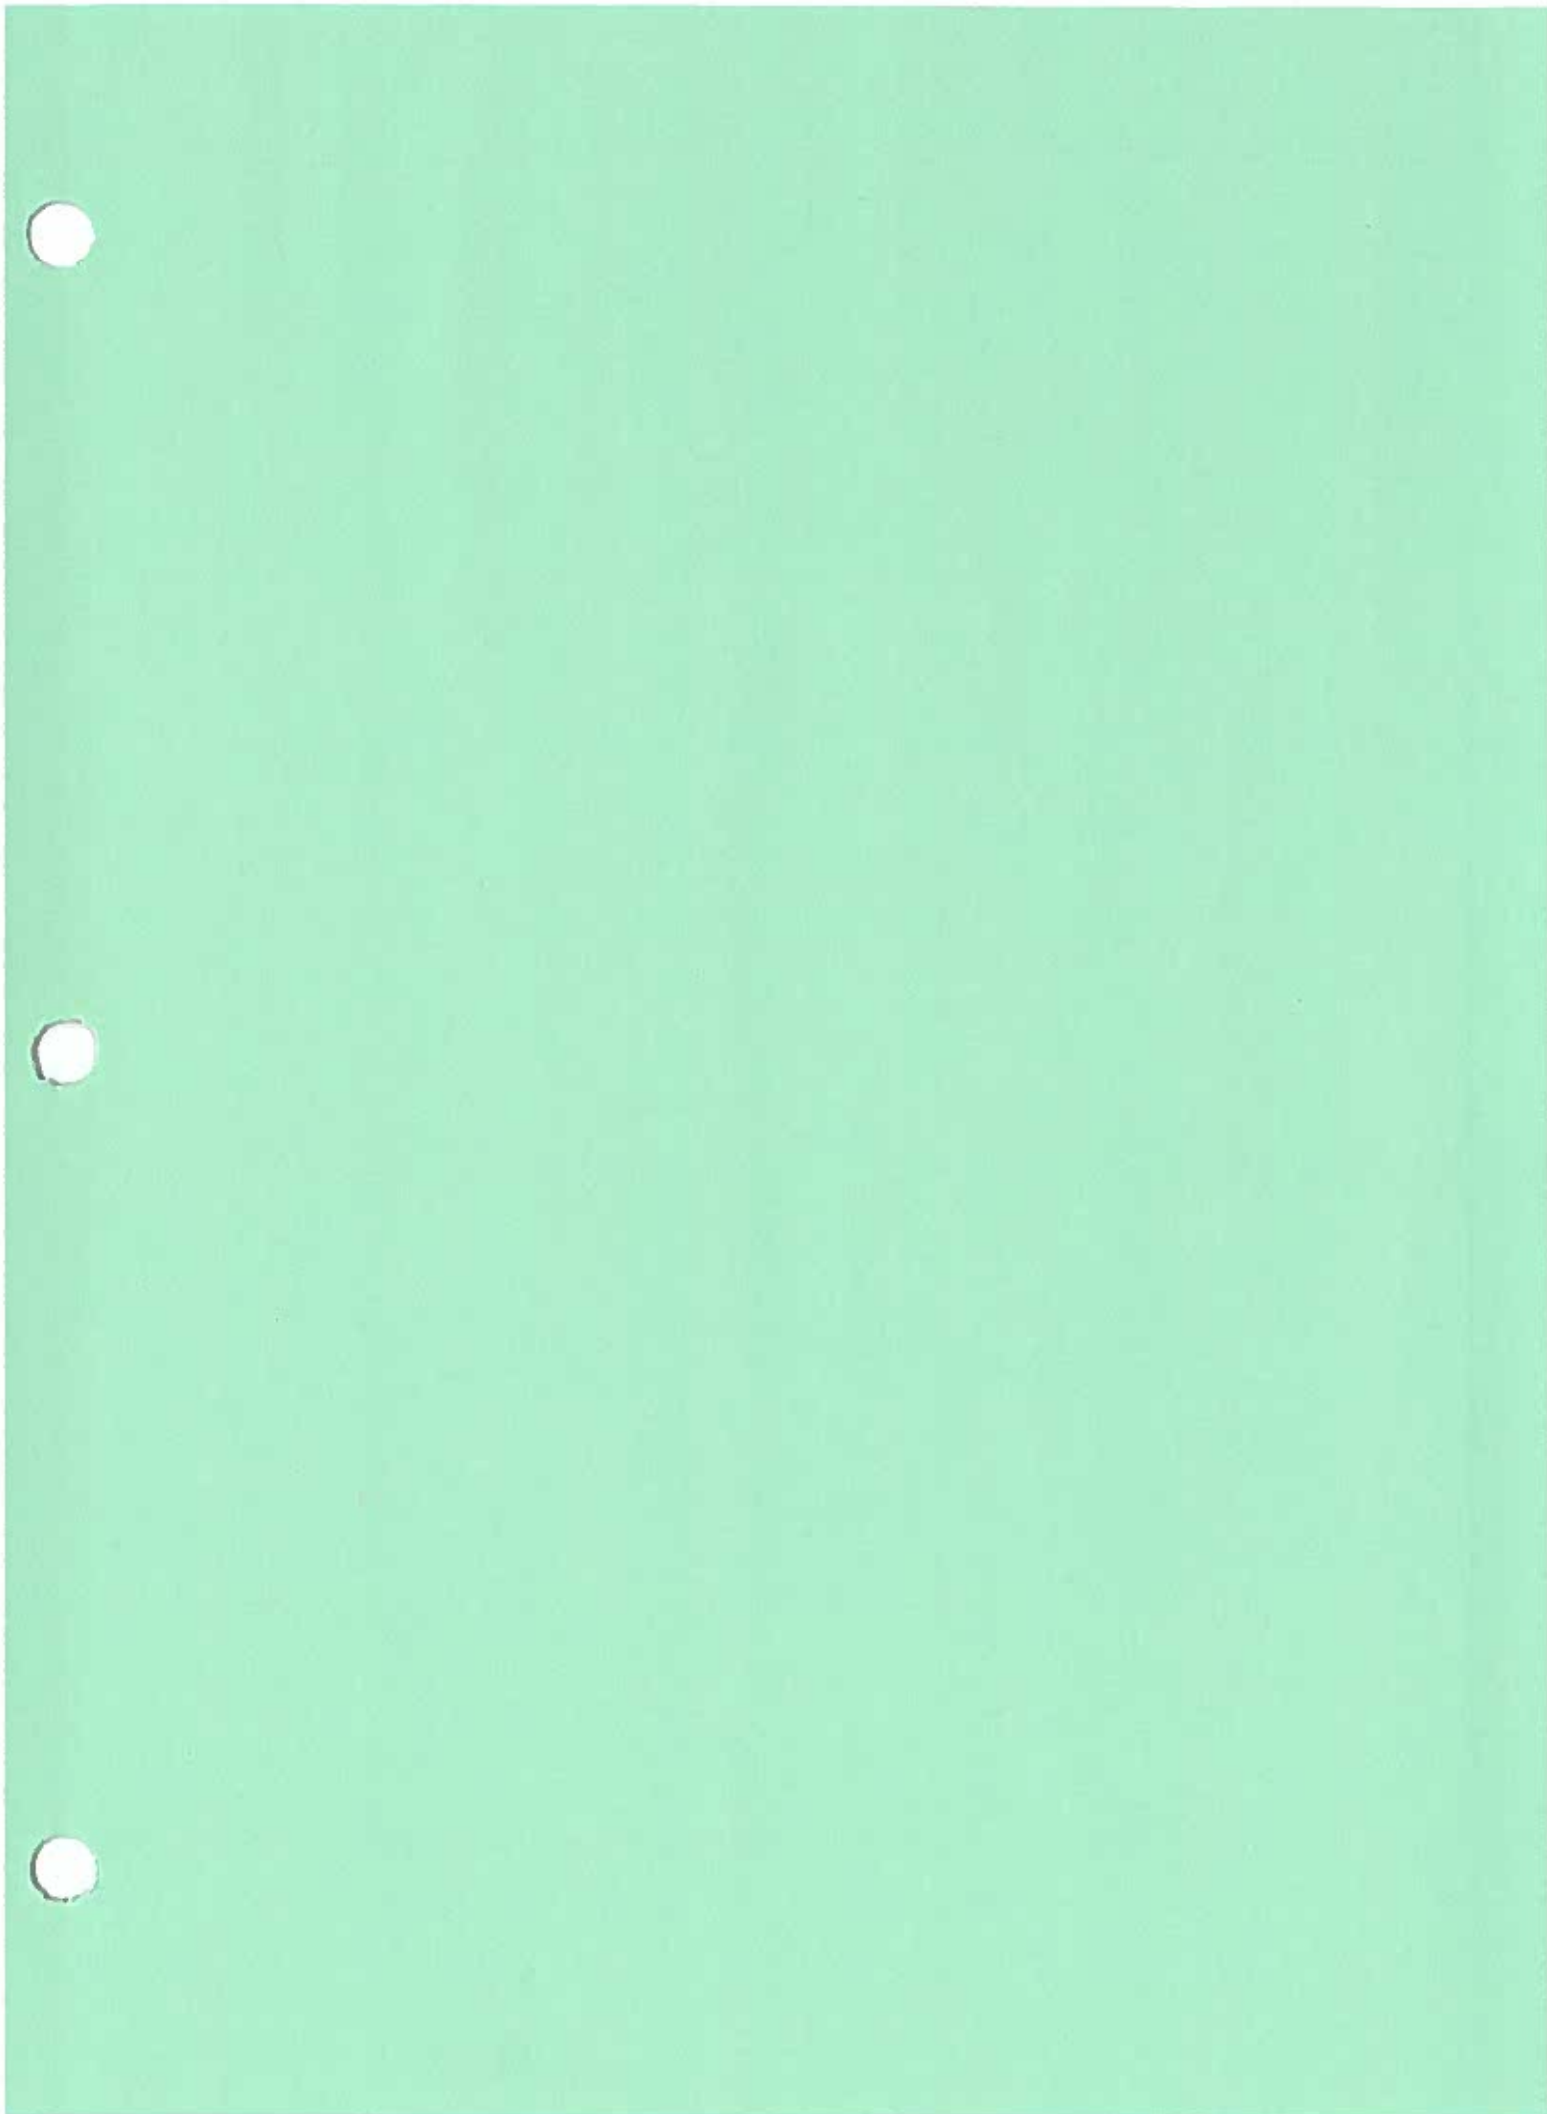

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# 04

Type of Material Miscellaneous Material

Quantity of Material 11,281 SF

Material Location
Throughout the building

Material Description
Black mastic

Comments
Black mastic was visible in some areas where carpet has been pulled up and tile previously removed. Where visible it is in good condition.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 06/01/1992

Current Surveillance Date 01/09/2001

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Patrick E. Wilson


State Indiana

Accreditation Number 190824065

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Auditorium
Material Description
Shock joint on AHU's
Comments
Entry door is 14' off floor - no way to get in. No ladder available.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 01/09/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Patrick E. Wilson

State Indiana
Accreditation Number 190824065

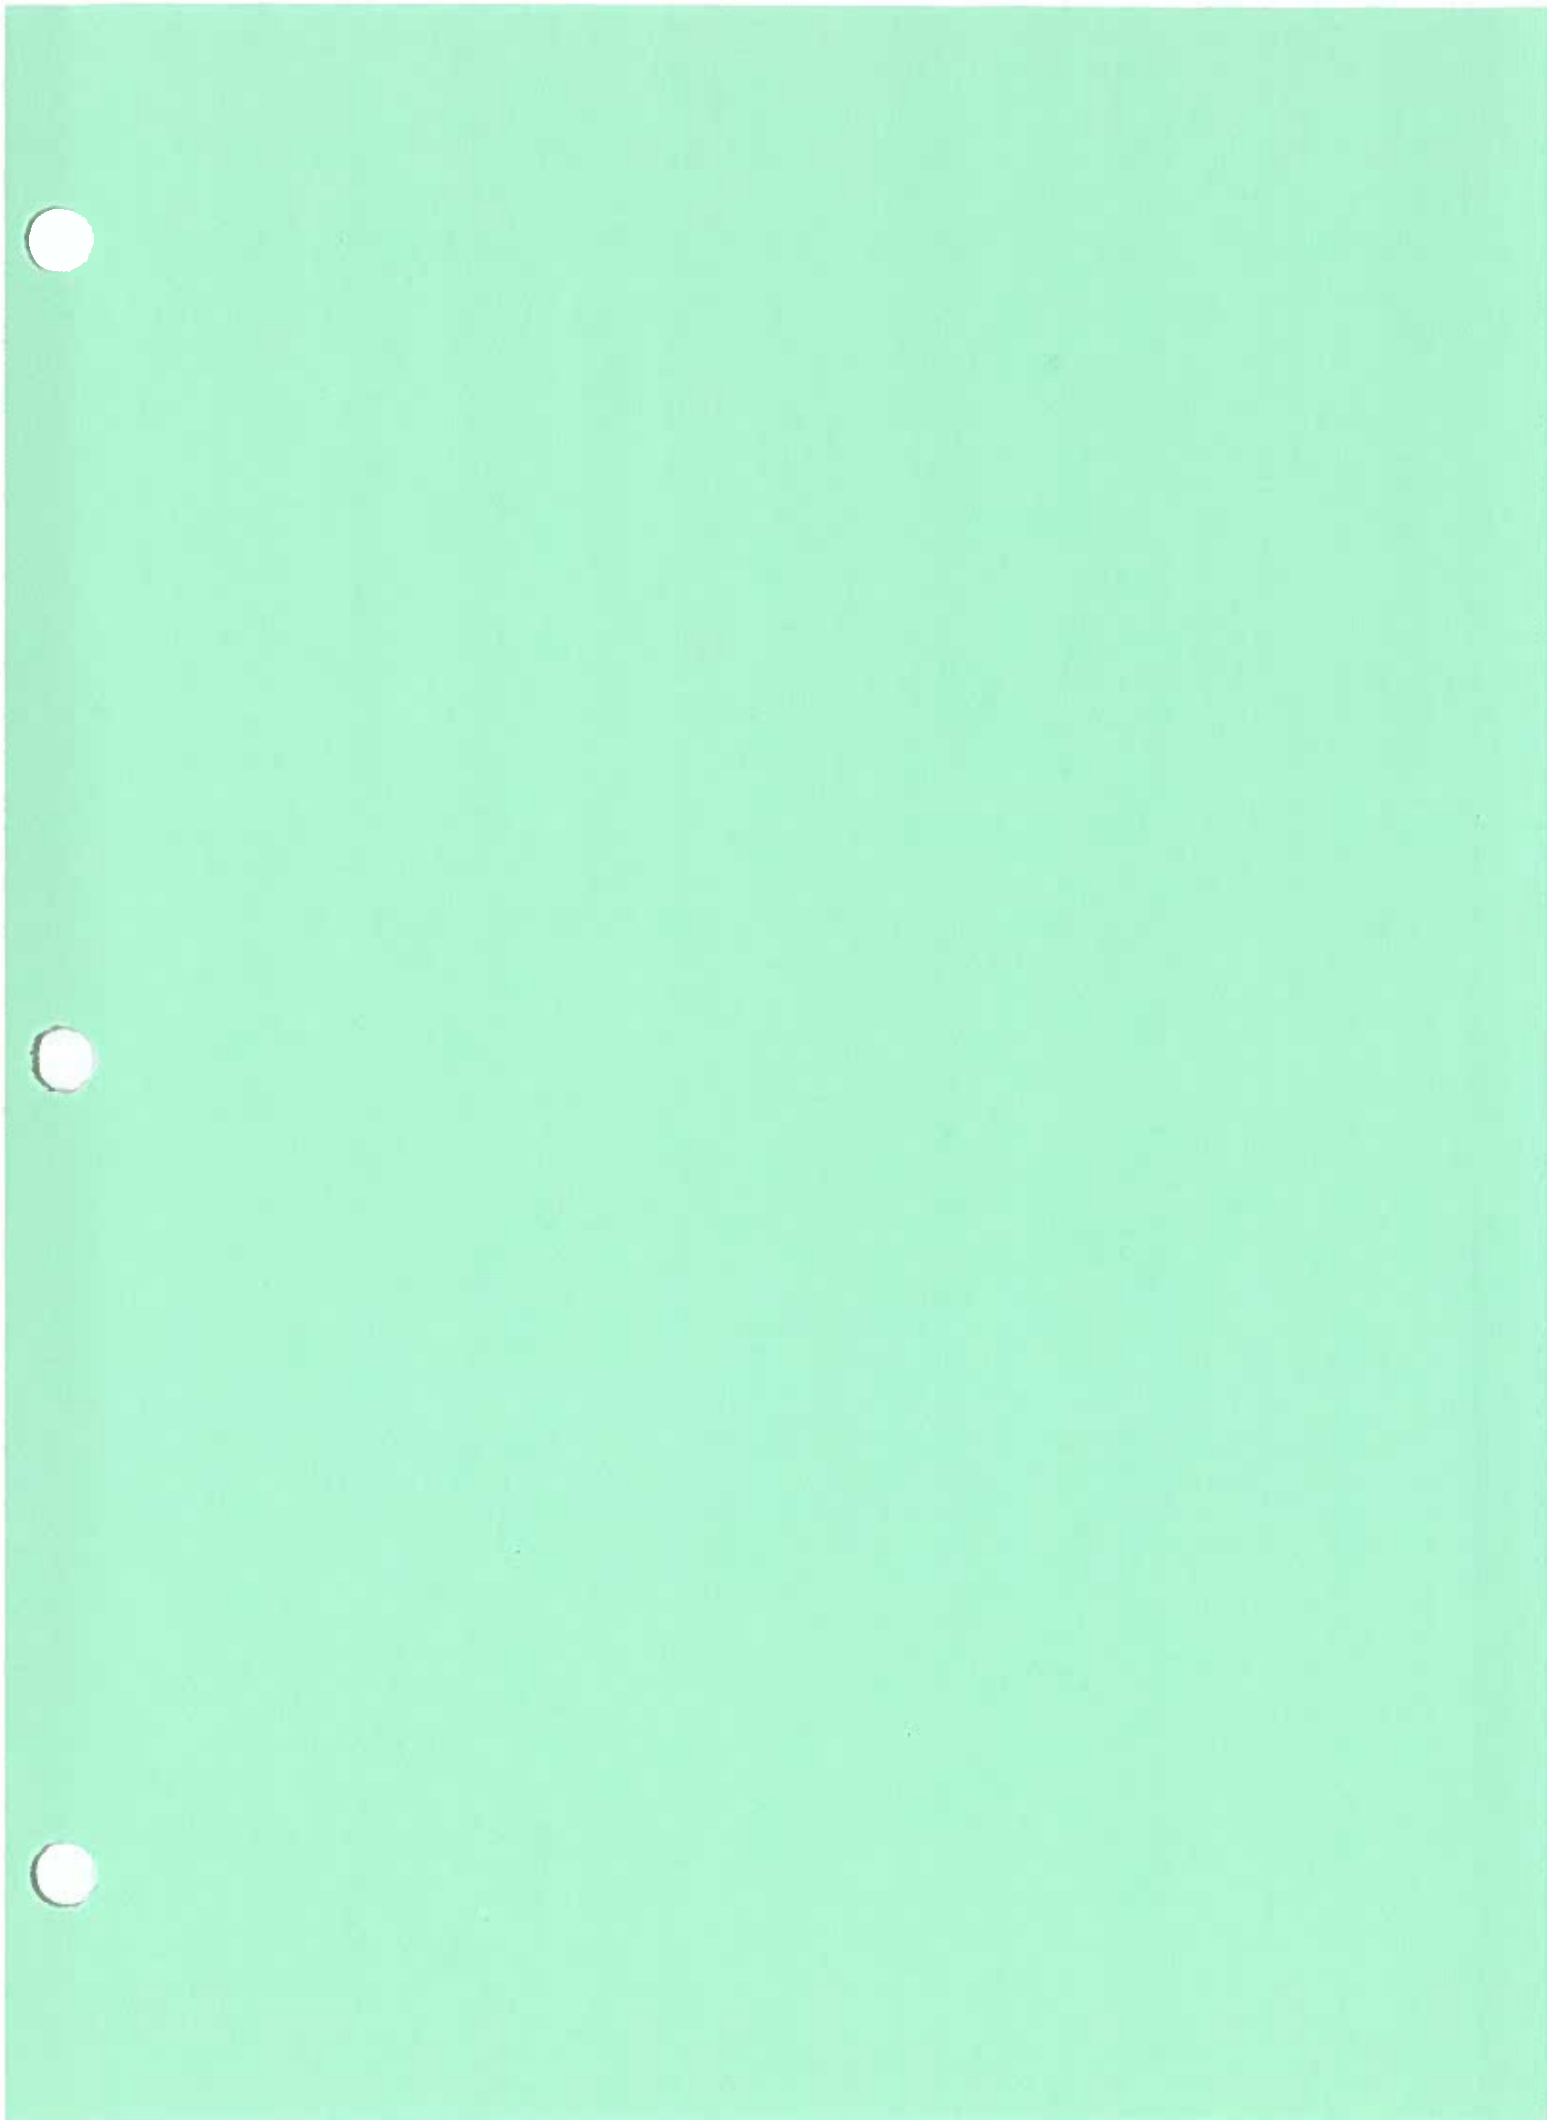

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# 04

Type of Material Miscellaneous Material

Quantity of Material 11281 SF

Material Location
Throughout building

Material Description
Black Mastic

Comments

Black mastic was visible in some areas where carpet has been pulled up and tile previously removed. Where visible it is in good condition.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 06/01/1992

Current Surveillance Date 06/29/2000

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Auditorium
Material Description
Shock Joint on AHU's

Comments

Entry door is 14' off floor - no way to get in. No ladder available. Will make arrangements for ladder on next trip to building.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/29/2000
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogile


State Indiana
Accreditation Number 191523030



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11281 SF
Material Location
Throughout building
Material Description
Mastic
Comments
Material is assumed to be in good condition.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Matthew Wallace

State Indiana
Accreditation Number 191219020


PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Auditorium
Material Description
Shock Joint on AHV's
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Matthew Wallace

State Indiana
Accreditation Number 191219020

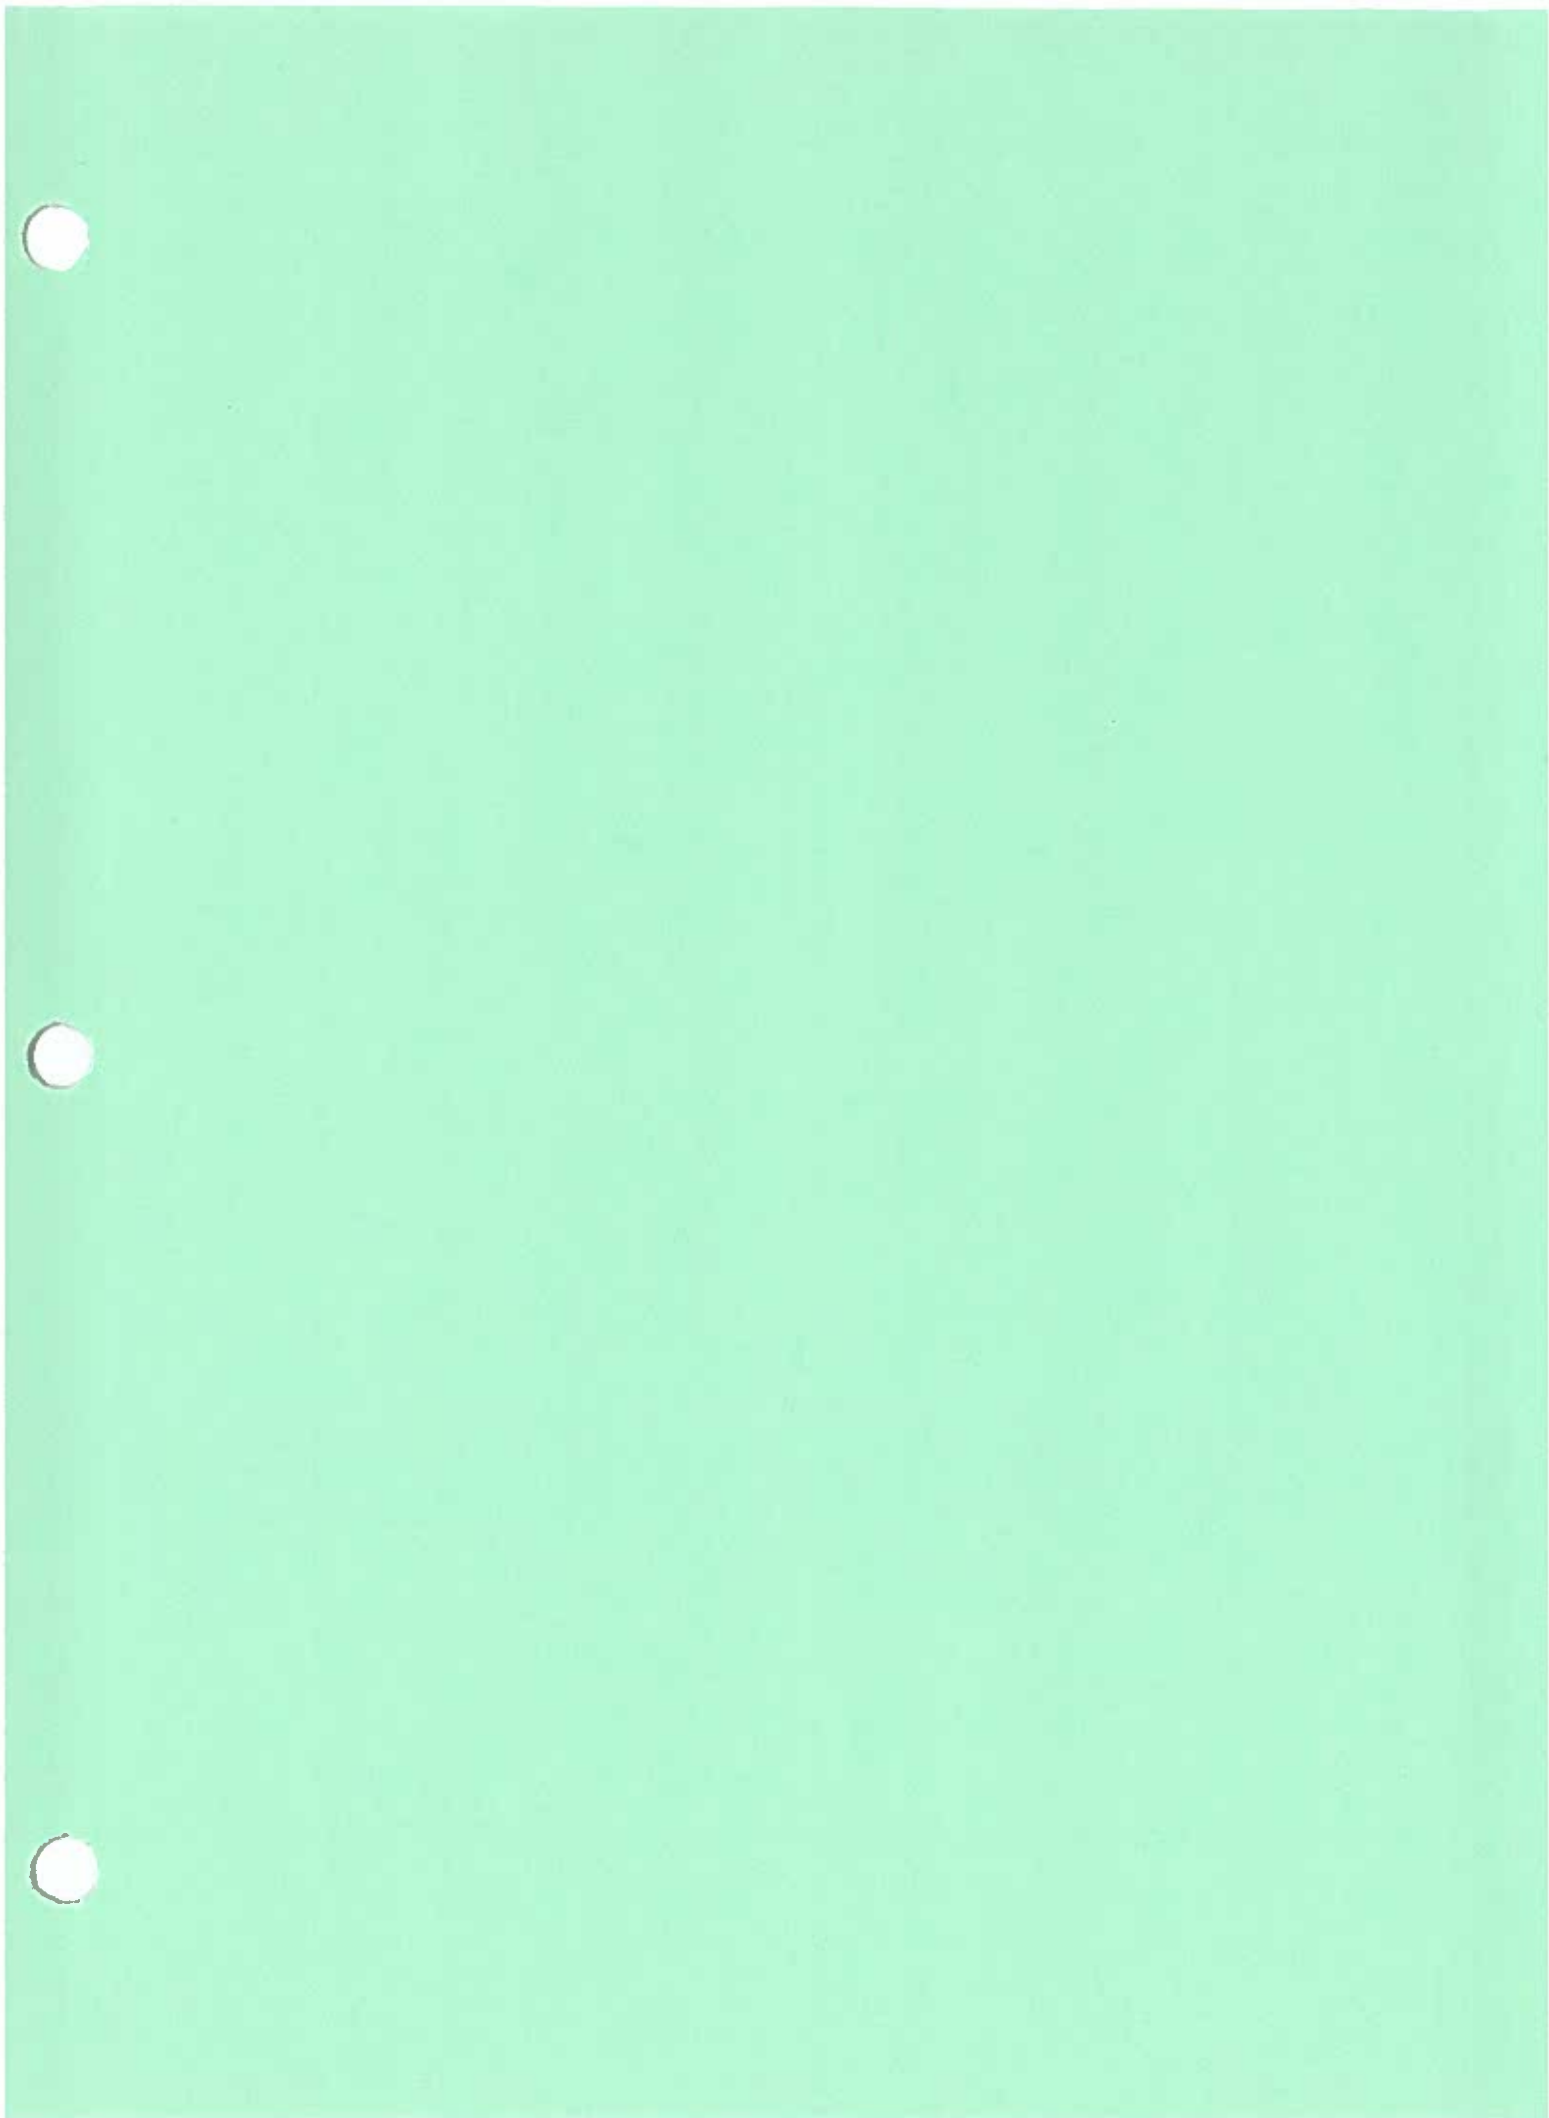

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11281 SF
Material Location
Throughout building
Material Description
Mastic
Comments
Material is assumed to be in good condition.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M
Inspector 
Matthew Wallace
State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Auditorium
Material Description
Shock Joint on AHV's
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector




Matthew Wallace

State

Indiana

Accreditation Number

191219020

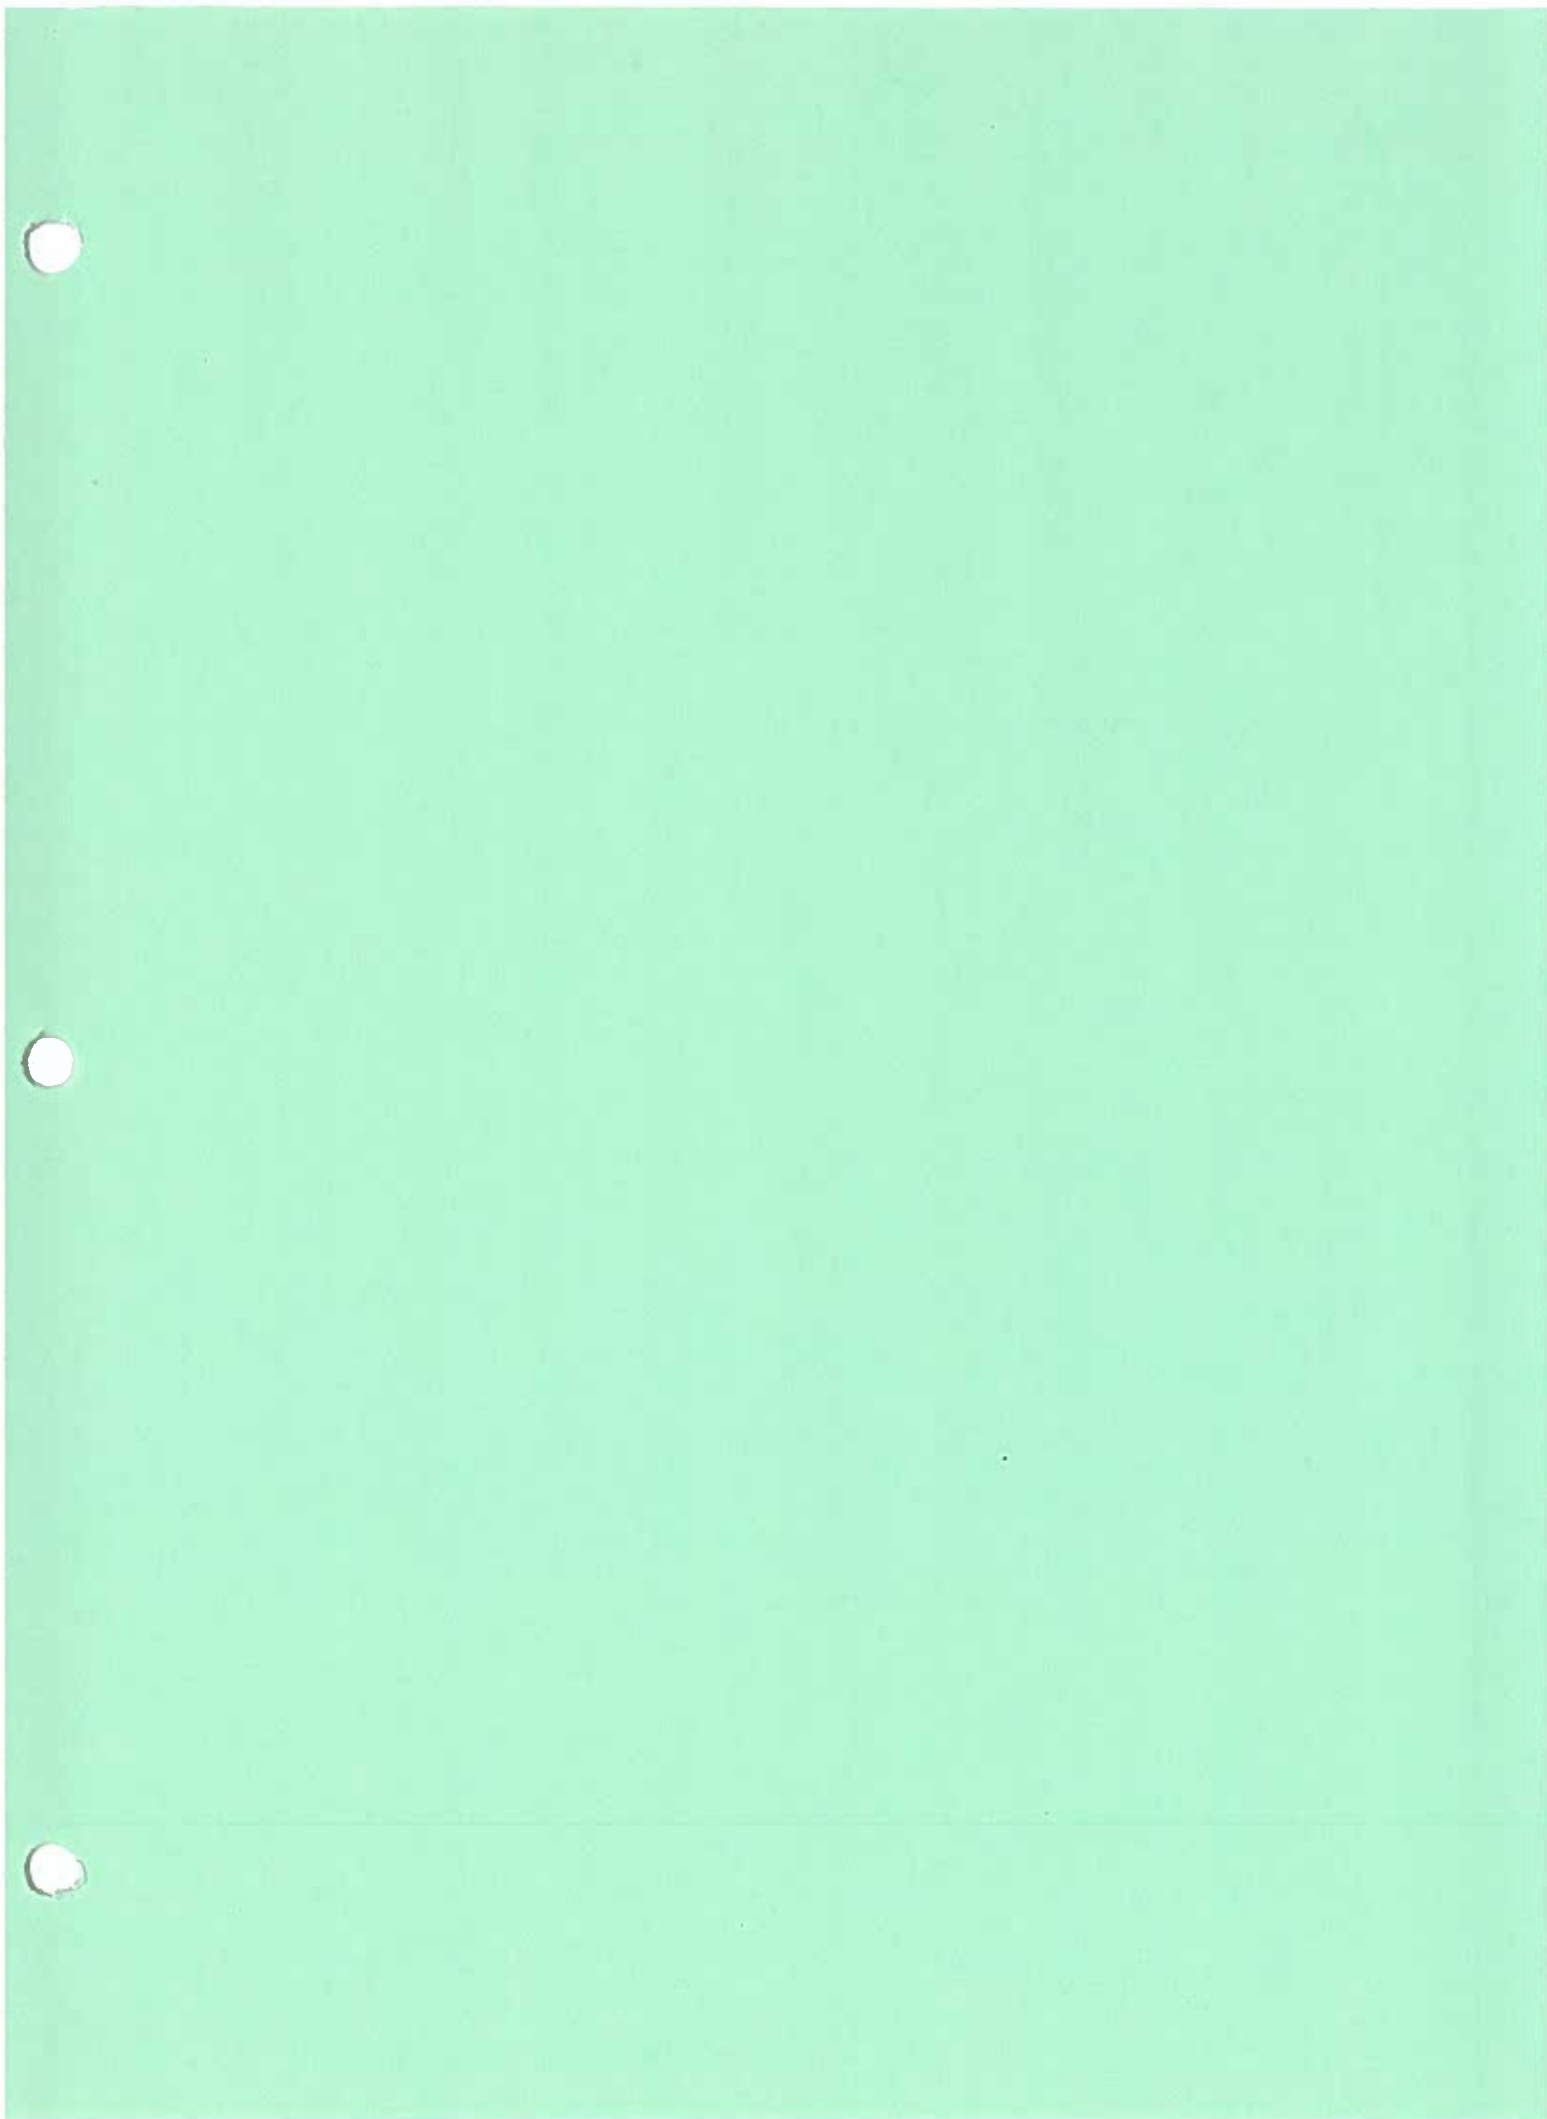


PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11281 SF
Material Location Throughout building
Material Description Mastic

Comments
Material is assumed to be in good condition.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/29/1998
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

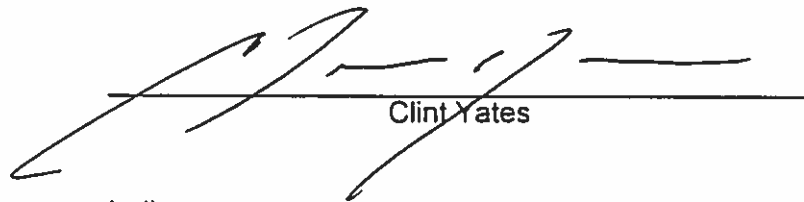

Clint Yates

State Indiana
Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# C

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location
Auditorium

Material Description
Shock Joint on AHV's

Comments
Material is in good condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 12/29/1998

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M


Inspector



Clint Yates

State Indiana

Accreditation Number 193804035

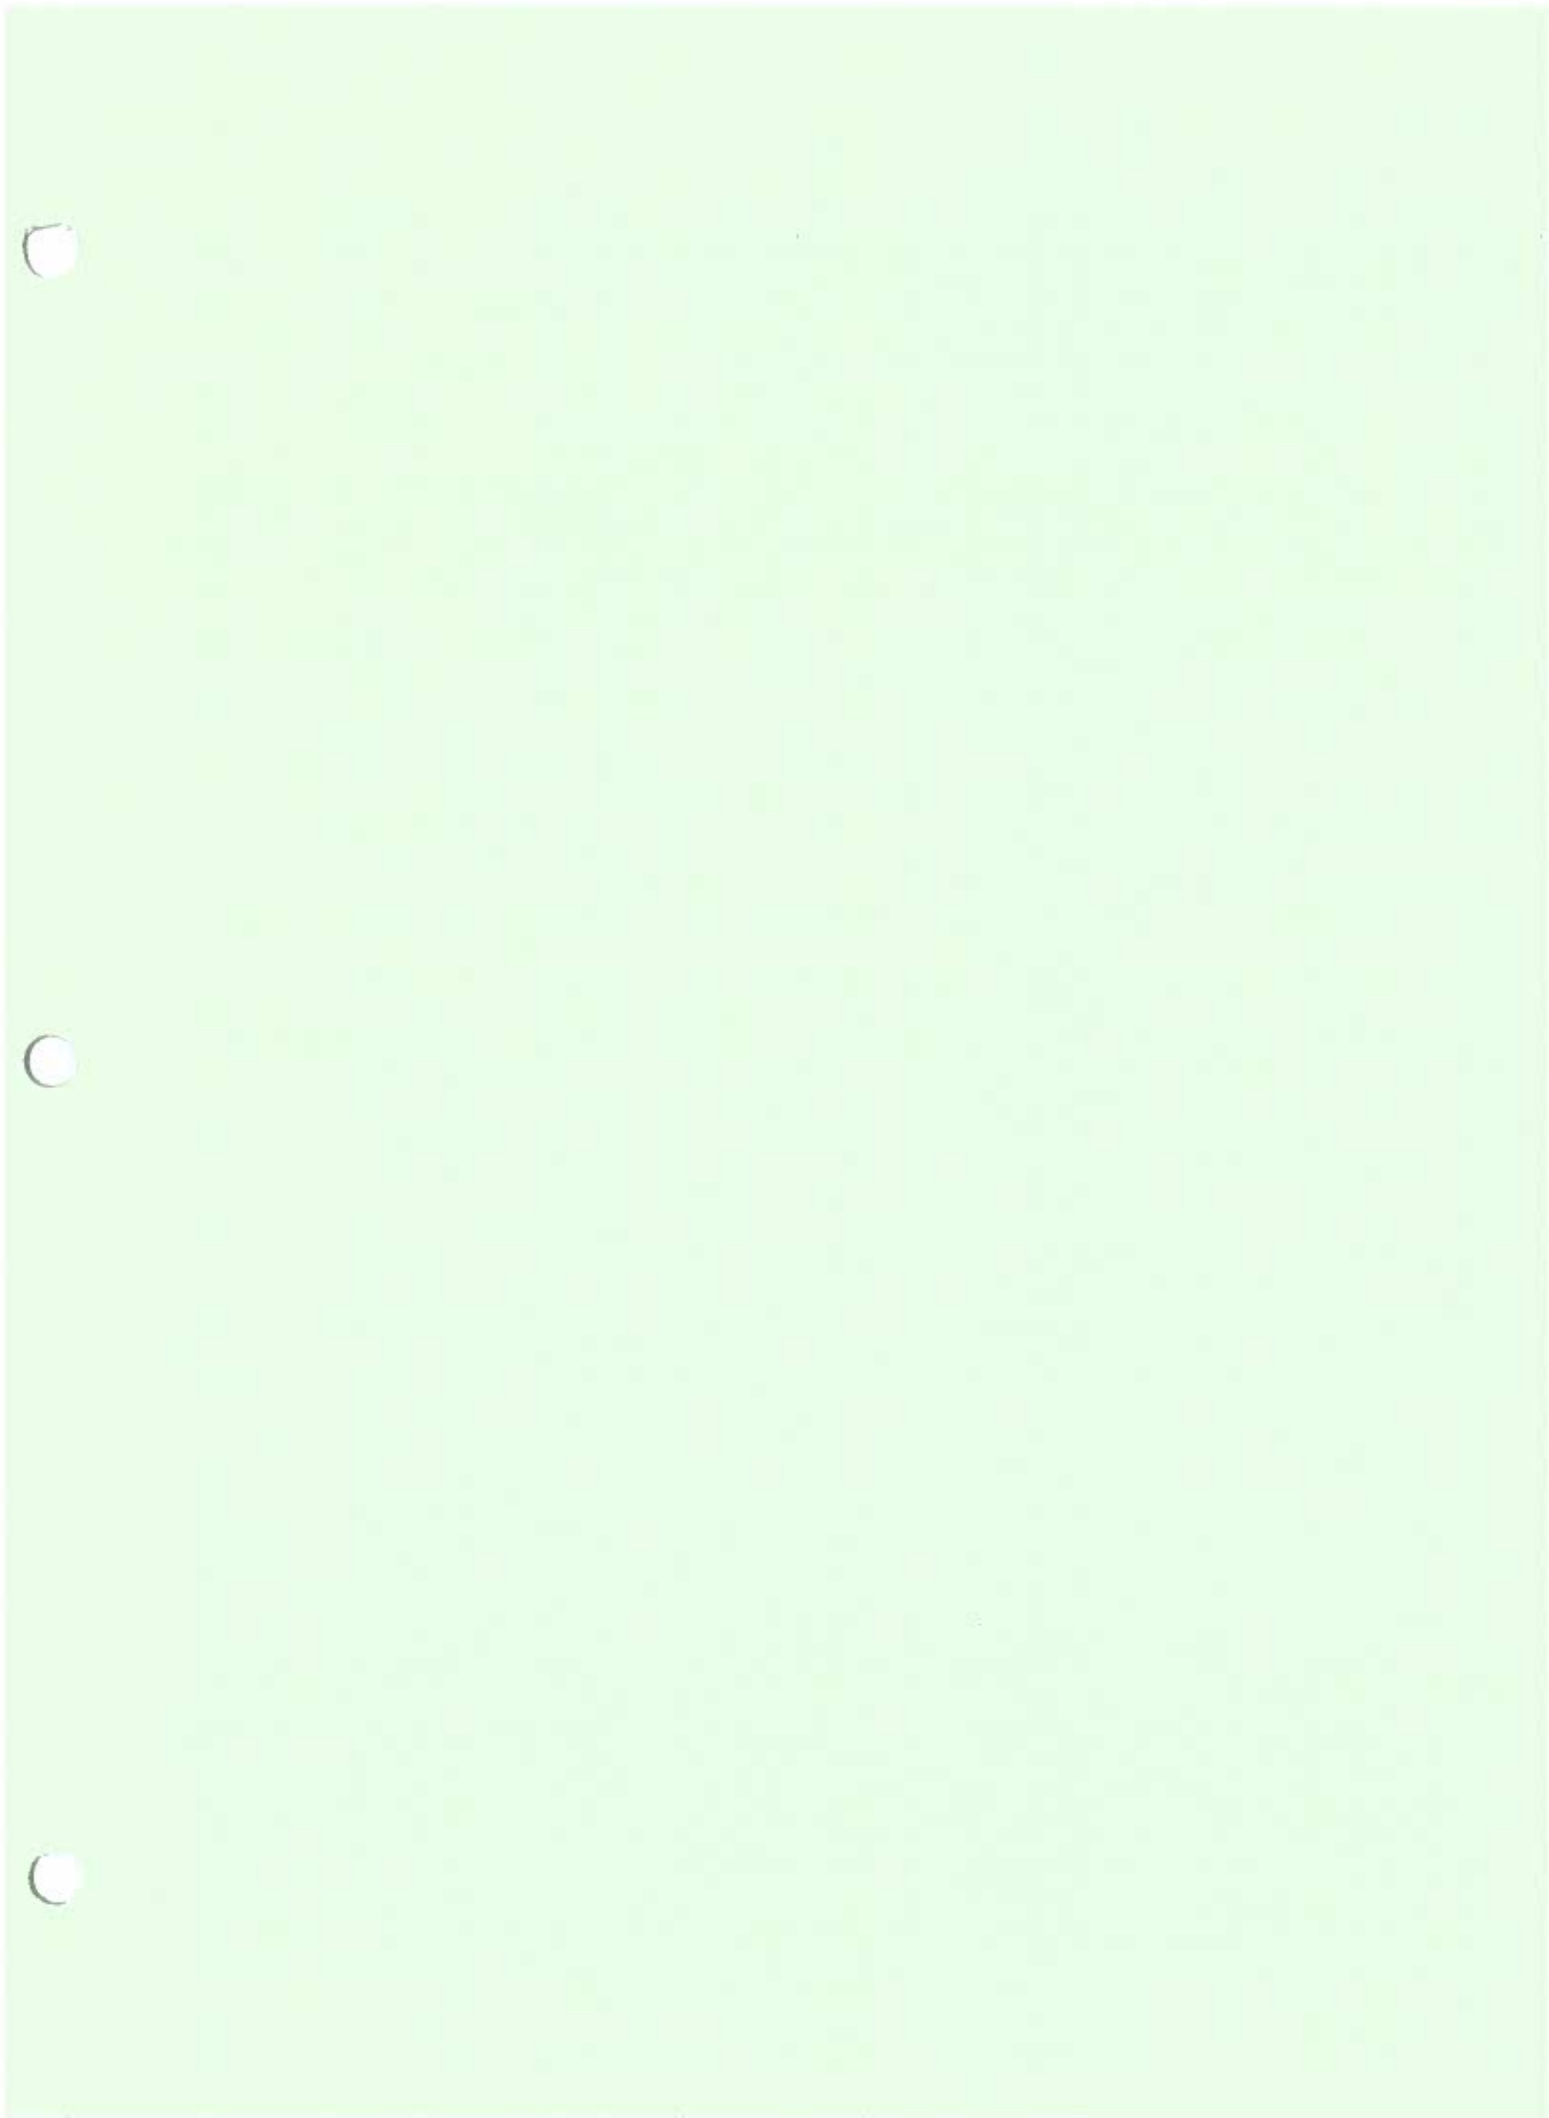

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF
Material Location
Throughout building
Material Description
Mastic

Comments
Material is assumed to be in good condition.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 1/14/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# A
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout building
Material Description
Cove Base

Comments

Material has been removed and replaced with new.

Does Material Contain Asbestos? No
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 1/14/98
Current Assessment Rating NA Not Applicable
Cause of Damage Not Applicable
Accessible No
Potential for Damage NA
Removed Yes
Planned Response Action None

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout building
Material Description
Cove Base Mastic

Comments

Material was sampled as alot of it is exposed during this surveillance. Results are negative for asbestos.

Does Material Contain Asbestos? No
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 1/14/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action None

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material SF
Material Location Auditorium
Material Description Shock Joint on AHV's
Comments Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 1/14/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# D

Type of Material Miscellaneous Material

Quantity of Material SF

Material Location
Incinerator in Boiler Room

Material Description
Fire Brick

Comments

Material was sampled in March '96. It is negative for asbestos. Incinerator has been removed.

Does Material Contain Asbestos? No
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 1/14/98
Current Assessment Rating NA Not Applicable
Cause of Damage Not Applicable
Accessible No
Potential for Damage NA
Removed Yes
Planned Response Action None


Inspector



Karen Foxx

State Indiana

Accreditation Number 191129014

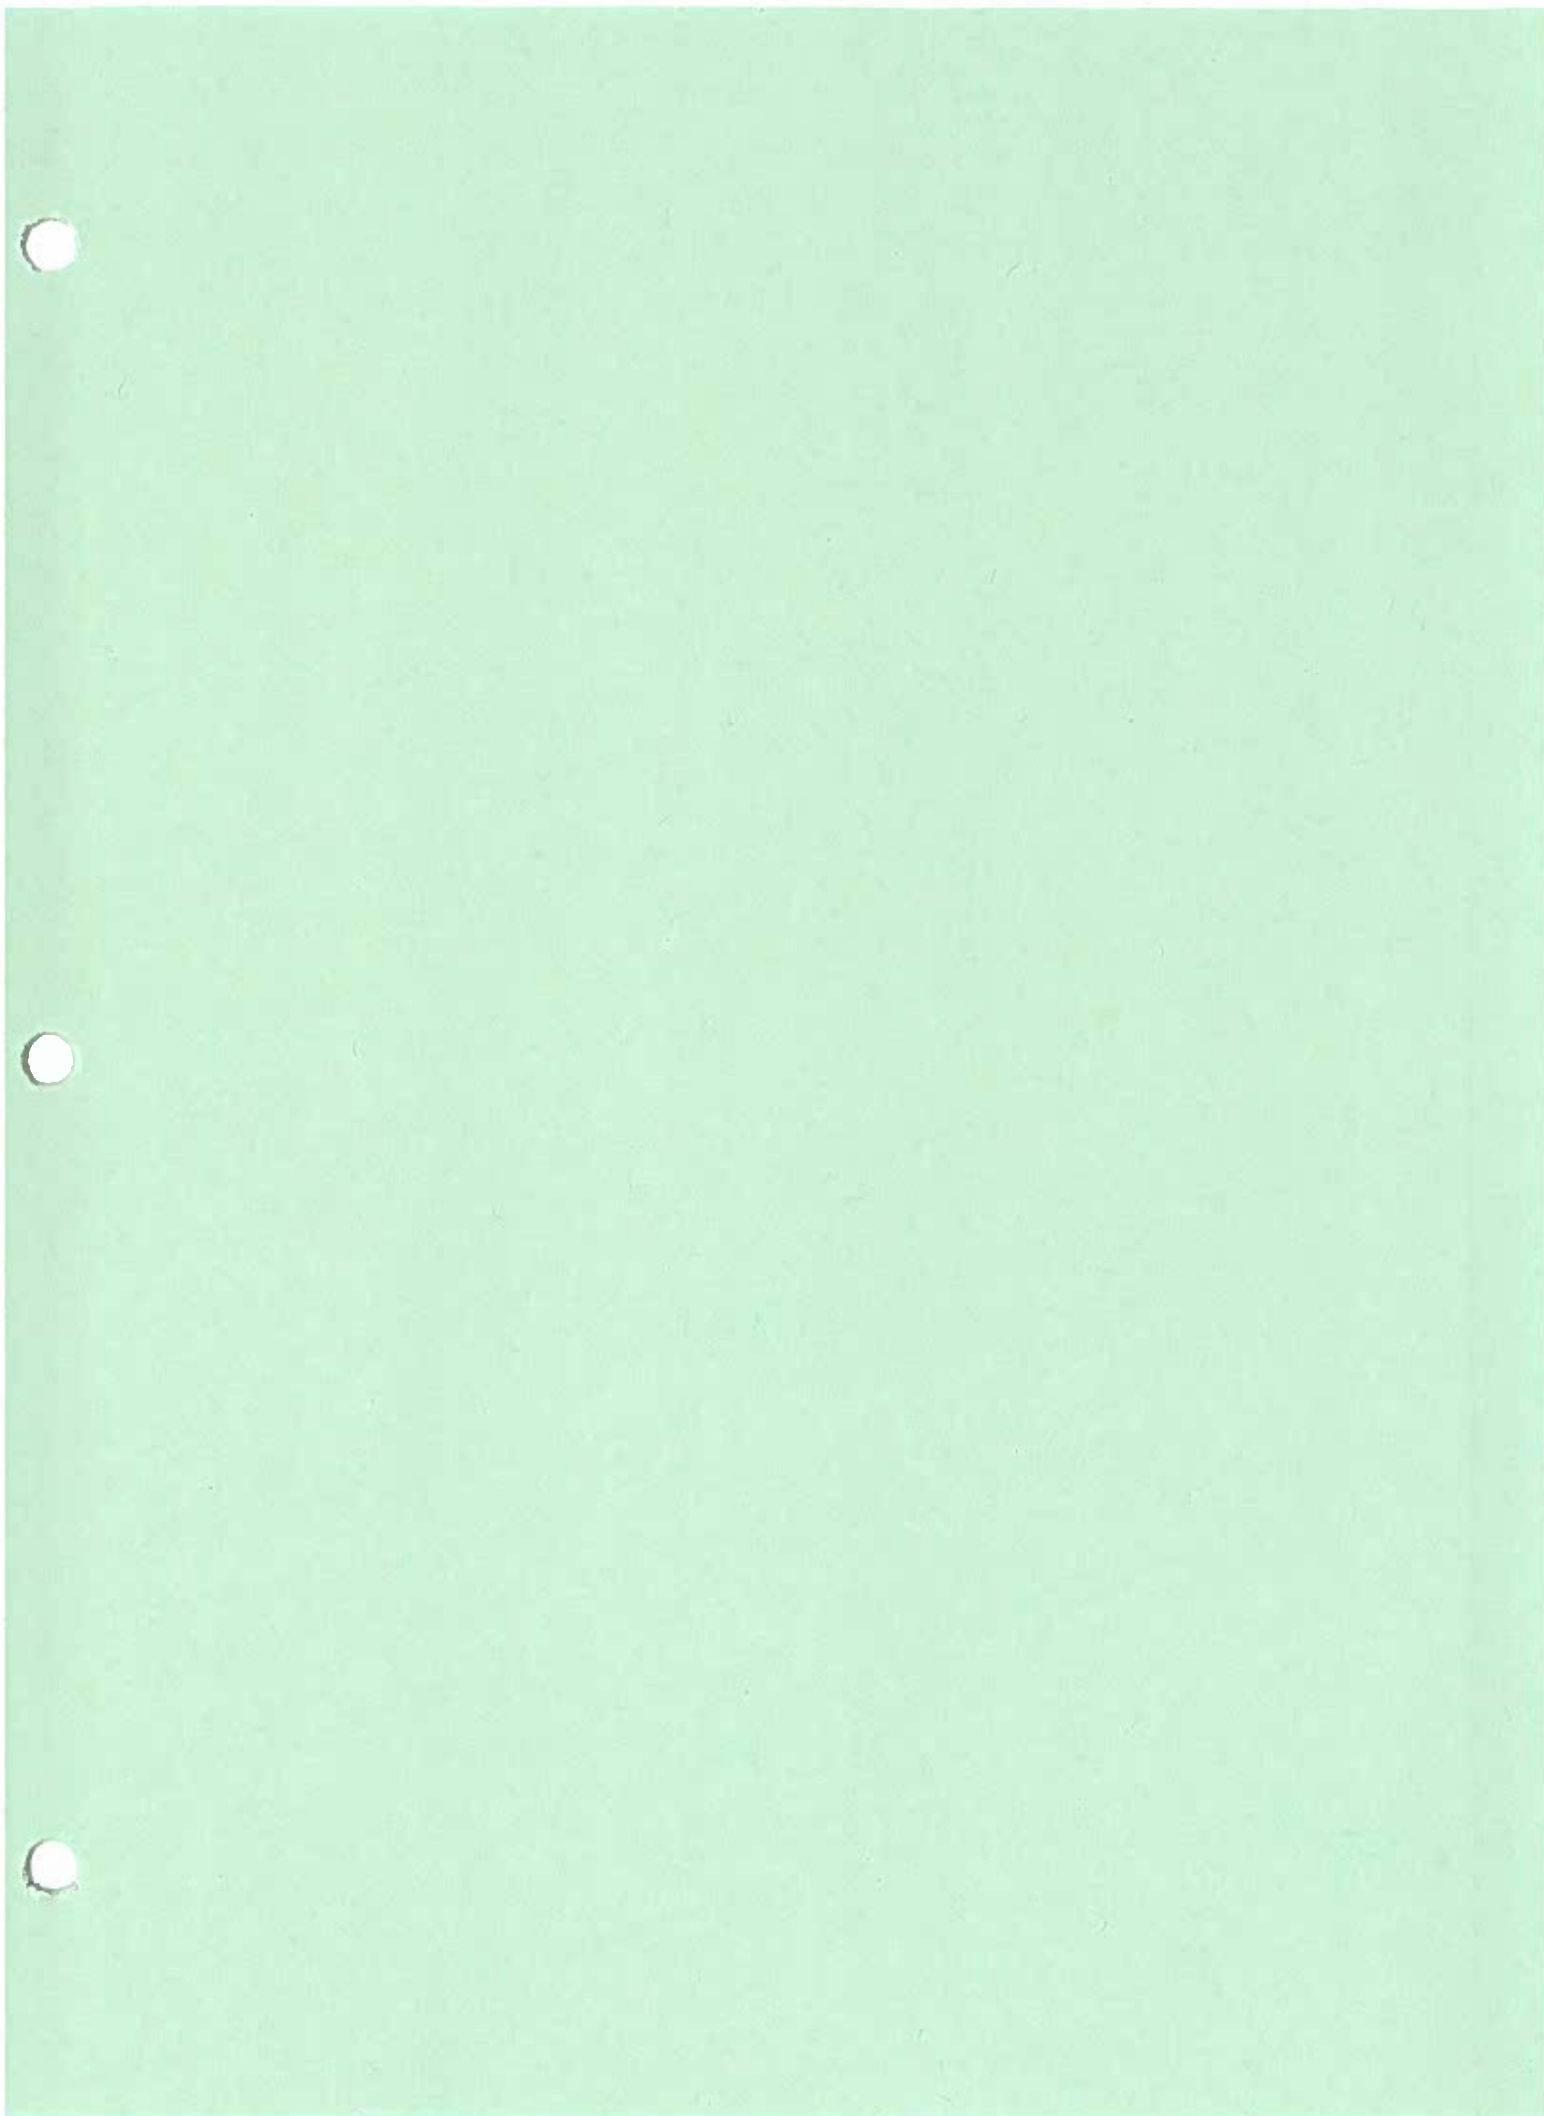

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# 4

Type of Material Miscellaneous Material

Quantity of Material 11,281 SF

Material Location
Throughout building

Material Description
Mastic

Comments
Material is assumed to be in good condition.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/ 1/92

Current Surveillance Date 7/ 2/97

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Karen Foxx

State Indiana

Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# A
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout building
Material Description
Cove Base

Comments

At the time of this 6 month surveillance the cove base was cracking and falling off the wall. I am told that the material will be removed and replaced this summer. A sample was taken. Results are negative for asbestos content..

Does Material Contain Asbestos? No
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 7/ 2/97
Current Assessment Rating NR Not Required
Cause of Damage Physical Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action None

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# B

Type of Material Miscellaneous Material

Quantity of Material LF

Material Location
Throughout building

Material Description
Cove Base Mastic

Comments
Material was sampled as alot of it is exposed during this surveillance. Results are negative for asbestos.

Does Material Contain Asbestos? No

Is it Friable? No

Original Inspection Date 5/31/95

Current Surveillance Date 7/ 2/97

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action None

Inspector



Karen Foxx

State Indiana

Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material SF
Material Location
Auditorium
Material Description
Shock Joint on AHV's
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 7/ 2/97
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# D

Type of Material Miscellaneous Material

Quantity of Material SF

Material Location
Incinerator in Boiler Room

Material Description
Fire Brick

Comments

Material was sampled in March '96. It is negative for asbestos. Incinerator has been removed.

Does Material Contain Asbestos? No

Is it Friable? No

Original Inspection Date 5/31/95

Current Surveillance Date 7/ 2/97

Current Assessment Rating NA Not Applicable

Cause of Damage Not Applicable

Accessible No

Potential for Damage NA

Removed Yes

Planned Response Action None


Inspector



Karen Foxx

State Indiana

Accreditation Number 191129014

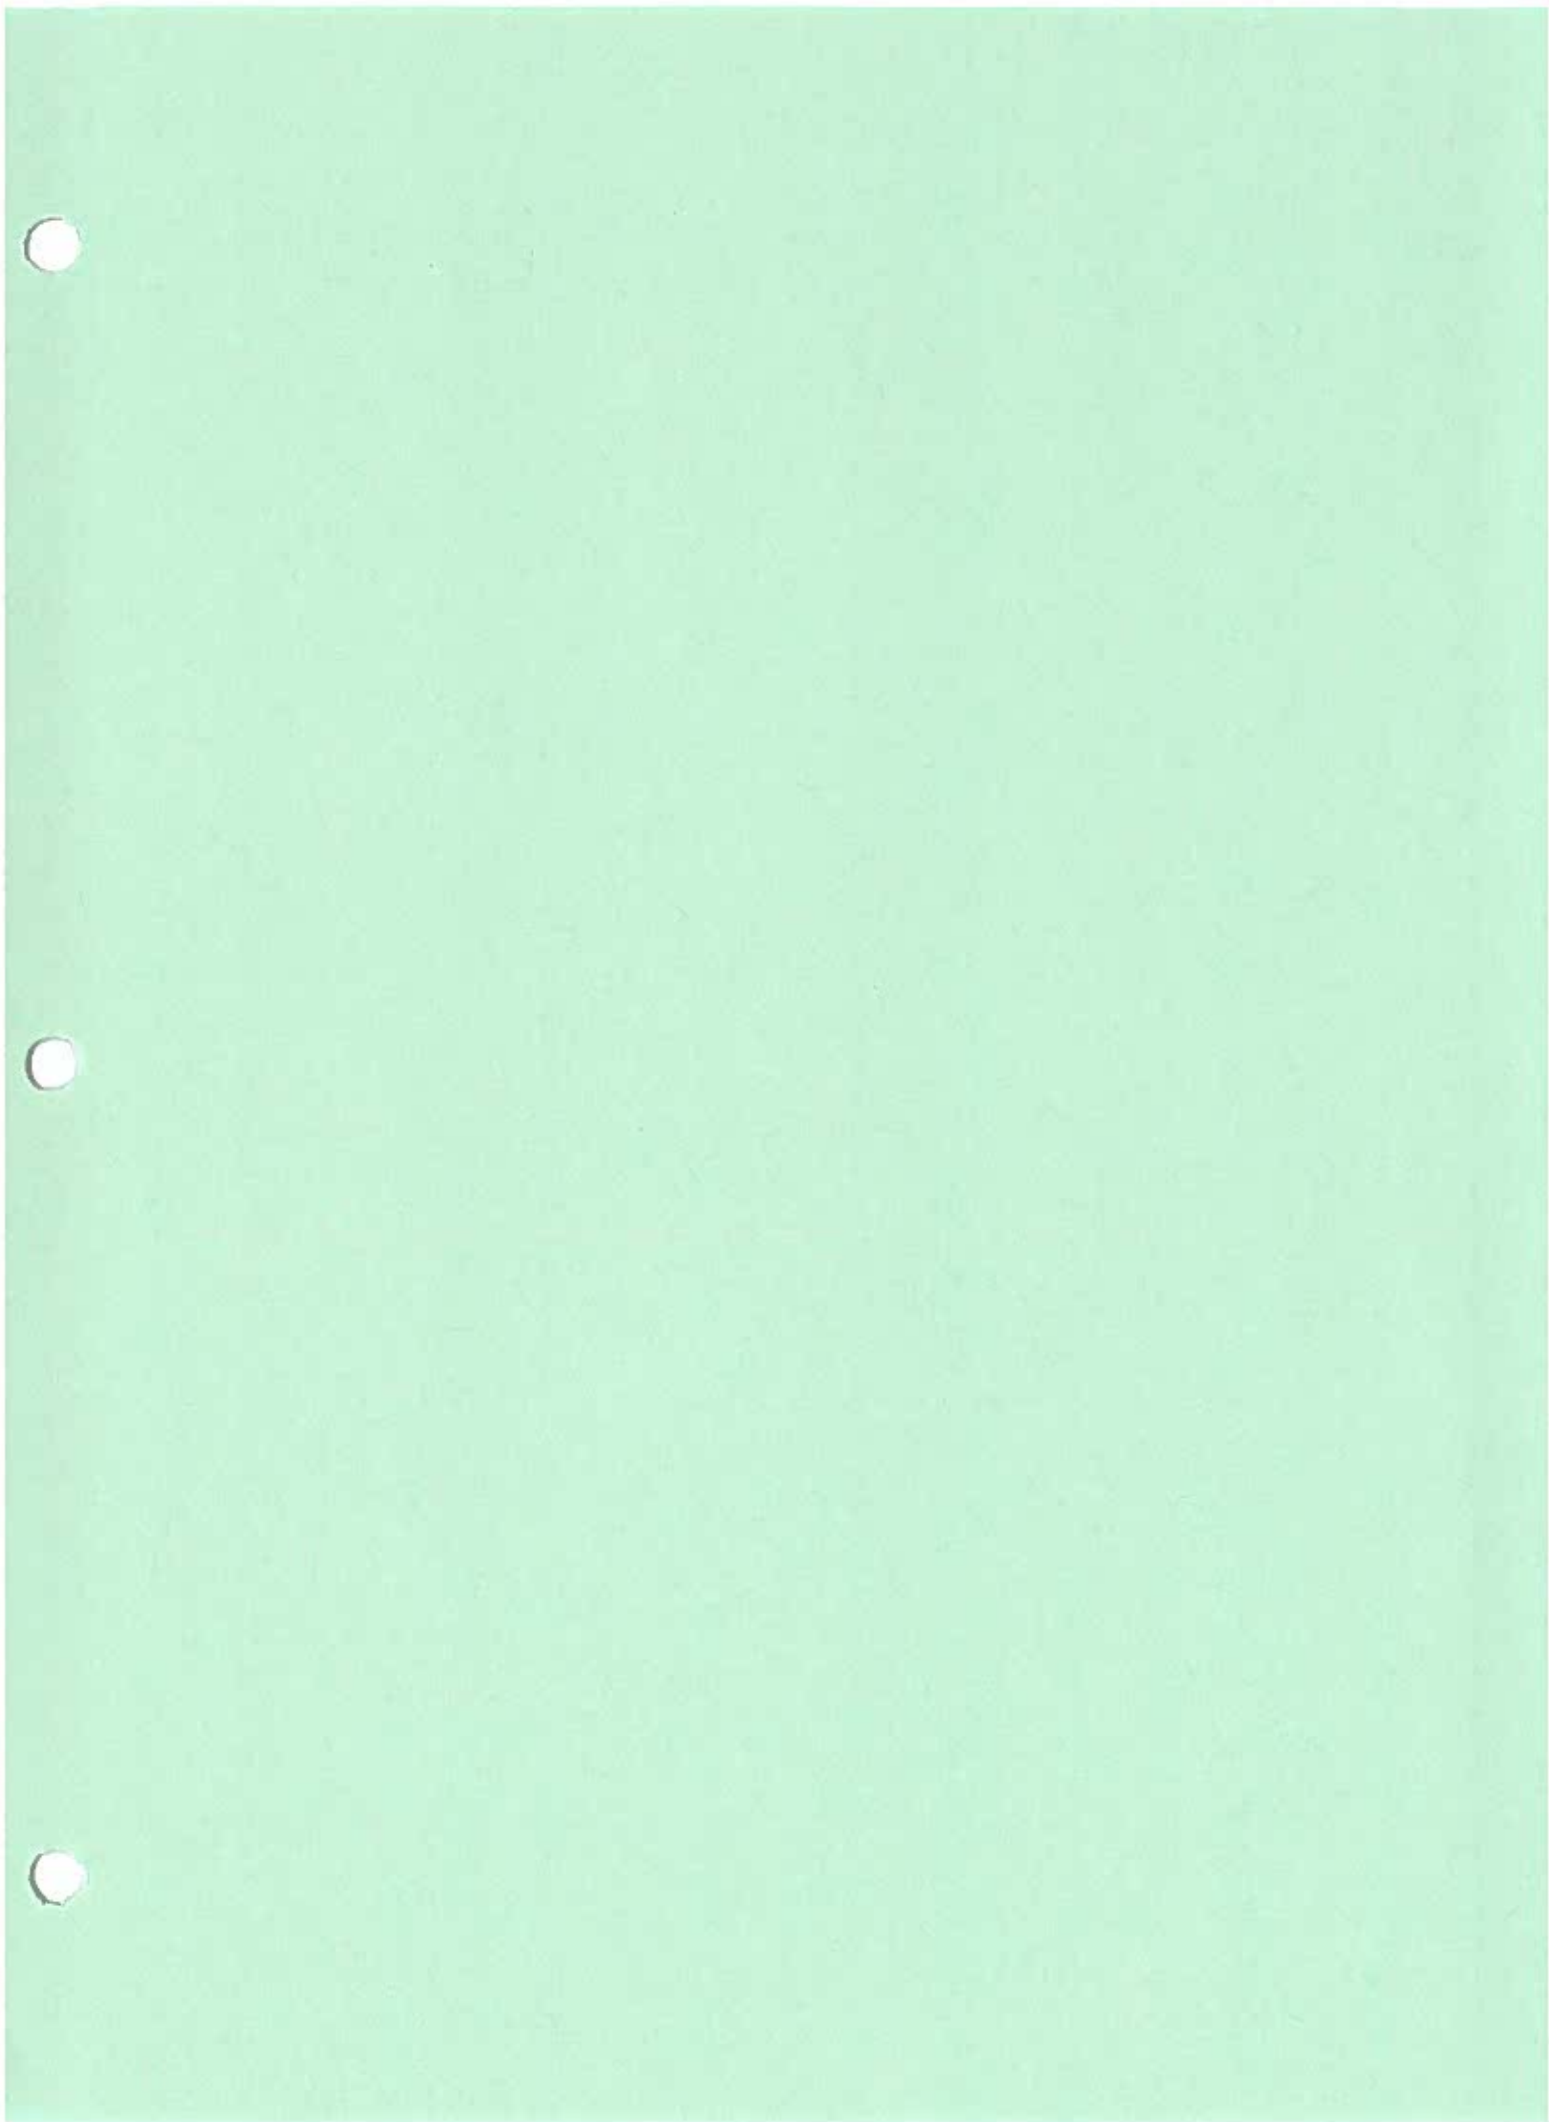

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# 4

Type of Material Miscellaneous Material

Quantity of Material 11,281 SF


Material Location
Throughout building

Material Description
Mastic

Comments
Material is known to be asbestos containing and is in good condition. No change.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

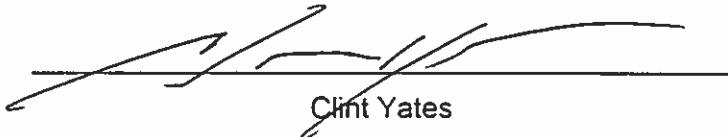

Clint Yates

State Indiana

Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# A
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location Throughout building
Material Description Cove Base
Comments Material is falling apart. Poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage Physical Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Clint Yates

State

Indiana

Accreditation Number

193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# B

Type of Material Miscellaneous Material

Quantity of Material LF

Material Location
Throughout building

Material Description
Cove Base Mastic

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/95

Current Surveillance Date 12/16/96

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

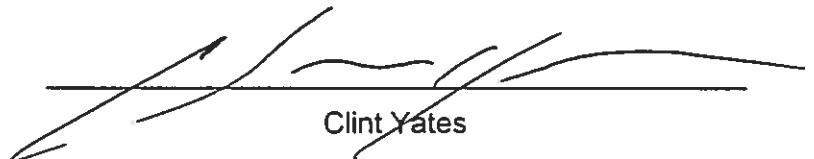

Clint Yates

State Indiana

Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material SF
Material Location Auditorium
Material Description Shock Joint on AHV's

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

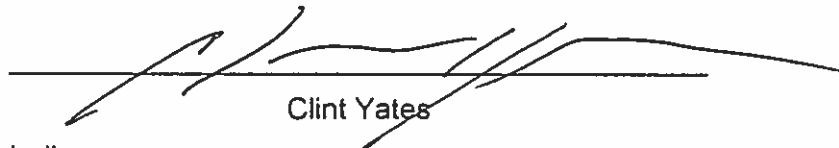
Clint Yates

State

Indiana

Accreditation Number

193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# D

Type of Material Miscellaneous Material

Quantity of Material SF

Material Location
Incinerator in Boiler Room

Material Description
Fire Brick

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	5/31/95
Current Surveillance Date	12/16/96
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Inspector


Clint Yates

State Indiana

Accreditation Number 193804035



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 4
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF

Material Location
Throughout building


Material Description
Mastic

Comments

Material is known to be asbestos containing and is in good condition. No change.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 6/24/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Rex Gaddis

State Indiana
Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material LF

Material Location
Throughout building


Material Description
Cove Base

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	5/31/95
Current Surveillance Date	6/24/96
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Inspector



Rex Gaddis

State Indiana

Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# B

Type of Material Miscellaneous Material

Quantity of Material LF

Material Location
Throughout building

Material Description
Cove Base Mastic

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/95

Current Surveillance Date 6/24/96

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Rex Gaddis

State Indiana

Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# C

Type of Material Miscellaneous Material

Quantity of Material SF

Material Location
Auditorium

Material Description
Shock Joint on AHV's

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/95

Current Surveillance Date 6/24/96

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Rex Gaddis

State Indiana

Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# D

Type of Material Miscellaneous Material

Quantity of Material SF


Material Location
Incinerator in Boiler Room

Material Description
Fire Brick

Comments
Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	5/31/95
Current Surveillance Date	6/24/96
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M


Inspector



Rex Gaddis

State Indiana

Accreditation Number 190908032

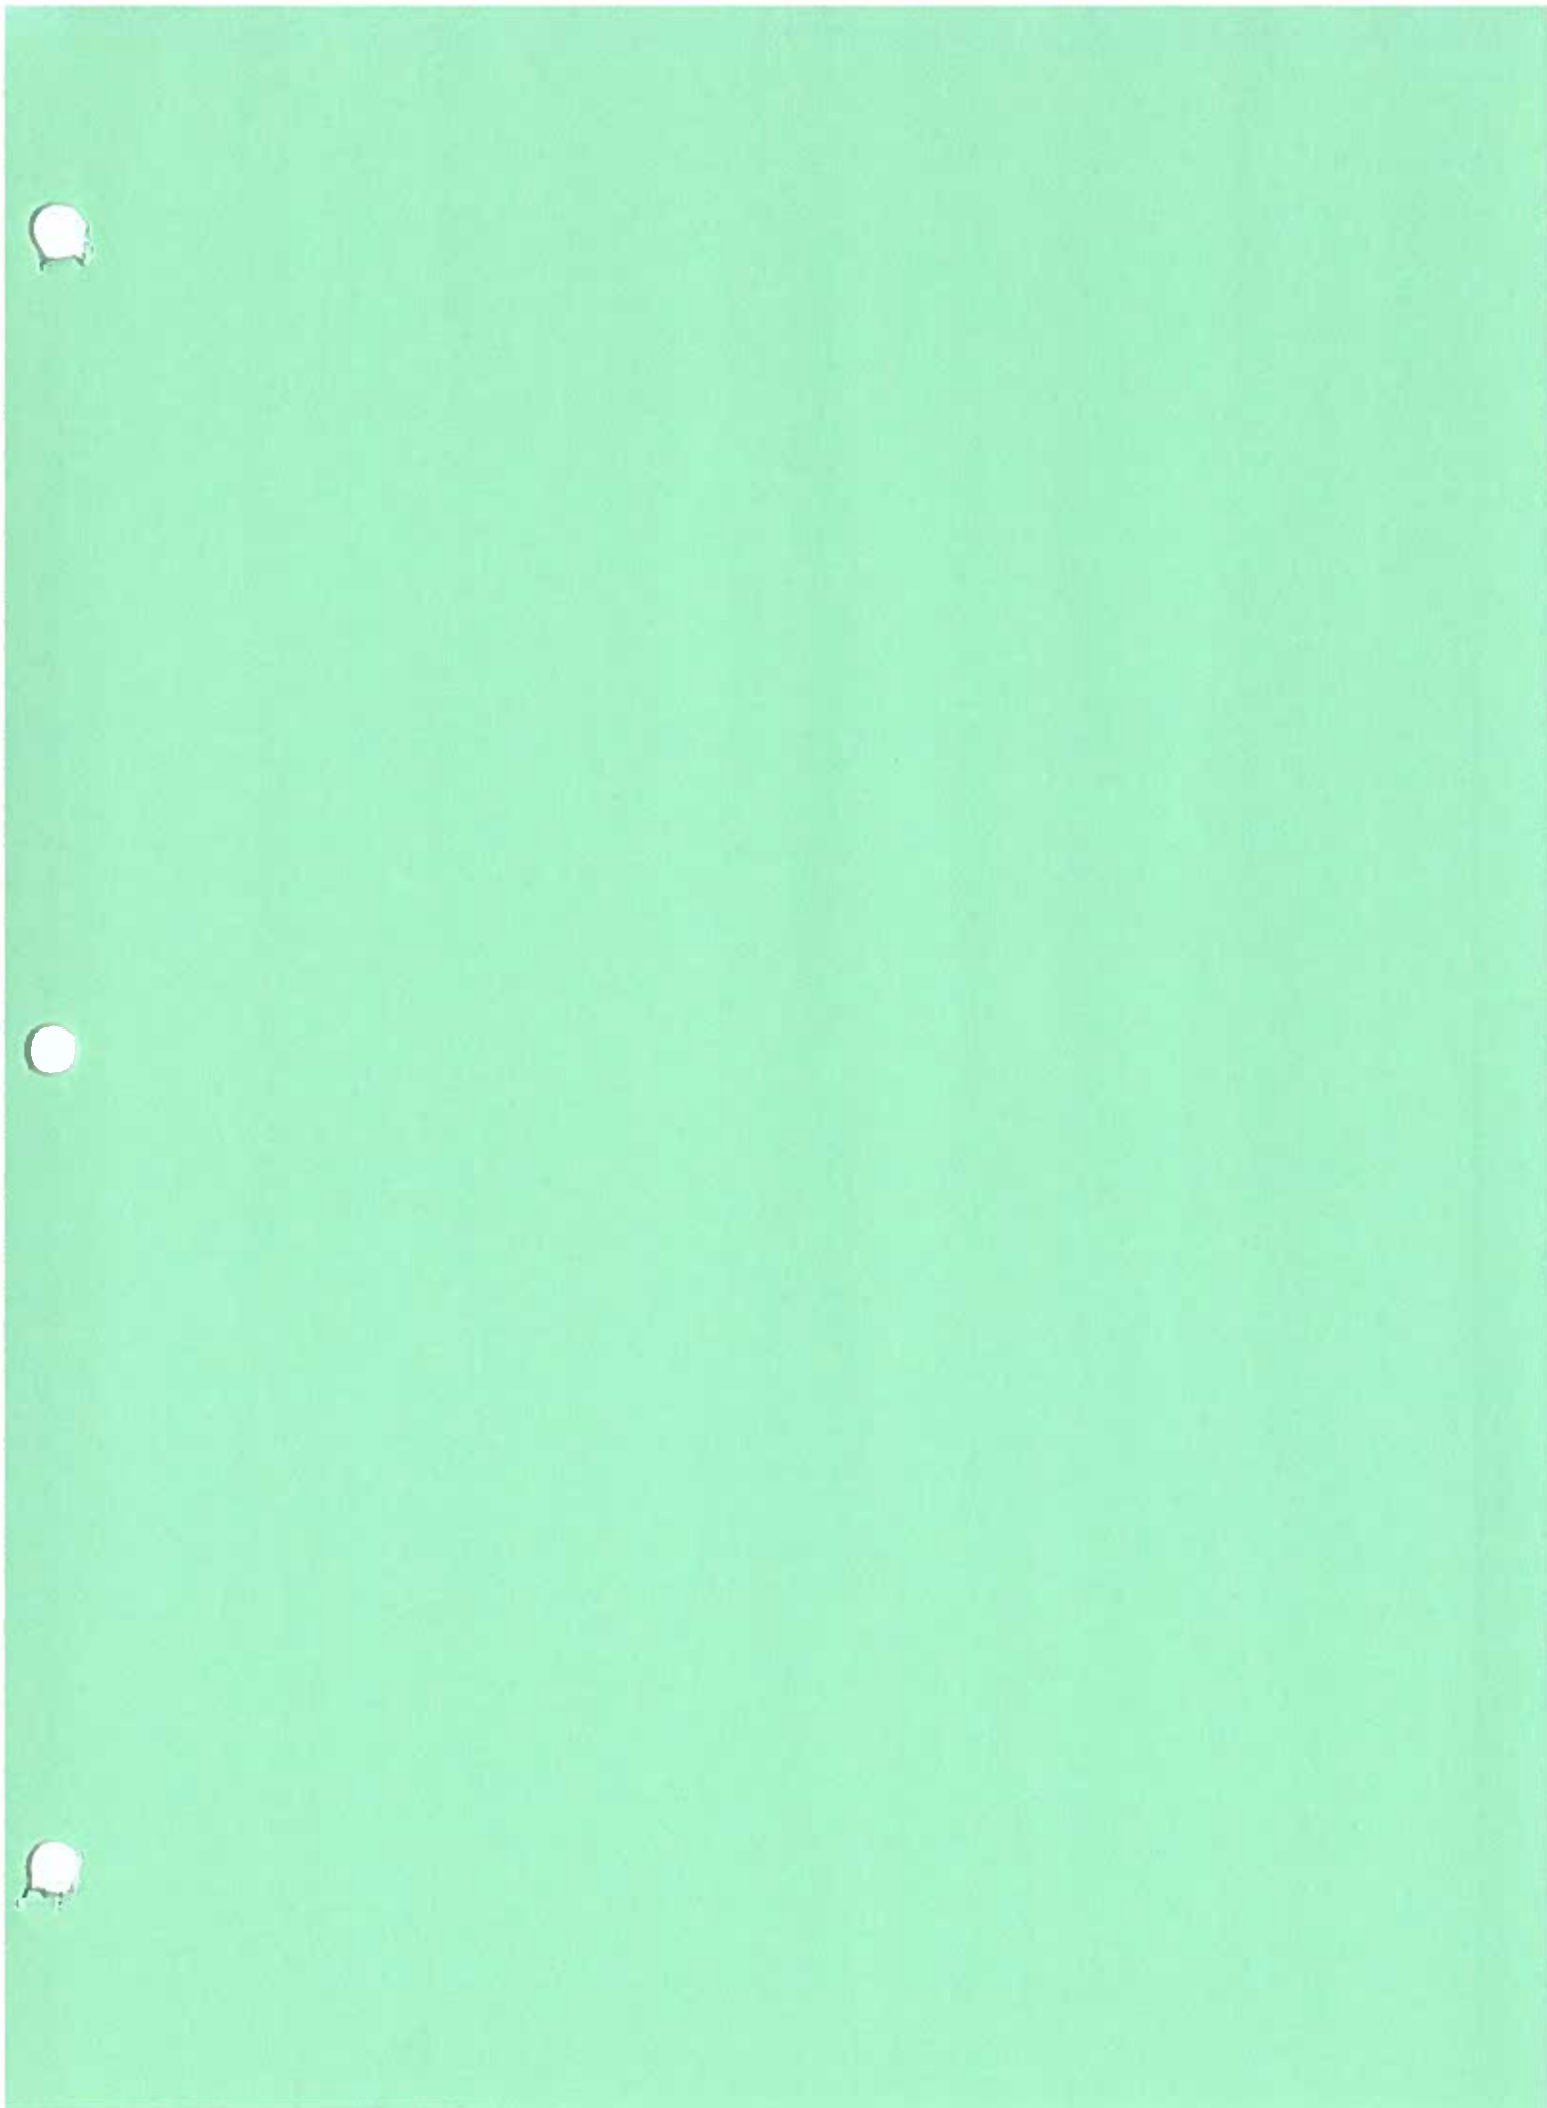

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools
BUILDING NAME: Parkview Middle School
HA#: 4
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL: 11,281SF

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Mastic

COMMENTS:

Material is known to be asbestos containing and is in good condition.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE: 06/01/92
CURRENT SURVEILLANCE DATE: 12/06/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
STATE: Indiana

INSPECTOR NAME:


Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools

BUILDING NAME: Parkview Middle School

HA#: A

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT SURVEILLANCE DATE: 12/06/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: YES

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

STATE: Indiana

INSPECTOR NAME:


Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools

BUILDING NAME: Parkview Middle School

HA#: B

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base Mastic

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT SURVEILLANCE DATE: 12/06/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage


ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

STATE: Indiana

INSPECTOR NAME:

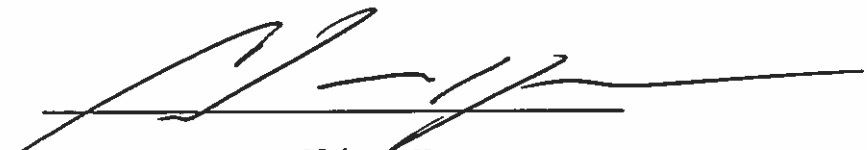
Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools

BUILDING NAME: Parkview Middle School

HA#: C

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Auditorium

MATERIAL DESCRIPTION:

Shock Joint on AHV's

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT SURVEILLANCE DATE: 12/06/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage


ACCESSIBLE: YES

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

STATE: Indiana

INSPECTOR NAME:

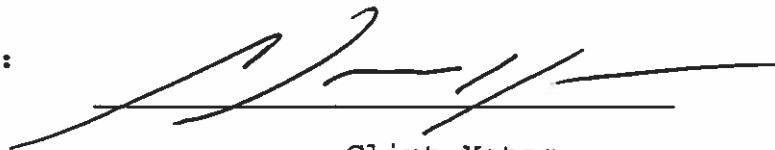
Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools

BUILDING NAME: Parkview Middle School

HA#: D

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Incinerator in Boiler Room

MATERIAL DESCRIPTION:

Fire Brick

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT SURVEILLANCE DATE: 12/06/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

STATE: Indiana

INSPECTOR NAME:


Clint Yates

THIRD YEAR REINSPECTIONS

REINSPECTION PLAN**GREATER CLARK COUNTY SCHOOLS**

Reinspection by an accredited building inspector will be scheduled to be performed not more than three years from the date of the original inspection. The reinspection report will then be made a permanent part of this Management Plan. Reinspections will be performed every three years for as long as the building contains ACBM, and will be reinspected once within three years from the date that all ACBM has been removed.

Records of each reinspection should be maintained in this binder.

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>JUNE 2007</u>	<u>July 2007</u>	<u>Bill Ogle</u>
<u>JUNE 2010</u>	<u>June 2010</u>	<u>Sandy Shadley</u>
<u>JUNE 2013</u>	<u>April 2013</u>	<u>Jeff Kachlin</u>
<u>JUNE 2016</u>	<u>April 2016</u>	<u>Benjamin [Signature]</u>
<u>JUNE 2019</u>	<u>May 2019</u>	<u>[Signature]</u>
<u>JUNE 2022</u>		
<u>JUNE 2025</u>		

REINSPECTION PLAN**GREATER CLARK COUNTY SCHOOLS****PARKVIEW MIDDLE SCHOOL**

The ACBM in this building shall be reinspected every three years to determine any change in the condition of the materials for as long they remain in the building. This reinspection will be conducted tri-annually by an accredited inspector.

The following table outlines the dates on which these inspections should take place in this school building.

REINSPECTION SCHEDULE

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>JUNE 1992</u>	<u>JUNE 1992</u>	<u>ASBESTECH</u>
<u>JUNE 1995</u>	<u>June '95</u>	<u>Alliance</u>
<u>JUNE 1998</u>	<u>June '98</u>	<u>Alliance</u>
<u>JUNE 2001</u>	<u>July '01</u>	<u>P. Wilson</u>
<u>JUNE 2004</u>	<u>July '04</u>	<u>C. Sparks</u>

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID 04
HA Description Black mastic
HA Type Miscellaneous Material
HA Location Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or
Quantity Unquantified SF
Comments Most of this material was removed during renovations in the Summer of 2012. Remaining material is under floor tile in the office, library, and closets.
Asbestos Known
Friable No
Original Inspection 6/1/1992
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition		
<u>Physical Contact</u>		<u>Vibration</u>		<u>Air</u>
Low/None		Low/None		Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID C
HA Description Shock joint on AHU's
HA Type Miscellaneous Material
HA Location Shock joint on AHU's

Quantity Unquantified SF
Comments The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID D
HA Description Window Caulking
HA Type Miscellaneous Material
HA Location Exterior windows

Quantity 52 SF

Comments This material was discovered during an asbestos survey in 2011. This material was sampled and found to be asbestos containing. This material was removed during summer renovations in 2012.

Asbestos Known
Friable No

Original Inspection 9/17/2011
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID 04
HA Description Black mastic
HA Type Miscellaneous Material
HA Location Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or
Quantity Unquantified SF
Comments Most of this material was removed during renovations in the Summer of 2012. Remaining material is under floor tile in the office, library, and closets.
Asbestos Known
Friable No
Original Inspection 6/1/1992
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID C
HA Description Shock joint on AHU's
HA Type Miscellaneous Material
HA Location Shock joint on AHU's

Quantity Unquantified SF

Comments The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Asbestos Assumed

Friable No

Original Inspection 5/31/1995
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Parkview Middle School
Building Number 12
HA ID D
HA Description Window Caulking
HA Type Miscellaneous Material
HA Location Exterior windows

Quantity 52 SF

Comments This material was discovered during an asbestos survey in 2011. This material was sampled and found to be asbestos containing. This material was removed during summer renovations in 2012.

Asbestos Known
Friable No

Original Inspection 9/17/2011
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location

Throughout the building except (halls, stairs, lobbies, music rooms, 4-A, 5-A, 9-A, 10-A, 22-A, 23-B, 30-A, & 31-A) These areas have been added on to the building or have terrazo under the carpet.

Material Description

Black mastic

Comments

Most of this material was removed during renovations in the Summer of 2012. Remaining material is under floor tile in the office, library, and closets.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Auditorium and upper gymnasium


Material Description
Shock joint on AHU's

Comments

The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# D
Type of Material Miscellaneous Material
Quantity of Material 52 SF
Material Location
Exterior Windows
Material Description
Window Caulking

Comments

This material was discovered during an asbestos survey in 2011. This material was sampled and found to be asbestos containing. This material was removed during summer renovations in 2012.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 9/17/2011
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# 04

Type of Material Miscellaneous Material

Quantity of Material 11,281 SF

Material Location
Throughout the building

Material Description

Black mastic

Comments

No mastic was visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Reinspection Date 6/30/2010

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Sandra Shadley

State IN

Accreditation Number 19A002323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# C

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Auditorium and upper gymnasium

Material Description

Shock joint on AHU's

Comments

The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Reinspection Date 6/30/2010

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Sandra Shadley

State IN

Accreditation Number 19A002323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF
Material Location
Throughout the building
Material Description
Black mastic
Comments
No mastic was visible to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 7/11/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# C

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Auditorium and upper gymnasium

Material Description

Shock joint on AHU's

Comments

The enclosed units (4 total) above the stage have black rubberized material and are not in poor condition. The material on 2 units in the upper gymnasium was not in poor condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Reinspection Date 7/11/2007

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027



THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF

Material Location
Throughout the building

Material Description
Black mastic

Comments

About two square feet of mastic was located in both air handler rooms above the stage. It was not in poor condition. No other mastic was exposed to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 7/2/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Auditorium and upper gymnasium

Material Description
Shock joint on AHU's

Comments

There are air handler units in the upper gymnasium with shock joints on them. I was unable to tell if they were vinyl or ACM. Therefore, they will be assumed ACM until further samples can be collected. The material located in the auditorium appeared to be vinyl. Further investigation is necessary. This material was not in poor condition.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 7/2/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

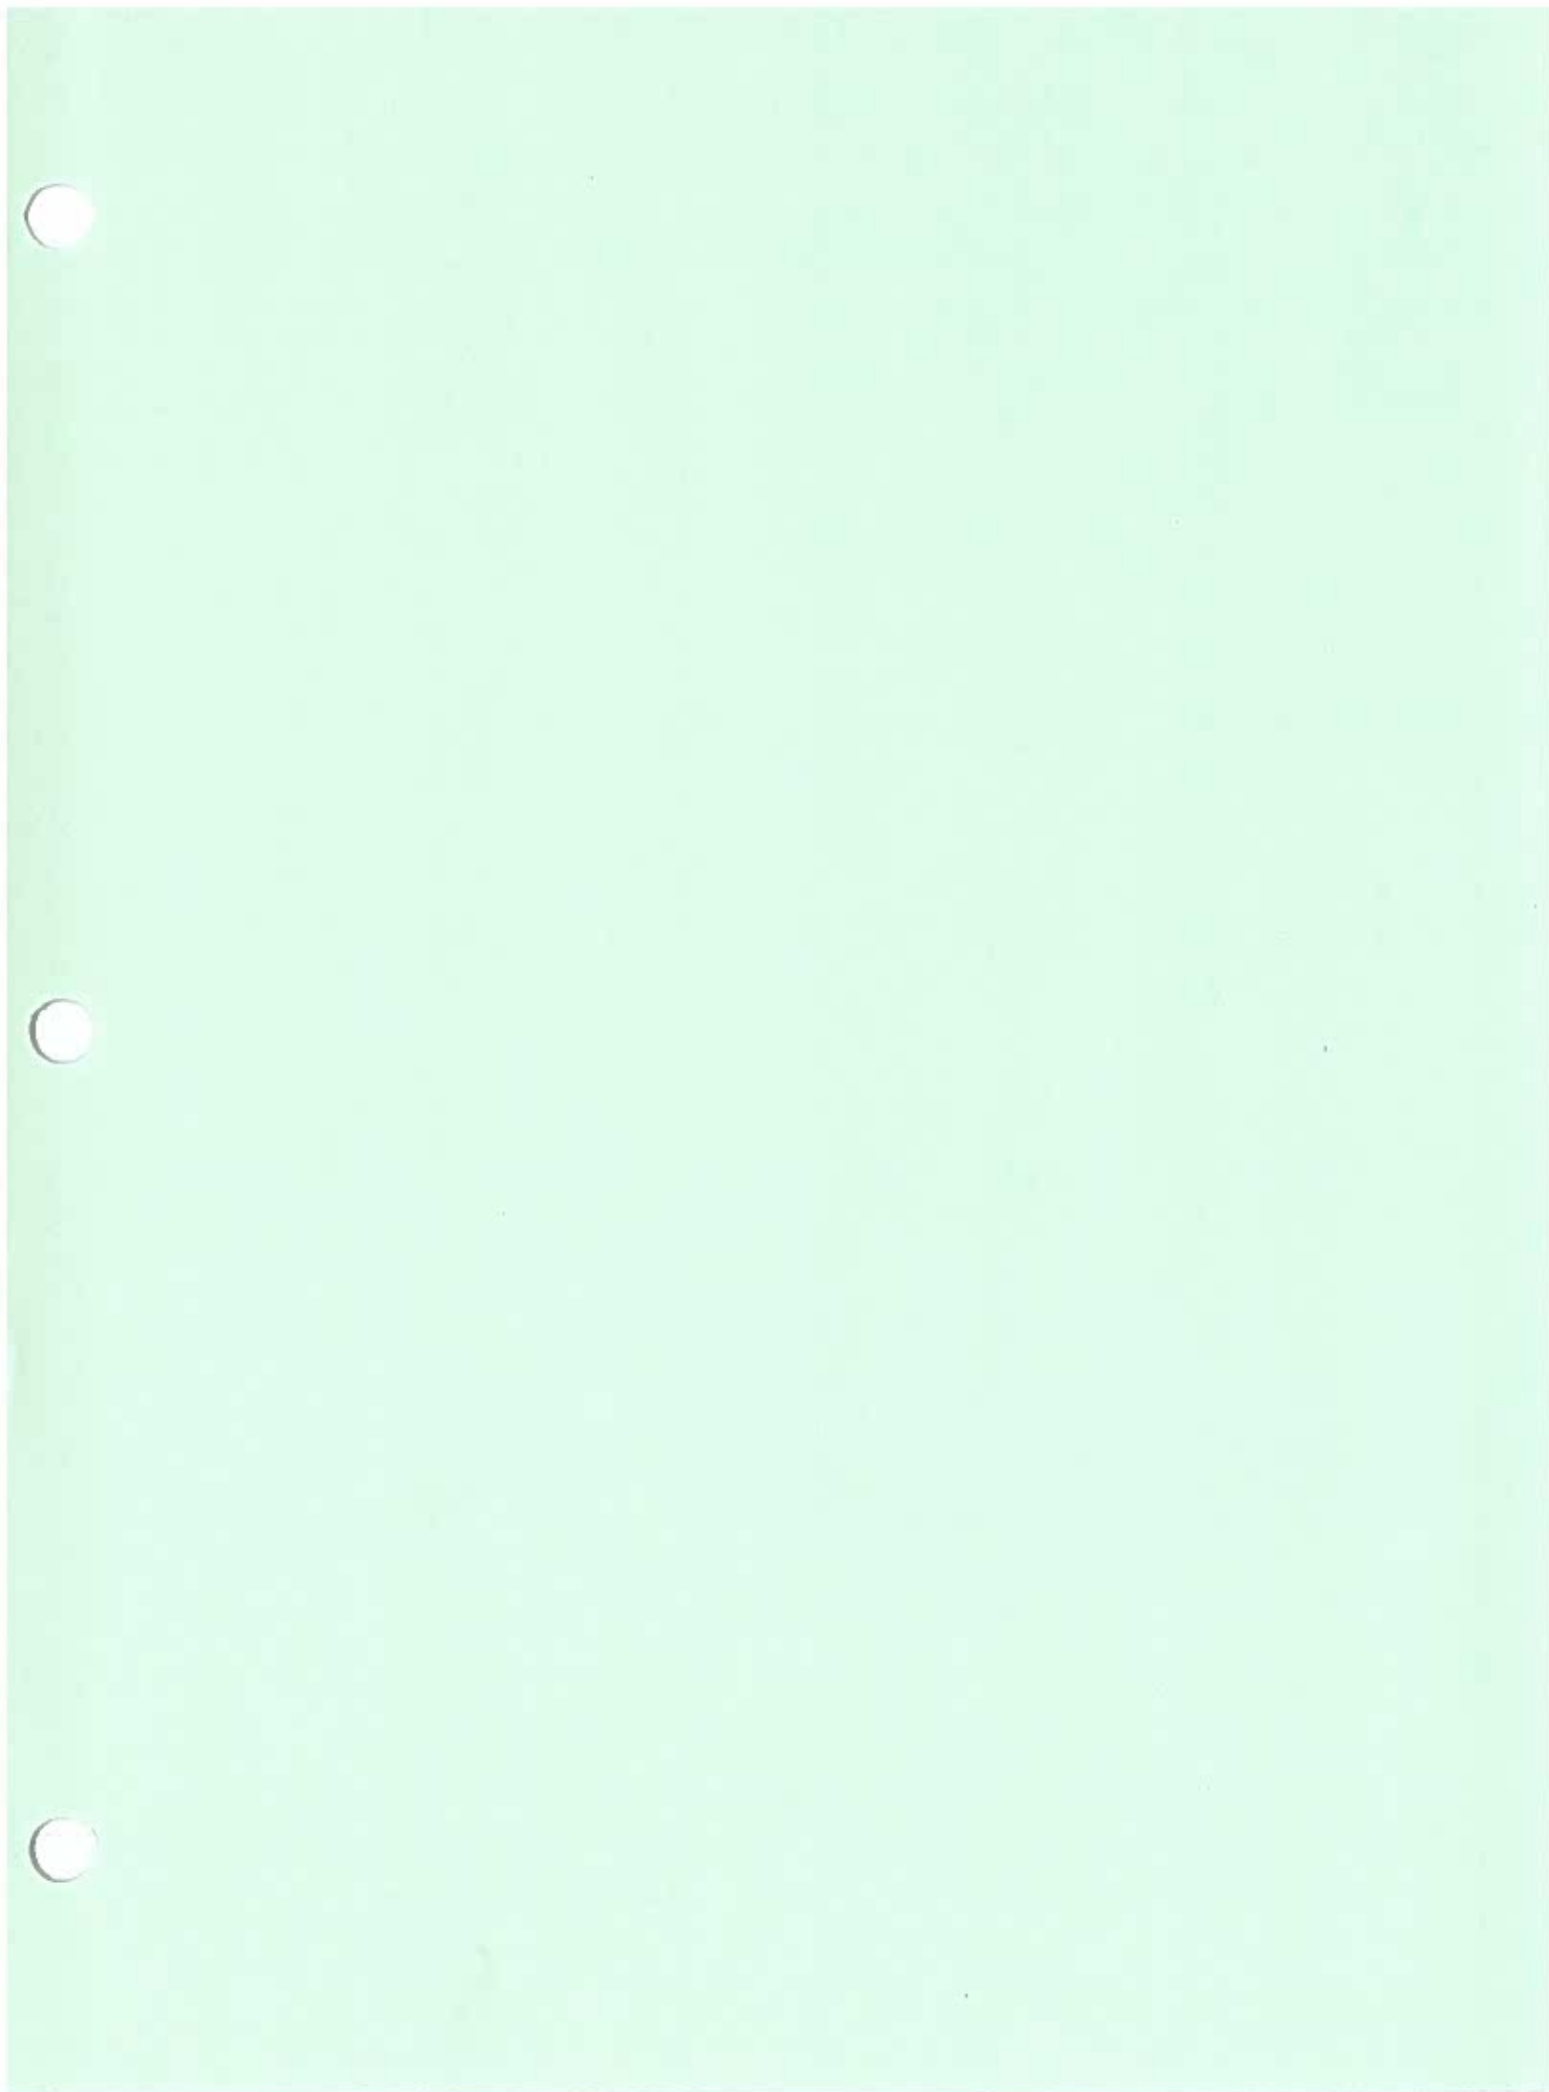

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF

Material Location
Throughout the building

Material Description
Black mastic

Comments
Black mastic was visible in some areas where carpet has been pulled up and tile previously removed. Where visible it is in good condition.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Reinspection Date 07/10/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Patrick E. Wilson

State Indiana
Accreditation Number 190824065

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Auditorium

Material Description
Shock joint on AHU's

Comments

I was able to enter mechanical room above auditorium to observe AHU shock joints. They are in good condition.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Reinspection Date 07/10/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Patrick E. Wilson

State Indiana
Accreditation Number 190824065

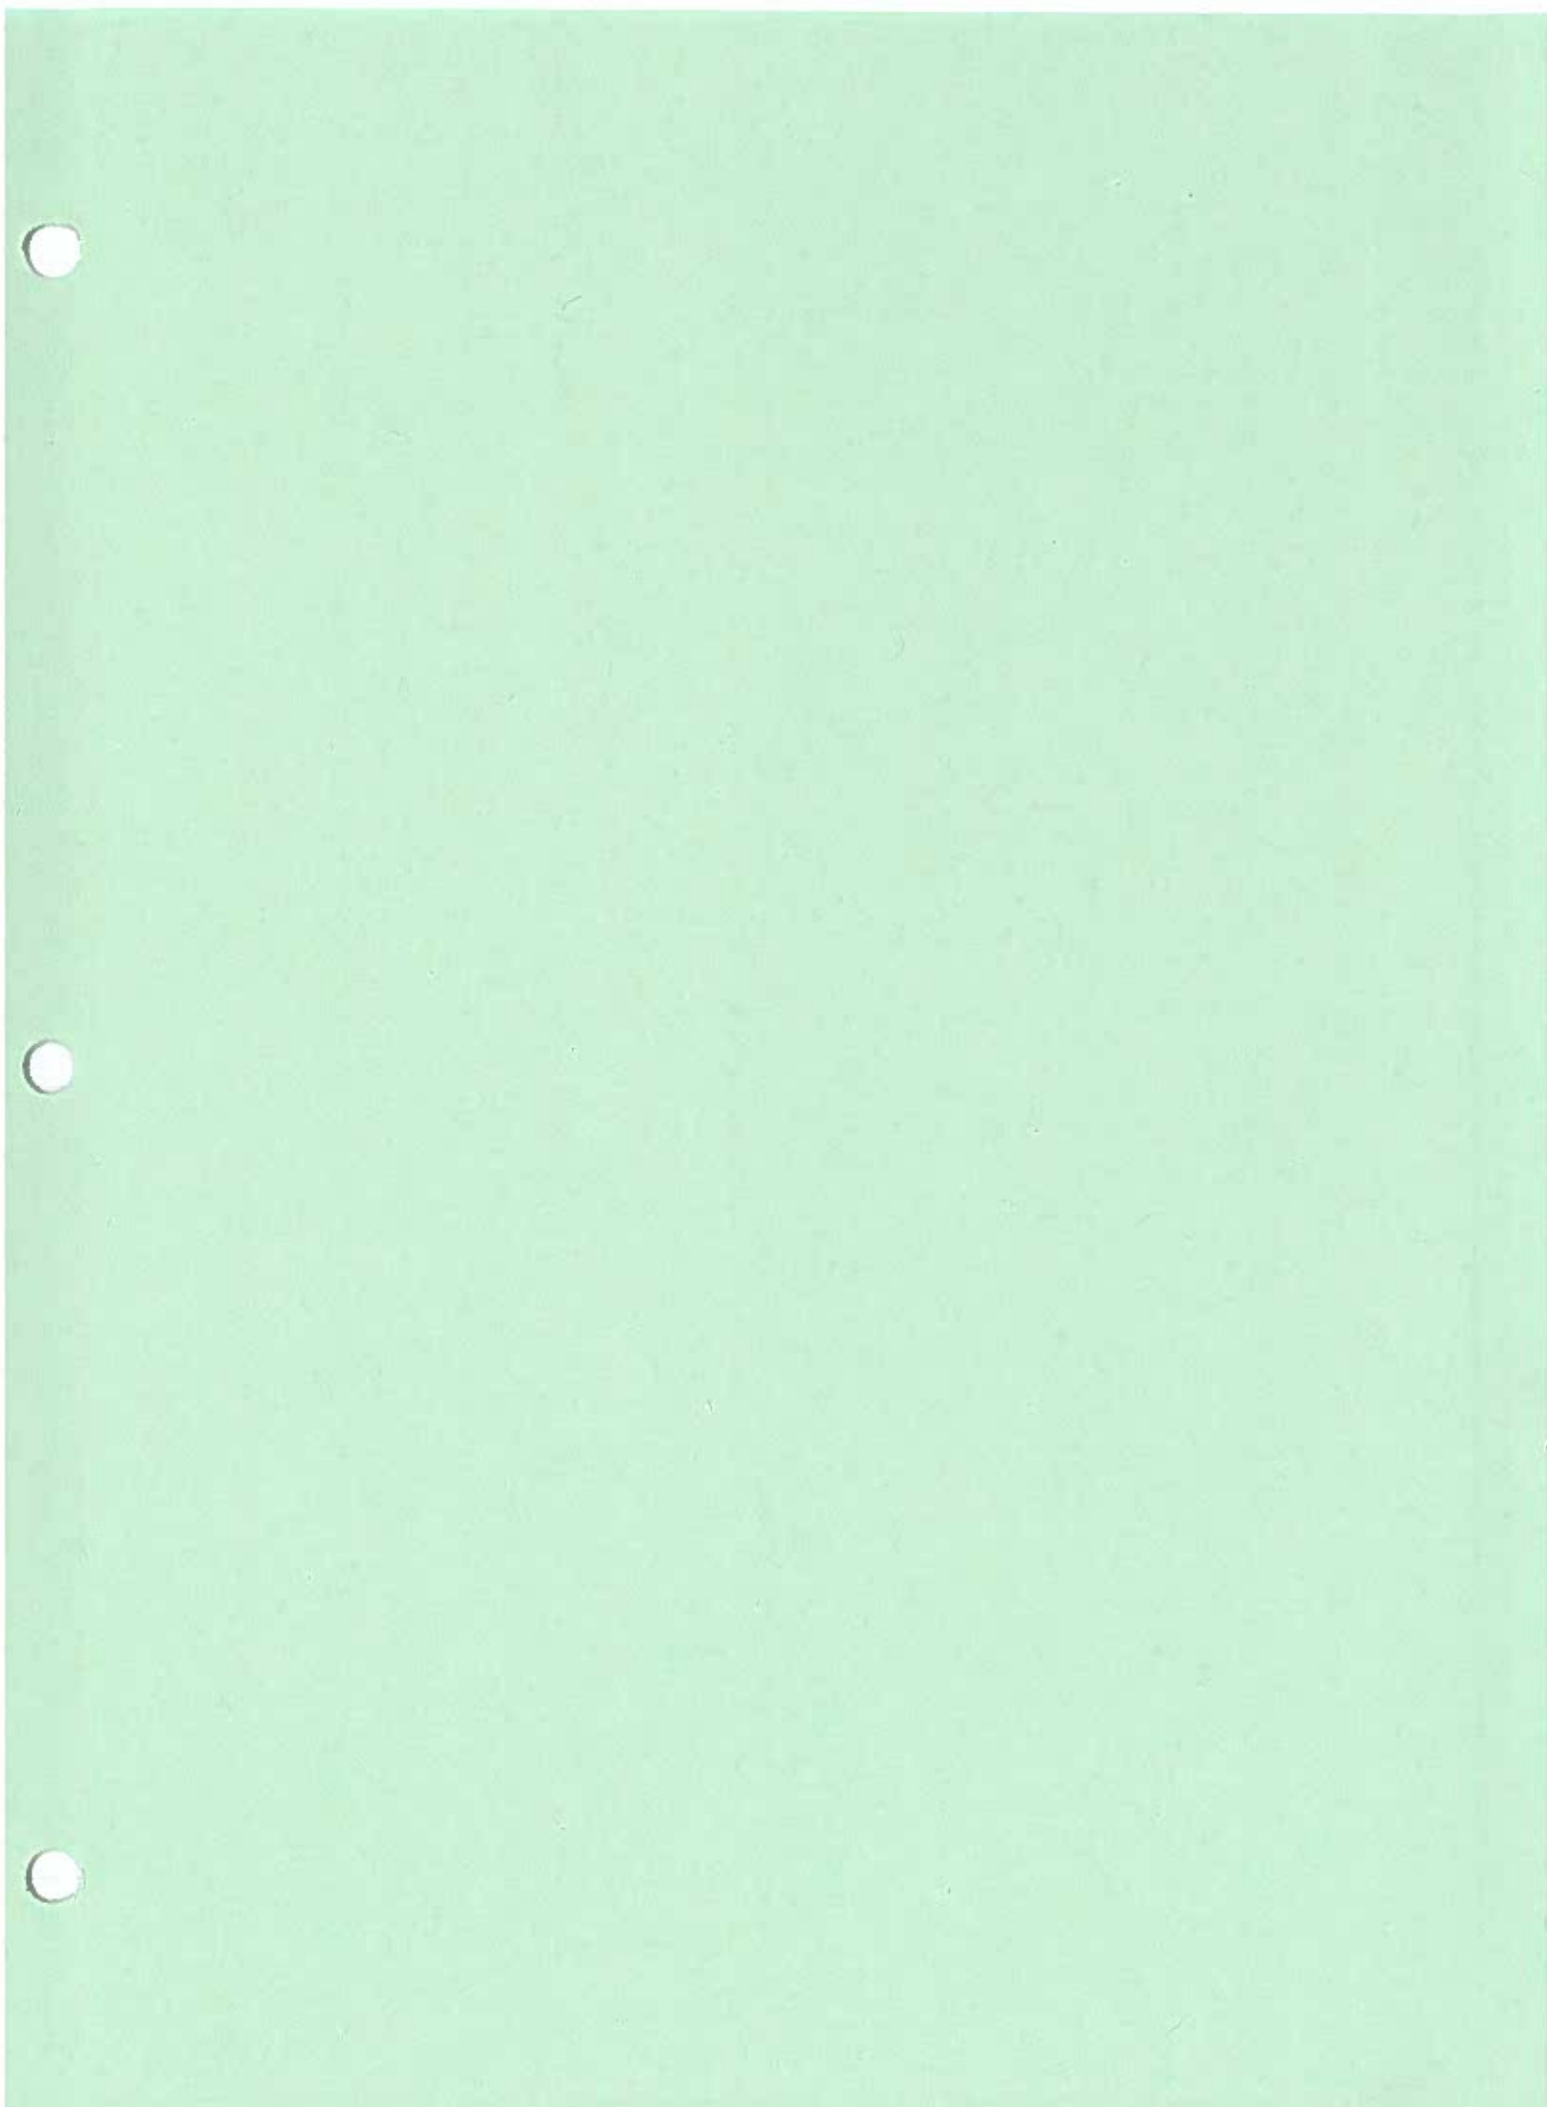

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Parkview Middle School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 11,281 SF


Material Location
Throughout building

Material Description
Mastic

Comments
Material is assumed to be in good condition.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Reinspection Date 6/ 1/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

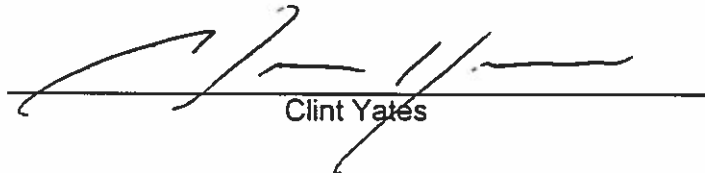
Clint Yates

State Indiana
Accreditation Number 193804035

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Parkview Middle School

HA# C

Type of Material Miscellaneous Material

Quantity of Material SF

Material Location
Auditorium

Material Description
Shock Joint on AHV's

Comments
Material is in good condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/95

Current Reinspection Date 6/ 1/98

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M


Inspector

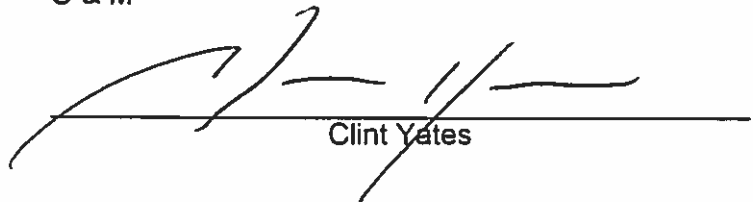

Clint Yates

State Indiana

Accreditation Number 193804035

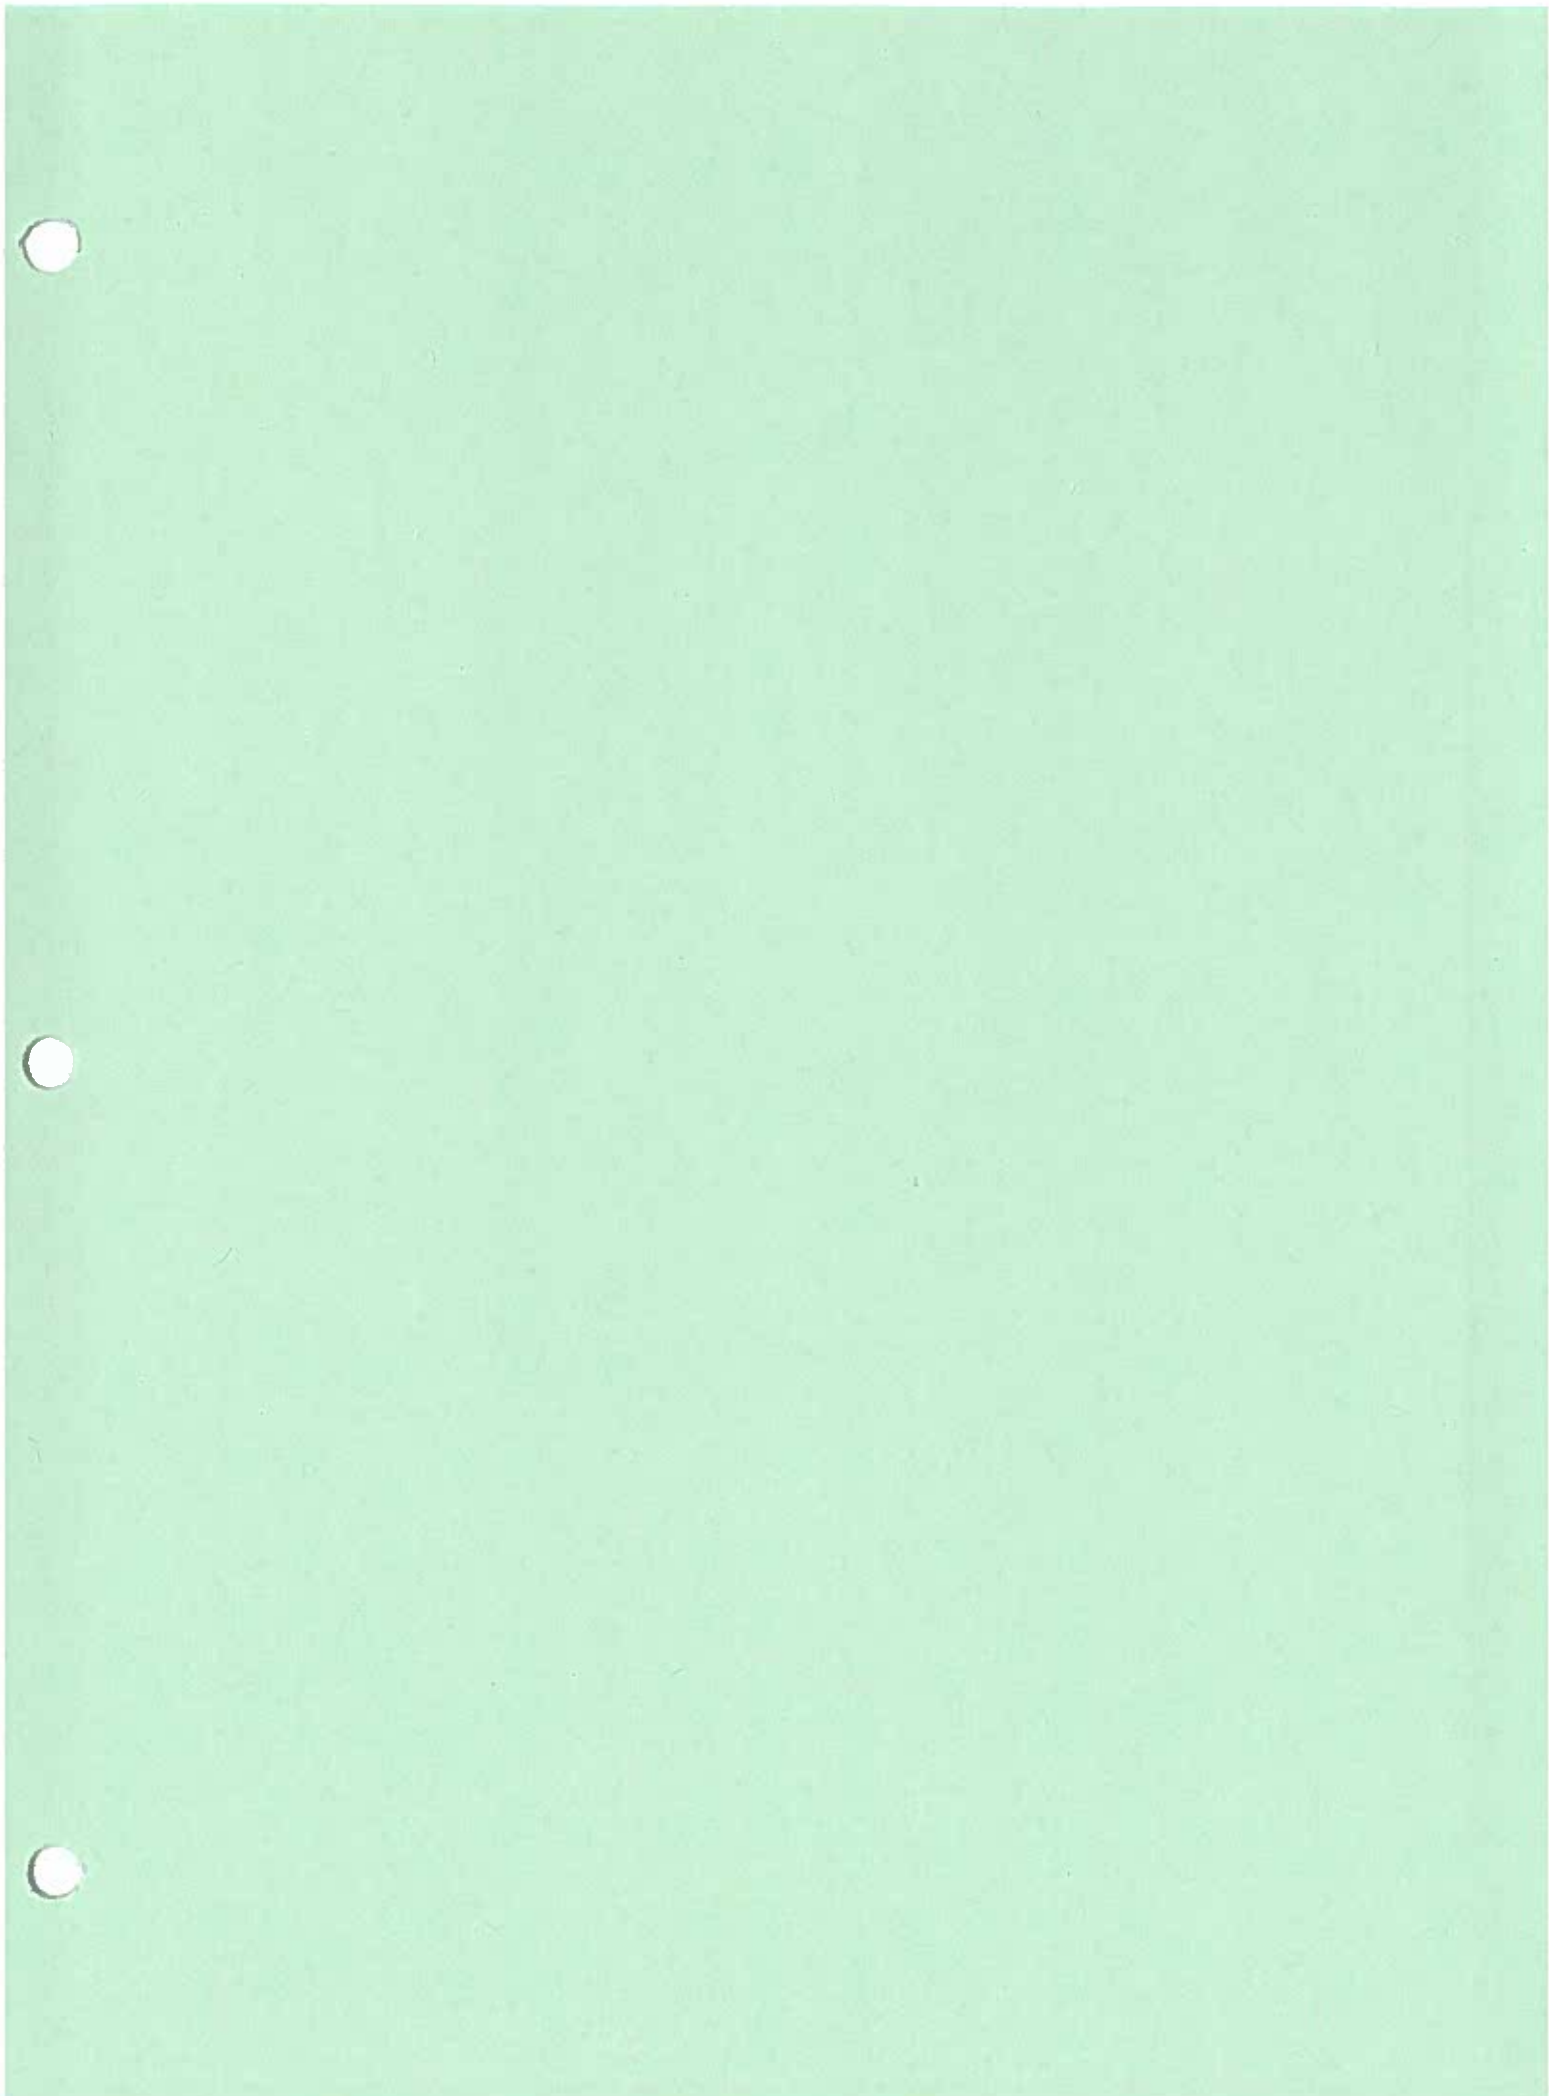

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.

BUILDING NAME: Parkview Middle School

HA#: 4

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL: 11,281SF

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Mastic

COMMENTS:

Material is known to be asbestos containing and is in good condition.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE: 06/01/92

CURRENT REINSPECTION DATE: 06/26/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:



Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.

BUILDING NAME: Parkview Middle School

HA#: A

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT REINSPECTION DATE: 06/26/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:



Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.

BUILDING NAME: Parkview Middle School

HA#: B

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base Mastic

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT REINSPECTION DATE: 06/26/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:



Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.

BUILDING NAME: Parkview Middle School

HA#: C

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Auditorium

MATERIAL DESCRIPTION:

Shock Joint on AHV's

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT REINSPECTION DATE: 06/26/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

CURRENT VIDEO TAPE:
(TAPE NO/FOOTAGE) /

INSPECTOR NAME: Rex Gaddis
Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.

BUILDING NAME: Parkview Middle School

HA#: D

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Incinerator in Boiler Room

MATERIAL DESCRIPTION:

Fire Brick

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT REINSPECTION DATE: 06/26/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:



Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

ADDITIONAL BULK SAMPLES



EMSL Analytical, Inc.

2001 East 52nd St., Indianapolis, IN 46205

Phone: (317) 803-2997 Fax: (317) 803-3047 Email: indianapolisl@emsl.com

Attn: **Sandy Shadley**
Alliance Environmental Group, Inc.
5340 Commerce Circle
Indianapolis, IN 46237

Customer ID: ALLI65
Customer PO:
Received: 07/06/10 8:00 AM
EMSL Order: 161010800

Fax: (317) 865-3401 Phone: (317) 865-3400
Project: NGR 00A02

EMSL Proj:
Analysis Date: 7/7/2010

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	Non-Asbestos		Asbestos
			% Fibrous	% Non-Fibrous	% Type
PVMS-FD-1 161010800-0001		White Fibrous Homogeneous	20% Cellulose	70% Non-fibrous (other) 10% Mica	None Detected

Initial report from 07/07/2010 17:16:41

Analyst(s)

Morgan Nastav (1)

Richard Harding, Laboratory Manager
or other approved signatory

EMSL Analytical, Inc. maintains liability limited to cost of analysis. This report relates only to the samples reported and may not be reproduced, except in full, without written approval by EMSL. EMSL is not responsible for sample collection activities or analytical method limitations. Interpretation and use of test results are the responsibility of the client. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-fragile organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Samples received in good condition unless otherwise noted.

Samples analyzed by EMSL Analytical, Inc. 2001 East 52nd St., Indianapolis IN NVLAP Lab Code 200188-0, AZ0939, CA 2575, CO AL-15132, TX 300262

ALLIANCE ENVIRONMENTAL GROUP, INC.

5340 Commerce Circle, Suite E
 Indianapolis, IN 46237
 317/865-3400 Fax 317/865-3401

48 HOUR
 161010800

Project Name- Greeter Clark Memorial Park
 Project Location- Parkview Middle School
 City/State- Jeffersonville, IN
 Project Number- NR000A02 Date- 7-5-10
 Samples Collected By- Sandy Starkey

SAMPLE I.D. NUMBER	LOCATION OF SAMPLE	DESCRIPTION OF SAMPLE MATERIAL
PVMS- FD-1	FIVE DOORS BETWEEN ART ROOMS	FIVE DOOR INSULATION- WHITE

CHAIN OF CUSTODY

Sample By: Sandy Starkey Received By: Emil Recorded By: _____
 Date: 6-30-10 Date: 7-6-10 3:00 Date: _____ Log#: _____
 Signature: [Signature] Signature: [Signature] Signature: _____
 Date Shipped: 7-5-10 Shipped Via: db Shipped To: _____

Scop.

ATC ASSOCIATES INC.
BULK SAMPLE ANALYSIS REPORT
 NVLAP Accredited
 NVLAP Code Number 101265-00

Date: July 24, 1997

Client: Alliance Indiana, Inc.

Project Identification: NGR-00A02 - Greater Clark County Schools
 Date Sample Received: July 9, 1997
 ATC Lab Batch Number: 971246

Lab ID	Client ID	Color / Description	Layer(s)	Asbestos Type	%	Other Fibrous Material	%	Non-Fibrous Material
001	PV-01	Tan Covebase <i>Park View Middle</i>	1	No Asbestos Detected		None Detected		Binder
002	PV-01	Yellow Mastic	1	No Asbestos Detected		None Detected		Adhesive
003	JJ-01	Tan Material	1	No Asbestos Detected		Glass	80-90	Binder
004	CT-01	Black Mastic	1	No Asbestos Detected		Manmade	2-3	Adhesive
005	CT-02	Brown Mastic	1	No Asbestos Detected		Cellulose Wollastonite	<1 2-3	Adhesive
006	SH-01	Tan Floor Tile	1	Chrysotile	5-10	None Detected		Vinyl Binder
007	SH-01	Black Mastic	1	Chrysotile	3-5	Cellulose	<1	Adhesive
008	SH-02	Black Covebase	1	No Asbestos Detected		None Detected		Vinyl Binder

- Analytical Methods: EPA 600/M4-82-020, December 82, EPA 600/R-93/116, July 1993
- Enclosed test results relates only to items tested.
- This report shall not be reproduced, except in full without written approval of the laboratory.
- This report can not be used to claim product endorsement by NVLAP or any agency of the U.S. Government.
- Method limitations: Analysis of floor tile and other resinously bound materials by Polarized Light Microscopy (PLM) may yield false negative results due to method limitations. In these cases ATC recommends alternative methods of analysis.
- For all heterogeneous samples easily separated into sub-samples each component will be analyzed separately. When layers cannot be separated without compromising the layer they will be analyzed as one sample. When a heterogeneous sample contains no asbestos in any layer reported results will be combined into one. When asbestos is detected in a layer or layers of a heterogeneous sample each individual layer will be reported separately.

ATC ASSOCIATES INC.
BULK SAMPLE ANALYSIS REPORT
 NVLAP Accredited
 NVLAP Code Number 101265-00

Date: July 24, 1997

Client: Alliance Indiana, Inc.

Project Identification: NGR-00A02 - Greater Clark County Schools
 Date Sample Received: July 9, 1997
 ATC Lab Batch Number: 971246

Lab ID	Client ID	Color / Description	Layer(s)	Asbestos Type	%	Other Fibrous Material	%	Non-Fibrous Material
009	SH-02	Brown Mastic	1	No Asbestos Detected		Cellulose	<1	Adhesive

Scott Frosch (PS)

Scott Frosch, Analyst

Patrick Stanford

Patrick Stanford, Group Leader

- Analytical Methods: EPA 600/M4-82-020, December 82, EPA 600/R-93/116, July 1993
- Enclosed test results relates only to items tested.
- This report shall not be reproduced, except in full without written approval of the laboratory.
- This report can not be used to claim product endorsement by NVLAP or any agency of the U.S. Government.
- Method limitations: Analysis of floor tile and other resinously bound materials by Polarized Light Microscopy (PLM) may yield false negative results due to method limitations. In these cases ATC recommends alternative methods of analysis.
- For all heterogeneous samples easily separated into sub-samples each component will be analyzed separately. When layers cannot be separated without compromising the layer they will be analyzed as one sample. When a heterogeneous sample contains no asbestos in any layer reported results will be combined into one. When asbestos is detected in a layer or layers of a heterogeneous sample each individual layer will be reported separately.

ALLIANCE INDIANA, INC.
 1433 Sadler Circle West Dr.
 Indianapolis, IN 46239
 317/351-5600 Fax 317/351-5610

971246
 7/9

Project Name- Greater Clark County Schools
 Project Location- _____
 City/State- Jeffersonville, Indiana
 Project Number- NGR 00A02 Date- 3 July 97
 Samples Collected By- Karen Fox

SAMPLE I.D. NUMBER	LOCATION OF SAMPLE	DESCRIPTION OF SAMPLE MATERIAL
PV-01	Main Hall	Cove base & mastic CB - NAD M - NAD
JS-01	Boiler	Gasket NAD
CT-01	Main Hall	Floor Tile Mastic NAD
CT-02	Main Hall	Cove Base Mastic NAD
SH-01	Classroom	Floor Tile & mastic FT - Chr 5-10% M - Chr 3-5%
SH-02	Classroom	Cove base & mastic CB - NAD M - NAD

7.23.97

(P)

CHAIN OF CUSTODY

Sample By: KAREN FOX Received By: DC 247 Recorded By: _____
 Date: 3 July 97 Date: 7 9 97 Date: _____ Log#: _____
 Signature: Karen Fox Signature: (Signature) Signature: _____
 Date Shipped: 9 July 97 Shipped Via: _____ Shipped To: _____

**ANNUAL NOTIFICATIONS
ACCREDITATIONS
TRAINING
INFORMATION**

NOTICES

NOTIFICATION LOG

GREATER CLARK COUNTY SCHOOLS

DATE OF NOTIFICATION

COPY IN BOOK

YEAR

(X)

2009

✓

2010

✓

2011

2012

2013

✓

2014

✓

2015

✓

2016

2017

2018

2019

2020

2021

2022

2023

2024

2025

2026

2027

2028

2029

2030

NOTIFICATION LOG

LEA Name - Greater Clark County Schools

<u>Date of Notification</u>	<u>Copy of Notification in Supplemental Book?</u>
1989	
1990	
1991	
1992	
1993	
1994	
1995	✓
1996	✓
1997	✓
1998	✓
1999	✓
2000	✓
2001	✓
2002	✓
2003	✓
2004	✓
2005	✓
2006	✓
2007	✓
2008	✓

March 2015

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services at River Valley Middle School, which is located at 2220 Veteran's Parkway, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, Service Center, Corden Porter Storage, Auto Tech Program- Witten Property, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2015/2016 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

* The required triennial re-inspection will be performed in April 2016.

* The required six month periodic surveillance was performed in October 2014.

* The required six month periodic surveillance activities are scheduled for April and October each year.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Corden Porter former Options Building and the Administration Building

March 2014

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2220 Veteran's Parkway, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, Corden Porter Storage, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2014/2015 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

* The required triennial re-inspection will be performed in April 2013.

* The required six month periodic surveillance was performed in October 2013.

* The required six month periodic surveillance activities are scheduled for April and October each year.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

March 2013

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, Corden Porter Storage, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2013/2014 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- * The required triennial re-inspection will be performed in April 2013.
- * The required six month periodic surveillance was performed in October 2012.
- * The required six month periodic surveillance activities are scheduled for April and October each year.
- * Projects completed in 2012: Parkview Middle School.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxillary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection will be performed in June 2010.
- * The required six month periodic surveillance was performed in December 2009.
- * The next scheduled activity is the required six month periodic surveillance in December 2010.
Charlestown High School is an ongoing asbestos removal project which will be complete prior to partial demolition.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building –
These buildings are asbestos free and **Riverside Elementary** was demolished in 2006.
No surveillances or reinspections are required for these buildings.

March 2010

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2007.
- * The required six month periodic surveillance was performed in December 2008.
- * The next scheduled activities are the required six month periodic surveillance in June 2009 and Dec 2009. Charlestown High School has undergone an asbestos removal project prior to partial demolition.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free and **Riverside Elementary** was demolished in 2006. No surveillances or re-inspections are required for these buildings.

April 2009

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number (812)288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2007.
- * The required six month periodic surveillance was performed in December 2007.
- * The next scheduled activities are the required six month periodic surveillance in June 2008 and Dec 2008.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building - These buildings are asbestos free. **Riverside Elementary** was Demolition in 2006. No surveillances or reinspections are required.

April 2008

**AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required six month periodic surveillance was performed in June 2006.
- * The required six month periodic surveillance was performed in December 2006.
- * The next scheduled activities are the required six month periodic surveillance in June 2007 and Dec 2007.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free. **Riverside Elementary** was Demolition in 2006. No surveillances or reinspections are required.

March 2007

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

* The required triennial reinspection was performed in June 2005.

* The required six month periodic surveillance was performed in December 2005.

* The next scheduled activities are the required six month periodic surveillance in June 2006 and Dec 2006.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building –
These buildings are asbestos free. No surveillances or reinspections are required.

March 2006

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2004.
- * The required six month periodic surveillance was performed in December 2004.
- * The next scheduled activities are the required six month periodic surveillance in June 2005 and December 2005.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

- * These buildings are asbestos free. No surveillances or reinspections are required.

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required six month periodic surveillance was performed in June 2003.
- * The required six month periodic surveillance was performed in December 2003.
- * The next scheduled activities are the required triennial reinspection in June 2004 and a required six month periodic surveillance in December 2004.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

- * These buildings are asbestos free. No surveillances or reinspections are required.

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required six month periodic surveillance was performed in June 2002.
- * The required six month periodic surveillance was performed in December 2002.
- * The next scheduled activity is the required periodic surveillance in June 2003.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

- * These buildings are asbestos free. No surveillances or reinspections are required.

May 2003

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in July 2001.
- * The required six month periodic surveillance was performed in December 2001.
- * The next scheduled activities are the required periodic surveillances in June 2002 and December 2002.

Pleasant Ridge Elementary School and (New) Utica Elementary School -

- * These buildings are asbestos free. No surveillances or reinspections are required.

(Old) Utica Elementary School -

- * In accordance with information collected from the GCCS this building has been deeded to the town of Utica. No further AHERA periodic surveillances or triennial reinspections will be conducted by the designated person.

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, (Old) Utica, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center -

- * The required six month periodic surveillance was performed in June 2000.
- * The required six month periodic surveillance was performed in January 2001.
- * The next scheduled activity is a required triennial reinspection in June 2001.

Pleasant Ridge Elementary School and (New) Utica Elementary School -

- * This building is asbestos free. No surveillances or reinspections are required.

June 2001

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, Utica, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center -

- * The required six month periodic surveillance was performed in June 1999.
- * The required six month periodic surveillance was performed in December 1999.
- * The next scheduled activity is a required periodic surveillance in June 2000.

Pleasant Ridge Elementary School -

- * This building is asbestos free. No surveillances or reinspections are required.

June 2000

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required six month periodic surveillance was performed in June 1998.
- * The required six month periodic surveillance was performed in December 1998.
- * The next scheduled activity is a required periodic surveillance in June 1999.

Parkwood Elementary School

- * O & M was performed in the boiler room in May 1998.

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1997 and December 1997.
- * Next activity scheduled activity is a required third year reinspection in June 1998.

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available, should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

* The required periodic surveillance was performed in June 1996 and December 1996.

* The next required periodic surveillance will be performed in June 1997 and December 1997.

June 97

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Denny Johanson at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All buildings where it is required -

- * The required third year reinspection was performed in June 1995.
- * The required periodic surveillance was performed in December 1995.
- * Next activity scheduled is a periodic surveillance in June 1996.

Charlestown High School -

- * Transite panels were compliantly removed from the exterior of the building.

Corden Porter Building #3 -

- * TSI was compliantly removed from the boiler room.

June 96

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available, should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Dennis Johanson at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1995 and December 1995.
- * The required triennial reinspection was performed in June 1995.
- * The next required periodic surveillance will be performed in June 1996 and December 1996.

June 95

ACCREDITATIONS



Environmental Management Institute

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846

www.envtlmgmt.org

This confirms that

Sandy Shadley

Completed the Required Initial Training for
Asbestos Accreditation Under TSCA Title II
and has
passed with a Score of 70 or Greater the Examination for

Asbestos Management Planner

Course Date
December 10 - 11, 2009

Examination Date
December 11, 2009


Jack E. Leonard, President

Certificate: MP(I) 2248

Expires: December 11, 2010

Approved by: Illinois Department of Public Health
Indiana Department of Environmental Management



Indiana Dept. of Environmental Management

Sandra S. Shadley

Asbestos Project Designer License #: 19A002607

Effective: 12/07/2009

Expiration: 12/07/2010

Birth Date: 04/21/1959

Gender: F

Height: 5-08

Eye Color: Blue

Weight: 140

Hair Color: Brown

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE
1435 Sadlier Circle West Drive
Indianapolis, Indiana 46239
(317) 352 -1270 / (317) 352 - 0669

CHRISTIAAN SPARKS
306 - 04 - 2616

Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better

For
ASBESTOS BUILDING INSPECTOR REFRESHER

Accredited by the
Indiana Department of Environmental Management.

Certificate # ES03/BIR755

Course Dates: 09/26/2003
Test Date: 09/26/ 2003 Expires: 09/26/2004



Sharyn Reyes
Sharyn Reyes
Instructor / Manager

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE
1435 Sadlier Circle West Drive
Indianapolis, Indiana 46239
(317) 352-1270 / (317) 352-06

GEORGE Wm. (BILL) OGLE

Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better
For

**ASBESTOS MANAGEMENT PLANNER
REFRESHER**

Accredited by the
Indiana Department of Environmental Management.

Certificate # ES03/MPR045

Course Dates: 09/05/2003
Test Date: 09/05/2003 Expires: 09/05/2004




Sharyn Reyes
Instructor

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE
1435 Sadlier Circle West Drive
Indianapolis, Indiana 46236
(317) 352-1270 / (317) 352 - 0669

PATRICK E. WILSON
309 - 90 - 6909

Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better
For

ASBESTOS BUILDING INSPECTOR REFRESHER

Accredited by the
Indiana Department of Environmental Management.

Certificate # ES00/BIR482

Course Dates: 11/29/2000
Test Date: 11/29/2000 Expires: 11/29/2001

Sharyn Reyes

Sharyn Reyes
Instructor



Environmental Management Institute

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846

www.spea.iupui.edu/Envtl_mgmt


This confirms that

George Wm. (Bill) Ogle

Completed the Requisite Initial Training for
Asbestos Accreditation Under TSCA Title II
and has
Passed with a Score of 70 or Greater the Examination for
Asbestos Management Planner

Course date
March 2 - 3, 2000

Examination Date
March 3, 2000

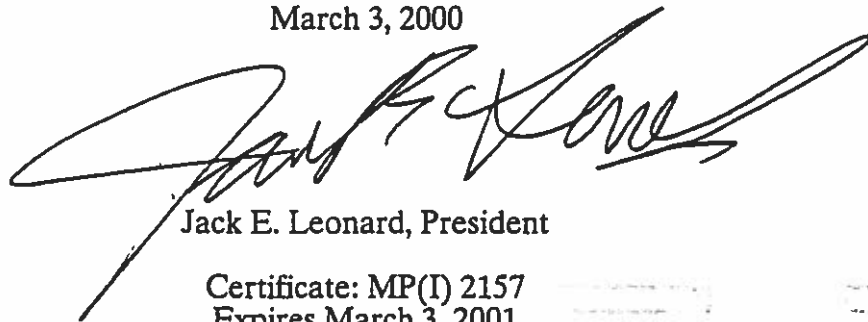

Jack E. Leonard, President

Certificate: MP(I) 2157
Expires March 3, 2001

Approved by: Illinois Department of Public Health
Indiana Department of Environmental Management



ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE
1435 Sadler Circle West Drive
Indianapolis, Indiana 46239
(317) 352-1270 / (317) 352-0669

CLINT YATES

316 - 92 - 7065

Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better
For

ASBESTOS BUILDING INSPECTOR REFRESHER

Accredited by the
Indiana Department of Environmental Management.

Certificate # ES/BIR98/004.

Course Dates: 01/22/98 - 01/22/98
Test Date: 01/22/98 Expires: 01/22/99

Sharyn Reyes

Sharyn Reyes
Assistant / Instructor

Environmental Management Institute

Environmental and Occupational Training Service

5610 Crawfordsville Road, Suite 15

Indianapolis, Indiana 46224-3714

317/248-4848

This confirms that

Rex Gaddis

Completed the Requisite Refresher Training for
Asbestos Accreditation Under TSCA Title II


and has

Passed with a Score of 70 or Greater the Examination for

Asbestos Building Inspector

Course date
November 22, 1994

Examination Date
November 22, 1994

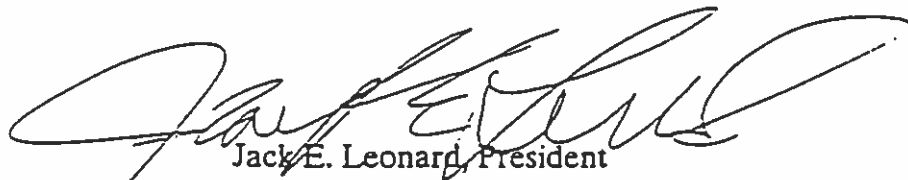

Jack E. Leonard, President

Certificate: IN(R) 2713
Expires November 22, 1995

Approved by: Illinois Department of Public Health
Indiana Department of Environmental Management

INDIANA DEPARTMENT OF ENVIRONMENTAL MANAGEMENT
ASBESTOS CERTIFICATE OF ACCREDITATION
CERTIFICATE # 192248026 EXPIRATION DATE 2/18/96
Rex Gaddis
IS CERTIFIED IN THE FOLLOWING DISCIPLINE(S)
INSPECTOR PLANNER DESIGNER
SUPERVISOR WORKER
WASTE DISPOSAL MANAGER
BIRTHDATE: 3/24/52 SEX: M EYES: BLU
HEIGHT: 5-10 WEIGHT: 220 HAIR: BRO

INDIANA DEPARTMENT OF ENVIRONMENTAL MANAGEMENT
ASBESTOS CERTIFICATE OF ACCREDITATION
CERTIFICATE # 190908032 EXPIRATION DATE 3/16/96
Rex Gaddis
IS CERTIFIED IN THE FOLLOWING DISCIPLINE(S)
INSPECTOR PLANNER DESIGNER
SUPERVISOR WORKER
WASTE DISPOSAL MANAGER
BIRTHDATE: 3/24/52 SEX: M EYES: BLU
HEIGHT: 5-10 WEIGHT: 220 HAIR: BRO

TRAINING

**OPERATIONS AND MAINTENANCE
INFORMATION**

MINOR FIBER RELEASE EPISODE

The local education agency shall ensure that the procedures described below are followed in the event of a minor fiber release episode (i.e., the falling or dislodging of not more than 3 square or linear feet of friable ACM):

1. Thoroughly saturate the debris using wet methods.
2. Clean the area using wet methods, protective clothing, HEPA-vacuums, mini-enclosures, glove bags, as necessary to inhibit the spread of any released fibers. At a minimum, workers should use air-purifying respirators with HEPA filters.
3. Place the asbestos debris in a sealed, leak-tight container, preferably a 6 mil. labeled plastic bag.
4. Repair the area of damaged ACM with materials such as asbestos-free spackling, plaster, cement, or insulation, or seal with latex paint or an encapsulant, or immediately have the appropriate response action implemented.
5. Each fiber release episode should be documented.

MAJOR FIBER RELEASE EPISODE

The local education agency shall ensure that the procedures described below are followed in the event of a major fiber release episode (i.e., the falling or dislodging of more than 3 square or linear feet of friable ACM):

1. Restrict entry into the area and post signs to prevent entry into the area by persons other than those necessary to perform the response action.
2. Shut off or temporarily modify the air-handling system to prevent the distribution of fibers to other areas in the building.
3. AHERA requires that major fiber release episodes be designed by accredited Project Designers. However, the following response procedures should form the basis for response actions.
4. All the procedures recommended by EPA and required by OSHA for large-scale removal of ACM should be used. These include containment barrier, negative pressure ventilation, personal respiratory protection and protective clothing, decontamination facilities, and air testing.
5. Workers should wear "type C" respirators and protective clothing, including a body suit, hood, boots and gloves. Personal air monitoring may be conducted on representative workers, but is not required by OSHA when "type C" respirators are used.
6. Fallen debris should be sprayed with amended water and placed in plastic bags for disposal. Shovels are useful for collecting the debris. The floor should be thoroughly cleaned with a HEPA vacuum cleaner.
7. Walls, ceiling, pipes, boilers, or other surfaces where ACM was damaged or delaminated should be repaired temporarily. This might involve replastering with asbestos-free material, spraying with an encapsulant, or taping with duct tape. In some cases, ACM beyond the immediate area of damage may need to be removed to prevent additional episodes.
8. The air should be tested for asbestos fibers before the plastic barriers are removed and the area reoccupied. Testing should follow guidelines in Chapter 6 of the Purple Book and Chapter 4 of the Silver Book. That is, air should be sampled at the specified number of locations and analyzed by either phase contrast microscopy or transmission electron microscopy. However, sampling should not be done aggressively since the use of blowers and fans may dislodge fibers from the remaining ACM.

9. After the barriers have been taken down, a decontamination of the entire building or a portion of it should be considered. The need for this will depend on how rapidly the response team reacted to the episode and, in particular, how quickly the HVAC system was turned off. A thorough decontamination includes HEPA-vacuuming and/or wet wiping all carpets, furniture, and other surfaces. Decontamination of the HVAC system would involve disassembling and cleaning (HEPA-vacuuming or wet wiping) ducts, ventilators, registers, and other system parts. System filters should also be removed and replaced.

10. All equipment used in the cleanup operation should be washed or wiped with damp cloths. All disposable materials (e.g., cloths, mop heads, filters, coveralls) should be discarded as asbestos wastes.

11. Each fiber release episode should be documented.

OPERATIONS AND MAINTENANCE REPORT
(Use only for O&M work less than 3 square or 3 linear feet)

L.E.A.: _____

BUILDING: _____

DATE: _____

The following information is provided in accordance with 40 CFR 763.91 and 763.94.

1. Location: _____

Homogeneous Area/Material Description _____

2. Response: Clean _____ Repair _____ Encapsulation _____

Enclosure _____ Removal _____

Reason: _____

3. Work Description: _____

4. Date: Start _____ Stop _____

Time: Start _____ Stop _____

5. Material: Surface _____ SF Thermal _____ LF

Other: _____ SF or _____ LF

6. Asbestos Control Method: Wet Methods _____ HEPA Vacuum _____

Glovebag _____ Mini-Enclosure _____

7. Respiratory Protection: N.A.P.R. _____ P.A.P.R. _____

Were all employees properly fit tested? YES NO NOT APPLICABLE

8. Equipment Used:

Low Vol. Pumps	_____	High Vol. Pumps	_____
FAM	_____	AFD	_____
HEPA Vac	_____		

Other: _____

9. Material Used:

6 Mil. Disposable Bags	_____	Poly	_____
Glovebags	_____	HEPA Filters	_____
Duct Tape	_____	Spray Glue	_____
Disposable Coveralls	_____	3M Pads	_____
Sponges	_____		

Encapsulants: Penetrating _____ Bridging _____

Other: _____

10. Work Personnel:

NAME **16 HOUR TRAINED - IDEM ACCREDITED**

Supervisor: _____ YES NO YES NO

Worker(s): _____ YES NO YES NO

_____ YES NO YES NO

_____ YES NO YES NO

_____ YES NO YES NO

_____ YES NO YES NO

11. ACBM Disposal: Storage: YES NO, If yes, where stored: _____

If no, where disposed: Landfill: _____

12. Final Visual Inspection Approved: _____
(LEA Designated Person - Printed Name)

(LEA Designated Person - Signature)

**REMOVAL PROJECT
INFORMATION**

SHORT TERM WORKER PROGRAM

GREATER CLARK COUNTY SCHOOLS

SHORT-TERM WORKER SIGN OFF SHEET

This form should be signed each and every time before a "short-term worker" (telephone repair worker, utility worker, etc.) performs work that may cause him to come in contact with ACBM or suspected ACBM assumed to be ACM. One copy of this form should then be forwarded to the LEA designated person, and one copy should be maintained in the school building's copy of the supplemental binder provided by Alliance Indiana, Inc., in order to fulfill the LEA's recordkeeping requirements. The third copy should be forwarded to Alliance Indiana, Inc. for placement in its copy of the supplemental binder.

School Building Name - Parkview Middle School Date _____

I certify that before performing any work which would possibly cause me to come in contact with Asbestos Containing Building Materials (ACBM), I was provided with adequate information regarding the locations of ACBM and suspected ACBM assumed to be ACM in the above-mentioned school building where I performed the work.

Signature - _____

Company - _____

Description of work (including number of days on site) - _____
