

GREATER CLARK COUNTY SCHOOLS

NEW WASHINGTON ELEMENTARY SCHOOL

AHERA

ASBESTOS MANAGEMENT PLAN

**DESIGNATED PERSON
TRUTH AND CORRECT STATEMENT**

Local Education Agency – Greater Clark County Schools
2112 Utica-Sellersburg Road
Jeffersonville, Indiana 47130

Designated Person - Alliance Environmental Group, Inc.
Sandra Shadley
5153 Commerce Square Drive, Suite E
Indianapolis, Indiana 46237

This Truth and Correct Statement, as outlined in 40 CFR 763.93(i), certifies that the general, local education agency responsibilities, as stipulated by 40 CFR 763.84, have been or will be met.

These responsibilities include:

1. Ensure that the activities of any persons who perform inspections, reinspections, and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with 40 CFR 763 Subpart E.
2. Ensure all custodial and maintenance employees are properly trained as required by 40 CFR 763 Subpart E and other applicable Federal and/or State regulations (e.g., the Occupational Safety and Health Administration Asbestos Standard for Construction, the EPA Worker Protection Rule, or applicable State regulations).
3. Ensure that workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress.
4. Ensure that short-term workers (e.g., telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.
5. Ensure that warning labels are posted in accordance with Section 763.95.
6. Ensure management plans are available for inspection and notification of such availability has been provided as specified in the management plan under Section 763.93(g).
7. The undersigned person designated by the LEA pursuant to Section 763.84(g) (1) has received adequate training as stipulated in Section 763.84(g) (2).
8. The LEA has and will consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under Part 763.

Signature:  Date: November 6, 2016

Sandra S. Shadley

ASBESTOS PROGRAM MASTER INDEX

The following volumes are part of the Asbestos Program for the **GREATER CLARK COUNTY SCHOOLS**:

- A. Original Asbestos Management Plan for each school building.
- B. Asbestos Management Plan Supplement for each school building.
 - 1. Amendments to Management Plan
 - 2. Remaining Materials Report
 - 3. Surveillance, Reinspection and Additional Bulk Sampling Information
 - 4. Annual Notifications, Accreditations and Training Records
 - 5. Operations and Maintenance Records
 - 6. Asbestos Removal Projects
 - 7. Short Term Worker Program

Copies of both volumes are found in the respective buildings. The Administration Building also contains duplicate copies of both volumes for each building in their entirety.

GREATER CLARK COUNTY SCHOOLS
NEW WASHINGTON ELEMENTARY SCHOOL
TABLE OF CONTENTS

AMENDMENTS TO MANAGEMENT PLAN	1
REMAINING MATERIALS REPORT	2
SURVEILLANCE, REINSPECTION AND ADDITIONAL BULK SAMPLING INFORMATION	3
ANNUAL NOTIFICATIONS, ACCREDITATIONS, AND TRAINING	4
OPERATIONS AND MAINTENANCE RECORDS	5
ASBESTOS REMOVAL PROJECTS	6
SHORT TERM WORKER INFORMATION	7

AMENDMENTS TO THE MANAGEMENT PLAN

GREATER CLARK COUNTY SCHOOLS
NEW WASHINGTON ELEMENTARY SCHOOL

LEA RESPONSIBILITY CERTIFICATION

LEA Designated Person - ALLIANCE INDIANA, INC.


Signature - Bruce Wallace, President/CEO

May 1, 1995
Date

ACCREDITATION STATEMENT

The Greater Clark County Schools ensures that the following items will be carried out:

Activities of any persons who perform inspections, reinspections, and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with Subpart E of this part.

All custodial and maintenance employees are properly trained as required by this Subpart E and other applicable Federal and/or State regulations (e.g., the OSHA asbestos standard for construction, the EPA worker protection rule, or applicable State regulations).

Workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, and post response action activities, including periodic reinspection and surveillance activities that are planned or in progress.

Short-term workers (e.g., telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.

Warning labels are posted in accordance with 763.95.

Management plans are available for inspection and notification of such availability has been provided as specified in the management plan under 763.93(g).

Designate a person to ensure that requirements under this section are properly implemented.

Designated person receives adequate training to perform duties assigned under this section. Such training shall provide, as necessary, basic knowledge of:

Health effects of asbestos

Detection, identification, and assessment of ACM

Options for controlling ACBM

Asbestos management programs

Relevant Federal and State regulations concerning asbestos, including those in this Subpart E and those of the OSHA, U.S. Department of Labor, the U.S. Department of Transportation and the U.S. Environmental Protection Agency.

Consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under this subpart.

AMENDMENT TO THE MANAGEMENT PLAN

LEA Name - Greater Clark County Schools

Building - New Washington Elementary School


Subject - LEA Designated Person Change

Effective May 1, 1995 the Designated Person for the Greater Clark County Schools is:

Alliance Indiana, Inc.
1433 Sadler Circle West Drive
Indianapolis, Indiana 46239
(317) 351-5600

Management Planner: Rex Gaddis

Accreditation No. 192218025



Signature

May 1, 1995
Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - New Washington Elementary School

Subject- New material

Reference - HA A Cove Base

Original Assessment - No assessment in original inspection.


Amended Assessment - The cove base in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025



Signature



Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - New Washington Elementary School

Subject- New material

Reference - HA B Cove Base Mastic

Original Assessment - No assessment in original inspection.


Amended Assessment - The cove base mastic in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025

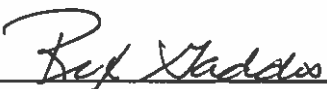

Signature



Date

AMENDMENT TO MANAGEMENT PLAN

LEA Name - Greater Clark County Schools
Subject - LEA Designated Person Change
Amendment - Effective March 2005, the Designated Person for the Greater Clark County Schools is:

Alliance Environmental Group, Inc.
5340 Commerce Circle, Suite E
Indianapolis, Indiana 46237
(317) 865-3400

Personnel contributing to this Management Plan are licensed in according with 40 CFR 763.93(e)(12).

Management Planner: Sandra S. Shadley

Accreditation Number: 19A002720


Signature


Date


AMENDMENT TO MANAGEMENT PLAN

Building Name - New Washington Elementary School
Subject - Addition of Homogeneous Area C
Amendment - Fire doors that were not assessed in the initial inspection. They are suspect material and are being added to the management plan until proper sampling has been completed.

Management Planner: Sandra Shadley

Accreditation Number: 19A002720


Signature

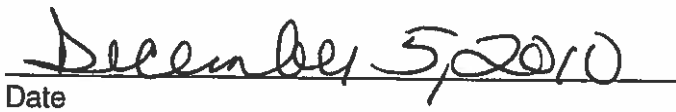

Date


AMENDMENT TO MANAGEMENT PLAN

Building Name - New Washington Elementary School
Subject - Addition of Homogeneous Area D
Amendment - Shock joint in the boiler room was not assessed in the initial inspection. It is suspect material and is being added to the management plan until proper sampling has been completed.

Management Planner: Sandra Shadley

Accreditation Number: 19A002720

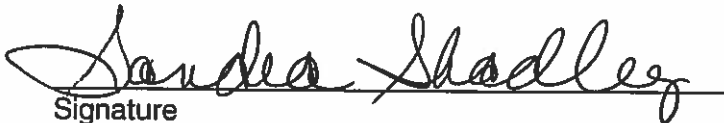
Signature

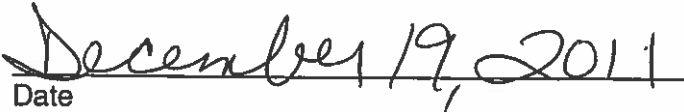

Date


AMENDMENT TO MANAGEMENT PLAN

Building Name - New Washington Elementary School
Subject - Addition of Homogeneous Area E
Amendment - Black sink insulation was not assessed in the initial inspection. It is suspect material and is being added to the management plan until proper sampling has been completed.

Management Planner: Sandra Shadley

Accreditation Number: 19A002720

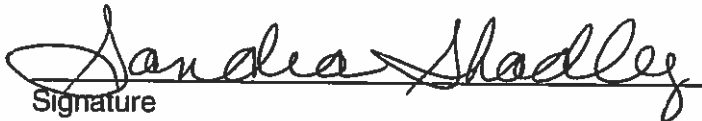
Signature

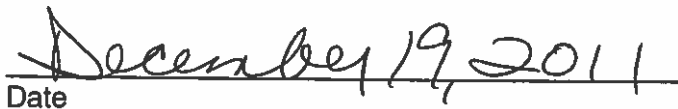
Date

REMAINING MATERIALS

Greater Clark County School Corporation

Remaining Materials Report

4/23/2020

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>New Washington Elementary School</u>						
04	Mastic	6328	SF	Known	Throughout building	O&M
A	Cove Base	5700	SF	Assumed	Throughout the 1971 and 1982 portions of the building. (classrooms)	O&M
B	Cove Base Mastic	Unquantified	LF	Assumed	Throughout the 1971 and 1982 portions of the building.	O&M
C	Fire Doors	3	Unit(s)	Assumed	Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior	O&M
D	Shock Joint	1	Unit(s)	Assumed	Boiler Room by interior door overhead.	O&M
E	Black Sink Insulation (Book store and teachers lounge)	Unquantified	LF	Assumed	Sink	O&M

Greater Clark County School Corporation

Remaining Materials Report

1/14/2020

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>New Washington Elementary School</u>						
04	Mastic	6328	SF	Known	Throughout building	O&M
A	Cove Base	5700	SF	Assumed	Throughout the 1971 and 1982 portions of the building. (classrooms)	O&M
B	Cove Base Mastic	Unquantified	LF	Assumed	Throughout the 1971 and 1982 portions of the building.	O&M
C	Fire Doors	3	Unit(s)	Assumed	Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior	O&M
D	Shock Joint	1	Unit(s)	Assumed	Boiler Room by interior door overhead.	O&M
E	Black Sink Insulation (Book store and teachers lounge)	Unquantified	LF	Assumed	Sink	O&M

Greater Clark County School Corporation

Remaining Materials Report

5/16/2019

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>New Washington Elementary School</u>						
04	Mastic	6328	SF	Known	Throughout building	O&M
A	Cove Base	5700	SF	Assumed	Throughout the 1971 and 1982 portions of the building. (classrooms)	O&M
B	Cove Base Mastic	Unquantified	LF	Assumed	Throughout the 1971 and 1982 portions of the building.	O&M
C	Fire Doors	3	Unit(s)	Assumed	Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior	O&M
D	Shock Joint	1	Unit(s)	Assumed	Boiler Room by interior door overhead.	O&M
E	Black Sink Insulation (Book store and teachers lounge)	Unquantified	LF	Assumed	Sink	O&M

Greater Clark County School Corporation

Remaining Materials Report

11/14/2018

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>New Washington Elementary School</u>						
04	Mastic	6328	SF	Known	Throughout building	O&M
A	Cove Base	5700	SF	Assumed	Throughout the 1971 and 1982 portions of the building. (classrooms)	O&M
B	Cove Base Mastic	Unquantified	LF	Assumed	Throughout the 1971 and 1982 portions of the building.	O&M
C	Fire Doors	3	Unit(s)	Assumed	Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior	O&M
D	Shock Joint	1	Unit(s)	Assumed	Boiler Room by interior door overhead.	O&M
E	Black Sink Insulation (Book store and teachers lounge)	Unquantified	LF	Assumed	Sink	O&M

Greater Clark County School Corporation

Remaining Materials Report

5/2/2018

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>New Washington Elementary School</u>						
04	Mastic	6328	SF	Known	Throughout building	O&M
A	Cove Base	5700	SF	Assumed	Throughout the 1971 and 1982 portions of the building. (classrooms)	O&M
B	Cove Base Mastic	Unquantified	LF	Assumed	Throughout the 1971 and 1982 portions of the building.	O&M
C	Fire Doors	3	Unit(s)	Assumed	Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior	O&M
D	Shock Joint	1	Unit(s)	Assumed	Boiler Room by interior door overhead.	O&M
E	Black Sink Insulation (Book store and teachers lounge)	Unquantified	LF	Assumed	Sink	O&M

Greater Clark County School Corporation

Remaining Materials Report

10/18/2017

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>New Washington Elementary School</u>						
04	Mastic	6328	SF	Known	Throughout building	O&M
A	Cove Base	5700	SF	Assumed	Throughout the 1971 and 1982 portions of the building. (classrooms)	O&M
B	Cove Base Mastic	Unquantified	LF	Assumed	Throughout the 1971 and 1982 portions of the building.	O&M
C	Fire Doors	3	Unit(s)	Assumed	Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior	O&M
D	Shock Joint	1	Unit(s)	Assumed	Boiler Room by interior door overhead.	O&M
E	Black Sink Insulation (Book store and teachers lounge)	Unquantified	LF	Assumed	Sink	O&M

Greater Clark County School Corporation

Remaining Materials Report

4/13/2017

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>New Washington Elementary School</u>						
04	Mastic	6328	SF	Known	Throughout building	O&M
A	Cove Base	5700	SF	Assumed	Throughout the 1971 and 1982 portions of the building. (classrooms)	O&M
B	Cove Base Mastic	Unquantified	LF	Assumed	Throughout the 1971 and 1982 portions of the building.	O&M
C	Fire Doors	3	Unit(s)	Assumed	Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior	O&M
D	Shock Joint	1	Unit(s)	Assumed	Boiler Room by interior door overhead.	O&M
E	Black Sink Insulation (Book store and teachers lounge)	Unquantified	LF	Assumed	Sink	O&M

Greater Clark County School Corporation

Remaining Materials Report

11/3/2016

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>New Washington Elementary School</u>						
04	Mastic	6328	SF	Known	Throughout building	O&M
A	Cove Base	5700	SF	Assumed	Throughout the 1971 and 1982 portions of the building. (classrooms)	O&M
B	Cove Base Mastic	Unquantified	LF	Assumed	Throughout the 1971 and 1982 portions of the building.	O&M
C	Fire Doors	3	Unit(s)	Assumed	Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior	O&M
D	Shock Joint	1	Unit(s)	Assumed	Boiler Room by interior door overhead.	O&M
E	Black Sink Insulation (Book store and teachers lounge)	Unquantified	LF	Assumed	Sink	O&M

Greater Clark County School Corporation

Remaining Materials Report

4/28/2016

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>New Washington Elementary School</u>						
04	Mastic	6328	SF	Known	Throughout building	O&M
A	Cove Base	5700	SF	Assumed	Throughout the 1971 and 1982 portions of the building. (classrooms)	O&M
B	Cove Base Mastic	Unquantified	LF	Assumed	Throughout the 1971 and 1982 portions of the building.	O&M
C	Fire Doors	3	Unit(s)	Assumed	Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior	O&M
D	Shock Joint	1	Unit(s)	Assumed	Boiler Room by interior door overhead.	O&M
E	Black Sink Insulation (Book store and teachers lounge)	Unquantified	LF	Assumed	Sink	O&M

Greater Clark County School Corporation

Remaining Materials Report

10/20/2015

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>New Washington Elementary School</u>						
04	Mastic	6328	SF	Known	Throughout building	O&M
A	Cove Base	5700	SF	Assumed	Throughout the 1971 and 1982 portions of the building. (classrooms)	O&M
B	Cove Base Mastic	Unquantified	LF	Assumed	Throughout the 1971 and 1982 portions of the building.	O&M
C	Fire Doors	3	Unit(s)	Assumed	Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior	O&M
D	Shock Joint	1	Unit(s)	Assumed	Boiler Room by interior door overhead.	O&M
E	Black Sink Insulation (Book store and teachers lounge)	Unquantified	LF	Assumed	Sink	O&M

**Greater Clark County Schools
Remaining Materials Report
April 22, 2015**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the 1971 and 1982 portions of the building. (classrooms)	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the 1971 and 1982 portions of the building.	O & M
C	Fire Doors	3 Eac	A	Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior	O & M
D	Shock joint	1 Eac	A	Boiler Room by interior door overhead.	O & M
E	Black Sink Insulation (Book store and teachers lounge)	Unquantified LF	A	Sink	O & M

**Greater Clark County Schools
Remaining Materials Report
October 22, 2014**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the 1971 and 1982 portions of the building. (classrooms)	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the 1971 and 1982 portions of the building.	O & M
C	Fire Doors	3 Eac	A	Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior	O & M
D	Shock joint	1 Eac	A	Boiler Room by interior door overhead.	O & M
E	Black Sink Insulation (Book store and teachers lounge)	Unquantified LF	A	Sink	O & M

**Greater Clark County Schools
Remaining Materials Report
April 21, 2014**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the 1971 and 1982 portions of the building. (classrooms)	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the 1971 and 1982 portions of the building.	O & M
C	Fire Doors	3 Eac	A	Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior	O & M
D	Shock joint	1 Eac	A	Boiler Room by interior door overhead.	O & M
E	Black Sink Insulation (Book store and teachers lounge)	Unquantified LF	A	Sink	O & M

**Greater Clark County Schools
Remaining Materials Report
October 24, 2013**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the 1971 and 1982 portions of the building. (classrooms)	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the 1971 and 1982 portions of the building.	O & M
C	Fire Doors	3 Eac	A	Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior	O & M
D	Shock joint	1 Eac	A	Boiler Room by interior door overhead.	O & M
E	Black Sink Insulation (Book store and teachers lounge)	Unquantified LF	A	Sink	O & M

**Greater Clark County Schools
Remaining Materials Report
April 24, 2013**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the 1971 and 1982 portions of the building. (classrooms)	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the 1971 and 1982 portions of the building.	O & M
C	Fire Doors	3 Eac	A	Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior	O & M
D	Shock joint	1 Eac	A	Boiler Room by interior door overhead.	O & M
E	Black Sink Insulation (Book store and teachers lounge)	Unquantified LF	A	Sink	O & M

**Greater Clark County Schools
Remaining Materials Report
October 24, 2012**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the 1971 and 1982 portions of the building. (classrooms)	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the 1971 and 1982 portions of the building.	O & M
C	Fire Doors	3 Eac	A	Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior	O & M
D	Shock joint	1 Eac	A	Boiler Room by interior door overhead.	O & M
E	Black Sink Insulation (Book store and teachers lounge)	Unquantified LF	A	Sink	O & M

**Greater Clark County Schools
Remaining Materials Report
June 25, 2012**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the 1971 and 1982 portions of the building. (classrooms)	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the 1971 and 1982 portions of the building.	O & M
C	Fire Doors	3 Eac	A	Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior	O & M
D	Shock joint	1 Eac	A	Boiler Room by interior door overhead.	O & M
E	Black Sink Insulation (Book store and teachers lounge)	Unquantified LF	A	Sink	O & M

**Greater Clark County Schools
Remaining Materials Report
December 15, 2011**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
-----	----------	----------	----------	----------	--------------------

New Washington Middle\High School

05	Mastic (VAT)	18,283 SF	A	Throughout the building	O & M
A	Cove base (brownish color)	Unquantified LF	A	Custodial closets on (1st and 2nd Floor)	O & M
B	Cove base mastic	Approx. 4,600 LF	A	Throughout the building	O & M
D	Fire Doors	7 Eac	A	Activity Room and Boiler Room	O & M

**Greater Clark County Schools
Remaining Materials Report
June 27, 2011**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the 1971 and 1982 portions of the building.	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the 1971 and 1982 portions of the building.	O & M
C	Fire Door	3 Eac	A	Boiler/Mechanical Room	O & M
D	Shock joint	1 Eac	A	Boiler Room by interior door overhead.	O & M
E	Black Sink Insulation	Unquantified LF	A	Sink	O & M

**Greater Clark County Schools
Remaining Materials Report
December 6, 2010**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the 1971 and 1982 portions of the building.	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the 1971 and 1982 portions of the building.	O & M
C	Fire Door	1 Eac	A	Boiler/Mechanical Room	O & M

**Greater Clark County Schools
Remaining Materials Report
June 30, 2010**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the 1971 and 1982 portions of the building.	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the 1971 and 1982 portions of the building.	O & M
C	Fire Door	1 Eac	A	Boiler/Mechanical Room	O & M

Greater Clark County Schools
Remaining Materials Report
December 7, 2009

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
June 11, 2009

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the building	O & M

**Greater Clark County Schools
Remaining Materials Report
December 10, 2008**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
June 30, 2008

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the building	O & M

**Greater Clark County Schools
Remaining Materials Report
December 14, 2007**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the building	O & M

**Greater Clark County Schools
Remaining Materials Report
July 9, 2007**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
December 18, 2006

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
June 28, 2006

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
January 25, 2006

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
July 20, 2005

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
December 9, 2004

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
July 2, 2004

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
December 9, 2003

HA#	Material	Quantity	ACBM	Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>						
04	Mastic	6,328 SF	Y		Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A		Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A		Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
June 13, 2003

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
December 18, 2003

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
June 19, 2002

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
December 12, 2001

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the building	O & M

**Greater Clark County Schools
Remaining Materials Report
July 12, 2001**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the building	O & M

**Greater Clark County Schools
 Remaining Materials Report
 January 11, 2001**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout the building	O & M
A	Cove base	Approx. 5,700 SF	A	Throughout the building	O & M
B	Cove base mastic	Unquantified LF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
June 29, 2000

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>					
04	Mastic	6,328 SF	Y	Throughout building	O & M
A	Cove Base	Unquantified LF	A	Throughout building	O & M
B	Cove Base Mastic	Unquantified LF	A	Throughout building	O & M

Greater Clark County Schools
Remaining Materials Report
February 23, 2000

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities	
<u>New Washington Elementary School</u>						
04	Mastic	6328	SF	Y	Throughout building	O & M
A	Cove Base	Unquantified	LF	A	Throughout building	O & M
B	Cove Base Mastic	Unquantified	LF	A	Throughout building	O & M

Greater Clark County Schools
Remaining Materials Report
July 6, 1999

HA#	Material	Quantity	ACBM	Y/A	Location	Planned Activities
<u>New Washington Elementary School</u>						
04	Mastic	6328 SF		Y	Throughout building	O & M
A	Cove Base	Unquantified LF		A	Throughout building	O & M
B	Cove Base Mastic	Unquantified LF		A	Throughout building	O & M

*PERIODIC SURVEILLANCE
REINSPECTION
ADDITIONAL BULK SAMPLING
INFORMATION*

ASSESSMENTS FOR AHERA

1. Damaged or significantly damaged thermal systems insulation.
2. Damaged friable surfacing ACM.
3. Significantly damaged friable surfacing ACM.
4. Damaged or significantly damaged friable miscellaneous ACM.
5. ACBM with potential for damage.
6. ACBM with potential for significant damage.
7. Any remaining friable ACBM or friable suspected ACBM.

If a material is non-friable, it does not require an assessment rating under AHERA.

Due to the differences in what is required of the LEA for damaged material compared to significantly damaged material, Alliance has modified the assessment scale to the following:

- 1A. Significantly damaged thermal systems insulation.
- 1B. Damaged thermal systems insulation.
- 4A. Significantly damaged friable miscellaneous ACM.
- 4B. Damaged friable miscellaneous ACM.

PERIODIC SURVEILLANCES


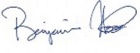
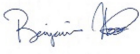
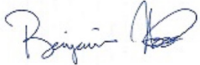

SURVEILLANCE INFORMATION

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>October 2014</u>	October 22, 2014	
<u>April 2015</u>	April 22, 2015	
<u>October 2015</u>	October 20, 2016	
<u>April 2016</u>	RE-INSPECTION	
<u>October 2016</u>	November 3, 2016	
<u>April 2017</u>	April 13, 2017	
<u>October 2017</u>	October 18, 2017	
<u>April 2018</u>	May 2, 2018	
<u>October 2018</u>	November 14, 2018	
<u>April 2019</u>	RE-INSPECTION	
<u>October 2019</u>	January 14, 2020	
<u>April 2020</u>	April 23, 2020	
<u>October 2020</u>		

SURVEILLANCE INFORMATION

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

<u>April 2021</u>	_____	_____
<u>October 2021</u>	_____	_____
<u>April 2022</u>	RE-INSPECTION	_____
<u>October 2022</u>	_____	_____
<u>April 2023</u>	_____	_____
<u>October 2023</u>	_____	_____
<u>April 2024</u>	_____	_____
<u>October 2024</u>	_____	_____
<u>April 2025</u>	RE-INSPECTION	_____
<u>October 2025</u>	_____	_____
<u>April 2026</u>	_____	_____
<u>October 2026</u>	_____	_____

SURVEILLANCE INFORMATION

PERIODIC SURVEILLANCE PLAN SCHEDULE

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>JUNE 2009</u>	<u>June 2009</u>	<u>Bill Ogle</u>
<u>DECEMBER 2009</u>	<u>Dec 2009</u>	<u>Bill Ogle</u>
<u>JUNE 2010</u>	<u>Reinspection</u>	<u>Sandy Shadley</u>
<u>DECEMBER 2010</u>	<u>December 2010</u>	<u>Paul Krick</u>
<u>JUNE 2011</u>	<u>June 2011</u>	<u>Sandy Shadley</u>
<u>DECEMBER 2011</u>	<u>December 2011</u>	<u>Sandy Shadley</u>
<u>JUNE 2012</u>	<u>June 2012</u>	<u>Jeff Hechtin</u>
<u>DECEMBER 2012</u>	<u>October 2012</u>	<u>Jeff Hechtin</u>
<u>JUNE 2013</u>	<u>Reinspection</u>	<u>Jeff Hechtin</u>
<u>DECEMBER 2013</u>	<u>_____</u>	<u>_____</u>

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each reinspection will be maintained in this binder.

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>JUNE 2003</u>	<u>June '03</u>	<u>C. Sparks</u>
<u>DECEMBER 2003</u>	<u>Dec. '03</u>	<u>C. Sparks</u>
<u>JUNE 2004</u>	<u>REINSPECTION</u>	<u>C. Sparks</u>
<u>DECEMBER 2004</u>	<u>Dec. '04</u>	<u>C. Sparks</u>
<u>JUNE 2005</u>	<u>July '05</u>	<u>J. Ogle</u>
<u>DECEMBER 2005</u>	<u>Jan 06</u>	<u>Bogel</u>
<u>JUNE 2006</u>	<u>June 06</u>	<u>C. Amos</u>
<u>DECEMBER 2006</u>	<u>Dec 06</u>	<u>Bogel</u>
<u>JUNE 2007</u>	<u>July 2007</u> <u>REINSPECTION</u>	<u>Bill Ogle</u>
<u>DECEMBER 2007</u>	<u>December 2007</u>	<u>Bill Ogle</u>
<u>JUNE 2008</u>	<u>June 2008</u>	<u>Bill Ogle</u>
<u>DECEMBER 2008</u>	<u>December 2008</u>	<u>Bill Ogle</u>

PERIODIC SURVEILLANCE PLANGREATER CLARK COUNTY SCHOOLSNEW WASHINGTON ELEMENTARY SCHOOL

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long they remain in the building. This inspection will be conducted semi-annually.

The following table outlines the dates on which these inspections should take place in this school building.

PERIODIC SURVEILLANCE SCHEDULE

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>DECEMBER 1995</u>	<u>12-95</u>	<u>Alliance</u>
<u>JUNE 1996</u>	<u>6-96</u>	<u>Alliance</u>
<u>DECEMBER 1996</u>	<u>12-96</u>	<u>Alliance</u>
<u>JUNE 1997</u>	<u>7-97</u>	<u>Alliance</u>
<u>DECEMBER 1997</u>	<u>1-98</u>	<u>Alliance</u>
<u>JUNE 1998</u>	<u>REINSPECTION</u>	<u>Alliance</u>
<u>DECEMBER 1998</u>	<u>12-98</u>	<u>Alliance</u>
<u>JUNE 1999</u>	<u>June '99</u>	<u>Alliance</u>
<u>DECEMBER 1999</u>	<u>Dec. '99</u>	<u>Alliance</u>
<u>JUNE 2000</u>	<u>June 2000</u>	<u>Alliance</u>
<u>DECEMBER 2000</u>	<u>Jan. '01</u>	<u>Pat Wilson</u>
<u>JUNE 2001</u>	<u>REINSPECTION</u>	<u>P. Wilson</u>
<u>DECEMBER 2001</u>	<u>Dec. '01</u>	<u>A Kimbrough</u>
<u>JUNE 2002</u>	<u>June '02</u>	<u>R. Calvert</u>
<u>DECEMBER 2002</u>	<u>Dec. '02</u>	<u>C Sparks</u>

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID 04
HA Description Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 6328 SF

Comments This material was exposed to inspect in custodial closets by rooms 204 & 306 & the bookstore. Normal wear is shown.

Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building. (classrooms)

Quantity 5700 SF
Comments This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cateteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982. The cove base in the hallways was replaced in 2011.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building.

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Contact		Vibration	Air
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID C
HA Description Fire Doors
HA Type Miscellaneous Material
HA Location Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior

Quantity 3 Unit(s)
Comments Boiler/Mechanical Room fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed. Holes need to be sealed.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID D
HA Description Shock Joint
HA Type Miscellaneous Material
HA Location Boiler Room by interior door overhead.

Quantity 1 Unit(s)
Comments This material is damaged in the boiler room and needs to be repaired. If the material is not capable of being repaired it should be removed and replaced.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Contact	Low/None	Vibration Low/None	Air Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID E
HA Description Black Sink Insulation (Book store and teachers lounge)
HA Type Miscellaneous Material
HA Location Sink

Quantity Unquantified LF
Comments Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition
Physical Contact	Vibration	Air
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID 04
HA Description Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 6328 SF

Comments This material was exposed to inspect in custodial closets by rooms 204 & 306 & the bookstore. Normal wear is shown.

Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building. (classrooms)

Quantity 5700 SF
Comments This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cateteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982. The cove base in the hallways was replaced in 2011.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building.

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Contact		Vibration	Air
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID C
HA Description Fire Doors
HA Type Miscellaneous Material
HA Location Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior

Quantity 3 Unit(s)
Comments Boiler/Mechanical Room fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed. Holes need to be sealed.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID D
HA Description Shock Joint
HA Type Miscellaneous Material
HA Location Boiler Room by interior door overhead.

Quantity 1 Unit(s)
Comments This material is damaged in the boiler room and needs to be repaired. If the material is not capable of being repaired it should be removed and replaced.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Contact	Low/None	Vibration Low/None	Air Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID E
HA Description Black Sink Insulation (Book store and teachers lounge)
HA Type Miscellaneous Material
HA Location Sink

Quantity Unquantified LF
Comments Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition
Physical Contact	Vibration	Air
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID 04
HA Description Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 6328 SF
Comments This material was exposed to inspect in custodial closets by rooms 204 & 306 & the bookstore. Normal wear is shown.
Asbestos Known
Friable No
Original Inspection 6/1/1992
Current Inspection 11/14/2018


Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition
Physical Contact	Low/None	Vibration Low/None
		Air Low/None

Planned Response Action O&M

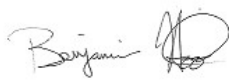Inspector 

Benjamin S. Hood

State IN
Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building. (classrooms)

Quantity 5700 SF
Comments This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cateteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982. The cove base in the hallways was replaced in 2011.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 11/14/2018

Material Assessment


Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector

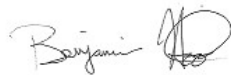

Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building.

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 11/14/2018

Material Assessment


Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector

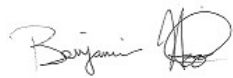

Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID C
HA Description Fire Doors
HA Type Miscellaneous Material
HA Location Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior

Quantity 3 Unit(s)
Comments Boiler/Mechanical Room fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed. Holes need to be sealed.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 11/14/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage


Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector

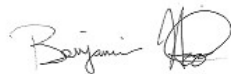

Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID D
HA Description Shock Joint
HA Type Miscellaneous Material
HA Location Boiler Room by interior door overhead.

Quantity 1 Unit(s)
Comments This material is damaged in the boiler room and needs to be repaired. If the material is not capable of being repaired it should be removed and replaced.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 11/14/2018

Material Assessment


Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

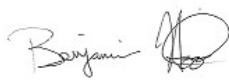Inspector 

Benjamin S. Hood

State IN
Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID E
HA Description Black Sink Insulation (Book store and teachers lounge)
HA Type Miscellaneous Material
HA Location Sink

Quantity Unquantified LF
Comments Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 11/14/2018

Material Assessment


Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

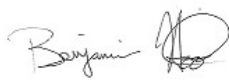Inspector 

Benjamin S. Hood

State IN
Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID 04
HA Description Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 6328 SF
Comments This material was exposed to inspect in custodial closets by rooms 204 & 306 & the bookstore. Normal wear is shown.
Asbestos Known
Friable No
Original Inspection 6/1/1992
Current Inspection 5/2/2018

Material Assessment


Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact	Vibration	Air
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector 
Benjamin S. Hood

State IN
Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building. (classrooms)

Quantity 5700 SF
Comments This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cateteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982. The cove base in the hallways was replaced in 2011.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building.

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Contact		Vibration	Air
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID C
HA Description Fire Doors
HA Type Miscellaneous Material
HA Location Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior

Quantity 3 Unit(s)
Comments Boiler/Mechanical Room fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed. Holes need to be sealed.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage


Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector

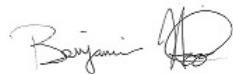

Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID D
HA Description Shock Joint
HA Type Miscellaneous Material
HA Location Boiler Room by interior door overhead.

Quantity 1 Unit(s)
Comments This material is damaged in the boiler room and needs to be repaired. If the material is not capable of being repaired it should be removed and replaced.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 5/2/2018

Material Assessment


Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact	Vibration	Air
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector 

Benjamin S. Hood

State IN
Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID E
HA Description Black Sink Insulation (Book store and teachers lounge)
HA Type Miscellaneous Material
HA Location Sink

Quantity Unquantified LF
Comments Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 5/2/2018

Material Assessment


Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector 

Benjamin S. Hood

State IN
Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID 04
HA Description Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 6328 SF
Comments This material was exposed to inspect in custodial closets by rooms 204 & 306 & the bookstore. Normal wear is shown.
Asbestos Known
Friable No
Original Inspection 6/1/1992
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition
Physical Contact	Vibration	Air
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building. (classrooms)

Quantity 5700 SF
Comments This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cateteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982. The cove base in the hallways was replaced in 2011.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building.

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact	Vibration	Air
Low/None	Low/None	Low/None

Planned Response Action O&M



Inspector _____
Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID C
HA Description Fire Doors
HA Type Miscellaneous Material
HA Location Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior

Quantity 3 Unit(s)
Comments Boiler/Mechanical Room fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed. Holes need to be sealed.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M



Inspector _____
Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID D
HA Description Shock Joint
HA Type Miscellaneous Material
HA Location Boiler Room by interior door overhead.

Quantity 1 Unit(s)
Comments This material is damaged in the boiler room and needs to be repaired. If the material is not capable of being repaired it should be removed and replaced.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M



Inspector _____
Dustin Hawkins

State IN
Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID E
HA Description Black Sink Insulation (Book store and teachers lounge)
HA Type Miscellaneous Material
HA Location Sink

Quantity Unquantified LF
Comments Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 10/18/2017


Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector 

Dustin Hawkins

State IN
Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID 04
HA Description Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 6328 SF
Comments This material was exposed to inspect in custodial closets by rooms 204 & 306 & the bookstore. Normal wear is shown.
Asbestos Known
Friable No
Original Inspection 6/1/1992
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Contact		Vibration	Air
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building. (classrooms)

Quantity 5700 SF
Comments This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cateteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982. The cove base in the hallways was replaced in 2011.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 4/13/2017

Material Assessment


Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building.

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Contact		Vibration	Air
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID C
HA Description Fire Doors
HA Type Miscellaneous Material
HA Location Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior

Quantity 3 Unit(s)
Comments Boiler/Mechanical Room fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed. Holes need to be sealed.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M



Inspector

Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID D
HA Description Shock Joint
HA Type Miscellaneous Material
HA Location Boiler Room by interior door overhead.

Quantity 1 Unit(s)
Comments This material is damaged in the boiler room and needs to be repaired. If the material is not capable of being repaired it should be removed and replaced.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition
Physical Contact	Low/None	Vibration Low/None
		Air Low/None

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID E
HA Description Black Sink Insulation (Book store and teachers lounge)
HA Type Miscellaneous Material
HA Location Sink

Quantity Unquantified LF
Comments Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 4/13/2017

Material Assessment


Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact	Vibration	Air
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector 

Jamie Hosier

State Indiana
Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID 04
HA Description Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 6328 SF
Comments This material was exposed to inspect in custodial closets by rooms 204 & 306 & the bookstore. Normal wear is shown.
Asbestos Known
Friable No
Original Inspection 6/1/1992
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M



Inspector _____
Dustin Hawkins

State IN
Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building. (classrooms)

Quantity 5700 SF
Comments This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cateteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982. The cove base in the hallways was replaced in 2011.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building.

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Contact		Vibration	Air
Low/None		Low/None	Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID C
HA Description Fire Doors
HA Type Miscellaneous Material
HA Location Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior

Quantity 3 Unit(s)
Comments Boiler/Mechanical Room fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed. Holes need to be sealed.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID D
HA Description Shock Joint
HA Type Miscellaneous Material
HA Location Boiler Room by interior door overhead.

Quantity 1 Unit(s)
Comments This material is damaged in the boiler room and needs to be repaired. If the material is not capable of being repaired it should be removed and replaced.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID E
HA Description Black Sink Insulation (Book store and teachers lounge)
HA Type Miscellaneous Material
HA Location Sink

Quantity Unquantified LF
Comments Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID 04
HA Description Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 6328 SF
Comments This material was exposed to inspect in custodial closets by rooms 204 & 306 & the bookstore. Normal wear is shown.
Asbestos Known
Friable No
Original Inspection 6/1/1992
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building. (classrooms)

Quantity 5700 SF
Comments This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cateteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982. The cove base in the hallways was replaced in 2011.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Contact		Vibration	Air
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building.

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID C
HA Description Fire Doors
HA Type Miscellaneous Material
HA Location Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior

Quantity 3 Unit(s)
Comments Boiler/Mechanical Room fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed. Holes need to be sealed.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID D
HA Description Shock Joint
HA Type Miscellaneous Material
HA Location Boiler Room by interior door overhead.

Quantity 1 Unit(s)
Comments This material is damaged in the boiler room and needs to be repaired. If the material is not capable of being repaired it should be removed and replaced.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 10/20/2015

Material Assessment


Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact	Vibration	Air
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector 
Benjamin S. Hood

State IN
Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID E
HA Description Black Sink Insulation (Book store and teachers lounge)
HA Type Miscellaneous Material
HA Location Sink

Quantity Unquantified LF
Comments Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Contact	Low/None	Vibration Low/None	Air Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout the building


Material Description

Mastic

Comments

This material was exposed to inspect in custodial closets by rooms 204 & 306 & the bookstore. Normal wear is shown.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 4/22/2015
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

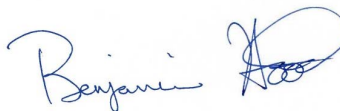

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF
Material Location Throughout the 1971 and 1982 portions of the building. (classrooms)


Material Description

Cove base

Comments

This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cafeteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982. The cove base in the hallways was replaced in 2011.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 4/22/2015
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

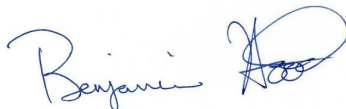

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF

Material Location

Throughout the 1971 and 1982 portions of the building.


Material Description

Cove base mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 4/22/2015
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

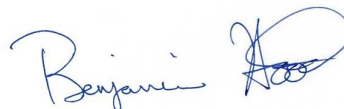

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 3 Each
Material Location Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior


Material Description

Fire Doors

Comments

Boiler/Mechanical Room fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/30/2010
Current Surveillance Date 4/22/2015
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

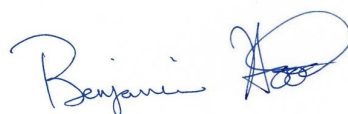

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# D
Type of Material Miscellaneous Material
Quantity of Material 1 Each

Material Location
Boiler Room by interior door overhead.

Material Description
Shock joint

Comments
This material is damaged in the boiler room and needs to be repaired. If the material is not capable of being repaired it should be removed and replaced.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 4/22/2015
Current Assessment Rating PD
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Sink

Material Description

Black Sink Insulation (Book store and teachers lounge)

Comments

Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 4/22/2015
Current Assessment Rating NA Not Applicable
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF
Material Location
Throughout the building


Material Description

Mastic

Comments

This material was exposed to inspect in custodial closets by rooms 204 & 306 & the bookstore. Normal wear is shown.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

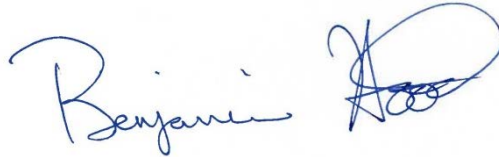

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF
Material Location Throughout the 1971 and 1982 portions of the building. (classrooms)


Material Description

Cove base

Comments

This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cafeteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982. The cove base in the hallways was replaced in 2011.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF

Material Location

Throughout the 1971 and 1982 portions of the building.


Material Description

Cove base mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

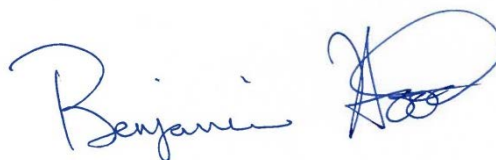

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 3 Each
Material Location Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior


Material Description

Fire Doors

Comments

Boiler/Mechanical Room fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/30/2010
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

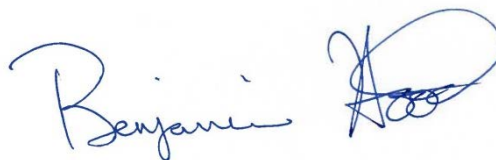

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# D
Type of Material Miscellaneous Material
Quantity of Material 1 Each

Material Location
Boiler Room by interior door overhead.

Material Description
Shock joint

Comments
This material is damaged in the boiler room and needs to be repaired. If the material is not capable of being repaired it should be removed and replaced.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/22/2014
Current Assessment Rating PD
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

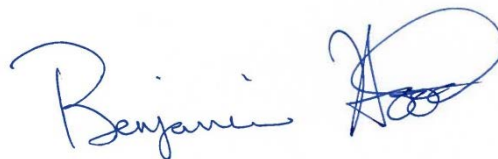

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Sink


Material Description

Black Sink Insulation (Book store and teachers lounge)

Comments

Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/22/2014
Current Assessment Rating NA Not Applicable
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

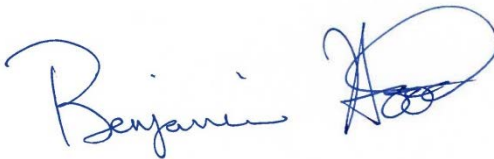

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout the building

Material Description

Mastic

Comments

This material was exposed to inspect in custodial closets by rooms 204 & 306 & the bookstore. Normal wear is shown.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 4/21/2014
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF
Material Location

Throughout the 1971 and 1982 portions of the building. (classrooms)

Material Description

Cove base

Comments

This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cafeteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982. The cove base in the hallways was replaced in 2011.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 4/21/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF

Material Location

Throughout the 1971 and 1982 portions of the building.

Material Description

Cove base mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 4/21/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 3 Each
Material Location Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior

Material Description

Fire Doors

Comments

Boiler/Mechanical Room fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/30/2010
Current Surveillance Date 4/21/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# D
Type of Material Miscellaneous Material
Quantity of Material 1 Each

Material Location
Boiler Room by interior door overhead.

Material Description
Shock joint

Comments
This material is damaged in the boiler room and needs to be repaired. If the material is not capable of being repaired it should be removed and replaced.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 4/21/2014
Current Assessment Rating PD
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Sink

Material Description

Black Sink Insulation (Book store and teachers lounge)

Comments

Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 4/21/2014
Current Assessment Rating NA Not Applicable
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout the building


Material Description
Mastic

Comments

This material was exposed to inspect in custodial closets by rooms 204 & 306 & the bookstore. Normal wear is shown.

Does Material Contain Asbestos? Yes
Is It Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF
Material Location
Throughout the 1971 and 1982 portions of the building. (classrooms)

Material Description


Cove base

Comments

This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cateteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982. The cove base in the hallways was replaced in 2011.

Does Material Contain Asbestos? Assumed
Is It Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

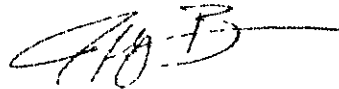

Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF

Material Location
Throughout the 1971 and 1982 portions of the building.

Material Description
Cove base mastic

Comments
This material was not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

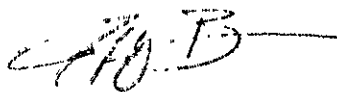

Inspector

Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 3 Each
Material Location
Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior


Material Description

Fire Doors

Comments

Boiler/Mechanical Room fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/30/2010
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

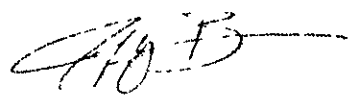

Inspector

Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# D
Type of Material Miscellaneous Material
Quantity of Material 1 Each


Material Location
Boiler Room by interior door overhead.

Material Description
Shock joint

Comments
This material was damaged at the time of inspection and needs to be replaced.
However, this material is not in a friable state.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/24/2013
Current Assessment Rating PD
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

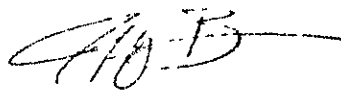

Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location Sink

Material Description


Black Sink Insulation (Book store and teachers lounge)

Comments

Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/24/2013
Current Assessment Rating NA Not Applicable
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

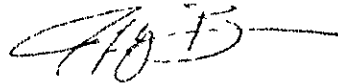

Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout the building

Material Description

Mastic

Comments

This material was exposed to inspect in custodial closets by rooms 204 & 306 & the bookstore. Normal wear is shown.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 10/24/2012
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF

Material Location

Throughout the 1971 and 1982 portions of the building. (classrooms)

Material Description

Cove base

Comments

This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cafeteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982. The cove base in the hallways was replaced in 2011.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/24/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF

Material Location
Throughout the 1971 and 1982 portions of the building.

Material Description
Cove base mastic

Comments
This material was not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/24/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 3 Each
Material Location
Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior

Material Description

Fire Doors

Comments

Boiler/Mechanical Room fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/30/2010
Current Surveillance Date 10/24/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# D
Type of Material Miscellaneous Material
Quantity of Material 1 Each

Material Location
Boiler Room by interior door overhead.


Material Description
Shock joint

Comments

Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/24/2012
Current Assessment Rating NA Not Applicable
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

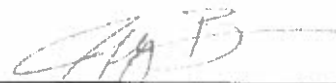

Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Sink

Material Description

Black Sink Insulation (Book store and teachers lounge)

Comments

Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/24/2012
Current Assessment Rating NA Not Applicable
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout the building


Material Description
Mastic

Comments

This material was exposed to inspect in custodial closets by rooms 204 & 306 & the bookstore. Normal wear is shown.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/25/2012
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

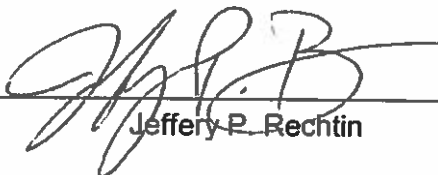

Jeffery P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF

Material Location

Throughout the 1971 and 1982 portions of the building. (classrooms)

Material Description

Cove base

Comments

This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cafeteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982. The cove base in the hallways was replaced in 2011.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/25/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Jeffery P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location

Throughout the 1971 and 1982 portions of the building.

Material Description

Cove base mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/25/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffery P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 3 Each
Material Location
Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior
Material Description
Fire Doors

Comments

Boiler/Mechanical Room fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/30/2010
Current Surveillance Date 6/25/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffery P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# D
Type of Material Miscellaneous Material
Quantity of Material 1 Each

Material Location
Boiler Room by interior door overhead.

Material Description
Shock joint

Comments

Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 6/25/2012
Current Assessment Rating NA Not Applicable
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Jeffery F. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF

Material Location
Sink

Material Description

Black Sink Insulation (Book store and teachers lounge)

Comments

Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 6/25/2012
Current Assessment Rating NA Not Applicable
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Jeffery P. Reehin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Middle\High School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF

Material Location
Custodial closets on (1st and 2nd Floor)

Material Description
Cove base (brownish color)

Comments

Most of this material was removed in the 2008 renovation in a non-friable manner. Old cove base was removed in the fish room in the agriculture department by the boiler room in December 2011. This room is now an activity room.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/15/2011
Current Assessment Rating NR Not Required
Cause of Damage Deterioration & Age
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Middle\High School
HA# 05
Type of Material Miscellaneous Material
Quantity of Material 18,283 SF

Material Location
Throughout the building

Material Description
Mastic (VAT)

Comments
No mastic was exposed to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/15/2011
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Middle\High School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF

Material Location
Throughout the building

Material Description
Cove base mastic

Comments

This material was not documented as being totally removed and is assumed to remain in place behind the new cove base. The visible cove base mastic in the activity room was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/15/2011
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Middle\High School
HA# D
Type of Material Miscellaneous Material
Quantity of Material 7 Each

Material Location
Activity Room and Boiler Room

Material Description
Fire Doors

Comments

Fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/30/2020
Current Surveillance Date 12/15/2011
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout the building

Material Description
Mastic

Comments
This material was not exposed to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/27/2011
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF

Material Location
Throughout the 1971 and 1982 portions of the building.

Material Description

Cove base

Comments

This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cafeteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/27/2011
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF

Material Location

Throughout the 1971 and 1982 portions of the building.

Material Description

Cove base mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/27/2011
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State

Indiana

Accreditation Number

19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 3 Each

Material Location
Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior

Material Description
Fire Doors

Comments

Boiler/Mechanical Room fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/30/2010
Current Surveillance Date 6/27/2011
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# D
Type of Material Miscellaneous Material
Quantity of Material 1 Each

Material Location
Boiler Room by interior door overhead.

Material Description
Shock joint

Comments

Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 6/27/2011
Current Assessment Rating NA Not Applicable
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF

Material Location
Sink

Material Description
Black Sink Insulation

Comments

Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 6/27/2011
Current Assessment Rating NA Not Applicable
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout the building

Material Description


Mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/6/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

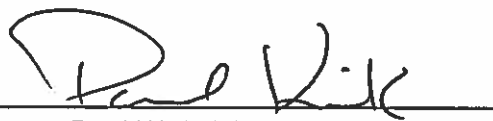
Paul W. Krick

State Indiana
Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF

Material Location

Throughout the 1971 and 1982 portions of the building.

Material Description

Cove base

Comments

This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cafeteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/6/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Paul W. Krick

State Indiana
Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF

Material Location

Throughout the 1971 and 1982 portions of the building.

Material Description


Cove base mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/6/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Paul W. Krick

State Indiana
Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 1 Each

Material Location
Boiler/Mechanical Room

Material Description
Fire Door

Comments

Boiler/Mechanical Room fire door was not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/30/2010
Current Surveillance Date 12/6/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Paul W. Krick

State Indiana
Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF
Material Location Throughout the building
Material Description Mastic
Comments This material was not exposed to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/4/2009
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF
Material Location

Throughout the building

Material Description


Cove base

Comments

This material shows signs of minor scrapes and chips but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/4/2009
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

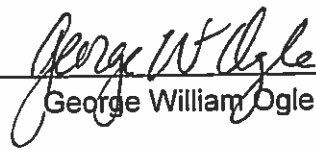
George William Ogle


State

Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name	Greater Clark County Schools	
Building Name	New Washington Elementary School	
HA#	B	
Type of Material	Miscellaneous Material	
Quantity of Material	Unquantified LF	
Material Location	Throughout the building	
Material Description	Cove base mastic	
Comments	This material was not visible to inspect.	
Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	5/31/1995	
Current Surveillance Date	12/4/2009	
Current Assessment Rating	NR	Not Required
Cause of Damage	No Damage	
Accessible	No	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	
Inspector	 George William Ogle	
State	Indiana	
Accreditation Number	191003027	

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF
Material Location

Throughout the building

Material Description

Cove base

Comments

This material shows signs of minor scrapes and chips but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/11/2009
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

IN

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location

Throughout the building

Material Description


Cove base mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/11/2009
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

IN

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF
Material Location
Throughout the building
Material Description
Mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/11/2009
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector _____
George W Ogle
George William Ogle

State IN
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout the building

Material Description
Mastic

Comments
This material was not exposed to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/10/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF

Material Location
Throughout the building

Material Description

Cove base

Comments

This material shows signs of minor scrapes and chips missing, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/10/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF

Material Location
Throughout the building

Material Description
Cove base mastic

Comments
This material was not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/10/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout the building

Material Description
Mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/30/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF

Material Location
Throughout the building

Material Description
Cove base

Comments

This material shows signs of minor scrapes and chips missing, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/30/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF

Material Location
Throughout the building

Material Description
Cove base mastic

Comments
This material was not visible to inspect.

Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	5/31/1995	
Current Surveillance Date	6/30/2008	
Current Assessment Rating	NR	Not Required
Cause of Damage	No Damage	
Accessible	No	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Middle\High School
HA# 05
Type of Material Miscellaneous Material
Quantity of Material 18,283 SF

Material Location
Throughout the building


Material Description
Mastic (VAT)

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	6/1/1992	
Current Surveillance Date	6/30/2008	
Current Assessment Rating	NR	Not Required
Cause of Damage	No Damage	
Accessible	No	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	

Inspector


George William Ogle

State

Indiana


Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

.EA Name Greater Clark County Schools
Building Name New Washington Middle/High School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location
Throughout the building (except band room, choir room, and auditorium)
Material Description
Cove base
Comments
This material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/30/2008
Current Assessment Rating NR Not Required
Cause of Damage Deterioration & Age
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

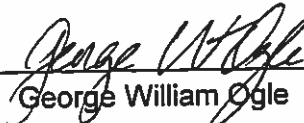
George William Ogle

State

Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Middle\High School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF


Material Location
Throughout the building

Material Description
Cove base mastic

Comments
This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/30/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

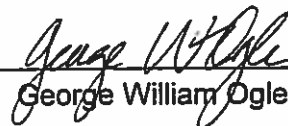
George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Middle\High School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 2 Each

Material Location
Wrestling storage room

Material Description
Ductwork flex connectors

Comments

The two in the wrestling storage room are a black vinyl type and are not in poor condition. The four in the gymnasium were removed nonfriable when the overhead units were removed intact. This location will be removed from the Management Plan.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 7/19/2005
Current Surveillance Date 6/30/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout the building

Material Description
Mastic

Comments
This material was not exposed to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/7/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF
Material Location

Throughout the building

Material Description

Cove base

Comments

This material shows signs of minor scrapes and chips missing, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/7/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not visible to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/7/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State


Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF
Material Location
Throughout the building
Material Description
Mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/19/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector _____

George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF

Material Location
Throughout the building

Material Description
Cove base

Comments
This material shows signs of minor scrapes and chips missing, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/19/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not visible to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/19/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout the building

Material Description

Mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/28/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christopher Ames

State Indiana
Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF

Material Location
Throughout the building

Material Description
Cove base

Comments

This material shows signs of minor scrapes and chips missing, but was not in poor condition overall. The missing sections have been replaced.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/28/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christopher Ames

State Indiana
Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not visible to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/28/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector _____
Christopher Ames

State Indiana
Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Middle\High School
HA# 05
Type of Material Miscellaneous Material
Quantity of Material 18,283 SF
Material Location
Throughout the building
Material Description
Mastic (VAT)
Comments
No mastic was exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/28/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector _____

Christopher Ames

State Indiana
Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Middle\High School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location
Throughout the building (except band room, choir room, and auditorium)
Material Description
Cove base
Comments
This material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/28/2006
Current Assessment Rating NR Not Required
Cause of Damage Deterioration & Age
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector _____
Christopher Ames

State Indiana
Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Middle\High School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF

Material Location
Throughout the building

Material Description
Cove base mastic

Comments
This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/28/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christopher Ames

State Indiana
Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Middle\High School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 6 Each

Material Location
Overhead in gymnasiums (2 Each) and wrestling storage room

Material Description
Ductwork flex connectors

Comments

The material is not in poor condition. The two in the wrestling storage room are a black vinyl type, while the four in the gymnasium are so high it's not possible to tell what type of material they are.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 7/19/2005
Current Surveillance Date 6/28/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christopher Ames

State Indiana
Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout the building

Material Description

Mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 1/24/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF

Material Location
Throughout the building

Material Description
Cove base

Comments

This material shows signs of minor scrapes and chips missing, but was not in poor condition overall. The missing sections have been replaced.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 1/24/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 1/24/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



George William Ogle

State

Indiana

Accreditation Number

191523030

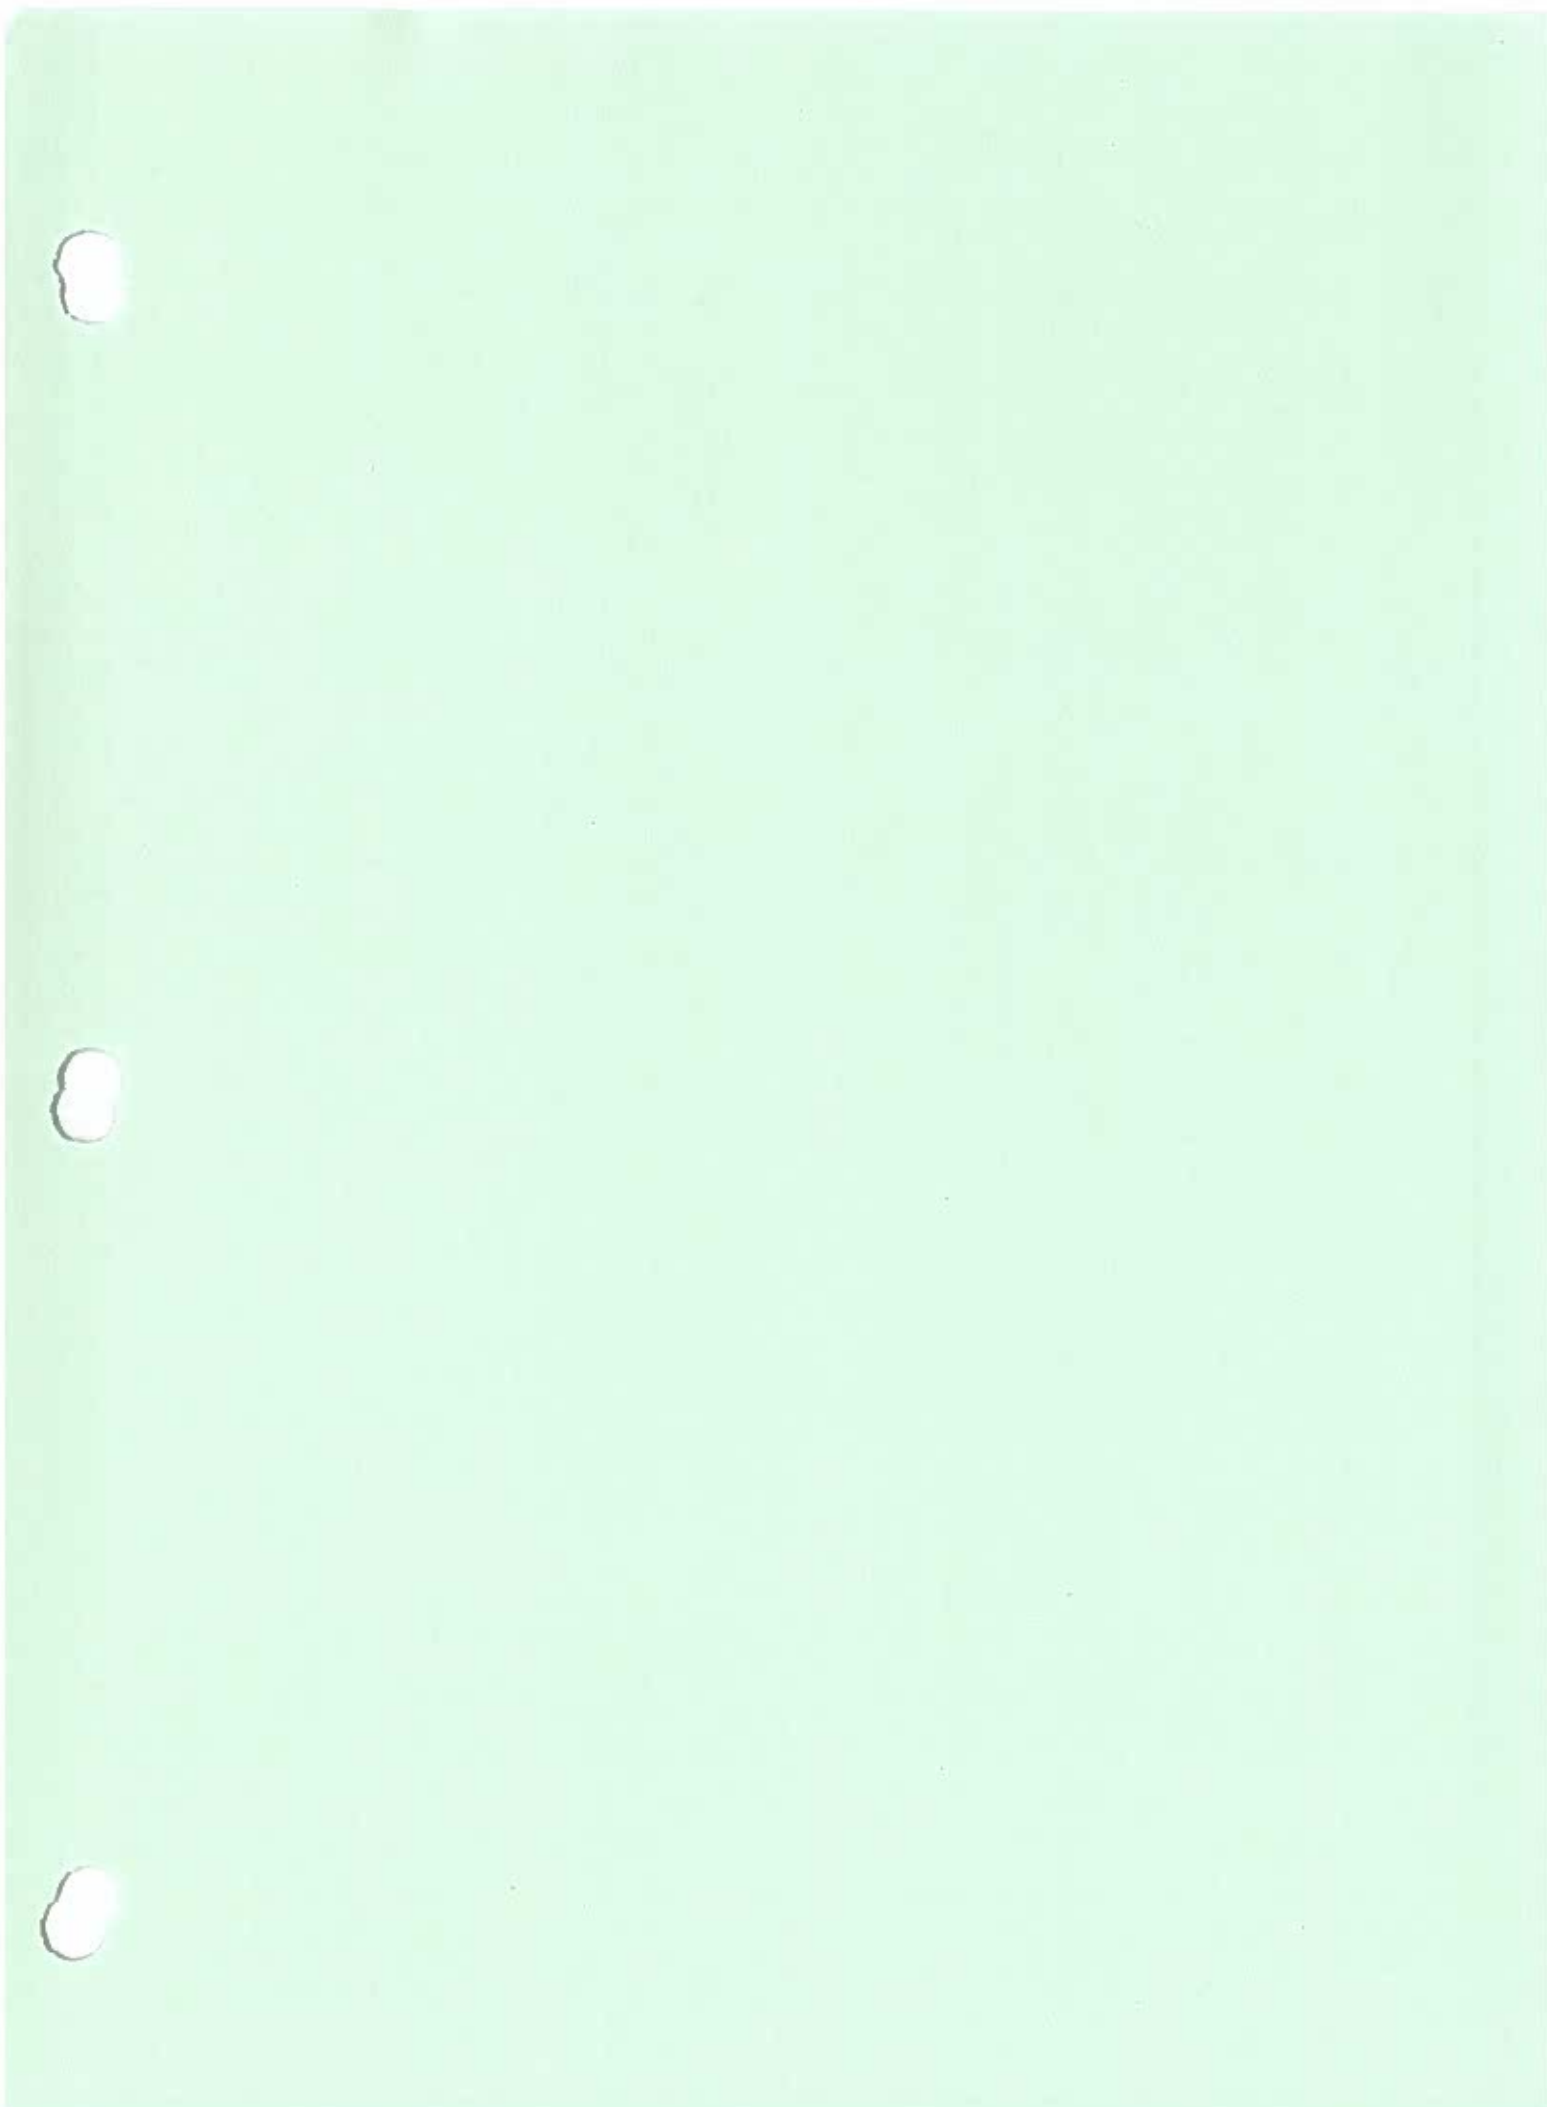

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF


Material Location
Throughout the building

Material Description
Mastic

Comments
This material was not exposed to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 7/19/2005
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF


Material Location
Throughout the building

Material Description
Cove base

Comments
This material shows signs of minor scrapes and chips missing, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 7/19/2005
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
Where visible, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 7/19/2005
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



George William Ogle

State

Indiana

Accreditation Number

191523030

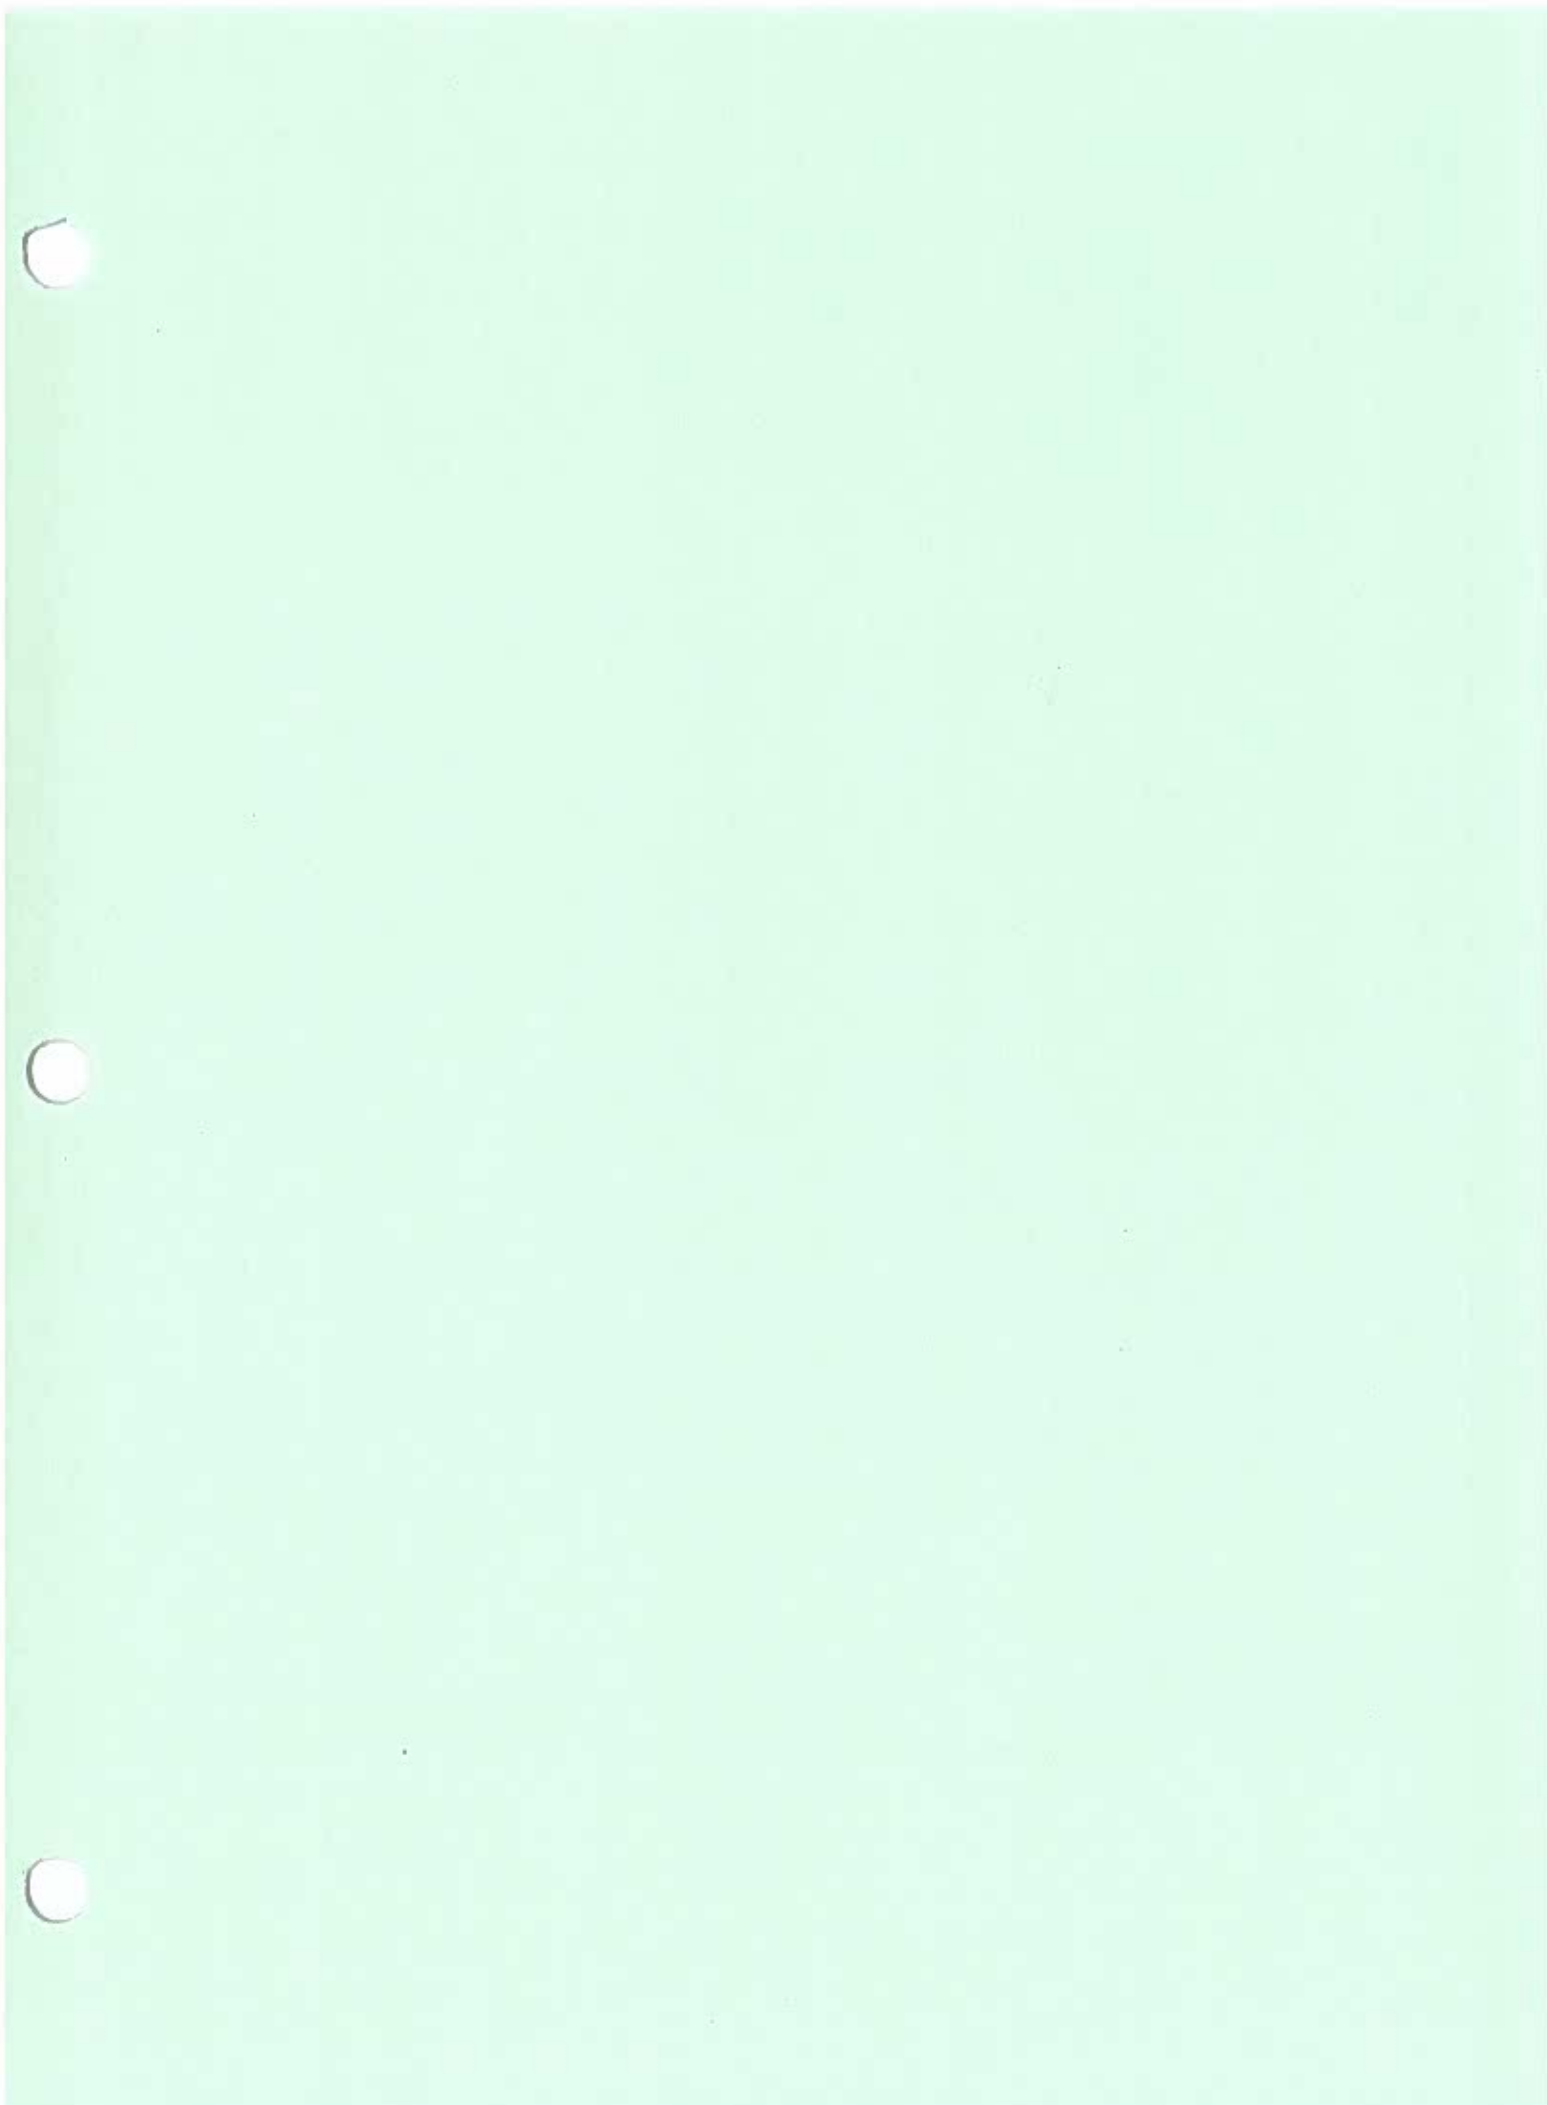

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout the building

Material Description
Mastic

Comments
This material was not exposed to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/8/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF

Material Location
Throughout the building

Material Description
Cove base

Comments
This material shows signs of minor scrapes, but was not in poor condition overall. There is one piece missing in the storage shed in the gymnasium.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/8/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF


Material Location
Throughout the building

Material Description
Cove base mastic

Comments
Where visible, this material was not in poor condition.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/8/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

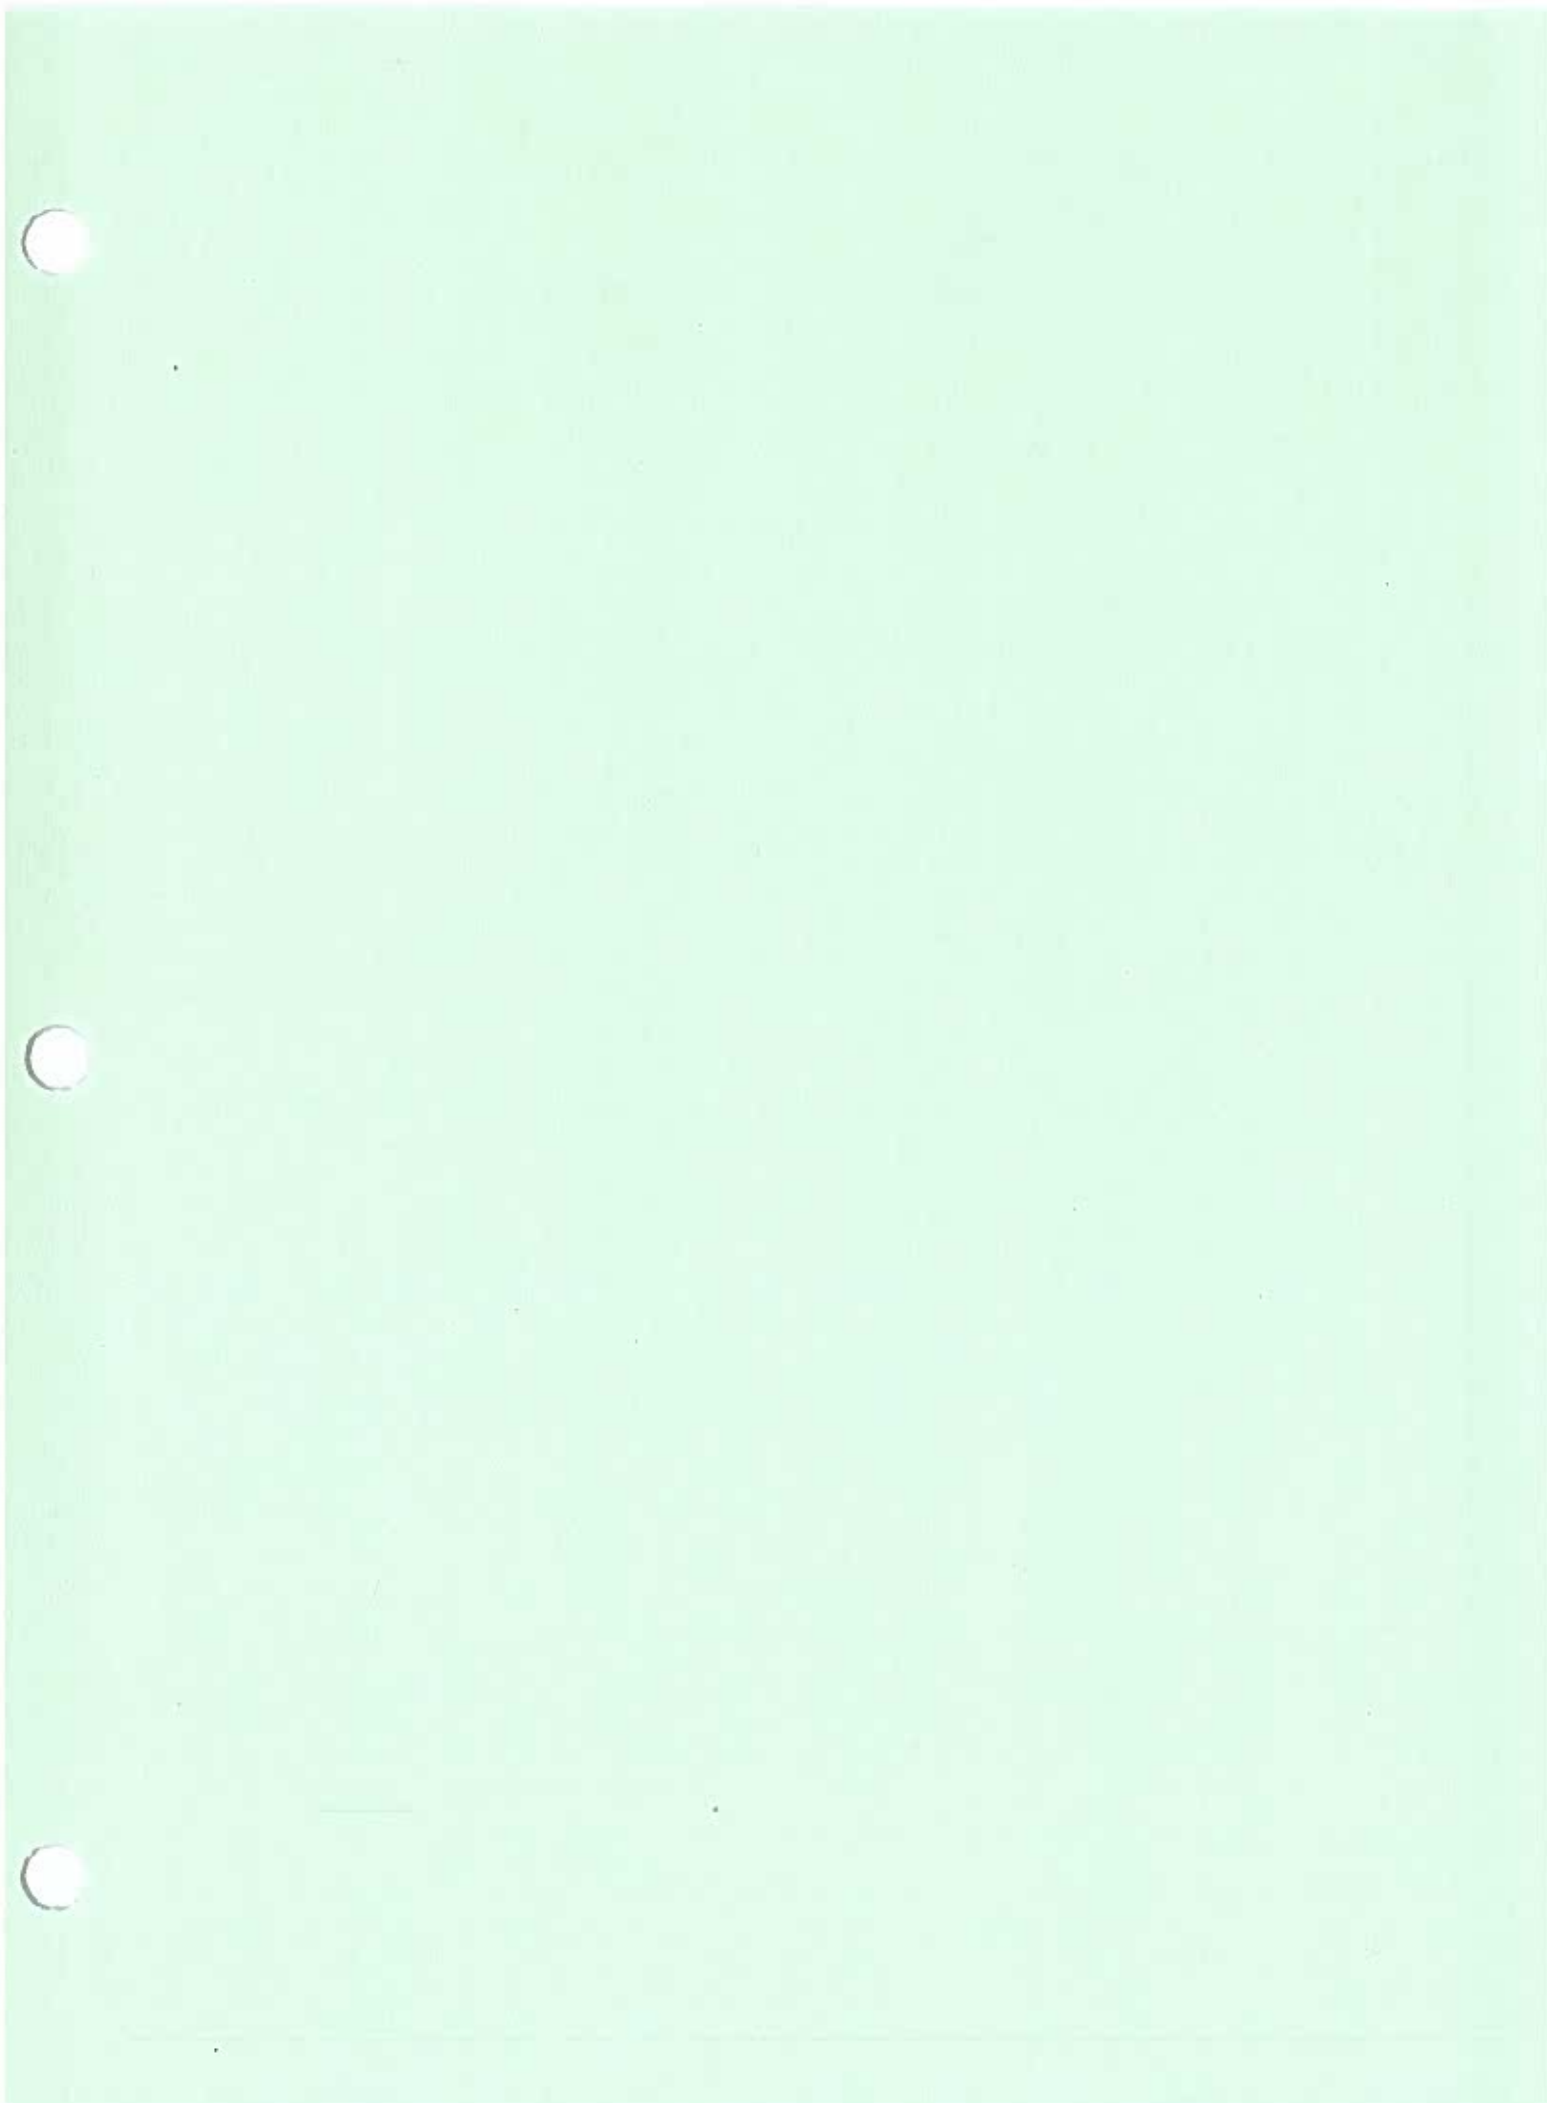

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout the building

Material Description
Mastic

Comments
This material was not exposed to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/08/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF

Material Location
Throughout the building

Material Description
Cove base

Comments

This material shows signs of minor scrapes, but was not in poor condition overall. There is one piece missing in the storage shed in the gymnasium.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/08/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF

Material Location
Throughout the building

Material Description
Cove base mastic

Comments
Where visible, this material was not in poor condition.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/08/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

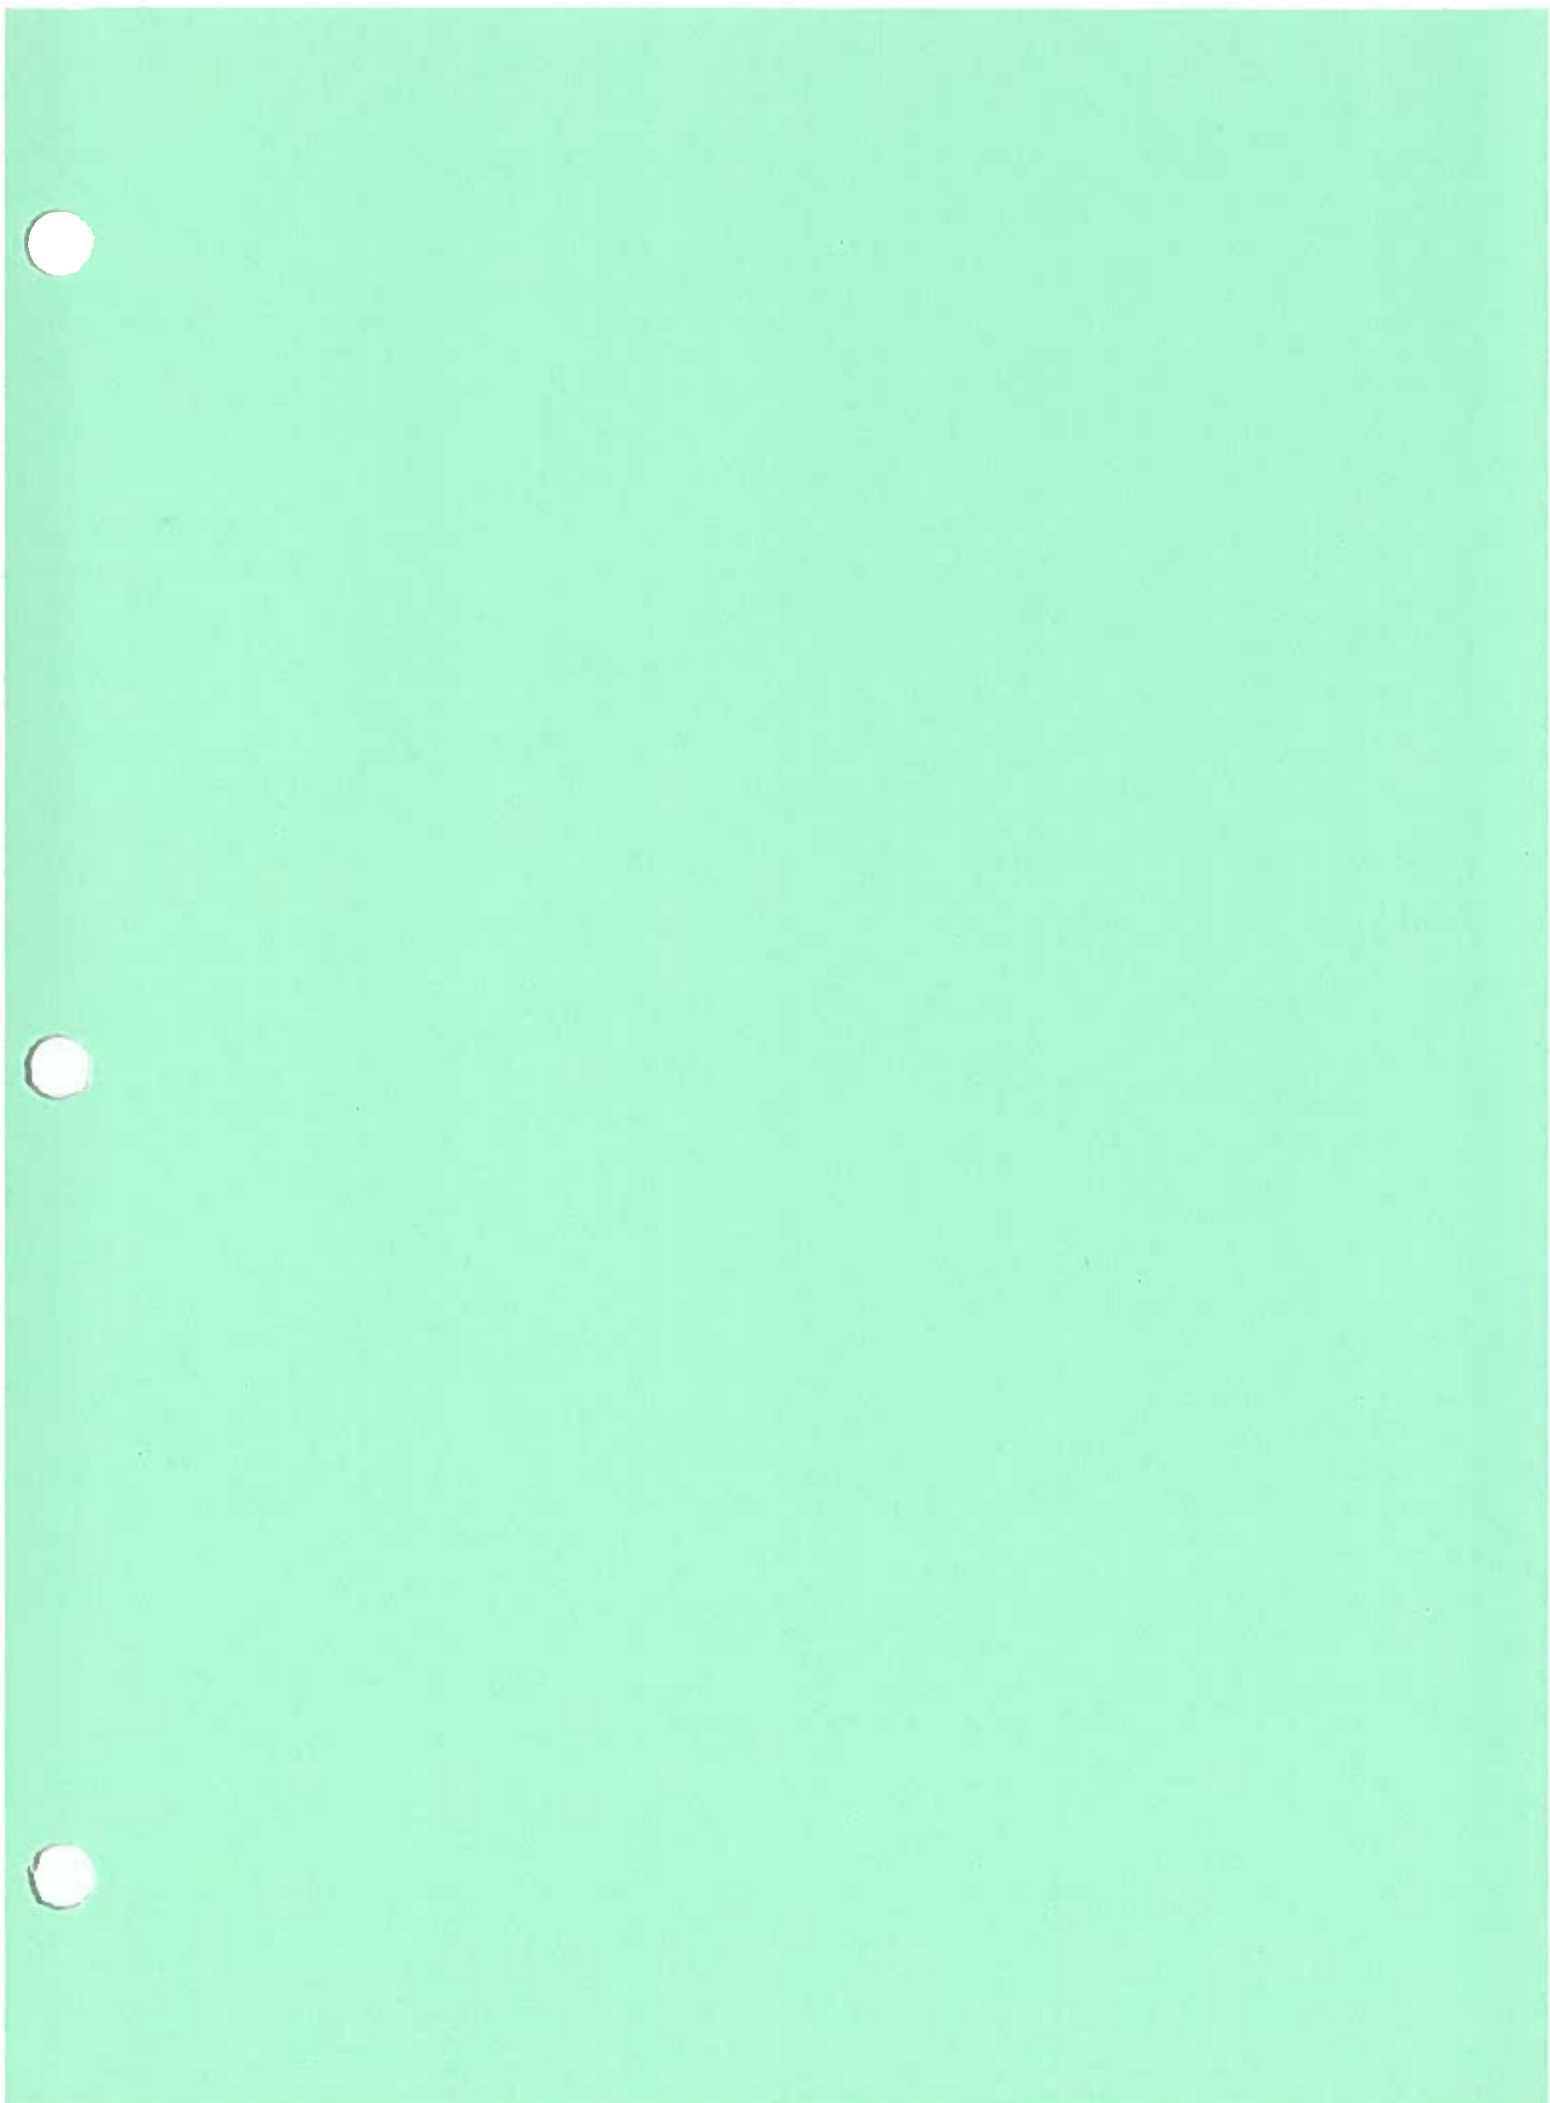

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF


Material Location
Throughout the building

Material Description
Mastic

Comments
This material was not exposed to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/13/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

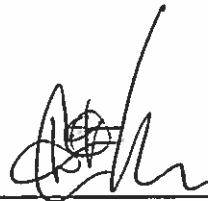

Christian Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF

Material Location
Throughout the building

Material Description
Cove base

Comments

This material shows signs of minor scrapes, but was not in poor condition overall. There is one piece missing in the storage shed in the gymnasium.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/13/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF


Material Location
Throughout the building

Material Description
Cove base mastic

Comments
Where visible, this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/13/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout the building

Material Description
Mastic

Comments
This material was not exposed to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/18/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF

Material Location
Throughout the building

Material Description
Cove base

Comments

This material shows signs of minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/18/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF

Material Location
Throughout the building

Material Description
Cove base mastic

Comments
This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/18/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF
Material Location
Throughout the building
Material Description
Mastic
Comments
No mastic was exposed to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/18/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M
Inspector

Richard D. Calvert
State Indiana
Accreditation Number 315989970

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF
Material Location
Throughout the building
Material Description
Cove base
Comments
Material is not in poor condition with minor scraping observed.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/18/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

Richard D. Calvert

State Indiana
Accreditation Number 315989970

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
Material is not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/18/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M
Inspector

Richard D. Calvert
State Indiana
Accreditation Number 315989970



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF
Material Location
Throughout the building
Material Description
Mastic
Comments
No mastic was exposed to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/11/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M
Inspector 
Stephen Kimbrough
State Indiana
Accreditation Number 191914122

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF

Material Location
Throughout the building

Material Description
Cove base

Comments
Material is not in poor condition with minor scraping observed.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/11/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector




Stephen Kimbrough

State Indiana
Accreditation Number 191914122

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
Material is not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/11/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M
Inspector 
Stephen Kimbrough
State Indiana
Accreditation Number 191914122

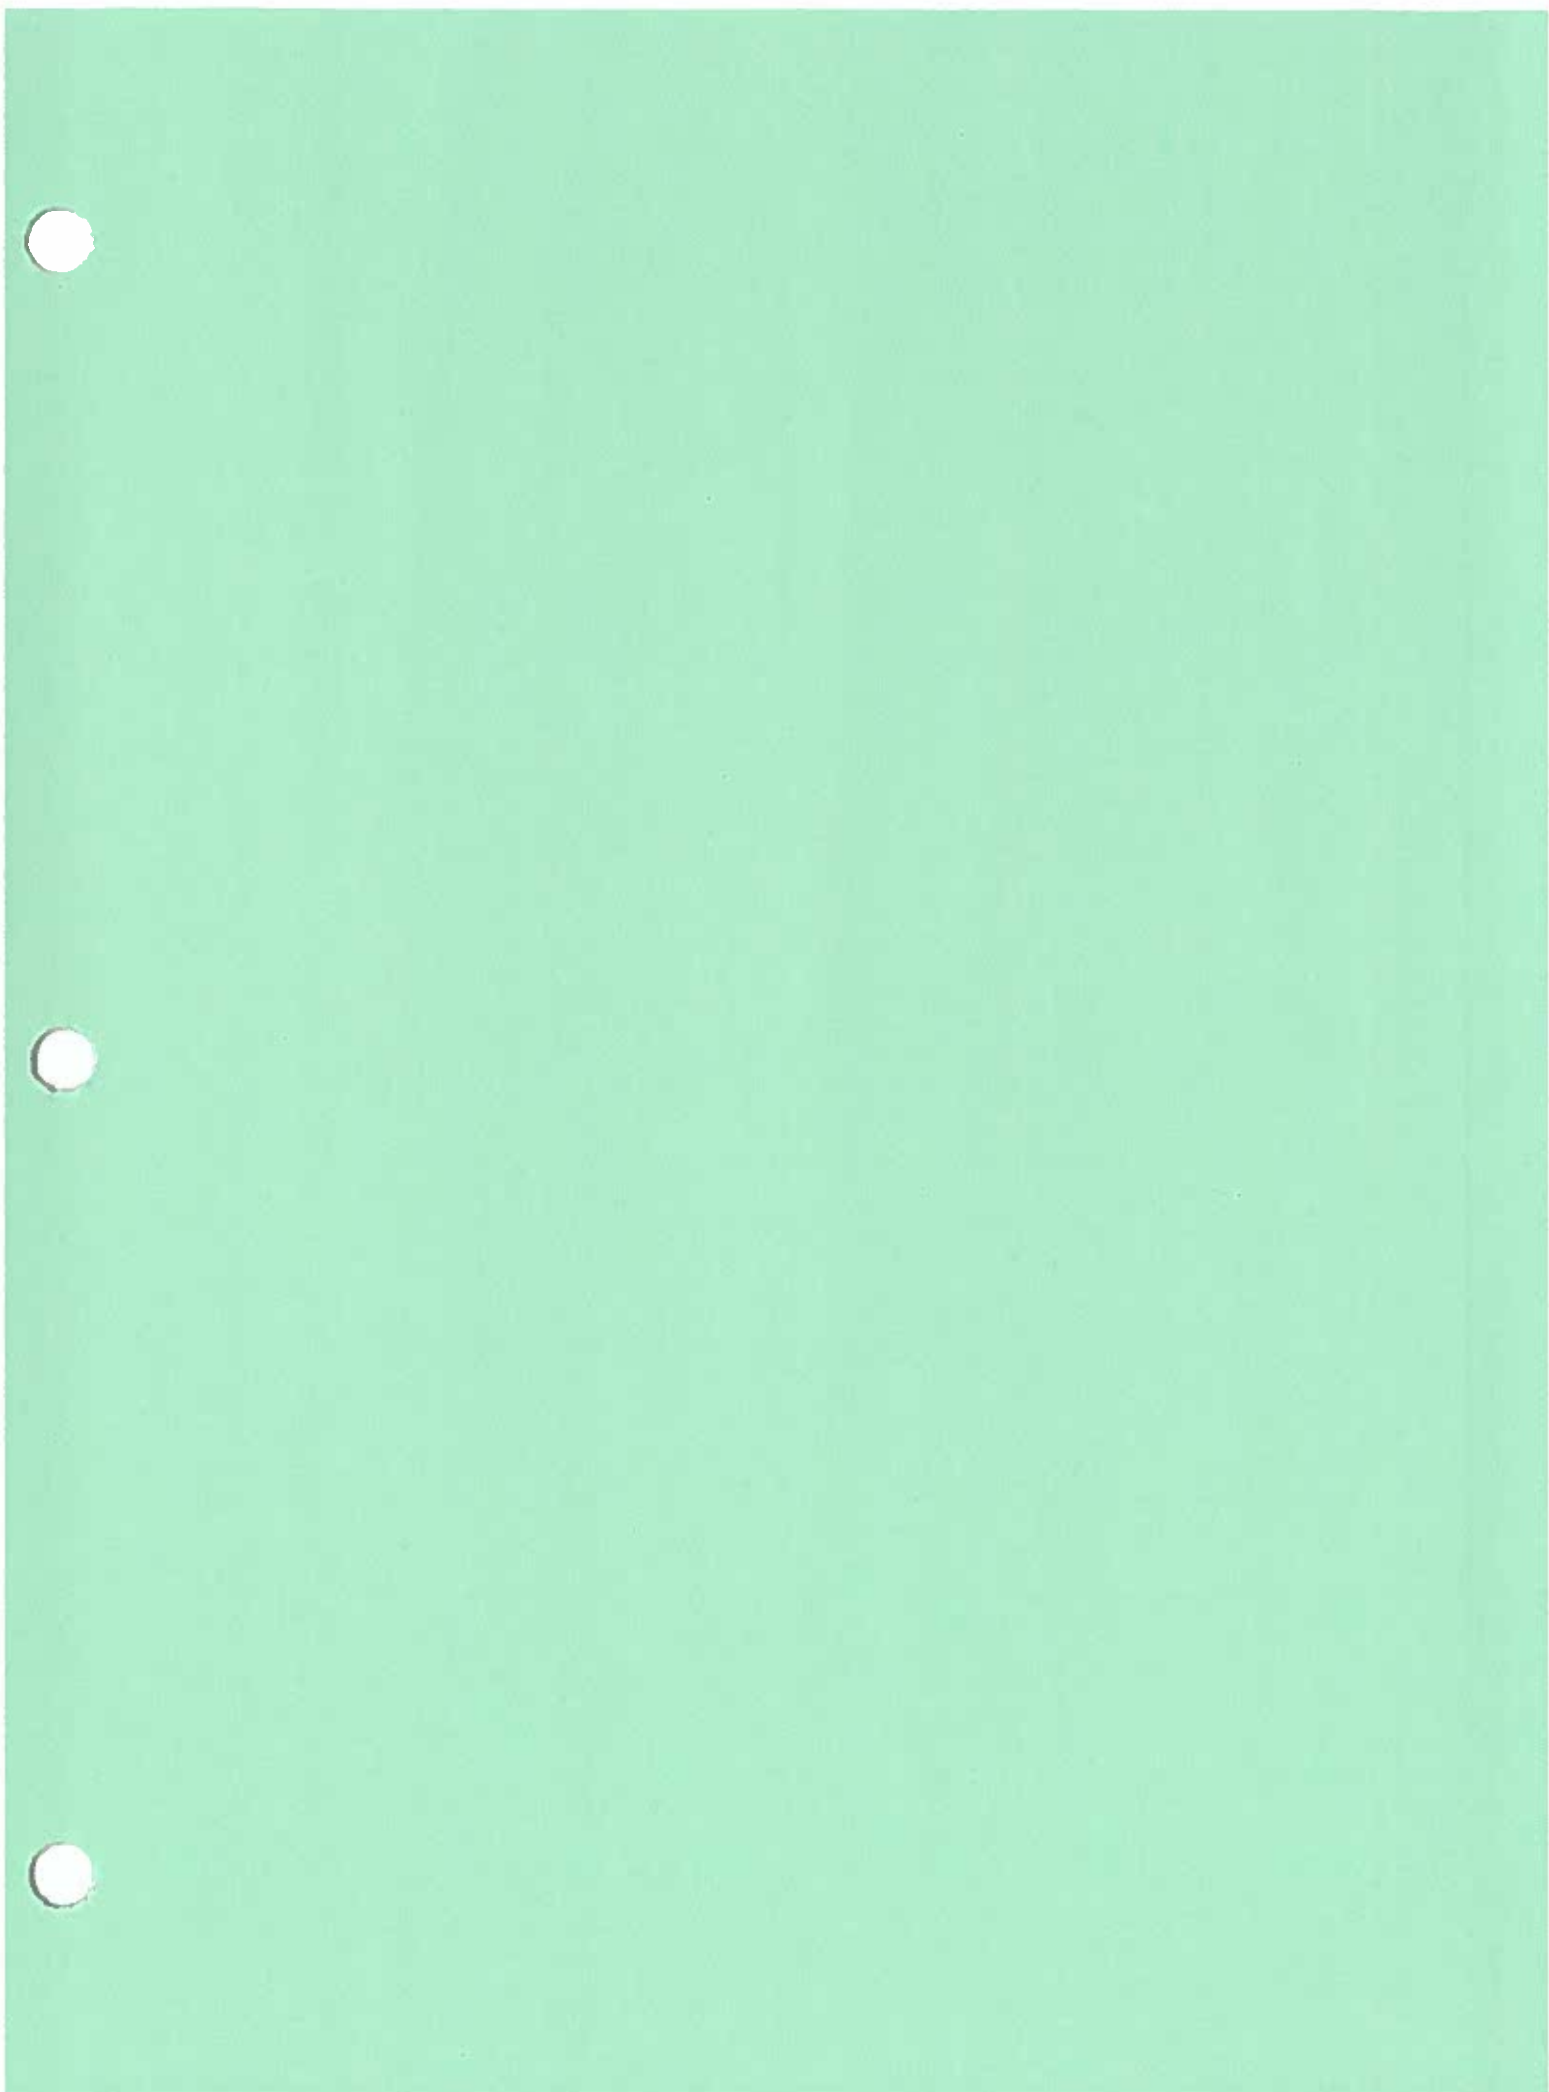

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF
Material Location
Throughout the building
Material Description
Mastic
Comments
No mastic was exposed to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 01/11/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

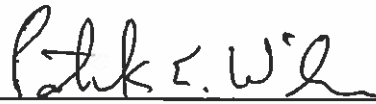


Patrick E. Wilson

State Indiana
Accreditation Number 190824065

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF
Material Location
Throughout the building
Material Description
Cove base
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 01/11/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Patrick E. Wilson

State Indiana
Accreditation Number 190824065

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
Material is not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 01/11/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector 
Patrick E. Wilson

State Indiana
Accreditation Number 190824065



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout building

Material Description
Mastic

Comments
Mastic is exposed where 3 tiles are broken outside boy's locker room.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/29/2000
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name	Greater Clark County Schools	
Building Name	New Washington Elementary School	
HA#	A	
Type of Material	Miscellaneous Material	
Quantity of Material	Unquantified LF	
Material Location	Throughout building	
Material Description	Cove Base	
Comments	Material is in good condition.	
Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	05/31/1995	
Current Surveillance Date	06/29/2000	
Current Assessment Rating	NR	Not Required
Cause of Damage	No Damage	
Accessible	Yes	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	
Inspector	 George William Ogle	
State	Indiana	
Accreditation Number	191523030	

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout building
Material Description
Cove Base Mastic
Comments
Material is not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/29/2000
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector _____

George William Ogle

State Indiana
Accreditation Number 191523030



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6328 SF

Material Location
Throughout building


Material Description
Mastic

Comments

Material is exposed by the exit to the locker room off the gymnasium. It is in good condition where exposed. Tile is negative.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

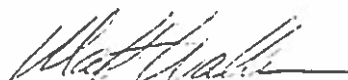

Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout building
Material Description
Cove Base
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF


Material Location
Throughout building

Material Description
Cove Base Mastic

Comments
Material is not exposed and is assumed to be in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

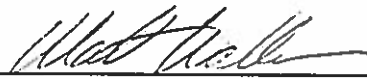

Matthew Wallace

State Indiana
Accreditation Number 191219020



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6328 SF
Material Location
Throughout building
Material Description
Mastic
Comments
Tile is negative.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M
Inspector

Matthew Wallace
State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout building
Material Description
Cove Base
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M
Inspector 
Matthew Wallace
State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF


Material Location
Throughout building

Material Description
Cove Base Mastic

Comments
Material is not exposed and is assumed to be in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

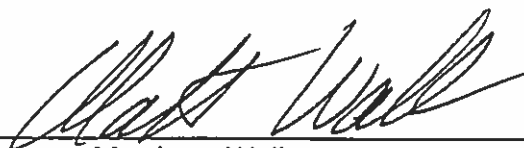

Matthew Wallace


State Indiana
Accreditation Number 191219020



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6328 SF
Material Location Throughout building
Material Description Mastic
Comments Tile is negative.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/29/1998
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

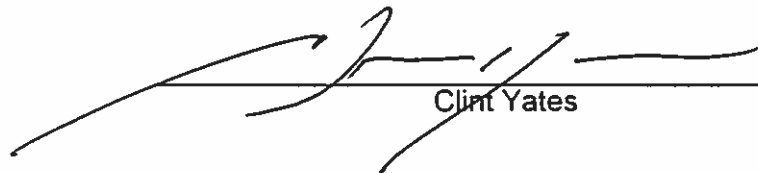


Clint Yates

State Indiana
Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location Throughout building
Material Description Cove Base
Comments Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/29/1998
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

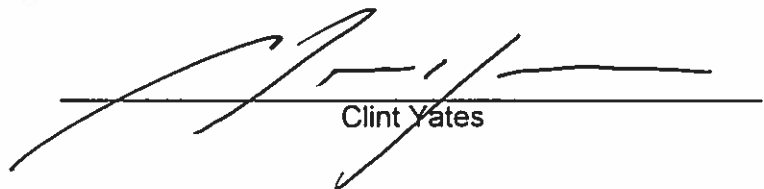

Clint Yates

State Indiana
Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout building

Material Description
Cove Base Mastic

Comments
Material is not exposed and is assumed to be in good condition.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/29/1998
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

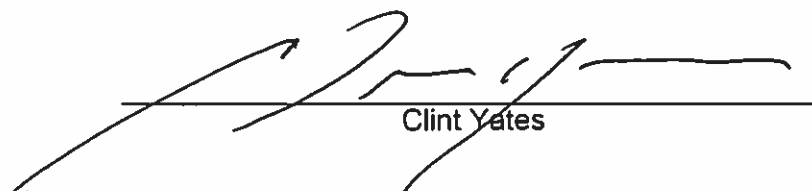

Clint Yates

State Indiana
Accreditation Number 193804035

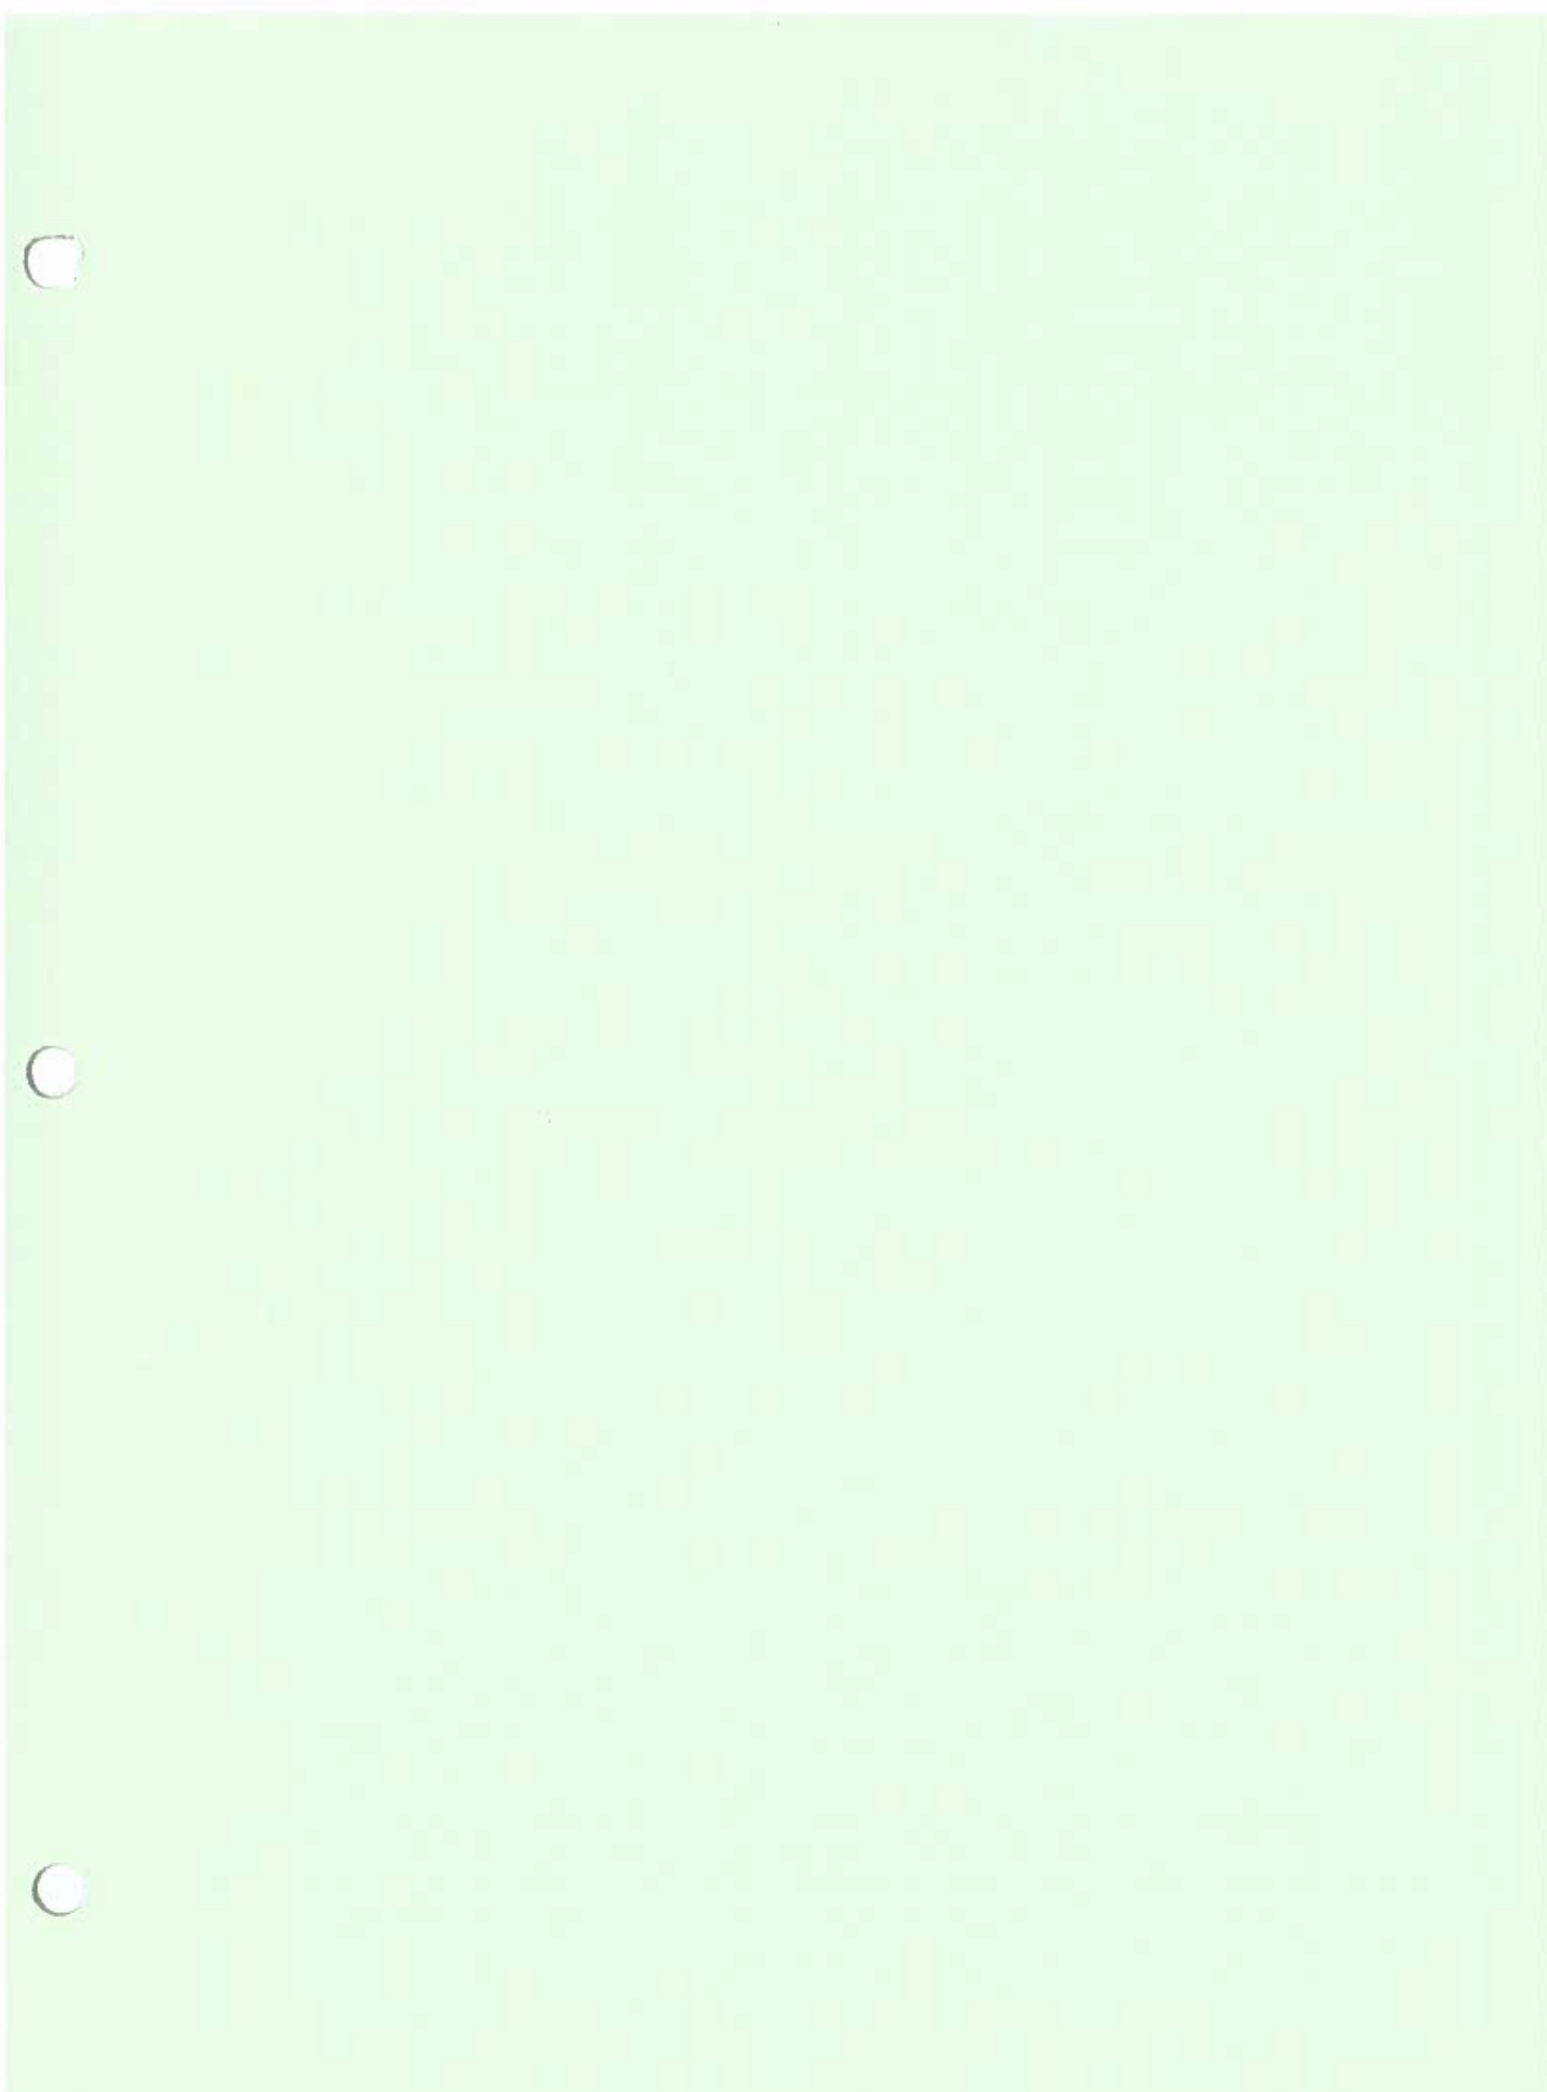

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF


Material Location
Throughout building

Material Description
Mastic

Comments
Minor water damage is present in the cafeteria. Tile is negative.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 1/15/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

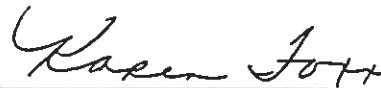


Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout building
Material Description
Cove Base
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 1/15/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

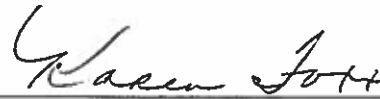

Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material LF

Material Location
Throughout building

Material Description
Cove Base Mastic

Comments

Material is not exposed and is assumed to be in good condition.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 1/15/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

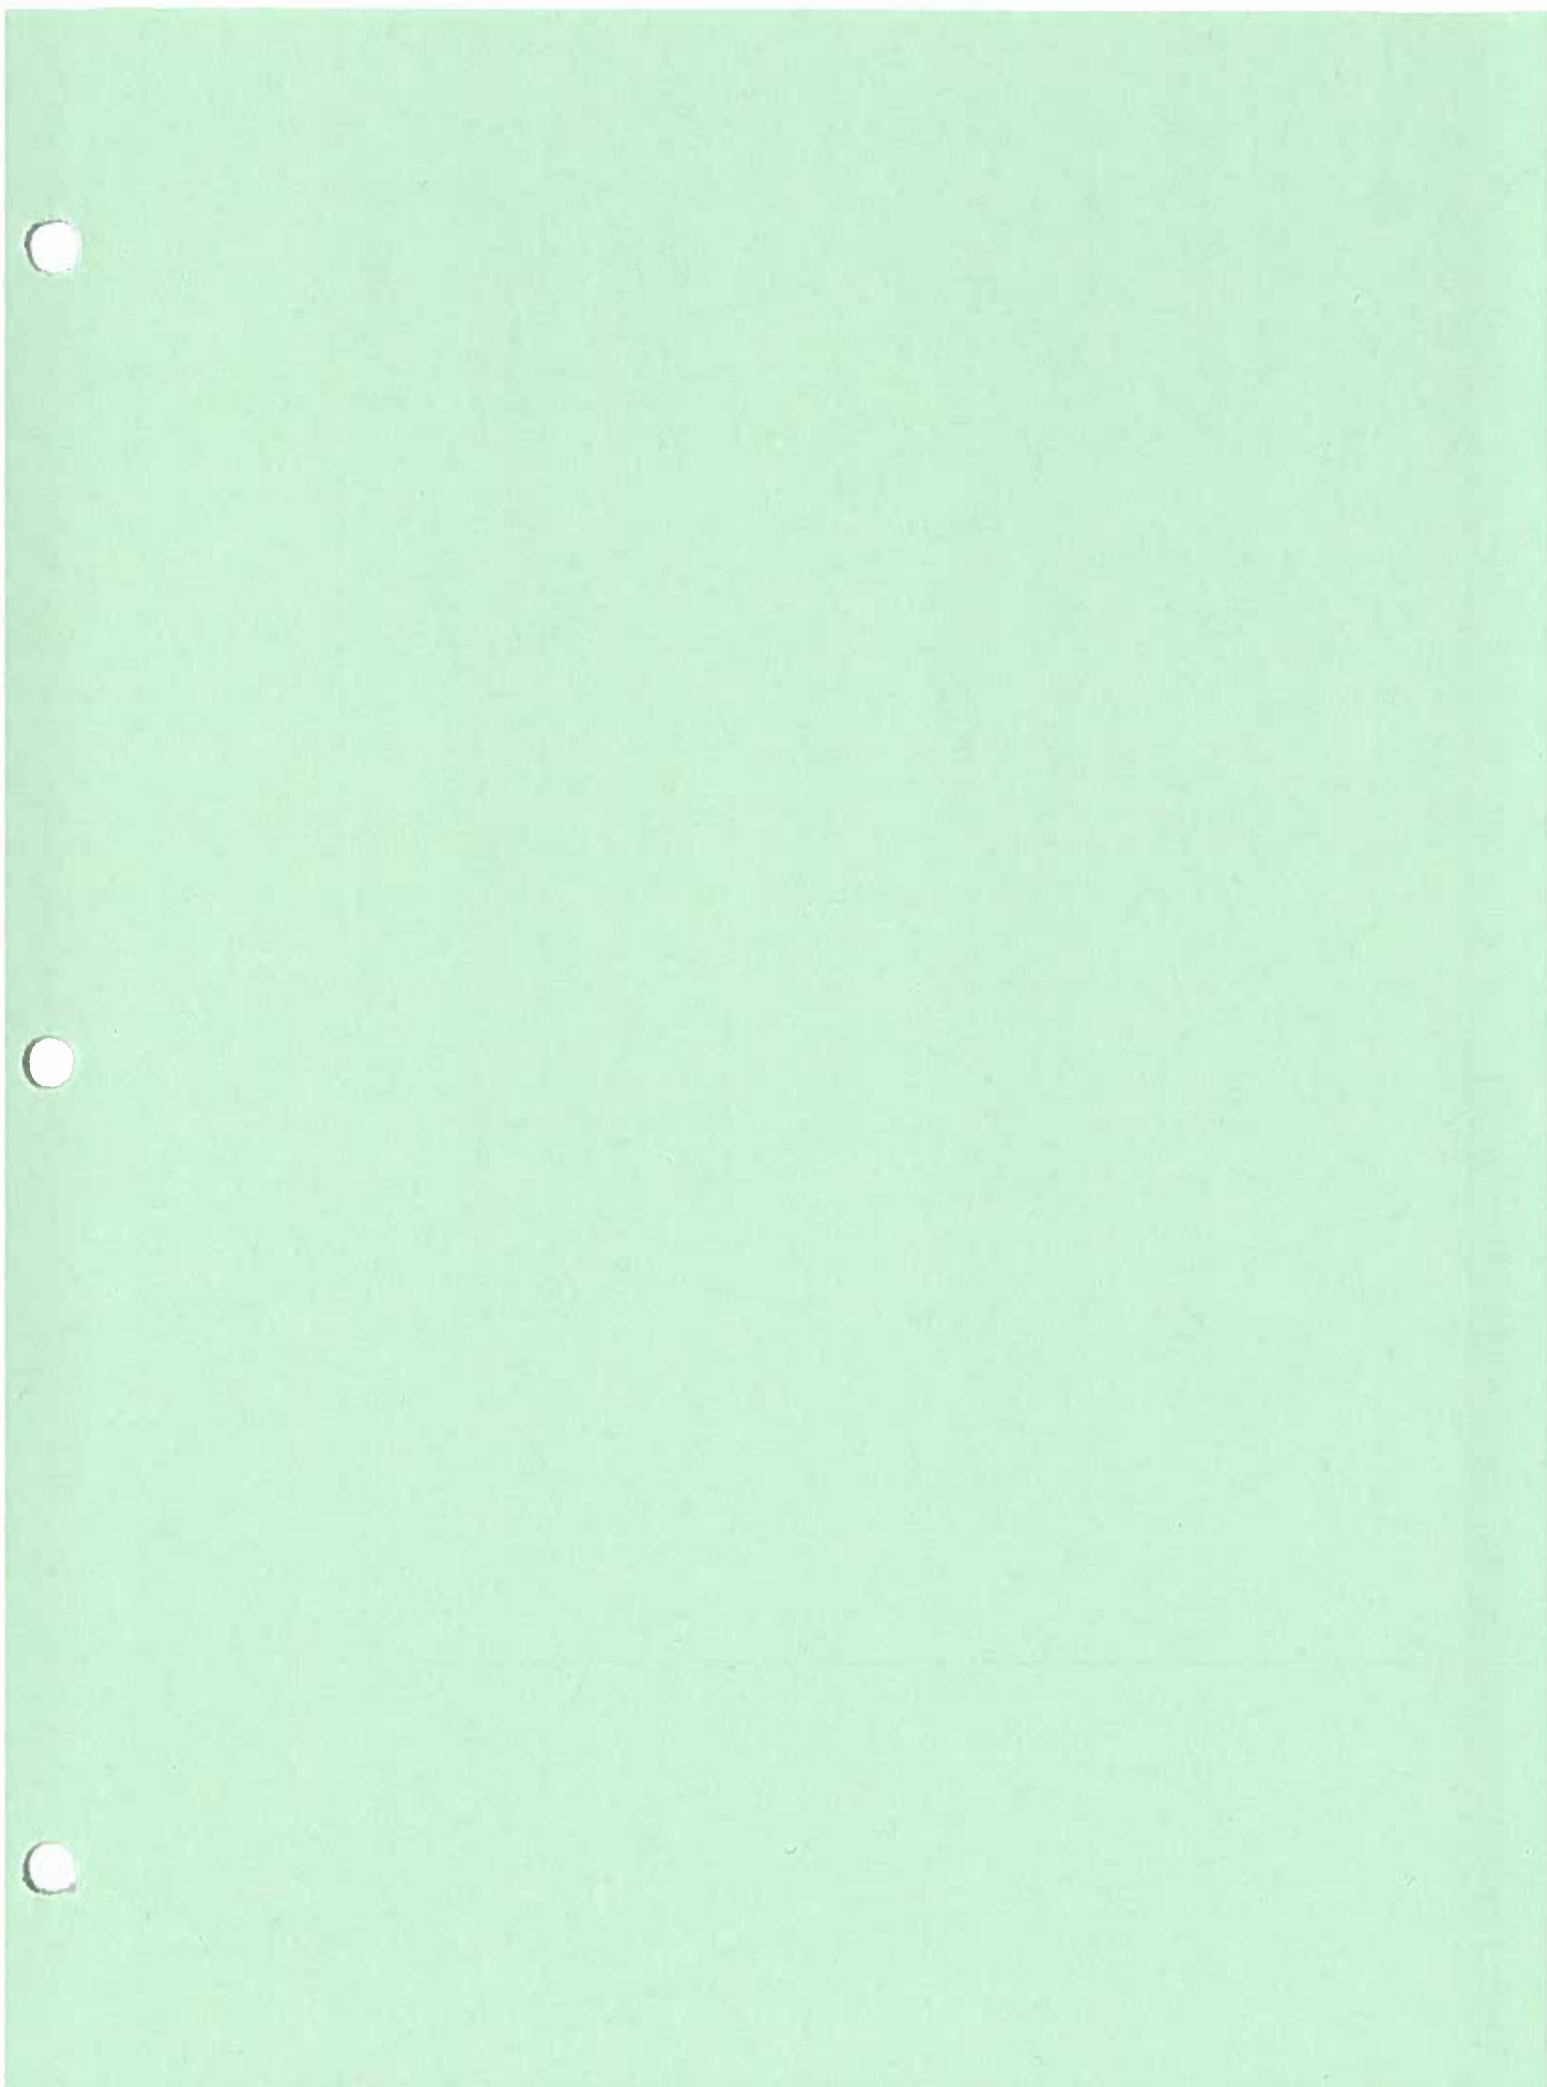

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 4
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout building

Material Description
Mastic

Comments

Minor water damage is present in the cafeteria. Tile is negative.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 7/ 1/97
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout building
Material Description
Cove Base
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 7/ 1/97
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material LF

Material Location
Throughout building

Material Description
Cove Base Mastic

Comments
Material is not exposed and is assumed to be in good condition.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 7/ 1/97
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

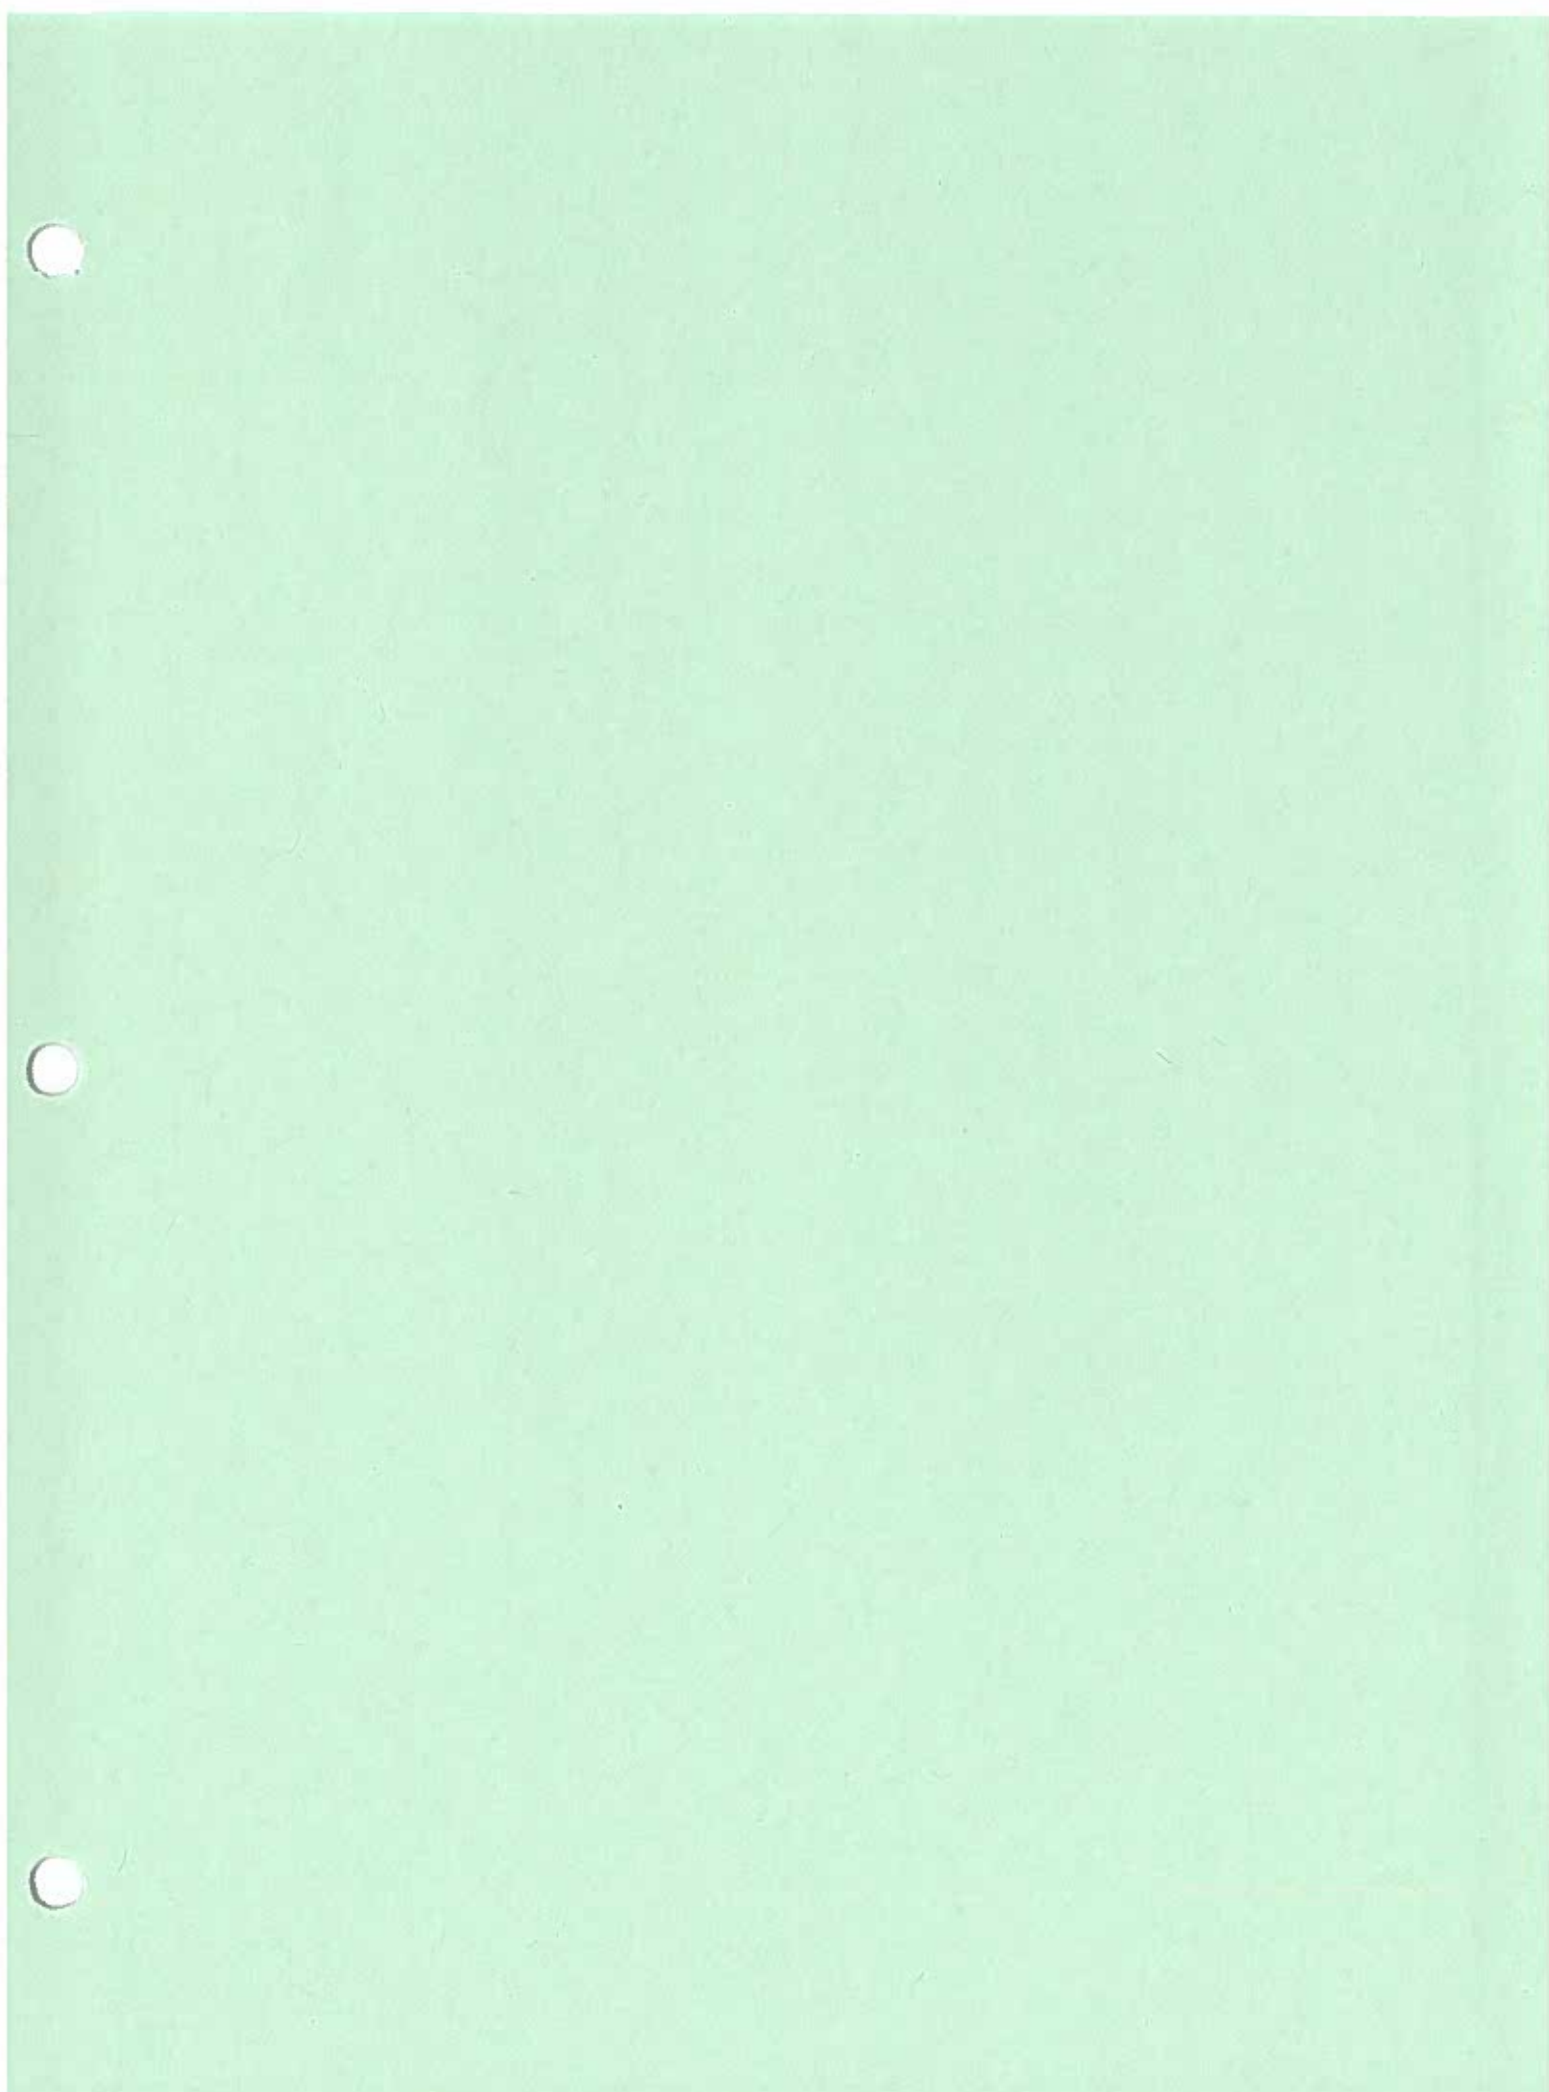

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 4
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF
Material Location
Throughout building
Material Description
Mastic
Comments
Material is in good condition. Tile is negative. No change.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Clint Yates

State Indiana
Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material LF

Material Location
Throughout building


Material Description
Cove Base

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

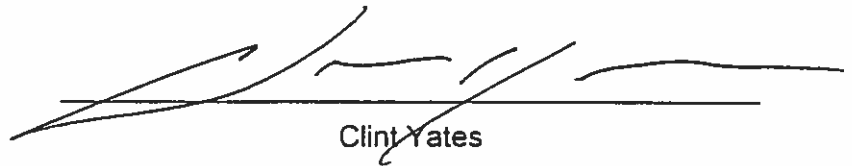

Clint Yates

State Indiana
Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material LF

Material Location
Throughout building


Material Description
Cove Base Mastic

Comments


Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Clint Yates

State Indiana
Accreditation Number 193804035

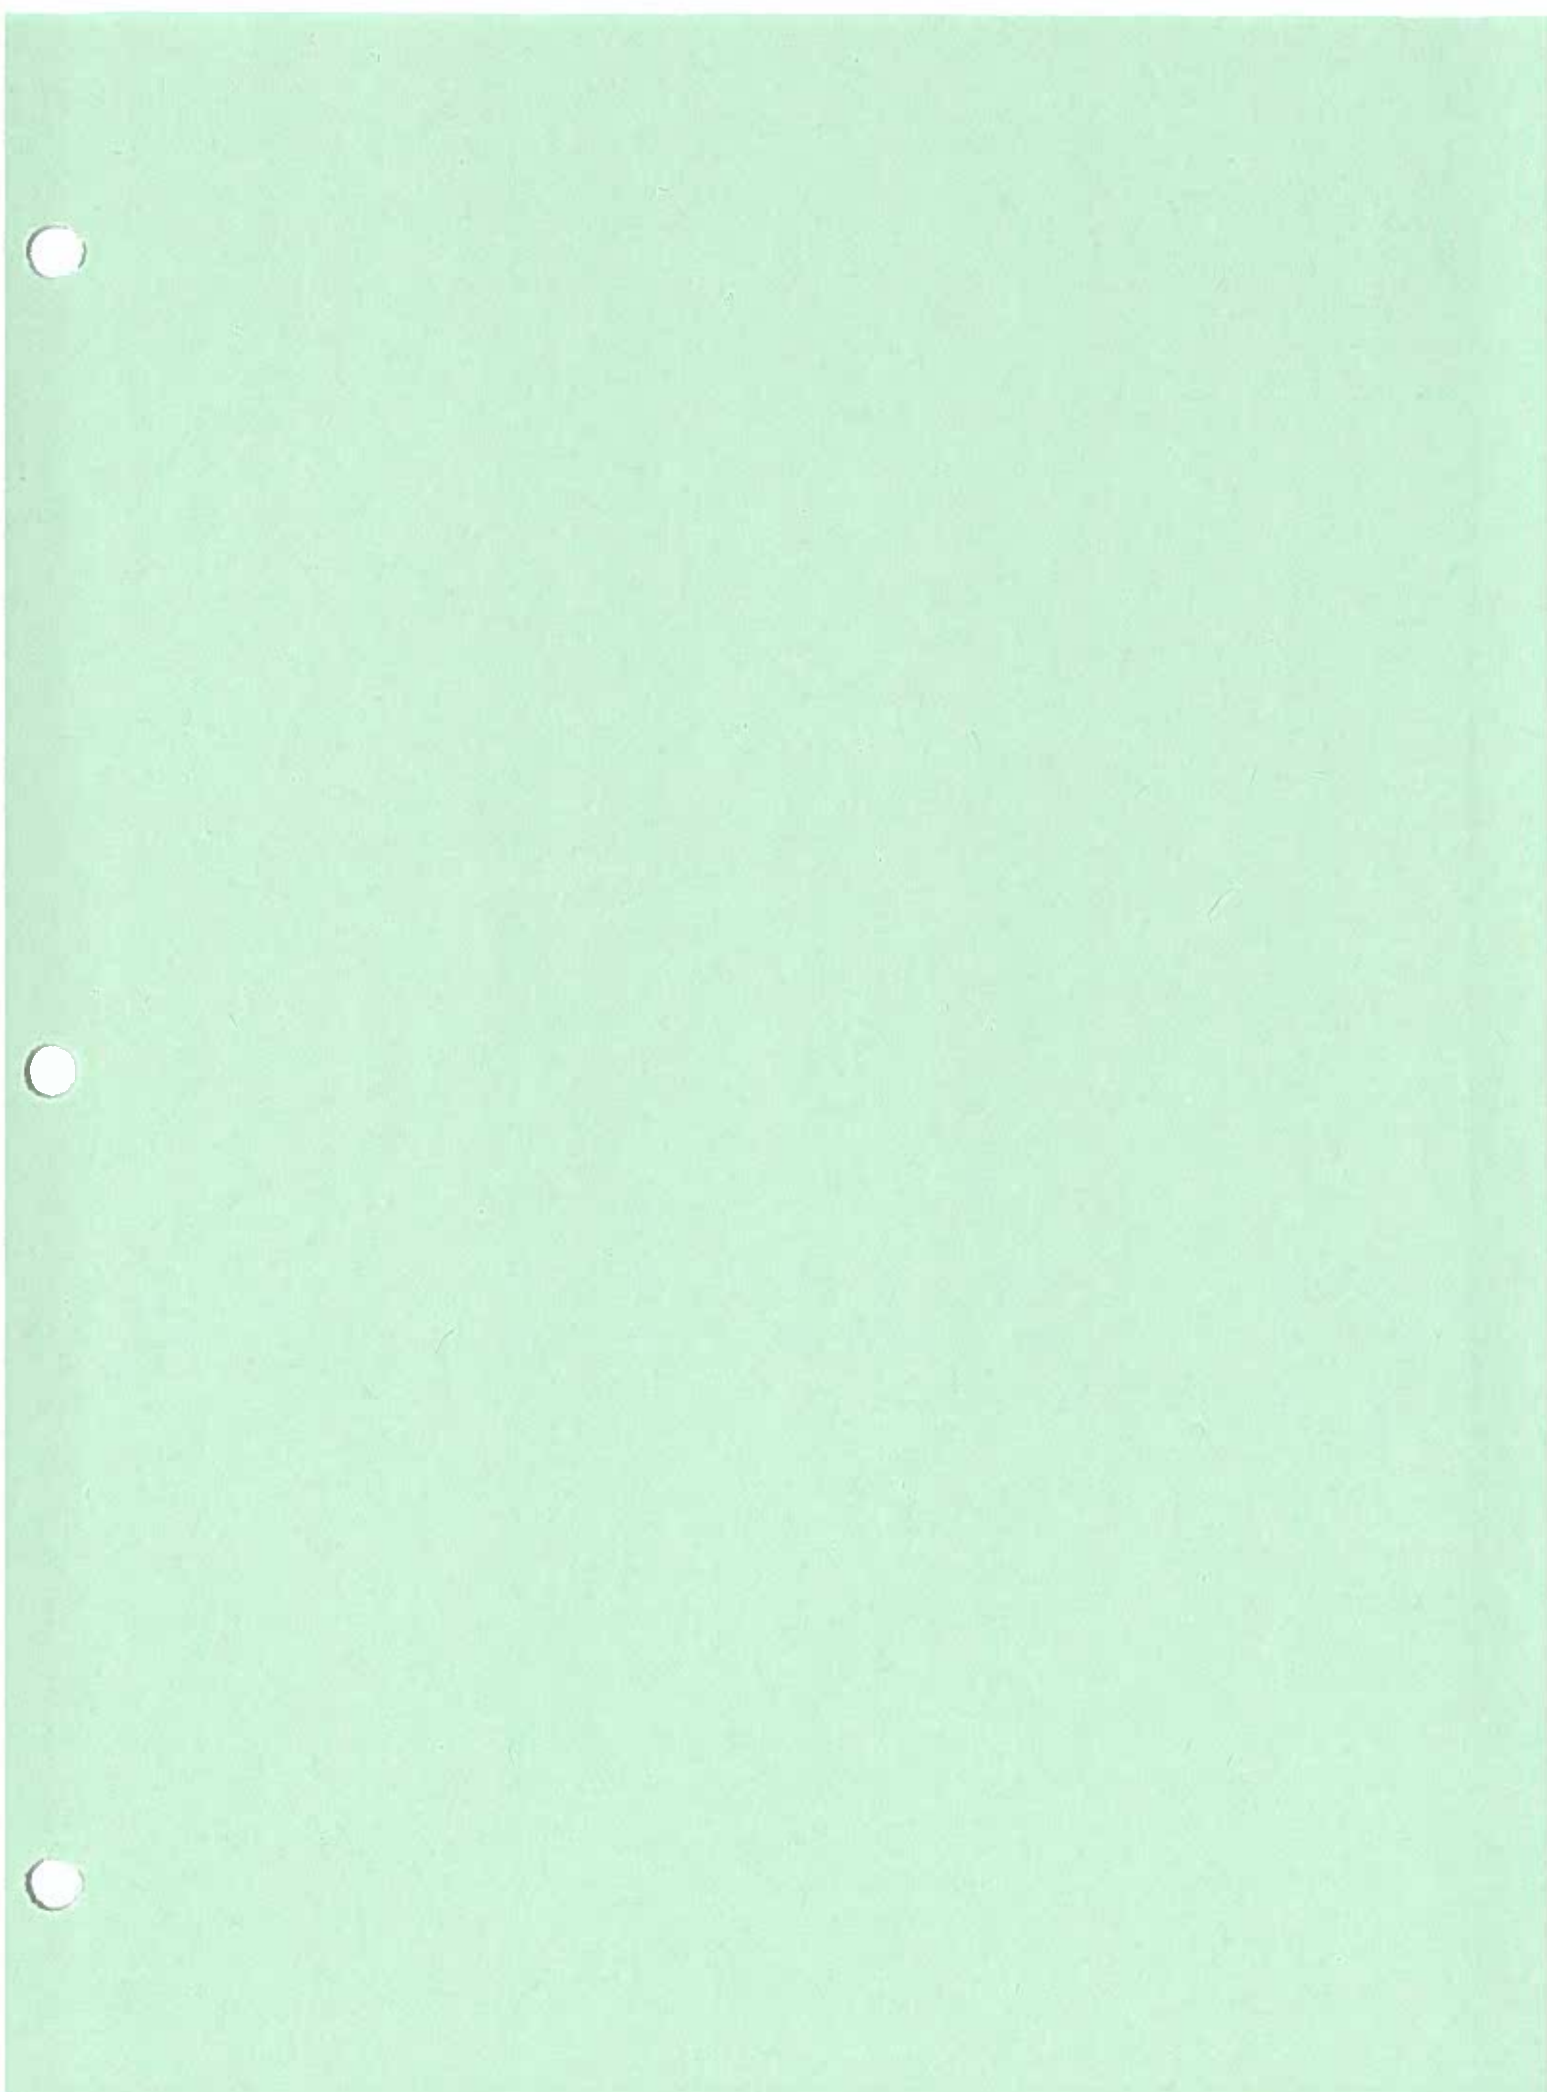


PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 4
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF
Material Location
Throughout building
Material Description
Mastic
Comments
Material is in good condition. Tile is negative. No change.

Does Material Contain Asbestos? No
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 6/21/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

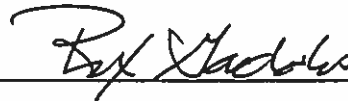

Rex Gaddis

State Indiana
Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material

Quantity of Material LF

Material Location
Throughout building


Material Description
Cove Base

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 6/21/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

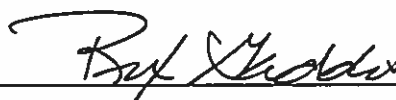

Rex Gaddis

State Indiana
Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material LF

Material Location
Throughout building


Material Description
Cove Base Mastic

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 6/21/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

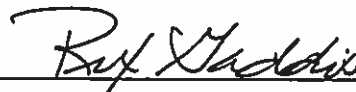

Rex Gaddis

State Indiana
Accreditation Number 190908032

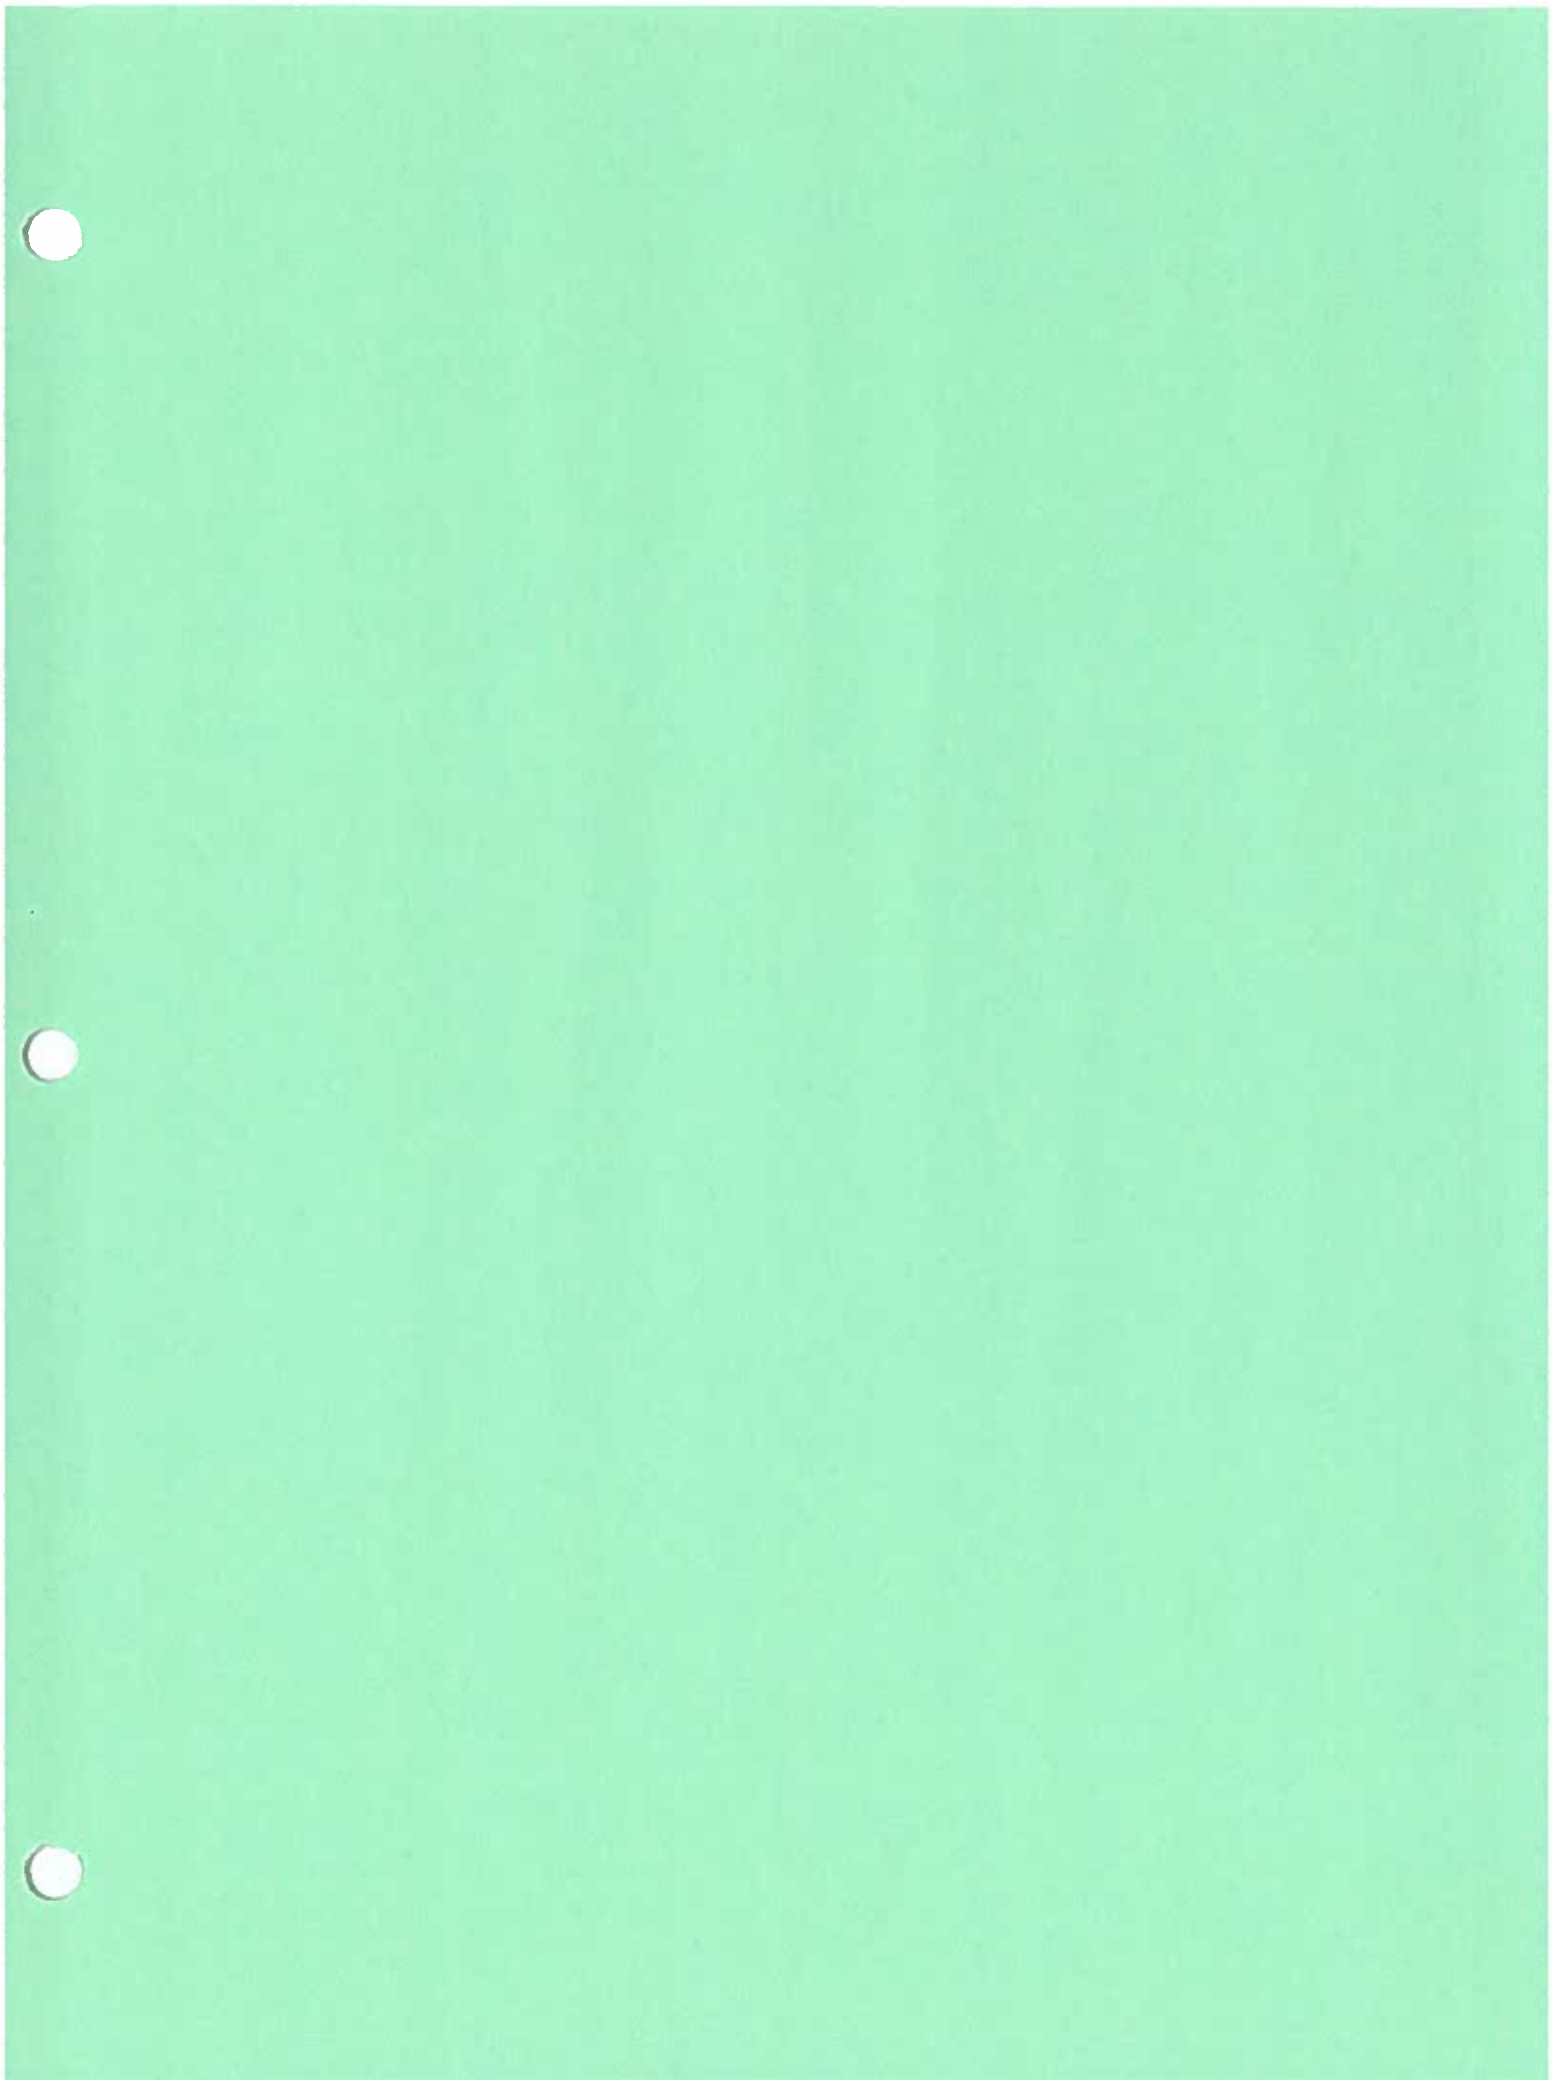

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools
BUILDING NAME: New Washington Elementary School
HA#: 4
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL: 6,328SF


MATERIAL LOCATION:
Throughout Building

MATERIAL DESCRIPTION:
Mastic

COMMENTS:
Material is in good condition. Tile is negative.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE: 06/01/95
CURRENT SURVEILLANCE DATE: 12/07/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
STATE: Indiana

INSPECTOR NAME:

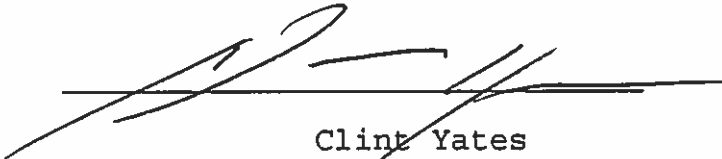
Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools
BUILDING NAME: New Washington Elementary School
HA#: A
TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:


Cove Base

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE:
CURRENT SURVEILLANCE DATE: 12/07/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: YES
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
STATE: Indiana

INSPECTOR NAME:

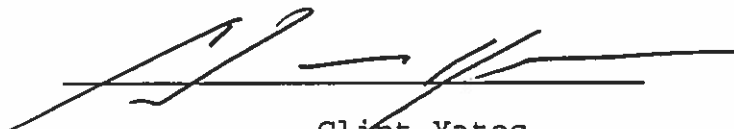
Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools
BUILDING NAME: New Washington Elementary School
HA#: B
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL:
MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:


Cove Base Mastic

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE:
CURRENT SURVEILLANCE DATE: 12/06/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
STATE: Indiana

INSPECTOR NAME:


Clint Yates

THIRD YEAR REINSPECTIONS

REINSPECTION PLAN

GREATER CLARK COUNTY SCHOOLS

Reinspection by an accredited building inspector will be scheduled to be performed not more than three years from the date of the original inspection. The reinspection report will then be made a permanent part of this Management Plan. Reinspections will be performed every three years for as long as the building contains ACBM, and will be reinspected once within three years from the date that all ACBM has been removed.

Records of each reinspection should be maintained in this binder.

DATE PLANNED

DATE COMPLETED

COMPLETED BY

JUNE 2007

July 2007

Bill Ogle

JUNE 2010

June 2010

Sandy Shadley

JUNE 2013

April 2013

Jeff Hechtin

JUNE 2016

April 2016

Benjamin B

JUNE 2019

May 2019

[Signature]

JUNE 2022

JUNE 2025

REINSPECTION PLAN

GREATER CLARK COUNTY SCHOOLS

NEW WASHINGTON ELEMENTARY SCHOOL

The ACBM in this building shall be reinspected every three years to determine any change in the condition of the materials for as long they remain in the building. This reinspection will be conducted tri-annually by an accredited inspector.

The following table outlines the dates on which these inspections should take place in this school building.

REINSPECTION SCHEDULE

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>JUNE 1992</u>	<u>JUNE 1992</u>	<u>ASBESTECH</u>
<u>JUNE 1995</u>	<u>June '95</u>	<u>Alliance</u>
<u>JUNE 1998</u>	<u>June '98</u>	<u>Alliance</u>
<u>JUNE 2001</u>	<u>July '01</u>	<u>P. Wilson</u>
<u>JUNE 2004</u>	<u>July '04</u>	<u>C. Sparks</u>

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID 04
HA Description Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 6328 SF
Comments This material was exposed to inspect in custodial closets by rooms 204 & 306 & the bookstore. Normal wear is shown.
Asbestos Known
Friable No
Original Inspection 6/1/1992
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building. (classrooms)

Quantity 5700 SF
Comments This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cateteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982. The cove base in the hallways was replaced in 2011.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building.

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Contact		Vibration	Air
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID C
HA Description Fire Doors
HA Type Miscellaneous Material
HA Location Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior

Quantity 3 Unit(s)
Comments Boiler/Mechanical Room fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed. Holes need to be sealed.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Contact		Vibration	Air
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID D
HA Description Shock Joint
HA Type Miscellaneous Material
HA Location Boiler Room by interior door overhead.

Quantity 1 Unit(s)
Comments This material is damaged in the boiler room and needs to be repaired. If the material is not capable of being repaired it should be removed and replaced.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID E
HA Description Black Sink Insulation (Book store and teachers lounge)
HA Type Miscellaneous Material
HA Location Sink

Quantity Unquantified LF
Comments Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID 04
HA Description Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 6328 SF
Comments This material was exposed to inspect in custodial closets by rooms 204 & 306 & the bookstore. Normal wear is shown.
Asbestos Known
Friable No
Original Inspection 6/1/1992
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building. (classrooms)

Quantity 5700 SF
Comments This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cateteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982. The cove base in the hallways was replaced in 2011.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout the 1971 and 1982 portions of the building.

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Contact		Vibration	Air
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID C
HA Description Fire Doors
HA Type Miscellaneous Material
HA Location Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior

Quantity 3 Unit(s)
Comments Boiler/Mechanical Room fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed. Holes need to be sealed.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID D
HA Description Shock Joint
HA Type Miscellaneous Material
HA Location Boiler Room by interior door overhead.

Quantity 1 Unit(s)
Comments This material is damaged in the boiler room and needs to be repaired. If the material is not capable of being repaired it should be removed and replaced.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name New Washington Elementary School
Building Number 06
HA ID E
HA Description Black Sink Insulation (Book store and teachers lounge)
HA Type Miscellaneous Material
HA Location Sink

Quantity Unquantified LF
Comments Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout the building

Material Description
Mastic

Comments

This material was exposed to inspect in custodial closets by rooms 204 & 306 & the bookstore. Normal wear is shown.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF

Material Location

Throughout the 1971 and 1982 portions of the building. (classrooms)

Material Description

Cove base

Comments

This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cateteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982. The cove base in the hallways was replaced in 2011.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF

Material Location

Throughout the 1971 and 1982 portions of the building.

Material Description

Cove base mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 3 Each
Material Location
Boiler/Mechanical Room-1 Wooden Interior & 2 Metal Exterior

Material Description

Fire Doors

Comments

Boiler/Mechanical Room fire doors were not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/30/2010
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# D
Type of Material Miscellaneous Material
Quantity of Material 1 Each

Material Location
Boiler Room by interior door overhead.

Material Description
Shock joint

Comments

Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Reinspection Date 4/24/2013
Current Assessment Rating NA Not Applicable
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF

Material Location
Sink

Material Description

Black Sink Insulation (Book store and teachers lounge)

Comments

Noted during the June 2011 6 month surveillance and will remain in the management plan until properly sampled

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Reinspection Date 4/24/2013
Current Assessment Rating NA Not Applicable
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF
Material Location Throughout the building

Material Description


Mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 6/30/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State IN
Accreditation Number 19A002323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF

Material Location

Throughout the 1971 and 1982 portions of the building.

Material Description

Cove base

Comments

This material shows signs of minor scrapes and chips but was not in poor condition overall. Cove base in cateteria installed in 2004. Cove base in 1971 and 1982 portions of the building installed in 1982.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 6/30/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State IN
Accreditation Number 19A002323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the 1971 and 1982 portions of the building.

Material Description

Cove base mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 6/30/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State IN
Accreditation Number 19A002323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 1 Each

Material Location
Boiler/Mechanical Room


Material Description
Fire Door

Comments

Boiler/Mechanical Room fire door was not assessed in the original inspection. The core material is suspect material and is being added to the Management Plan until proper sampling has been completed.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/30/2010
Current Reinspection Date 6/30/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

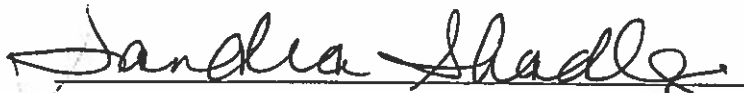
Sandra Shadley

State Indiana
Accreditation Number 19A992323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout the building

Material Description
Mastic

Comments
This material was not exposed to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 7/11/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF

Material Location
Throughout the building

Material Description
Cove base

Comments
This material shows signs of minor scrapes and chips missing, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 7/11/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not visible to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 7/11/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027



THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF

Material Location
Throughout the building

Material Description
Mastic

Comments
This material was not exposed to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 6/28/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF

Material Location
Throughout the building

Material Description
Cove base

Comments

This material shows signs of minor scrapes, but was not in poor condition overall. There is one piece missing in the storage shed in the gymnasium.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 6/28/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF


Material Location
Throughout the building

Material Description
Cove base mastic

Comments
Where visible, this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 6/28/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

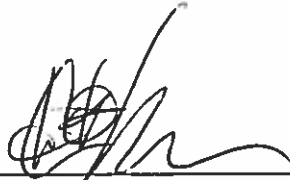

Christian Sparks

State Indiana
Accreditation Number 190804103



THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF
Material Location
Throughout the building
Material Description
Mastic
Comments
No mastic was exposed to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Reinspection Date 07/12/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Patrick E. Wilson

State Indiana
Accreditation Number 190824065

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 5,700 SF
Material Location
Throughout the building
Material Description
Cove base
Comments
Material is in good condition with minor scraping observed.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Reinspection Date 07/12/2001
Current Assessment Rating NR Not Required
Cause of Damage Physical Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Patrick E. Wilson

State Indiana
Accreditation Number 190824065


THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
Material is not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Reinspection Date 07/12/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Patrick E. Wilson


State Indiana
Accreditation Number 190824065

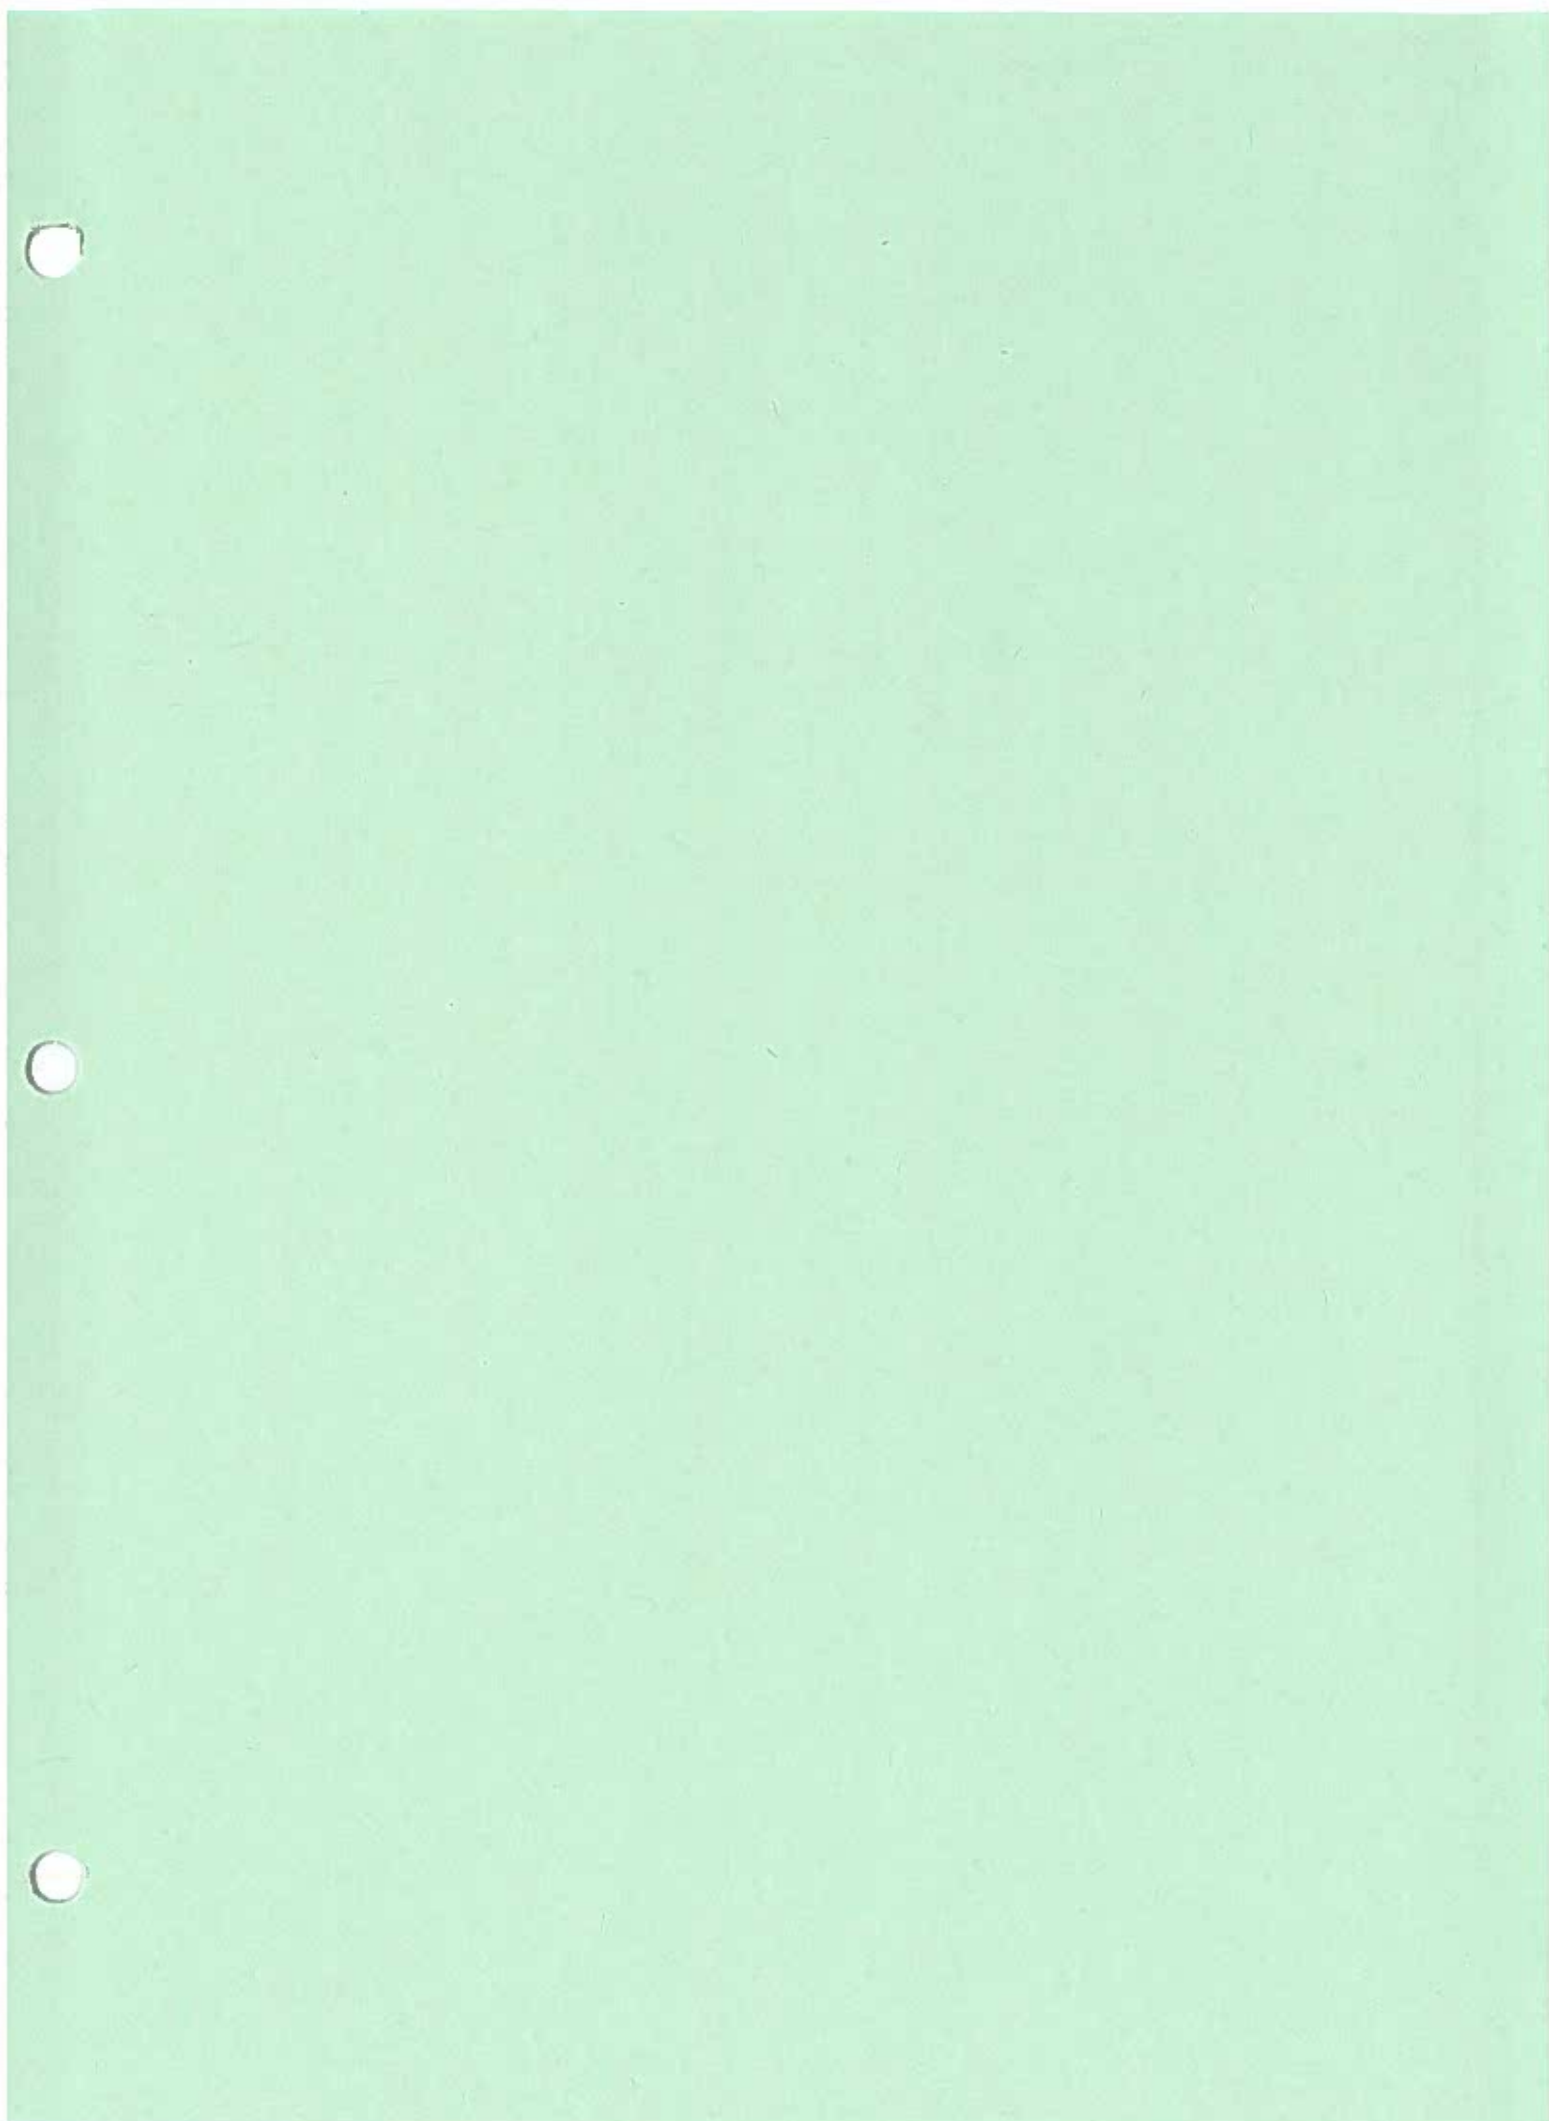

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# 04
Type of Material Miscellaneous Material
Quantity of Material 6,328 SF
Material Location Throughout building
Material Description Mastic
Comments Tile is negative.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Reinspection Date 6/ 1/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Clint Yates

State Indiana
Accreditation Number 193804035

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout building
Material Description
Cove Base
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Reinspection Date 6/ 1/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

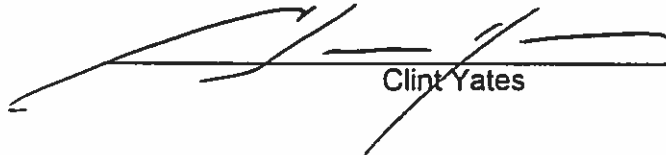
Clint Yates

State Indiana
Accreditation Number 193804035

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name New Washington Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material LF


Material Location
Throughout building

Material Description
Cove Base Mastic


Comments
Material is not exposed and is assumed to be in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Reinspection Date 6/ 1/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

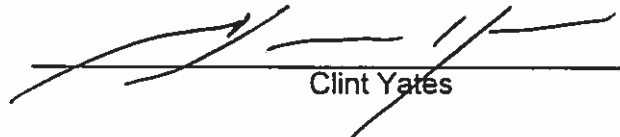
Clint Yates

State Indiana
Accreditation Number 193804035

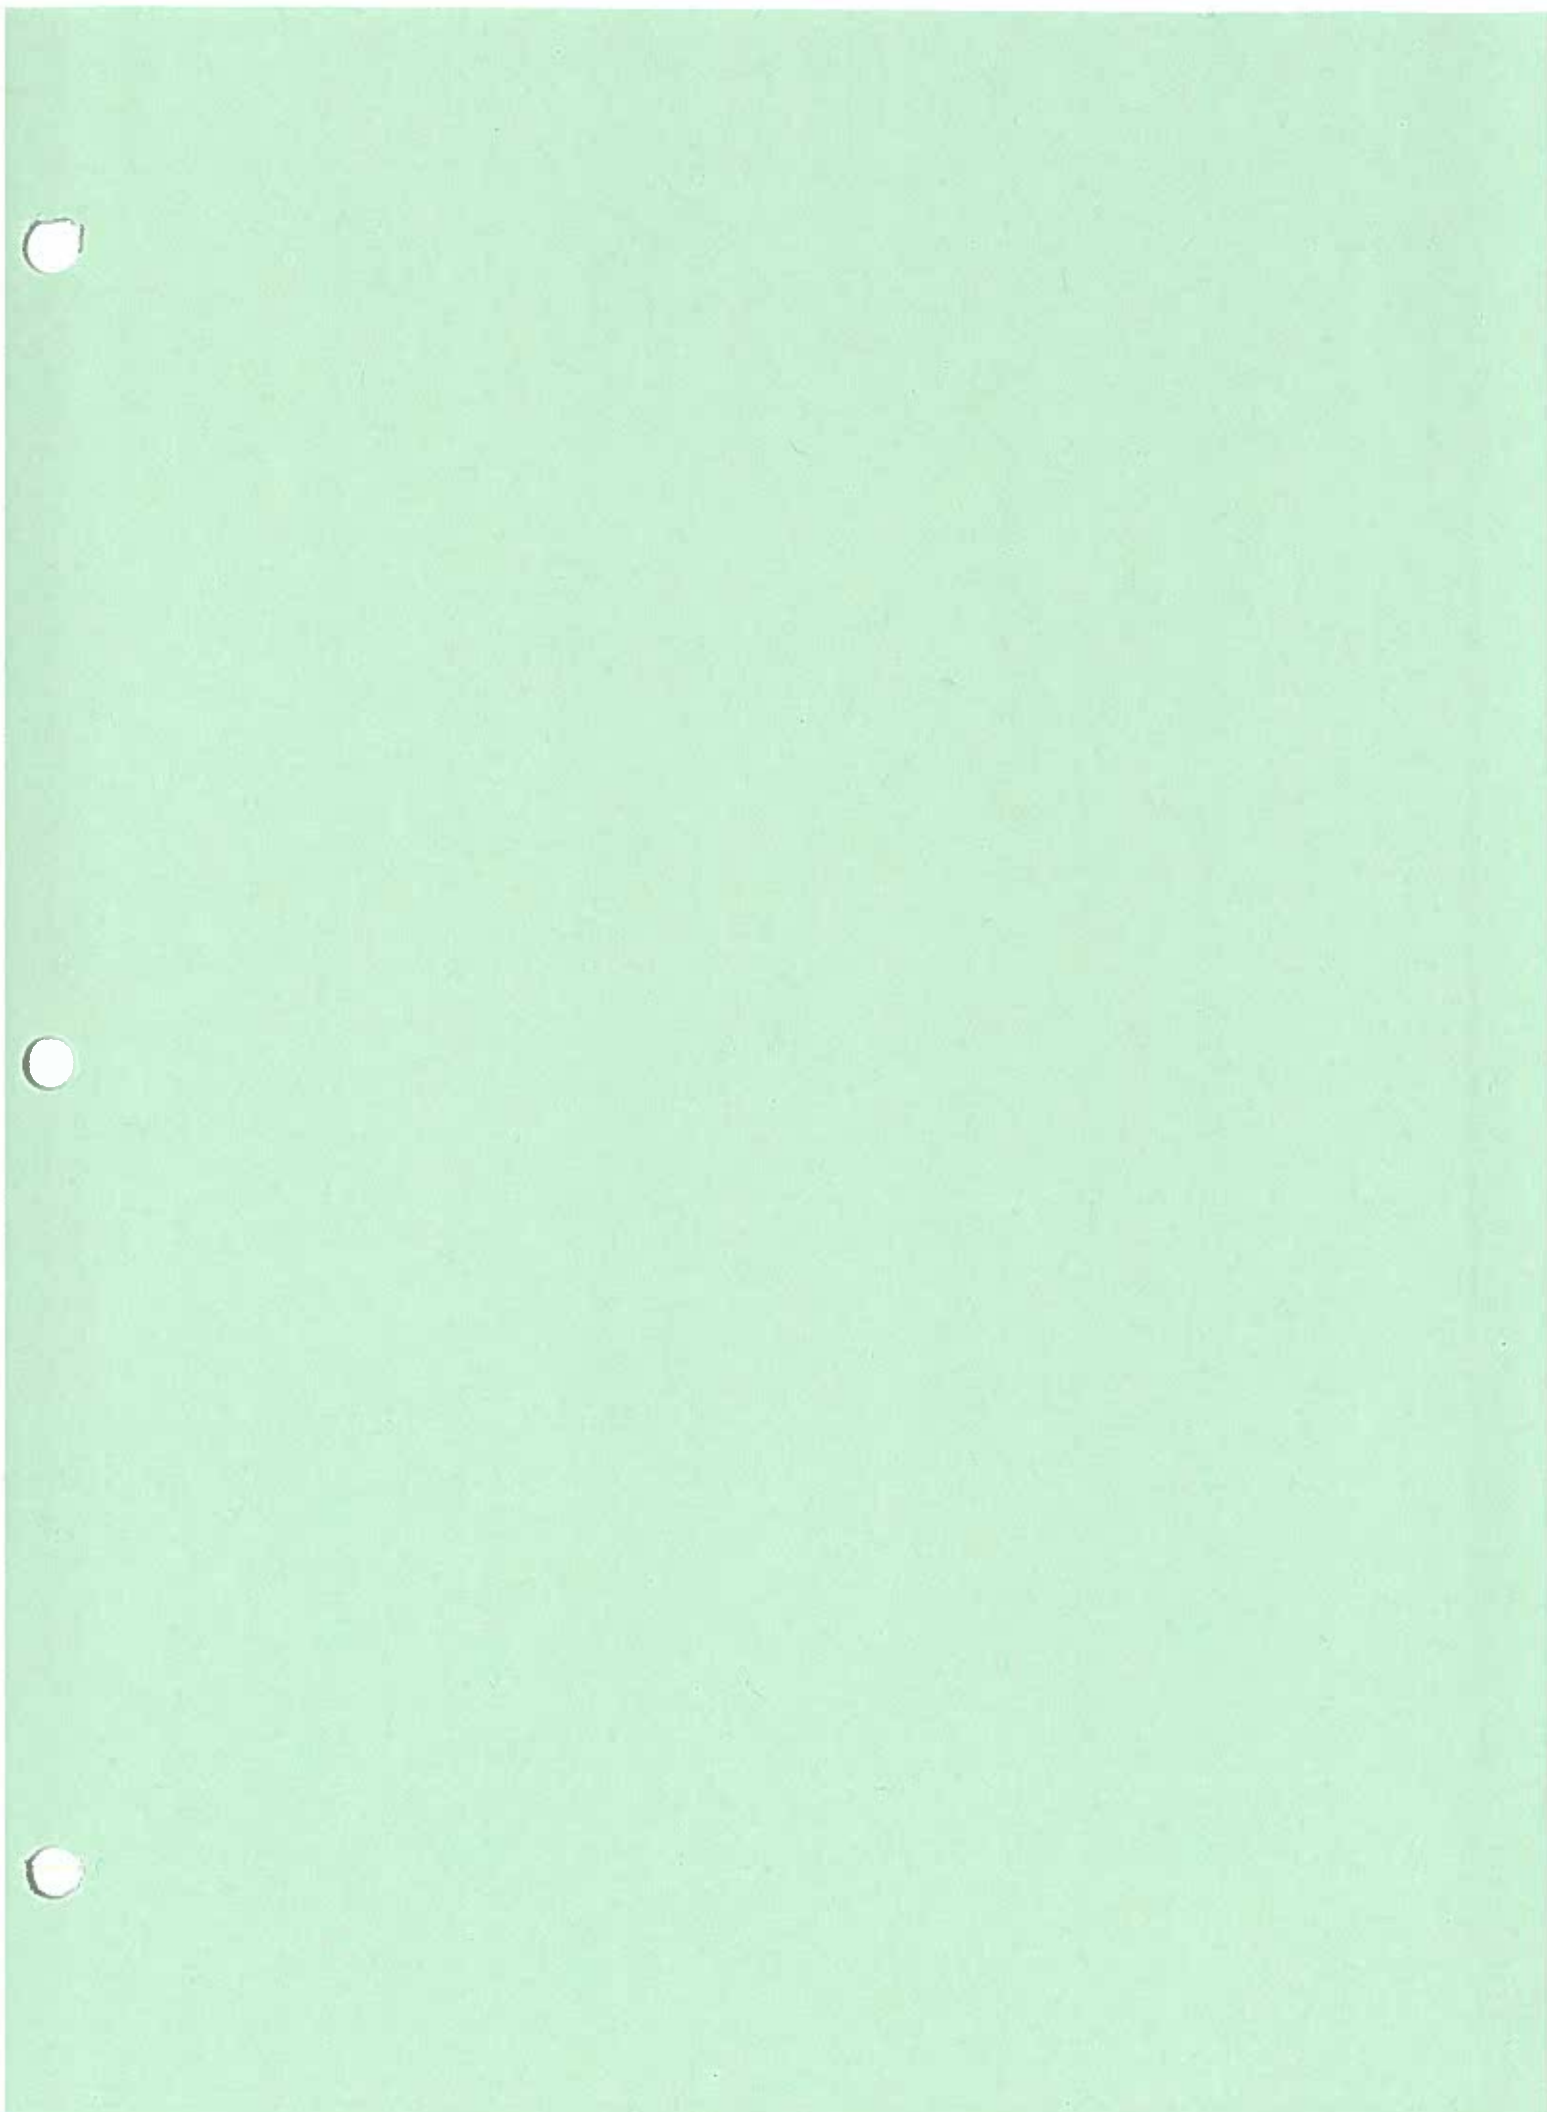

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.
BUILDING NAME: New Washington Elementary School
HA#: 4
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL: 6,328SF

MATERIAL LOCATION:
Throughout Building

MATERIAL DESCRIPTION:
Mastic

COMMENTS:
Material is in good condition. Tile is negative.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE: 06/01/95
CURRENT REINSPECTION DATE: 06/28/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:



Rex Gaddis

STATE: Indiana
ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.

BUILDING NAME: New Washington Elementary School

HA#: A

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL: .

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT REINSPECTION DATE: 06/28/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

CURRENT VIDEO TAPE:
(TAPE NO/FOOTAGE)

/

INSPECTOR NAME:



Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.

BUILDING NAME: New Washington Elementary School

HA#: B

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base Mastic

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT REINSPECTION DATE: 06/28/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:



Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

**ANNUAL NOTIFICATIONS
ACCREDITATIONS
TRAINING
INFORMATION**

Indiana Department of Environmental Management
100 N. Senate Avenue
Mail Code 61-52 IGCN 1003
Indianapolis, IN 46204-2251



April 17, 2014

RECEIVED APR 22 2014

Benjamin S. Hood
Alliance Environmental Group
5340 Commerce Circle, Ste E
Indianapolis IN 46237

Re: Asbestos Inspector # 19A001039

Based upon the review of your license application, the Office of Air Quality has determined that you have fulfilled the requirements of 326 IAC 18 and are eligible for licensing in the following discipline:

Asbestos Inspector

Your Asbestos Inspector license is attached below. The license is waterproof and tear resistant. Please sign your license and do not laminate or alter your license in anyway. Your license must be available for review at all times while implementing an asbestos project. This license may be revoked, pursuant to 326 IAC 18-1-7, if you:

- (1) Violate any requirements of these rules (326 IAC 18), 326 IAC 14-10, or any requirement of the Asbestos-Containing Materials in Schools Rule or any other federal, state, or local regulation pertaining to asbestos in buildings or to asbestos projects.
- (2) Falsify information on your application for licensing.
- (3) Fail to meet any qualifications specified in 326-IAC 18-1-4.
- (4) Conduct asbestos project, or related asbestos handling activity, in a manner which is hazardous to the public health.

Your license is valid effective 05/05/2014, and will expire on 05/05/2015, as indicated on your card. We suggest that you attend the required training and submit an application for license renewal early to insure your license does not lapse. NOTE: 326 IAC 18-1-4(h) and 326 IAC 18-1-6(e) require that any individual who has an eighteen (18) month lapse between any two training courses of the same discipline to attend an initial training course for the discipline in which they are seeking a license. In order to avoid re-taking the initial training course you must have attended a refresher in the discipline you are seeking a license within eighteen (18) months from the date of issuance of your last training course certificate.

Office of Air Quality, Asbestos Licensing Section (317) 233-3861



Indiana Dept. of Environmental Management

Benjamin S. Hood

Asbestos Inspector License #: 19A001039

Effective: 05/05/2014	Expiration: 05/05/2015
Birth Date: 04/10/1978	Gender: M
Height: 6-00	Eye Color: Brown
Weight: 285	Hair Color: Brown

NOTICES

NOTIFICATION LOG

GREATER CLARK COUNTY SCHOOLS

DATE OF NOTIFICATION

COPY IN BOOK

YEAR

(X)

- 2009
- 2010
- 2011
- 2012
- 2013
- 2014
- 2015
- 2016
- 2017
- 2018
- 2019
- 2020
- 2021
- 2022
- 2023
- 2024
- 2025
- 2026
- 2027
- 2028
- 2029
- 2030

2009	✓
2010	✓
2011	
2012	
2013	✓
2014	✓
2015	✓
2016	
2017	
2018	
2019	
2020	
2021	
2022	
2023	
2024	
2025	
2026	
2027	
2028	
2029	
2030	

NOTIFICATION LOG

LEA Name - Greater Clark County Schools

<u>Date of Notification</u>	<u>Copy of Notification in Supplemental Book?</u>
1989	
1990	
1991	
1992	
1993	
1994	
1995	✓
1996	✓
1997	✓
1998	✓
1999	✓
2000	✓
2001	✓
2002	✓
2003	✓
2004	✓
2005	✓
2006	✓
2007	✓
2008	✓

March 2015

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services at River Valley Middle School, which is located at 2220 Veteran's Parkway, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, Service Center, Corden Porter Storage, Auto Tech Program- Witten Property, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2015/2016 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

* The required triennial re-inspection will be performed in April 2016.

* The required six month periodic surveillance was performed in October 2014.

* The required six month periodic surveillance activities are scheduled for April and October each year.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Corden Porter former Options Building and the Administration Building

March 2014

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2220 Veteran's Parkway, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, Corden Porter Storage, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2014/2015 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

* The required triennial re-inspection will be performed in April 2013.

* The required six month periodic surveillance was performed in October 2013.

* The required six month periodic surveillance activities are scheduled for April and October each year.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

March 2013

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, Corden Porter Storage, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2013/2014 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- * The required triennial re-inspection will be performed in April 2013.
- * The required six month periodic surveillance was performed in October 2012.
- * The required six month periodic surveillance activities are scheduled for April and October each year.
- * Projects completed in 2012: Parkview Middle School.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

March 2012

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, and Cordon Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2012/2013 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- * The required triennial re-inspection will be performed in June 2013.
- * The required six month periodic surveillance was performed in December 2011.
- * The required six month periodic surveillance activities are scheduled for June and December each year.
- * Projects completed in 2011: Options building and Parkwood Elementary.
- * Projects scheduled for 2012: Parkview Middle School and Bridgepoint Elementary.
- * Cordon Porter storage building was sold in 2012.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

**AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxillary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, Options and Corden Porter Center Buildings and Alternative School-

- * The required triennial reinspection will be performed in June 2013.
- * The required six month periodic surveillance was performed in December 2010.
- * The next scheduled activity is the required six month periodic surveillance in June 2011.
- * Charlestown High School asbestos removal project was completed in 2010.
- * Options Building is under renovation in 2011.
- * Parkwood Elementary is under renovation in 2011.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building
- These buildings are asbestos free and **Riverside Elementary** was demolished in 2006.
No surveillances or reinspections are required for these buildings.

March 2011

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teacher organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection will be performed in June 2010.
- * The required six month periodic surveillance was performed in December 2009.
- * The next scheduled activity is the required six month periodic surveillance in December 2010.
Charlestown High School is an ongoing asbestos removal project which will be complete prior to partial demolition.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building –
These buildings are asbestos free and **Riverside Elementary** was demolished in 2006.
No surveillances or reinspections are required for these buildings.

March 2010

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2007.
- * The required six month periodic surveillance was performed in December 2008.
- * The next scheduled activities are the required six month periodic surveillance in June 2009 and Dec 2009.
Charlestown High School has undergone an asbestos removal project prior to partial demolition.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building –
These buildings are asbestos free and **Riverside Elementary** was demolished in 2006.
No surveillances or re-inspections are required for these buildings.

April 2009

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number (812)288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2007.
- * The required six month periodic surveillance was performed in December 2007.
- * The next scheduled activities are the required six month periodic surveillance in June 2008 and Dec 2008.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free. **Riverside Elementary** was Demolition in 2006. No surveillances or reinspections are required.

April 2008

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

* The required six month periodic surveillance was performed in June 2006.

* The required six month periodic surveillance was performed in December 2006.

* The next scheduled activities are the required six month periodic surveillance in June 2007 and Dec 2007.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free. **Riverside Elementary** was Demolition in 2006. No surveillances or reinspections are required.

March 2007

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

* The required triennial reinspection was performed in June 2005.

* The required six month periodic surveillance was performed in December 2005.

* The next scheduled activities are the required six month periodic surveillance in June 2006 and Dec 2006.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building –
These buildings are asbestos free. No surveillances or reinspections are required.

March 2006

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2004.
- * The required six month periodic surveillance was performed in December 2004.
- * The next scheduled activities are the required six month periodic surveillance in June 2005 and December 2005.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

- * These buildings are asbestos free. No surveillances or reinspections are required.

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required six month periodic surveillance was performed in June 2003.
- * The required six month periodic surveillance was performed in December 2003.
- * The next scheduled activities are the required triennial reinspection in June 2004 and a required six month periodic surveillance in December 2004.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

- * These buildings are asbestos free. No surveillances or reinspections are required.

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required six month periodic surveillance was performed in June 2002.
- * The required six month periodic surveillance was performed in December 2002.
- * The next scheduled activity is the required periodic surveillance in June 2003.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

- * These buildings are asbestos free. No surveillances or reinspections are required.

May 2003

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in July 2001.
- * The required six month periodic surveillance was performed in December 2001.
- * The next scheduled activities are the required periodic surveillances in June 2002 and December 2002.

Pleasant Ridge Elementary School and (New) Utica Elementary School -

- * These buildings are asbestos free. No surveillances or reinspections are required.

(Old) Utica Elementary School -

- * In accordance with information collected from the GCCS this building has been deeded to the town of Utica. No further AHERA periodic surveillances or triennial reinspections will be conducted by the designated person.

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, (Old) Utica, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center -

- * The required six month periodic surveillance was performed in June 2000.
- * The required six month periodic surveillance was performed in January 2001.
- * The next scheduled activity is a required triennial reinspection in June 2001.

Pleasant Ridge Elementary School and (New) Utica Elementary School -

- * This building is asbestos free. No surveillances or reinspections are required.

June 2001

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, Utica, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center -

- * The required six month periodic surveillance was performed in June 1999.
- * The required six month periodic surveillance was performed in December 1999.
- * The next scheduled activity is a required periodic surveillance in June 2000.

Pleasant Ridge Elementary School -

- * This building is asbestos free. No surveillances or reinspections are required.

June 2000

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required six month periodic surveillance was performed in June 1998.
- * The required six month periodic surveillance was performed in December 1998.
- * The next scheduled activity is a required periodic surveillance in June 1999.

Parkwood Elementary School

- * O & M was performed in the boiler room in May 1998.

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1997 and December 1997.
- * Next activity scheduled activity is a required third year reinspection in June 1998.

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available, should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1996 and December 1996.
- * The next required periodic surveillance will be performed in June 1997 and December 1997.

June 97

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Denny Johanson at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All buildings where it is required -

- * The required third year reinspection was performed in June 1995.
- * The required periodic surveillance was performed in December 1995.
- * Next activity scheduled is a periodic surveillance in June 1996.

Charlestown High School -

- * Transite panels were compliantly removed from the exterior of the building.

Corden Porter Building #3 -

- * TSI was compliantly removed from the boiler room.

June 96

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available, should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Dennis Johanson at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1995 and December 1995.
- * The required triennial reinspection was performed in June 1995.
- * The next required periodic surveillance will be performed in June 1996 and December 1996.

June 95

ACCREDITATIONS



Environmental Management Institute

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846
www.envtlmgmt.org

This confirms that

Sandy Shadley

Completed the Required Initial Training for
Asbestos Accreditation Under TSCA Title II
and has
passed with a Score of 70 or Greater the Examination for

Asbestos Management Planner

Course Date
December 10 - 11, 2009

Examination Date
December 11, 2009




Jack E. Leonard, President

Certificate: MP(I) 2248
Expires: December 11, 2010

Approved by:: Illinois Department of Public Health
Indiana Department of Environmental Management

Indiana Department of Environmental Management
100 N. Senate Avenue
Mail Code 61-52 IGCN 1003
Indianapolis, IN 46204-2251

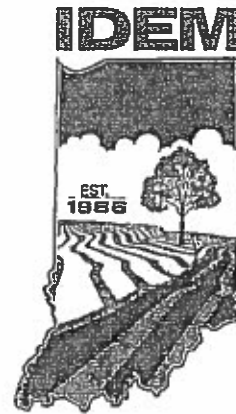

January 21, 2010

RECEIVED JAN 23 2010

Sandra S. Shadley
Alliance Environmental Grp
5340 Commerce Circle Ste E
Indianapolis IN 46237

Re: Asbestos Management Planner # 19A002720

Based upon the review of your license application, the Office of Air Quality has determined that you have fulfilled the requirements of 326 IAC 18 and are eligible for licensing in the following discipline:

Asbestos Management Planner

Your Asbestos Management Planner license is attached below. The license is waterproof and tear resistant. Please sign your license and do not laminate or alter your license in anyway. Your license must be available for review at all times while implementing an asbestos project. This license may be revoked, pursuant to 326 IAC 18-1-7, if you:

- (1) Violate any requirements of these rules (326 IAC 18), 326 IAC 14-10, or any requirement of the Asbestos-Containing Materials in Schools Rule or any other federal, state, or local regulation pertaining to asbestos in buildings or to asbestos projects.
- (2) Falsify information on your application for licensing.
- (3) Fail to meet any qualifications specified in 326-IAC 18-1-4.
- (4) Conduct asbestos project, or related asbestos handling activity, in a manner which is hazardous to the public health.

Your license is valid effective 01/21/2010, and will expire on 01/21/2011, as indicated on your card. We suggest that you attend the required training and submit an application for license renewal early to insure your license does not lapse. NOTE: 326 IAC 18-1-4(h) and 326 IAC 18-1-6(e) require that any individual who has an eighteen (18) month lapse between any two training courses of the same discipline to attend an initial training course for the discipline in which they are seeking a license. In order to avoid re-taking the initial training course you must have attended a refresher in the discipline you are seeking a license within eighteen (18) months from the date of issuance of your last training course certificate.

Office of Air Quality, Asbestos Licensing Section (317) 233-3861



Indiana Dept. of Environmental Management

Sandra S. Shadley

Asbestos Management Planner License #: 19A002720

Effective: 01/21/2010
Birth Date: 04/21/1959
Height: 5-08
Weight: 140

Expiration: 01/21/2011
Gender: F
Eye Color: Blue
Hair Color: Brown

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE
1435 Sadlier Circle West Drive
Indianapolis, Indiana 46239
(317) 352 -1270 / (317) 352 - 0669

CHRISTIAAN SPARKS
306 - 04 - 2616

Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better

For
ASBESTOS BUILDING INSPECTOR REFRESHER

Accredited by the
Indiana Department of Environmental Management.

Certificate # ES03/BIR755

Course Dates: 09/26/2003
Test Date: 09/26/ 2003 Expires: 09/26/2004



Sharyn Reyes
Sharyn Reyes
Instructor / Manager

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE
1435 Sadlier Circle West Drive
Indianapolis, Indiana 46239
(317) 352-1270 / (317) 352-06

GEORGE Wm. (BILL) OGLE

Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better
For

**ASBESTOS MANAGEMENT PLANNER
REFRESHER**

Accredited by the
Indiana Department of Environmental Management.

Certificate # ES03/MPR045

Course Dates: 09/05/2003
Test Date: 09/05/2003 Expires: 09/05/2004




Sharyn Reyes
Instructor

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE

**1435 Sadlier Circle West Drive
Indianapolis, Indiana 46236
(317) 352-1270 / (317) 352 - 0669**

**PATRICK E. WILSON
309 - 90 - 6909**

**Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better
For**

ASBESTOS BUILDING INSPECTOR REFRESHER

**Accredited by the
Indiana Department of Environmental Management.**

Certificate # ES00/BIR482

**Course Dates: 11/29/2000
Test Date: 11/29/2000 Expires: 11/29/2001**

Sharyn Reyes

**Sharyn Reyes
Instructor**



Environmental Management Institute

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846

www.spea.iupui.edu/Envtl_mgmt

This confirms that

George Wm. (Bill) Ogle



Completed the Requisite Initial Training for
Asbestos Accreditation Under TSCA Title II
and has
Passed with a Score of 70 or Greater the Examination for
Asbestos Management Planner

Course date
March 2 - 3, 2000

Examination Date
March 3, 2000

Jack E. Leonard, President

Certificate: MP(I) 2157
Expires March 3, 2001

Approved by: Illinois Department of Public Health
Indiana Department of Environmental Management



ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE
1435 Sadler Circle West Drive
Indianapolis, Indiana 46239
(317) 352-1270 / (317) 352-0669

CLINT YATES

316 - 92 - 7065

Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better
For

ASBESTOS BUILDING INSPECTOR REFRESHER

Accredited by the
Indiana Department of Environmental Management.

Certificate # ES/BIR98/004.

Course Dates: 01/22/98 - 01/22/98
Test Date: 01/22/98 Expires: 01/22/99

Sharyn Reyes

Sharyn Reyes
Assistant / Instructor

Environmental Management Institute
Environmental and Occupational Training Service
5610 Crawfordsville Road, Suite 15
Indianapolis, Indiana 46224-3714
317/248-4848


This confirms that

Rex Gaddis

Completed the Requisite Refresher Training for
Asbestos Accreditation Under TSCA Title II
and has
Passed with a Score of 70 or Greater the Examination for
Asbestos Building Inspector

Course date
November 22, 1994

Examination Date
November 22, 1994

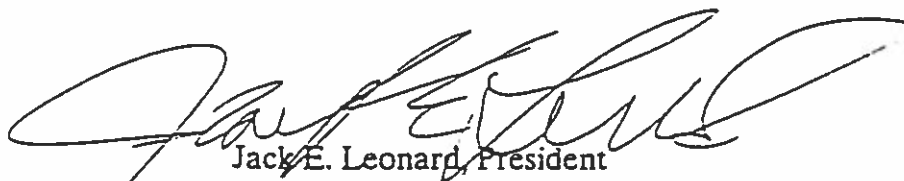

Jack E. Leonard, President

Certificate: IN(R) 2713
Expires November 22, 1995

Approved by: Illinois Department of Public Health
Indiana Department of Environmental Management

INDIANA DEPARTMENT OF ENVIRONMENTAL MANAGEMENT
ASBESTOS CERTIFICATE OF ACCREDITATION
CERTIFICATE # 102248025 EXPIRATION DATE 2/18/96
Rex Gaddis
IS CERTIFIED IN THE FOLLOWING DISCIPLINE(S)
INSPECTOR PLANNER DESIGNER
SUPERVISOR WORKER
WASTE DISPOSAL MANAGER
BIRTHDATE: 3/24/52 SEX: M EYES: BLU
HEIGHT: 5-10 WEIGHT: 220 HAIR: BRO

INDIANA DEPARTMENT OF ENVIRONMENTAL MANAGEMENT
ASBESTOS CERTIFICATE OF ACCREDITATION
CERTIFICATE # 190908032 EXPIRATION DATE 3/16/96
Rex Gaddis
IS CERTIFIED IN THE FOLLOWING DISCIPLINE(S)
INSPECTOR PLANNER DESIGNER
SUPERVISOR WORKER
WASTE DISPOSAL MANAGER
BIRTHDATE: 3/24/52 SEX: M EYES: BLU
HEIGHT: 5-10 WEIGHT: 220 HAIR: BRO

TRAINING

**OPERATIONS AND MAINTENANCE
INFORMATION**

**REMOVAL PROJECT
INFORMATION**

SHORT TERM WORKER PROGRAM

GREATER CLARK COUNTY SCHOOLS

SHORT-TERM WORKER SIGN OFF SHEET

This form should be signed each and every time before a "short-term worker" (telephone repair worker, utility worker, etc.) performs work that may cause him to come in contact with ACBM or suspected ACBM assumed to be ACM. One copy of this form should then be forwarded to the LEA designated person, and one copy should be maintained in the school building's copy of the supplemental binder provided by Alliance Indiana, Inc., in order to fulfill the LEA's recordkeeping requirements. The third copy should be forwarded to Alliance Indiana, Inc. for placement in its copy of the supplemental binder.

School Building Name - New Washington Elementary School Date _____

I certify that before performing any work which would possibly cause me to come in contact with Asbestos Containing Building Materials (ACBM), I was provided with adequate information regarding the locations of ACBM and suspected ACBM assumed to be ACM in the above-mentioned school building where I performed the work.

Signature - _____

Company - _____

Description of work (including number of days on site) - _____

GREATER CLARK COUNTY SCHOOLS

SHORT-TERM WORKER SIGN IN LOG

ALL SHORT-TERM WORKERS MUST SIGN THIS LOG CONFIRMING THAT THEY HAVE SIGNED A "SHORT-TERM WORKER SIGN OFF SHEET"

BUILDING NAME - New Washington Elementary School

DATE	NAME(print)	COMPANY	SIGNATURE