



ALLIANCE
Environmental Group, Inc.

THE ENVIRONMENTAL SOLUTION

GREATER CLARK COUNTY SCHOOLS

W.E. WILSON ELEMENTARY SCHOOL

AHERA

ASBESTOS MANAGEMENT PLAN

**DESIGNATED PERSON
TRUTH AND CORRECT STATEMENT**

Local Education Agency – Greater Clark County Schools
2112 Utica-Sellersburg Road
Jeffersonville, Indiana 47130

Designated Person - Alliance Environmental Group, Inc.
Sandra Shadley
5153 Commerce Square Drive, Suite E
Indianapolis, Indiana 46237

This Truth and Correct Statement, as outlined in 40 CFR 763.93(i), certifies that the general, local education agency responsibilities, as stipulated by 40 CFR 763.84, have been or will be met. These responsibilities include:

1. Ensure that the activities of any persons who perform inspections, reinspections, and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with 40 CFR 763 Subpart E.
2. Ensure all custodial and maintenance employees are properly trained as required by 40 CFR 763 Subpart E and other applicable Federal and/or State regulations (e.g., the Occupational Safety and Health Administration Asbestos Standard for Construction, the EPA Worker Protection Rule, or applicable State regulations).
3. Ensure that workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress.
4. Ensure that short-term workers (e.g., telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.
5. Ensure that warning labels are posted in accordance with Section 763.95.
6. Ensure management plans are available for inspection and notification of such availability has been provided as specified in the management plan under Section 763.93(g).
7. The undersigned person designated by the LEA pursuant to Section 763.84(g) (1) has received adequate training as stipulated in Section 763.84(g) (2).
8. The LEA has and will consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under Part 763.

Signature:  Date: November 6, 2016

Sandra S. Shadley

ASBESTOS PROGRAM MASTER INDEX

The following volumes are part of the Asbestos Program for the **GREATER CLARK COUNTY SCHOOLS**:

- A. Original Asbestos Management Plan for each school building.
- B. Asbestos Management Plan Supplement for each school building.
 - 1. Amendments to Management Plan
 - 2. Remaining Materials Report
 - 3. Surveillance, Reinspection and Additional Bulk Sampling Information
 - 4. Annual Notifications, Accreditations and Training Records
 - 5. Operations and Maintenance Records
 - 6. Asbestos Removal Projects
 - 7. Short Term Worker Program

Copies of both volumes are found in the respective buildings. The Administration Building also contains duplicate copies of both volumes for each building in their entirety.

GREATER CLARK COUNTY SCHOOLS

W. E. WILSON ELEMENTARY SCHOOL

TABLE OF CONTENTS


| | |
|---|---|
| AMENDMENTS TO MANAGEMENT PLAN | 1 |
| REMAINING MATERIALS REPORT | 2 |
| SURVEILLANCE, REINSPECTION AND ADDITIONAL BULK SAMPLING INFORMATION | 3 |
| ANNUAL NOTIFICATIONS, ACCREDITATIONS, AND TRAINING | 4 |
| OPERATIONS AND MAINTENANCE RECORDS | 5 |
| ASBESTOS REMOVAL PROJECTS | 6 |
| SHORT TERM WORKER INFORMATION | 7 |

AMENDMENTS TO THE MANAGEMENT PLAN

GREATER CLARK COUNTY SCHOOLS
WILSON ELEMENTARY SCHOOL

LEA RESPONSIBILITY CERTIFICATION

LEA Designated Person - ALLIANCE INDIANA, INC.


Signature - Bruce Wallace, President/CEO

May 1, 1995
Date

ACCREDITATION STATEMENT

The Greater Clark County Schools ensures that the following items will be carried out:

Activities of any persons who perform inspections, reinspections, and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with Subpart E of this part.

All custodial and maintenance employees are properly trained as required by this Subpart E and other applicable Federal and/or State regulations (e.g., the OSHA asbestos standard for construction, the EPA worker protection rule, or applicable State regulations).

Workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, and post response action activities, including periodic reinspection and surveillance activities that are planned or in progress.

Short-term workers (e.g., telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.

Warning labels are posted in accordance with 763.95.

Management plans are available for inspection and notification of such availability has been provided as specified in the management plan under 763.93(g).

Designate a person to ensure that requirements under this section are properly implemented.

Designated person receives adequate training to perform duties assigned under this section. Such training shall provide, as necessary, basic knowledge of:

Health effects of asbestos

Detection, identification, and assessment of ACM

Options for controlling ACBM

Asbestos management programs

Relevant Federal and State regulations concerning asbestos, including those in this Subpart E and those of the OSHA, U.S. Department of Labor, the U.S. Department of Transportation and the U.S. Environmental Protection Agency.

Consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under this subpart.

AMENDMENT TO THE MANAGEMENT PLAN

LEA Name - Greater Clark County Schools
Building - Wilson Elementary School
Subject - LEA Designated Person Change

Effective May 1, 1995 the Designated Person for the
Greater Clark County Schools is:

Alliance Indiana, Inc.
1433 Sadlier Circle West Drive
Indianapolis, Indiana 46239
(317) 351-5600

Management Planner: Rex Gaddis

Accreditation No. 192218025



Signature

May 1, 1995
Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - W. E. Wilson Elementary School

Subject- New material

Reference - HA A Cove Base

Original Assessment - No assessment in original inspection.

Amended Assessment - The cove base in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner


Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025



Signature



Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - W. E. Wilson Elementary School

Subject- New material

Reference - HA B Cove Base Mastic

Original Assessment - No assessment in original inspection.


Amended Assessment - The cove base mastic in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025



Signature



Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - W. E. Wilson Elementary School

Subject- New material

Reference - HA C Shock Joint Material

Original Assessment - No assessment in original inspection.


Amended Assessment - The shock joint material on the air handlers in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025


Signature


Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - W. E. Wilson Elementary School

Subject- New material

Reference - HA D Fittings

Original Assessment - No assessment in original inspection.


Amended Assessment - The fittings in the gym and custodial room(s) were not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025



Signature



Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - W. E. Wilson Elementary School

Subject- New material

Reference - HA E Fittings

Original Assessment - No assessment in original inspection.

Amended Assessment - The fittings in the classrooms were not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025



Signature

9/5/95

Date

AMENDMENT TO MANAGEMENT PLAN

Building Name - (Now Former) Administration Building, W.E. Wilson Elementary School, Thomas Jefferson Elementary School, Jeffersonville High School, River Valley Middle School, Corden Porter Center, Corden Porter Building #3, Corden Porter Building #4, and the Service Center/Bus Garage

Subject - Typographical Error

Amendment - A typographical error was made on the paperwork for the Periodic Surveillance that was conducted in December 2001. The pages in the Management Plan Supplement which are dated 12/10/2002 should read 12/10/2001.

Management Planner: George Wm. Ogle

Accreditation Number: 191523030


Signature


Date

AMENDMENT TO MANAGEMENT PLAN

LEA Name - Greater Clark County Schools

Subject - LEA Designated Person Change

Amendment - Effective March 2005, the Designated Person for the Greater Clark County Schools is:

Alliance Environmental Group, Inc.
5340 Commerce Circle, Suite E
Indianapolis, Indiana 46237
(317) 865-3400

Personnel contributing to this Management Plan are licensed in according with 40 CFR 763.93(e)(12).

Management Planner: Sandra S. Shadley

Accreditation Number: 19A002720


Signature



Date


AMENDMENT TO MANAGEMENT PLAN

Building Name - W. E. Wilson Elementary School
Subject - Quantity update to Homogeneous Area C
Amendment - One white canvas shock joint on air handling unit in the boiler room was removed non-friable during normal operations and maintenance activities.

Management Planner: Sandra Shadley

Accreditation Number: 19A002720


Signature


Date

AMENDMENT TO MANAGEMENT PLAN


Building Name - W.E. Wilson Elementary School


Subject - Addition of Homogeneous Area F

Amendment - Fire doors were found throughout the building that were not included in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Management Planner: Sandra Shadley

Accreditation Number: 19A002720

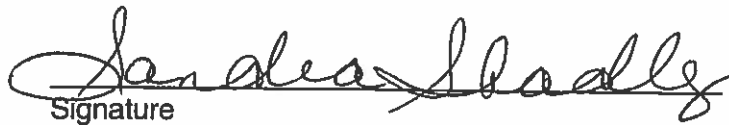
Signature


Date

REMAINING MATERIALS

Greater Clark County School Corporation

Remaining Materials Report

4/23/2020

| HA ID | HA Description | Quantity | | Asbestos | HA Location | Planned Response Action |
|---|-------------------------------------|--------------|---------|----------|--|-------------------------|
| <u>W.E. Wilson Elementary School</u> | | | | | | |
| 10-A | 9" X 9" Dark Gray | Unquantified | SF | Known | Kitchen office and Stock Room | O&M |
| 10-B | 9" X 9" Chocolate vinyl floor tile. | Unquantified | SF | Assumed | Gym Entrance | O&M |
| 10-C | 9" X 9" Light Gray vinyl floor tile | Unquantified | SF | Assumed | A wing custodial closets | O&M |
| 11 | Floor tile mastic | 18914 | SF | Assumed | Throughout building | O&M |
| A | Cove Base | Approx. 4600 | LF | Assumed | Throughout the building (Classrooms) | O&M |
| B | Cove Base Mastic | Approx. 1600 | SF | Assumed | Throughout building | O&M |
| C | White canvas shock joints on AHU's | 3 | Unit(s) | Assumed | Boiler room (one) A wing custodial closet (two) | O&M |
| D | Fittings | Approx. 18 | Unit(s) | Assumed | Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet | O&M |
| E | Fittings | Unquantified | SF | Assumed | Classrooms | O&M |
| F | Fire Doors | Unquantified | Unit(s) | Assumed | Boiler Room and Gym | O&M |

Greater Clark County School Corporation

Remaining Materials Report

1/14/2020

| HA ID | HA Description | Quantity | | Asbestos | HA Location | Planned Response Action |
|---|-------------------------------------|--------------|---------|----------|--|-------------------------|
| <u>W.E. Wilson Elementary School</u> | | | | | | |
| 10-A | 9" X 9" Dark Gray | Unquantified | SF | Known | Kitchen office and Stock Room | O&M |
| 10-B | 9" X 9" Chocolate vinyl floor tile. | Unquantified | SF | Assumed | Gym Entrance | O&M |
| 10-C | 9" X 9" Light Gray vinyl floor tile | Unquantified | SF | Assumed | A wing custodial closets | O&M |
| 11 | Floor tile mastic | 18914 | SF | Assumed | Throughout building | O&M |
| A | Cove Base | Approx. 4600 | LF | Assumed | Throughout the building (Classrooms) | O&M |
| B | Cove Base Mastic | Approx. 1600 | SF | Assumed | Throughout building | O&M |
| C | White canvas shock joints on AHU's | 3 | Unit(s) | Assumed | Boiler room (one) A wing custodial closet (two) | O&M |
| D | Fittings | Approx. 18 | Unit(s) | Assumed | Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet | O&M |
| E | Fittings | Unquantified | SF | Assumed | Classrooms | O&M |
| F | Fire Doors | Unquantified | Unit(s) | Assumed | Boiler Room and Gym | O&M |

Greater Clark County School Corporation

Remaining Materials Report

5/16/2019

| HA ID | HA Description | Quantity | | Asbestos | HA Location | Planned Response Action |
|---|-------------------------------------|--------------|---------|----------|--|-------------------------|
| <u>W.E. Wilson Elementary School</u> | | | | | | |
| 10-A | 9" X 9" Dark Gray | Unquantified | SF | Known | Kitchen office and Stock Room | O&M |
| 10-B | 9" X 9" Chocolate vinyl floor tile. | Unquantified | SF | Assumed | Gym Entrance | O&M |
| 10-C | 9" X 9" Light Gray vinyl floor tile | Unquantified | SF | Assumed | A wing custodial closets | O&M |
| 11 | Floor tile mastic | 18914 | SF | Assumed | Throughout building | O&M |
| A | Cove Base | Approx. 4600 | LF | Assumed | Throughout the building (Classrooms) | O&M |
| B | Cove Base Mastic | Approx. 1600 | SF | Assumed | Throughout building | O&M |
| C | White canvas shock joints on AHU's | 3 | Unit(s) | Assumed | Boiler room (one) A wing custodial closet (two) | O&M |
| D | Fittings | Approx. 18 | Unit(s) | Assumed | Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet | O&M |
| E | Fittings | Unquantified | SF | Assumed | Classrooms | O&M |
| F | Fire Doors | Unquantified | Unit(s) | Assumed | Boiler Room and Gym | O&M |

Greater Clark County School Corporation

Remaining Materials Report

11/13/2018

| HA ID | HA Description | Quantity | | Asbestos | HA Location | Planned Response Action |
|---|-------------------------------------|--------------|---------|----------|--|-------------------------|
| <u>W.E. Wilson Elementary School</u> | | | | | | |
| 10-A | 9" X 9" Dark Gray | Unquantified | SF | Known | Kitchen office and Stock Room | O&M |
| 10-B | 9" X 9" Chocolate vinyl floor tile. | Unquantified | SF | Assumed | Gym Entrance | O&M |
| 10-C | 9" X 9" Light Gray vinyl floor tile | Unquantified | SF | Assumed | A wing custodial closets | O&M |
| 11 | Floor tile mastic | 18914 | SF | Assumed | Throughout building | O&M |
| A | Cove Base | Approx. 4600 | LF | Assumed | Throughout the building (Classrooms) | O&M |
| B | Cove Base Mastic | Approx. 1600 | SF | Assumed | Throughout building | O&M |
| C | White canvas shock joints on AHU's | 3 | Unit(s) | Assumed | Boiler room (one) A wing custodial closet (two) | O&M |
| D | Fittings | Approx. 18 | Unit(s) | Assumed | Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet | O&M |
| E | Fittings | Unquantified | SF | Assumed | Classrooms | O&M |
| F | Fire Doors | Unquantified | Unit(s) | Assumed | Boiler Room and Gym | O&M |

Greater Clark County School Corporation

Remaining Materials Report

5/2/2018

| HA ID | HA Description | Quantity | | Asbestos | HA Location | Planned Response Action |
|---|-------------------------------------|--------------|---------|----------|--|-------------------------|
| <u>W.E. Wilson Elementary School</u> | | | | | | |
| 10-A | 9" X 9" Dark Gray | Unquantified | SF | Known | Kitchen office and Stock Room | O&M |
| 10-B | 9" X 9" Chocolate vinyl floor tile. | Unquantified | SF | Assumed | Gym Entrance | O&M |
| 10-C | 9" X 9" Light Gray vinyl floor tile | Unquantified | SF | Assumed | A wing custodial closets | O&M |
| 11 | Floor tile mastic | 18914 | SF | Assumed | Throughout building | O&M |
| A | Cove Base | Approx. 4600 | LF | Assumed | Throughout the building (Classrooms) | O&M |
| B | Cove Base Mastic | Approx. 1600 | SF | Assumed | Throughout building | O&M |
| C | White canvas shock joints on AHU's | 3 | Unit(s) | Assumed | Boiler room (one) A wing custodial closet (two) | O&M |
| D | Fittings | Approx. 18 | Unit(s) | Assumed | Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet | O&M |
| E | Fittings | Unquantified | SF | Assumed | Classrooms | O&M |
| F | Fire Doors | Unquantified | Unit(s) | Assumed | Boiler Room and Gym | O&M |

Greater Clark County School Corporation

Remaining Materials Report

10/18/2017

| HA ID | HA Description | Quantity | | Asbestos | HA Location | Planned Response Action |
|---|-------------------------------------|--------------|---------|----------|--|-------------------------|
| <u>W.E. Wilson Elementary School</u> | | | | | | |
| 10-A | 9" X 9" Dark Gray | Unquantified | SF | Known | Kitchen office and Stock Room | O&M |
| 10-B | 9" X 9" Chocolate vinyl floor tile. | Unquantified | SF | Assumed | Gym Entrance | O&M |
| 10-C | 9" X 9" Light Gray vinyl floor tile | Unquantified | SF | Assumed | A wing custodial closets | O&M |
| 11 | Floor tile mastic | 18914 | SF | Assumed | Throughout building | O&M |
| A | Cove Base | Approx. 4600 | LF | Assumed | Throughout the building (Classrooms) | O&M |
| B | Cove Base Mastic | Approx. 1600 | SF | Assumed | Throughout building | O&M |
| C | White canvas shock joints on AHU's | 3 | Unit(s) | Assumed | Boiler room (one) A wing custodial closet (two) | O&M |
| D | Fittings | Approx. 18 | Unit(s) | Assumed | Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet | O&M |
| E | Fittings | Unquantified | SF | Assumed | Classrooms | O&M |
| F | Fire Doors | Unquantified | Unit(s) | Assumed | Boiler Room and Gym | O&M |

Greater Clark County School Corporation

Remaining Materials Report

4/13/2017

| HA ID | HA Description | Quantity | | Asbestos | HA Location | Planned Response Action |
|---|-------------------------------------|--------------|---------|----------|--|-------------------------|
| <u>W.E. Wilson Elementary School</u> | | | | | | |
| 10-A | 9" X 9" Dark Gray | Unquantified | SF | Known | Kitchen office and Stock Room | O&M |
| 10-B | 9" X 9" Chocolate vinyl floor tile. | Unquantified | SF | Assumed | Gym Entrance | O&M |
| 10-C | 9" X 9" Light Gray vinyl floor tile | Unquantified | SF | Assumed | A wing custodial closets | O&M |
| 11 | Floor tile mastic | 18914 | SF | Assumed | Throughout building | O&M |
| A | Cove Base | Approx. 4600 | LF | Assumed | Throughout the building (Classrooms) | O&M |
| B | Cove Base Mastic | Approx. 1600 | SF | Assumed | Throughout building | O&M |
| C | White canvas shock joints on AHU's | 3 | Unit(s) | Assumed | Boiler room (one) A wing custodial closet (two) | O&M |
| D | Fittings | Approx. 18 | Unit(s) | Assumed | Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet | O&M |
| E | Fittings | Unquantified | SF | Assumed | Classrooms | O&M |
| F | Fire Doors | Unquantified | Unit(s) | Assumed | Boiler Room and Gym | O&M |

Greater Clark County School Corporation

Remaining Materials Report

11/3/2016

| HA ID | HA Description | Quantity | | Asbestos | HA Location | Planned Response Action |
|---|-------------------------------------|--------------|---------|----------|--|-------------------------|
| <u>W.E. Wilson Elementary School</u> | | | | | | |
| 10-A | 9" X 9" Dark Gray | Unquantified | SF | Known | Kitchen office and Stock Room | O&M |
| 10-B | 9" X 9" Chocolate vinyl floor tile. | Unquantified | SF | Assumed | Gym Entrance | O&M |
| 10-C | 9" X 9" Light Gray vinyl floor tile | Unquantified | SF | Assumed | A wing custodial closets | O&M |
| 11 | Floor tile mastic | 18914 | SF | Assumed | Throughout building | O&M |
| A | Cove Base | Approx. 4600 | LF | Assumed | Throughout the building (Classrooms) | O&M |
| B | Cove Base Mastic | Approx. 1600 | SF | Assumed | Throughout building | O&M |
| C | White canvas shock joints on AHU's | 3 | Unit(s) | Assumed | Boiler room (one) A wing custodial closet (two) | O&M |
| D | Fittings | Approx. 18 | Unit(s) | Assumed | Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet | O&M |
| E | Fittings | Unquantified | SF | Assumed | Classrooms | O&M |
| F | Fire Doors | Unquantified | Unit(s) | Assumed | Boiler Room and Gym | O&M |

Greater Clark County School Corporation

Remaining Materials Report

4/28/2016

| HA ID | HA Description | Quantity | | Asbestos | HA Location | Planned Response Action |
|---|-------------------------------------|--------------|---------|----------|--|-------------------------|
| <u>W.E. Wilson Elementary School</u> | | | | | | |
| 10-A | 9" X 9" Dark Gray | Unquantified | SF | Known | Kitchen office and Stock Room | O&M |
| 10-B | 9" X 9" Chocolate vinyl floor tile. | Unquantified | SF | Assumed | Gym Entrance | O&M |
| 10-C | 9" X 9" Light Gray vinyl floor tile | Unquantified | SF | Assumed | A wing custodial closets | O&M |
| 11 | Floor tile mastic | 18914 | SF | Assumed | Throughout building | O&M |
| A | Cove Base | Approx. 4600 | LF | Assumed | Throughout the building (Classrooms) | O&M |
| B | Cove Base Mastic | Approx. 1600 | SF | Assumed | Throughout building | O&M |
| C | White canvas shock joints on AHU's | 3 | Unit(s) | Assumed | Boiler room (one) A wing custodial closet (two) | O&M |
| D | Fittings | Approx. 18 | Unit(s) | Assumed | Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet | O&M |
| E | Fittings | Unquantified | SF | Assumed | Classrooms | O&M |
| F | Fire Doors | Unquantified | Unit(s) | Assumed | Boiler Room and Gym | O&M |

Greater Clark County School Corporation

Remaining Materials Report

10/20/2015

| HA ID | HA Description | Quantity | | Asbestos | HA Location | Planned Response Action |
|---|-------------------------------------|--------------|---------|----------|--|-------------------------|
| <u>W.E. Wilson Elementary School</u> | | | | | | |
| 10-A | 9" X 9" Dark Gray | Unquantified | SF | Known | Kitchen office and Stock Room | O&M |
| 10-B | 9" X 9" Chocolate vinyl floor tile. | Unquantified | SF | Assumed | Gym Entrance | O&M |
| 10-C | 9" X 9" Light Gray vinyl floor tile | Unquantified | SF | Assumed | A wing custodial closets | O&M |
| 11 | Floor tile mastic | 18914 | SF | Assumed | Throughout building | O&M |
| A | Cove Base | Approx. 4600 | LF | Assumed | Throughout the building (Classrooms) | O&M |
| B | Cove Base Mastic | Approx. 1600 | SF | Assumed | Throughout building | O&M |
| C | White canvas shock joints on AHU's | 3 | Unit(s) | Assumed | Boiler room (one) A wing custodial closet (two) | O&M |
| D | Fittings | Approx. 18 | Unit(s) | Assumed | Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet | O&M |
| E | Fittings | Unquantified | SF | Assumed | Classrooms | O&M |
| F | Fire Doors | Unquantified | Unit(s) | Assumed | Boiler Room and Gym | O&M |

Greater Clark County Schools
Remaining Materials Report
April 22, 2015

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|-------------------------------------|------------------|----------|--|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| 10-A | 9" X 9" Dark Gray | Unquantified SF | Y | Kitchen office and Stock Room | O & M |
| 10-B | 9" X 9" Chocolate vinyl floor tile. | Unquantified SF | A | Gym Entrance | O & M |
| 10-C | 9" X 9" Light Gray vinyl floor tile | Unquantified SF | A | A wing custodial closets | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building (Classrooms) | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 3 Eac | A | Boiler room (one) A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |
| F | Fire Doors | Unquantified Ea | A | Boiler Room and Gym | O & M |

Greater Clark County Schools
Remaining Materials Report
October 22, 2014

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|-------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| 10-A | 9" X 9" Dark Gray | Unquantified SF | Y | Kitchen office and Stock Room | O & M |
| 10-B | 9" X 9" Chocolate vinyl floor tile. | Unquantified SF | A | Gym Entrance | O & M |
| 10-C | 9" X 9" Light Gray vinyl floor tile | Unquantified SF | A | A wing custodial closets | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building (Classrooms) | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 3 Eac | A | Boiler room (one) A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium west wall and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |
| F | Fire Doors | Unquantified Ea | A | Boiler Room and Gym | O & M |

Greater Clark County Schools
Remaining Materials Report
April 21, 2014

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|-------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| 10-A | 9" X 9" Dark Gray | Unquantified SF | Y | Kitchen office and Stock Room | O & M |
| 10-B | 9" X 9" Chocolate vinyl floor tile. | Unquantified SF | A | Gym Entrance | O & M |
| 10-C | 9" X 9" Light Gray vinyl floor tile | Unquantified SF | A | A wing custodial closets | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building (Classrooms) | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 3 Eac | A | Boiler room (one) A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium west wall and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |
| F | Fire Doors | Unquantified Ea | A | Boiler Room and Gym | O & M |

Greater Clark County Schools
Remaining Materials Report
April 24, 2013

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|-------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| 10-A | 9" X 9" Dark Gray | Unquantified SF | Y | Kitchen office and Stock Room | O & M |
| 10-B | 9" X 9" Chocolate vinyl floor tile. | Unquantified SF | A | Gym Entrance | O & M |
| 10-C | 9" X 9" Light Gray vinyl floor tile | Unquantified SF | A | A wing custodial closets | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building (Classrooms) | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 3 Eac | A | Boiler room (one) A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium west wall and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |
| F | Fire Doors | Unquantified Ea | A | Boiler Room and Gym | O & M |

**Greater Clark County Schools
Remaining Materials Report
April 18, 2014**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|-------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| 10-A | 9" X 9" Dark Gray | Unquantified SF | Y | Kitchen office and Stock Room | O & M |
| 10-B | 9" X 9" Chocolate vinyl floor tile. | Unquantified SF | A | Gym Entrance | O & M |
| 10-C | 9" X 9" Light Gray vinyl floor tile | Unquantified SF | A | A wing custodial closets | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building (Classrooms) | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 3 Eac | A | Boiler room (one) A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium west wall and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |
| F | Fire Doors | Unquantified Ea | A | Boiler Room and Gym | O & M |

Greater Clark County Schools
Remaining Materials Report
October 24, 2012

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|-------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| 10-A | 9" X 9" Dark Gray | Unquantified SF | Y | Kitchen office and Stock Room | O & M |
| 10-B | 9" X 9" Chocolate vinyl floor tile. | Unquantified SF | A | Gym Entrance | O & M |
| 10-C | 9" X 9" Light Gray vinyl floor tile | Unquantified SF | A | A wing custodial closets | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building (Classrooms) | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 3 Eac | A | Boiler room (one) A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium west wall and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |
| F | Fire Doors | Unquantified Ea | A | Boiler Room and Gym | O & M |

Greater Clark County Schools
Remaining Materials Report
June 25, 2012

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|-------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| 10-A | 9" X 9" Dark Gray | Unquantified SF | Y | Kitchen office and Stock Room | O & M |
| 10-B | 9" X 9" Chocolate vinyl floor tile. | Unquantified SF | A | Gym Entrance | O & M |
| 10-C | 9" X 9" Light Gray vinyl floor tile | Unquantified SF | A | A wing custodial closets | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building (Classrooms) | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 3 Eac | A | Boiler room (one) A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium west wall and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |
| F | Fire Doors | Unquantified Ea | A | Boiler Room and Gym | O & M |

**Greater Clark County Schools
Remaining Materials Report
June 27, 2011**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|-------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| 10-A | 9" X 9" Dark Gray | Unquantified SF | Y | Kitchen office and Stock Room | O & M |
| 10-B | 9" X 9" Chocolate vinyl floor tile. | Unquantified SF | A | Gym Entrance | O & M |
| 10-C | 9" X 9" Light Gray vinyl floor tile | Unquantified SF | A | A wing custodial closets | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 3 Eac | A | Boiler room (one) A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium west wall and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |
| F | Fire Doors | Unquantified Ea | A | Boiler Room and Gym | O & M |

**Greater Clark County Schools
Remaining Materials Report
December 6, 2010**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 18,914 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 3 Eac | A | Boiler room (one) A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium west wall and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |
| F | Fire Doors | Unquantified Ea | A | Boiler Room and Gym | O & M |

**Greater Clark County Schools
Remaining Materials Report
June 30, 2010**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 18,914 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 3 Eac | A | Boiler room (one) A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium west wall and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |
| F | Fire Doors | Unquantified Ea | A | Boiler Room and Gym | O & M |

Greater Clark County Schools
Remaining Materials Report
December 7, 2009

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 18,914 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 Eac | A | Boiler room (two) and A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

**Greater Clark County Schools
Remaining Materials Report
June 10, 2009**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 18,914 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 Eac | A | Boiler room (two) and A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

**Greater Clark County Schools
Remaining Materials Report
December 10, 2008**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 18,914 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 Eac | A | Boiler room (two) and A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

**Greater Clark County Schools
Remaining Materials Report
June 30, 2008**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 18,914 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 Eac | A | Boiler room (two) and A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

**Greater Clark County Schools
Remaining Materials Report
December 14, 2007**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 18,914 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 Eac | A | Boiler room (two) and A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

**Greater Clark County Schools
Remaining Materials Report
July 9, 2007**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 18,914 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 Eac | A | Boiler room (two) and A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

**Greater Clark County Schools
Remaining Materials Report
December 18, 2006**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 18,914 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 Eac | A | Boiler room (two) and A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

**Greater Clark County Schools
Remaining Materials Report
June 28, 2006**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 18,914 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 Eac | A | Boiler room (two) and A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

**Greater Clark County Schools
Remaining Materials Report
January 25, 2006**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 18,914 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 Eac | A | Boiler room (two) and A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Eac | A | Gymnasium and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

**Greater Clark County Schools
Remaining Materials Report
July 20, 2005**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 18,914 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 Each | A | Boiler room (two) and A wing custodial closet (two) | O & M |
| D | Fittings | Approx. 18 Each | A | Gymnasium and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

Greater Clark County Schools
Remaining Materials Report
December 9, 2004

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 18,914 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 , Each | A | Boiler room and A wing custodial closet | O & M |
| D | Fittings | Approx. 18 Each | A | Gymnasium and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

Greater Clark County Schools
Remaining Materials Report
July 2, 2004

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 18,914 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 Each | A | Boiler room and A wing custodial closet | O & M |
| D | Fittings | Approx. 18 Each | A | Gymnasium and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

**Greater Clark County Schools
Remaining Materials Report
December 9, 2003**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 18,914 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 Each | A | Boiler room and A wing custodial closet | O & M |
| D | Fittings | Approx. 18 Each | A | Gymnasium and "A" wing custodial closet | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

**Greater Clark County Schools
Remaining Materials Report
June 13, 2003**

| HA# | Material | Quantity | | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|---------------|------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | | |
| 10 | VAT (various colors & sizes) | 18,914 | SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 18,914 | SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 | LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 | SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 | Each | A | Boiler room and A wing custodial closet | O & M |
| D | Fittings | Approx. 18 | Each | A | Gymnasium and custodial room | O & M |
| E | Fittings | Unquantified | SF | A | Classrooms | O & M |

**Greater Clark County Schools
Remaining Materials Report
December 18, 2003**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 18,914 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 18,914 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 Each | A | Boiler room and A wing custodial closet | O & M |
| D | Fittings | Approx. 18 Each | A | Gymnasium and custodial room | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

**Greater Clark County Schools
Remaining Materials Report
June 19, 2002**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 28,814 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 28,814 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 Each | A | Boiler room and A wing custodial closet | O & M |
| D | Fittings | Approx. 18 Each | A | Gymnasium and custodial room | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

**Greater Clark County Schools
Remaining Materials Report
December 12, 2001**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 28,814 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 28,814 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 Each | A | Boiler room and A wing custodial closet | O & M |
| D | Fittings | Approx. 18 Each | A | Gymnasium and custodial room | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

**Greater Clark County Schools
Remaining Materials Report
July 12, 2001**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 28,814 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 28,814 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 Each | A | Boiler room and A wing custodial closet | O & M |
| D | Fittings | Approx. 18 Each | A | Gymnasium and custodial room | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

**Greater Clark County Schools
Remaining Materials Report
January 11, 2001**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------------|------------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 28,814 SF | Y | Various locations throughout the building | O & M |
| 11 | Floor tile mastic | 28,814 SF | A | Throughout the building | O & M |
| A | Cove base | Approx. 4,600 LF | A | Throughout the building | O & M |
| B | Cove base mastic | Approx. 1,600 SF | A | Throughout the building | O & M |
| C | White canvas shock joints on AHU's | 4 Each | A | Boiler room and A wing custodial closet | O & M |
| D | Fittings | Approx. 18 Each | A | Gymnasium and custodial room | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

**Greater Clark County Schools
Remaining Materials Report
June 29, 2000**

| HA# | Material | Quantity | ACBM | Y/A | Location | Planned Activities |
|--|------------------------------------|--------------|------|-----|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | | |
| 10 | VAT (various colors & sizes) | 28814 | SF | Y | Various locations throughout the building | O & M |
| 11 | Floor Tile Mastic | 28814 | SF | A | Throughout the building | O & M |
| A | Cove Base | Unquantified | LF | A | Throughout the building | O & M |
| B | Cove Base Mastic | Unquantified | LF | A | Throughout the building | O & M |
| C | White Canvas Shock Joints on AHU's | 4 | Each | A | Boiler room and A wing custodial closet | O & M |
| D | Fittings | Approx. 18 | Each | A | Gymnasium and custodial room | O & M |
| E | Fittings | Unquantified | SF | A | Classrooms | O & M |

**Greater Clark County Schools
Remaining Materials Report
February 23, 2000**

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|------------------------------|-----------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT (various colors & sizes) | 28814 SF | Y | Various locations throughout the building | O & M |
| 11 | Mastic | 28814 SF | A | Throughout the building | O & M |
| A | Cove Base | Unquantified LF | A | Throughout the building | O & M |
| B | Cove Base Mastic | Unquantified LF | A | Throughout the building | O & M |
| C | Shock Joints on AHV's | Unquantified SF | A | Throughout the building | O & M |
| D | Fittings | Approx. 18 Each | A | Gymnasium and custodial room | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

Greater Clark County Schools
Remaining Materials Report
July 6, 1999

| HA# | Material | Quantity | ACBM Y/A | Location | Planned Activities |
|--|-----------------------|-----------------|----------|---|--------------------|
| <u>W. E. Wilson Elementary School</u> | | | | | |
| 10 | VAT | 28814 SF | Y | Various locations throughout the building | O & M |
| 11 | Mastic | 28814 SF | A | Throughout Building | O & M |
| A | Cove Base | Unquantified LF | A | Throughout the building | O & M |
| B | Cove Base Mastic | Unquantified LF | A | Throughout the building | O & M |
| C | Shock Joints on AHV's | Unquantified SF | A | Throughout Building | O & M |
| D | Fittings | Unquantified SF | A | Gymnasium and Custodial Room | O & M |
| E | Fittings | Unquantified SF | A | Classrooms | O & M |

*PERIODIC SURVEILLANCE
REINSPECTION
ADDITIONAL BULK SAMPLING
INFORMATION*

ASSESSMENTS FOR AHERA

1. Damaged or significantly damaged thermal systems insulation.
2. Damaged friable surfacing ACM.
3. Significantly damaged friable surfacing ACM.
4. Damaged or significantly damaged friable miscellaneous ACM.
5. ACBM with potential for damage.
6. ACBM with potential for significant damage.
7. Any remaining friable ACBM or friable suspected ACBM.

If a material is non-friable, it does not require an assessment rating under AHERA.

Due to the differences in what is required of the LEA for damaged material compared to significantly damaged material, Alliance has modified the assessment scale to the following:

- 1A. Significantly damaged thermal systems insulation.
- 1B. Damaged thermal systems insulation.
- 4A. Significantly damaged friable miscellaneous ACM.
- 4B. Damaged friable miscellaneous ACM.

PERIODIC SURVEILLANCES

SURVEILLANCE INFORMATION

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

| DATE PLANNED | DATE COMPLETED | COMPLETED BY |
|---------------------|-----------------------|---|
| <u>October 2014</u> | October 22, 2014 |  |
| <u>April 2015</u> | April 22, 2015 |  |
| <u>October 2015</u> | October 20, 2016 |  |
| <u>April 2016</u> | RE-INSPECTION |  |
| <u>October 2016</u> | November 3, 2016 |  |
| <u>April 2017</u> | April 13, 2017 |  |
| <u>October 2017</u> | October 18, 2017 |  |
| <u>April 2018</u> | May 2, 2018 |  |
| <u>October 2018</u> | November 13, 2018 |  |
| <u>April 2019</u> | RE-INSPECTION |  |
| <u>October 2019</u> | January 14, 2020 |  |
| <u>April 2020</u> | April 23, 2020 |  |
| <u>October 2020</u> | | |

SURVEILLANCE INFORMATION

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

| | | |
|---------------------|---------------|-------|
| <u>April 2021</u> | _____ | _____ |
| <u>October 2021</u> | _____ | _____ |
| <u>April 2022</u> | RE-INSPECTION | _____ |
| <u>October 2022</u> | _____ | _____ |
| <u>April 2023</u> | _____ | _____ |
| <u>October 2023</u> | _____ | _____ |
| <u>April 2024</u> | _____ | _____ |
| <u>October 2024</u> | _____ | _____ |
| <u>April 2025</u> | RE-INSPECTION | _____ |
| <u>October 2025</u> | _____ | _____ |
| <u>April 2026</u> | _____ | _____ |
| <u>October 2026</u> | _____ | _____ |

SURVEILLANCE INFORMATION

PERIODIC SURVEILLANCE PLAN SCHEDULE

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

| <u>DATE PLANNED</u> | <u>DATE COMPLETED</u> | <u>COMPLETED BY</u> |
|----------------------|-----------------------|----------------------|
| <u>JUNE 2009</u> | <u>JUNE 2009</u> | <u>Bill Ogle</u> |
| <u>DECEMBER 2009</u> | <u>Dec 2009</u> | <u>Bill Ogle</u> |
| <u>JUNE 2010</u> | <u>Reinspection</u> | <u>Sandy Shadley</u> |
| <u>DECEMBER 2010</u> | <u>December 2010</u> | <u>Paul Brick</u> |
| <u>JUNE 2011</u> | <u>June 2011</u> | <u>Sandy Shadley</u> |
| <u>DECEMBER 2011</u> | | |
| <u>JUNE 2012</u> | <u>June 2012</u> | <u>Jeff Hechtin</u> |
| <u>DECEMBER 2012</u> | <u>October 2012</u> | <u>Jeff Hechtin</u> |
| <u>JUNE 2013</u> | <u>Reinspection</u> | <u>Jeff Hechtin</u> |
| <u>DECEMBER 2013</u> | | |

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each reinspection will be maintained in this binder.

| <u>DATE PLANNED</u> | <u>DATE COMPLETED</u> | <u>COMPLETED BY</u> |
|----------------------|---|---------------------|
| <u>JUNE 2003</u> | <u>June '03</u> | <u>C. Sparks</u> |
| <u>DECEMBER 2003</u> | <u>Dec. '03</u> | <u>C. Sparks</u> |
| <u>JUNE 2004</u> | <u>REINSPECTION</u> | <u>C. Sparks</u> |
| <u>DECEMBER 2004</u> | <u>Dec. '04</u> | <u>C. Sparks</u> |
| <u>JUNE 2005</u> | <u>July '05</u> | <u>J. Ogle</u> |
| <u>DECEMBER 2005</u> | <u>Jan 06</u> | <u>Bogler</u> |
| <u>JUNE 2006</u> | <u>June 06</u> | <u>C. Ames</u> |
| <u>DECEMBER 2006</u> | <u>Dec 06</u> | <u>Bogler</u> |
| <u>JUNE 2007</u> | <u>July 2007</u> <u>REINSPECTION</u> | <u>Bill Ogle</u> |
| <u>DECEMBER 2007</u> | <u>December 2007</u> | <u>Bill Ogle</u> |
| <u>JUNE 2008</u> | <u>June 2008</u> | <u>Bill Ogle</u> |
| <u>DECEMBER 2008</u> | <u>December 2008</u> | <u>Bill Ogle</u> |

PERIODIC SURVEILLANCE PLANGREATER CLARK COUNTY SCHOOLSWILSON ELEMENTARY SCHOOL

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long they remain in the building. This inspection will be conducted semi-annually.

The following table outlines the dates on which these inspections should take place in this school building.

PERIODIC SURVEILLANCE SCHEDULE

| <u>DATE PLANNED</u> | <u>DATE COMPLETED</u> | <u>COMPLETED BY</u> |
|----------------------|-----------------------|---------------------|
| <u>DECEMBER 1995</u> | <u>12 - 95</u> | <u>Alliance</u> |
| <u>JUNE 1996</u> | <u>6 - 96</u> | <u>Alliance</u> |
| <u>DECEMBER 1996</u> | <u>12 - 96</u> | <u>Alliance</u> |
| <u>JUNE 1997</u> | <u>7 - 97</u> | <u>Alliance</u> |
| <u>DECEMBER 1997</u> | <u>1 - 98</u> | <u>Alliance</u> |
| <u>JUNE 1998</u> | <u>REINSPECTION</u> | <u>Alliance</u> |
| <u>DECEMBER 1998</u> | <u>12 - 98</u> | <u>Alliance</u> |
| <u>JUNE 1999</u> | <u>June '99</u> | <u>Alliance</u> |
| <u>DECEMBER 1999</u> | <u>Dec. '99</u> | <u>Alliance</u> |
| <u>JUNE 2000</u> | <u>June 2000</u> | <u>Alliance</u> |
| <u>DECEMBER 2000</u> | <u>Jan. '01</u> | <u>Pat Wilson</u> |
| <u>JUNE 2001</u> | <u>REINSPECTION</u> | <u>P. Wilson</u> |
| <u>DECEMBER 2001</u> | <u>Dec. '01</u> | <u>A. Kimbrough</u> |
| <u>JUNE 2002</u> | <u>June '02</u> | <u>R. Calvert</u> |
| <u>DECEMBER 2002</u> | <u>Dec. '02</u> | <u>C. Spraker</u> |

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID 10-A

HA Description 9" X 9" Dark Gray

HA Type Miscellaneous Material

HA Location Kitchen office and Stock Room

Quantity Unquantified SF

Comments This area has some broken edges. This material was not in poor condition overall.

Asbestos Known

Friable No

Original Inspection 6/1/1992

Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 10-B
HA Description 9" X 9" Chocolate vinyl floor tile.
HA Type Miscellaneous Material
HA Location Gym Entrance

Quantity Unquantified SF
Comments This material overall was not in poor condition. There are broken edge pieces missing in the gynasium entry and storage area. Some tiles have been replaced
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID 10-C

HA Description 9" X 9" Light Gray vinyl floor tile

HA Type Miscellaneous Material

HA Location A wing custodial closets

Quantity Unquantified SF

Comments This material overall is not in poor condition. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 11
HA Description Floor tile mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 18914 SF
Comments Where exposed, this material was not in poor condition.
Asbestos Assumed
Friable No

Original Inspection 6/1/1992
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the building (Classrooms)

Quantity Approx. 4600 LF
Comments This material showed minor normal wear and tear, but was not in poor condition overall.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector 
Michael J. Ardis

State IN
Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID B

HA Description Cove Base Mastic

HA Type Miscellaneous Material

HA Location Throughout building

Quantity Approx. 1600 SF

Comments This material was not exposed to inspect.

Asbestos Assumed

Friable No

Original Inspection 5/31/1995

Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID C
HA Description White canvas shock joints on AHU's
HA Type Miscellaneous Material
HA Location Boiler room (one) A wing custodial closet (two)

Quantity 3 Unit(s)

Comments There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Asbestos Assumed

Friable No

Original Inspection 5/31/1995

Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID D
HA Description Fittings
HA Type Thermal System Insulation (TSI)
HA Location Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet

Quantity Approx. 18 Unit(s)
Comments Tear on fitting above the kitchen restroom. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID E

HA Description Fittings

HA Type Miscellaneous Material

HA Location Classrooms

Quantity Unquantified SF

Comments It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Asbestos Assumed

Friable No

Original Inspection 5/31/1995

Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID F

HA Description Fire Doors

HA Type Miscellaneous Material

HA Location Boiler Room and Gym

Quantity Unquantified Unit(s)

Comments Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 6/30/2010

Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 10-A
HA Description 9" X 9" Dark Gray
HA Type Miscellaneous Material
HA Location Kitchen office and Stock Room

Quantity Unquantified SF
Comments This area has some broken edges. This material was not in poor condition overall.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration


Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID 10-B

HA Description 9" X 9" Chocolate vinyl floor tile.

HA Type Miscellaneous Material

HA Location Gym Entrance

Quantity Unquantified SF

Comments This material overall was not in poor condition. There are broken edge pieces missing in the gynasium entry and storage area. Some tiles have been replaced

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID 10-C

HA Description 9" X 9" Light Gray vinyl floor tile

HA Type Miscellaneous Material

HA Location A wing custodial closets

Quantity Unquantified SF

Comments This material overall is not in poor condition. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 11
HA Description Floor tile mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 18914 SF
Comments Where exposed, this material was not in poor condition.
Asbestos Assumed
Friable No

Original Inspection 6/1/1992
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the building (Classrooms)

Quantity Approx. 4600 LF
Comments This material showed minor normal wear and tear, but was not in poor condition overall.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity Approx. 1600 SF
Comments This material was not exposed to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID C
HA Description White canvas shock joints on AHU's
HA Type Miscellaneous Material
HA Location Boiler room (one) A wing custodial closet (two)

Quantity 3 Unit(s)

Comments There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Asbestos Assumed

Friable No

Original Inspection 5/31/1995

Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID D
HA Description Fittings
HA Type Thermal System Insulation (TSI)
HA Location Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet

Quantity Approx. 18 Unit(s)
Comments Tear on fitting above the kitchen restroom. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID E
HA Description Fittings
HA Type Miscellaneous Material
HA Location Classrooms

Quantity Unquantified SF
Comments It is believed the fittings are encased behind the dry wall and are not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector 
Michael J. Ardis

State IN
Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID F

HA Description Fire Doors

HA Type Miscellaneous Material

HA Location Boiler Room and Gym

Quantity Unquantified Unit(s)

Comments Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 6/30/2010

Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 10-A
HA Description 9" X 9" Dark Gray
HA Type Miscellaneous Material
HA Location Kitchen office and Stock Room

Quantity Unquantified SF
Comments This area has some broken edges. This material was not in poor condition overall.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 10-B
HA Description 9" X 9" Chocolate vinyl floor tile.
HA Type Miscellaneous Material
HA Location Gym Entrance

Quantity Unquantified SF
Comments This material overall was not in poor condition. There are broken edge pieces missing in the gynosium entry and storage area. Some tiles have been replaced
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 10-C
HA Description 9" X 9" Light Gray vinyl floor tile
HA Type Miscellaneous Material
HA Location A wing custodial closets

Quantity Unquantified SF
Comments This material overall is not in poor condition. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 11
HA Description Floor tile mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 18914 SF
Comments Where exposed, this material was not in poor condition.
Asbestos Assumed
Friable No

Original Inspection 6/1/1992
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the building (Classrooms)

Quantity Approx. 4600 LF
Comments This material showed minor normal wear and tear, but was not in poor condition overall.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity Approx. 1600 SF
Comments This material was not exposed to inspect.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID C
HA Description White canvas shock joints on AHU's
HA Type Miscellaneous Material
HA Location Boiler room (one) A wing custodial closet (two)

Quantity 3 Unit(s)
Comments There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 11/13/2018

Material Assessment


Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID D
HA Description Fittings
HA Type Thermal System Insulation (TSI)
HA Location Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet

Quantity Approx. 18 Unit(s)
Comments Tear on fitting above the kitchen restroom. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 11/13/2018

Material Assessment


Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID E
HA Description Fittings
HA Type Miscellaneous Material
HA Location Classrooms

Quantity Unquantified SF
Comments It is believed the fittings are encased behind the dry wall and are not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID F

HA Description Fire Doors

HA Type Miscellaneous Material

HA Location Boiler Room and Gym

Quantity Unquantified Unit(s)

Comments Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 6/30/2010

Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration


Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 10-A
HA Description 9" X 9" Dark Gray
HA Type Miscellaneous Material
HA Location Kitchen office and Stock Room

Quantity Unquantified SF
Comments This area has some broken edges. This material was not in poor condition overall.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration


Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 10-B
HA Description 9" X 9" Chocolate vinyl floor tile.
HA Type Miscellaneous Material
HA Location Gym Entrance

Quantity Unquantified SF
Comments This material overall was not in poor condition. There are broken edge pieces missing in the gynasium entry and storage area. Some tiles have been replaced
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID 10-C

HA Description 9" X 9" Light Gray vinyl floor tile

HA Type Miscellaneous Material

HA Location A wing custodial closets

Quantity Unquantified SF

Comments This material overall is not in poor condition. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 11
HA Description Floor tile mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 18914 SF
Comments Where exposed, this material was not in poor condition.
Asbestos Assumed
Friable No

Original Inspection 6/1/1992
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the building (Classrooms)

Quantity Approx. 4600 LF
Comments This material showed minor normal wear and tear, but was not in poor condition overall.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | | |
|--------------------------------|---|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition | |
| <u>Physical Contact</u> | | <u>Vibration</u> | <u>Air</u> |
| Low/None | | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity Approx. 1600 SF
Comments This material was not exposed to inspect.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration


Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID C
HA Description White canvas shock joints on AHU's
HA Type Miscellaneous Material
HA Location Boiler room (one) A wing custodial closet (two)

Quantity 3 Unit(s)

Comments There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Asbestos Assumed

Friable No

Original Inspection 5/31/1995

Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID D
HA Description Fittings
HA Type Thermal System Insulation (TSI)
HA Location Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet

Quantity Approx. 18 Unit(s)
Comments Tear on fitting above the kitchen restroom. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID E
HA Description Fittings
HA Type Miscellaneous Material
HA Location Classrooms

Quantity Unquantified SF
Comments It is believed the fittings are encased behind the dry wall and are not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | | |
|--------------------------------|---|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition | |
| <u>Physical Contact</u> | | <u>Vibration</u> | <u>Air</u> |
| Low/None | | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID F

HA Description Fire Doors

HA Type Miscellaneous Material

HA Location Boiler Room and Gym

Quantity Unquantified Unit(s)

Comments Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 6/30/2010

Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 10-A
HA Description 9" X 9" Dark Gray
HA Type Miscellaneous Material
HA Location Kitchen office and Stock Room

Quantity Unquantified SF
Comments This area has some broken edges. This material was not in poor condition overall.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 10/18/2017


Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector 

Dustin Hawkins

State IN
Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID 10-B

HA Description 9" X 9" Chocolate vinyl floor tile.

HA Type Miscellaneous Material

HA Location Gym Entrance

Quantity Unquantified SF

Comments This material overall was not in poor condition. There are broken edge pieces missing in the gynosium entry and storage area. Some tiles have been replaced

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID 10-C

HA Description 9" X 9" Light Gray vinyl floor tile

HA Type Miscellaneous Material

HA Location A wing custodial closets

Quantity Unquantified SF

Comments This material overall is not in poor condition. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 11
HA Description Floor tile mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 18914 SF
Comments Where exposed, this material was not in poor condition.
Asbestos Assumed
Friable No

Original Inspection 6/1/1992
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the building (Classrooms)

Quantity Approx. 4600 LF
Comments This material showed minor normal wear and tear, but was not in poor condition overall.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | | |
|---------------------------------------|-----|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition | |
| <u>Physical Contact</u> | | <u>Vibration</u> | <u>Air</u> |
| Low/None | | Low/None | Low/None |
| <u>Planned Response Action</u> | O&M | | |



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity Approx. 1600 SF
Comments This material was not exposed to inspect.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID C
HA Description White canvas shock joints on AHU's
HA Type Miscellaneous Material
HA Location Boiler room (one) A wing custodial closet (two)

Quantity 3 Unit(s)

Comments There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Asbestos Assumed

Friable No

Original Inspection 5/31/1995

Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID D
HA Description Fittings
HA Type Thermal System Insulation (TSI)
HA Location Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet

Quantity Approx. 18 Unit(s)
Comments Tear on fitting above the kitchen restroom. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID E
HA Description Fittings
HA Type Miscellaneous Material
HA Location Classrooms

Quantity Unquantified SF
Comments It is believed the fittings are encased behind the dry wall and are not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | | |
|--------------------------------|---|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition | |
| <u>Physical Contact</u> | | <u>Vibration</u> | <u>Air</u> |
| Low/None | | Low/None | Low/None |

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID F

HA Description Fire Doors

HA Type Miscellaneous Material

HA Location Boiler Room and Gym

Quantity Unquantified Unit(s)

Comments Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 6/30/2010

Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 10-A
HA Description 9" X 9" Dark Gray
HA Type Miscellaneous Material
HA Location Kitchen office and Stock Room

Quantity Unquantified SF
Comments This area has some broken edges. This material was not in poor condition overall.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | | |
|---------------------------------------|-----|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition | |
| <u>Physical Contact</u> | | <u>Vibration</u> | <u>Air</u> |
| Low/None | | Low/None | Low/None |
| <u>Planned Response Action</u> | O&M | | |

Inspector

Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID 10-B

HA Description 9" X 9" Chocolate vinyl floor tile.

HA Type Miscellaneous Material

HA Location Gym Entrance

Quantity Unquantified SF

Comments This material overall was not in poor condition. There are broken edge pieces missing in the gynosium entry and storage area. Some tiles have been replaced

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 10-C
HA Description 9" X 9" Light Gray vinyl floor tile
HA Type Miscellaneous Material
HA Location A wing custodial closets

Quantity Unquantified SF
Comments This material overall is not in poor condition. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
|--------------------------------|-------------------------|-------------------|
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 11
HA Description Floor tile mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 18914 SF
Comments Where exposed, this material was not in poor condition.
Asbestos Assumed
Friable No

Original Inspection 6/1/1992
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the building (Classrooms)

Quantity Approx. 4600 LF
Comments This material showed minor normal wear and tear, but was not in poor condition overall.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 4/13/2017


Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | | |
|---------------------------------------|-----|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition | |
| <u>Physical Contact</u> | | <u>Vibration</u> | <u>Air</u> |
| Low/None | | Low/None | Low/None |
| <u>Planned Response Action</u> | O&M | | |

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity Approx. 1600 SF
Comments This material was not exposed to inspect.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID C
HA Description White canvas shock joints on AHU's
HA Type Miscellaneous Material
HA Location Boiler room (one) A wing custodial closet (two)

Quantity 3 Unit(s)
Comments There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
|--------------------------------|-------------------------|-------------------|
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID D
HA Description Fittings
HA Type Thermal System Insulation (TSI)
HA Location Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet

Quantity Approx. 18 Unit(s)
Comments Tear on fitting above the kitchen restroom. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|---------------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |
| <u>Planned Response Action</u> | O&M | |

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID E
HA Description Fittings
HA Type Miscellaneous Material
HA Location Classrooms

Quantity Unquantified SF
Comments It is believed the fittings are encased behind the dry wall and are not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
|--------------------------------|-------------------------|-------------------|
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector

Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID F

HA Description Fire Doors

HA Type Miscellaneous Material

HA Location Boiler Room and Gym

Quantity Unquantified Unit(s)

Comments Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 6/30/2010

Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID 10-A

HA Description 9" X 9" Dark Gray

HA Type Miscellaneous Material

HA Location Kitchen office and Stock Room

Quantity Unquantified SF

Comments This area has some broken edges. This material was not in poor condition overall.

Asbestos Known

Friable No

Original Inspection 6/1/1992

Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID 10-B

HA Description 9" X 9" Chocolate vinyl floor tile.

HA Type Miscellaneous Material

HA Location Gym Entrance

Quantity Unquantified SF

Comments This material overall was not in poor condition. There are broken edge pieces missing in the gynosium entry and storage area. Some tiles have been replaced

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID 10-C

HA Description 9" X 9" Light Gray vinyl floor tile

HA Type Miscellaneous Material

HA Location A wing custodial closets

Quantity Unquantified SF

Comments This material overall is not in poor condition. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 11
HA Description Floor tile mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 18914 SF
Comments Where exposed, this material was not in poor condition.
Asbestos Assumed
Friable No

Original Inspection 6/1/1992
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the building (Classrooms)

Quantity Approx. 4600 LF
Comments This material showed minor normal wear and tear, but was not in poor condition overall.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 11/3/2016


Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | | |
|--------------------------------|---|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition | |
| <u>Physical Contact</u> | | <u>Vibration</u> | <u>Air</u> |
| Low/None | | Low/None | Low/None |

Planned Response Action O&M

Inspector 

Dustin Hawkins

State IN
Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity Approx. 1600 SF
Comments This material was not exposed to inspect.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID C
HA Description White canvas shock joints on AHU's
HA Type Miscellaneous Material
HA Location Boiler room (one) A wing custodial closet (two)

Quantity 3 Unit(s)
Comments There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID D
HA Description Fittings
HA Type Thermal System Insulation (TSI)
HA Location Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet

Quantity Approx. 18 Unit(s)
Comments Tear on fitting above the kitchen restroom. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID E
HA Description Fittings
HA Type Miscellaneous Material
HA Location Classrooms

Quantity Unquantified SF
Comments It is believed the fittings are encased behind the dry wall and are not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| <u>Percent Damaged</u> | % | Good Condition |
|--------------------------------|-------------------------|-----------------------|
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector 

Dustin Hawkins

State IN
Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID F

HA Description Fire Doors

HA Type Miscellaneous Material

HA Location Boiler Room and Gym

Quantity Unquantified Unit(s)

Comments Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 6/30/2010

Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 10-C
HA Description 9" X 9" Light Gray vinyl floor tile
HA Type Miscellaneous Material
HA Location A wing custodial closets

Quantity Unquantified SF
Comments This material overall is not in poor condition. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 11
HA Description Floor tile mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 18914 SF
Comments Where exposed, this material was not in poor condition.
Asbestos Assumed
Friable No

Original Inspection 6/1/1992
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the building (Classrooms)

Quantity Approx. 4600 LF
Comments This material showed minor normal wear and tear, but was not in poor condition overall.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity Approx. 1600 SF
Comments This material was not exposed to inspect.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID C
HA Description White canvas shock joints on AHU's
HA Type Miscellaneous Material
HA Location Boiler room (one) A wing custodial closet (two)

Quantity 3 Unit(s)
Comments There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID D
HA Description Fittings
HA Type Thermal System Insulation (TSI)
HA Location Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet

Quantity Approx. 18 Unit(s)
Comments Tear on fitting above the kitchen restroom. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID E
HA Description Fittings
HA Type Miscellaneous Material
HA Location Classrooms

Quantity Unquantified SF
Comments It is believed the fittings are encased behind the dry wall and are not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| <u>Percent Damaged</u> | % | Good Condition |
|--------------------------------|-------------------------|-----------------------|
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID F

HA Description Fire Doors

HA Type Miscellaneous Material

HA Location Boiler Room and Gym

Quantity Unquantified Unit(s)

Comments Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 6/30/2010

Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 10-A
HA Description 9" X 9" Dark Gray
HA Type Miscellaneous Material
HA Location Kitchen office and Stock Room

Quantity Unquantified SF
Comments This area has some broken edges. This material was not in poor condition overall.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID 10-B

HA Description 9" X 9" Chocolate vinyl floor tile.

HA Type Miscellaneous Material

HA Location Gym Entrance

Quantity Unquantified SF

Comments This material overall was not in poor condition. There are broken edge pieces missing in the gynasium entry and storage area. Some tiles have been replaced

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-A
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Kitchen office and Stock Room

Material Description
9" X 9" Dark Gray

Comments

This area has some broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 4/21/2015
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-B
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Gym Entrance


Material Description

9" X 9" Chocolate vinyl floor tile.

Comments

This material overall was not in poor condition. There are broken edge pieces missing in the gynasium entry and storage area. Some tiles have been replaced

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 4/21/2015
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location

A wing custodial closets


Material Description

9" X 9" Light Gray vinyl floor tile

Comments

This material overall is not in poor condition. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 4/21/2015
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M




Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 4/21/2015
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location
Throughout the building (Classrooms)


Material Description

Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 4/21/2015
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 4/21/2015
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 3 Each

Material Location
Boiler room (one) A wing custodial closet (two)

Material Description
White canvas shock joints on AHU's

Comments
There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 4/21/2015
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D

Type of Material Thermal Material

Quantity of Material Approx. 18 Each

Material Location

Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet

Material Description

Fittings

Comments

Tear on fitting above the kitchen restroom. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 4/21/2015

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039


PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 4/21/2015
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# F
Type of Material Miscellaneous Material
Quantity of Material Unquantified Ea


Material Location
Boiler Room and Gym

Material Description
Fire Doors

Comments

Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/30/2010
Current Surveillance Date 4/21/2015
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-A
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Kitchen office and Stock Room

Material Description
9" X 9" Dark Gray

Comments

This area has some broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

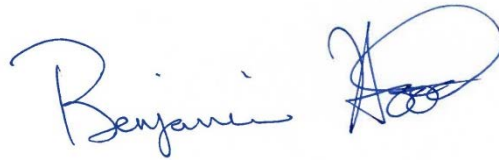

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-B
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Gym Entrance


Material Description

9" X 9" Chocolate vinyl floor tile.

Comments

This material overall was not in poor condition. There are broken edge pieces missing in the gynasium entry and storage area. Some tiles have been replaced

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

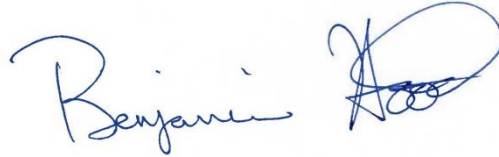

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location

A wing custodial closets


Material Description

9" X 9" Light Gray vinyl floor tile

Comments

This material overall is not in poor condition. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

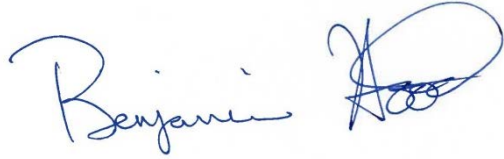


Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

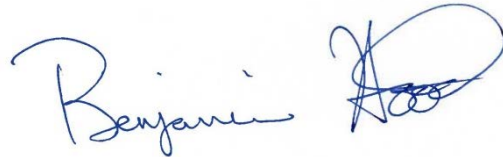

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location
Throughout the building (Classrooms)

Material Description

Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 3 Each

Material Location
Boiler room (one) A wing custodial closet (two)

Material Description
White canvas shock joints on AHU's

Comments
There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

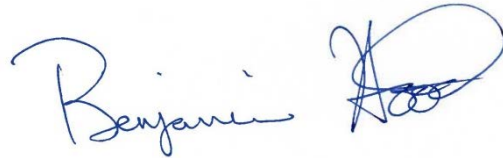

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location
Gymnasium west wall and "A" wing custodial closet


Material Description

Fittings

Comments

This material was not in poor condition overall

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

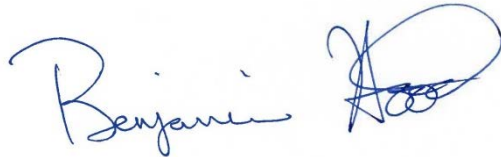

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039


PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

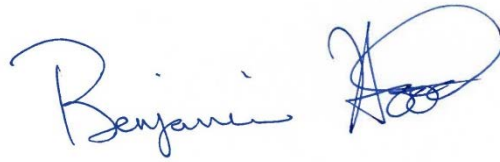

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# F
Type of Material Miscellaneous Material
Quantity of Material Unquantified Ea
Material Location
Boiler Room and Gym


Material Description

Fire Doors

Comments

Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/30/2010
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

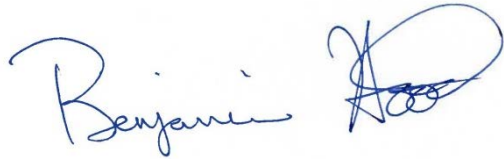

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-A
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Kitchen office and Stock Room

Material Description
9" X 9" Dark Gray

Comments

This area has some broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 4/21/2014
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-B
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Gym Entrance

Material Description

9" X 9" Chocolate vinyl floor tile.

Comments

This material overall was not in poor condition. There are broken edge pieces missing in the gynasium entry and storage area. Some tiles have been replaced

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 4/21/2014
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location

A wing custodial closets

Material Description

9" X 9" Light Gray vinyl floor tile

Comments

This material overall is not in poor condition. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 4/21/2014
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 4/21/2014
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF

Material Location
Throughout the building (Classrooms)

Material Description
Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 4/21/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

| | |
|--|---|
| LEA Name | Greater Clark County Schools |
| Building Name | W. E. Wilson Elementary School |
| HA# | B |
| Type of Material | Miscellaneous Material |
| Quantity of Material | Approx. 1,600 SF |
| Material Location | Throughout the building |
| Material Description | Cove base mastic |
| Comments | This material was not exposed to inspect. |
| Does Material Contain Asbestos? | Assumed |
| Is it Friable? | No |
| Original Inspection Date | 5/31/1995 |
| Current Surveillance Date | 4/21/2014 |
| Current Assessment Rating | NR Not Rated |
| Cause of Damage | No Damage |
| Accessible | No |
| Potential for Damage | Low |
| Removed | No |
| Planned Response Action | O & M |

Inspector



Jeffrey P. Rehtin

| | |
|-----------------------------|-----------|
| State | Indiana |
| Accreditation Number | 19A003594 |

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 3 Each

Material Location
Boiler room (one) A wing custodial closet (two)

Material Description
White canvas shock joints on AHU's

Comments
There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 4/21/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location
Gymnasium west wall and "A" wing custodial closet

Material Description

Fittings

Comments

This material was not in poor condition overall

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 4/21/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 4/21/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# F
Type of Material Miscellaneous Material
Quantity of Material Unquantified Ea

Material Location
Boiler Room and Gym

Material Description
Fire Doors

Comments

Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/30/2010
Current Surveillance Date 4/21/2014
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechlin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-A
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location

Kitchen office and Stock Room


Material Description

9" X 9" Dark Gray

Comments

This area has some broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-B
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Gym Entrance
Material Description


9" X 9" Chocolate vinyl floor tile.

Comments

This material overall was not in poor condition. There are broken edge pieces missing in the gynasium entry and storage area. Some tiles have been replaced

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location

A wing custodial closets

Material Description


9" X 9" Light Gray vinyl floor tile

Comments

This material overall is not in poor condition. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector




Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is It Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location

Throughout the building (Classrooms)


Material Description

Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector


Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is It Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 3 Each

Material Location

Boiler room (one) A wing custodial closet (two)

Material Description


White canvas shock joints on AHU's

Comments

There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is It Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location

Gymnasium west wall and "A" wing custodial closet

Material Description


Fittings

Comments

This material was not in poor condition overall

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is It Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# F

Type of Material Miscellaneous Material

Quantity of Material Unquantified Ea

Material Location

Boiler Room and Gym

Material Description

Fire Doors

Comments

Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/30/2010

Current Surveillance Date 10/24/2013

Current Assessment Rating NR Not Rated

Cause of Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-A
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Kitchen office and Stock Room

Material Description
9" X 9" Dark Gray

Comments

This area has some broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 10/24/2012
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-B
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Gym Entrance

Material Description

9" X 9" Chocolate vinyl floor tile.

Comments

This material overall was not in poor condition. There are broken edge pieces missing in the gynasium entry and storage area. Some tiles have been replaced

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/24/2012
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location

A wing custodial closets

Material Description

9" X 9" Light Gray vinyl floor tile

Comments

This material overall is not in poor condition. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/24/2012
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector




Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is It Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 10/24/2012
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,600 LF

Material Location
Throughout the building (Classrooms)

Material Description

Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 10/24/2012

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/24/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 3 Each
Material Location
Boiler room (one) A wing custodial closet (two)

Material Description

White canvas shock joints on AHU's

Comments

There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/24/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location
Gymnasium west wall and "A" wing custodial closet
Material Description
Fittings
Comments
This material was not in poor condition overall
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 10/24/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School

HA# E

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location
Classrooms

Material Description
Fittings

Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 10/24/2012

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School

HA# F

Type of Material Miscellaneous Material

Quantity of Material Unquantified Ea

Material Location

Boiler Room and Gym

Material Description

Fire Doors

Comments

Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/30/2010

Current Surveillance Date 10/24/2012

Current Assessment Rating NR Not Rated

Cause of Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector




Jeffrey P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is It Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/25/2012
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

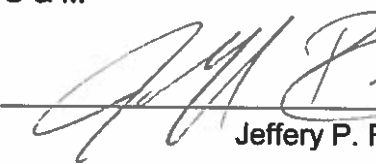Inspector

Jeffery P. Rechtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-A
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Kitchen office and Stock Room


Material Description
9" X 9" Dark Gray

Comments

This area has some broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/25/2012
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Jeffery P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-B
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Gym Entrance

Material Description

9" X 9" Chocolate vinyl floor tile.

Comments

This material overall was not in poor condition. There are broken edge pieces missing in the gynosium entry and storage area. Some tiles have been replaced

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 6/25/2012
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Jeffery P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location

A wing custodial closets

Material Description


9" X 9" Light Gray vinyl floor tile

Comments

This material overall is not in poor condition. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 6/25/2012
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

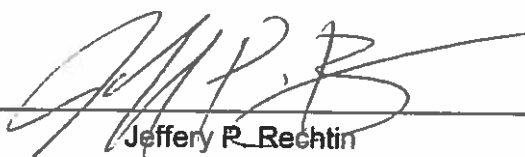

Jeffery R. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location

Throughout the building (Classrooms)

Material Description

Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/25/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M


Inspector


Jeffery P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/25/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

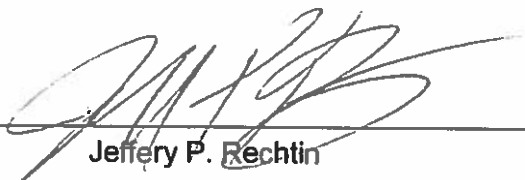Inspector

Jeffery P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 3 Each

Material Location
Boiler room (one) A wing custodial closet (two)

Material Description
White canvas shock joints on AHU's

Comments
There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/25/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Jeffery P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location
Gymnasium west wall and "A" wing custodial closet

Material Description


Fittings

Comments

This material was not in poor condition overall

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/25/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Jeffery P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/25/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

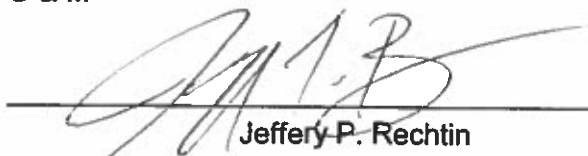
Jeffery P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School

HA# F

Type of Material Miscellaneous Material

Quantity of Material Unquantified Ea

Material Location
Boiler Room and Gym

Material Description

Fire Doors

Comments

Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/30/2010

Current Surveillance Date 6/25/2012

Current Assessment Rating NR Not Rated

Cause of Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffery P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-A
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location

Kitchen office and Stock Room

Material Description

9" X 9" Dark Gray

Comments

This area has some broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/27/2011
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-B
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Gym Entrance
Material Description


9" X 9" Chocolate vinyl floor tile.

Comments

This material overall was not in poor condition. There are broken edge pieces missing in the gynasium entry. Some tiles have been replaced

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 6/27/2011
Current Assessment Rating NA Not Applicable
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

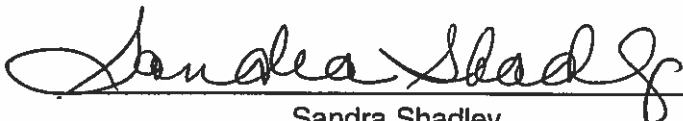
Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location

A wing custodial closets

Material Description

9" X 9" Light Gray vinyl floor tile

Comments

This material overall is not in poor condition. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 6/27/2011
Current Assessment Rating NA Not Applicable
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/27/2011
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF

Material Location
Throughout the building

Material Description
Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/27/2011
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT
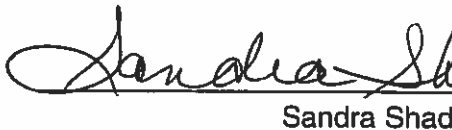
| | |
|--|--|
| LEA Name | Greater Clark County Schools |
| Building Name | W. E. Wilson Elementary School |
| HA# | B |
| Type of Material | Miscellaneous Material |
| Quantity of Material | Approx. 1,600 SF |
| Material Location | Throughout the building |
| Material Description | Cove base mastic |
| Comments | This material was not exposed to inspect. |
| Does Material Contain Asbestos? | Assumed |
| Is it Friable? | No |
| Original Inspection Date | 5/31/1995 |
| Current Surveillance Date | 6/27/2011 |
| Current Assessment Rating | NR Not Required |
| Cause of Damage | No Damage |
| Accessible | No |
| Potential for Damage | Low |
| Removed | No |
| Planned Response Action | O & M |
| Inspector |  Sandra Shadley |
| State | Indiana |
| Accreditation Number | 19A002323 |

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 3 Each

Material Location

Boiler room (one) A wing custodial closet (two)

Material Description

White canvas shock joints on AHU's

Comments

There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/27/2011
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location

Gymnasium west wall and "A" wing custodial closet

Material Description

Fittings

Comments

This material was not in poor condition overall

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/27/2011
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/27/2011
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# F
Type of Material Miscellaneous Material
Quantity of Material Unquantified Ea

Material Location

Boiler Room and Gym

Material Description


Fire Doors

Comments

Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/30/2010
Current Surveillance Date 6/27/2011
Current Assessment Rating NR Not Required
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

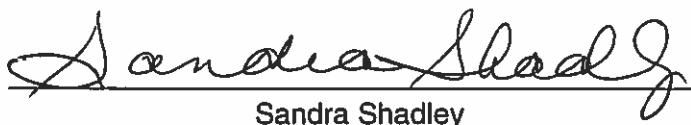
Sandra Shadley

State Indiana
Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location

Various locations throughout the building

Material Description

VAT (various colors & sizes)

Comments

There are broken edge pieces missing in the gymnasium entryway. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/6/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Paul W. Krick

State Indiana
Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF

Material Location
Throughout the building

Material Description
Floor tile mastic

Comments
Where exposed, this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/6/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Paul W. Krick

State Indiana
Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location

Throughout the building

Material Description

Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/6/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Paul W. Krick

State Indiana
Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF

Material Location
Throughout the building

Material Description
Cove base mastic

Comments
This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/6/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Paul W. Krick

State Indiana
Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 3 Each
Material Location

Boiler room (one) A wing custodial closet (two)

Material Description

White canvas shock joints on AHU's

Comments

There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/6/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Paul W. Krick

State Indiana
Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location

Gymnasium west wall and "A" wing custodial closet

Material Description

Fittings

Comments

This material was not in poor condition overall

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/6/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Paul W. Krick

State Indiana
Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/6/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

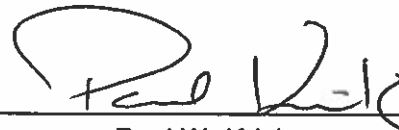

Paul W. Krick

State Indiana
Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# F
Type of Material Miscellaneous Material
Quantity of Material Unquantified Ea
Material Location
Boiler Room and Gym
Material Description
Fire Doors

Comments

Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/30/2010
Current Surveillance Date 12/6/2010
Current Assessment Rating NR Not Required
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Paul W. Krick

State Indiana
Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School

HA# 10

Type of Material Miscellaneous Material

Quantity of Material 18,914 SF

Material Location

Various locations throughout the building

Material Description

VAT (various colors & sizes)

Comments

There are broken edge pieces missing in the gymnasium entryway. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 12/4/2009

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

| | |
|---------------------------------|---|
| LEA Name | Greater Clark County Schools |
| Building Name | W. E. Wilson Elementary School |
| HA# | 11 |
| Type of Material | Miscellaneous Material |
| Quantity of Material | 18,914 SF |
| Material Location | Throughout the building |
| Material Description | Floor tile mastic |
| Comments | Where exposed, this material was not in poor condition. |
| Does Material Contain Asbestos? | Assumed |
| Is it Friable? | No |
| Original Inspection Date | 6/1/1992 |
| Current Surveillance Date | 12/4/2009 |
| Current Assessment Rating | NR Not Required |
| Cause of Damage | No Damage |
| Accessible | No |
| Potential for Damage | Low |
| Removed | No |
| Planned Response Action | O & M |

Inspector


George William Ogle

State

Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,600 LF

Material Location

Throughout the building

Material Description

Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 12/4/2009

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

| | |
|---------------------------------|---|
| LEA Name | Greater Clark County Schools |
| Building Name | W. E. Wilson Elementary School |
| HA# | B |
| Type of Material | Miscellaneous Material |
| Quantity of Material | Approx. 1,600 SF |
| Material Location | Throughout the building |
| Material Description | Cove base mastic |
| Comments | This material was not exposed to inspect. |
| Does Material Contain Asbestos? | Assumed |
| Is it Friable? | No |
| Original Inspection Date | 5/31/1995 |
| Current Surveillance Date | 12/4/2009 |
| Current Assessment Rating | NR Not Required |
| Cause of Damage | No Damage |
| Accessible | No |
| Potential for Damage | Low |
| Removed | No |
| Planned Response Action | O & M |

Inspector


George William Ogle

State

Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School

HA# C

Type of Material Miscellaneous Material

Quantity of Material 4 Each

Material Location

Boiler room (two) and A wing custodial closet (two)

Material Description

White canvas shock joints on AHU's

Comments

There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 12/4/2009

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M


Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT
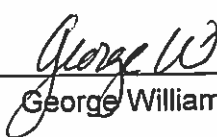
| | | |
|---------------------------------|---|--------------|
| LEA Name | Greater Clark County Schools | |
| Building Name | W. E. Wilson Elementary School | |
| HA# | D | |
| Type of Material | Thermal Material | |
| Quantity of Material | Approx. 18 Each | |
| Material Location | Gymnasium and "A" wing custodial closet | |
| Material Description | Fittings | |
| Comments | This material was not in poor condition overall | |
| Does Material Contain Asbestos? | Assumed | |
| Is it Friable? | No | |
| Original Inspection Date | 5/31/1995 | |
| Current Surveillance Date | 12/4/2009 | |
| Current Assessment Rating | NR | Not Required |
| Cause of Damage | No Damage | |
| Accessible | Yes | |
| Potential for Damage | Low | |
| Removed | No | |
| Planned Response Action | O & M | |
| Inspector |  George William Ogle | |
| State | Indiana | |
| Accreditation Number | 191003027 | |

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School

HA# E

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location
Classrooms

Material Description
Fittings

Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 12/4/2009

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School

HA# 10

Type of Material Miscellaneous Material

Quantity of Material 18,914 SF

Material Location

Various locations throughout the building

Material Description

VAT (various colors & sizes)

Comments

There are broken edge pieces missing in the gymnasium entryway. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 6/10/2009

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State IN

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/10/2009
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

IN

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location

Throughout the building

Material Description

Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/10/2009
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

IN

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

| | |
|---------------------------------|---|
| LEA Name | Greater Clark County Schools |
| Building Name | W. E. Wilson Elementary School |
| HA# | B |
| Type of Material | Miscellaneous Material |
| Quantity of Material | Approx. 1,600 SF |
| Material Location | Throughout the building |
| Material Description | Cove base mastic |
| Comments | This material was not exposed to inspect. |
| Does Material Contain Asbestos? | Assumed |
| Is it Friable? | No |
| Original Inspection Date | 5/31/1995 |
| Current Surveillance Date | 6/10/2009 |
| Current Assessment Rating | NR Not Required |
| Cause of Damage | No Damage |
| Accessible | No |
| Potential for Damage | Low |
| Removed | No |
| Planned Response Action | O & M |

Inspector


George William Ogle

State

IN

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School

HA# C

Type of Material Miscellaneous Material

Quantity of Material 4 Each

Material Location

Boiler room (two) and A wing custodial closet (two)

Material Description

White canvas shock joints on AHU's

Comments

There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 6/10/2009

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State IN

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location
Gymnasium and "A" wing custodial closet
Material Description
Fittings
Comments
This material was not in poor condition overall
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/10/2009
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

IN

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location Classrooms
Material Description Fittings

Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/10/2009
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State IN
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF

Material Location

Various locations throughout the building

Material Description

VAT (various colors & sizes)

Comments

There are broken edge pieces missing in the gymnasium entryway. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/10/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

Where exposed, this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/10/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location

Throughout the building

Material Description

Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is It Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/10/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF

Material Location
Throughout the building

Material Description
Cove base mastic

Comments
This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/10/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 4 Each

Material Location
Boiler room (two) and A wing custodial closet (two)

Material Description
White canvas shock joints on AHU's

Comments
There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/10/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location

Gymnasium and "A" wing custodial closet

Material Description

Fittings

Comments

This material was not in poor condition overall

| | | |
|--|------------|--------------|
| Does Material Contain Asbestos? | Assumed | |
| Is it Friable? | No | |
| Original Inspection Date | 5/31/1995 | |
| Current Surveillance Date | 12/10/2008 | |
| Current Assessment Rating | NR | Not Required |
| Cause of Damage | No Damage | |
| Accessible | Yes | |
| Potential for Damage | Low | |
| Removed | No | |
| Planned Response Action | O & M | |

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is It Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/10/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location

Various locations throughout the building

Material Description

VAT (various colors & sizes)

Comments

There are broken edge pieces missing in the gymnasium entryway. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/30/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/30/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector _____
George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location

Throughout the building

Material Description

Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/30/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/30/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 4 Each
Material Location

Boiler room (two) and A wing custodial closet (two)

Material Description

White canvas shock joints on AHU's

Comments

There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

| | |
|--|-----------------|
| Does Material Contain Asbestos? | Assumed |
| Is it Friable? | No |
| Original Inspection Date | 5/31/1995 |
| Current Surveillance Date | 6/30/2008 |
| Current Assessment Rating | NR Not Required |
| Cause of Damage | No Damage |
| Accessible | Yes |
| Potential for Damage | Low |
| Removed | No |
| Planned Response Action | O & M |

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location

Gymnasium and "A" wing custodial closet

Material Description

Fittings

Comments

This material was not in poor condition overall

| | | |
|--|-----------|--------------|
| Does Material Contain Asbestos? | Assumed | |
| Is it Friable? | No | |
| Original Inspection Date | 5/31/1995 | |
| Current Surveillance Date | 6/30/2008 | |
| Current Assessment Rating | NR | Not Required |
| Cause of Damage | No Damage | |
| Accessible | Yes | |
| Potential for Damage | Low | |
| Removed | No | |
| Planned Response Action | O & M | |

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings
Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/30/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location

Various locations throughout the building

Material Description


VAT (various colors & sizes)

Comments

There are broken edge pieces missing in the gymnasium entryway. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/7/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/7/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,600 LF

Material Location
Throughout the building

Material Description
Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 12/7/2007

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location Throughout the building
Material Description Cove base mastic
Comments This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/7/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 4 Each
Material Location

Boiler room (two) and A wing custodial closet (two)

Material Description

White canvas shock joints on AHU's

Comments

There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

| | |
|---------------------------------|-----------------|
| Does Material Contain Asbestos? | Assumed |
| Is it Friable? | No |
| Original Inspection Date | 5/31/1995 |
| Current Surveillance Date | 12/7/2007 |
| Current Assessment Rating | NR Not Required |
| Cause of Damage | No Damage |
| Accessible | Yes |
| Potential for Damage | Low |
| Removed | No |
| Planned Response Action | O & M |

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location
Gymnasium and "A" wing custodial closet
Material Description
Fittings
Comments
This material was not in poor condition overall
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/7/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location Classrooms
Material Description Fittings
Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/7/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location

Various locations throughout the building

Material Description

VAT (various colors & sizes)

Comments

There are broken edge pieces missing in the gymnasium entryway. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 7/9/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

Where exposed, this material was not in poor condition.

| | | |
|--|-----------|--------------|
| Does Material Contain Asbestos? | Assumed | |
| Is it Friable? | No | |
| Original Inspection Date | 6/1/1992 | |
| Current Surveillance Date | 7/9/2007 | |
| Current Assessment Rating | NR | Not Required |
| Cause of Damage | No Damage | |
| Accessible | No | |
| Potential for Damage | Low | |
| Removed | No | |
| Planned Response Action | O & M | |

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,600 LF

Material Location
Throughout the building

Material Description
Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 7/9/2007

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

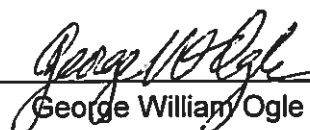
George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 7/9/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 4 Each

Material Location
Boiler room (two) and A wing custodial closet (two)

Material Description
White canvas shock joints on AHU's

Comments
There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 7/9/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location
Gymnasium and "A" wing custodial closet
Material Description
Fittings
Comments
This material was not in poor condition overall
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 7/9/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector _____
George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings
Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 7/9/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location

Various locations throughout the building

Material Description

VAT (various colors & sizes)

Comments

There are broken edge pieces missing in the gymnasium entryway. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/18/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/18/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location

Throughout the building

Material Description

Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

| | |
|--|-----------------|
| Does Material Contain Asbestos? | Assumed |
| Is it Friable? | No |
| Original Inspection Date | 5/31/1995 |
| Current Surveillance Date | 12/18/2006 |
| Current Assessment Rating | NR Not Required |
| Cause of Damage | No Damage |
| Accessible | Yes |
| Potential for Damage | Low |
| Removed | No |
| Planned Response Action | O & M |

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/18/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 4 Each
Material Location

Boiler room (two) and A wing custodial closet (two)

Material Description

White canvas shock joints on AHU's

Comments

There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

| | |
|--|-----------------|
| Does Material Contain Asbestos? | Assumed |
| Is it Friable? | No |
| Original Inspection Date | 5/31/1995 |
| Current Surveillance Date | 12/18/2006 |
| Current Assessment Rating | NR Not Required |
| Cause of Damage | No Damage |
| Accessible | Yes |
| Potential for Damage | Low |
| Removed | No |
| Planned Response Action | O & M |

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location
Gymnasium and "A" wing custodial closet
Material Description
Fittings
Comments
This material was not in poor condition overall
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/18/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings
Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/18/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF

Material Location

Various locations throughout the building

Material Description

VAT (various colors & sizes)

Comments

There are broken edge pieces missing in the gymnasium entryway. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/28/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector




Christopher Ames

State Indiana
Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/28/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

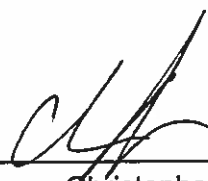Inspector 
Christopher Ames

State Indiana
Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location

Throughout the building

Material Description

Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/28/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christopher Ames

State Indiana
Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location

Throughout the building

Material Description

Cove base mastic

Comments

This material was not exposed to inspect.

| | |
|---------------------------------|-----------------|
| Does Material Contain Asbestos? | Assumed |
| Is it Friable? | No |
| Original Inspection Date | 5/31/1995 |
| Current Surveillance Date | 6/28/2006 |
| Current Assessment Rating | NR Not Required |
| Cause of Damage | No Damage |
| Accessible | No |
| Potential for Damage | Low |
| Removed | No |
| Planned Response Action | O & M |

Inspector


Christopher Ames

State Indiana
Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 4 Each

Material Location
Boiler room (two) and A wing custodial closet (two)

Material Description
White canvas shock joints on AHU's

Comments
This material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/28/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christopher Ames

State Indiana
Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School

HA# D

Type of Material Thermal Material

Quantity of Material Approx. 18 Each

Material Location
Gymnasium and "A" wing custodial closet

Material Description

Fittings

Comments

This material was not in poor condition overall with some fittings showing slight deterioration.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 6/28/2006

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Christopher Ames

State Indiana

Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings
Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/28/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christopher Ames

State Indiana
Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location

Various locations throughout the building

Material Description

VAT (various colors & sizes)

Comments

There are broken edge pieces missing in the gymnasium entryway. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material was not in poor condition overall.

| | |
|--|-----------------|
| Does Material Contain Asbestos? | Yes |
| Is it Friable? | No |
| Original Inspection Date | 6/1/1992 |
| Current Surveillance Date | 1/24/2006 |
| Current Assessment Rating | NR Not Required |
| Cause of Damage | No Damage |
| Accessible | Yes |
| Potential for Damage | Low |
| Removed | No |
| Planned Response Action | O & M |

Inspector


George William Ogle

State

Indiana

Accreditation Number

191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF

Material Location
Throughout the building

Material Description
Floor tile mastic

Comments
Where exposed, this material was not in poor condition.

| | | |
|--|-----------|--------------|
| Does Material Contain Asbestos? | Assumed | |
| Is it Friable? | No | |
| Original Inspection Date | 6/1/1992 | |
| Current Surveillance Date | 1/24/2006 | |
| Current Assessment Rating | NR | Not Required |
| Cause of Damage | No Damage | |
| Accessible | No | |
| Potential for Damage | Low | |
| Removed | No | |
| Planned Response Action | O & M | |

Inspector


George William Ogles

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location

Throughout the building

Material Description

Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 1/24/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

Indiana

Accreditation Number

191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location

Throughout the building

Material Description

Cove base mastic

Comments

This material was not exposed to inspect.


| | | |
|---------------------------------|-----------|--------------|
| Does Material Contain Asbestos? | Assumed | |
| Is it Friable? | No | |
| Original Inspection Date | 5/31/1995 | |
| Current Surveillance Date | 1/24/2006 | |
| Current Assessment Rating | NR | Not Required |
| Cause of Damage | No Damage | |
| Accessible | No | |
| Potential for Damage | Low | |
| Removed | No | |
| Planned Response Action | O & M | |

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

| | | |
|---------------------------------|---|--------------|
| LEA Name | Greater Clark County Schools | |
| Building Name | W. E. Wilson Elementary School | |
| HA# | C | |
| Type of Material | Miscellaneous Material | |
| Quantity of Material | 4 Each | |
| Material Location | Boiler room (two) and A wing custodial closet (two) | |
| Material Description | White canvas shock joints on AHU's | |
| Comments | This material was not in poor condition. | |
| Does Material Contain Asbestos? | Assumed | |
| Is it Friable? | No | |
| Original Inspection Date | 5/31/1995 | |
| Current Surveillance Date | 1/24/2006 | |
| Current Assessment Rating | NR | Not Required |
| Cause of Damage | No Damage | |
| Accessible | Yes | |
| Potential for Damage | Low | |
| Removed | No | |
| Planned Response Action | O & M | |
| Inspector |  George William Ogle | |
| State | Indiana | |
| Accreditation Number | 191523030 | |

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location

Gymnasium and "A" wing custodial closet

Material Description

Fittings

Comments

This material was not in poor condition overall with some fittings showing slight deterioration.

| | |
|--|-----------------|
| Does Material Contain Asbestos? | Assumed |
| Is it Friable? | No |
| Original Inspection Date | 5/31/1995 |
| Current Surveillance Date | 1/24/2006 |
| Current Assessment Rating | NR Not Required |
| Cause of Damage | No Damage |
| Accessible | Yes |
| Potential for Damage | Low |
| Removed | No |
| Planned Response Action | O & M |

Inspector


George William Ogle

State

Indiana

Accreditation Number

191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings
Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 1/24/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF

Material Location
Various locations throughout the building

Material Description
VAT (various colors & sizes)

Comments
There are broken edge pieces missing in the gymnasium entryway. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 7/19/2005
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 7/19/2005
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF

Material Location
Throughout the building

Material Description
Cove base

Comments
This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 7/19/2005
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 7/19/2005
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 4 Each
Material Location
Boiler room (two) and A wing custodial closet (two)
Material Description
White canvas shock joints on AHU's
Comments
This material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 7/19/2005
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector _____
George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each

Material Location
Gymnasium and "A" wing custodial closet

Material Description
Fittings

Comments
This material was not in poor condition overall with some fittings showing slight deterioration..

| | |
|--|-----------------|
| Does Material Contain Asbestos? | Assumed |
| Is it Friable? | No |
| Original Inspection Date | 5/31/1995 |
| Current Surveillance Date | 7/19/2005 |
| Current Assessment Rating | NR Not Required |
| Cause of Damage | No Damage |
| Accessible | Yes |
| Potential for Damage | Low |
| Removed | No |
| Planned Response Action | O & M |

Inspector



George William Ogle

State Indiana
Accreditation Number 191523030


PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings
Comments
It is believed the fittings are encased behind the dry wall and are not visible to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 7/19/2005
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030

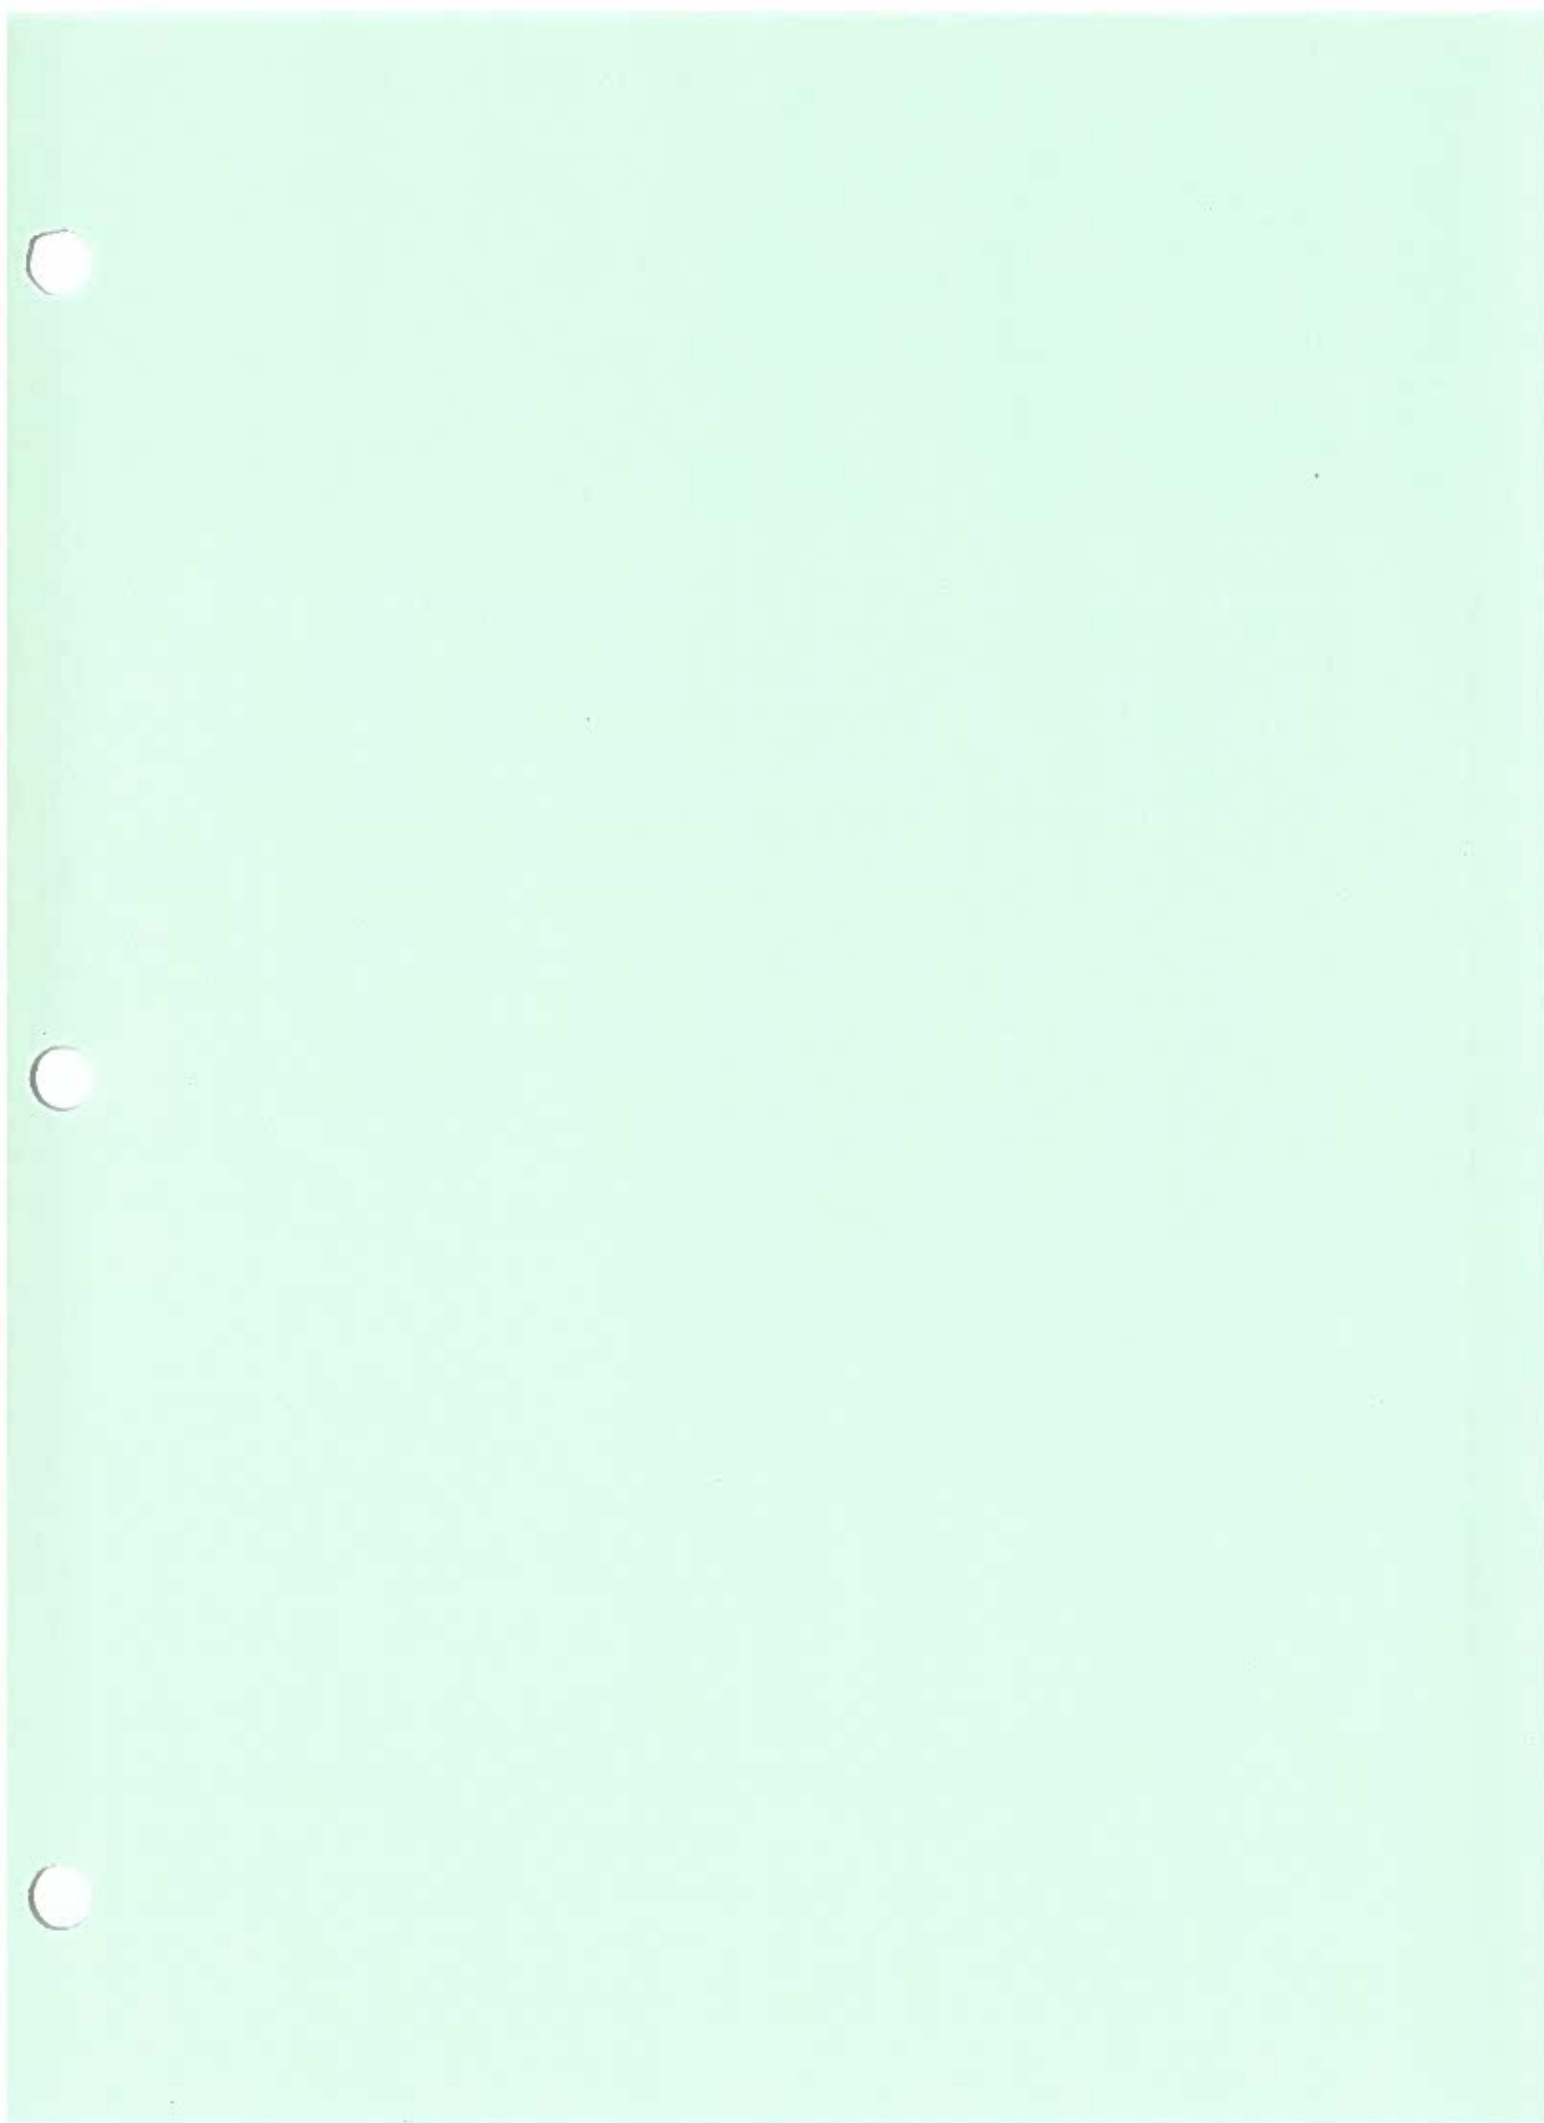

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF

Material Location
Various locations throughout the building

Material Description
VAT (various colors & sizes)

Comments

There are broken edge pieces missing in the gymnasium entryway. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/8/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/8/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector 
Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF

Material Location
Throughout the building

Material Description
Cove base

Comments

This material showed minor scraping, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/8/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector




Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/8/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector




Christian Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 4 Each
Material Location
Boiler room and A wing custodial closet
Material Description
White canvas shock joints on AHU's
Comments
This material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/8/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location
Gymnasium and "A" wing custodial closet


Material Description
Fittings

Comments

Some minor gouges were observed. However, this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/8/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/8/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

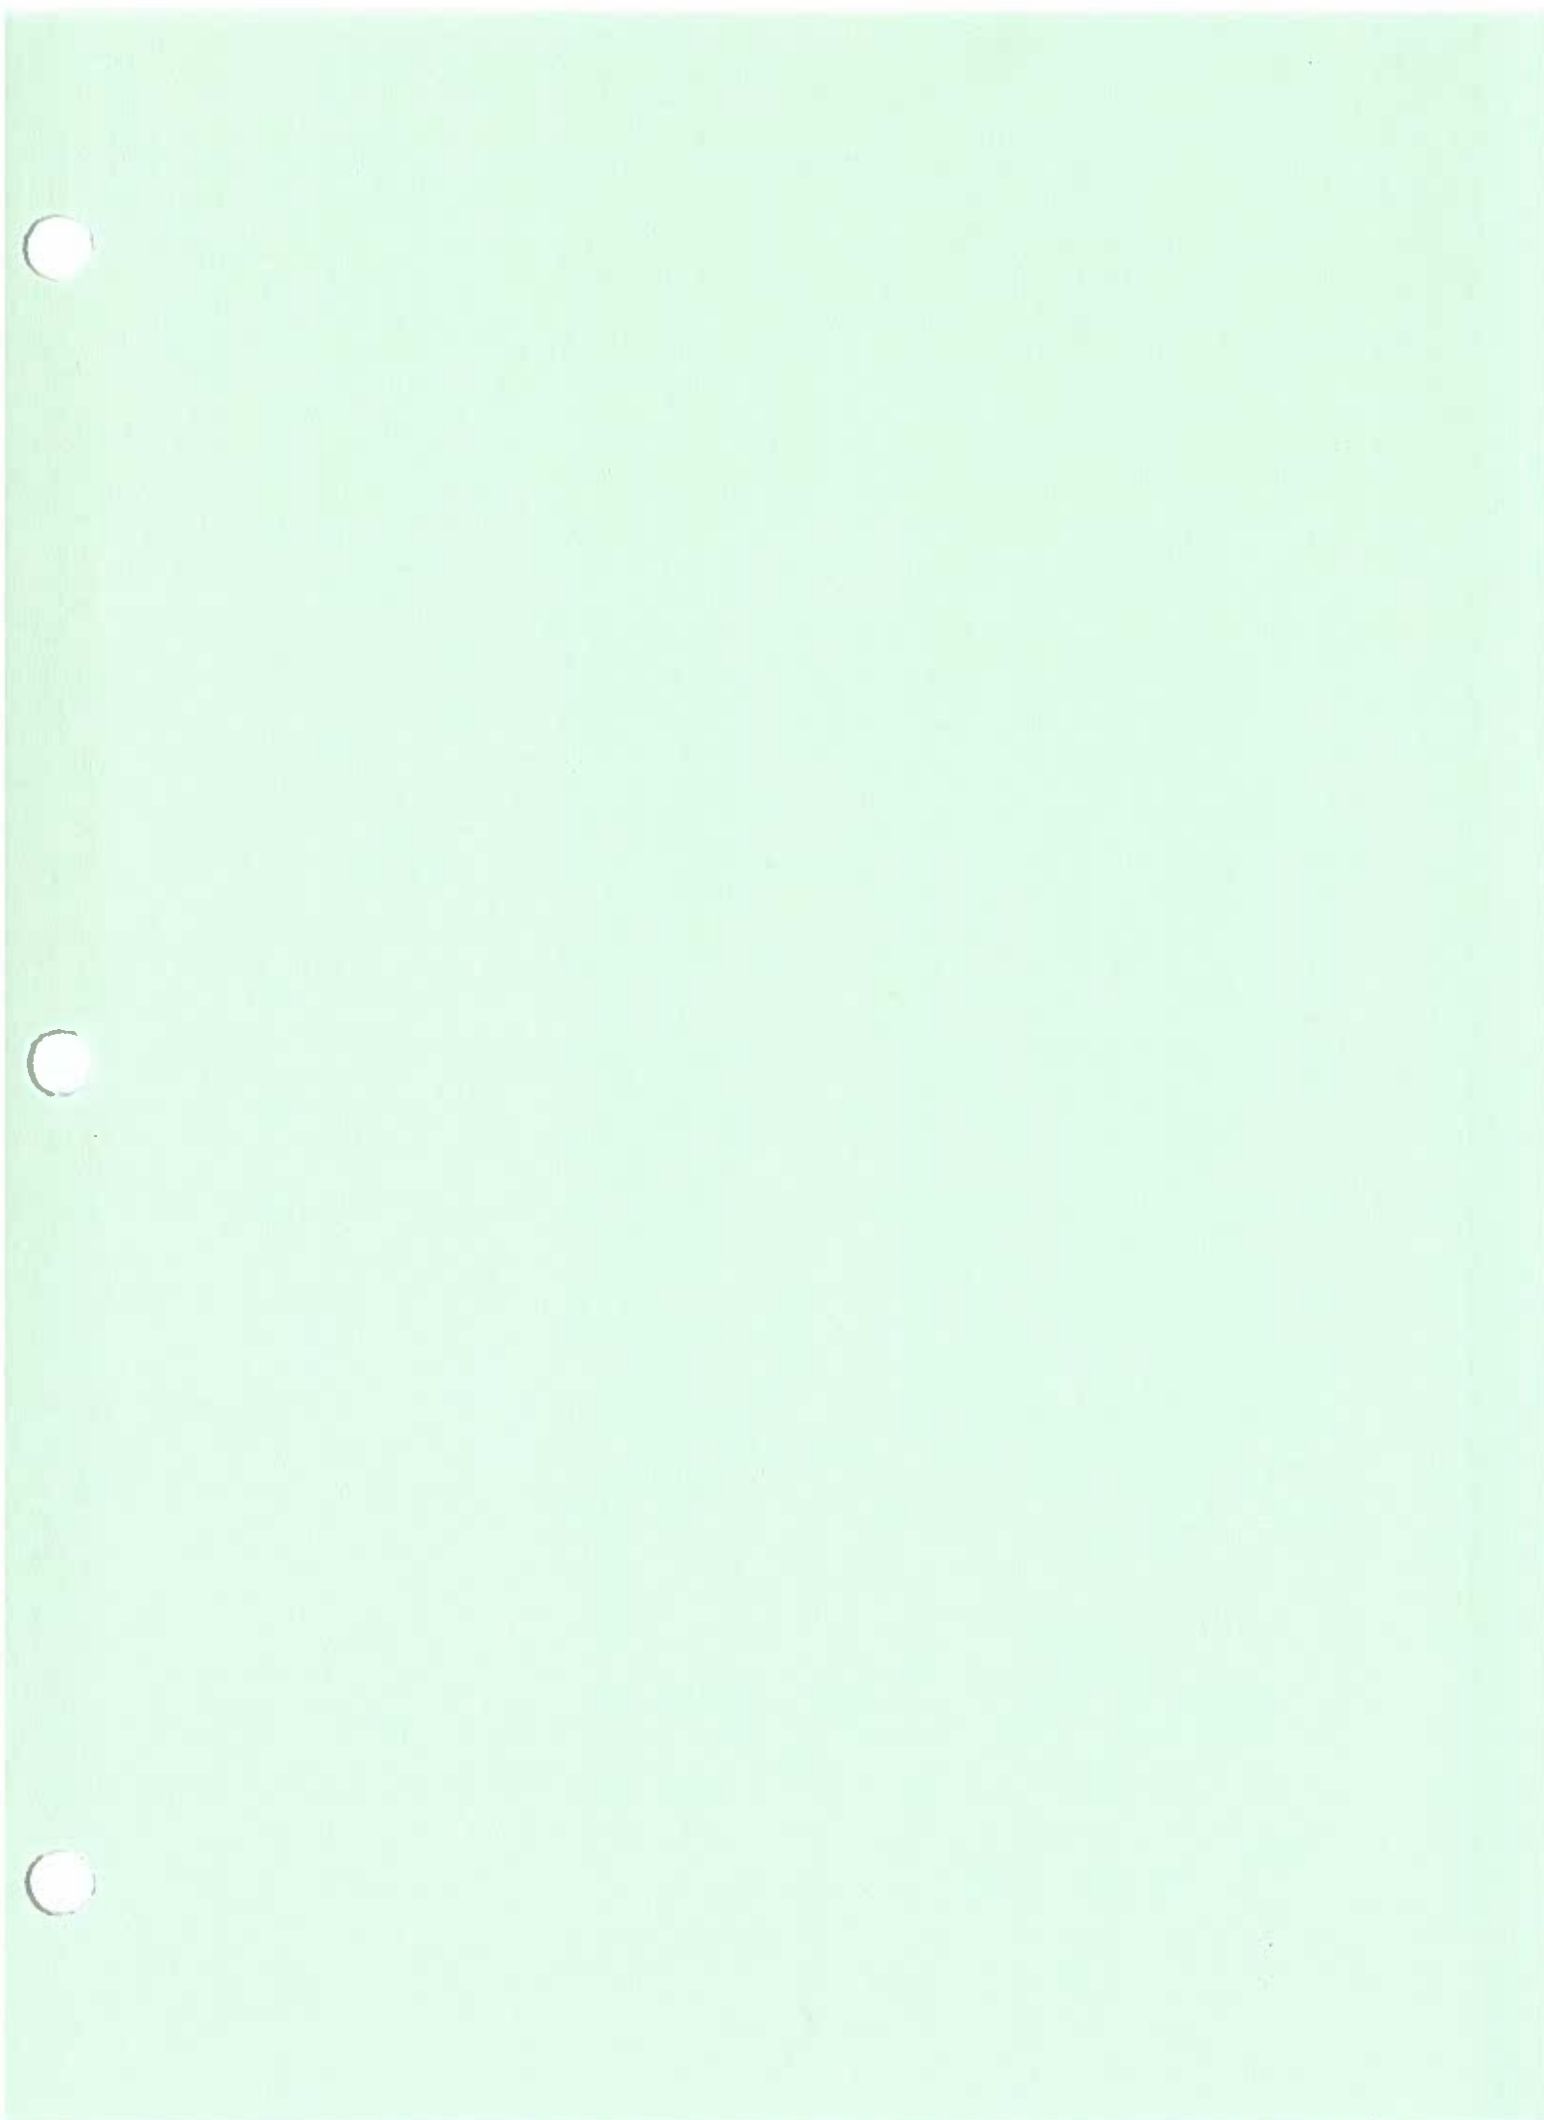

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF

Material Location
Various locations throughout the building

Material Description
VAT (various colors & sizes)

Comments
There are broken edge pieces missing in the gymnasium entryway. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/09/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/09/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector 
Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF

Material Location
Throughout the building

Material Description
Cove base

Comments
This material showed minor scraping, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/09/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/09/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector




Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 4 Each
Material Location
Boiler room and A wing custodial closet
Material Description
White canvas shock joints on AHU's
Comments
This material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/09/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each

Material Location
Gymnasium and "A" wing custodial closet

Material Description
Fittings

Comments

Some minor gouges were observed. However, this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/09/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/09/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF

Material Location
Various locations throughout the building

Material Description
VAT (various colors & sizes)

Comments

There are broken edge pieces missing in the gymnasium entryway. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/13/2003
Current Assessment Rating NR Not Required
Cause of Damage Physical Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christian Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/13/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF


Material Location
Throughout the building

Material Description
Cove base

Comments
This material showed minor scraping, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/13/2003
Current Assessment Rating NR Not Required
Cause of Damage Physical Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

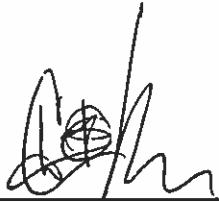

Christian Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/13/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 4 Each
Material Location
Boiler room and A wing custodial closet
Material Description
White canvas shock joints on AHU's
Comments
This material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/13/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location
Gymnasium and custodial room

Material Description
Fittings

Comments

Some minor gouges were observed. However, this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/13/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/13/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

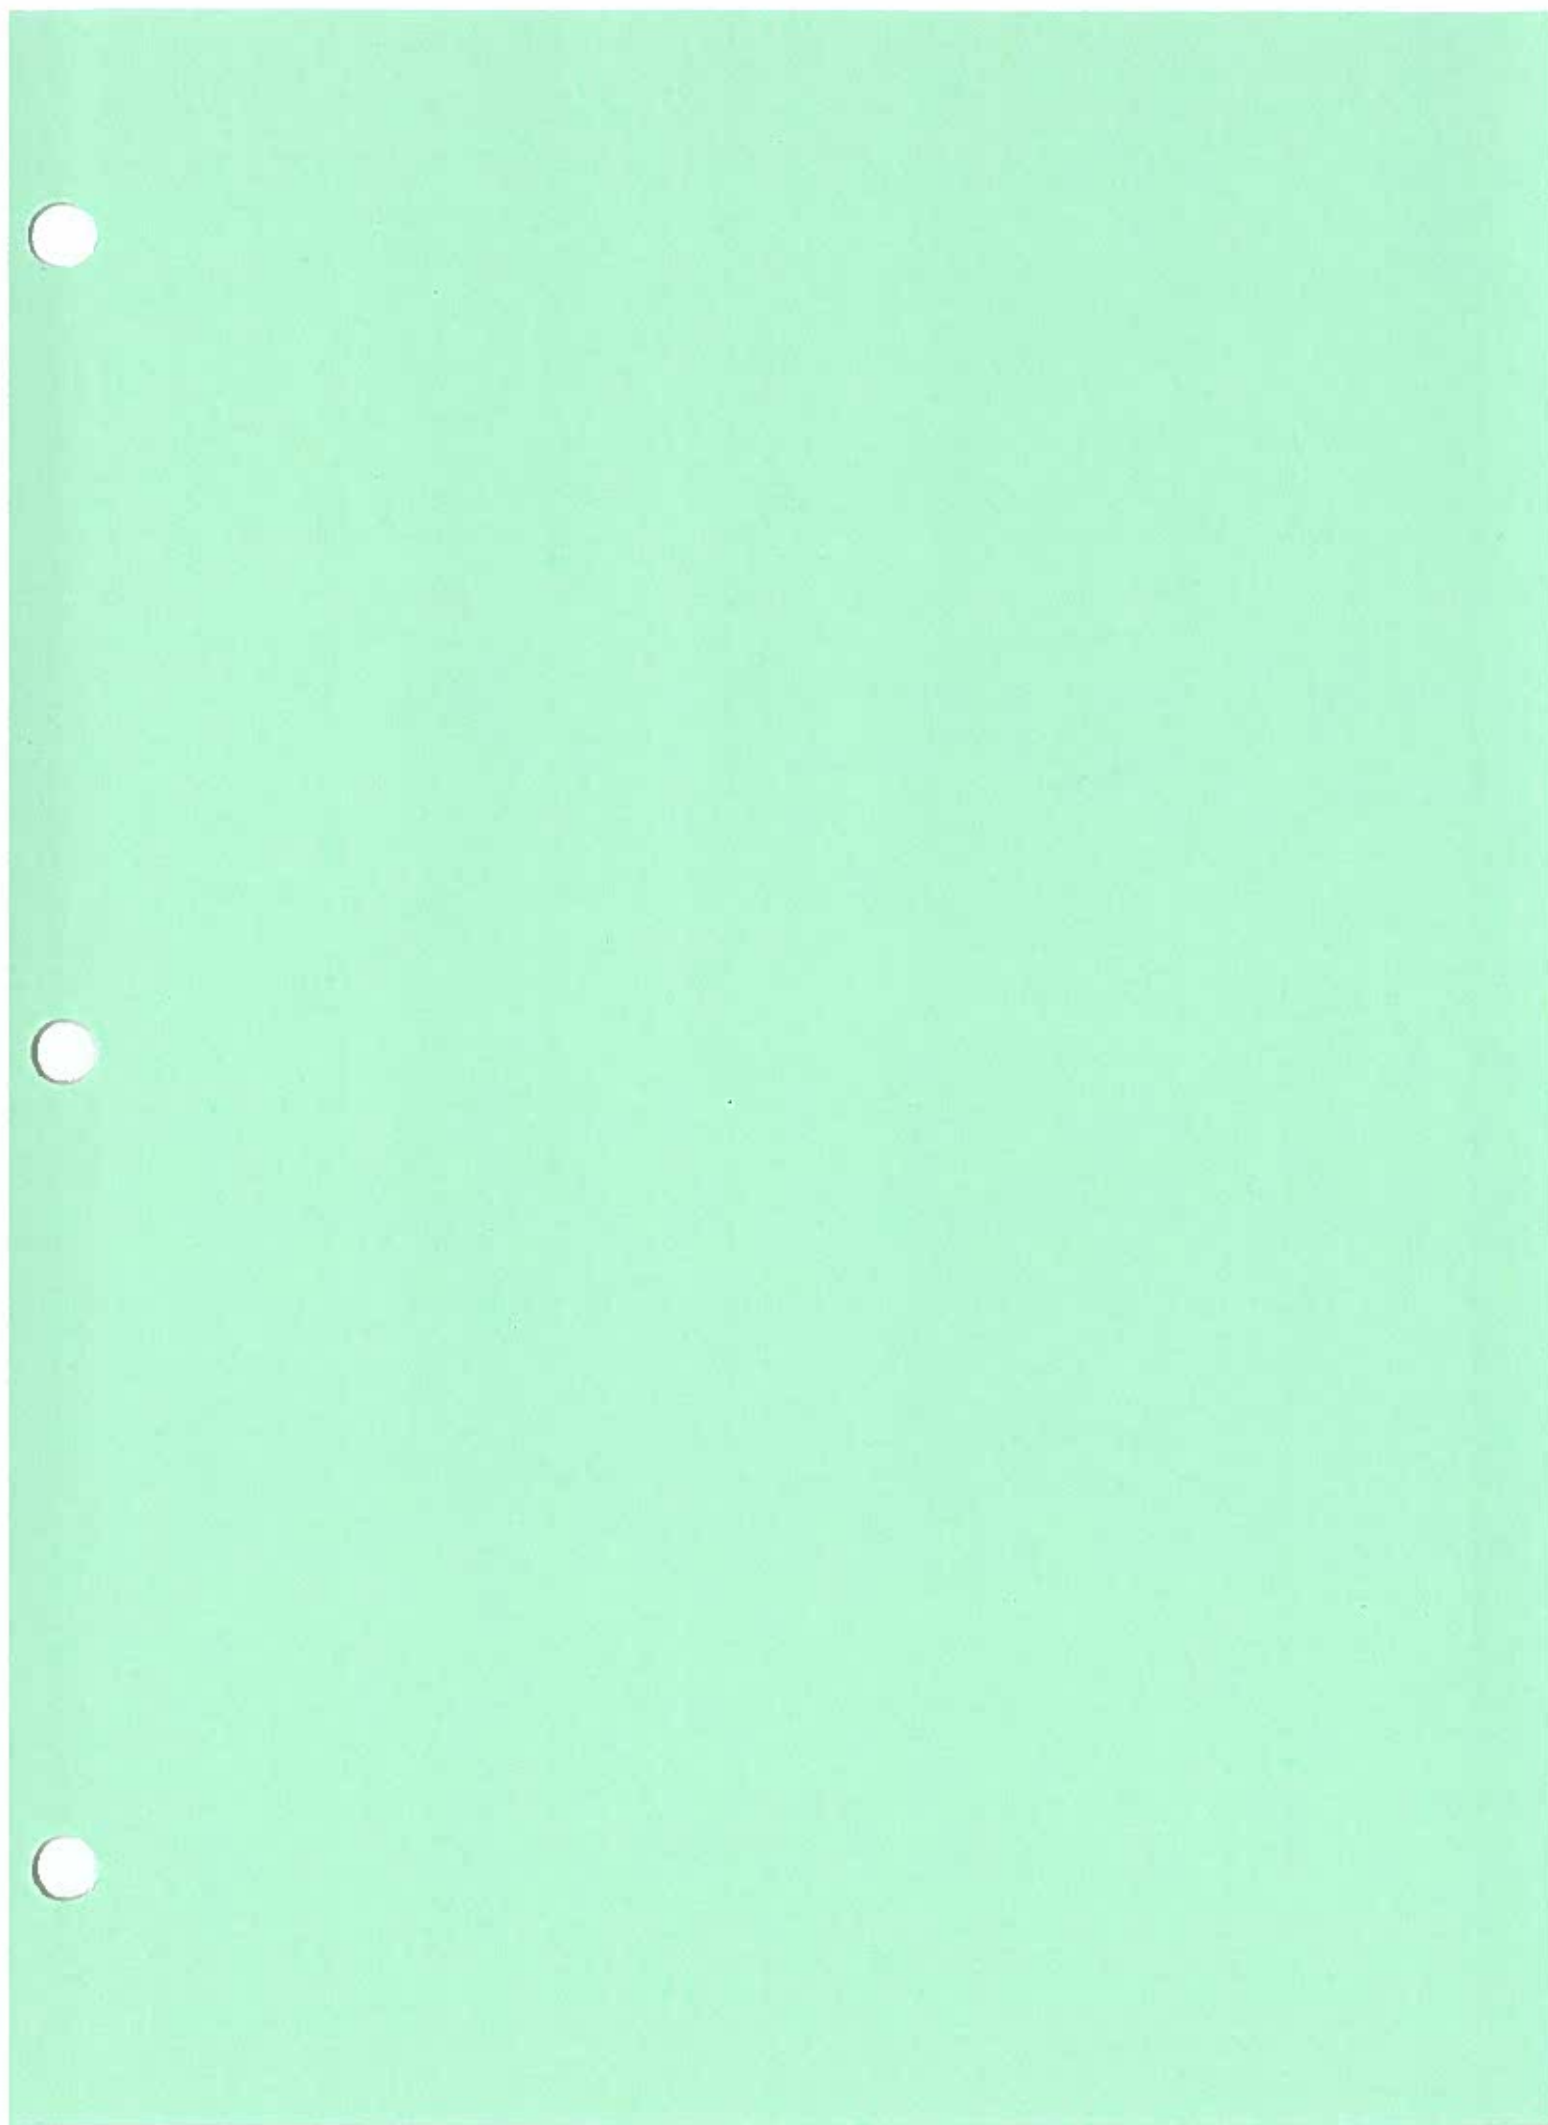

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF

Material Location
Various locations throughout the building


Material Description
VAT (various colors & sizes)

Comments

There are broken edge pieces missing in the gymnasium entryway. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/18/2002
Current Assessment Rating NR Not Required
Cause of Damage Physical Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

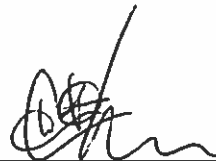

Christian Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/18/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Christian Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 28814 SF
Material Location
Throughout Building
Material Description
Mastic

Comments

Some exposure of material in gymnasium. It is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/29/1998
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Clint Yates

State

Indiana

Accreditation Number

193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building

Material Description
Cove Base

Comments

Material is in good condition. Some loose pieces in the art room.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/29/1998
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Clint Yates

State

Indiana

Accreditation Number

193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove Base Mastic

Comments

Material is in good condition where exposed.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/29/1998
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Clint Yates

State

Indiana

Accreditation Number

193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Throughout Building

Material Description
Shock Joints on AHV's

Comments
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/29/1998
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Clint Yates

State Indiana
Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Gymnasium and Custodial Room

Material Description
Fittings

Comments
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/29/1998
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Clint Yates

State

Indiana

Accreditation Number

193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments

Material is in good condition. From information gathered it is believed the fittings are encased behind the dry wall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/29/1998
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Clint Yates

State

Indiana

Accreditation Number

193804035

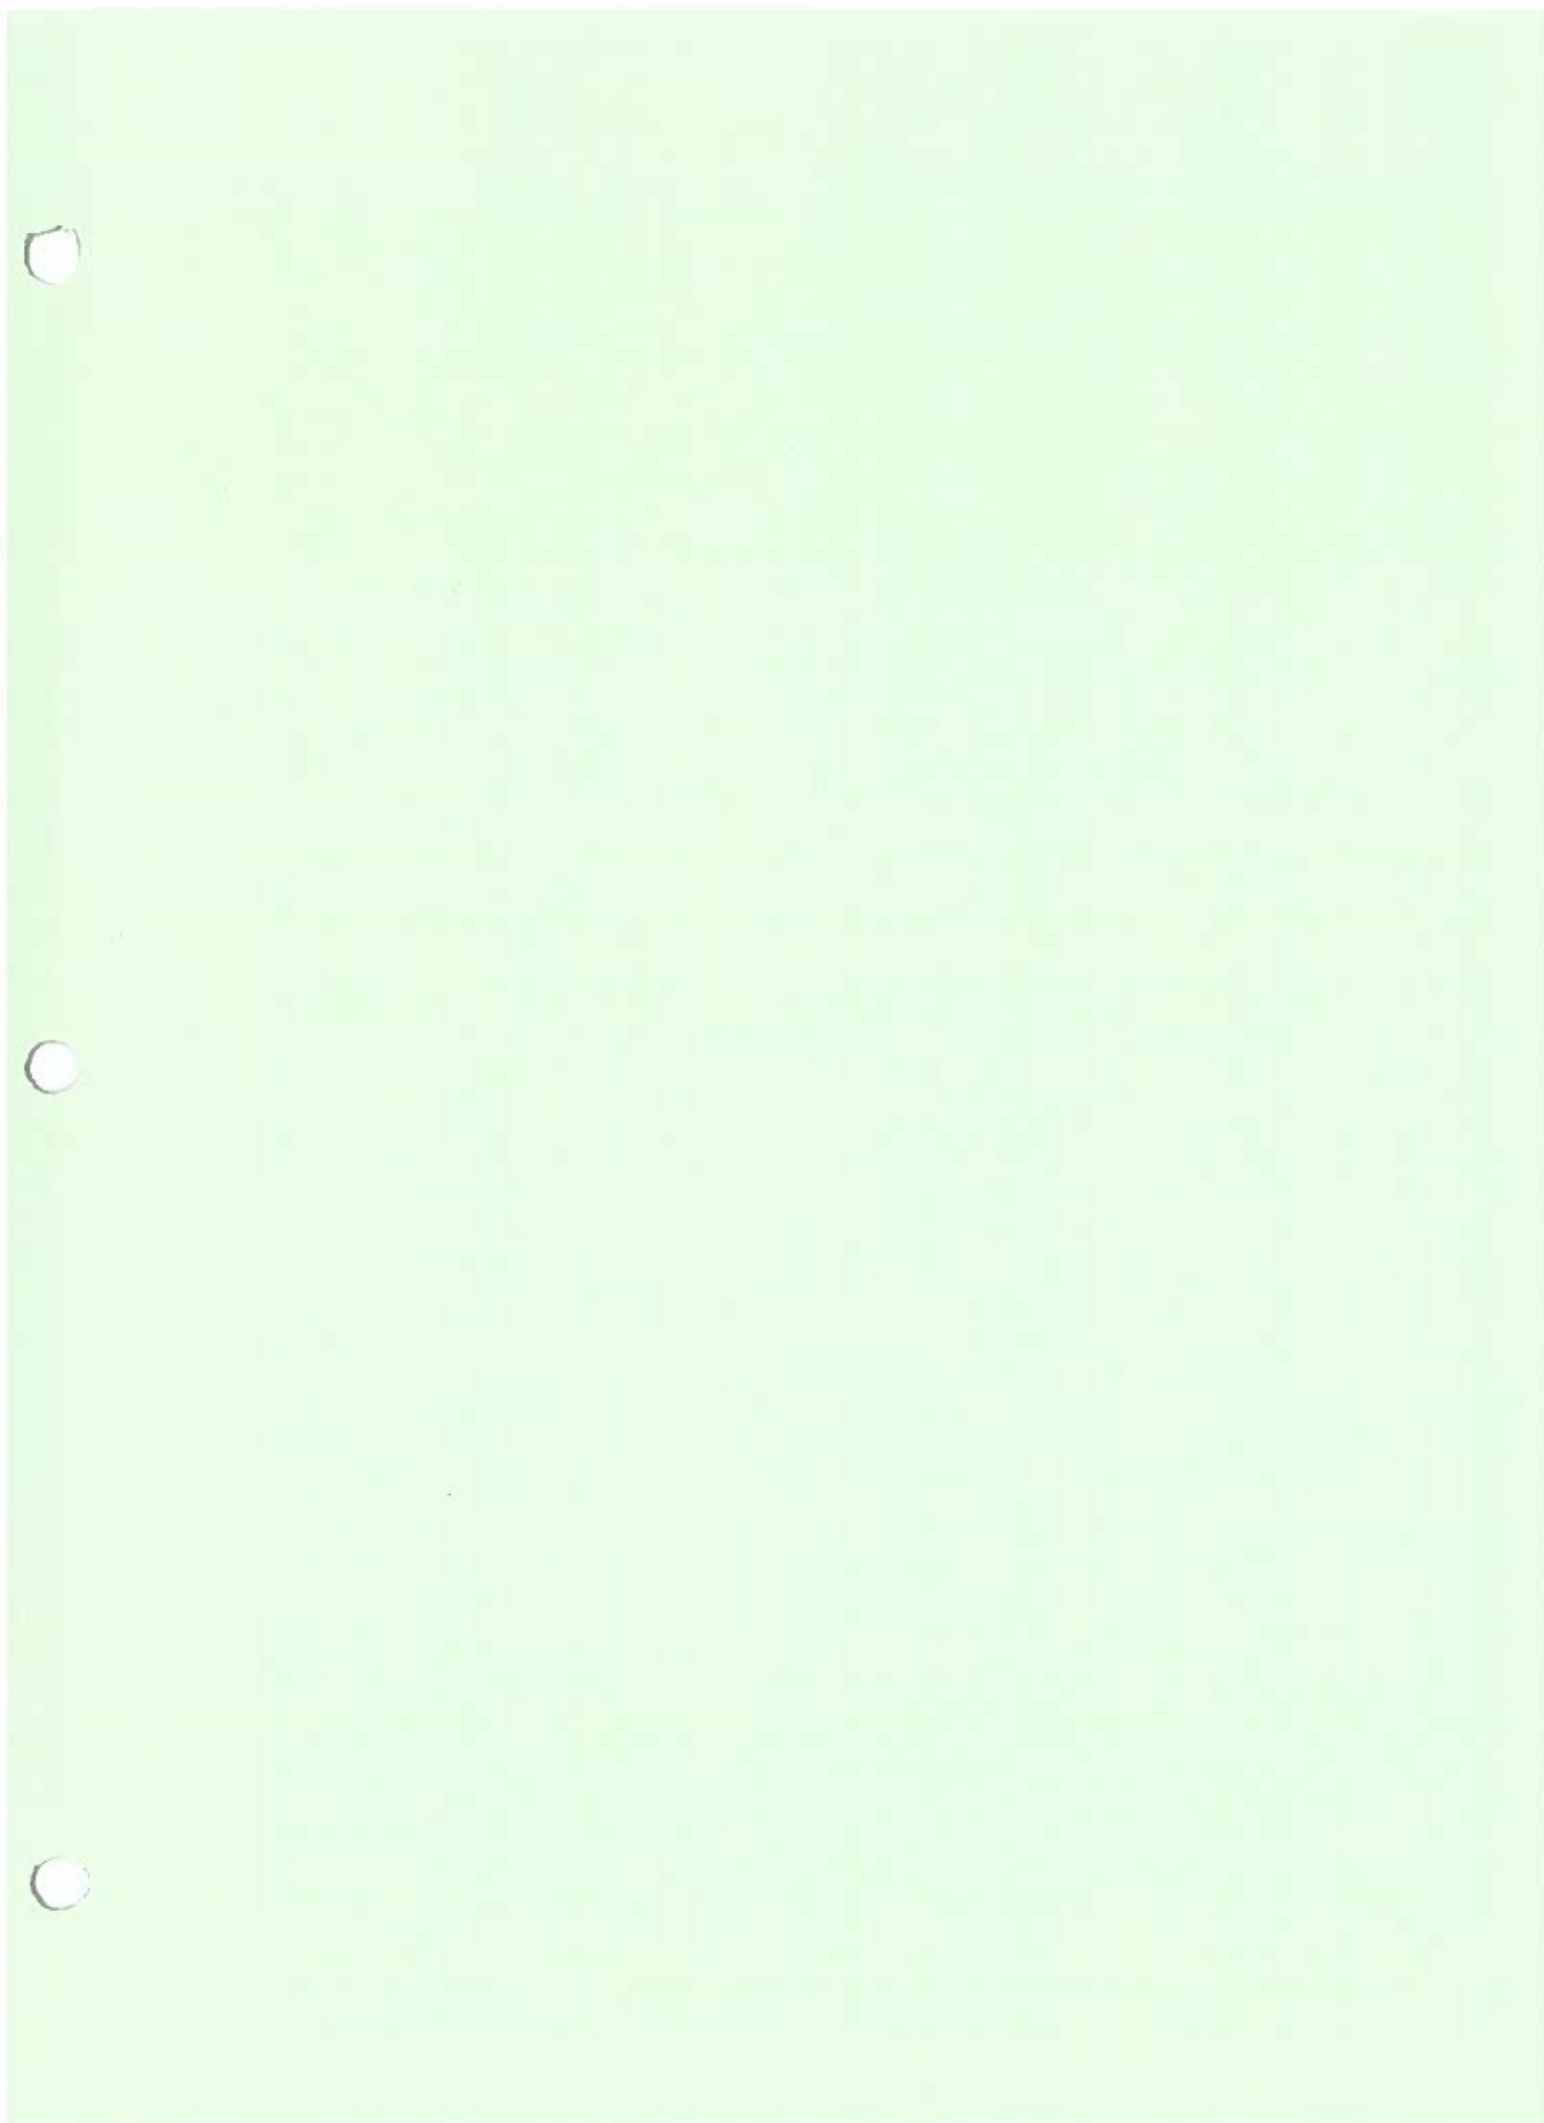

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 28,814 SF
Material Location
Various locations throughout the building
Material Description
VAT
Comments
Material is in good condition.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 1/14/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 28,814 SF
Material Location
Throughout Building
Material Description
Mastic

Comments

Some exposure of material in gymnasium. It is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 1/14/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School

HA# A

Type of Material Miscellaneous Material

Quantity of Material LF

Material Location
Throughout the building

Material Description
Cove Base

Comments
Material is in good condition. Some loose pieces in the art room.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/95

Current Surveillance Date 1/14/98

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Karen Foxx

State Indiana

Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout the building
Material Description
Cove Base Mastic
Comments
Material is in good condition where exposed.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 1/14/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material SF
Material Location
Throughout Building
Material Description
Shock Joints on AHV's
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 1/14/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Miscellaneous Material
Quantity of Material Each
Material Location
Gymnasium and Custodial Room
Material Description
Fittings
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 1/14/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Each
Material Location
Classrooms
Material Description
Fittings

Comments

Material is in good condition. From information gathered it is believed the fittings are encased behind the dry wall.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 1/14/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foss

State Indiana
Accreditation Number 191129014

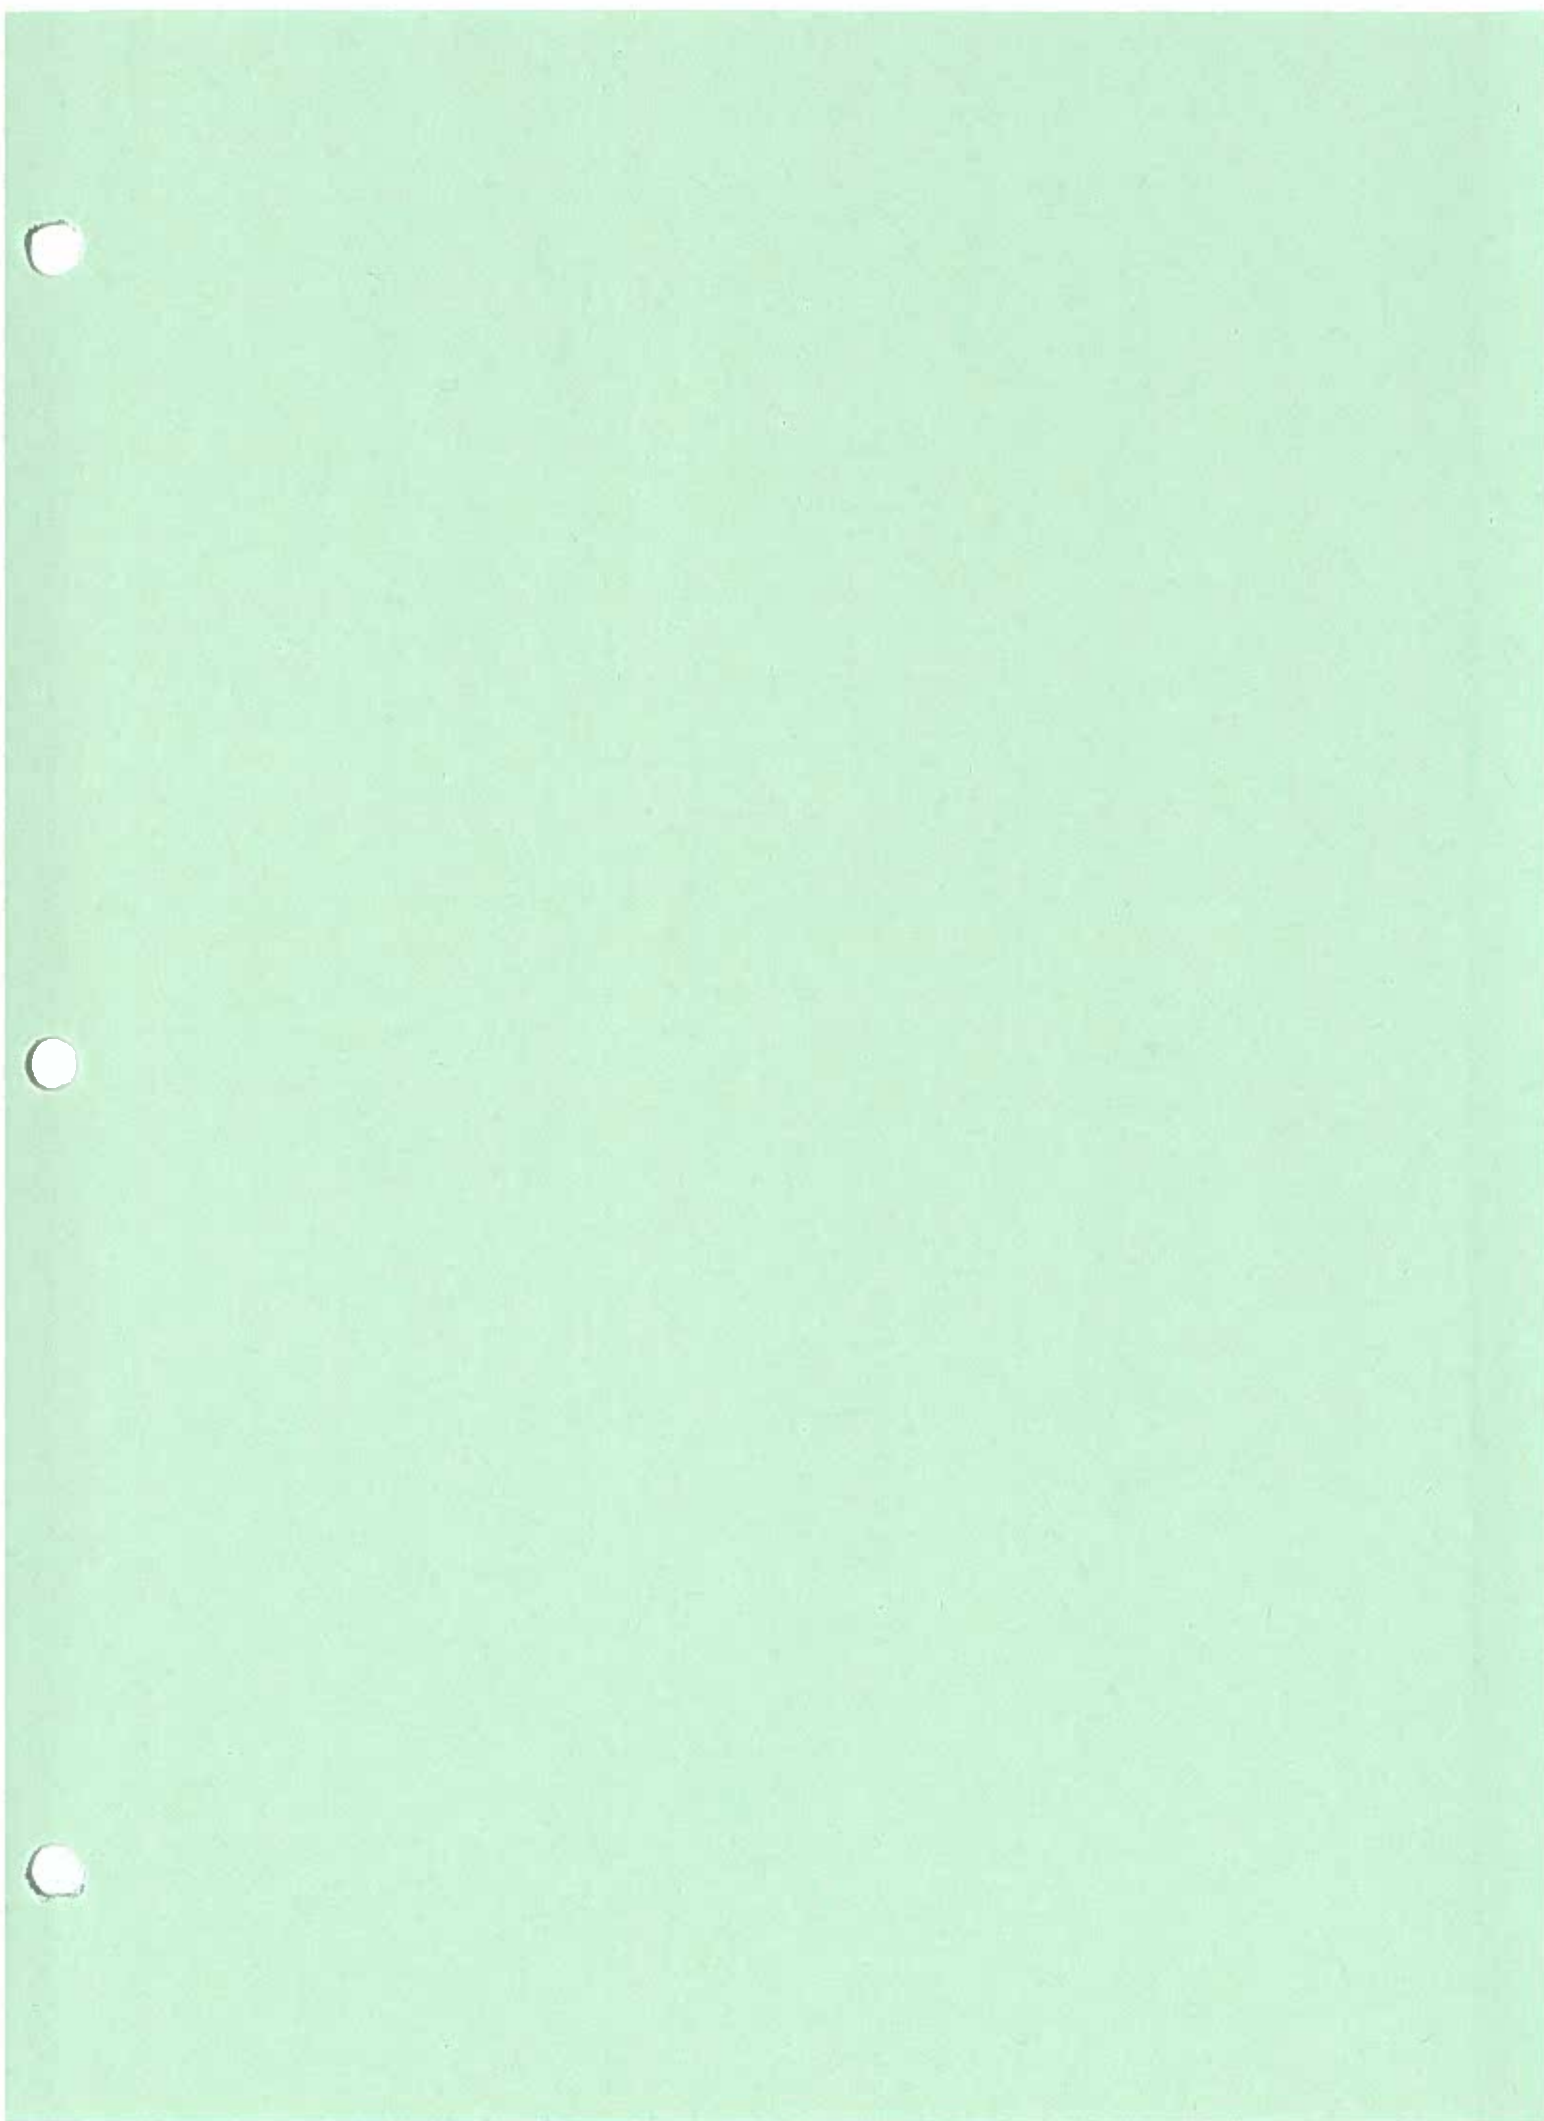

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 28,814 SF
Material Location
Various locations throughout the building
Material Description
VAT

Comments
Material is in good condition.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 7/ 3/97
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State

Indiana

Accreditation Number

191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 28,814 SF
Material Location
Throughout Building
Material Description
Mastic
Comments
Some exposure of material in gymnasium. It is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 7/ 3/97
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

| | |
|---------------------------------|---|
| LEA Name | Greater Clark County Schools |
| Building Name | W. E. Wilson Elementary School |
| HA# | A |
| Type of Material | Miscellaneous Material |
| Quantity of Material | LF |
| Material Location | Throughout the building |
| Material Description | Cove Base |
| Comments | Material is in good condition. Some loose pieces in the art room. |
| Does Material Contain Asbestos? | Assumed |
| Is it Friable? | No |
| Original Inspection Date | 5/31/95 |
| Current Surveillance Date | 7/ 3/97 |
| Current Assessment Rating | NR Not Required |
| Cause of Damage | No Damage |
| Accessible | Yes |
| Potential for Damage | Low |
| Removed | No |
| Planned Response Action | O & M |

Inspector



Karen Foxx

State

Indiana

Accreditation Number

191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout the building
Material Description
Cove Base Mastic
Comments
Material is in good condition where exposed.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 7/ 3/97
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material SF
Material Location
Throughout Building
Material Description
Shock Joints on AHV's
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 7/ 3/97
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Miscellaneous Material
Quantity of Material Each
Material Location
Gymnasium and Custodial Room
Material Description
Fittings
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 7/ 3/97
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location
Throughout the building
Material Description
Cove base
Comments
This material showed minor scraping, but was not in poor condition overall.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/18/2002
Current Assessment Rating NR Not Required
Cause of Damage Physical Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/18/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 4 Each
Material Location
Boiler room and A wing custodial closet
Material Description
White canvas shock joints on AHU's
Comments
This material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/18/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector 
Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each

Material Location
Gymnasium and custodial room

Material Description
Fittings

Comments

Some minor gouges were observed. However, this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/18/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/18/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 28,814 SF

Material Location
Various locations throughout the building


Material Description
VAT (various colors & sizes)

Comments

There are broken edge pieces missing in gymnasium. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material is not in poor condition overall. The material in the gymnasium was removed non-friable and replaced with vinyl sheet flooring.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/19/2002
Current Assessment Rating NR Not Required
Cause of Damage Physical Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

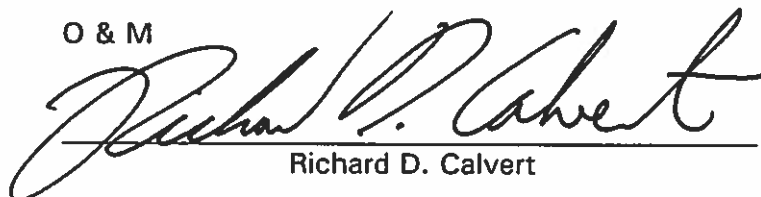
Richard D. Calvert

State Indiana
Accreditation Number 315989970

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 28,814 SF

Material Location
Throughout the building


Material Description
Floor tile mastic

Comments

Mastic is exposed in kitchen office and storage room. It is not in poor condition. Material was removed non-friable from the gymnasium.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/19/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

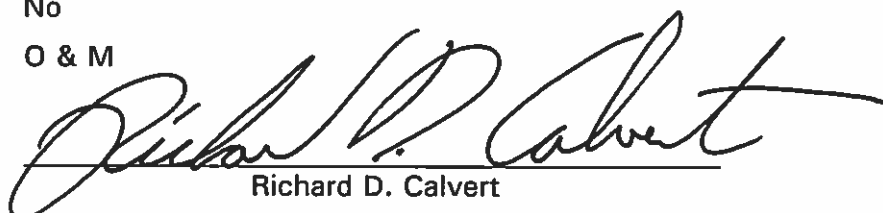
Richard D. Calvert

State Indiana
Accreditation Number 315989970

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF

Material Location
Throughout the building

Material Description
Cove base

Comments
Material is not in poor condition throughout with minor scraping observed.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/19/2002
Current Assessment Rating NR Not Required
Cause of Damage Physical Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Richard D. Calvert

State Indiana
Accreditation Number 315989970

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
No mastic was exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/19/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

Richard D. Calvert

State Indiana
Accreditation Number 315989970

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 4 Each
Material Location
Boiler room and A wing custodial closet
Material Description
White canvas shock joints on AHU's
Comments
Material is not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/19/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M
Inspector

Richard D. Calvert
State Indiana
Accreditation Number 315989970

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School

HA# D

Type of Material Thermal Material

Quantity of Material Approx. 18 Each

Material Location
Gymnasium and custodial room

Material Description
Fittings

Comments

Fittings are not in poor condition. Some minor gouges observed in the custodial room.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 06/19/2002

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

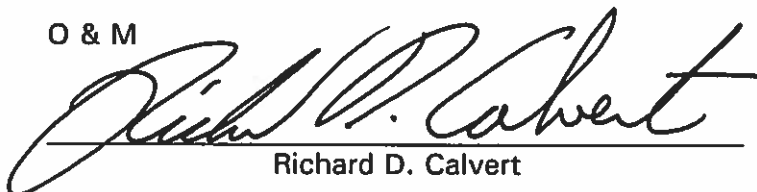
Richard D. Calvert

State Indiana

Accreditation Number 315989970

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments

From information gathered it is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/19/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

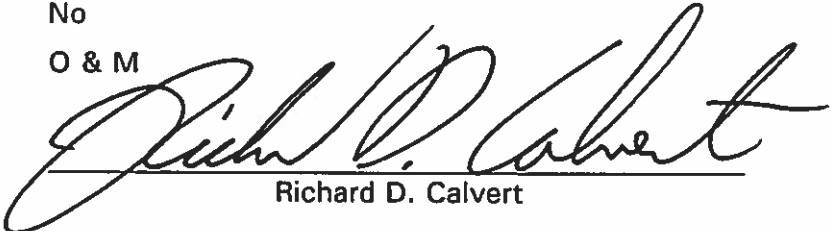

Richard D. Calvert

State Indiana
Accreditation Number 315989970



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 28,814 SF

Material Location
Various locations throughout the building


Material Description
VAT (various colors & sizes)

Comments

There are broken edge pieces missing in gymnasium. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material is not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/10/2002
Current Assessment Rating NR Not Required
Cause of Damage Physical Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

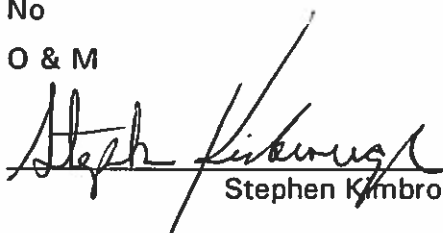
Stephen Kimbrough

State Indiana
Accreditation Number 191914122

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 28,814 SF


Material Location
Throughout the building

Material Description
Floor tile mastic

Comments
Mastic is exposed in gymnasium, kitchen office and storage room. It is not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/10/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

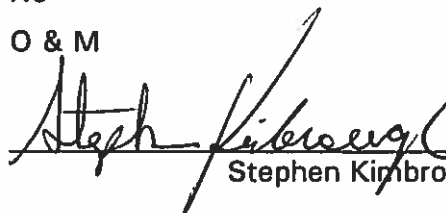
Stephen Kimbrough

State Indiana
Accreditation Number 191914122

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF


Material Location
Throughout the building

Material Description
Cove base

Comments
Material is not in poor condition throughout with minor scraping observed.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/10/2002
Current Assessment Rating NR Not Required
Cause of Damage Physical Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

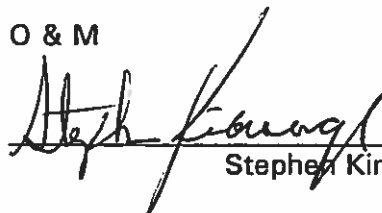

Stephen Kimbrough

State Indiana
Accreditation Number 191914122

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
No mastic was exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/10/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M
Inspector

Stephen Kimbrough
State Indiana
Accreditation Number 191914122

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 4 Each
Material Location
Boiler room and A wing custodial closet
Material Description
White canvas shock joints on AHU's
Comments
Material is not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/10/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M
Inspector 
Stephen Kimbrough
State Indiana
Accreditation Number 191914122

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each

Material Location
Gymnasium and custodial room

Material Description
Fittings

Comments
Fittings are not in poor condition. Some minor gouges observed in the custodial room.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/10/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Stephen Kimbrough

State Indiana
Accreditation Number 191914122

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments

From information gathered it is believed the fittings are encased behind the dry wall and are not visible to inspect.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/10/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

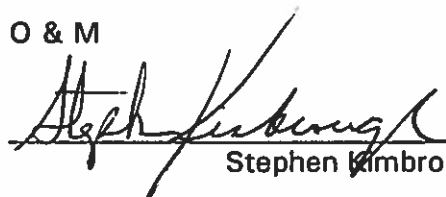

Stephen Kimbrough

State Indiana
Accreditation Number 191914122

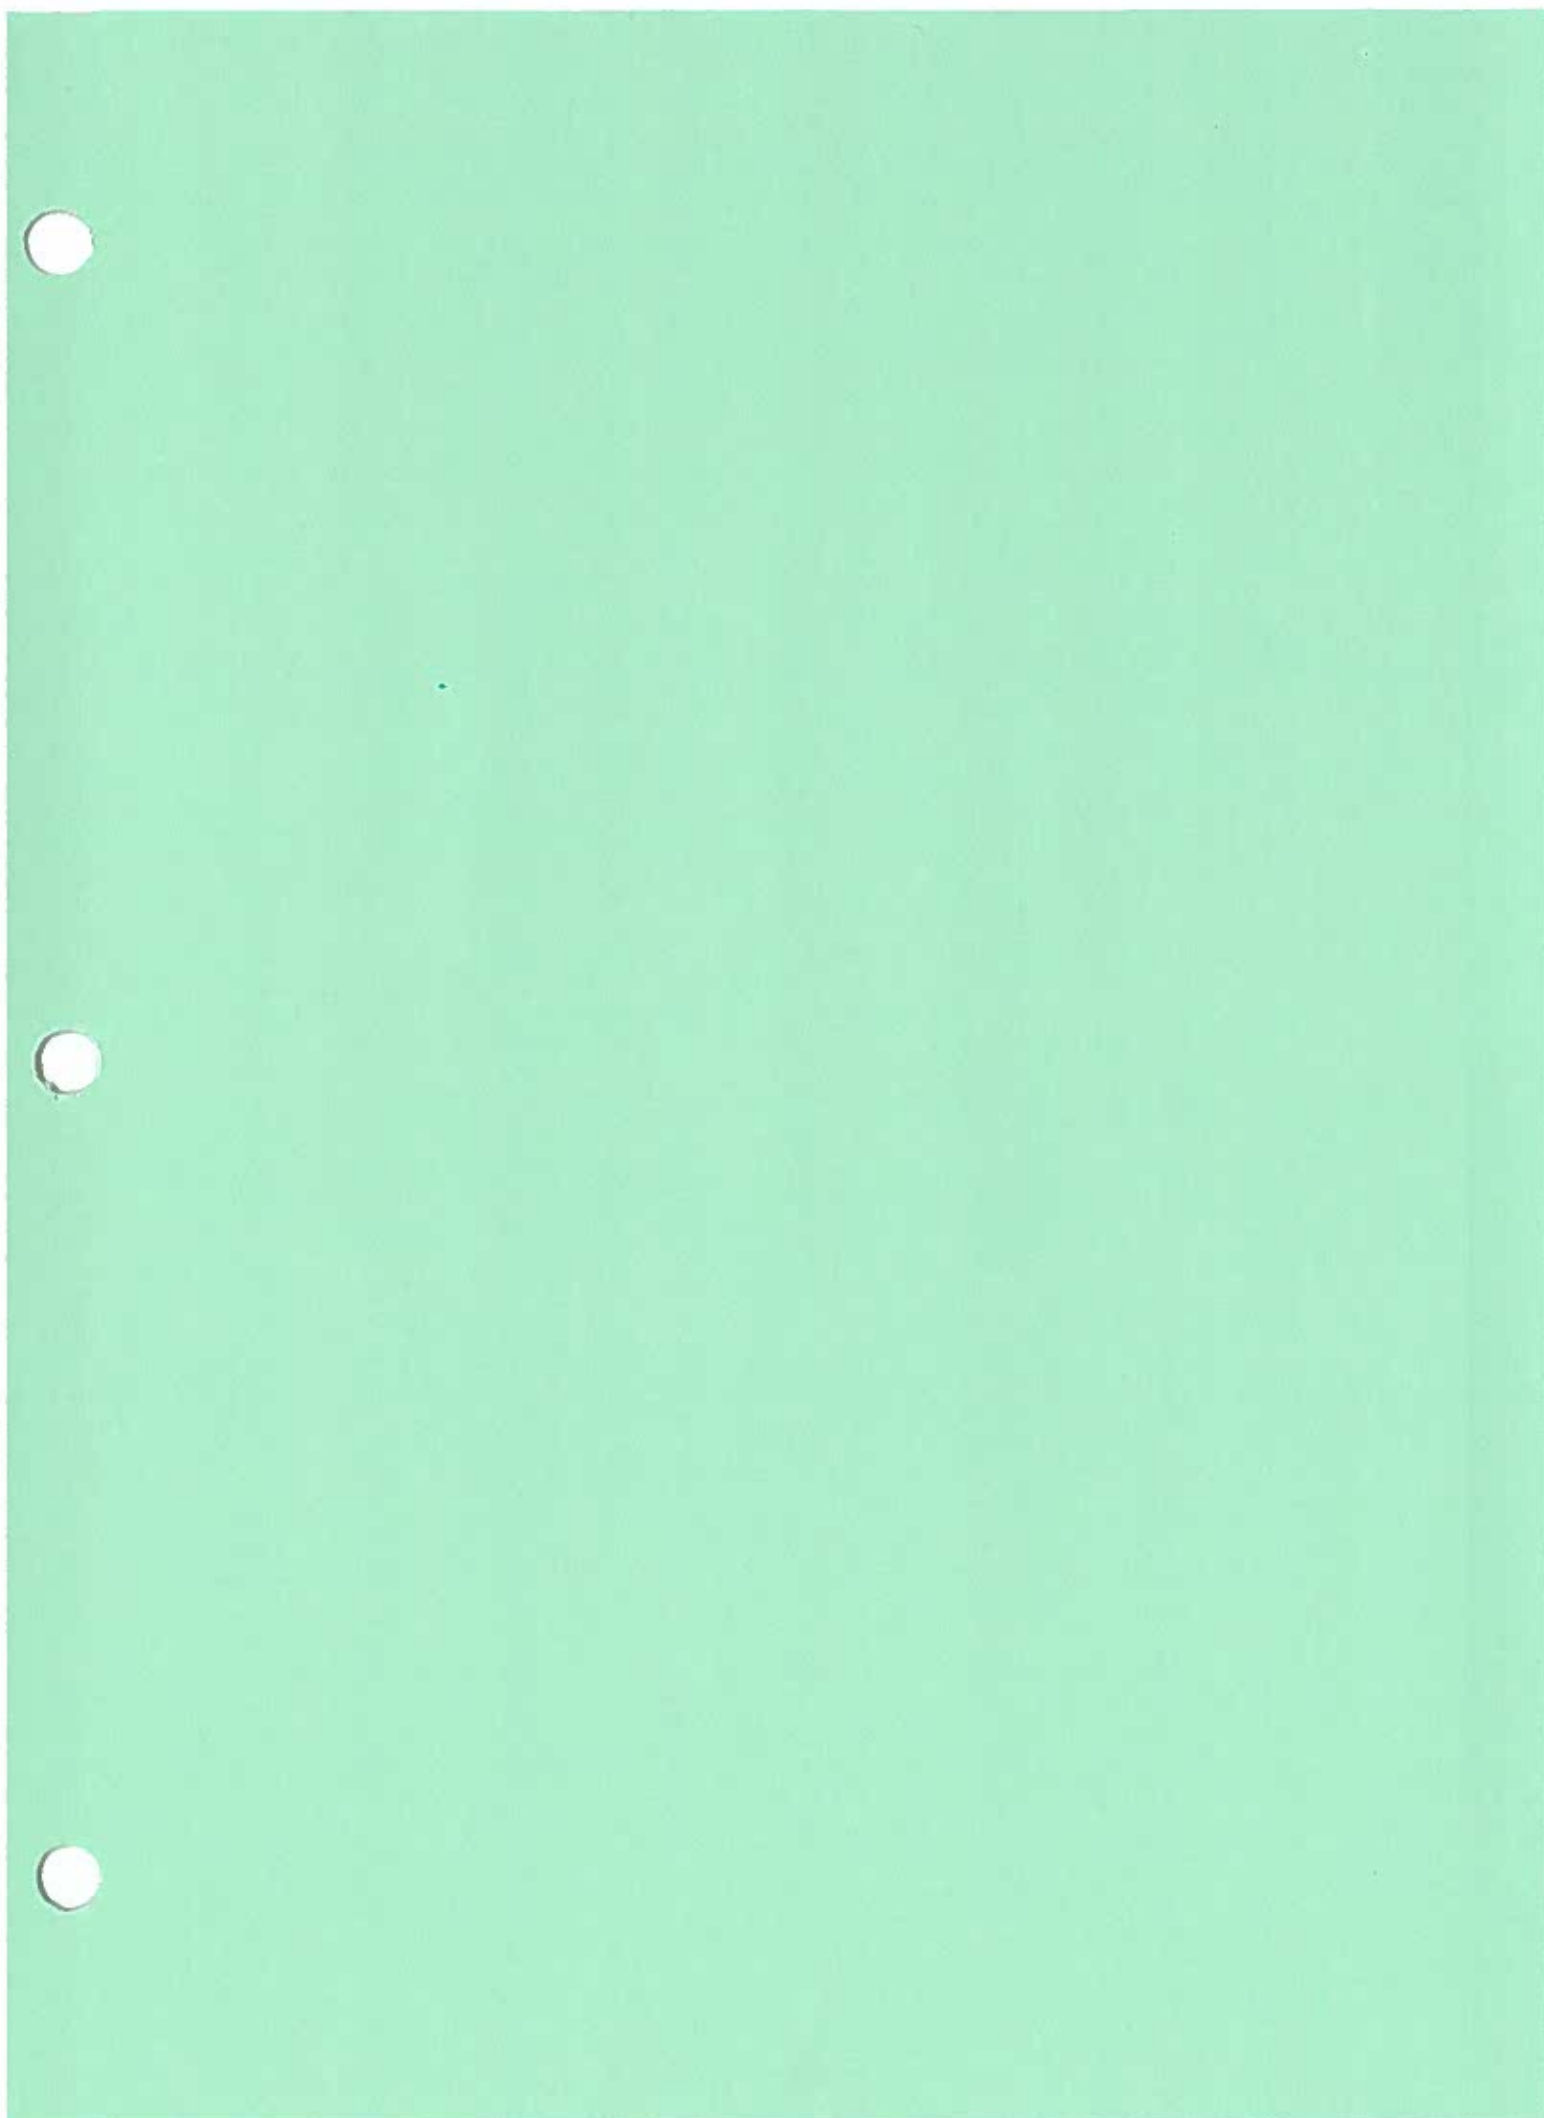

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 28,814 SF


Material Location
Various locations throughout the building

Material Description
VAT (various colors & sizes)

Comments
There are broken edge pieces missing in gymnasium. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material is in good overall condition.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 01/10/2001
Current Assessment Rating NR Not Required
Cause of Damage Physical Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Patrick E. Wilson

State Indiana
Accreditation Number 190824065

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 28,814 SF

Material Location
Throughout the building

Material Description
Floor tile mastic

Comments
Mastic is exposed in gymnasium, kitchen office and storage room. It is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 01/10/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Patrick E. Wilson

State Indiana
Accreditation Number 190824065

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location
Throughout the building
Material Description
Cove base
Comments
Material is in good condition throughout.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 01/10/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Patrick E. Wilson

State Indiana
Accreditation Number 190824065

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
No mastic was exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 01/10/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Patrick E. Wilson

State Indiana
Accreditation Number 190824065

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 4 Each
Material Location
Boiler room and A wing custodial closet
Material Description
White canvas shock joints on AHU's
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 01/10/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Patrick E. Wilson

State Indiana
Accreditation Number 190824065

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location
Gymnasium and custodial room
Material Description
Fittings
Comments
Fittings are in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 01/10/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Patrick E. Wilson

State Indiana
Accreditation Number 190824065

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments

From information gathered it is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 01/10/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Patrick E. Wilson

State Indiana
Accreditation Number 190824065



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 28814 SF

Material Location
Various locations throughout the building

Material Description
VAT (various colors & sizes)

Comments

There are broken edge pieces missing in gymnasium. Lowere level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material is in good overall condition.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/29/2000
Current Assessment Rating NR Not Required
Cause of Damage Physical Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 28814 SF
Material Location
Throughout the building
Material Description
Floor Tile Mastic
Comments
Where mastic is exposed in gymnasium, it is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/29/2000
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

Indiana

Accreditation Number

191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name W. E. Wilson Elementary School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Unquantified LF

Material Location
Throughout the building

Material Description
Cove Base

Comments

Material is in good condition. The loose pieces in the art room have been reattached.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 06/29/2000

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove Base Mastic
Comments
No mastic was exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/29/2000
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

Indiana


Accreditation Number

191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 4 Each
Material Location
Boiler room and A wing custodial closet
Material Description
White Canvas Shock Joints on AHU's
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/29/2000
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

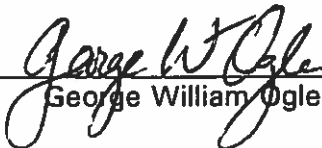
George William Ogle

State

Indiana

Accreditation Number

191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location
Gymnasium and custodial room
Material Description
Fittings
Comments
Fittings are in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/29/2000
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector _____

George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments

From information gathered it is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/29/2000
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 28814 SF


Material Location
Various locations throughout the building

Material Description
VAT (various colors & sizes)

Comments
Edge pieces missing in gymnasium. First floor custodial closet has water damage and edge pieces missing. Second floor custodial closet has loose pieces. Kitchen office and storage area has broken edges.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage Other
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 28814 SF

Material Location
Throughout the building


Material Description
Mastic

Comments

Some exposure of material in gymnasium. It is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove Base
Comments
Material is in good condition. Some loose pieces in the art room.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove Base Mastic
Comments
Material is in good condition where exposed.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Throughout the building
Material Description
Shock Joints on AHV's
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location
Gymnasium and custodial room
Material Description
Fittings
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Classrooms


Material Description
Fittings

Comments

From information gathered it is believed the fittings are encased behind the dry wall.
Unable to inspect at this time.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Matthew Wallace

State Indiana
Accreditation Number 191219020



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 28814 SF
Material Location
Various locations throughout the building
Material Description
VAT
Comments
Loose pieces found in 2nd floor custodial closet.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage Other
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector 
Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 28814 SF

Material Location
Throughout Building

Material Description
Mastic

Comments
Some exposure of material in gymnasium. It is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove Base
Comments
Material is in good condition. Some loose pieces in the art room.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M
Inspector

Matthew Wallace
State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove Base Mastic
Comments
Material is in good condition where exposed.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

Matthew Wallace


State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

| | |
|---------------------------------|---|
| LEA Name | Greater Clark County Schools |
| Building Name | W. E. Wilson Elementary School |
| HA# | C |
| Type of Material | Miscellaneous Material |
| Quantity of Material | Unquantified SF |
| Material Location | Throughout Building |
| Material Description | Shock Joints on AHV's |
| Comments | Material is in good condition. |
| Does Material Contain Asbestos? | Assumed |
| Is it Friable? | No |
| Original Inspection Date | 05/31/1995 |
| Current Surveillance Date | 06/24/1999 |
| Current Assessment Rating | NR Not Required |
| Cause of Damage | No Damage |
| Accessible | Yes |
| Potential for Damage | Low |
| Removed | No |
| Planned Response Action | O & M |
| Inspector |  Matthew Wallace |
| State | Indiana |
| Accreditation Number | 191219020 |

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Gymnasium and Custodial Room
Material Description
Fittings
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

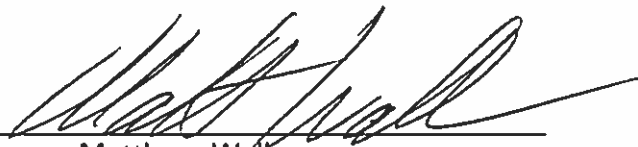Inspector 
Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms


Material Description
Fittings

Comments

Material is in good condition. From information gathered it is believed the fittings are encased behind the dry wall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

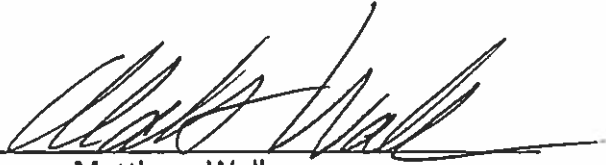
Matthew Wallace

State Indiana
Accreditation Number 191219020



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 28814 SF
Material Location
Various locations throughout the building


Material Description
VAT

Comments

Loose pieces found in 2nd floor custodial closet.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/29/1998
Current Assessment Rating NR Not Required
Cause of Damage Other
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

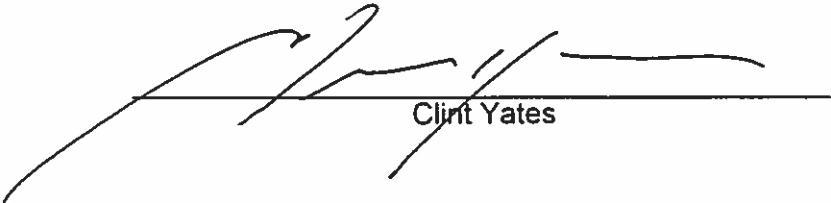
Clint Yates

State

Indiana

Accreditation Number

193804035

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Each
Material Location Classrooms
Material Description Fittings

Comments

Material is in good condition. From information gathered it is believed the fittings are encased behind the dry wall.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 7/ 3/97
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

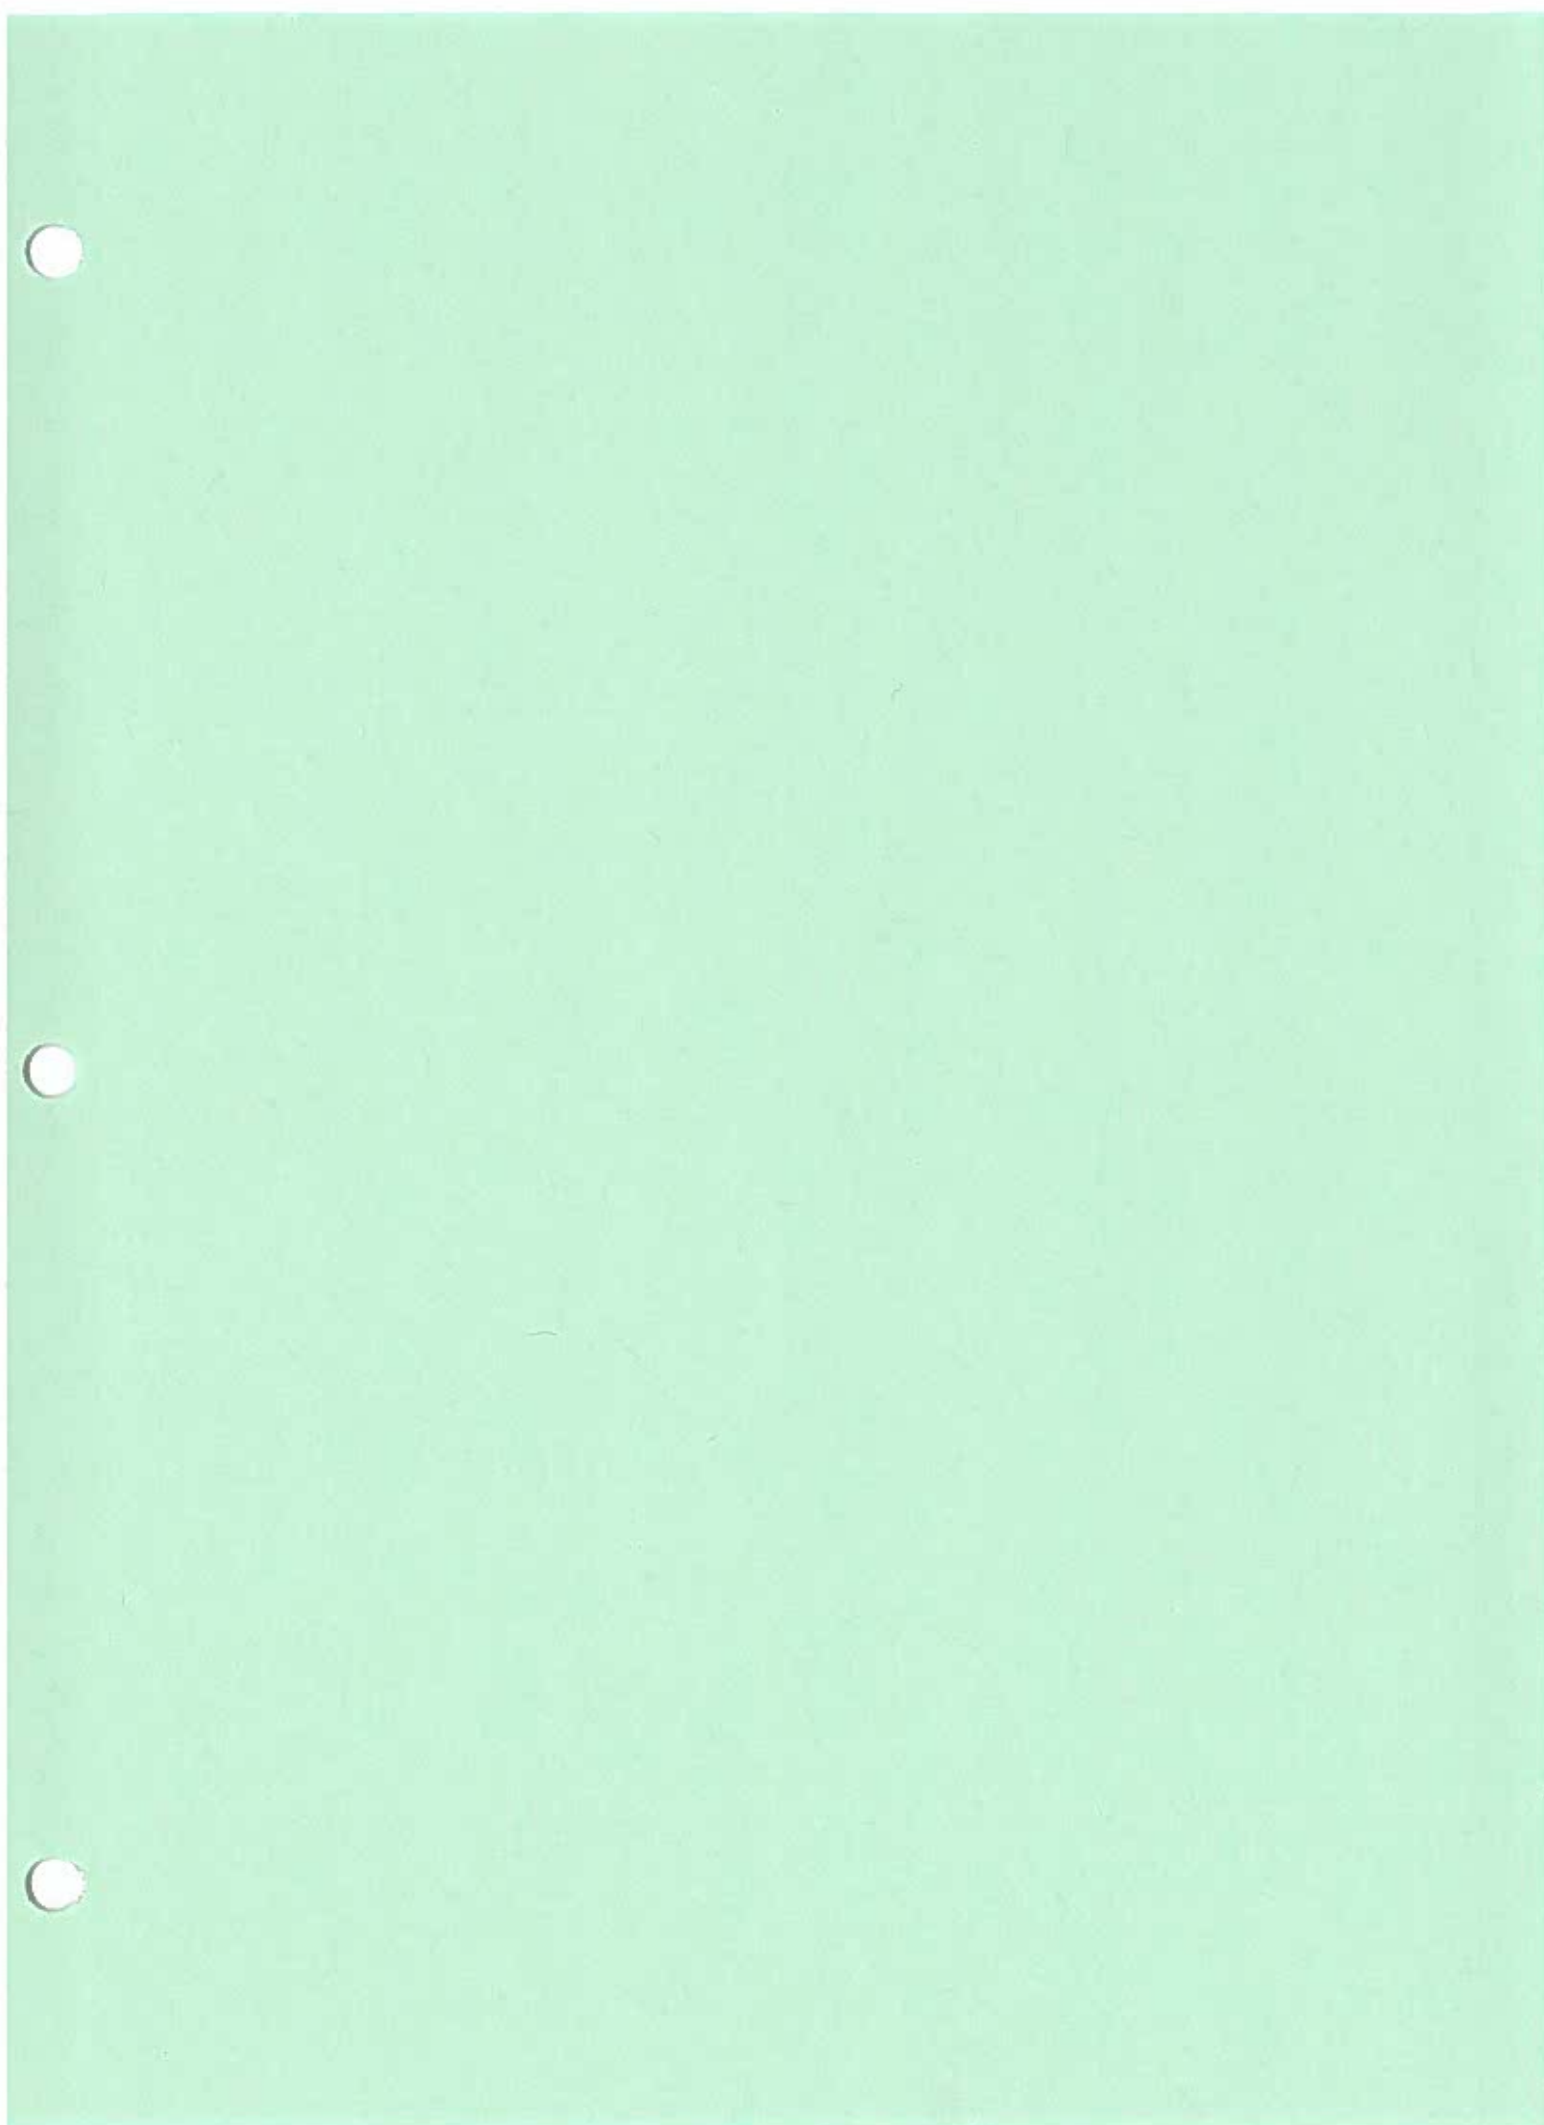

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 28,814 SF

Material Location
Throughout the building


Material Description
VAT

Comments

Material is in good condition and known to be asbestos containing. No change.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

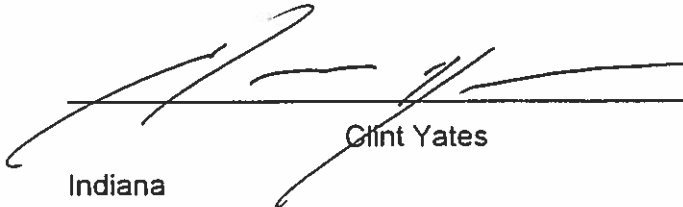
Clint Yates

State

Indiana

Accreditation Number

193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 28,814 SF

Material Location
Throughout Building


Material Description
Mastic

Comments

Material is assumed to be asbestos containing and is in good condition. No change.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

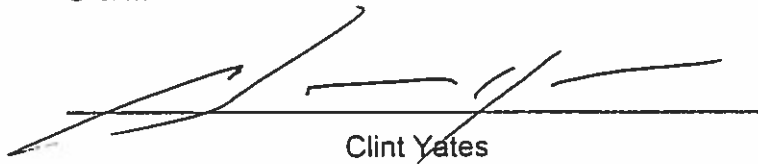

Clint Yates

State Indiana
Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material LF

Material Location
Throughout the building


Material Description
Cove Base

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

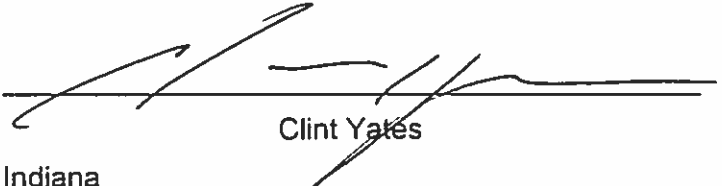
Clint Yates

State Indiana

Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material LF


Material Location
Throughout the building

Material Description
Cove Base Mastic

Comments
Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

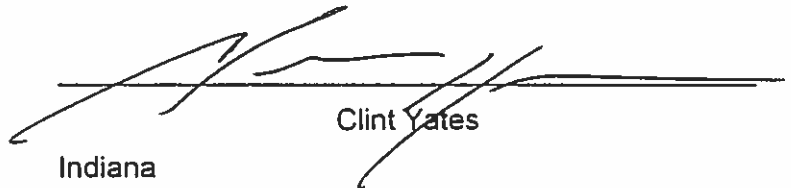

Clint Yates

State Indiana
Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material SF

Material Location
Throughout Building


Material Description
Shock Joints on AHV's

Comments

Material is assumed to be positive and will be treated as ACM until is is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

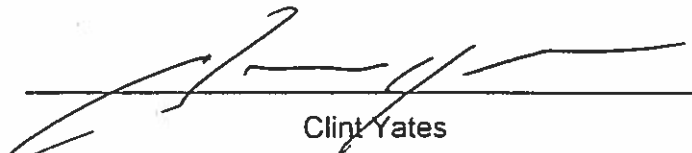
Clint Yates

State Indiana

Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name W. E. Wilson Elementary School

HA# D

Type of Material Miscellaneous Material

Quantity of Material Each

Material Location

Gymnasium and Custodial Room

Material Description

Fittings

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/95

Current Surveillance Date 12/16/96

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

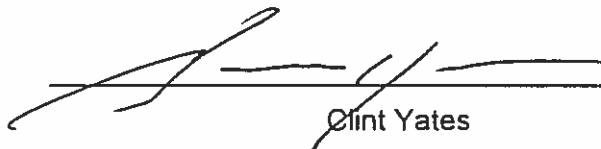
Clint Yates

State Indiana

Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Each
Material Location
Classrooms
Material Description
Fittings

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition. From information gathered it is believed the fittings are encased behind the dry wall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

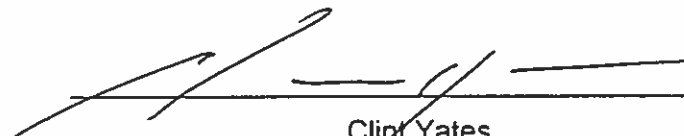
Clint Yates

State

Indiana

Accreditation Number

193804035



PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 28,814 SF
Material Location
Throughout the building
Material Description
VAT

Comments

Material is in good condition and known to be asbestos containing. No change.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 6/24/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Rex Gaddis

State Indiana
Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 28,814 SF
Material Location
Throughout Building
Material Description
Mastic

Comments

Material is assumed to be asbestos containing and is in good condition. No change.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 6/24/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Rex Gaddis

State Indiana
Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School

HA# A

Type of Material Miscellaneous Material

Quantity of Material LF

Material Location
Throughout the building

Material Description
Cove Base

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

| | |
|--|-----------------|
| Does Material Contain Asbestos? | Assumed |
| Is it Friable? | No |
| Original Inspection Date | 5/31/95 |
| Current Surveillance Date | 6/24/96 |
| Current Assessment Rating | NR Not Required |
| Cause of Damage | No Damage |
| Accessible | Yes |
| Potential for Damage | Low |
| Removed | No |
| Planned Response Action | O & M |

Inspector



Rex Gaddis

State Indiana
Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material

Quantity of Material LF


Material Location
Throughout the building

Material Description
Cove Base Mastic

Comments
Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

| | |
|--|-----------------|
| Does Material Contain Asbestos? | Assumed |
| Is it Friable? | No |
| Original Inspection Date | 5/31/95 |
| Current Surveillance Date | 6/24/96 |
| Current Assessment Rating | NR Not Required |
| Cause of Damage | No Damage |
| Accessible | No |
| Potential for Damage | Low |
| Removed | No |
| Planned Response Action | O & M |

Inspector



Rex Gaddis

State Indiana
Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material SF
Material Location
Throughout Building


Material Description
Shock Joints on AHV's

Comments

Material is assumed to be positive and will be treated as ACM until is is sampled.
Material is in good condition.

| | |
|---------------------------------|-----------------|
| Does Material Contain Asbestos? | Assumed |
| Is it Friable? | No |
| Original Inspection Date | 5/31/95 |
| Current Surveillance Date | 6/24/96 |
| Current Assessment Rating | NR Not Required |
| Cause of Damage | No Damage |
| Accessible | Yes |
| Potential for Damage | Low |
| Removed | No |
| Planned Response Action | O & M |

Inspector



Rex Gaddis

State Indiana
Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name W. E. Wilson Elementary School

HA# D

Type of Material Miscellaneous Material

Quantity of Material Each

Material Location
Gymnasium and Custodial Room

Material Description
Fittings

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/95

Current Surveillance Date 6/24/96

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Rex Gaddis

State Indiana

Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Each
Material Location
Classrooms
Material Description
Fittings

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition. From information gathered it is believed the fittings are encased behind the dry wall.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 6/24/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Rex Gaddis

State Indiana
Accreditation Number 190908032

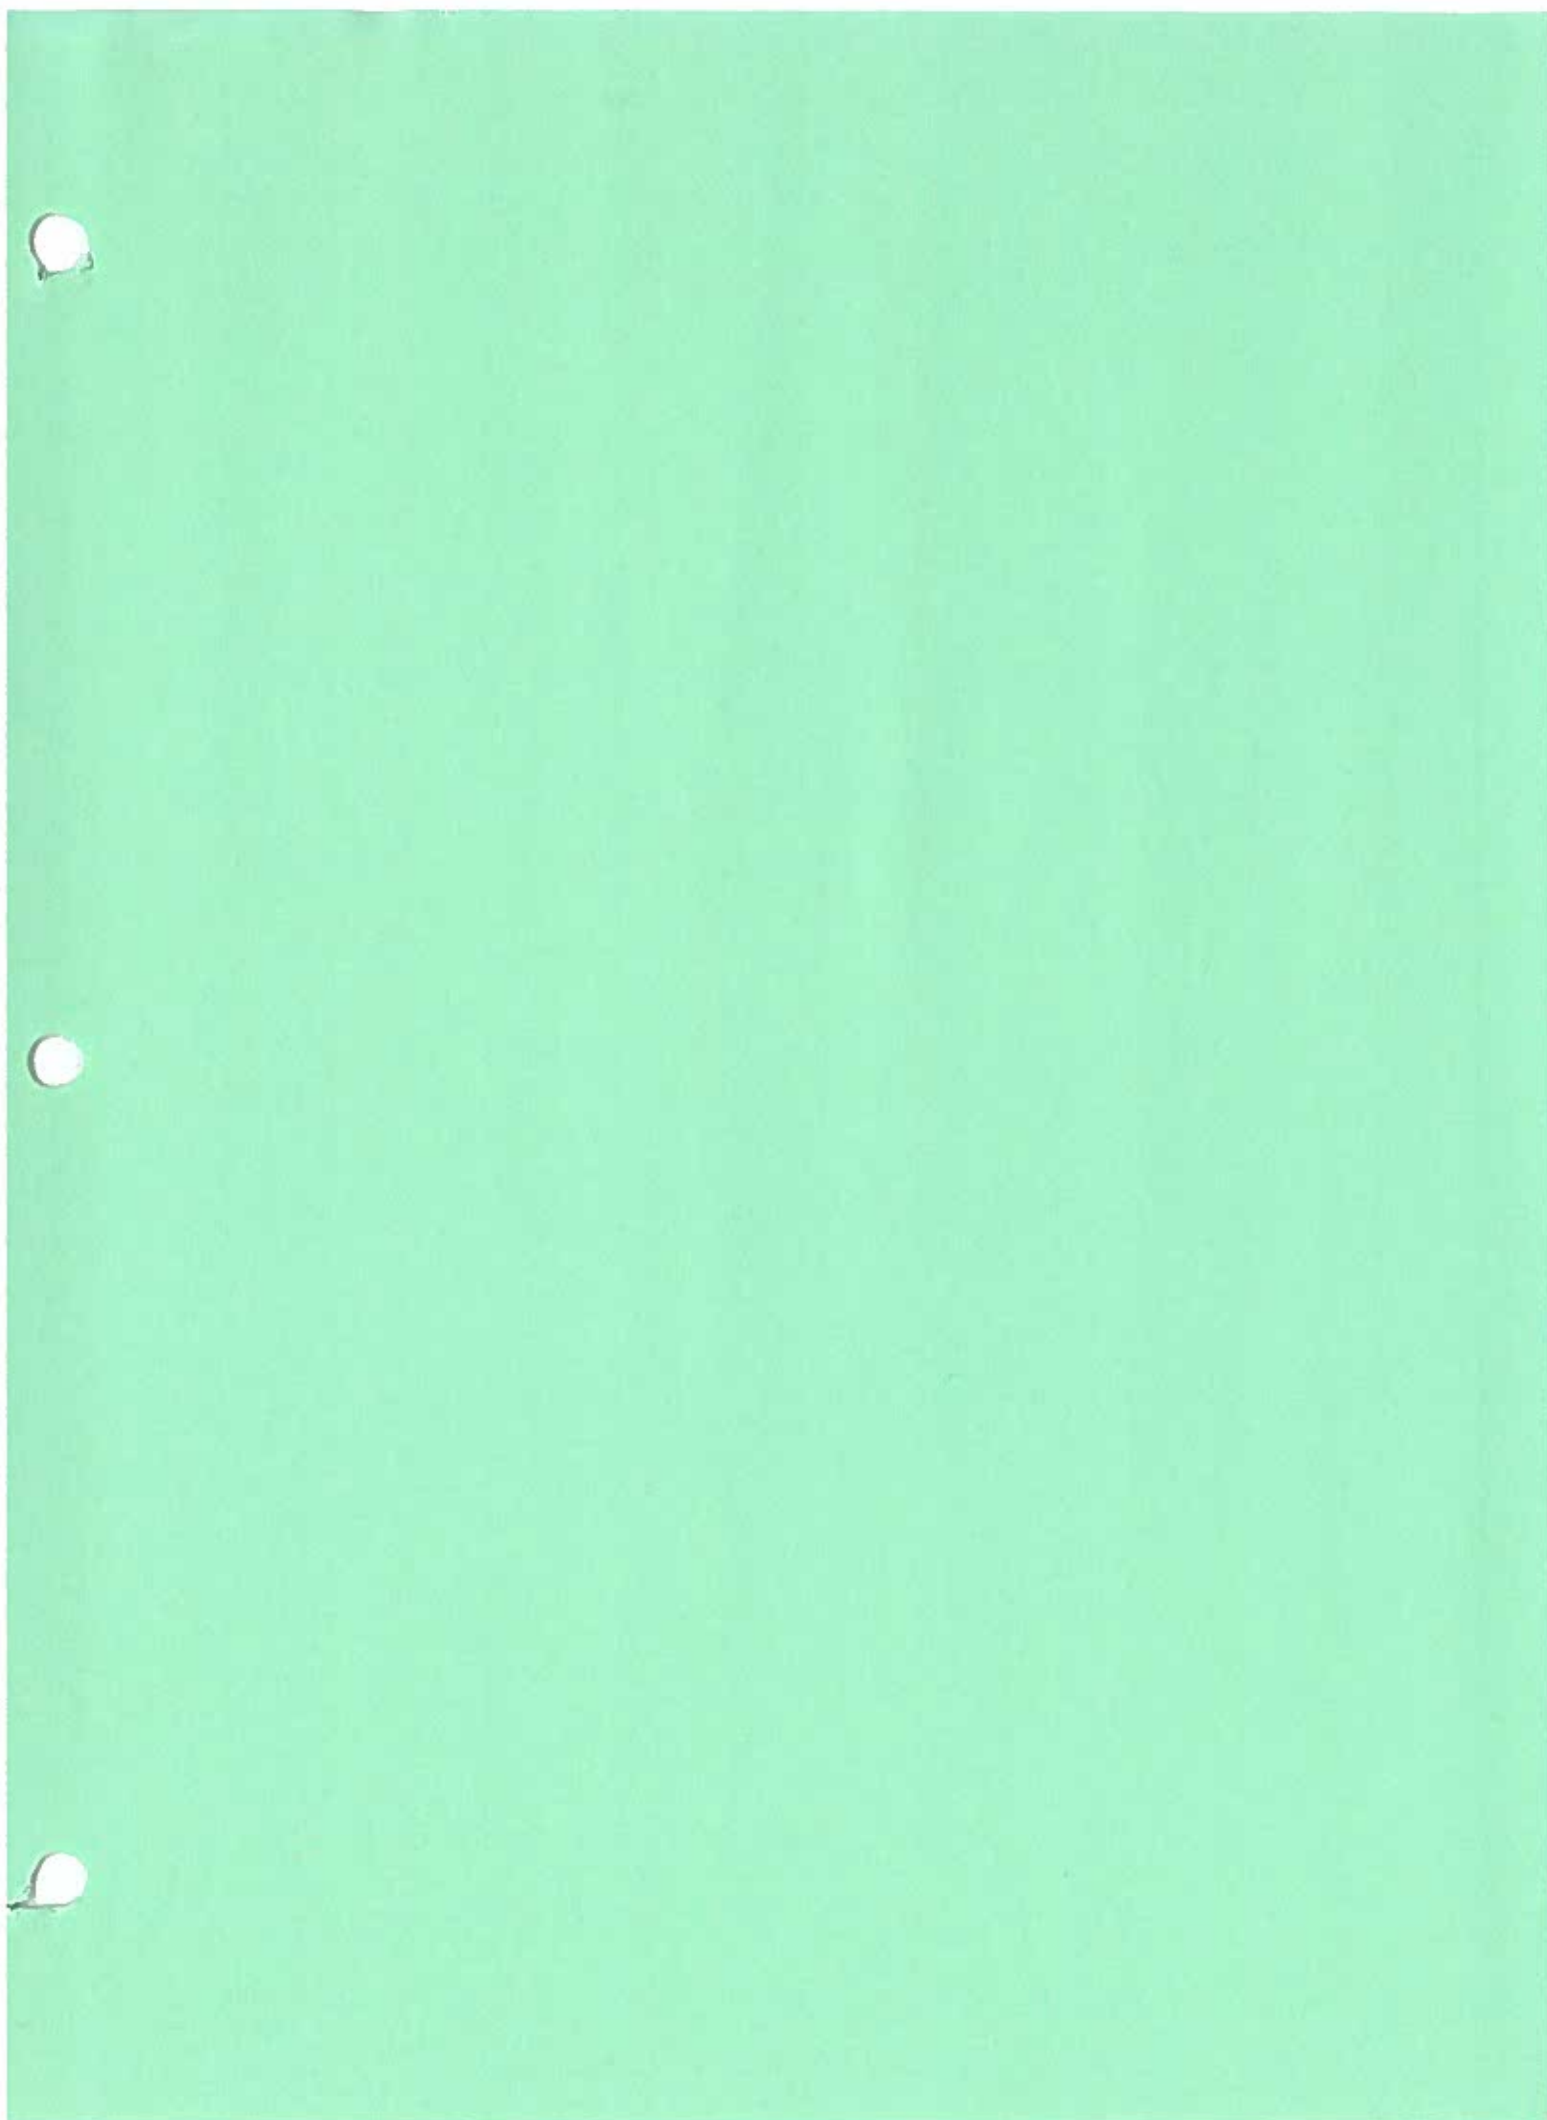

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools
BUILDING NAME: W. E. Wilson Elementary School
HA#: 10
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL: 28,814SF
MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:


VAT

COMMENTS:

Material is in good condition and known to be asbestos containing.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE: 06/01/92
CURRENT SURVEILLANCE DATE: 12/07/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: YES
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
STATE: Indiana

INSPECTOR NAME:

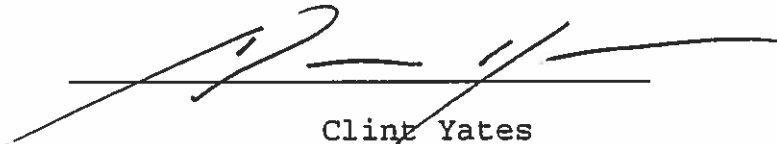
Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools
BUILDING NAME: W. E. Wilson Elementary School
HA#: 11
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL: 28,814SF
MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:


Mastic

COMMENTS:

Material is assumed to be asbestos containing and is in good condition.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE: 06/01/92
CURRENT SURVEILLANCE DATE: 12/07/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
STATE: Indiana

INSPECTOR NAME:

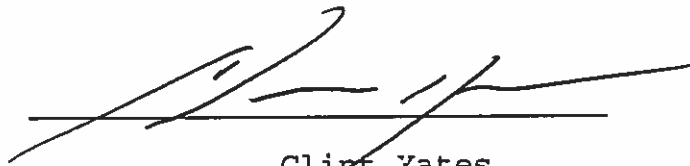
Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools
BUILDING NAME: W. E. Wilson Elementary School
HA#: A
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL:
MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE:
CURRENT SURVEILLANCE DATE: 12/07/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: YES
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
STATE: Indiana

INSPECTOR NAME:


Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools
BUILDING NAME: W. E. Wilson Elementary School
HA#: B
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL:
MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base Mastic

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE:
CURRENT SURVEILLANCE DATE: 12/07/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
STATE: Indiana

INSPECTOR NAME:


Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools
BUILDING NAME: W. E. Wilson Elementary School
HA#: D
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL:
MATERIAL LOCATION:

Gymnasium and Custodial Room

MATERIAL DESCRIPTION:


Fittings

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE:
CURRENT SURVEILLANCE DATE: 12/07/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: YES
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
STATE: Indiana

INSPECTOR NAME:

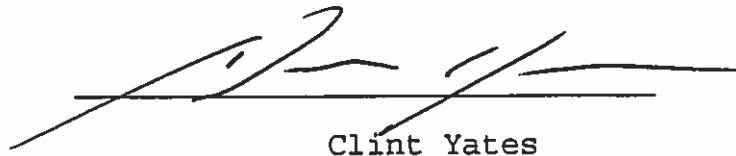
Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools
BUILDING NAME: W. E. Wilson Elementary School
HA#: E
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL:
MATERIAL LOCATION:

Classrooms

MATERIAL DESCRIPTION:


Fittings

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time. From information gathered it is believed the fittings are encased behind the dry wall.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE:
CURRENT SURVEILLANCE DATE: 12/07/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
STATE: Indiana

INSPECTOR NAME:

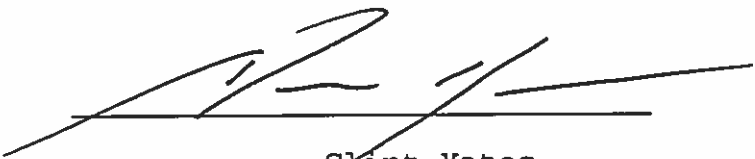
Clint Yates

THIRD YEAR REINSPECTIONS

REINSPECTION PLAN**GREATER CLARK COUNTY SCHOOLS**

Reinspection by an accredited building inspector will be scheduled to be performed not more than three years from the date of the original inspection. The reinspection report will then be made a permanent part of this Management Plan. Reinspections will be performed every three years for as long as the building contains ACBM, and will be reinspected once within three years from the date that all ACBM has been removed.

Records of each reinspection should be maintained in this binder.

DATE PLANNED**DATE COMPLETED****COMPLETED BY**JUNE 2007July 2007Bill OgleJUNE 2010June 2010Sandy ShadleyJUNE 2013April 2013Jeff PechtinJUNE 2016April 2016BenjaminJUNE 2019May 2019SEJUNE 2022JUNE 2025

REINSPECTION PLAN

GREATER CLARK COUNTY SCHOOLS

WILSON ELEMENTARY SCHOOL

The ACBM in this building shall be reinspected every three years to determine any change in the condition of the materials for as long they remain in the building. This reinspection will be conducted tri-annually by an accredited inspector.

The following table outlines the dates on which these inspections should take place in this school building.

REINSPECTION SCHEDULE

| <u>DATE PLANNED</u> | <u>DATE COMPLETED</u> | <u>COMPLETED BY</u> |
|---------------------|-----------------------|---------------------|
| <u>JUNE 1992</u> | <u>JUNE 1992</u> | <u>ASBESTECH</u> |
| <u>JUNE 1995</u> | <u>June '95</u> | <u>Alliance</u> |
| <u>JUNE 1998</u> | <u>June '98</u> | <u>Alliance</u> |
| <u>JUNE 2001</u> | <u>July '01</u> | <u>P. Wilson</u> |
| <u>JUNE 2004</u> | <u>July '04</u> | <u>C. Sparks</u> |

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 10-A
HA Description 9" X 9" Dark Gray
HA Type Miscellaneous Material
HA Location Kitchen office and Stock Room

Quantity Unquantified SF
Comments This area has some broken edges. This material was not in poor condition overall.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID 10-B

HA Description 9" X 9" Chocolate vinyl floor tile.

HA Type Miscellaneous Material

HA Location Gym Entrance

Quantity Unquantified SF

Comments This material overall was not in poor condition. There are broken edge pieces missing in the gynosium entry and storage area. Some tiles have been replaced

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID 10-C

HA Description 9" X 9" Light Gray vinyl floor tile

HA Type Miscellaneous Material

HA Location A wing custodial closets

Quantity Unquantified SF

Comments This material overall is not in poor condition. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 11
HA Description Floor tile mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 18914 SF
Comments Where exposed, this material was not in poor condition.
Asbestos Assumed
Friable No

Original Inspection 6/1/1992
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the building (Classrooms)

Quantity Approx. 4600 LF
Comments This material showed minor normal wear and tear, but was not in poor condition overall.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID B

HA Description Cove Base Mastic

HA Type Miscellaneous Material

HA Location Throughout building

Quantity Approx. 1600 SF

Comments This material was not exposed to inspect.

Asbestos Assumed

Friable No

Original Inspection 5/31/1995

Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID C
HA Description White canvas shock joints on AHU's
HA Type Miscellaneous Material
HA Location Boiler room (one) A wing custodial closet (two)

Quantity 3 Unit(s)
Comments There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID D
HA Description Fittings
HA Type Thermal System Insulation (TSI)
HA Location Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet

Quantity Approx. 18 Unit(s)
Comments Tear on fitting above the kitchen restroom. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID E
HA Description Fittings
HA Type Miscellaneous Material
HA Location Classrooms

Quantity Unquantified SF
Comments It is believed the fittings are encased behind the dry wall and are not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID F

HA Description Fire Doors

HA Type Miscellaneous Material

HA Location Boiler Room and Gym

Quantity Unquantified Unit(s)

Comments Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 6/30/2010

Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 10-A
HA Description 9" X 9" Dark Gray
HA Type Miscellaneous Material
HA Location Kitchen office and Stock Room

Quantity Unquantified SF
Comments This area has some broken edges. This material was not in poor condition overall.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID 10-B

HA Description 9" X 9" Chocolate vinyl floor tile.

HA Type Miscellaneous Material

HA Location Gym Entrance

Quantity Unquantified SF

Comments This material overall was not in poor condition. There are broken edge pieces missing in the gynosium entry and storage area. Some tiles have been replaced

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID 10-C

HA Description 9" X 9" Light Gray vinyl floor tile

HA Type Miscellaneous Material

HA Location A wing custodial closets

Quantity Unquantified SF

Comments This material overall is not in poor condition. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID 11
HA Description Floor tile mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 18914 SF
Comments Where exposed, this material was not in poor condition.
Asbestos Assumed
Friable No

Original Inspection 6/1/1992
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID A
HA Description Cove Base
HA Type Miscellaneous Material
HA Location Throughout the building (Classrooms)

Quantity Approx. 4600 LF
Comments This material showed minor normal wear and tear, but was not in poor condition overall.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity Approx. 1600 SF
Comments This material was not exposed to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID C
HA Description White canvas shock joints on AHU's
HA Type Miscellaneous Material
HA Location Boiler room (one) A wing custodial closet (two)

Quantity 3 Unit(s)

Comments There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Asbestos Assumed

Friable No

Original Inspection 5/31/1995

Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID D
HA Description Fittings
HA Type Thermal System Insulation (TSI)
HA Location Gymnasium west wall, kitchen, kitchen storage, and "A" wing custodial closet

Quantity Approx. 18 Unit(s)
Comments Tear on fitting above the kitchen restroom. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

| | | |
|--------------------------------|-------------------------|-------------------|
| <u>Percent Damaged</u> | % | Good Condition |
| <u>Physical Contact</u> | <u>Vibration</u> | <u>Air</u> |
| Low/None | Low/None | Low/None |

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name W.E. Wilson Elementary School
Building Number 02
HA ID E
HA Description Fittings
HA Type Miscellaneous Material
HA Location Classrooms

Quantity Unquantified SF
Comments It is believed the fittings are encased behind the dry wall and are not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 5/31/1995
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation

Building Name W.E. Wilson Elementary School

Building Number 02

HA ID F

HA Description Fire Doors

HA Type Miscellaneous Material

HA Location Boiler Room and Gym

Quantity Unquantified Unit(s)

Comments Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 6/30/2010

Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-A
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Kitchen office and Stock Room

Material Description
9" X 9" Dark Gray

Comments

This area has some broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-B
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Gym Entrance

Material Description

9" X 9" Chocolate vinyl floor tile.

Comments

This material overall was not in poor condition. There are broken edge pieces missing in the gynasium entry and storage area. Some tiles have been replaced

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10-C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location

A wing custodial closets

Material Description

9" X 9" Light Gray vinyl floor tile

Comments

This material overall is not in poor condition. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location

Throughout the building (Classrooms)

Material Description

Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 3 Each
Material Location

Boiler room (one) A wing custodial closet (two)

Material Description

White canvas shock joints on AHU's

Comments

There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location

Gymnasium west wall and "A" wing custodial closet

Material Description

Fittings

Comments

This material was not in poor condition overall

| | | |
|--|-----------|-----------|
| Does Material Contain Asbestos? | Assumed | |
| Is it Friable? | No | |
| Original Inspection Date | 5/31/1995 | |
| Current Reinspection Date | 4/24/2013 | |
| Current Assessment Rating | NR | Not Rated |
| Cause of Damage | No Damage | |
| Accessible | Yes | |
| Potential for Damage | Low | |
| Removed | No | |
| Planned Response Action | O & M | |

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594


THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings
Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechtin

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# F
Type of Material Miscellaneous Material
Quantity of Material Unquantified Ea
Material Location
Boiler Room and Gym
Material Description
Fire Doors

Comments

Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/30/2010
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF

Material Location
Various locations throughout the building

Material Description
VAT (various colors & sizes)

Comments

There are broken edge pieces missing in the gymnasium entryway. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 6/30/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State IN
Accreditation Number 19A002323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF

Material Location
Throughout the building

Material Description
Floor tile mastic

Comments

Where exposed, this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 6/30/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State IN
Accreditation Number 19A002323

THIRD YEAR REINSPECTION REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location
Throughout the building
Material Description
Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 6/30/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State IN
Accreditation Number 19A002323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location

Throughout the building

Material Description

Cove base mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 6/30/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State IN
Accreditation Number 19A002323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 3 Each
Material Location

Boiler room (one) A wing custodial closet (two)

Material Description

White canvas shock joints on AHU's

Comments

There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 6/30/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State IN
Accreditation Number 19A002323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each
Material Location
Gymnasium west wall and "A" wing custodial closet

Material Description

Fittings

Comments

This material was not in poor condition overall

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 6/30/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State

IN

Accreditation Number

19A002323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description

Fittings

Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 6/30/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State IN
Accreditation Number 19A002323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# F
Type of Material Miscellaneous Material
Quantity of Material Unquantified Ea
Material Location
Boiler Room and Gym

Material Description

Fire Doors

Comments

Fire Doors were found in the Boiler Room and Gym that were not assessed in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/30/2010
Current Reinspection Date 6/30/2010
Current Assessment Rating NR Not Required
Cause of Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State IN
Accreditation Number 19A002323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF

Material Location

Various locations throughout the building

Material Description


VAT (various colors & sizes)

Comments

There are broken edge pieces missing in the gymnasium entryway. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 7/9/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

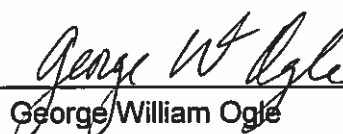
George William Ogle

State Indiana
Accreditation Number 191003027

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 7/9/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location

Throughout the building

Material Description

Cove base

Comments

This material showed minor normal wear and tear, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 7/9/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



George William Ogle

State Indiana
Accreditation Number 191003027

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 7/9/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



George William Ogle

State Indiana
Accreditation Number 191003027

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School

HA# C

Type of Material Miscellaneous Material

Quantity of Material 4 Each

Material Location

Boiler room (two) and A wing custodial closet (two)

Material Description

White canvas shock joints on AHU's

Comments

There is a rip in one of the pieces in the custodial closet, but overall this material was not in poor condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Reinspection Date 7/9/2007

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

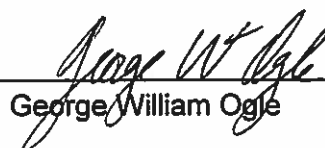
George William Ogle

State Indiana

Accreditation Number 191003027

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each

Material Location
Gymnasium and "A" wing custodial closet

Material Description

Fittings

Comments

This material was not in poor condition overall

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 7/9/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings
Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 7/9/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027



THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF

Material Location
Various locations throughout the building

Material Description
VAT (various colors & sizes)

Comments

There are broken edge pieces missing in the gymnasium entryway. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 7/2/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 18,914 SF


Material Location
Throughout the building

Material Description
Floor tile mastic

Comments
Where exposed, this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 7/2/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

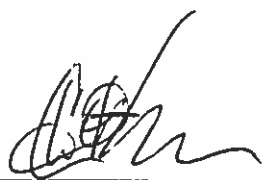


Christiaan Sparks

State Indiana
Accreditation Number 190804103

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location
Throughout the building
Material Description
Cove base
Comments
This material showed minor scraping, but was not in poor condition overall.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 7/2/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

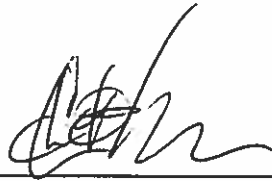
Inspector 
Christiaan Sparks

State Indiana
Accreditation Number 190804103

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 7/2/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

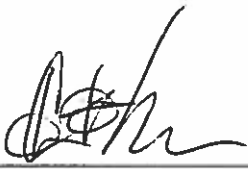

Christiaan Sparks

State Indiana
Accreditation Number 190804103

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 4 Each
Material Location
Boiler room and A wing custodial closet
Material Description
White canvas shock joints on AHU's
Comments
This material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 7/2/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Thermal Material
Quantity of Material Approx. 18 Each

Material Location
Gymnasium and "A" wing custodial closet


Material Description
Fittings

Comments

Some minor gouges were observed. However, this material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 7/2/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

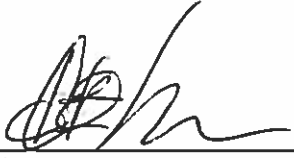

Christiaan Sparks

State Indiana
Accreditation Number 190804103

THIRD YEAR REINSPECTION REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments

It is believed the fittings are encased behind the dry wall and are not visible to inspect.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 7/2/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

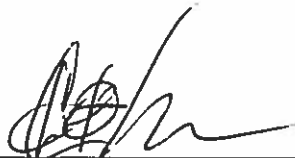

Christiaan Sparks

State Indiana
Accreditation Number 190804103

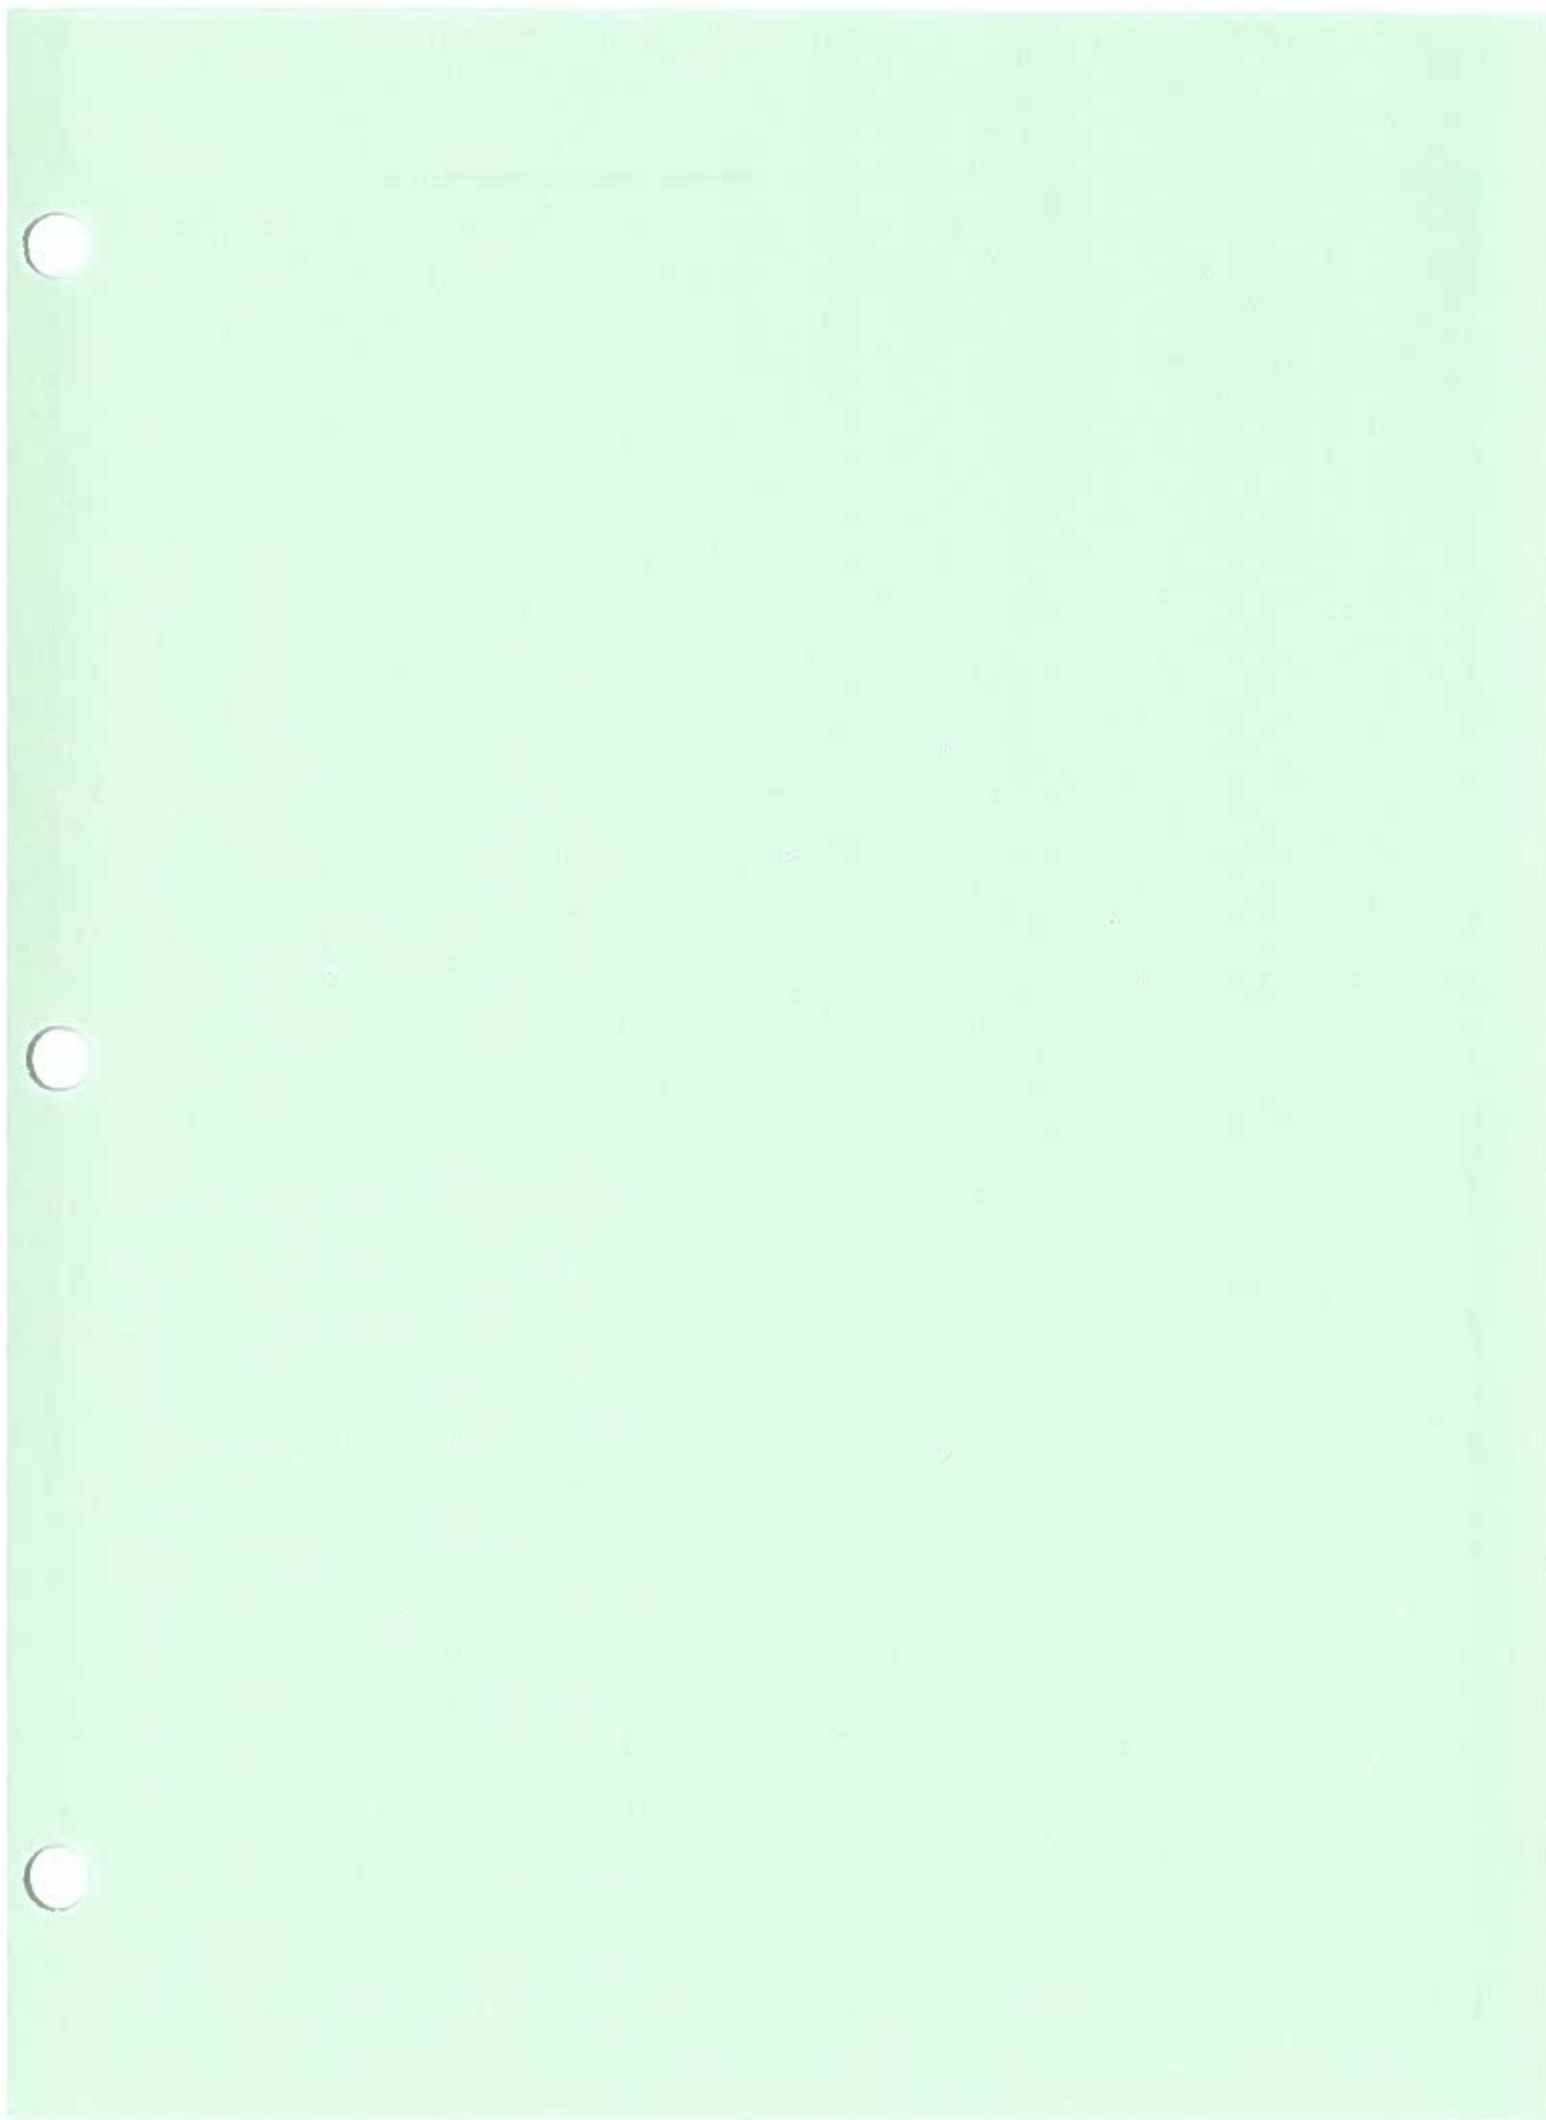

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 28,814 SF

Material Location
Various locations throughout the building

Material Description
VAT (various colors & sizes)

Comments
There are broken edge pieces missing in gymnasium. Some of these have been replaced with new tiles. Lower level custodial closet has water damage and edge pieces missing. First floor custodial closet has loose pieces. Kitchen office and storage area have broken edges. This material is in good overall condition.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Reinspection Date 07/12/2001
Current Assessment Rating NR Not Required
Cause of Damage Physical Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Patrick E. Wilson

State Indiana
Accreditation Number 190824065

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 28,814 SF

Material Location
Throughout the building

Material Description
Floor tile mastic

Comments
Mastic is exposed in gymnasium, kitchen office and storage room. It is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Reinspection Date 07/12/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

Patrick E. Wilson kw
Patrick E. Wilson

State Indiana
Accreditation Number 190824065

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,600 LF
Material Location
Throughout the building
Material Description
Cove base
Comments
Material is in good condition throughout with minor scraping observed.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Reinspection Date 07/12/2001
Current Assessment Rating NR Not Required
Cause of Damage Physical Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Patrick E. Wilson

State Indiana
Accreditation Number 190824065

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,600 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
No mastic was exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Reinspection Date 07/12/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Patrick E. Wilson

State

Indiana

Accreditation Number

190824065

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material 4 Each
Material Location
Boiler room and A wing custodial closet
Material Description
White canvas shock joints on AHU's
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Reinspection Date 07/12/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Patrick E. Wilson

State Indiana
Accreditation Number 190824065

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School

HA# D

Type of Material Thermal Material

Quantity of Material Approx. 18 Each

Material Location
Gymnasium and custodial room

Material Description
Fittings

Comments
Fittings are in good condition. Some minor gouges observed in the custodial room.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Reinspection Date 07/12/2001

Current Assessment Rating NR Not Required

Cause of Damage Physical Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Patrick E. Wilson

State Indiana

Accreditation Number 190824065

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Classrooms
Material Description
Fittings

Comments


From information gathered it is believed the fittings are encased behind the dry wall and are not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Reinspection Date 07/12/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Patrick E. Wilson

State Indiana
Accreditation Number 190824065

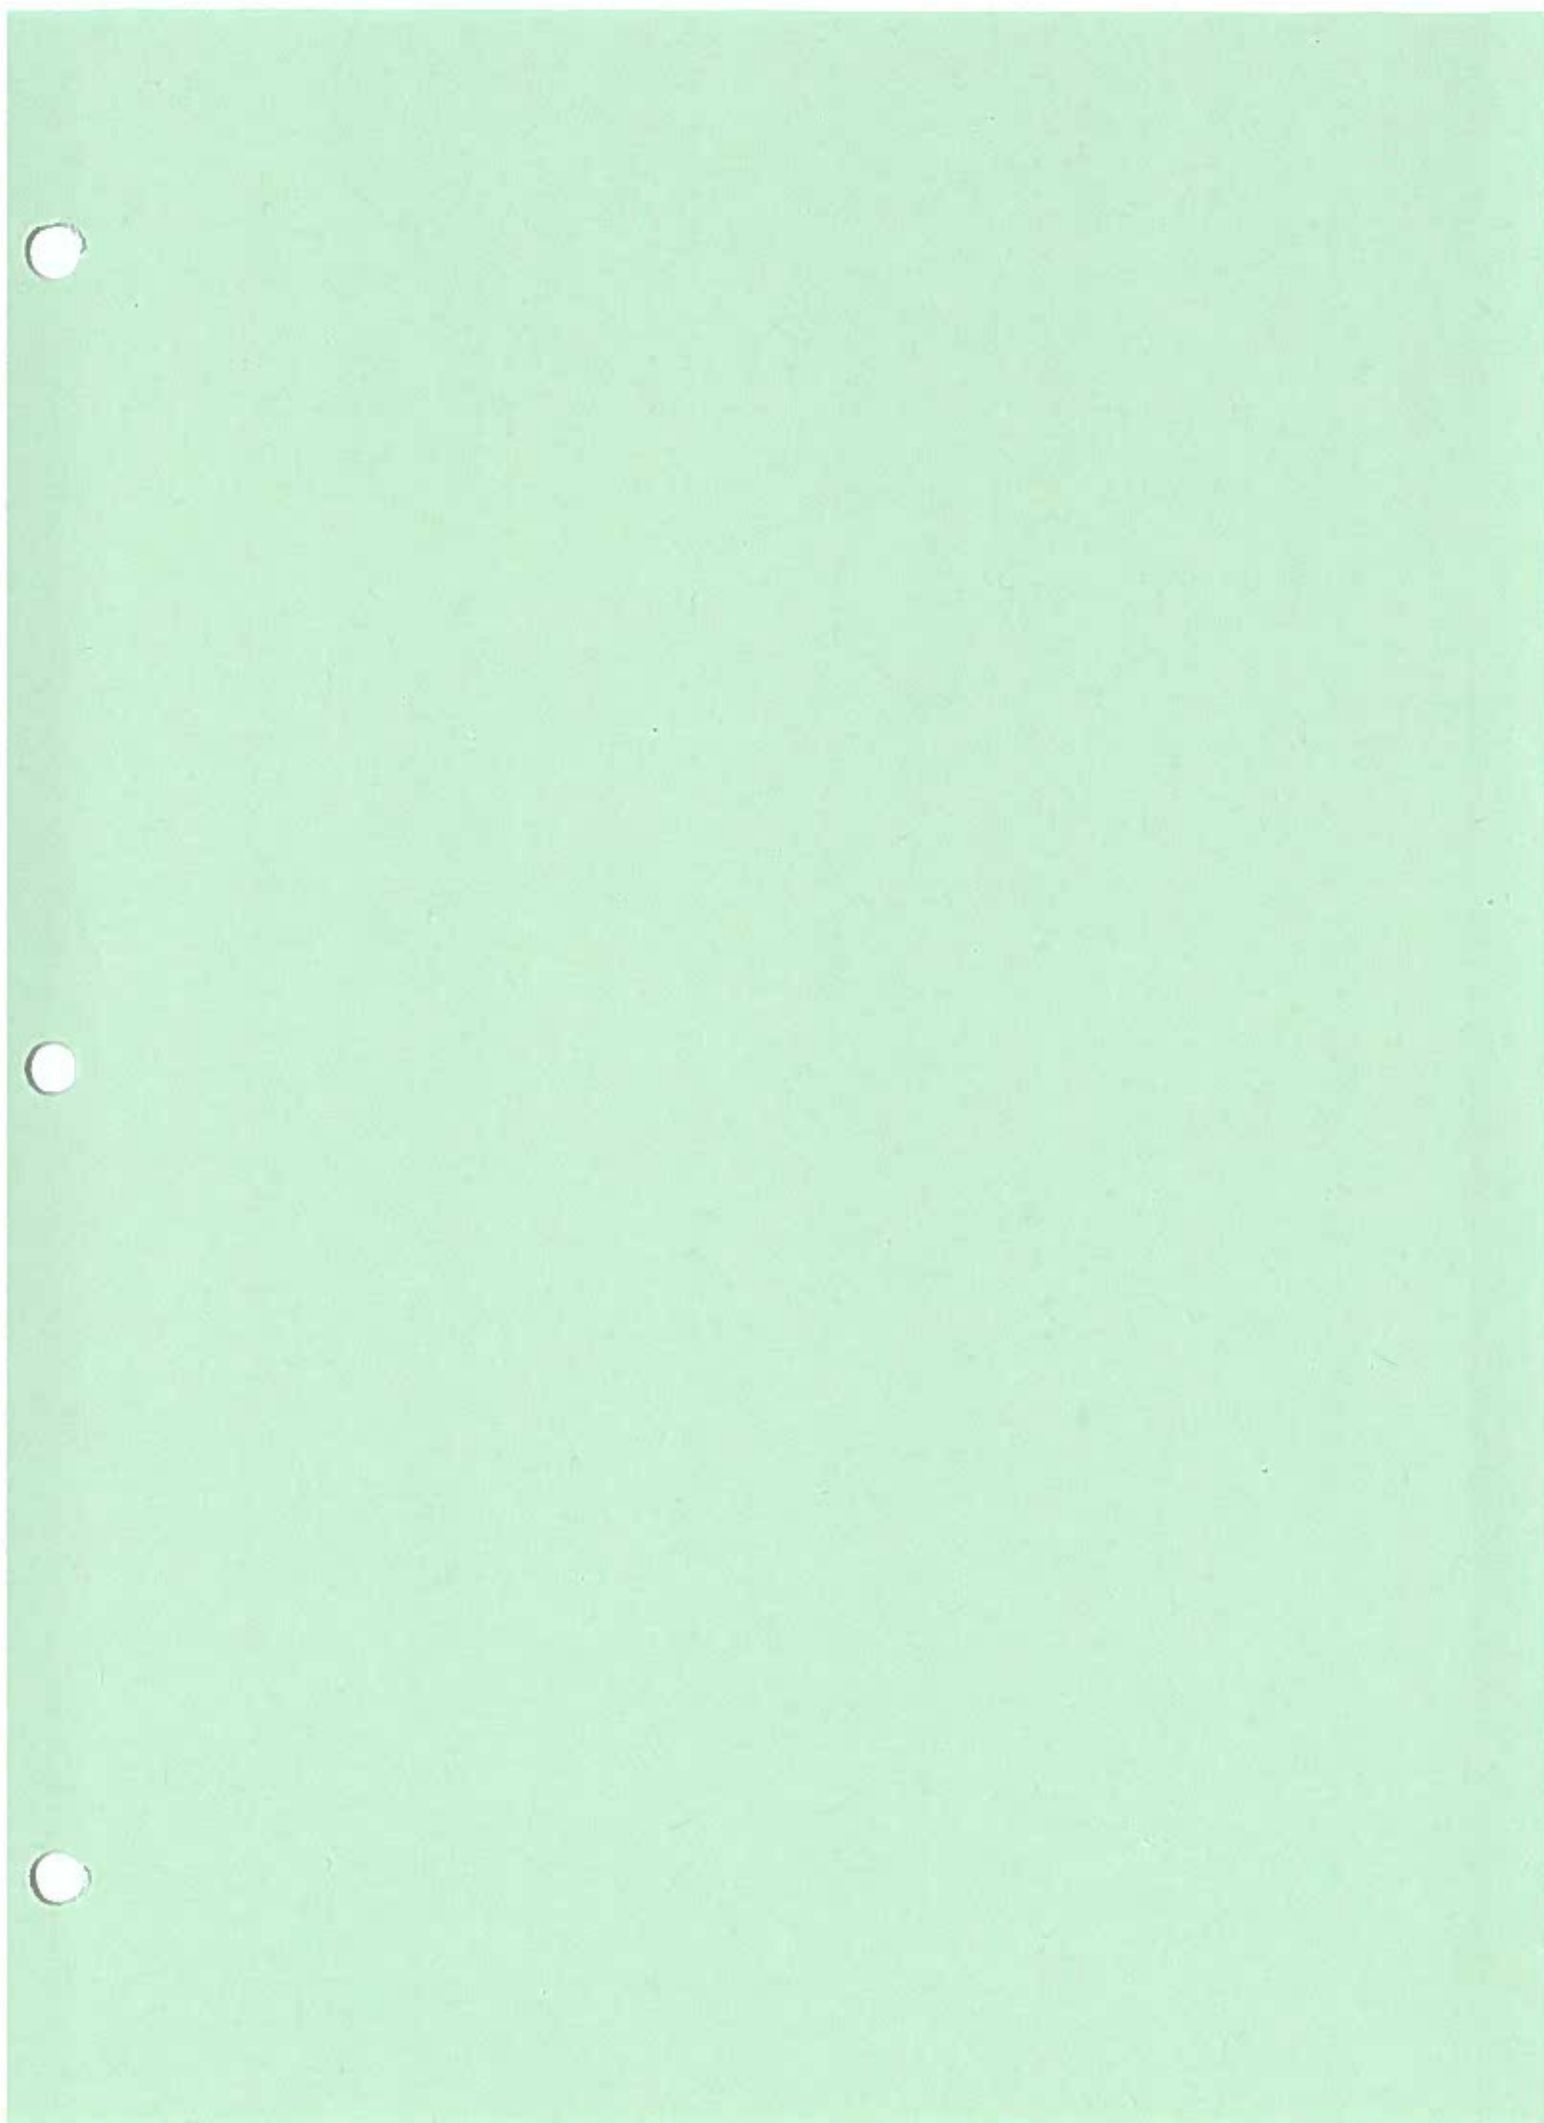

THIRD YEAR REINSPECTION REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 10
Type of Material Miscellaneous Material
Quantity of Material 28,814 SF
Material Location
Various locations throughout the building
Material Description
VAT

Comments

Loose pieces found in 2nd floor custodial closet.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Reinspection Date 6/ 1/98
Current Assessment Rating NR Not Required
Cause of Damage Other
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

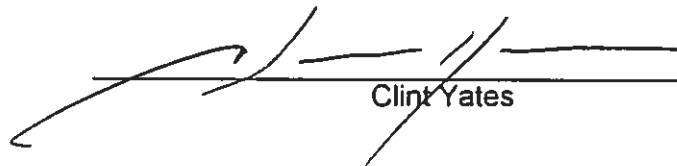
Clint Yates

State Indiana
Accreditation Number 193804035

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# 11
Type of Material Miscellaneous Material
Quantity of Material 28,814 SF

Material Location
Throughout Building


Material Description
Mastic

Comments

Some exposure of material in gymnasium. It is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Reinspection Date 6/ 1/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

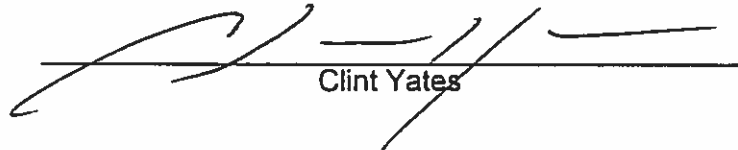

Clint Yates

State Indiana
Accreditation Number 193804035

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# A
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout the building
Material Description
Cove Base

Comments

Material is in good condition. Some loose pieces in the art room.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Reinspection Date 6/ 1/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Clint Yates

State Indiana
Accreditation Number 193804035

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# B
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout the building
Material Description
Cove Base Mastic
Comments
Material is in good condition where exposed.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Reinspection Date 6/ 1/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Clint Yates

State Indiana
Accreditation Number 193804035

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# C
Type of Material Miscellaneous Material
Quantity of Material SF
Material Location
Throughout Building
Material Description
Shock Joints on AHV's
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Reinspection Date 6/ 1/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Clint Yates

State Indiana
Accreditation Number 193804035

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# D
Type of Material Miscellaneous Material
Quantity of Material Each
Material Location
Gymnasium and Custodial Room
Material Description
Fittings
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Reinspection Date 6/ 1/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

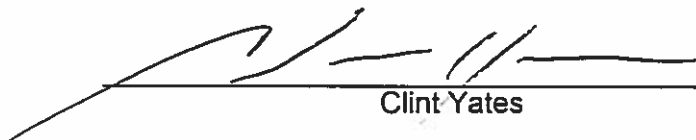
Clint Yates

State Indiana
Accreditation Number 193804035

THIRD YEAR REINSPECTION REPORT


LEA Name Greater Clark County Schools
Building Name W. E. Wilson Elementary School
HA# E
Type of Material Miscellaneous Material
Quantity of Material Each
Material Location
Classrooms
Material Description
Fittings

Comments


Material is in good condition. From information gathered it is believed the fittings are encased behind the dry wall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Reinspection Date 6/ 1/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

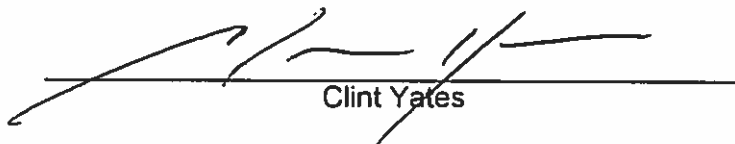
Clint Yates

State Indiana
Accreditation Number 193804035

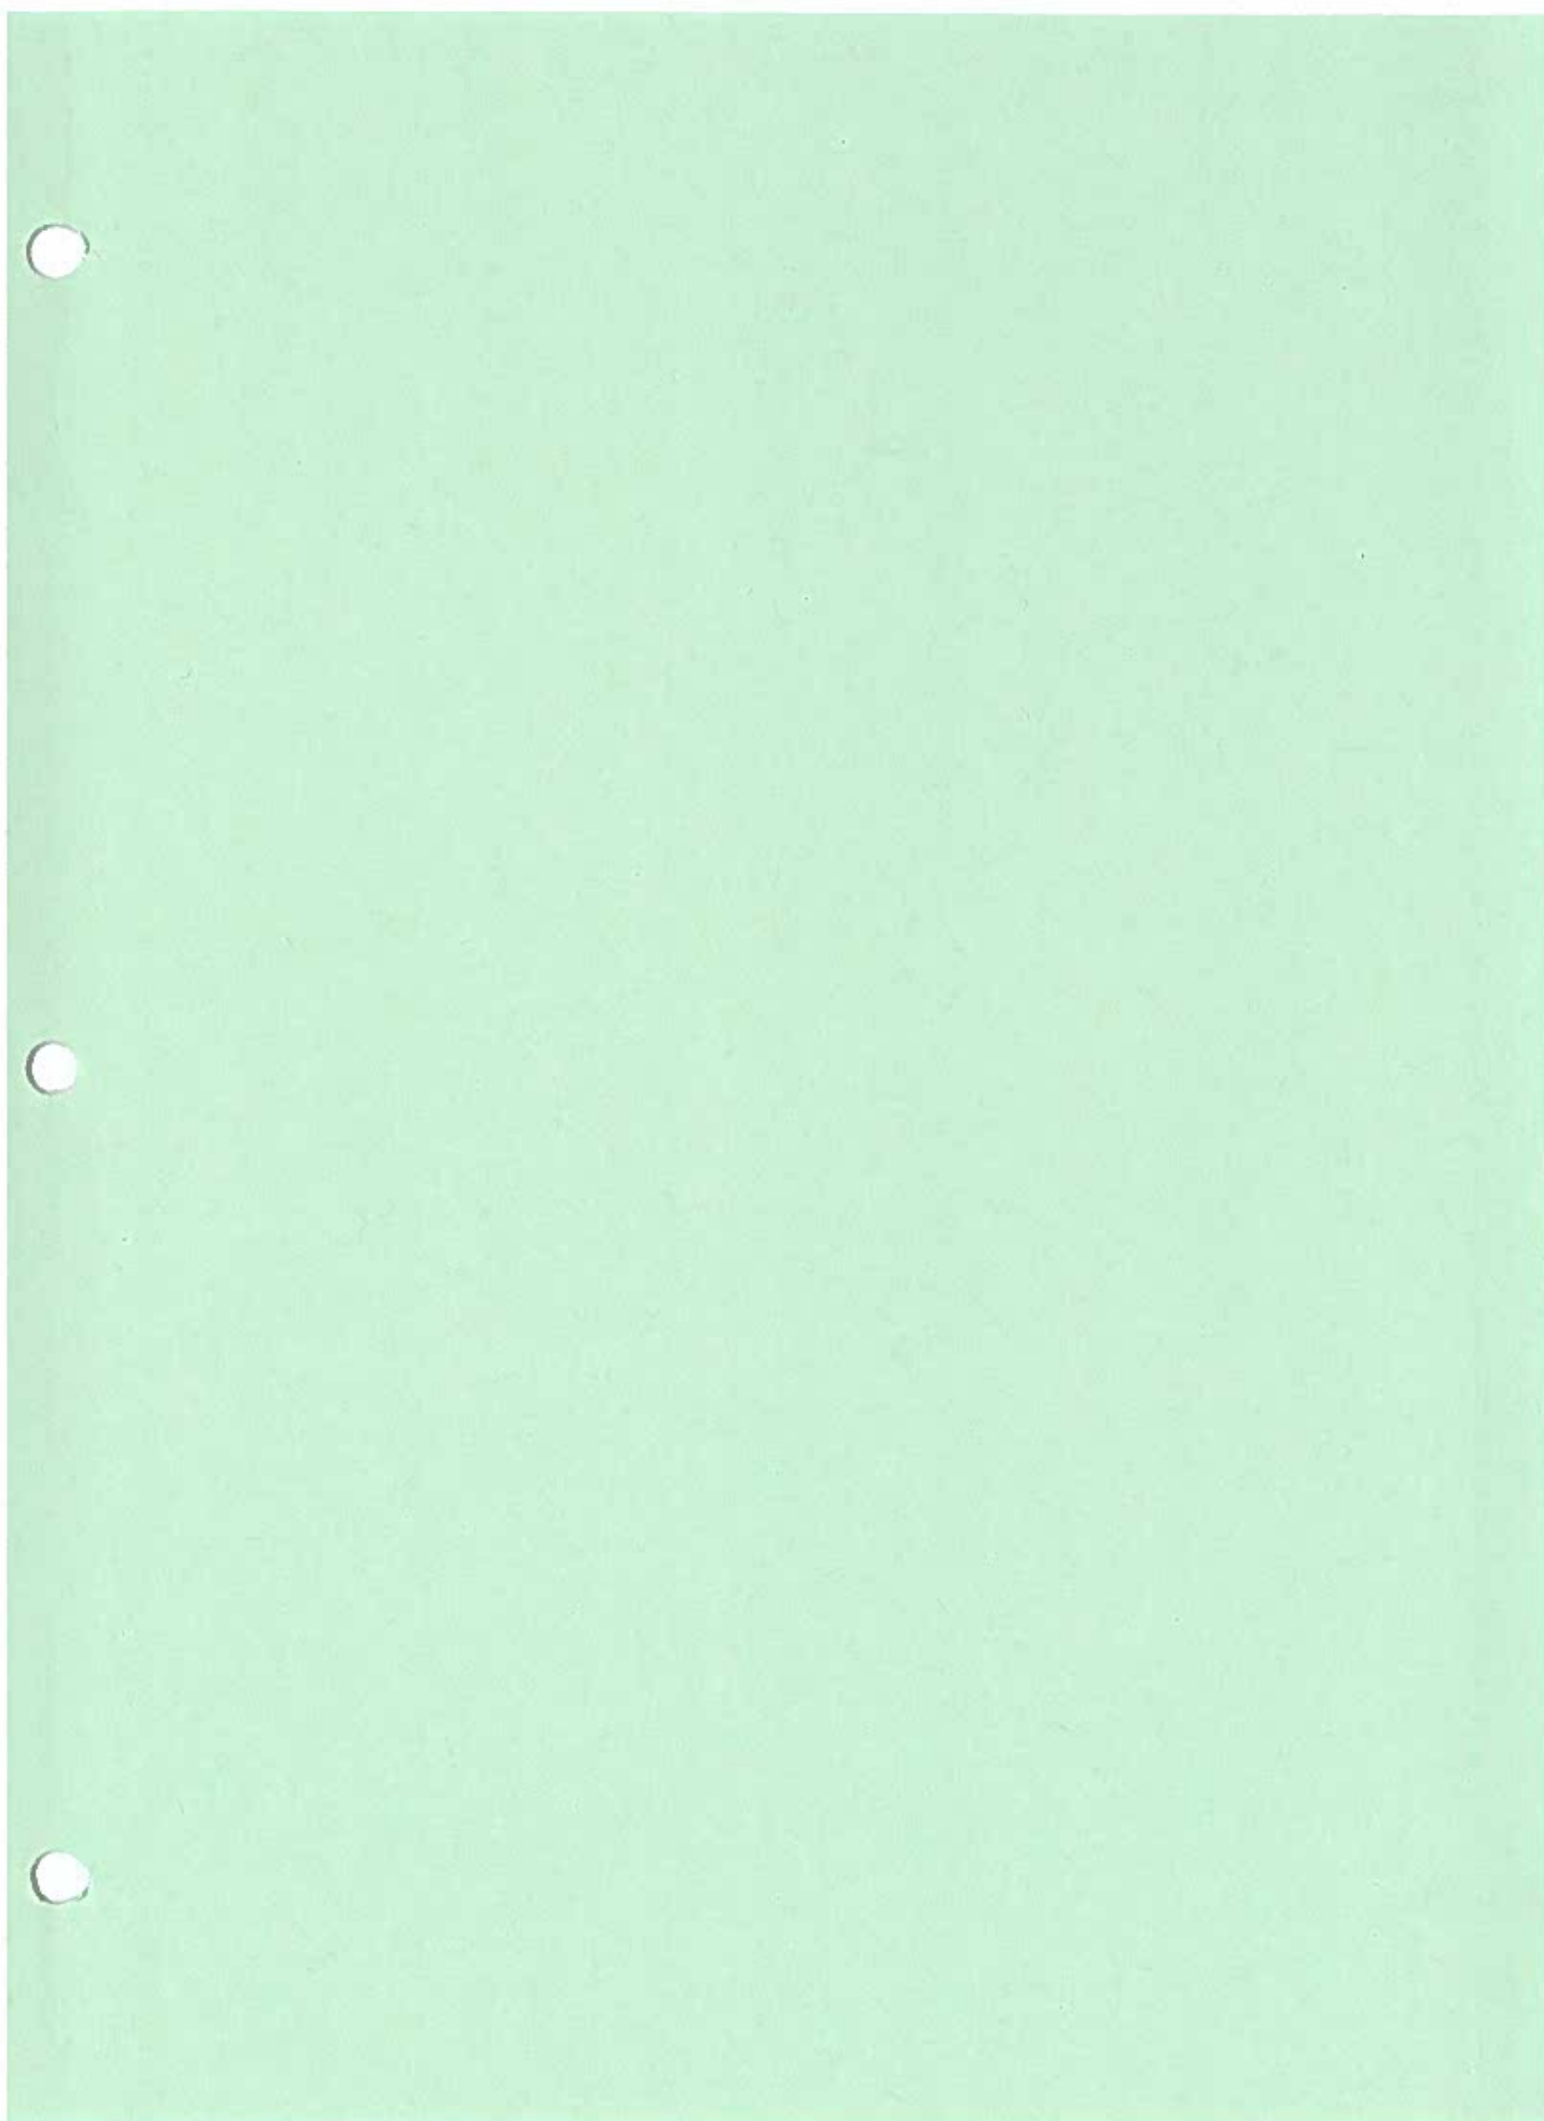

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.
BUILDING NAME: W. E. Wilson Elementary School
HA#: 10
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL: 28,814SF
MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

VAT

COMMENTS:

Material is in good condition and known to be asbestos containing.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE: 06/01/92
CURRENT REINSPECTION DATE: 06/27/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:



Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.
BUILDING NAME: W. E. Wilson Elementary School
HA#: 11
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL: 28,814SF
MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Mastic

COMMENTS:

Material is assumed to be asbestos containing and is in good condition.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE: 06/01/92
CURRENT REINSPECTION DATE: 06/27/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:


Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.
BUILDING NAME: W. E. Wilson Elementary School
HA#: A
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL:
MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE:
CURRENT REINSPECTION DATE: 06/27/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:


Rex Gaddis

STATE: Indiana
ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.
BUILDING NAME: W. E. Wilson Elementary School
HA#: B
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL:
MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base Mastic

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE:
CURRENT REINSPECTION DATE: 06/27/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:



Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.
BUILDING NAME: W. E. Wilson Elementary School
HA#: C
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL:
MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Shock Joints on AHV's

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE:
CURRENT REINSPECTION DATE: 06/27/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:



Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.
BUILDING NAME: W. E. Wilson Elementary School
HA#: D
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL:
MATERIAL LOCATION:

Gymnasium and Custodial Room

MATERIAL DESCRIPTION:

Fittings

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE:
CURRENT REINSPECTION DATE: 06/27/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)
INSPECTOR NAME: Rex Gaddis
Rex Gaddis
STATE: Indiana
ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.
BUILDING NAME: W. E. Wilson Elementary School
HA#: E
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL:
MATERIAL LOCATION:

Classrooms

MATERIAL DESCRIPTION:

Fittings

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time. From information gathered it is believed the fittings are encased behind the dry wall.

IS MATERIAL FRIABLE?

NO

ORIGINAL INSPECTION DATE:

CURRENT REINSPECTION DATE: 06/27/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

CURRENT VIDEO TAPE:
(TAPE NO/FOOTAGE)

/

INSPECTOR NAME:


Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

ADDITIONAL BULK SAMPLES

**ANNUAL NOTIFICATIONS
ACCREDITATIONS
TRAINING
INFORMATION**

Indiana Department of Environmental Management
100 N. Senate Avenue
Mail Code 61-52 IGCN 1003
Indianapolis, IN 46204-2251



April 17, 2014

RECEIVED APR 22 2014

Benjamin S. Hood
Alliance Environmental Group
5340 Commerce Circle, Ste E
Indianapolis IN 46237

Re: Asbestos Inspector # 19A001039

Based upon the review of your license application, the Office of Air Quality has determined that you have fulfilled the requirements of 326 IAC 18 and are eligible for licensing in the following discipline:

Asbestos Inspector

Your Asbestos Inspector license is attached below. The license is waterproof and tear resistant. Please sign your license and do not laminate or alter your license in anyway. Your license must be available for review at all times while implementing an asbestos project. This license may be revoked, pursuant to 326 IAC 18-1-7, if you:

- (1) Violate any requirements of these rules (326 IAC 18), 326 IAC 14-10, or any requirement of the Asbestos-Containing Materials in Schools Rule or any other federal, state, or local regulation pertaining to asbestos in buildings or to asbestos projects.
- (2) Falsify information on your application for licensing.
- (3) Fail to meet any qualifications specified in 326-IAC 18-1-4.
- (4) Conduct asbestos project, or related asbestos handling activity, in a manner which is hazardous to the public health.

Your license is valid effective 05/05/2014, and will expire on 05/05/2015, as indicated on your card. We suggest that you attend the required training and submit an application for license renewal early to insure your license does not lapse. NOTE: 326 IAC 18-1-4(h) and 326 IAC 18-1-6(e) require that any individual who has an eighteen (18) month lapse between any two training courses of the same discipline to attend an initial training course for the discipline in which they are seeking a license. In order to avoid re-taking the initial training course you must have attended a refresher in the discipline you are seeking a license within eighteen (18) months from the date of issuance of your last training course certificate.

Office of Air Quality, Asbestos Licensing Section (317) 233-3861



Indiana Dept. of Environmental Management

Benjamin S. Hood

Asbestos Inspector License #: 19A001039

| | |
|------------------------|------------------------|
| Effective: 05/05/2014 | Expiration: 05/05/2015 |
| Birth Date: 04/10/1978 | Gender: M |
| Height: 6-00 | Eye Color: Brown |
| Weight: 285 | Hair Color: Brown |

NOTICES

AHERA NOTIFICATION LOG

GREATER CLARK COUNTY SCHOOLS

| <u>DATE OF NOTIFICATION</u> | <u>COPY IN BOOK</u> |
|-----------------------------|---------------------|
|-----------------------------|---------------------|

| | |
|------|--|
| YEAR | |
|------|--|

| | |
|------|--|
| 2011 | |
|------|--|



| | |
|------|--|
| 2012 | |
|------|--|



| | |
|------|--|
| 2013 | |
|------|--|



| | |
|------|--|
| 2014 | |
|------|--|



| | |
|------|--|
| 2015 | |
|------|--|



| | |
|------|--|
| 2016 | |
|------|--|

| | |
|------|--|
| 2017 | |
|------|--|

| | |
|------|--|
| 2018 | |
|------|--|

| | |
|------|--|
| 2019 | |
|------|--|

| | |
|------|--|
| 2020 | |
|------|--|

| | |
|------|--|
| 2021 | |
|------|--|

| | |
|------|--|
| 2022 | |
|------|--|

| | |
|------|--|
| 2023 | |
|------|--|

| | |
|------|--|
| 2024 | |
|------|--|

NOTIFICATION LOG

LEA Name - Greater Clark County Schools

Date of Notification

Copy of Notification in Supplemental Book?

| | |
|------------------------------|---|
| 1989 | |
| 1990 | |
| 1991 | |
| 1992 | |
| 1993 | |
| 1994 | |
| 1995 | ✓ |
| 1996 | ✓ |
| 1997 | ✓ |
| 1998 | ✓ |
| 1999 | ✓ |
| 2000 | ✓ |
| 2001 | ✓ |
| 2002 | ✓ |
| 2003 | ✓ |
| 2004 | ✓ |
| 2005 | |
| 2006 | ✓ |
| 2007 | ✓ |
| 2008 | ✓ |
| 2009 | ✓ |
| 2010 | ✓ |
| Greater Clark County Schools | ✓ |
| 2011 | ✓ |
| 2012 | ✓ |

Notification Log

March 2015

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services at River Valley Middle School, which is located at 2220 Veteran's Parkway, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, Service Center, Corden Porter Storage, Auto Tech Program- Witten Property, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2015/2016 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

* The required triennial re-inspection will be performed in April 2016.

* The required six month periodic surveillance was performed in October 2014.

* The required six month periodic surveillance activities are scheduled for April and October each year.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

March 2014

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2220 Veteran's Parkway, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, Corden Porter Storage, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2014/2015 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

* The required triennial re-inspection will be performed in April 2013.

* The required six month periodic surveillance was performed in October 2013.

* The required six month periodic surveillance activities are scheduled for April and October each year.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

March 2013

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, Corden Porter Storage, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2013/2014 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- * The required triennial re-inspection will be performed in April 2013.
- * The required six month periodic surveillance was performed in October 2012.
- * The required six month periodic surveillance activities are scheduled for April and October each year.
- * Projects completed in 2012: Parkview Middle School.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

March 2012

**AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, and Cordon Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2012/2013 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- * The required triennial re-inspection will be performed in June 2013.
- * The required six month periodic surveillance was performed in December 2011.
- * The required six month periodic surveillance activities are scheduled for June and December each year.
- * Projects completed in 2011: Options building and Parkwood Elementary.
- * Projects scheduled for 2012: Parkview Middle School and Bridgepoint Elementary.
- * Cordon Porter storage building was sold in 2012.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

**AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxillary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, Options and Corden Porter Center Buildings and Alternative School-

- * The required triennial reinspection will be performed in June 2013.
- * The required six month periodic surveillance was performed in December 2010.
- * The next scheduled activity is the required six month periodic surveillance in June 2011.
- * Charlestown High School asbestos removal project was completed in 2010.
- * Options Building is under renovation in 2011.
- * Parkwood Elementary is under renovation in 2011.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building
– These buildings are asbestos free and **Riverside Elementary** was demolished in 2006.
No surveillances or reinspections are required for these buildings.

March 2011

**AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxillary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection will be performed in June 2010.
- * The required six month periodic surveillance was performed in December 2009.
- * The next scheduled activity is the required six month periodic surveillance in December 2010.
Charlestown High School is an ongoing asbestos removal project which will be complete prior to partial demolition.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -
These buildings are asbestos free and Riverside Elementary was demolished in 2006.
No surveillances or reinspections are required for these buildings.

March 2010

**AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2007.
- * The required six month periodic surveillance was performed in December 2008.
- * The next scheduled activities are the required six month periodic surveillance in June 2009 and Dec 2009. Charlestown High School has undergone an asbestos removal project prior to partial demolition.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building - These buildings are asbestos free and **Riverside Elementary** was demolished in 2006. No surveillances or re-inspections are required for these buildings.

April 2009

**AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number (812)288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2007.
- * The required six month periodic surveillance was performed in December 2007.
- * The next scheduled activities are the required six month periodic surveillance in June 2008 and Dec 2008.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free. **Riverside Elementary** was Demolition in 2006. No surveillances or reinspections are required.

April 2008

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teacher organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required six month periodic surveillance was performed in June 2006.
- * The required six month periodic surveillance was performed in December 2006.
- * The next scheduled activities are the required six month periodic surveillance in June 2007 and Dec 2007.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building - These buildings are asbestos free. **Riverside Elementary** was Demolition in 2006. No surveillances or reinspections are required.

March 2007

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2005.
- * The required six month periodic surveillance was performed in December 2005.
- * The next scheduled activities are the required six month periodic surveillance in June 2006 and Dec 2006.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -
These buildings are asbestos free. No surveillances or reinspections are required.

March 2006

**AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2004.
- * The required six month periodic surveillance was performed in December 2004.
- * The next scheduled activities are the required six month periodic surveillance in June 2005 and December 2005.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

- * These buildings are asbestos free. No surveillances or reinspections are required.

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required six month periodic surveillance was performed in June 2003.
- * The required six month periodic surveillance was performed in December 2003.
- * The next scheduled activities are the required triennial reinspection in June 2004 and a required six month periodic surveillance in December 2004.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

- * These buildings are asbestos free. No surveillances or reinspections are required.

March 2004

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required six month periodic surveillance was performed in June 2002.
- * The required six month periodic surveillance was performed in December 2002.
- * The next scheduled activity is the required periodic surveillance in June 2003.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

- * These buildings are asbestos free. No surveillances or reinspections are required.

May 2003

**AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in July 2001.
- * The required six month periodic surveillance was performed in December 2001.
- * The next scheduled activities are the required periodic surveillances in June 2002 and December 2002.

Pleasant Ridge Elementary School and (New) Utica Elementary School -

- * These buildings are asbestos free. No surveillances or reinspections are required.

(Old) Utica Elementary School -

- * In accordance with information collected from the GCCS this building has been deeded to the town of Utica. No further AHERA periodic surveillances or triennial reinspections will be conducted by the designated person.

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, (Old) Utica, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center -

- * The required six month periodic surveillance was performed in June 2000.
- * The required six month periodic surveillance was performed in January 2001.
- * The next scheduled activity is a required triennial reinspection in June 2001.

Pleasant Ridge Elementary School and (New) Utica Elementary School -

- * This building is asbestos free. No surveillances or reinspections are required.

June 2001

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, Utica, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center -

- * The required six month periodic surveillance was performed in June 1999.
- * The required six month periodic surveillance was performed in December 1999.
- * The next scheduled activity is a required periodic surveillance in June 2000.

Pleasant Ridge Elementary School -

- * This building is asbestos free. No surveillances or reinspections are required.

June 2000

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required six month periodic surveillance was performed in June 1998.
- * The required six month periodic surveillance was performed in December 1998.
- * The next scheduled activity is a required periodic surveillance in June 1999.

Parkwood Elementary School

- * O & M was performed in the boiler room in May 1998.

June 1999

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1997 and December 1997.
- * Next activity scheduled activity is a required third year reinspection in June 1998.

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available, should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1996 and December 1996.
- * The next required periodic surveillance will be performed in June 1997 and December 1997.

June 97

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Denny Johanson at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All buildings where it is required -

- * The required third year reinspection was performed in June 1995.
- * The required periodic surveillance was performed in December 1995.
- * Next activity scheduled is a periodic surveillance in June 1996.

Charlestown High School -

- * Transite panels were compliantly removed from the exterior of the building.

Corden Porter Building #3 -

- * TSI was compliantly removed from the boiler room.

June 96

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available, should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Dennis Johanson at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1995 and December 1995.
- * The required triennial reinspection was performed in June 1995.
- * The next required periodic surveillance will be performed in June 1996 and December 1996.

June 95

ACCREDITATIONS



Environmental Management Institute

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846

www.envtlmgmt.org

This confirms that

Sandy Shadley

Completed the Required Initial Training for
Asbestos Accreditation Under TSCA Title II
and has
passed with a Score of 70 or Greater the Examination for
Asbestos Management Planner

Course Date
December 10 - 11, 2009

Examination Date
December 11, 2009



Jack E. Leonard, President

Certificate: MP(I) 2248
Expires: December 11, 2010

Approved by:: Illinois Department of Public Health
Indiana Department of Environmental Management

Indiana Department of Environmental Management
100 N. Senate Avenue
Mail Code 61-52 IGCN 1003
Indianapolis, IN 46204-2251



January 21, 2010

RECEIVED JAN 23 2010

Sandra S. Shadley
Alliance Environmental Grp
5340 Commerce Circle Ste E
Indianapolis IN 46237

Re: Asbestos Management Planner # 19A002720

Based upon the review of your license application, the Office of Air Quality has determined that you have fulfilled the requirements of 326 IAC 18 and are eligible for licensing in the following discipline:

Asbestos Management Planner

Your Asbestos Management Planner license is attached below. The license is waterproof and tear resistant. Please sign your license and do not laminate or alter your license in anyway. Your license must be available for review at all times while implementing an asbestos project. This license may be revoked, pursuant to 326 IAC 18-1-7, if you:

- (1) Violate any requirements of these rules (326 IAC 18), 326 IAC 14-10, or any requirement of the Asbestos-Containing Materials in Schools Rule or any other federal, state, or local regulation pertaining to asbestos in buildings or to asbestos projects.
- (2) Falsify information on your application for licensing.
- (3) Fail to meet any qualifications specified in 326-IAC 18-1-4.
- (4) Conduct asbestos project, or related asbestos handling activity, in a manner which is hazardous to the public health.

Your license is valid effective 01/21/2010, and will expire on 01/21/2011, as indicated on your card. We suggest that you attend the required training and submit an application for license renewal early to insure your license does not lapse. NOTE: 326 IAC 18-1-4(h) and 326 IAC 18-1-6(e) require that any individual who has an eighteen (18) month lapse between any two training courses of the same discipline to attend an initial training course for the discipline in which they are seeking a license. In order to avoid re-taking the initial training course you must have attended a refresher in the discipline you are seeking a license within eighteen (18) months from the date of issuance of your last training course certificate.

Office of Air Quality, Asbestos Licensing Section (317) 233-3861



Indiana Dept. of Environmental Management

Sandra S. Shadley

Asbestos Management Planner License #: 19A002720

Effective: 01/21/2010
Birth Date: 04/21/1959
Height: 5-08
Weight: 140

Expiration: 01/21/2011
Gender: F
Eye Color: Blue
Hair Color: Brown

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE

**1435 Sadlier Circle West Drive
Indianapolis, Indiana 46239
(317) 352 -1270 / (317) 352 - 0669**

CHRISTIAAN SPARKS
306 - 04 - 2616

**Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better**

**For
ASBESTOS BUILDING INSPECTOR REFRESHER**

**Accredited by the
Indiana Department of Environmental Management.**

Certificate # ES03/BIR755

**Course Dates: 09/26/2003
Test Date: 09/26/ 2003 Expires: 09/26/2004**



Sharyn Reyes
Sharyn Reyes
Instructor / Manager

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE
1435 Sadlier Circle West Drive
Indianapolis, Indiana 46239
(317) 352-1270 / (317) 352-06

GEORGE Wm. (BILL) OGLE

Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better
For

**ASBESTOS MANAGEMENT PLANNER
REFRESHER**

Accredited by the
Indiana Department of Environmental Management.

Certificate # ES03/MPR045

Course Dates: 09/05/2003
Test Date: 09/05/2003 Expires: 09/05/2004




Sharyn Reyes
Instructor

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE

**1435 Sadlier Circle West Drive
Indianapolis, Indiana 46236
(317) 352-1270 / (317) 352 - 0669**

**PATRICK E. WILSON
309 - 90 - 6909**


**Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better
For**

ASBESTOS BUILDING INSPECTOR REFRESHER

**Accredited by the
Indiana Department of Environmental Management.**

Certificate # ES00/BIR482

**Course Dates: 11/29/2000
Test Date: 11/29/2000 Expires: 11/29/2001**


**Sharyn Reyes
Instructor**



Environmental Management Institute

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846

www.spea.iupui.edu/Envtl_mgmt


This confirms that

George Wm. (Bill) Ogle

Completed the Requisite Initial Training for
Asbestos Accreditation Under TSCA Title II
and has
Passed with a Score of 70 or Greater the Examination for
Asbestos Management Planner

Course date
March 2 - 3, 2000

Examination Date
March 3, 2000

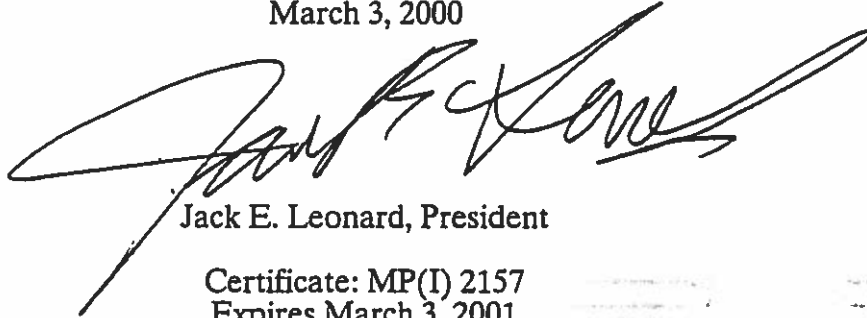

Jack E. Leonard, President

Certificate: MP(I) 2157
Expires March 3, 2001

Approved by: Illinois Department of Public Health
Indiana Department of Environmental Management



ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE

**1435 Sadlier Circle West Drive
Indianapolis, Indiana 46239
(317) 352-1270 / (317) 352-0669**

CLINT YATES

316 - 92 - 7065


**Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better
For**

ASBESTOS BUILDING INSPECTOR REFRESHER

**Accredited by the
Indiana Department of Environmental Management.**

Certificate # ES/BIR98/004.

**Course Dates: 01/22/98 - 01/22/98
Test Date: 01/22/98 Expires: 01/22/99**



**Sharyn Reyes
Assistant / Instructor**

Environmental Management Institute

Environmental and Occupational Training Service

5610 Crawfordsville Road, Suite 15

Indianapolis, Indiana 46224-3714

317/248-4848

This confirms that

Rex Gaddis

Completed the Requisite Refresher Training for
Asbestos Accreditation Under TSCA Title II


and has

Passed with a Score of 70 or Greater the Examination for

Asbestos Building Inspector

Course date
November 22, 1994

Examination Date
November 22, 1994

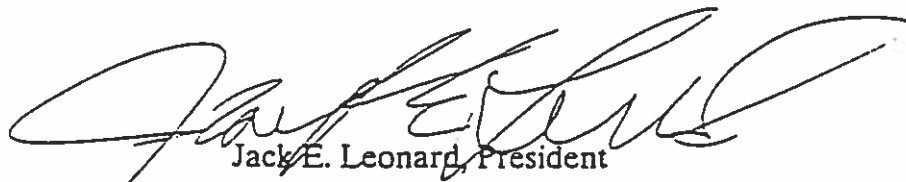

Jack E. Leonard, President

Certificate: IN(R) 2713
Expires November 22, 1995

Approved by: Illinois Department of Public Health
Indiana Department of Environmental Management

INDIANA DEPARTMENT OF
ENVIRONMENTAL MANAGEMENT
ASBESTOS CERTIFICATE OF ACCREDITATION
CERTIFICATE # 102240026 EXPIRATION DATE 2/13/96
Rex Gaddis
IS CERTIFIED IN THE FOLLOWING DISCIPLINE(S)
INSPECTOR ☐ PLANNER ☒ DESIGNER ☐
SUPERVISOR ☐ WORKER ☐
WASTE DISPOSAL MANAGER ☐
BIRTHDATE 3/24/52 SEX M EYES BLU
HEIGHT 5-10 WEIGHT 220 HAIR BRO

INDIANA DEPARTMENT OF
ENVIRONMENTAL MANAGEMENT
ASBESTOS CERTIFICATE OF ACCREDITATION
CERTIFICATE # 190908032 EXPIRATION DATE 3/16/96
Rex Gaddis
IS CERTIFIED IN THE FOLLOWING DISCIPLINE(S)
INSPECTOR ☒ PLANNER ☐ DESIGNER ☒
SUPERVISOR ☐ WORKER ☐
WASTE DISPOSAL MANAGER ☐
BIRTHDATE 3/24/52 SEX M EYES BLU
HEIGHT 5-10 WEIGHT 220 HAIR BRO

TRAINING

**OPERATIONS AND MAINTENANCE
INFORMATION**

MINOR FIBER RELEASE EPISODE

The local education agency shall ensure that the procedures described below are followed in the event of a minor fiber release episode (i.e., the falling or dislodging of not more than 3 square or linear feet of friable ACBM):

1. Thoroughly saturate the debris using wet methods.
2. Clean the area using wet methods, protective clothing, HEPA-vacuums, mini-enclosures, glove bags, as necessary to inhibit the spread of any released fibers. At a minimum, workers should use air-purifying respirators with HEPA filters.
3. Place the asbestos debris in a sealed, leak-tight container, preferably a 6 mil. labeled plastic bag.
4. Repair the area of damaged ACM with materials such as asbestos-free spackling, plaster, cement, or insulation, or seal with latex paint or an encapsulant, or immediately have the appropriate response action implemented.
5. Each fiber release episode should be documented.

MAJOR FIBER RELEASE EPISODE

The local education agency shall ensure that the procedures described below are followed in the event of a major fiber release episode (i.e., the falling or dislodging of more than 3 square or linear feet of friable ACBM):

1. Restrict entry into the area and post signs to prevent entry into the area by persons other than those necessary to perform the response action.
2. Shut off or temporarily modify the air-handling system to prevent the distribution of fibers to other areas in the building.
3. AHERA requires that major fiber release episodes be designed by accredited Project Designers. However, the following response procedures should form the basis for response actions.
4. All the procedures recommended by EPA and required by OSHA for large-scale removal of ACM should be used. These include containment barrier, negative pressure ventilation, personal respiratory protection and protective clothing, decontamination facilities, and air testing.
5. Workers should wear "type C" respirators and protective clothing, including a body suit, hood, boots and gloves. Personal air monitoring may be conducted on representative workers, but is not required by OSHA when "type C" respirators are used.
6. Fallen debris should be sprayed with amended water and placed in plastic bags for disposal. Shovels are useful for collecting the debris. The floor should be thoroughly cleaned with a HEPA vacuum cleaner.
7. Walls, ceiling, pipes, boilers, or other surfaces where ACM was damaged or delaminated should be repaired temporarily. This might involve replastering with asbestos-free material, spraying with an encapsulant, or taping with duct tape. In some cases, ACM beyond the immediate area of damage may need to be removed to prevent additional episodes.
8. The air should be tested for asbestos fibers before the plastic barriers are removed and the area reoccupied. Testing should follow guidelines in Chapter 6 of the Purple Book and Chapter 4 of the Silver Book. That is, air should be sampled at the specified number of locations and analyzed by either phase contrast microscopy or transmission electron microscopy. However, sampling should not be done aggressively since the use of blowers and fans may dislodge fibers from the remaining ACM.

9. After the barriers have been taken down, a decontamination of the entire building or a portion of it should be considered. The need for this will depend on how rapidly the response team reacted to the episode and, in particular, how quickly the HVAC system was turned off. A thorough decontamination includes HEPA-vacuuming and/or wet wiping all carpets, furniture, and other surfaces. Decontamination of the HVAC system would involve disassembling and cleaning (HEPA-vacuuming or wet wiping) ducts, ventilators, registers, and other system parts. System filters should also be removed and replaced.

10. All equipment used in the cleanup operation should be washed or wiped with damp cloths. All disposable materials (e.g., cloths, mop heads, filters, coveralls) should be discarded as asbestos wastes.

11. Each fiber release episode should be documented.

OPERATIONS AND MAINTENANCE REPORT
(Use only for O&M work less than 3 square or 3 linear feet)

L.E.A.: _____

BUILDING: _____

DATE: _____

The following information is provided in accordance with 40 CFR 763.91 and 763.94.

1. Location: _____

Homogeneous Area/Material Description _____

2. Response: Clean _____ Repair _____ Encapsulation _____

Enclosure _____ Removal _____

Reason: _____

3. Work Description: _____

4. Date: Start _____ Stop _____

Time: Start _____ Stop _____

5. Material: Surface _____ SF Thermal _____ LF

Other: _____ SF or _____ LF

6. Asbestos Control Method: Wet Methods _____ HEPA Vacuum _____

Glovebag _____ Mini-Enclosure _____

7. Respiratory Protection: N.A.P.R. _____ P.A.P.R. _____

Were all employees properly fit tested? YES NO NOT APPLICABLE

8. Equipment Used:

Low Vol. Pumps
FAM
HEPA Vac

High Vol. Pumps
AFD

Other: _____

9. Material Used:

6 Mil. Disposable Bags
Glovebags
Duct Tape
Disposable Coveralls
Sponges

Poly
HEPA Filters
Spray Glue
3M Pads

Encapsulants: Penetrating _____ Bridging _____

Other: _____

10. Work Personnel:

| NAME | 16 HOUR TRAINED - IDEM ACCREDITED | | | |
|-------------------|-----------------------------------|----|-----|----|
| Supervisor: _____ | YES | NO | YES | NO |
| Worker(s): _____ | YES | NO | YES | NO |
| _____ | YES | NO | YES | NO |
| _____ | YES | NO | YES | NO |
| _____ | YES | NO | YES | NO |
| _____ | YES | NO | YES | NO |

11. ACBM Disposal: Storage: YES NO , If yes, where stored: _____

If no, where disposed: Landfill: _____

12. Final Visual Inspection Approved: _____
(LEA Designated Person - Printed Name)

(LEA Designated Person - Signature)

**REMOVAL PROJECT
INFORMATION**

SHORT TERM WORKER PROGRAM

GREATER CLARK COUNTY SCHOOLS

SHORT-TERM WORKER SIGN OFF SHEET

This form should be signed each and every time before a "short-term worker" (telephone repair worker, utility worker, etc.) performs work that may cause him to come in contact with ACBM or suspected ACBM assumed to be ACM. One copy of this form should then be forwarded to the LEA designated person, and one copy should be maintained in the school building's copy of the supplemental binder provided by Alliance Indiana, Inc., in order to fulfill the LEA's recordkeeping requirements. The third copy should be forwarded to Alliance Indiana, Inc. for placement in its copy of the supplemental binder.

School Building Name - W. E. Wilson Elementary School Date _____

I certify that before performing any work which would possibly cause me to come in contact with Asbestos Containing Building Materials (ACBM), I was provided with adequate information regarding the locations of ACBM and suspected ACBM assumed to be ACM in the above-mentioned school building where I performed the work.

Signature - _____

Company - _____

Description of work (including number of days on site) - _____

GREATER CLARK COUNTY SCHOOLS

SHORT-TERM WORKER SIGN IN LOG

ALL SHORT-TERM WORKERS MUST SIGN THIS LOG CONFIRMING THAT THEY HAVE SIGNED A "SHORT-TERM WORKER SIGN OFF SHEET"

BUILDING NAME - W. E. Wilson Elementary School

DATE _____

NAME(print)

COMPANY

SIGNATURE

© 2006 The Authors
Journal compilation © 2006 Blackwell Publishing Ltd

[illegible]