

GREATER CLARK COUNTY SCHOOLS

JONATHAN JENNINGS ELEMENTARY SCHOOL

AHERA ASBESTOS MANAGEMENT PLAN

DESIGNATED PERSON TRUTH AND CORRECT STATEMENT

Local Education Agency – Greater Clark County Schools

2112 Utica-Sellersburg Road Jeffersonville, Indiana 47130

Designated Person - Alliance Environmental Group, Inc.

Sandra Shadley

5153 Commerce Square Drive, Suite E

Indianapolis, Indiana 46237

This Truth and Correct Statement, as outlined in 40 CFR 763.93(i), certifies that the general, local education agency responsibilities, as stipulated by 40 CFR 763.84, have been or will be met. These responsibilities include:

- 1. Ensure that the activities of any persons who perform inspections, reinspections, and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with 40 CFR 763 Subpart E.
- 2. Ensure all custodial and maintenance employees are properly trained as required by 40 CFR 763 Subpart E and other applicable Federal and/or State regulations (e.g., the Occupational Safety and Health Administration Asbestos Standard for Construction, the EPA Worker Protection Rule, or applicable State regulations).
- 3. Ensure that workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress.
- 4. Ensure that short-term workers (e.g., telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.
- 5. Ensure that warning labels are posted in accordance with Section 763.95.
- 6. Ensure management plans are available for inspection and notification of such availability has been provided as specified in the management plan under Section 763.93(g).
- 7. The undersigned person designated by the LEA pursuant to Section 763.84(g) (1) has received adequate training as stipulated in Section 763.84(g) (2).
- 8. The LEA has and will consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under Part 763.

Signature: _______ Date: November 6, 2016

Sandra S. Shadley

ASBESTOS PROGRAM MASTER INDEX

The following volumes are part of the Asbestos Program for the GREATER CLARK COUNTY SCHOOLS:

- A. Original Asbestos Management Plan for each school building.
- B. Asbestos Management Plan Supplement for each school building.
 - 1. Amendments to Management Plan
 - 2. Remaining Materials Report
 - 3. Surveillance, Reinspection and Additional Bulk Sampling Information
 - 4. Annual Notifications, Accreditations and Training Records
 - 5. Operations and Maintenance Records
 - 6. Asbestos Removal Projects
 - 7. Short Term Worker Program

Copies of both volumes are found in the respective buildings. The Administration Building also contains duplicate copies of both volumes for each building in their entirety.

GREATER CLARK COUNTY SCHOOLS JONATHAN JENNINGS ELEMENTARY SCHOOL TABLE OF CONTENTS

AMENDMENTS TO MANAGEMENT PLAN	1
REMAINING MATERIALS REPORT	2
SURVEILLANCE, REINSPECTION AND ADDITIONAL BULK SAMPLING INFORMATION	3
ANNUAL NOTIFICATIONS, ACCREDITATIONS, AND TRAINING	4
OPERATIONS AND MAINTENANCE RECORDS	5
ASBESTOS REMOVAL PROJECTS	6
SHORT TERM WORKER INFORMATION	7

AMENDMENTS TO THE MANAGEMENT PLAN

GREATER CLARK COUNTY SCHOOLS JONATHAN JENNINGS ELEMENTARY SCHOOL

LEA RESPONSIBILITY CERTIFICATION

LEA Designated Person - ALLIANCE INDIANA, INC.

Signature - Bruce Wallace, President/CEO

May 1, 1995

ACCREDITATION STATEMENT

The Greater Clark County Schools ensures that the following items will be carried out:

Activities of any persons who perform inspections, reinspections, and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with Subpart E of this part.

All custodial and maintenance employees are properly trained as required by this Subpart E and other applicable Federal and/or State regulations (e.g., the OSHA asbestos standard for construction, the EPA worker protection rule, or applicable State regulations).

Workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, and post response action activities, including periodic reinspection and surveillance activities that are planned or in progress.

Short-term workers (e.g., telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.

Warning labels are posted in accordance with 763.95.

Management plans are available for inspection and notification of such availability has been provided as specified in the management plan under 763.93(g).

Designate a person to ensure that requirements under this section are properly implemented.

Designated person receives adequate training to perform duties assigned under this section. Such training shall provide, as necessary, basic knowledge of:

Health effects of asbestos

Detection, identification, and assessment of ACM

Options for controlling ACBM

Asbestos management programs

Relevant Federal and State regulations concerning asbestos, including those in this Subpart E and those of the OSHA, U.S. Department of Labor, the U.S. Department of Transportation and the u.S. Environmental Protection Agency.

Consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under this subpart.

AMENDMENT TO THE MANAGEMENT PLAN

LEA Name -

Greater Clark County Schools

Building -

Jonathan Jennings Elementary School

Subject -

LEA Designated Person Change

Effective May 1, 1995 the Designated Person for the

Greater Clark County Schools is:

Alliance Indiana, Inc.

1433 Sadlier Circle West Drive Indianapolis, Indiana 46239

(317) 351-5600

Management Planner: Rex Gaddis Accreditation No. 192218025

s L<u>Sadds</u>

May 1, 1995

Date

AMENDMENT TO MANAGEMENT PLAN

Building Name -

Jonathan Jennings Elementary

Subject -

Addition of Homogeneous Area D

Amendment -

Cloth expansion joints were noted during the December 2011 surveillance and they were not included in the original inspection. This material is suspect to contain asbestos; therefore, it is being added to the

management plan until properly sampled.

Management Planner: Sandra Shadley

Accreditation Number: 19A002720

Greater Clark County Schools

Amendments

AMENDMENT TO THE AHERA MANAGEMENT PLAN

Building -	Jonathan Je	nnings Elementary Scho	ol	
Subject-	New materia	I		
Reference -	HA A Floor 1	Tile Mastic		
Original Ass	essment -	No assessment in origi	nal inspection.	
Amended A	ssessment -	The floor tile mastic in to original inspection. The by EPA. The material and treated as such ur sampled.	e material is considered will be assumed to co	d to be suspect entain asbestos
Management	t Planner			Rex Gaddis
Indiana Depa	artment of En	vironmental Managemer	nt Accreditation	192218025
Signature	<u>Sadolv</u>		9/5/95 Date	

Greater Clark County Schools

Amendments

AMENDMENT TO THE AHERA MANAGEMENT PLAN

n Jennings Elementary School	
terial	
ove Base	
t - No assessment in original inspection.	
ent - The cove base in the building was not a original inspection. The material is consider by EPA. The material will be assumed to and treated as such until a future renovation sampled.	red to be suspect contain asbestos
	Rex Gaddis
f Environmental Management Accreditation	192218025
9/5/95 Date	
	terial The cove base in the building was not a original inspection. The material is consider by EPA. The material will be assumed to and treated as such until a future renovation sampled. Tenvironmental Management Accreditation

AMENDMENT TO THE AHERA MANAGEMENT PLAN

Building - Jonathan Jennings Elementary School								
Subject-	New materia	al .						
Reference -	HA C Cove	Base Mastic						
Original Ass	sessment -	No assessment in original inspection.						
Amended A	ssessment -	The cove base mastic in the building we the original inspection. The material is suspect by EPA. The material will be asbestos and treated as such until a futilit will be sampled.	s considered to be assumed to contain					
Management	t Planner		Rex Gaddis					
Indiana Depa	artment of En	vironmental Management Accreditation	192218025					
Signature	<u>Sadds</u>	<u>9/5/95</u> Date						

AMENDMENT TO MANAGEMENT PLAN

LEA Name -

Greater Clark County Schools

Subject -

LEA Designated Person Change

Amendment -

Effective March 2005, the Designated Person for the Greater Clark

County Schools is:

Alliance Environmental Group, Inc. 5340 Commerce Circle, Suite E Indianapolis, Indiana 46237

(317) 865-3400

Personnel contributing to this Management Plan are licensed in

according with 40 CFR 763.93(e)(12).

Management Planner: Sandra S. Shadley

Accreditation Number: 19A002720

Signature

Date

REMAINING MATERIALS

Greater Clark County School Corporation

Remaining Materials Report 4/23/2020

HA ID	HA Description	Quant	Quantity		HA Location	Plannned Response Action
Jonathan	Jennings Elementary School					
02	4"+ 2" fitting insulation	156	LF	Known	Boiler room and throughout the building	O&M
05-A	Floor tile - under carpet	27000	SF	Assumed	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O&M
05-B	Floor tile- Green 12" X 12"	Unquantified	SF	Known	Principals office and Breezeway	O&M
Α	Floor Tile Mastic	27000	SF	Assumed	Throughout building	O&M
В	Cove Base Moldign	Approx. 3700	LF	Assumed	Throughout the building - Light Gray, Cafeteria and Gym	O&M
С	Cove Base Castic	Approx. 1200	SF	Assumed	Throughout building	O&M
D	Cloth expansion joints	2	Unit(s)	Assumed	Kitchen storage room	O&M

Greater Clark County School Corporation

Remaining Materials Report 1/14/2020

HA ID	HA Description	Quant	Quantity		HA Location	Plannned Response Action
Jonathan	Jennings Elementary School					
02	4"+ 2" fitting insulation	156	LF	Known	Boiler room and throughout the building	O&M
05-A	Floor tile - under carpet	27000	SF	Assumed	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O&M
05-B	Floor tile- Green 12" X 12"	Unquantified	SF	Known	Principals office and Gym Breezeway	O&M
Α	Floor Tile Mastic	27000	SF	Assumed	Throughout building	O&M
В	Cove Base Moldign	Approx. 3700	LF	Assumed	Throughout the building - Light Gray, Cafeteria and Gym	O&M
С	Cove Base Castic	Approx. 1200	SF	Assumed	Throughout building	O&M
D	Cloth expansion joints	2	Unit(s)	Assumed	Kitchen storage room	O&M

Greater Clark County School Corporation Remaining Materials Report 5/16/2019

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
Jonathan	Jennings Elementary School					
02	4"+ 2" fitting insulation	156	LF	Known	Boiler room and throughout the building	O&M
05-A	Floor tile - under carpet	27000	SF	Assumed	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O&M
05-B	Floor tile- Green 12" X 12"	Unquantified	SF	Known	Principals office and Breezeway	O&M
Α	Floor Tile Mastic	27000	SF	Assumed	Throughout building	O&M
В	Cove Base Moldign	Approx. 3700	LF	Assumed	Throughout the building - Light Gray, Cafeteria and Gym	O&M
С	Cove Base Castic	Approx. 1200	SF	Assumed	Throughout building	O&M
D	Cloth expansion joints	2	Unit(s)	Assumed	Kitchen storage room	O&M

Greater Clark County School Corporation Remaining Materials Report

11/14/2018

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
Jonathan	Jennings Elementary School					
02	4" & 2" fitting insulation	156	LF	Known	Boiler room and throughout the building	O&M
05-A	Floor tile - under carpet	27000	SF	Assumed	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O&M
05-B	Floor tile- Green 12" X 12"	Unquantified	SF	Known	Principals office and Breezeway	O&M
Α	Floor Tile Mastic	27000	SF	Assumed	Throughout building	O&M
В	Cove Base Molding	Approx. 3700	LF	Assumed	Throughout the building - Light Gray, Cafeteria and Gym	O&M
С	Cove Base Mastic	Approx. 1200	SF	Assumed	Throughout building	O&M
D	Cloth expansion joints	2	Unit(s)	Assumed	Kitchen storage room	O&M

Greater Clark County School Corporation

Remaining Materials Report 5/2/2018

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
Jonathan	Jennings Elementary School					
02	4"+ 2" fitting insulation	156	LF	Known	Boiler room and throughout the building	O&M
05-A	Floor tile - under carpet	27000	SF	Assumed	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O&M
05-B	Floor tile- Green 12" X 12"	Unquantified	SF	Known	Principals office and Breezeway	O&M
Α	Floor Tile Mastic	27000	SF	Assumed	Throughout building	O&M
В	Cove Base Moldign	Approx. 3700	LF	Assumed	Throughout the building - Light Gray, Cafeteria and Gym	O&M
С	Cove Base Castic	Approx. 1200	SF	Assumed	Throughout building	O&M
D	Cloth expansion joints	2	Unit(s)	Assumed	Kitchen storage room	0&M

Greater Clark County School Corporation

Remaining Materials Report 10/18/2017

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
Jonathan	Jennings Elementary School					
02	4"+ 2" fitting insulation	156	LF	Known	Boiler room and throughout the building	O&M
05-A	Floor tile - under carpet	27000	SF	Assumed	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O&M
05-B	Floor tile- Green 12" X 12"	Unquantified	SF	Known	Principals office and Breezeway	O&M
Α	Floor Tile Mastic	27000	SF	Assumed	Throughout building	O&M
В	Cove Base Moldign	Approx. 3700	LF	Assumed	Throughout the building - Light Gray, Cafeteria and Gym	O&M
С	Cove Base Castic	Approx. 1200	SF	Assumed	Throughout building	O&M
D	Cloth expansion joints	2	Unit(s)	Assumed	Kitchen storage room	0&M

Greater Clark County School Corporation Remaining Materials Report

4/13/2017

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
<u>Jonathan</u>	Jennings Elementary School					
02	4"+ 2" fitting insulation	156	LF	Known	Boiler room and throughout the building	O&M
05-A	Floor tile - under carpet	27000	SF	Assumed	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O&M
05-B	Floor tile- Green 12" X 12"	Unquantified	SF	Known	Principals office and Breezeway	O&M
Α	Floor Tile Mastic	27000	SF	Assumed	Throughout building	O&M
В	Cove Base Moldign	Approx. 3700	LF	Assumed	Throughout the building - Light Gray, Cafeteria and Gym	O&M
С	Cove Base Castic	Approx. 1200	SF	Assumed	Throughout building	O&M
D	Cloth expansion joints	2	Unit(s)	Assumed	Kitchen storage room	O&M

Greater Clark County School Corporation Remaining Materials Report 11/3/2016

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
Jonathan	Jennings Elementary School					
02	4"+ 2" fitting insulation	156	LF	Known	Boiler room and throughout the building	O&M
05-A	Floor tile - under carpet	27000	SF	Assumed	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O&M
05-B	Floor tile- Green 12" X 12"	Unquantified	SF	Known	Principals office and Breezeway	O&M
Α	Floor Tile Mastic	27000	SF	Assumed	Throughout building	O&M
В	Cove Base Molding	Approx. 0	LF	Assumed	Throughout the building - Light Gray, Cafeteria and Gym	Removed
С	Cove Base Mastic	0	SF	Assumed	Throughout building	Removed
D	Cloth expansion joints	2	Unit(s)	Assumed	Kitchen storage room	O&M

Greater Clark County School Corporation

Remaining Materials Report 4/28/2016

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
Jonathan	Jennings Elementary School					
02	4"+ 2" fitting insulation	156	LF	Known	Boiler room and throughout the building	O&M
05-A	Floor tile - under carpet	27000	SF	Assumed	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O&M
05-B	Floor tile- Green 12" X 12"	Unquantified	SF	Known	Principals office and Breezeway	O&M
Α	Floor Tile Mastic	27000	SF	Assumed	Throughout building	O&M
В	Cove Base Moldign	Approx. 3700	LF	Assumed	Throughout the building - Light Gray, Cafeteria and Gym	O&M
С	Cove Base Castic	Approx. 1200	SF	Assumed	Throughout building	O&M
D	Cloth expansion joints	2	Unit(s)	Assumed	Kitchen storage room	O&M

Greater Clark County School Corporation

Remaining Materials Report 10/20/2015

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
Jonathan	Jennings Elementary School					
02	4"+ 2" fitting insulation	156	LF	Known	Boiler room and throughout the building	O&M
05-A	Floor tile - under carpet	27000	SF	Assumed	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O&M
05-B	Floor tile- Green 12" X 12"	Unquantified	SF	Known	Principals office and Breezeway	O&M
Α	Floor Tile Mastic	27000	SF	Assumed	Throughout building	O&M
В	Cove Base Moldign	Approx. 3700	LF	Assumed	Throughout the building - Light Gray, Cafeteria and Gym	O&M
С	Cove Base Castic	Approx. 1200	SF	Assumed	Throughout building	O&M
D	Cloth expansion joints	2	Unit(s)	Assumed	Kitchen storage room	O&M

Greater Clark County Schools Remaining Materials Report April 22, 2015

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Jonatha</u>	an Jennings Elementary				
02	4"+ 2" fitting insulation	156 LF	Υ	Boiler room and throughout the building	O & M
05-A	Floor tile - under carpet	27,000 SF	Α	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O & M
05-B	Floor tile- Green 12" X 12"	Unquantified SF	Υ	Principals office and Breezeway	O & M
05-C	12"X 12" White Floor tile	Unquantified SF	Α	Gym Floor	O & M
Α	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
В	Cove base molding	Approx. 3,700 LF	Α	Throughout the building - Light Gray, Cafeteria and Gym	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M
D	Cloth expansion joints	2 Eac	Α	Kitchen storage room	O & M

Greater Clark County Schools Remaining Materials Report October 22, 2014

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Jonatha</u>	an Jennings Elementary				
02	4"+ 2" fitting insulation	156 LF	Υ	Boiler room and throughout the building	O & M
05-A	Floor tile - under carpet	27,000 SF	Α	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O & M
05-B	Floor tile- Green 12" X 12"	Unquantified SF	Υ	Principals office and Breezeway	O & M
05-C	12"X 12" White Floor tile	Unquantified SF	Α	Gym Floor	O & M
Α	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
В	Cove base molding	Approx. 3,700 LF	Α	Throughout the building - Light Gray, Cafeteria and Gym	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M
D	Cloth expansion joints	2 Eac	Α	Kitchen storage room	O & M

Greater Clark County Schools Remaining Materials Report April 21, 2014

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Jonatha</u>	an Jennings Elementary				
02	4"+ 2" fitting insulation	156 LF	Υ	Boiler room and throughout the building	O & M
05-A	Floor tile - under carpet	27,000 SF	Α	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O & M
05-B	Floor tile- Green 12" X 12"	Unquantified SF	Υ	Principals office and Breezeway	O & M
05-C	12"X 12" White Floor tile	Unquantified SF	Α	Gym Floor	O & M
4	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
3	Cove base molding	Approx. 3,700 LF	Α	Throughout the building - Light Gray, Cafeteria and Gym	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M
D	Cloth expansion joints	2 Eac	Α	Kitchen storage room	O & M

Greater Clark County Schools Remaining Materials Report October 24, 2013

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Jonath</u>	an Jennings Elementary				
02	4"+ 2" fitting insulation	156 LF	Y	Boiler room and throughout the building	O & M
)5-A	Floor tile - under carpet	27,000 SF	Α	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O & M
5-B	Floor tile- Green 12" X 12"	Unquantified SF	Υ	Principals office and Breezeway	O & M
5-C	12"X 12" White Floor tile	Unquantified SF	Α	Gym Floor	O & M
\	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
3	Cove base molding	Approx. 3,700 LF	Α	Throughout the building - Light Gray, Cafeteria and Gym	O & M
3	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M
D	Cloth expansion joints	2 Eac	Α	Kitchen storage room	O & M

Greater Clark County Schools Remaining Materials Report April 24, 2013

A#	Material	Quantity	ACBM Y/A	Location	Planned Activities
onath	an Jennings Elementary				
2	4"+ 2" fitting insulation	156 LF	Υ	Boiler room and throughout the building	O & M
5-A	Floor tile - under carpet	27,000 SF	Α	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O & M
i-B	Floor tile- Green 12" X 12"	Unquantified SF	Υ	Principals office and Breezeway	O & M
·C	12"X 12" White Floor tile	Unquantified SF	Α	Gym Floor	O & M
-	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
	Cove base molding	Approx. 3,700 LF	Α	Throughout the building - Light Gray, Cafeteria and Gym	O & M
	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M
	Cloth expansion joints	2 Eac	Α	Kitchen storage room	O & M

Greater Clark County Schools Remaining Materials Report October 24, 2012

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Jonath</u>	an Jennings Elementary				
02	4"+ 2" fitting insulation	156 LF	Υ	Boiler room and throughout the building	O & M
05-A	Floor tile - under carpet	27,000 SF	Α	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O & M
05-B	Floor tile- Green 12" X 12"	Unquantified SF	Υ	Principals office and Breezeway	O & M
05-C	12"X 12" White Floor tile	Unquantified SF	Α	Gym Floor	O & M
Α	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
В	Cove base molding	Approx. 3,700 LF	Α	Throughout the building - Light Gray, Cafeteria and Gym	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M
D	Cloth expansion joints	2 Eac	Α	Kitchen storage room	O & M

Greater Clark County Schools Remaining Materials Report June 25, 2012

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Jonath</u>	an Jennings Elementary				
)2	4"+ 2" fitting insulation	156 LF	Υ	Boiler room and throughout the building	O & M
5-A	Floor tile - under carpet	27,000 SF	Α	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O & M
5-B	Floor tile- Green 12" X 12"	Unquantified SF	Υ	Principals office and Breezeway	O & M
5-C	12"X 12" White Floor tile	Unquantified SF	Α	Gym Floor	O & M
	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
	Cove base molding	Approx. 3,700 LF	Α	Throughout the building - Light Gray, Cafeteria and Gym	O & M
;	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M
)	Cloth expansion joints	2 Eac	Α	Kitchen storage room	O & M

Greater Clark County Schools Remaining Materials Report December 15, 2011

IA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
lonath	an Jennings Elementary				
)2	4"+ 2" fitting insulation	156 LF	Υ	Boiler room and throughout the building	O & M
5-A	Floor tile - under carpet	27,000 SF	Α	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O & M
5-B	Floor tile- Green 12" X 12"	Unquantified SF	Υ	Principals office and Breezeway	O & M
5-C	12"X 12" White Floor tile	Unquantified SF	Α	Gym Floor	O & M
	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
	Cove base molding	Approx. 3,700 LF	Α	Throughout the building - Light Gray, Cafeteria and Gym	O & M
	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M
•	Cloth expansion joints	2 Eac	Α	Kitchen storage room	O & M

Greater Clark County Schools Remaining Materials Report June 27, 2011

łA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
onath	an Jennings Elementary				
)2	4"+ 2" fitting insulation	156 LF	Υ	Boiler room and throughout the building	O & M
5-A	Floor tile - under carpet	Unquantified SF	Α	Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under Carpet)	O & M
5-B	Floor tile- Green 12" X 12"	Unquantified SF	Υ	Nurses station/ Principals office and Breezeway	O & M
5-C	12"X 12" White Floor tile	Unquantified SF	Α	Gym Floor	O & M
ı	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
	Cove base molding	Approx. 3,700 LF	Α	Throughout the building	O & M
	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report December 6, 2010

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
Jonath	an Jennings Elementary				
02	4"+ 2" fitting insulation	156 LF	Υ	Boiler room and throughout the building	O & M
5	Floor tile	27,000 SF	Υ	Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under Carpet)	O & M
	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
	Cove base molding	Approx. 3,700 LF	Α	Throughout the building	O & M
;	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report June 30, 2010

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
Jonath	an Jennings Elementary				
02	4" fitting insulation	156 LF	Υ	Boiler room and throughout the building	O & M
05	Floor tile	27,000 SF	Υ	Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under Carpet)	O & M
A	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
В	Cove base molding	Approx. 3,700 LF	Α	Throughout the building	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report December 7, 2009

				Planned Activities	
HA#	Material	Quantity	ACBM Y/A	Location	Planned Activides
<u>Jonath</u>	an Jennings Elementary				
02	4" fitting insulation	156 LF	Υ	Boiler room and throughout the building	O & M
05	Floor tile	27,000 SF	Υ	Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under Carpet)	O & M
A	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
В	Cove base molding	Approx. 3,700 LF	Α	Throughout the building	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report June 11, 2009

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
		12			
Jonath:	an Jennings Elementary				
)2	4" fitting insulation	156 LF	Υ	Boiler room and throughout the building	O & M
5	Floor tile	27,000 SF	Υ	Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under Carpet)	O & M
	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
3	Cove base molding	Approx. 3,700 LF	Α	Throughout the building	O & M
	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report December 10, 2008

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Jonath</u>	an Jennings Elementary				
02	4" fitting insulation	156 LF	Υ	Boiler room and throughout the building	O & M
05	Floor tile	27,000 SF	Υ.	Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under Carpet)	O & M
Α	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
В	Cove base molding	Approx. 3,700 LF	Α	Throughout the building	O & M
C	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report June 30, 2008

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Jonatha</u>	an Jennings Elementary				
02	4" fitting insulation	156 LF	Υ	Boiler room and throughout the building	O & M
05	Floor tile	27,000 SF	Υ	Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under Carpet)	O & M
Α	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
В	Cove base molding	Approx. 3,700 LF	Α	Throughout the building	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report December 14, 2007

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Jonath</u>	an Jennings Elementary				
)2	4" fitting insulation	156 LF	Y	Boiler room and throughout the building	O & M
5	Floor tile	27,000 SF	Υ	Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under Carpet)	O & M
ı	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
3	Cove base molding	Approx. 3,700 LF	Α	Throughout the building	O & M
;	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report July 9, 2007

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Jonath</u>	an Jennings Elementary				
02	4" fitting insulation	156 LF	Υ	Boiler room and throughout the building	O & M
05	Floor tile	27,000 SF	Y	Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under Carpet)	O & M
A	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
3	Cove base molding	Approx. 3,700 LF	Α	Throughout the building	O & M
0	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report December 18, 2006

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Jonath</u>	an Jennings Elementary				
02	4" fitting insulation	156 LF	Υ	Boiler room and throughout the building	O & M
05	Floor tile	27,000 SF	Υ	Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under Carpet)	O & M
Α	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
В	Cove base molding	Approx. 3,700 LF	Α	Throughout the building	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report June 28, 2006

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Jonath</u>	an Jennings Elementary				
02	4" fitting insulation	156 LF	Υ	Boiler room and throughout the building	O & M
05	Floor tile	27,000 SF	Υ	Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under Carpet)	O & M
Α	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
В	Cove base molding	Approx. 3,700 LF	Α	Throughout the building	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report January 25, 2006

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Jonatha</u>	nn Jennings Elementary				
02	4" fitting insulation	156 LF	Y	Boiler room and throughout the building	O & M
05	Floor tile	27,000 SF	Y	Classrooms, "D" pod teacher's storeroom, Media Center (under carpet) and office areas	O & M
A	Floor tile mastic	27,000 SF	Α	Throughout the building	O & M
В	Cove base molding	Approx. 3,700 LF	Α	Throughout the building	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report July 20, 2005

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>Jonath</u>	an Jennings Elementary					
02	4" fitting insulation	156	LF	Υ	Boiler room and throughout the building	O & M
05	Floor tile	27,000	SF	Υ	Classrooms, "D" pod teacher's storeroom, Media Center and office areas	O & M
Α	Floor tile mastic	27,000	SF	Α	Throughout the building	O & M
В	Cove base molding	Approx. 3,700	LF	Α	Throughout the building	O & M
С	Cove base mastic	Approx. 1,200	SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report December 9, 2004

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
Jonatha	an Jennings Elementary					
02	4" fitting insulation	156	LF	Υ	Boiler room and throughout the building	O & M
5	Floor tile	27,000	SF	Υ	Classrooms, storeroom, Media Center and office areas	O & M
.	Floor tile mastic	27,000	SF	Α	Throughout the building	O & M
3	Cove base molding	Approx. 3,700	LF	Α	Throughout the building	O & M
	Cove base mastic	Approx. 1,200	SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report July 2, 2004

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
onath	an Jennings Elementary					
2	4" fitting insulation	156	LF	Y	Boiler room and throughout the building	O & M
5	Floor tile	27,000	SF	Υ	Classrooms, storeroom, Media Center and office areas	O & M
	Floor tile mastic	27,000	SF	Α	Throughout the building	O & M
	Cove base molding	Approx. 3,700	LF	Α	Throughout the building	O & M
;	Cove base mastic	Approx. 1,200	SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report December 9, 2003

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
Jonatha	an Jennings Elementary					
02	4" fitting insulation	156	LF	Υ	Boiler room and throughout the building	O & M
5	Floor tile	27,000	SF	Υ	Classrooms, storeroom, and office areas	O & M
	Floor tile mastic	27,000	SF	Α	Throughout the building	O & M
}	Cove base molding	Approx. 3,700	LF	Α	Throughout the building	O & M
;	Cove base mastic	Approx. 1,200	SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report June 13, 2003

HA#	Material	Quantity	noc	ACBM Y/A	Location	Planned Activities
Jonath	an Jennings Elementary					
)2	4" fitting insulation	156	LF	Y	Boiler room and throughout the building	O & M
5	Floor tile	27,000	SF	Y	Classrooms, storeroom, and office areas	O & M
i	Floor tile mastic	27,000	SF	Α	Throughout the building	O&M
3	Cove base molding	Approx. 3,700	LF	Α	Throughout the building	O & M
;	Cove base mastic	Approx. 1,200	SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report December 18, 2003

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>Jonatha</u>	an Jennings Elementary					
02	4" fitting insulation	156	LF	Υ	Boiler room and throughout the building	O & M
)5	Floor tile	27,000	SF	Y	Classrooms, storeroom, and office areas	O & M
A.	Floor tile mastic	27,000	SF	Α	Throughout the building	O & M
3	Cove base molding	Approx. 3,700	LF	Α	Throughout the building	O & M
	Cove base mastic	Approx. 1,200	SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report June 19, 2002

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
Jonatha	an Jennings Elementary					
)2	4" fitting insulation	156	LF	Y	Boiler room and throughout the building	O & M
5	Floor tile	27,000	SF	Υ	Classrooms, storeroom, and office areas	O & M
i	Floor tile mastic	27,000	SF	Α	Throughout the building	O & M
}	Cove base molding	Approx. 3,700	LF	Α	Throughout the building	O & M
	Cove base mastic	Approx. 1,200	SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report December 12, 2001

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>Jonath</u>	an Jennings Elementary					
2	4" fitting insulation	156	LF	Υ	Boiler room and throughout the building	O & M
5	Floor tile	27,000	SF	Υ	Classrooms, storeroom, and office areas	O & M
	Floor tile mastic	27,000	SF	Α	Throughout the building	O & M
	Cove base molding	Approx. 3,700	LF	Α	Throughout the building	O & M
;	Cove base mastic	Approx. 1,200	SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report July 12, 2001

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>Jonath</u>	an Jennings Elementary					
02	4" fitting insulation	156	LF	Y	Boiler room and throughout the building	O & M
)5	Floor tile	27,000	SF	Υ	Classrooms, storeroom, and office areas	O & M
A	Floor tile mastic	27,000	ŞF	Α	Throughout the building	O & M
3	Cove base molding	Approx. 3,700	LF	Α	Throughout the building	O & M
	Cove base mastic	Approx. 1,200	SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report January 11, 2001

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
Jonatha	an Jennings Elementary					
02	4" fitting insulation	156	LF	Υ	Boiler room and throughout the building	O & M
05	Floor tile	27,000	SF	Υ	Classrooms, storeroom, and office areas	O & M
Ą	Floor tile mastic	27,000	SF	Α	Throughout the building	O & M
3	Cove base molding	Approx. 3,700	LF	Α	Throughout the building	O & M
C	Cove base mastic	Approx. 1,200	SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report June 29, 2000

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>Jonath</u>	an Jennings Elementary					
02	4" Fitting Insulation	156	LF	Υ	Boiler room and throughout the building	O & M
5	Floor Tile	27000	SF	Υ	Classrooms, Storeroom, and Office Areas	O & M
	Floor Tile Mastic	27000	SF	Α	Throughout the building	O & M
3	Cove Base Molding	Unquantified	LF	Α	Throughout the building	O & M
;	Cove Base Mastic	Unquantified	LF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report February 23, 2000

IA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
· · · · · · · · · · · · · · · · · · ·						
natha	an Jennings Elementary				W	
2	4" Fitting Insulation	156	LF	Y	Boiler room and throughout the building	O & M
5	Floor Tile	27000	SF	Y	Classrooms, Storeroom, and Office Areas	e O & M
	Floor Tile Mastic	27000	SF	Α	Throughout the building	O & M
	Cove Base Molding	Unquantified	LF	Α	Throughout the building	O & M
	Cove Base Mastic	Unquantified	LF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report July 6, 1999

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
Jonath	an Jennings Elementary					
02	4" Fitting Insulation	156	LF	Y	Boiler room and throughout the building	O & M
)5	Floor Tile	27000	SF	Y	Classrooms, Storeroom, and Office Areas	O & M
٨	Floor Tile Mastic	27000	SF	Α	Throughout the building	O & M
3	Cove Base Molding	Unquantified	LF	Α	Throughout the building	O & M
;	Cove Base Mastic	Unquantified	LF	Α	Throughout the building	O & M

PERIODIC SURVEILLANCE REINSPECTION ADDITIONAL BULK SAMPLING INFORMATION

ASSESSMENTS FOR AHERA

- 1. Damaged or significantly damaged thermal systems insulation.
- 2. Damaged friable surfacing ACM.
- 3. Significantly damaged friable surfacing ACM.
- 4. Damaged or significantly damaged friable miscellaneous ACM.
- 5. ACBM with potential for damage.
- 6. ACBM with potential for significant damage.
- 7. Any remaining friable ACBM or friable suspected ACBM.

If a material is non-friable, it does not require an assessment rating under AHERA.

Due to the differences in what is required of the LEA for damaged material compared to significantly damaged material, Alliance has modified the assessment scale to the following:

- 1A. Significantly damaged thermal systems insulation.
- 1B. Damaged thermal systems insulation.
- 4A. Significantly damaged friable miscellaneous ACM.
- 4B. Damaged friable miscellaneous ACM.

PERIODIC SURVEILLANCES

SURVEILLANCE INFORMATION PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

DATE PLANNED	DATE COMPLETED	COMPLETED BY
October 2014	October 22, 2014	Ryingin ()
<u> April 2015</u>	April 22, 2015	Bijain (Ko)
October 2015	October 20, 2016	Rjujain (Koo)
<u> April 2016</u>	RE-INSPECTION	Payan (
October 2016	November 3, 2016	Dotte
<u> April 2017</u>	April 13, 2017	Garin Athlene
October 2017	October 18, 2017	DAHL
<u> April 2018</u>	May 2, 2018	Brigain (Kor)
October 2018	November 14, 2018	Reigan (Ka)
<u> April 2019</u>	RE-INSPECTION	562
October 2019	Janaury 14, 2020	Mill Is
<u> April 2020</u>	April 23, 2020	Mill Is
October 2020		

SURVEILLANCE INFORMATION

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

<u>April 2021</u>		
October 2021		
<u>April 2022</u>	RE-INSPECTION	
October 2022		
<u>April 2023</u>		
October 2023		
<u>April 2024</u>		
October 2024		
<u>April 2025</u>	RE-INSPECTION	
October 2025		
<u>April 2026</u>		
October 2026		

SURVEILLANCE INFORMATION

PERIODIC SURVEILLANCE PLAN SCHEDULE

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

DATE PLANNED	DATE COMPLETED	COMPLETED BY
JUNE 2009	SINE 2009	Bur Ocus
DECEMBER 2009	Dec 2009	Bill Ogle
JUNE 2010	Reinspection	Sandy Shadley
DECEMBER 2010	December 2010	Paul Mrick
JUNE 2011	June 2011	Sandy Shadley
DECEMBER 2011	December 2017	Sandy Snadley
JUNE 2012	June 2012	Jeff hachtin
DECEMBER 2012	October 2012	Jeff hechtin
<u>JUNE 2013</u>	Peinspection	Jeff hachtin
DECEMBER 2013	V	

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each reinspection will be maintained in this binder.

DATE PLANNED	DATE COMPLETED	COMPLETED BY
JUNE 2003	June '03	C. Spacks
DECEMBER 2003	Dec. '03	C. Spirks
JUNE 2004	REINSPECTION	C. Spicks
DECEMBER 2004	Dec. '04	C. Spicks
JUNE 2005	July '05	g. Ogle
DECEMBER 2005	Jun ob	Boyle
JUNE 2006	Docole	C Ams
DECEMBER 2006	Dec 06	B058
JUNE 2007	July 2007 REINSPECTION	Bill Ugle
DECEMBER 2007	December 2001	Bill Ugh
JUNE 2008	June 2008	Bill Gle
DECEMBER 2008	December accor	Kill Gle

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

JONATHAN JENNINGS ELEMENTARY SCHOOL

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long they remain in the building. This inspection will be conducted semi-annually.

The following table outlines the dates on which these inspections should take place in this school building.

PERIODIC SURVEILLANCE SCHEDULE

DATE PLANNED	DATE COMPLETED	COMPLETED BY
DECEMBER 1995	12-95	alliance
JUNE 1996	6-96	alliance
DECEMBER 1996	12-96	alliance
JUNE 1997	7-97	alliance
DECEMBER 1997	1-98	alliance
JUNE 1998	REINSPECTION	alliance
DECEMBER 1998	12-98	alliance
JUNE 1999	June '99	alleance
DECEMBER 1999	Dec. 99	alliance
JUNE 2000	June 2000	alliance
DECEMBER 2000	San. '01	Pat Wilson
JUNE 2001	REINSPECTION	P. Wilson
DECEMBER 2001	Dec. 101	A. Kimbrough
JUNE 2002	June 'OZ	R. Calvert
DECEMBER 2002	Dec. OZ	C. Apacks

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 02

HA Description 4"+ 2" fitting insulation

HA Type Thermal System Insulation (TSI)

HA Location Boiler room and throughout the building

Quantity 156 LF

Comments This material was not in poor condition overall. Kitchen storage stage ends and

custodial closet by room A-1 have visible fittings; small amount of debris found in kitchen storage. Minor patch and repair needed. Material is also located in

hallways

above ceilings. There is no access to pipe chases. This material needs asbestos

labels on all of the locations.

Asbestos Known

Friable Yes

Original Inspection 6/1/1988

Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Michael J. Ardis

State IN Accreditation Number 19A007304

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 05-A

HA Type Floor tile - under carpet Miscellaneous Material

HA Location Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under

Carpet)

Quantity 27000 SF

Comments The material was under carpet therefore not visible to inspect.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Michael J. Ardis

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 05-B

HA TypeFloor tile- Green 12" X 12"

Miscellaneous Material

HA Location Principals office and Breezeway

Quantity Unquantified SF

Comments This material was not in poor condition.

Asbestos Known

Friable No

Original Inspection 6/1/1988

Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Michael J. Ardis

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID A

HA Description Floor Tile Mastic

HA Type Miscellaneous Material
HA Location Throughout building

Quantity 27000 SF

Comments This material was not in poor condition. It was installed in 1987 when Gym was

added

on to building.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Michael J. Ardis

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID B

HA Description Cove Base Moldign

HA Type Miscellaneous Material

HA Location Throughout the building - Light Gray, Cafeteria and Gym

Quantity Approx. 3700 LF

Comments This material has minor scrapes, but was not in poor condition overall.

Asbestos Assumed

Friable No

Original Inspection 5/31/1996
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Michael J. Ardis

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID C

HA Description Cove Base Castic

HA Type Miscellaneous Material

HA Location Throughout building

Quantity Approx. 1200 SF

Comments The material was not visible to inspect.

Asbestos Assumed

Friable No

Original Inspection 5/31/1996

Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Michael J. Ardis

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID D

HA Description Cloth expansion jointsHA Type Miscellaneous MaterialHA Location Kitchen storage room

Quantity 2 Unit(s)

Comments This material was not assessed in the original inspection and will be added to the

management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 12/15/2011

Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Michael J. Ardis

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 02

HA Description 4"+ 2" fitting insulation

HA Type Thermal System Insulation (TSI)

HA Location Boiler room and throughout the building

Quantity 156 LF

Comments This material was not in poor condition overall. Kitchen storage stage ends and

custodial closet by room A-1 have visible fittings; small amount of debris found in kitchen storage. Minor patch and repair needed. Material is also located in

hallways

above ceilings. There is no access to pipe chases. This material needs asbestos

labels on all of the locations.

Asbestos Known

Friable Yes

Original Inspection 6/1/1988

Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Michael J. Ardis

State IN Accreditation Number 19A007304

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 05-A

HA Type Floor tile - under carpet Miscellaneous Material

HA Location Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under

Carpet)

Quantity 27000 SF

Comments The material was under carpet therefore not visible to inspect.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Michael J. Ardis

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 05-B

HA TypeFloor tile- Green 12" X 12"

Miscellaneous Material

HA Location Principals office and Gym Breezeway

Quantity Unquantified SF

Comments Where visible, this material was not in poor condition. The principals office has

been carpeted.

Asbestos Known

Friable No

Original Inspection 6/1/1988

Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Michael J. Ardis

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID A

HA Description Floor Tile Mastic

HA Type Miscellaneous Material
HA Location Throughout building

Quantity 27000 SF

Comments This material was not in poor condition. It was installed in 1987 when Gym was

added

on to building.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Michael J. Ardis

State IN

Accreditation Number 19A007304

Inspector

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID B

HA Description Cove Base Moldign

HA Type Miscellaneous Material

HA Location Throughout the building - Light Gray, Cafeteria and Gym

Quantity Approx. 3700 LF

Comments This material has minor scrapes, but was not in poor condition overall.

Asbestos Assumed

Friable No

Original Inspection 5/31/1996

Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Michael J. Ardis

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID C

HA Description Cove Base Castic

HA Type Miscellaneous Material

HA Location Throughout building

Quantity Approx. 1200 SF

Comments The material was not visible to inspect.

Asbestos Assumed

Friable No

Original Inspection 5/31/1996

Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Michael J. Ardis

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID D

HA Description Cloth expansion jointsHA Type Miscellaneous MaterialHA Location Kitchen storage room

Quantity 2 Unit(s)

Comments This material was not assessed in the original inspection and will be added to the

management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 12/15/2011

Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Michael J. Ardis

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 02

HA Description 4" & 2" fitting insulation

HA Type Thermal System Insulation (TSI)

HA Location Boiler room and throughout the building

Quantity 156 LF

Comments This material was not in poor condition overall. Kitchen storage stage ends and

custodial closet by room A-1 have visible fittings; small amount of debris found in kitchen storage. Minor patch and repair needed. Material is also located in

hallways

above ceilings. There is no access to pipe chases. This material needs asbestos

labels on all locations.

Asbestos Known

Friable Yes

Original Inspection 6/1/1988

Current Inspection 11/14/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact Vibration Air

Low/None Low/None Low/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN Accreditation Number 19A001039

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 05-A

HA Type Floor tile - under carpet

Miscellaneous Material

HA Location Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under

Carpet)

Quantity 27000 SF

Comments The material was under carpet therefore not visible to inspect.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 11/14/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 05-B

HA Type Floor tile- Green 12" X 12"

HA Type Miscellaneous Material

HA Location Principals office and Breezeway

Quantity Unquantified SF

Comments This material was not in poor condition.

Asbestos Known

Friable No

Original Inspection 6/1/1988

Current Inspection 11/14/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HAID A

HA Description Floor Tile Mastic

HA Type Miscellaneous Material
HA Location Throughout building

Quantity 27000 SF

Comments This material was not in poor condition. It was installed in 1987 when Gym was

added

on to building.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 11/14/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID B

HA Description Cove Base Molding

HA Type Miscellaneous Material

HA Location Throughout the building - Light Gray, Cafeteria and Gym

Quantity Approx. 3700 LF

Comments This material has minor scrapes, but was not in poor condition overall.

Asbestos Assumed

Friable No

Original Inspection 5/31/1996

Current Inspection 11/14/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HAID C

HA Description Cove Base Mastic

HA Location Miscellaneous Material
Throughout building

HA Location Throughout building

Quantity Approx. 1200 SF

Comments The material was not visible to inspect.

Asbestos Assumed

Friable No

Original Inspection 5/31/1996

Current Inspection 11/14/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID D

HA Description Cloth expansion jointsHA Type Miscellaneous MaterialHA Location Kitchen storage room

Quantity 2 Unit(s)

Comments This material was not assessed in the original inspection and will be added to

the

management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 12/15/2011

Current Inspection 11/14/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 02

HA Description 4"+ 2" fitting insulation

HA Type Thermal System Insulation (TSI)

HA Location Boiler room and throughout the building

Quantity 156 LF

Comments This material was not in poor condition overall. Kitchen storage stage ends and

custodial closet by room A-1 have visible fittings; small amount of debris found in kitchen storage. Minor patch and repair needed. Material is also located in

hallways

above ceilings. There is no access to pipe chases. This material needs asbestos

labels on all of the locations.

Asbestos Known

Friable Yes

Original Inspection 6/1/1988

Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

2011/110110

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN Accreditation Number 19A001039

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 05-A

HA Type Floor tile - under carpet Miscellaneous Material

HA Location Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under

Carpet)

Quantity 27000 SF

Comments The material was under carpet therefore not visible to inspect.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 05-B

HA Type Floor tile- Green 12" X 12"

HA Type Miscellaneous Material

HA Location Principals office and Breezeway

Quantity Unquantified SF

Comments This material was not in poor condition.

Asbestos Known

Friable No

Original Inspection 6/1/1988

Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID A

HA Description Floor Tile Mastic

HA Type Miscellaneous Material
HA Location Throughout building

Quantity 27000 SF

Comments This material was not in poor condition. It was installed in 1987 when Gym was

added

on to building.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID B

HA Description Cove Base MoldignHA Type Miscellaneous Material

HA Location Throughout the building - Light Gray, Cafeteria and Gym

Quantity Approx. 3700 LF

Comments This material has minor scrapes, but was not in poor condition overall.

Asbestos Assumed

Friable No

Original Inspection 5/31/1996

Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID C

HA Description Cove Base Castic

HA Type Miscellaneous Material
HA Location Throughout building

Quantity Approx. 1200 SF

Comments The material was not visible to inspect.

Asbestos Assumed

Friable No

Original Inspection 5/31/1996

Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID D

HA Description Cloth expansion jointsHA Type Miscellaneous MaterialHA Location Kitchen storage room

Quantity 2 Unit(s)

Comments This material was not assessed in the original inspection and will be added to

the

management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 12/15/2011

Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name	Greater Clark County School Corporation					
Building Name	Jonathan Jennings Elementary School					
Building Number	09					
HA ID	02					
HA Description	4"+ 2" fitting in	sulation				
НА Туре	Thermal System Insulation (TSI)					
HA Location	Boiler room and throughout the building					
Quantity	156	l	.F			
Comments	This material was not in poor condition overall. Kitchen storage stage ends and custodial closet by room A-1 have visible fittings; small amount of debris found in kitchen storage. Minor patch and repair needed. Material is also located in hallways above ceilings. There is no access to pipe chases. This material needs asbestos labels on all of the locations.					
Asbestos	Known					
Friable	Yes					
Original Inspection	6/1/1988					
Current Inspection	10/18/2017					
		Material As	sessment			
Assessment Rating 5 ACBM with potential for damage Damage Assessment and Potential for Damage						
Percent Damag	<u>ed</u> %	Good Condition				
<u>Phy</u>	sical Contact	<u>Vibrat</u>	<u>ion</u>	<u>Air</u>		
Low/None		Low/N	one	Low/None		
Planned Response Action O&M						
Inspector	5	Al				

Dustin Hawkins

State IN Accreditation Number 19A007194

LEA Name Greater Clark County School Corporation Building Name Jonathan Jennings Elementary School **Building Number** 09 HA ID 05-A **HA Description** Floor tile - under carpet **HA Type** Miscellaneous Material Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under **HA Location** Carpet) Quantity 27000 SF Comments The material was under carpet therefore not visible to inspect. **Asbestos** Assumed **Friable** No Original Inspection 6/27/2011 **Current Inspection** 10/18/2017 **Material Assessment Assessment Rating** 5 ACBM with potential for damage **Damage Assessment and Potential for Damage Percent Damaged Good Condition** % **Physical Contact** Vibration <u>Air</u> Low/None Low/None Low/None **Planned Response Action 0&M** Inspector

Dustin Hawkins

State IN

LEA Name Greater Clark County School Corporation Jonathan Jennings Elementary School **Building Name Building Number** 09 **HAID** 05-B Floor tile- Green 12" X 12" **HA Description HA Type** Miscellaneous Material Principals office and Breezeway **HA Location** Quantity Unquantified SF Comments This material was not in poor condition. **Asbestos** Known **Friable** No **Original Inspection** 6/1/1988 **Current Inspection** 10/18/2017 **Material Assessment Assessment Rating** 5 ACBM with potential for damage **Damage Assessment and Potential for Damage Percent Damaged Good Condition Physical Contact** Vibration <u>Air</u> Low/None Low/None Low/None **Planned Response Action** 0&M Inspector **Dustin Hawkins**

State IN

LEA Name Greater Clark County School Corporation Building Name Jonathan Jennings Elementary School **Building Number** 09 **HAID** Α **HA Description** Floor Tile Mastic **HA Type** Miscellaneous Material Throughout building **HA Location** Quantity 27000 SF Comments This material was not in poor condition. It was installed in 1987 when Gym was on to building. **Asbestos** Assumed Friable No **Original Inspection** 6/27/2011 **Current Inspection** 10/18/2017 **Material Assessment Assessment Rating** 5 ACBM with potential for damage **Damage Assessment and Potential for Damage Percent Damaged** % **Good Condition Physical Contact Vibration** <u>Air</u> Low/None Low/None Low/None **Planned Response Action 0&M** Inspector **Dustin Hawkins**

State IN

LEA Name	Greater Clark County School Corporation						
Building Name	Jonathan Jennings Elementary School						
Building Number	09						
HA ID	В						
HA Description	Cove Base Moldign						
НА Туре	Miscellaneous Material						
HA Location	Throughout the building - Light Gray, Cafeteria and Gym						
Quantity	Approx 2700	l F					
Quantity Comments	Approx. 3700 LF This material has minor scrapes, but was not in near condition everall.						
Asbestos	This material has minor scrapes, but was not in poor condition overall. Assumed						
Friable	No						
Original Inspection	5/31/1996						
Current Inspection	10/18/2017						
Material Assessment							
Assessment Rating 5 ACBM with potential for damage							
<u>Da</u>	amage Asse	essment and Pot	ential for Damage				
Percent Damag	<u>ed</u> %	Good Condition					
<u>Ph</u> y	rsical Contact	<u>Vibration</u>	<u>Air</u>				
1	_ow/None	Low/None	Low/None				
Planned Response Action O&M							
D-AA-C							
Inspector							
Dustin Hawkins							

State IN

LEA Name Greater Clark County School Corporation Jonathan Jennings Elementary School **Building Name Building Number** 09 HA ID С **HA Description Cove Base Castic HA Type** Miscellaneous Material Throughout building **HA Location** Quantity Approx. 1200 SF Comments The material was not visible to inspect. **Asbestos** Assumed **Friable** No **Original Inspection** 5/31/1996 **Current Inspection** 10/18/2017 **Material Assessment Assessment Rating** 5 ACBM with potential for damage **Damage Assessment and Potential for Damage Percent Damaged Good Condition Physical Contact** Vibration <u>Air</u> Low/None Low/None Low/None **Planned Response Action** 0&M Inspector **Dustin Hawkins**

State IN

LEA Name	Greater Clark County School Corporation				
Building Name	Jonathan Jennings Elementary School				
Building Number	09				
HA ID	D				
HA Description	Cloth expansion	on joints			
на Туре	Miscellaneous Material				
HA Location	Kitchen storage room				
Quantity	2	Unit(s)			
Comments	This material was not assessed in the original inspection and will be added to the management plan until properly sampled.				
Asbestos	Assumed				
Friable	No				
Original Inspection	12/15/2011				
Current Inspection	10/18/2017				
		Material Assessmer	<u>1t</u>		
Assessment Rating 5 ACBM with potential for damage					
<u>Da</u>	amage Asse	essment and Potent	ial for Damage		
Percent Damag	<u>ed</u> %	Good Condition			
<u>Phy</u>	sical Contact	<u>Vibration</u>	<u>Air</u>		
I	Low/None	Low/None	Low/None		
<u>Planned</u>	Response Actio	on O&M			
	5-4	He.			
Inspector					
<u>-</u>	Dustin H	awkins			

State IN

LEA Name Greater Clark County School Corporation Building Name Jonathan Jennings Elementary School **Building Number** 09 HA ID 02 4"+ 2" fitting insulation **HA Description HA Type** Thermal System Insulation (TSI) Boiler room and throughout the building **HA Location** Quantity 156 LF Comments This material was not in poor condition overall. Kitchen storage stage ends and custodial closet by room A-1 have visible fittings; small amount of debris found in kitchen storage. Minor patch and repair needed. Material is also located in hallways above ceilings. There is no access to pipe chases. This material needs asbestos labels on all of the locations. **Asbestos** Known Friable Yes Original Inspection 6/1/1988 **Current Inspection** 4/13/2017 **Material Assessment** 5 ACBM with potential for damage **Assessment Rating Damage Assessment and Potential for Damage Percent Damaged** % **Good Condition Physical Contact** Vibration <u>Air</u> Low/None Low/None Low/None **Planned Response Action 0&M** Janie AHoin

Inspector

Jamie Hosier

State Indiana **Accreditation Number** 19A007179

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 05-A

HA Type Floor tile - under carpet

Miscellaneous Material

HA Location Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under

Carpet)

Quantity 27000 SF

Comments The material was under carpet therefore not visible to inspect.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector
Jamie Hosier

State Indiana

LEA Name Greater Clark County School Corporation Building Name Jonathan Jennings Elementary School **Building Number** 09 **HAID** 05-B Floor tile- Green 12" X 12" **HA Description HA Type** Miscellaneous Material Principals office and Breezeway **HA Location** Quantity Unquantified SF Comments This material was not in poor condition. **Asbestos** Known **Friable** No **Original Inspection** 6/1/1988 **Current Inspection** 4/13/2017 **Material Assessment Assessment Rating** 5 ACBM with potential for damage **Damage Assessment and Potential for Damage Percent Damaged Good Condition Physical Contact** Vibration <u>Air</u> Low/None Low/None Low/None **Planned Response Action** 0&M Janie AHoin

State Indiana

Jamie Hosier

Accreditation Number 19A007179

Inspector

LEA Name

Greater Clark County School Corporation Building Name Jonathan Jennings Elementary School **Building Number** 09 **HAID** Α **HA Description** Floor Tile Mastic **HA Type** Miscellaneous Material Throughout building **HA Location** Quantity 27000 SF Comments This material was not in poor condition. It was installed in 1987 when Gym was on to building. **Asbestos** Assumed Friable No **Original Inspection** 6/27/2011 **Current Inspection** 4/13/2017 **Material Assessment Assessment Rating** 5 ACBM with potential for damage **Damage Assessment and Potential for Damage** Percent Damaged % **Good Condition Physical Contact Vibration** <u>Air</u> Low/None Low/None Low/None **Planned Response Action 0&M** Janie Attoin

State Indiana Accreditation Number 19A007179

Jamie Hosier

Inspector

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID B

HA Description Cove Base MoldignHA Type Miscellaneous Material

HA Location Throughout the building - Light Gray, Cafeteria and Gym

Quantity Approx. 3700 LF

Comments This material has minor scrapes, but was not in poor condition overall.

Asbestos Assumed

Friable No

Original Inspection 5/31/1996

Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector
Jamie Hosier

State Indiana

LEA Name Greater Clark County School Corporation Jonathan Jennings Elementary School **Building Name Building Number** 09 **HAID** С **HA Description Cove Base Castic HA Type** Miscellaneous Material Throughout building **HA Location** Quantity Approx. 1200 SF Comments The material was not visible to inspect. **Asbestos** Assumed **Friable** No **Original Inspection** 5/31/1996 **Current Inspection** 4/13/2017 **Material Assessment Assessment Rating** 5 ACBM with potential for damage **Damage Assessment and Potential for Damage Percent Damaged Good Condition Physical Contact** Vibration <u>Air</u> Low/None Low/None Low/None **Planned Response Action** 0&M Janie Attoin

Jamie Hosier

State Indiana

Accreditation Number 19A007179

Inspector

LEA Name Greater Clark County School Corporation Building Name Jonathan Jennings Elementary School **Building Number** 09 HA ID D **HA Description** Cloth expansion joints **HA Type** Miscellaneous Material Kitchen storage room **HA Location** Quantity 2 Unit(s) Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled. **Asbestos** Assumed Friable No Original Inspection 12/15/2011 **Current Inspection** 4/13/2017 **Material Assessment Assessment Rating** 5 ACBM with potential for damage **Damage Assessment and Potential for Damage Percent Damaged** % **Good Condition Physical Contact Vibration** <u>Air</u> Low/None Low/None Low/None **Planned Response Action** 0&M Janie AHoin Inspector

State Indiana

Jamie Hosier

LEA Name Greater Clark County School Corporation Building Name Jonathan Jennings Elementary School **Building Number** 09 **HAID** 02 **HA Description** 4"+ 2" fitting insulation **HA Type** Thermal System Insulation (TSI) Boiler room and throughout the building **HA Location** Quantity 156 LF Comments This material was not in poor condition overall. Kitchen storage stage ends and custodial closet by room A-1 have visible fittings; small amount of debris found in kitchen storage. Minor patch and repair needed. Material is also located in hallways above ceilings. There is no access to pipe chases. This material needs asbestos labels on all of the locations. **Asbestos** Known **Friable** Yes Original Inspection 6/1/1988 **Current Inspection** 11/3/2016 **Material Assessment** 5 ACBM with potential for damage **Assessment Rating Damage Assessment and Potential for Damage Percent Damaged** % **Good Condition Physical Contact** Vibration Air Low/None Low/None Low/None **Planned Response Action 0&M** Inspector

Dustin Hawkins

State IN Accreditation Number 19A007194

LEA Name Greater Clark County School Corporation Building Name Jonathan Jennings Elementary School **Building Number** 09 HA ID 05-A **HA Description** Floor tile - under carpet **HA Type** Miscellaneous Material Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under **HA Location** Carpet) SF Quantity 27000 Comments The material was under carpet therefore not visible to inspect. **Asbestos** Assumed **Friable** No Original Inspection 6/27/2011 **Current Inspection** 11/3/2016 **Material Assessment Assessment Rating** 5 ACBM with potential for damage **Damage Assessment and Potential for Damage Percent Damaged Good Condition Physical Contact** Vibration Air Low/None Low/None Low/None **Planned Response Action** 0&M Inspector

Dustin Hawkins

State IN

LEA Name Greater Clark County School Corporation Jonathan Jennings Elementary School **Building Name Building Number** 09 HA ID 05-B **HA Description** Floor tile- Green 12" X 12" **HA Type** Miscellaneous Material Principals office and Breezeway **HA Location** Unquantified Quantity SF Comments This material was not in poor condition. **Asbestos** Known **Friable** No **Original Inspection** 6/1/1988 **Current Inspection** 11/3/2016 **Material Assessment Assessment Rating** 5 ACBM with potential for damage **Damage Assessment and Potential for Damage Percent Damaged Good Condition Physical Contact** Vibration Air Low/None Low/None Low/None **Planned Response Action** 0&M Inspector **Dustin Hawkins**

State IN

LEA Name Greater Clark County School Corporation Jonathan Jennings Elementary School **Building Name Building Number** 09 **HAID** Α **HA Description** Floor Tile Mastic **HA Type** Miscellaneous Material Throughout building **HA Location** Quantity 27000 SF Comments This material was not in poor condition. It was installed in 1987 when Gym was on to building. **Asbestos** Assumed **Friable** No Original Inspection 6/27/2011 **Current Inspection** 11/3/2016 **Material Assessment Assessment Rating** 5 ACBM with potential for damage **Damage Assessment and Potential for Damage Percent Damaged** % **Good Condition Physical Contact Vibration** <u>Air</u> Low/None Low/None Low/None **Planned Response Action 0&M** Inspector **Dustin Hawkins**

State IN

LEA Name Greater Clark County School Corporation Building Name Jonathan Jennings Elementary School **Building Number** 09 **HAID** В **HA Description Cove Base Molding HA Type** Miscellaneous Material Throughout the building - Light Gray, Cafeteria and Gym **HA Location** LF Quantity Approx. 0 Comments During the November 2016 inspection they inspector noticed that this material had been removed per the facility respresentitive, during the 2016 summer renovations. **Asbestos** Assumed **Friable** No Original Inspection 5/31/1996 **Current Inspection** 11/3/2016 **Material Assessment Assessment Rating** 5 ACBM with potential for damage **Damage Assessment and Potential for Damage Percent Damaged** % **Good Condition Physical Contact Vibration** <u>Air</u> Low/None Low/None Low/None **Planned Response Action** Removed Inspector **Dustin Hawkins**

State IN

LEA Name	Greater Clark County School Corporation			
Building Name	Jonathan Jennings Elementary School			
Building Number	09			
HA ID	С			
HA Description	Cove Base Mastic			
НА Туре	Miscellaneous Material			
HA Location	Throughout building			
Quantity	0	SF		
Comments	_	•	inspector noticed that this matentitive, during the 2016 summe	
Asbestos	Assumed			
Friable	No			
Original Inspection	5/31/1996			
Current Inspection	11/3/2016			
Material Assessment				
Assessment Rating 5 ACBM with potential for damage				
Damage Assessment and Potential for Damage				
Percent Damag	<u>ed</u> %	Good Condition		
<u>Phy</u>	sical Contact	<u>Vibration</u>	<u>Air</u>	
l	₋ow/None	Low/None	Low/None	
Planned Response Action Removed				
D-AA-C				
Inspector				
Dustin Hawkins				

State IN

LEA Name Greater Clark County School Corporation Jonathan Jennings Elementary School **Building Name Building Number** 09 **HAID** D **HA Description** Cloth expansion joints **HA Type** Miscellaneous Material Kitchen storage room **HA Location** Quantity 2 Unit(s) Comments This material was not assessed in the original inspection and will be added to management plan until properly sampled. **Asbestos** Assumed **Friable** No Original Inspection 12/15/2011 **Current Inspection** 11/3/2016 **Material Assessment Assessment Rating** 5 ACBM with potential for damage **Damage Assessment and Potential for Damage Percent Damaged** % **Good Condition Physical Contact Vibration** <u>Air</u> Low/None Low/None Low/None **Planned Response Action 0&M** Inspector **Dustin Hawkins**

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 02

HA Description 4"+ 2" fitting insulation

HA Type Thermal System Insulation (TSI)

HA Location Boiler room and throughout the building

Quantity 156 LF

Comments This material was not in poor condition overall. Kitchen storage stage ends and

custodial closet by room A-1 have visible fittings; small amount of debris found in kitchen storage. Minor patch and repair needed. Material is also located in

hallways

above ceilings. There is no access to pipe chases. This material needs asbestos

labels on all of the locations.

Asbestos Known

Friable Yes

Original Inspection 6/1/1988

Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN Accreditation Number 19A001039

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 05-A

HA Type Floor tile - under carpet

Miscellaneous Material

HA Location Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under

Carpet)

Quantity 27000 SF

Comments The material was under carpet therefore not visible to inspect.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 05-B

HA Type Floor tile- Green 12" X 12"

HA Type Miscellaneous Material

HA Location Principals office and Breezeway

Quantity Unquantified SF

Comments This material was not in poor condition.

Asbestos Known

Friable No

Original Inspection 6/1/1988

Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID A

HA Description Floor Tile Mastic

HA Type Miscellaneous Material
HA Location Throughout building

Quantity 27000 SF

Comments This material was not in poor condition. It was installed in 1987 when Gym was

added

on to building.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID B

HA Description Cove Base Moldign

HA Type Miscellaneous Material

HA Location Throughout the building - Light Gray, Cafeteria and Gym

Quantity Approx. 3700 LF

Comments This material has minor scrapes, but was not in poor condition overall.

Asbestos Assumed

Friable No

Original Inspection 5/31/1996

Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID C

HA Description Cove Base Castic

HA Type Miscellaneous Material

HA Location Throughout building

Quantity Approx. 1200 SF

Comments The material was not visible to inspect.

Asbestos Assumed

Friable No

Original Inspection 5/31/1996

Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID D

HA Description Cloth expansion jointsHA Type Miscellaneous MaterialHA Location Kitchen storage room

Quantity 2 Unit(s)

Comments This material was not assessed in the original inspection and will be added to

the

management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 12/15/2011

Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 02

Type of Material Thermal Material

Quantity of Material 156 LF

Material Location

Boiler room and throughout the building

Material Description

4"+ 2" fitting insulation

Comments

This material was not in poor condition overall. Kitchen storage stage ends and custodial closet by room A-1 have visible fittings. Material is also located in hallways above ceilings. There is no access to pipe chases. This material needs asbestos labels on all of the locations.

Does Material Contain Asbestos? Yes
Is it Friable? No

Original Inspection Date 6/1/1988

Current Surveillance Date 4/22/2015

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes
Potential for Damage Low
Removed No

Planned Response Action O & M

Inspector _____

Benjamin S. Hood

State Indiana

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 05-A

Type of Material Miscellaneous Material

Quantity of Material 27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under

Carpet)

Material Description

Floor tile - under carpet

Comments

The material was under carpet therefore not visible to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 6/27/2011

Current Surveillance Date 4/22/2015

Current Assessment Rating NA Not Applicable

Cause of Damage No Damage

Accessible No
Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

Benjamin S. Hood

State Indiana

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 05-B

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Principals office and Breezeway

Material Description

Floor tile- Green 12" X 12"

Comments

This material was not in poor condition.

Does Material Contain Asbestos? Yes
Is it Friable? No

Original Inspection Date 6/1/1988

Current Surveillance Date 4/22/2015

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible No
Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector Benjamin S. Hood

State Indiana

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 05-C

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Gym Floor

Material Description

12"X 12" White Floor tile

Comments

This material was not in poor condition. It was installed in 1987 when Gym was added on to building.

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 6/27/2011

Current Surveillance Date 4/22/2015

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes
Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector _____

Benjamin S. Hood

State Indiana

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# A

Type of Material Miscellaneous Material

Quantity of Material 27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

Inspector

No mastic was exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 6/1/1988

Current Surveillance Date 4/22/2015

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible No Potential for Damage Low

Removed No

Planned Response Action O & M

Benjamin S. Hood

State Indiana

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# B

Type of Material Miscellaneous Material

Quantity of Material Approx. 3,700 LF

Material Location

Throughout the building - Light Gray, Cafeteria and Gym

Material Description

Cove base molding

Comments

Inspector

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 5/31/1996
Current Surveillance Date 4/22/2015

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes
Potential for Damage Low

Removed No

Planned Response Action O & M

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# C

Type of Material Miscellaneous Material

Quantity of Material Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

Inspector

The material was not visible to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 5/31/1996
Current Surveillance Date 4/22/2015

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible No Potential for Damage Low

Removed No

Planned Response Action O & M

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# D

Type of Material Miscellaneous Material

Quantity of Material 2 Each

Material Location

Kitchen storage room

Material Description

Cloth expansion joints

Comments

Inspector

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 12/15/2011

Current Surveillance Date 4/22/2015

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes
Potential for Damage Low
Removed No

Planned Response Action O & M

Benjamin S. Hood

State Indiana

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 02

Type of Material Thermal Material

Quantity of Material 156 LF

Material Location

Boiler room and throughout the building

Material Description

4"+ 2" fitting insulation

Comments

This material was not in poor condition overall. Kitchen storage stage ends and custodial closet by room A-1 have visible fittings. Material is also located in hallways above ceilings. There is no access to pipe chases. This material needs asbestos labels on all of the locations.

Does Material Contain Asbestos?YesIs it Friable?No

Original Inspection Date 6/1/1988

Current Surveillance Date 10/22/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No.

Planned Response Action O & M

Inspector

Benjamin S. Hood

State Indiana

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 05-A

Type of Material Miscellaneous Material

Quantity of Material 27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under

Carpet)

Material Description

Floor tile - under carpet

Comments

The material was under carpet therefore not visible to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 6/27/2011

Current Surveillance Date 10/22/2014

Current Assessment Rating NA Not Applicable

Cause of Damage No Damage

Accessible No
Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector Benjamin S. Hood

State Indiana

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 05-B

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Principals office and Breezeway

Material Description

Floor tile- Green 12" X 12"

Comments

This material was not in poor condition.

Does Material Contain Asbestos? Yes
Is it Friable? No

Original Inspection Date 6/1/1988

Current Surveillance Date 10/22/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible No Potential for Damage Low

Removed No.

Planned Response Action O & M

Inspector Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

Greater Clark County Schools LEA Name Building Name Jonathan Jennings Elementary HA# 05-C Type of Material Miscellaneous Material **Quantity of Material** Unquantified SF **Material Location** Gym Floor **Material Description** 12"X 12" White Floor tile Comments This material was not in poor condition. It was installed in 1987 when Gym was added on to building. **Does Material Contain Asbestos?** Assumed Is it Friable? No 6/27/2011 **Original Inspection Date Current Surveillance Date** 10/22/2014 NR Not Rated **Current Assessment Rating Cause of Damage** No Damage **Accessible** Yes **Potential for Damage** Low Removed No

Inspector _____

O & M

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

Planned Response Action

Greater Clark County Schools LEA Name Building Name Jonathan Jennings Elementary HA# Α Type of Material Miscellaneous Material **Quantity of Material** 27,000 SF **Material Location** Throughout the building **Material Description** Floor tile mastic Comments No mastic was exposed to inspect. **Does Material Contain Asbestos?** Assumed No Is it Friable? 6/1/1988 **Original Inspection Date Current Surveillance Date** 10/22/2014 NR Not Rated **Current Assessment Rating Cause of Damage** No Damage No Accessible **Potential for Damage** Low

No

O & M

Inspector

Removed

Planned Response Action

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

Greater Clark County Schools LEA Name Building Name Jonathan Jennings Elementary HA# В

Type of Material Miscellaneous Material

Quantity of Material Approx. 3,700 LF

Material Location

Throughout the building - Light Gray, Cafeteria and Gym

Material Description

Cove base molding

Comments

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

5/31/1996 **Original Inspection Date Current Surveillance Date** 10/22/2014

NR Not Rated **Current Assessment Rating**

Cause of Damage No Damage

Yes Accessible

Potential for Damage Low

No Removed

O & M **Planned Response Action**

Inspector Benjamin S. Hood

Indiana State

19A001039 **Accreditation Number**

LEA Name
Greater Clark County Schools
Building Name
Jonathan Jennings Elementary
C
Type of Material
Miscellaneous Material

Type of Material Miscellaneous Materia

Quantity of Material Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 5/31/1996

Current Surveillance Date 10/22/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible No Potential for Damage Low

Removed No.

Planned Response Action O & M

Inspector Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# D

Type of Material Miscellaneous Material

Quantity of Material 2 Each

Material Location

Kitchen storage room

Material Description

Cloth expansion joints

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 12/15/2011

Current Surveillance Date 10/22/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes
Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector _____

Benjamin S. Hood

State Indiana

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 02

Type of Material Thermal Material

Quantity of Material 156 LF

Material Location

Boiler room and throughout the building

Material Description

4"+ 2" fitting insulation

Comments

This material was not in poor condition overall. Kitchen storage stage ends and custodial closet by room A-1 have visible fittings. Material is also located in hallways above ceilings. There is no access to pipe chases. This material needs asbestos labels on all of the locations.

Does Material Contain Asbestos? Yes
Is it Friable? No

Original Inspection Date 6/1/1988

Current Surveillance Date 4/21/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

Jeffrey P. Rechtin

State Indiana
Accreditation Number 19A003594

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 05-A

Type of Material Miscellaneous Material

Quantity of Material 27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under

Carpet)

Material Description

Floor tile - under carpet

Comments

The material was under carpet therefore not visible to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 6/27/2011

Current Surveillance Date 4/21/2014

Current Assessment Rating NA Not Applicable

Cause of Damage No Damage

Accessible No
Potential for Damage Low
Removed No

Planned Response Action O & M

Inspector

Jeffrey P. Rechtin

State Indiana

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 05-B

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Principals office and Breezeway

Material Description

Floor tile- Green 12" X 12"

Comments

This material was not in poor condition.

Does Material Contain Asbestos? Yes
Is it Friable? No

Original Inspection Date 6/1/1988

Current Surveillance Date 4/21/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector _______ Jeffrey P. Rechtin

State Indiana
Accreditation Number 19A003594

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 05-C

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Gym Floor

Material Description

12"X 12" White Floor tile

Comments

This material was not in poor condition. It was installed in 1987 when Gym was added on to building.

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 6/27/2011

Current Surveillance Date 4/21/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes
Potential for Damage Low
Removed No

Planned Response Action O & M

Inspector

Jeffrey P. Rechtin

State Indiana

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# A

Type of Material Miscellaneous Material

Quantity of Material 27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

Inspector

No mastic was exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 6/1/1988

Current Surveillance Date 4/21/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible No
Potential for Damage Low
Removed No

Planned Response Action O & M

Jeffrey P. Rechtin

State Indiana

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# B

Type of Material Miscellaneous Material

Quantity of Material Approx. 3,700 LF

Material Location

Throughout the building - Light Gray, Cafeteria and Gym

Material Description

Cove base molding

Comments

Inspector

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 5/31/1996
Current Surveillance Date 4/21/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Jeffrey P. Rechtin

State Indiana

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# C

Type of Material Miscellaneous Material

Quantity of Material Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

Inspector

The material was not visible to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 5/31/1996
Current Surveillance Date 4/21/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Jeffrey P. Rechtin

State Indiana
Accreditation Number 19A003594

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# D

Type of Material Miscellaneous Material

Quantity of Material 2 Each

Material Location

Kitchen storage room

Material Description

Cloth expansion joints

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 12/15/2011

Current Surveillance Date 4/21/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes
Potential for Damage Low
Removed No

Planned Response Action O & M

Inspector

Jeffrey P. Rechtin

State Indiana

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05-A

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under

Carpet)

Material Description

Floor tile - under carpet

Comments

The material was under carpet therefore not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/27/2011

Current Surveillance Date

10/24/2013

Current Assessment Rating

NA

Not Applicable

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05-B

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified SF

Material Location

Principals office and Breezeway

Material Description

Floor tile- Green 12" X 12"

Comments

This material was not in poor condition.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

10/24/2013

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05-C

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified SF

Material Location

Gym Floor

Material Description

12"X 12" White Floor tile

Comments

This material was not in poor condition. It was installed in 1987 when Gym was added on to building.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/27/2011

Current Surveillance Date

10/24/2013

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

10/24/2013

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building - Light Gray, Cafeteria and Gym

Material Description

Cove base molding

Comments

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

10/24/2013

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

Italiovea

No

Planned Response Action

0 & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

С

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

10/24/2013

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

D

Type of Material

Miscellaneous Material

Quantity of Material

2 Each

Material Location

Kitchen storage room

Material Description

Cloth expansion joints

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

12/15/2011

Current Surveillance Date

10/24/2013

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4"+ 2" fitting insulation

Comments

This material was not in poor condition overall. Kitchen storage stage ends and custodial closet by room A-1 have visible fittings. Material is also located in hallways above ceilings. There is no access to pipe chases.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

10/24/2012

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05-A

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under

Carpet)

Material Description

Floor tile - under carpet

Comments

The material was under carpet therefore not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/27/2011

Current Surveillance Date

10/24/2012

Current Assessment Rating

NA

Not Applicable

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05-B

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified SF

Material Location

Principals office and Breezeway

Material Description

Floor tile- Green 12" X 12"

Comments

This material was not in poor condition.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

10/24/2012

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05-C

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified SF

Material Location

Gym Floor

Material Description

12"X 12" White Floor tile

Comments

This material was not in poor condition. It was installed in 1987 when Gym was added on to building.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/27/2011

Current Surveillance Date

10/24/2012

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

10/24/2012

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building - Light Gray, Cafeteria and Gym

Material Description

Cove base molding

Comments

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

10/24/2012

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

10/24/2012

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

D

Type of Material

Miscellaneous Material

Quantity of Material

2 Each

Material Location

Kitchen storage room

Material Description

Cloth expansion joints

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

12/15/2011

Current Surveillance Date

10/24/2012

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4"+ 2" fitting insulation

Comments

This material was not in poor condition overall. Kitchen storage stage ends and custodial closet by room A-1 have visible fittings. Material is also located in hallways above ceilings. There is no access to pipe chases.

Does Material Contain Asbestos?

Yes

is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

6/25/2012

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffery P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05-A

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under

Carpet)

Material Description

Floor tile - under carpet

Comments

The material was under carpet therefore not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/27/2011

Current Surveillance Date

6/25/2012

Current Assessment Rating

NA

Not Applicable

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffen P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05-B

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified SF

Material Location

Principals office and Breezeway

Material Description

Floor tile- Green 12" X 12"

Comments

This material was not in poor condition.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

6/25/2012

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffery # Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05-C

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified SF

Material Location

Gym Floor

Material Description

12"X 12" White Floor tile

Comments

This material was not in poor condition. It was installed in 1987 when Gym was added on to building.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/27/2011

Current Surveillance Date

6/25/2012

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

leffery B. Rech

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

6/25/2012

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

effery P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building - Light Gray, Cafeteria and Gym

Material Description

Cove base molding

Comments

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

6/25/2012

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Jeffery P. Rechtir

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

6/25/2012

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffery P. Rechtim

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

D

Type of Material

Miscellaneous Material

Quantity of Material

2 Each

Material Location

Kitchen storage room

Material Description

Cloth expansion joints

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Aspestos?

Assumed

Is it Friable?

No

Original Inspection Date

12/15/2011

Current Surveillance Date

6/25/2012

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffery P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Type of Material

Miscellaneous Material

Quantity of Material

2 Each

Material Location

Kitchen storage room

Material Description

Cloth expansion joints

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

12/15/2011

Current Surveillance Date

12/15/2011

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Sandra Shadlev

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4"+ 2" fitting insulation

Comments

This material was not in poor condition overall. Kitchen storage stage ends and custodial closet by room A-1 have visible fittings. Material is also located in hallways above ceilings. There is no access to pipe chases.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/15/2011

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Sandra Shadley

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05-A

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under

Carpet)

Material Description

Floor tile - under carpet

Comments

The material was under carpet therefore not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/27/2011

Current Surveillance Date

12/15/2011

Current Assessment Rating

NA

Not Applicable

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Sandra Shadley

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05-B

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified SF

Material Location

Principals office and Breezeway

Material Description

Floor tile- Green 12" X 12"

Comments

This material was not in poor condition.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/15/2011

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Sandra Shadlev

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05-C

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified SF

Material Location

Gym Floor

Material Description

12"X 12" White Floor tile

Comments

This material was not in poor condition. It was installed in 1987 when Gym was added on to building.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/27/2011

Current Surveillance Date

12/15/2011

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Sandra Shadley

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/15/2011

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O&M

Inspector

Sandra Shadley

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building - Light Gray(Cafeteria and Gym)

Material Description

Cove base molding

Comments

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

12/15/2011

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Sandra Shadley

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

12/15/2011

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Sandra Shadley

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4"+ 2" fitting insulation

Comments

This material was not in poor condition overall. Kitchen storage and stage ends have visible fittings. Material is also located in hallways above ceilings. There is no access to pipe chases.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

6/27/2011

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Sandra Shadlov

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05-A

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under

Carpet)

Material Description

Floor tile - under carpet

Comments

Inspector chose to separate HA 05 into three different HA's during the June 2011 6 month surveillance. The material was under carpet therefore not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/27/2011

Current Surveillance Date

6/27/2011

Current Assessment Rating

NA

Not Applicable

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Sandra Shadley

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05-B

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified SF

Material Location

Nurses station/ Principals office and Breezeway

Material Description

Floor tile- Green 12" X 12"

Comments

This material was not in poor condition.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

6/27/2011

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Sandra Shadley

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05-C

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified SF

Material Location

Gym Floor

Material Description

12"X 12" White Floor tile

Comments

This material was not in poor condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/27/2011

Current Surveillance Date

6/27/2011

Current Assessment Rating

NA

Not Applicable

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Sandra Shadley

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

6/27/2011

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Sandra Shadlev

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

6/27/2011

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Sandra Shadley

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

6/27/2011

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Sandra Shadley

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4"+ 2" fitting insulation

Comments

This material was not in poor condition overall. Kitchen storage and stage ends have visible fittings. Material is also located in hallways above ceilings. There is no access to pipe chases.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/6/2010

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Paul W. Krick

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under

Carpet)

Material Description

Floor tile

Comments

This material was under carpet therefore not visible to inspect.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/6/2010

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Paul W. Krick

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/6/2010

Current Assessment Rating

NR

No Damage

Cause of Damage

No

Potential for Damage

Low

Removed

Accessible

No

Planned Response Action

O & M

Inspector

Paul W. Krick

Not Required

State

Índiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

12/6/2010

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Paul W. Krick

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

12/6/2010

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Potential for Damage

No Low

Accessible

L011

Removed

No

Planned Response Action

O & M

Inspector

Paul W. Krick

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

ilding Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

This material was not in poor condition overall. Kitchen and stage have visible fittings.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/3/2009

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

otential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

ilding Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under

Carpet)

Material Description

Floor tile

Comments

This material was not visible to inspect.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/3/2009

Current Assessment Rating

NR

Cause of Damage

No Damage

ccessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Seorge William Ogle

Not Required

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

ilding Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/3/2009

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage No

Accessible

otential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

ilding Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

12/3/2009

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

otential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

ilding Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

12/3/2009

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

otential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

3uilding Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

This material was not in poor condition overall. Kitchen and stage have visible fittings.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

6/11/2009

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

otential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

George William Ogle

State

IN

Accreditation Number

LEA Name

Greater Clark County Schools

uilding Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under

Carpet)

Material Description

Floor tile

Comments

This material was not visible to inspect.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

6/11/2009

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

eorge William Øgle

State

IN

Accreditation Number

LEA Name

Greater Clark County Schools

uilding Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

6/11/2009

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

otential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

George William Ogle

State

IN

Accreditation Number

LEA Name

Greater Clark County Schools

uilding Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

6/11/2009

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

?otential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

dear Milliam O

State

IN

Accreditation Number

LEA Name

Greater Clark County Schools

uilding Name

Jonathan Jennings Elementary

HA#

С

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

is it Friable?

Nο

Original Inspection Date

5/31/1996

Current Surveillance Date

6/11/2009

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

otential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

State

IN

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

This material was not in poor condition overall. Kitchen and stage have visible fittings.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/10/2008

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under

Carpet)

Material Description

Floor tile

Comments

This material was not visible to inspect.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/10/2008

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

eorge William Ó

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/10/2008

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

12/10/2008

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

12/10/2008

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O&M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

This material was not in poor condition overall. Kitchen and stage have visible fittings.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

6/30/2008

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under

Carpet)

Material Description

Floor tile

Comments

This material was not visible to inspect.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

6/30/2008

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

Nο

Original Inspection Date

6/1/1988

Current Surveillance Date

6/30/2008

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

George William Øgle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

6/30/2008

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

Νo

Planned Response Action

0 & M

Inspector

George William Øgle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

6/30/2008

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

George/William

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

This material was not in poor condition overall. Kitchen and stage have visible fittings.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/7/2007

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under

Carpet)

Material Description

Floor tile

Comments

This material was not visible to inspect.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/7/2007

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/7/2007

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

12/6/2007

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

С

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

12/7/2007

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

This material was not in poor condition overall.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/19/2006

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Seorge William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under

Carpet)

Material Description

Floor tile

Comments

This material was not visible to inspect.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/19/2006

No Damage

Current Assessment Rating

NR

Not Required

Cause of Damage

No

Accessible

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

∕George William Øgle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/19/2006

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

d William (

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Арргох. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

12/19/2006

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

С

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

12/19/2006

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

This material was not in poor condition overall.

Does Material Contain Asbestos?

Yes

is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

6/28/2006

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Ohristopher Ames

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under

Carpet)

Material Description

Floor tile

Comments

This material was not visible to inspect.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

6/28/2006

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Christopher Ames

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?

Assumed

ls it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

6/28/2006

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

hristopher Ames

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

6/28/2006

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Christopher Ames

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

6/28/2006

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Christopher Ame:

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

This material was not in poor condition overall.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

1/24/2006

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

Nο

Planned Response Action

O & M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center (under carpet) and office

areas

Material Description

Floor tile

Comments

This material was not in poor condition overall.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

1/24/2006

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

eorge William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

1/24/2006

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

1/24/2006

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

eorge Milliam Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

1/24/2006

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M


Inspector

ebrge William Ogle

State

Indiana

Accreditation Number

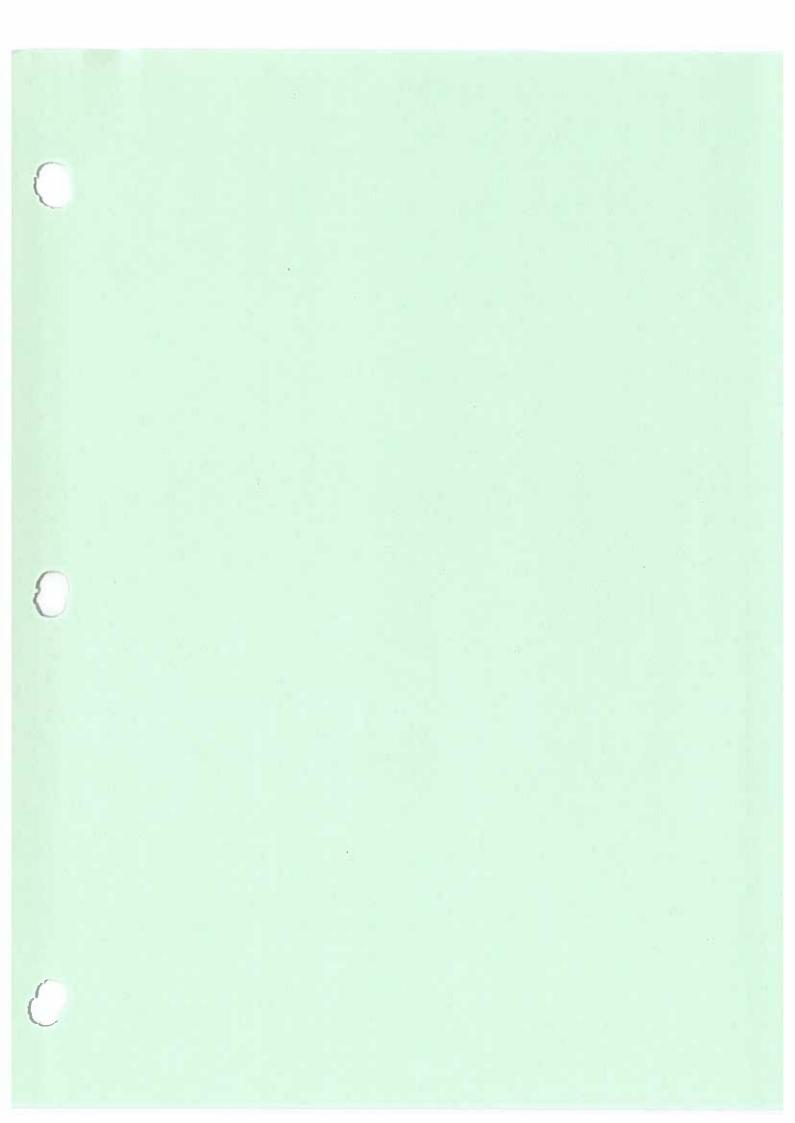

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 02

Type of Material Thermal Material

Quantity of Material 156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

Inspector

This material was not in poor condition overall.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1988

Current Surveillance Date 7/18/2005

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes
Potential for Damage Low
Removed No

Planned Response Action O & M

State Indiana

Accreditation Number 191523030

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center and office areas

Material Description

Floor tile

Comments

This material was not in poor condition overall.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

7/18/2005

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

7/18/2005

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

George/William C

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material had minor scraping present, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

7/18/2005

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

7/18/2005

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action


0 & M

Inspector

State

Indiana

Accreditation Number

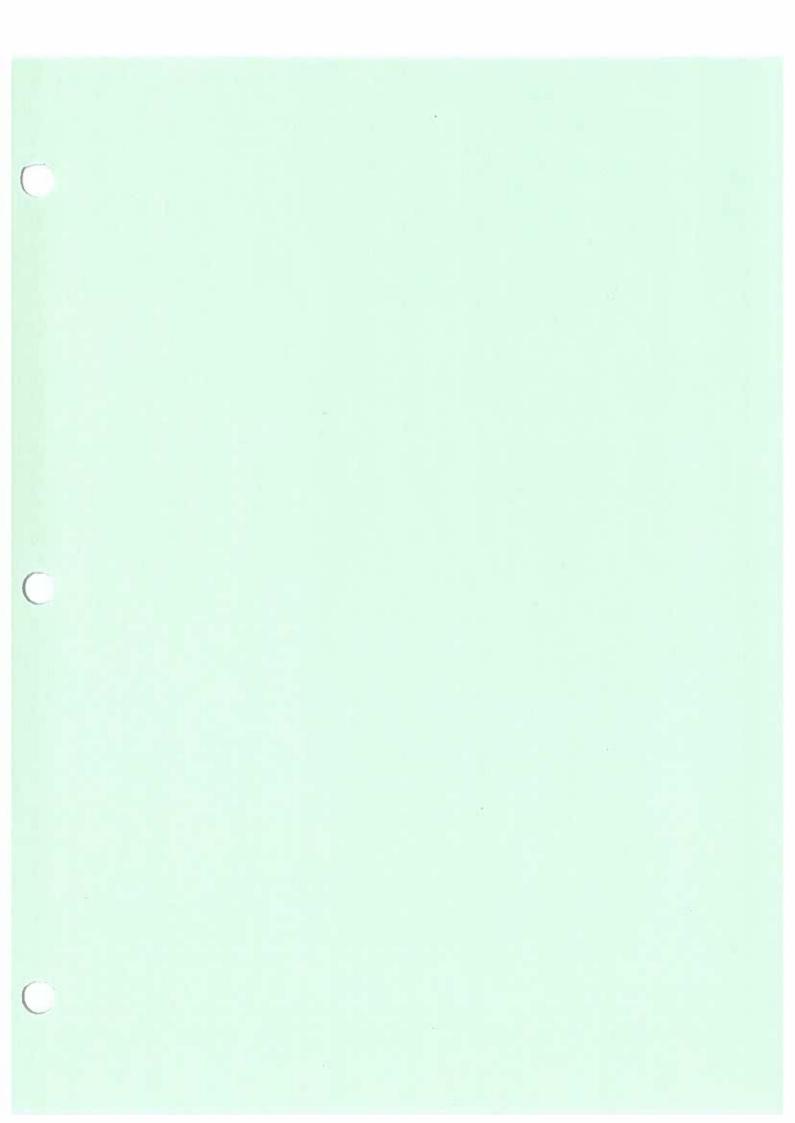

Greater Clark County Schools LEA Name

Building Name Jonathan Jennings Elementary

HA# 02

Type of Material Thermal Material

Quantity of Material 156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

This material was not in poor condition overall.

Does Material Contain Asbestos? Yes Is it Friable? No

Original Inspection Date 6/1/1988 **Current Surveillance Date** 12/8/2004

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes Potential for Damage Low No Removed

Planned Response Action 0 & M

Inspector Christiaan Sparks

State Indiana

190804103 **Accreditation Number**

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, storeroom, Media Center and office areas

Material Description

Floor tile

Comments

12" X 12" and 9" X 9" tile are visible in the Media Center. There were minor chips and

cracks throughout. This material was not in poor condition overall.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/8/2004

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Δ

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

Where exposed, this material was not in poor condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Surveillance Date

12/8/2004

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material had minor scraping present, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

12/8/2004

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Surveillance Date

12/8/2004

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

Νo

Planned Response Action

0 & M


Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

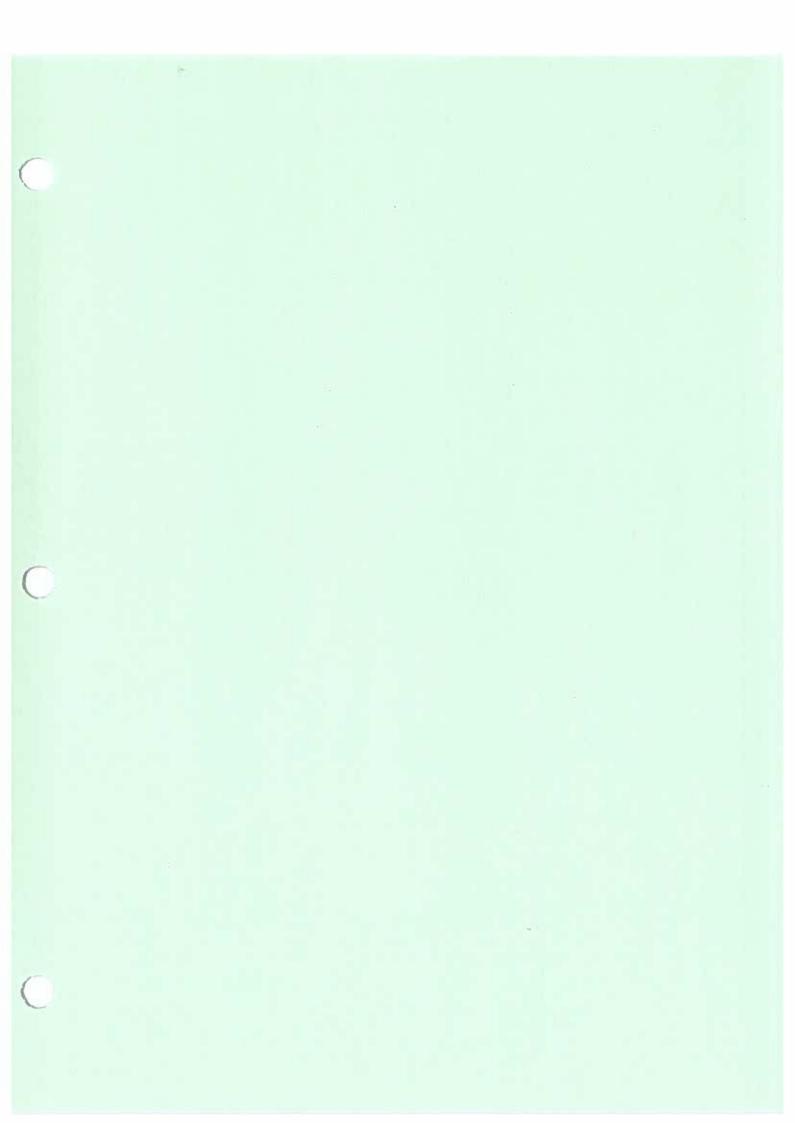

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 05

Type of Material Miscellaneous Material

Quantity of Material 27,000 SF

Material Location

Classrooms, storeroom, Media Center and office areas

Material Description

Floor tile

Comments

12" X 12" and 9" X 9" tile are visible in the Media Center. There were minor chips and cracks throughout. This material was not in poor condition overall.

Does Material Contain Asbestos? Yes

Is it Friable?

Original Inspection Date 6/1/1988

Current Reinspection Date 6/28/2004

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No
Potential for Damage Low
Removed No

Planned Response Action 0 & M

Inspector Christian Sparks

State Indiana

Accreditation Number 190804103

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

Where exposed, this material was not in poor condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Reinspection Date

6/28/2004

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material had minor scraping present, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Reinspection Date

6/28/2004

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Reinspection Date

6/28/2004

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M


Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

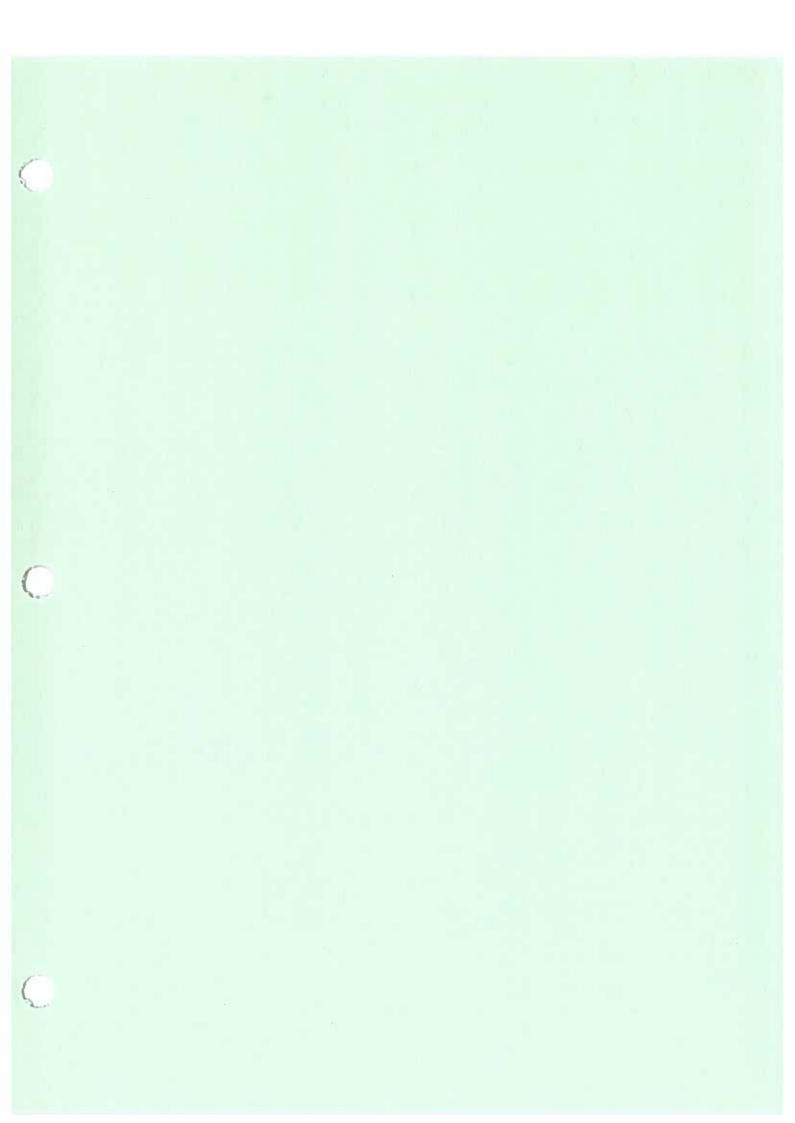

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 02

Type of Material Thermal Material

Quantity of Material 156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

This material was not in poor condition overall.

Does Material Contain Asbestos? Yes

Is it Friable?

Original Inspection Date 06/01/1988

Current Surveillance Date 12/08/2003

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes
Potential for Damage Low
Removed No

Planned Response Action 0 & M

Inspector Christiaan Sparks

State Indiana

Accreditation Number 190804103

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, storeroom, and office areas

Material Description

Floor tile

Comments

All areas have been covered with carpet and are not visible to inspect.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

12/08/2003

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

12/08/2003

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material had minor scraping present, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Surveillance Date

12/08/2003

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Surveillance Date

12/08/2003

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

No

Potential for Damage

Low

Removed

Accessible

No

Planned Response Action

O & M


Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

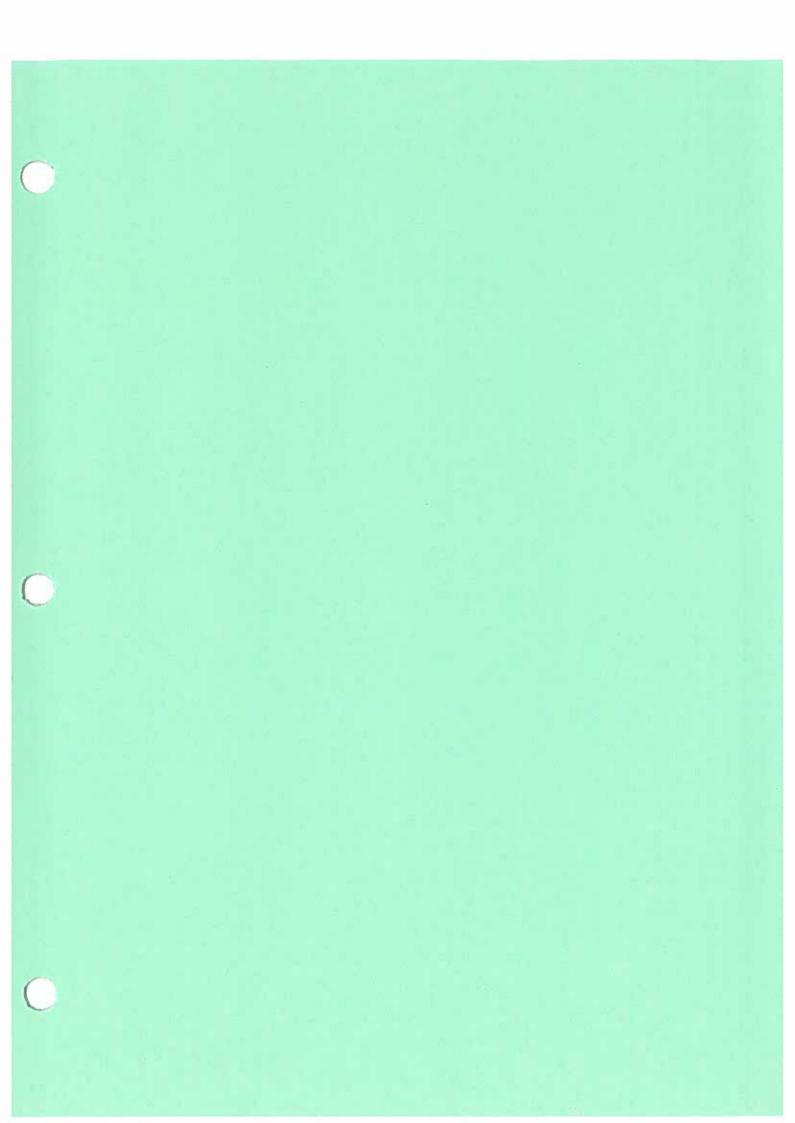

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 02

Type of Material Thermal Material

Quantity of Material 156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

Removed

This material was not in poor condition overall.

Does Material Contain Asbestos? Yes

Is it Friable?

Original Inspection Date 06/01/1988

Current Surveillance Date 06/13/2003

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Planned Response Action 0 & M

Inspector Christiaan Sparks

No

State Indiana

Accreditation Number 190804103

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, storeroom, and office areas

Material Description

Floor tile

Comments

All areas have been covered with carpet and are not visible to inspect.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

06/13/2003

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

06/13/2003

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material had minor scraping present, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Surveillance Date

06/13/2003

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The small section of wall base carpet between B4 and B5 has been repaired. The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Surveillance Date

06/13/2003

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M


Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

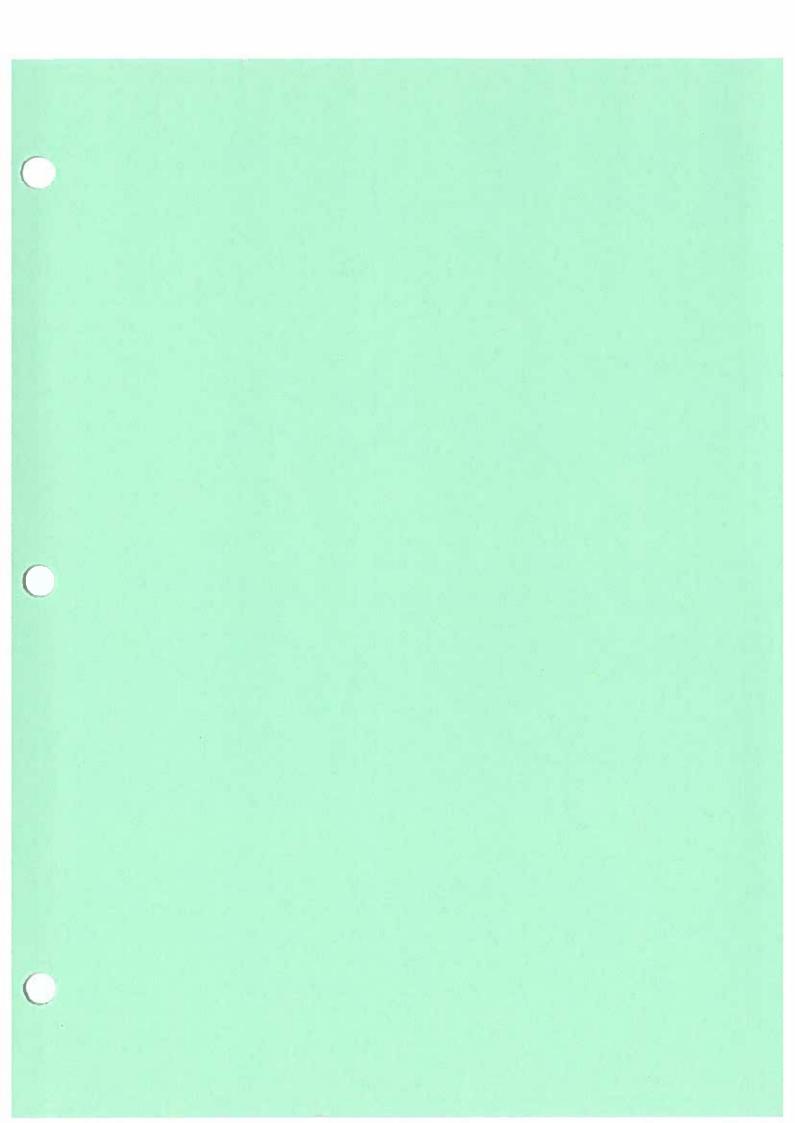

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

This material was not in poor condition overall.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

12/18/2002

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, storeroom, and office areas

Material Description

Floor tile

Comments

All areas have been covered with carpet and are not visible to inspect.

Does Material Contain Asbestos?

Vac

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

12/18/2002

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

12/18/2002

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

B

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material had minor scraping present, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Surveillance Date

12/18/2002

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

A small section of wall base carpet has pulled away between B4 and B5 exposing old cove base mastic which is not in poor condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Surveillance Date

12/18/2002

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M


Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

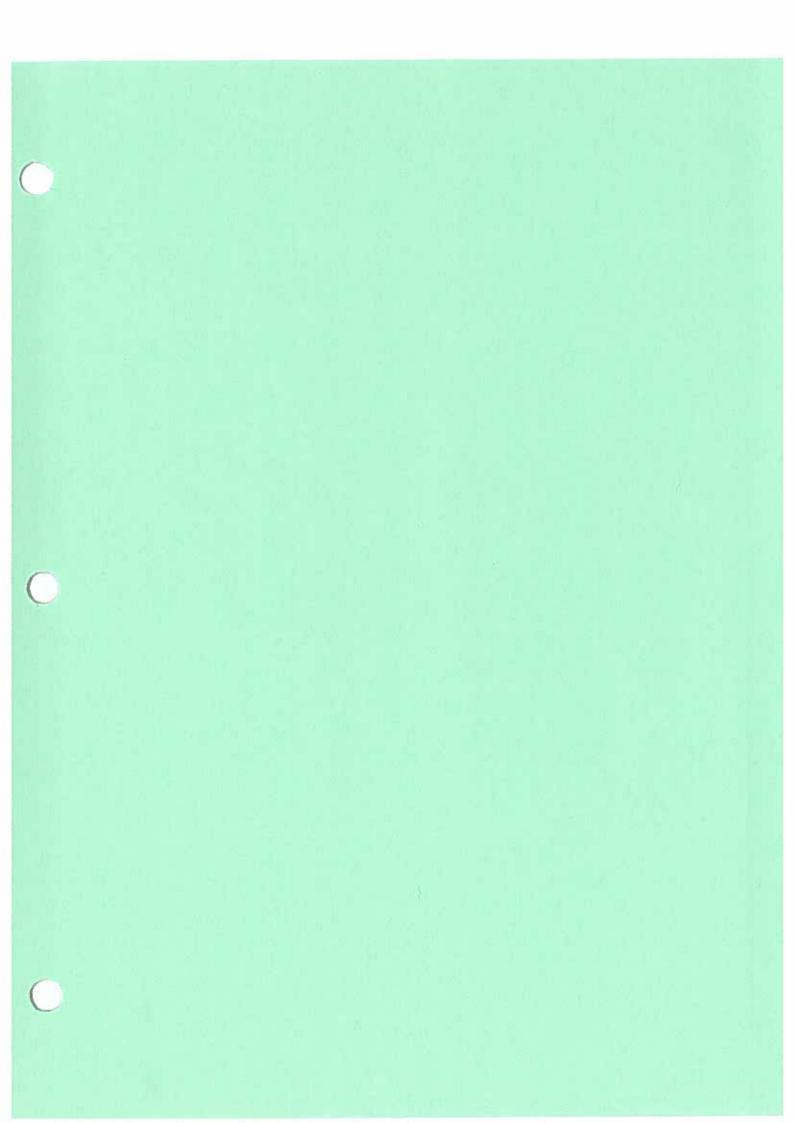

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

Repair work has been done in the boiler room. However, more O & M is needed. Material is not in poor condition overall.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

06/19/2002

Current Assessment Rating

NR

Not Required

Cause of Damage

Deterioration & Age

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Richard D. Calvert

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, storeroom, and office areas

Material Description

Floor tile

Comments

Floor tile is not in poor condition with minor chipping and cracking throughout.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

06/19/2002

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

...

0 & M

Inspector

Richard D. Calvert

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

Material was not exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

06/19/2002

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Richard D. Calvert

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

Material is not in poor condition with minor scraping observed in kitchen area.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Surveillance Date

06/19/2002

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Richard D. Calvert

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

Small section of wall base carpet has pulled away between B4 and B5 exposing old cove base mastic which is not in poor condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Surveillance Date

06/19/2002

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Planned Response Action

Low

O & M

Removed

No


Inspector

Richard D. Calvert

State

Indiana

Accreditation Number

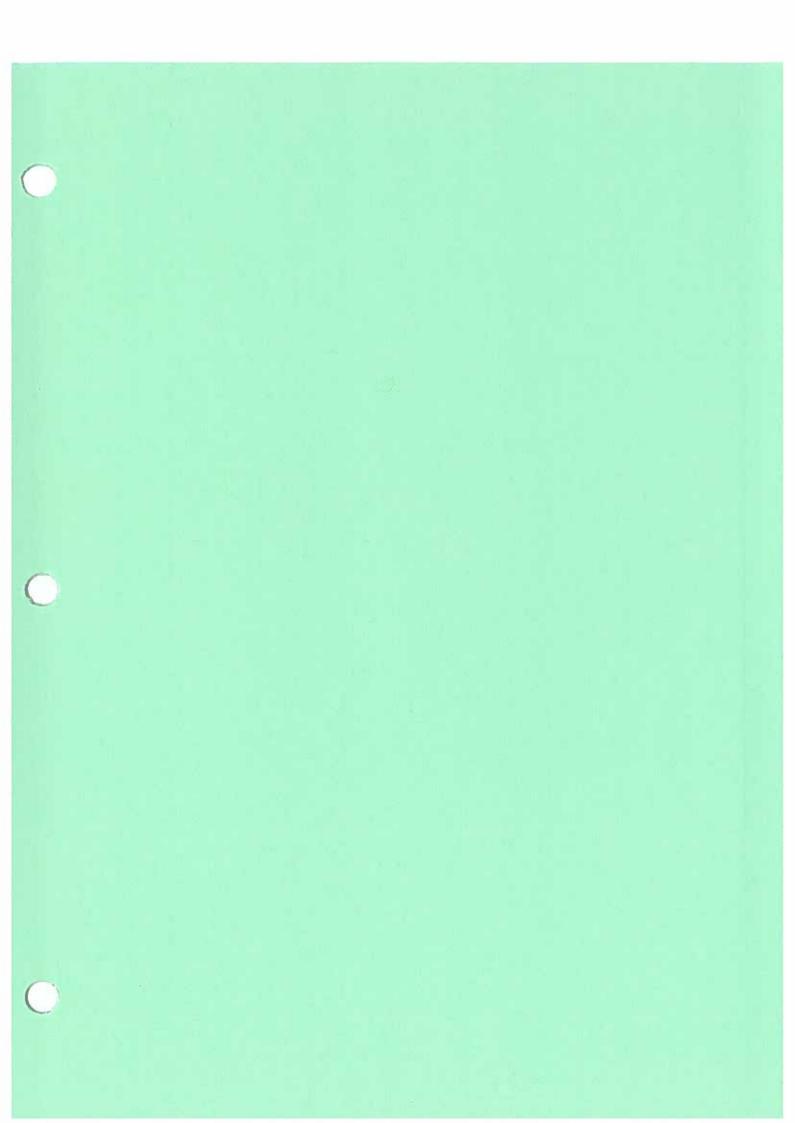

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

Repair work has been done in the boiler room. However, more O & M is needed. Material is not in poor condition overall.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

12/11/2001

Current Assessment Rating

NR

Not Required

Cause of Damage

Deterioration & Age

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Stephen Kimbrough

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, storeroom, and office areas

Material Description

Floor tile

Comments

Floor tile is not in poor condition with minor chipping and cracking throughout.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

12/11/2001

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Stephen Kimbrough

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

Material was not exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

12/11/2001

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Stephen Kimbraugh

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

Material is not in poor condition with minor scraping observed in kitchen area.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Surveillance Date

12/11/2001

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Stanban Kimbraugh

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

Small section of wall base carpet has pulled away between B4 and B5 exposing old cove base mastic which is not in poor condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Surveillance Date

12/11/2001

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

. .

Planned Response Action

No O & M


Inspector

- Kinstally -

State

Indiana

Accreditation Number

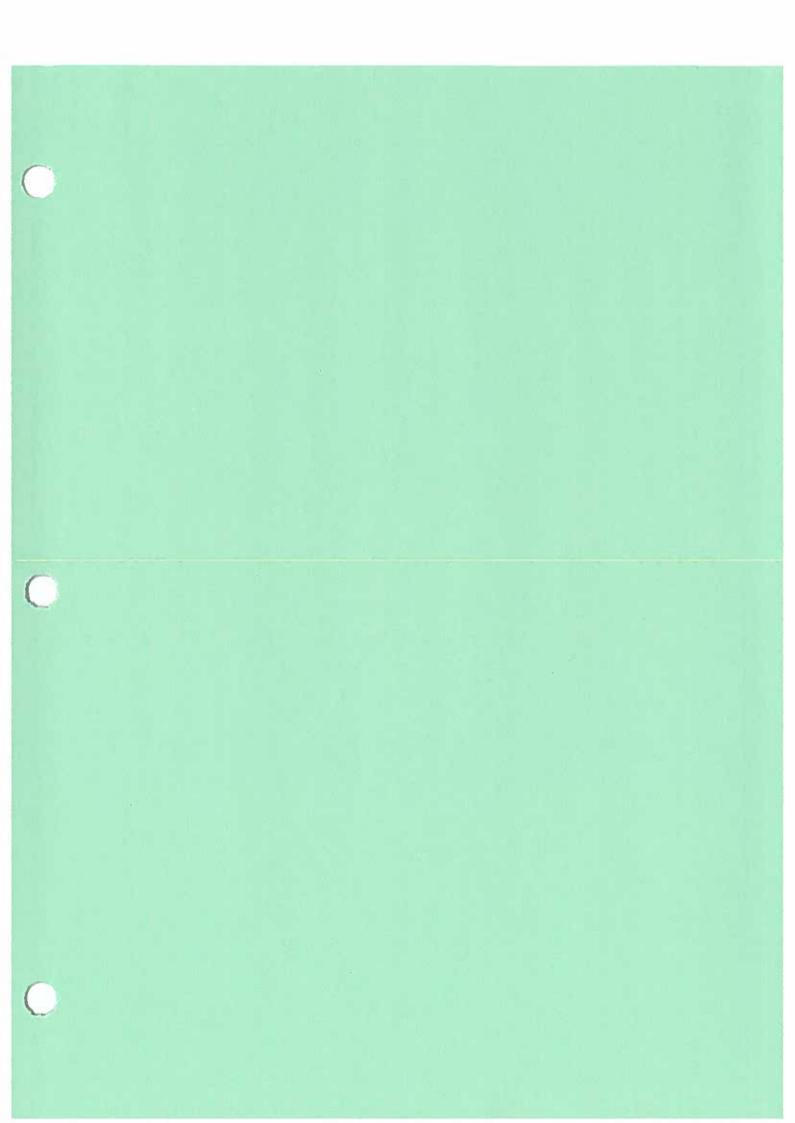

Greater Clark County Schools **LEA Name**

Jonathan Jennings Elementary **Building Name**

HA# 02

Type of Material Thermal Material

156 LF Quantity of Material

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

Inspector

State

Repair work has been done in the boiler room. However, more O & M is needed. Material is in good condition overall.

Does Material Contain Asbestos? Yes

Is it Friable? No

06/01/1988 **Original Inspection Date**

Current Surveillance Date 01/09/2001

NR Not Required **Current Assessment Rating**

Cause of Damage Deterioration & Age

Accessible Yes

Potential for Damage Low

Removed No

0 & M **Planned Response Action**

Indiana

Accreditation Number 190824065

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 05

Type of Material Miscellaneous Material

27,000 SF Quantity of Material

Material Location

Classrooms, storeroom, and office areas

Material Description

Floor tile

Comments

Inspector

Floor tile is in good condition with minor chipping and cracking throughout.

Does Material Contain Asbestos? Yes

Is it Friable? No

06/01/1988 **Original Inspection Date**

Current Surveillance Date 01/09/2001

Not Required **Current Assessment Rating** NR

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

0 & M **Planned Response Action**

K C. WZ

Indiana State

190824065 **Accreditation Number**

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

Material was not exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

06/01/1988

No Damage

Current Surveillance Date

01/09/2001

Current Assessment Rating

NR

Not Required

Cause of Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Patrick F Wilson

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

Material is in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Surveillance Date

01/09/2001

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Patrick E. Wilson

State

Indiana

Accreditation Number

Greater Clark County Schools **LEA Name**

Jonathan Jennings Elementary **Building Name**

C HA#

Miscellaneous Material Type of Material

Approx. 1,200 SF Quantity of Material

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

Small section of wall base carpet has pulled away between B4 and B5 exposing old cove

base mastic which is in good condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

05/31/1996 **Original Inspection Date Current Surveillance Date** 01/09/2001

Not Required NR **Current Assessment Rating**

No Damage Cause of Damage

No Accessible

Low Potential for Damage

Removed No

0 & M **Planned Response Action**

Inspector

Indiana State

190824065 **Accreditation Number**



LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 02

Type of Material Thermal Material

Quantity of Material 156 LF

Material Location

Boiler room and throughout the building

Material Description

4" Fitting Insulation

Comments

Inspector

State

Repair work has been done in the boiler room. Material is in good condition overall.

Does Material Contain Asbestos? Yes

Is it Friable?

Original Inspection Date 06/01/1988

Current Surveillance Date 06/29/2000

Current Assessment Rating NR Not Required

Indiana

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Accreditation Number 191523030

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27000 SF

Material Location

Classrooms, Storeroom, and Office Areas

Material Description

Floor Tile

Comments

Floor tile is in good condition.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

06/29/2000

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

George William

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27000 SF

Material Location

Throughout the building

Material Description

Floor Tile Mastic

Comments

Material was not exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

06/29/2000

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified LF

Material Location

Throughout the building

Material Description

Cove Base Molding

Comments

Material is in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Surveillance Date

06/29/2000

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

С

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified LF

Material Location

Throughout the building

Material Description

Cove Base Mastic

Comments

Small section of wall base carpet has pulled away between B4 and B5 exposing old cove base mastic which is in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Surveillance Date

06/29/2000

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

eorge William Ogl

State

Indiana

Accreditation Number



LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4" Fitting Insulation

Comments

Approximately 20 mudded fittings found in the boiler room. Four fittings have black duct

tape. Repairs needed.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

12/08/1999

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Matthew Wallace

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27000 SF

Material Location

Classrooms, Storeroom, and Office Areas

Material Description

Floor Tile

Comments

Good Condition. Walkway by the courtyard is non ACM.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

12/08/1999

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Matthew Wallace

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Δ

Type of Material

Miscellaneous Material

Quantity of Material

27000 SF

Material Location

Throughout the building

Material Description

Floor Tile Mastic

Comments

Material is not exposed. It is assumed to be in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

12/08/1999

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Matthew Wallace

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified LF

Material Location

Throughout the building

Material Description

Cove Base Molding

Comments

Material is in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Surveillance Date

12/08/1999

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Matthew Wallace

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified LF

Material Location

Throughout the building

Material Description

Cove Base Mastic

Comments

Material is not exposed. It is assumed to be in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Surveillance Date

12/08/1999

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Matthew Wallace

State

Indiana

Accreditation Number



LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 02

Type of Material Thermal Material

Quantity of Material 156 LF

Material Location

Boiler room and throughout the building

Material Description

4" Fitting Insulation

Comments

Inspector

State

Approximately 20 mudded fittings found in the boiler room. All in good condition.

Does Material Contain Asbestos? Yes

Is it Friable?

Original Inspection Date 06/01/1988

Current Surveillance Date 06/24/1999

Current Assessment Rating NR Not Required

Indiana

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Accreditation Number 191219020

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27000 SF

Material Location

Classrooms, Storeroom, and Office Areas

Material Description

Floor Tile

Comments

Good Condition. Walkway by the courtyard is non ACM.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

06/24/1999

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Matthew Wallace

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27000 SF

Material Location

Throughout the building

Material Description

Floor Tile Mastic

Comments

Material is not exposed. It is assumed to be in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

06/24/1999

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Matthew Wallace

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified LF

Material Location

Throughout the building

Material Description

Cove Base Molding

Comments

Material is in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Surveillance Date

06/24/1999

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Matthew Wallace

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

С

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified LF

Material Location

Throughout the building

Material Description

Cove Base Mastic

Comments

Material is not exposed. It is assumed to be in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

Nο

Original Inspection Date

05/31/1996

Current Surveillance Date

06/24/1999

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Matthew Wallace

State

Indiana

Accreditation Number



LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 02

Type of Material Thermal Material

Quantity of Material 156 LF

Material Location

Boiler room and throughout the building

Material Description

4" Fitting Insulation

Comments

Approximately 20 mudded fittings found in the boiler room. All in good condition.

Does Material Contain Asbestos? Yes Is it Friable? No

Original Inspection Date 06/01/1988
Current Surveillance Date 12/29/1998

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

State (Indiana

Accreditation Number 193804035

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27000 SF

Material Location

Classrooms, Storeroom, and Office Areas

Material Description

Floor Tile

Comments

Good Condition. Walkway by the courtyard is non ACM.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

12/29/1998

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

M & O

Inspector

Clint Yates

State

Accreditation Number

193804035

Indiana

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27000 SF

Material Location

Throughout the building

Material Description

Floor Tile Mastic

Comments

Material is not exposed. It is assumed to be in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Surveillance Date

12/29/1998

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Clint Yates

State

Accreditation Number

Indiana

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified LF

Material Location

Throughout the building

Material Description

Cove Base Molding

Comments

Material is in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Surveillance Date

12/29/1998

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Clint Yates

State

Accreditation Number

Indiana

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified LF

Material Location

Throughout the building

Material Description

Cove Base Mastic

Comments

Material is not exposed. It is assumed to be in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Surveillance Date

12/29/1998

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M


inspector

Clint Yates

State

Indiana

Accreditation Number



LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4" Fitting Insulation

Comments

All material seen was fiberglass. Good condition.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/ 1/88

Current Surveillance Date

1/15/98

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Karen Foxx

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Type of Material

Miscellaneous Material SF

Quantity of Material

32

Material Location

Boiler Room

Material Description

Boiler Gaskets

Comments

Boiler has been removed.

Does Material Contain Asbestos?

No

Is it Friable?

No

Original Inspection Date

6/ 1/88

Current Surveillance Date

1/15/98

Current Assessment Rating

NA Not Applicable

Not Applicable

Cause of Damage

No

Potential for Damage

NA

Removed

Accessible

Yes

Planned Response Action

None

Inspector

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, Storeroom, and Office Areas

Material Description

Floor Tile

Comments

Good Condition. Walkway by the courtyard is non ACM.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/ 1/88

Current Surveillance Date

1/15/98

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Karen Foxx

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor Tile Mastic

Comments

Material is not exposed. It is assumed to be in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/ 1/88

Current Surveillance Date

1/15/98

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Karen Fovy

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

LF

Material Location

Throughout the building

Material Description

Cove Base Molding

Comments

Material is in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/96

Current Surveillance Date

1/15/98

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Karen Foxx

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

LF

Material Location

Throughout the building

Material Description

Cove Base Mastic

Comments

Material is not exposed. It is assumed to be in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/96

Current Surveillance Date

1/15/98

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

Νo

Planned Response Action

0 & M


Inspector

Kasen Joka Karen Foxx

State

Indiana

Accreditation Number

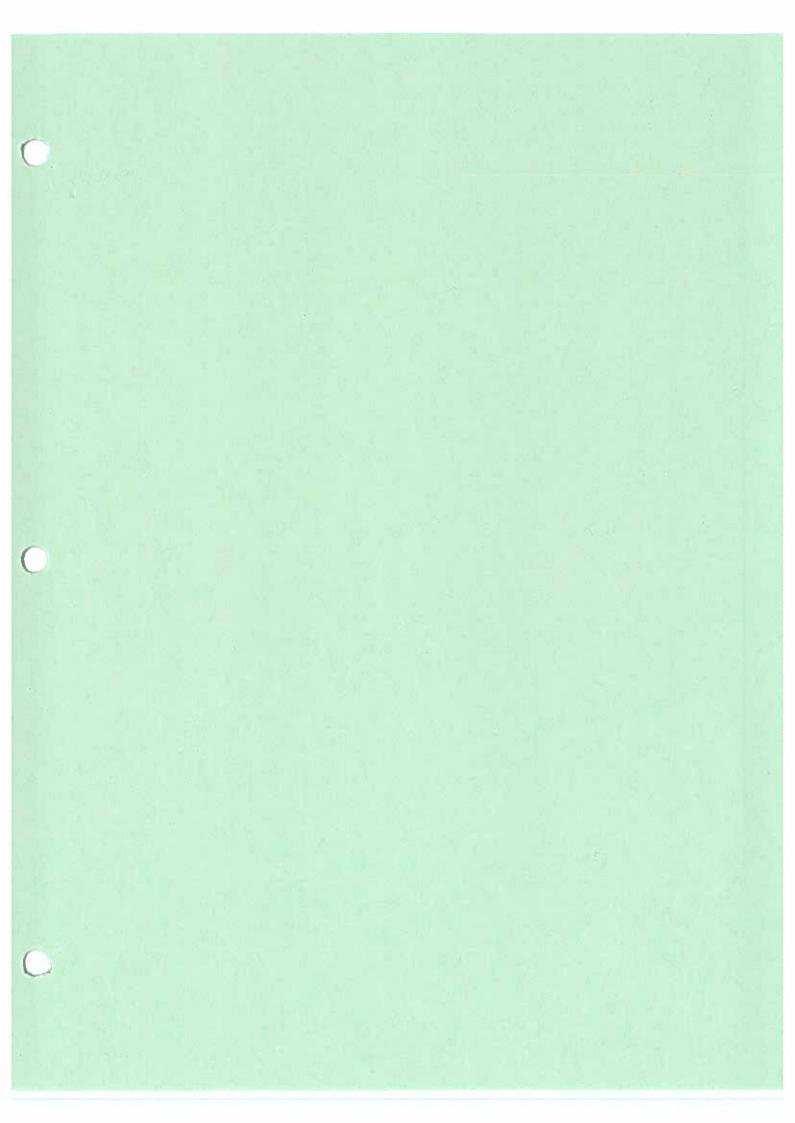

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

LF

Material Location

Boiler room and throughout the building

156

Material Description

4" Fitting Insulation

Comments

Good condition.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/ 1/88

Current Surveillance Date

7/ 1/97

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Karen Foxx

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

03

32

Type of Material

Miscellaneous Material

Quantity of Material

SF

Material Location

Boiler Room

Material Description

Boiler Gaskets

Comments

Boiler is open. Material is in good condition. Material was sampled and found to be negative for asbestos.

Does Material Contain Asbestos?

No

Is it Friable?

No

Original Inspection Date

6/ 1/88

Current Surveillance Date

7/ 1/97

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

None

Inspector

Karen Foxx

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, Storeroom, and Office Areas

Material Description

Floor Tile

Comments

Good Condition. Walkway by the courtyard is non ACM.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/ 1/88

Current Surveillance Date

7/ 1/97

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Karen John Karen Foxx

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor Tile Mastic

Comments

Material is not exposed. It is assumed to be in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/ 1/88

Current Surveillance Date

7/ 1/97

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Kancer Jaky Karen Foxx

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

LF

Material Location

Throughout the building

Material Description

Cove Base Molding

Comments

Material is in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/96

Current Surveillance Date

7/ 1/97

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Karen Foxx

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

LF

Material Location

Throughout the building

Material Description

Cove Base Mastic

Comments

Material is not exposed. It is assumed to be in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/96

Current Surveillance Date

7/ 1/97

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M


Inspector

Karen Foxx

State

Indiana

Accreditation Number

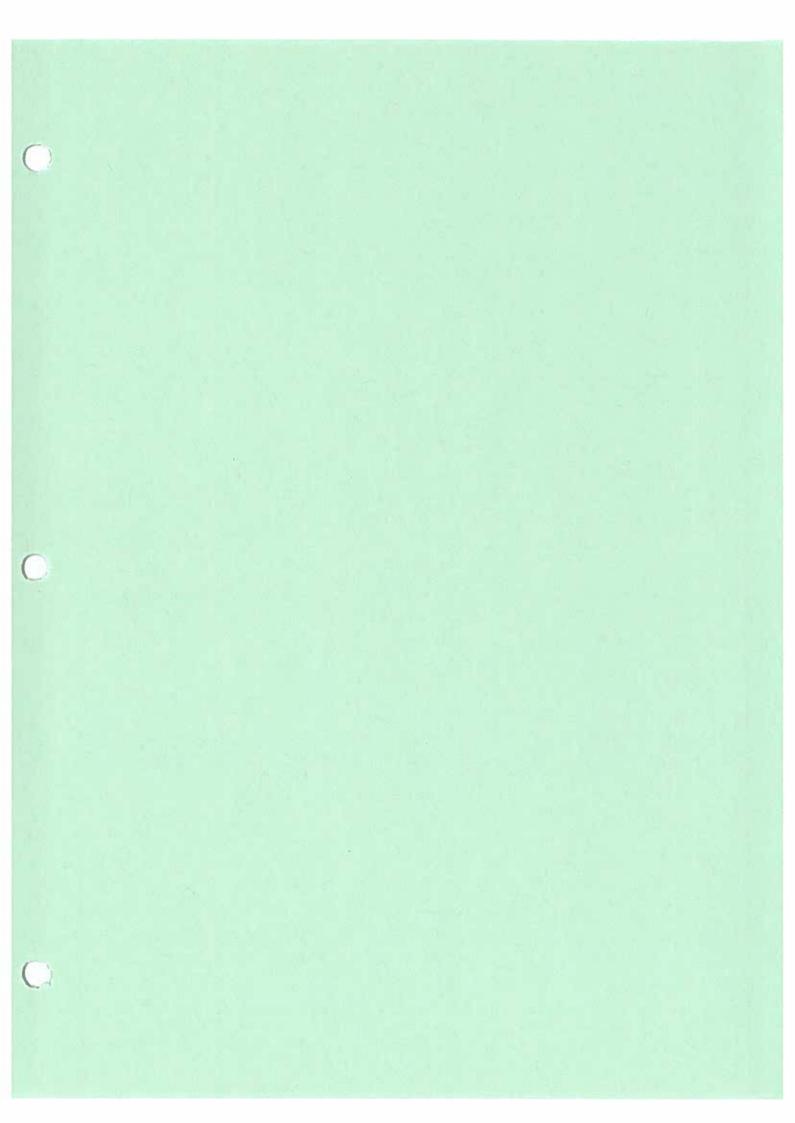

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4" Fitting Insulation

Comments

Good condition. No change.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/ 1/88

Current Surveillance Date

12/16/96

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

M & O

Inspector

Clint Yates

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

03

Type of Material

Miscellaneous Material

Quantity of Material

32 SF

Material Location

Boiler Room

Material Description

Boiler Gaskets

Comments

Good condition. No change.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/ 1/88

Current Surveillance Date

12/16/96

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Clint Yates

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, Storeroom, and Office Areas

Material Description

Floor Tile

Comments

Good Condition. Walkway by the courtyard is non ACM. No change.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/ 1/88

Current Surveillance Date

12/16/96

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Clint Yafes

State

Indiana

Accreditation Number

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# A

Type of Material Miscellaneous Material

Quantity of Material 27,000 SF

Material Location

Throughout the building

Material Description

Floor Tile Mastic

Comments

Material is assumed. It was not addressed in the original inspection. Good condition.

Clint Yates

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 6/ 1/88
Current Surveillance Date 12/16/96

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

State Indiana

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

LF

Material Location

Throughout the building

Material Description

Cove Base Molding

Comments

Good condition. Material was not addressed in the original inspection.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/96

Current Surveillance Date

12/16/96

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

M & O

inspector

Clint Xates

State

Indiana

Accreditation Number

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# C

Type of Material Miscellaneous Material

Quantity of Material LF

Material Location

Throughout the building

Material Description

Cove Base Mastic

Comments

Good condition. Material was not addressed in the original inspection.

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 5/31/96
Current Surveillance Date 12/16/96


Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

State Indiana

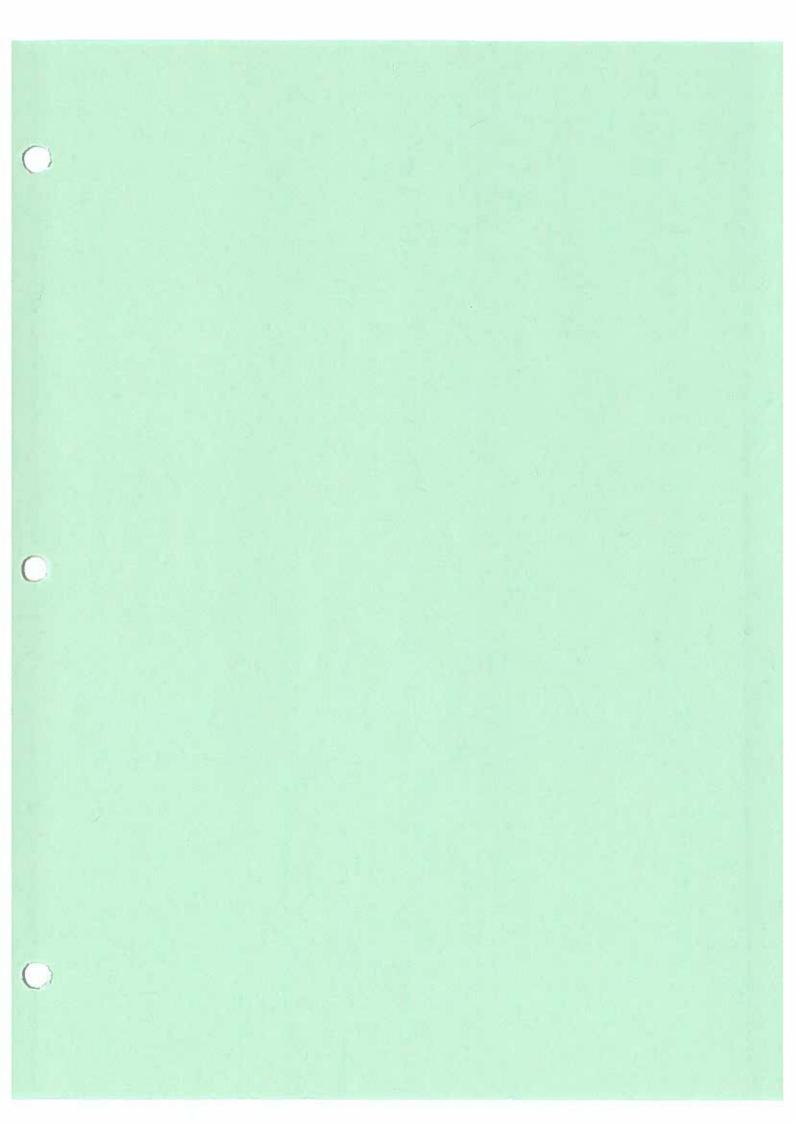

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 02

Type of Material Thermal Material

Quantity of Material 156 LF

Material Location

Boiler Room and throughout the building

Material Description

4" Fitting Insulation

Comments

Good condition. No change.

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 6/ 1/88

Current Surveillance Date 6/24/96

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

Rex Gaddis

State Indiana
Accreditation Number 190908032

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

03

32

Type of Material

Miscellaneous Material

Quantity of Material

SF

Material Location

Boiler Room

Material Description

Boiler Gaskets

Comments

Good condition. No change.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/ 1/88

Current Surveillance Date

6/24/96

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Rex Gaddis

my Sholde

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, Storeroom, and Office Areas

Material Description

Floor Tile

Comments

Good Condition. Walkway by the courtyard is non ACM. No change.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/ 1/88

Current Surveillance Date

6/24/96

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Rex Gaddis

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor Tile Mastic

Comments

Material is assumed. It was not addressed in the original inspection. Good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/ 1/88

Current Surveillance Date

6/24/96

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Rev Gaddie

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

LF

Material Location

Throughout the building

Material Description

Cove Base Molding

Comments

Good condition. Material was not addressed in the original inspection.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/96

Current Surveillance Date

6/24/96

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Rex Gaddis

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Ç

Type of Material

Miscellaneous Material

Quantity of Material

LF

Material Location

Throughout the building

Material Description

Cove Base Mastic

Comments

Good condition. Material was not addressed in the original inspection.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/96

Current Surveillance Date

6/24/96

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector


Rex Gaddis

Ky Xkde

State

Indiana

Accreditation Number

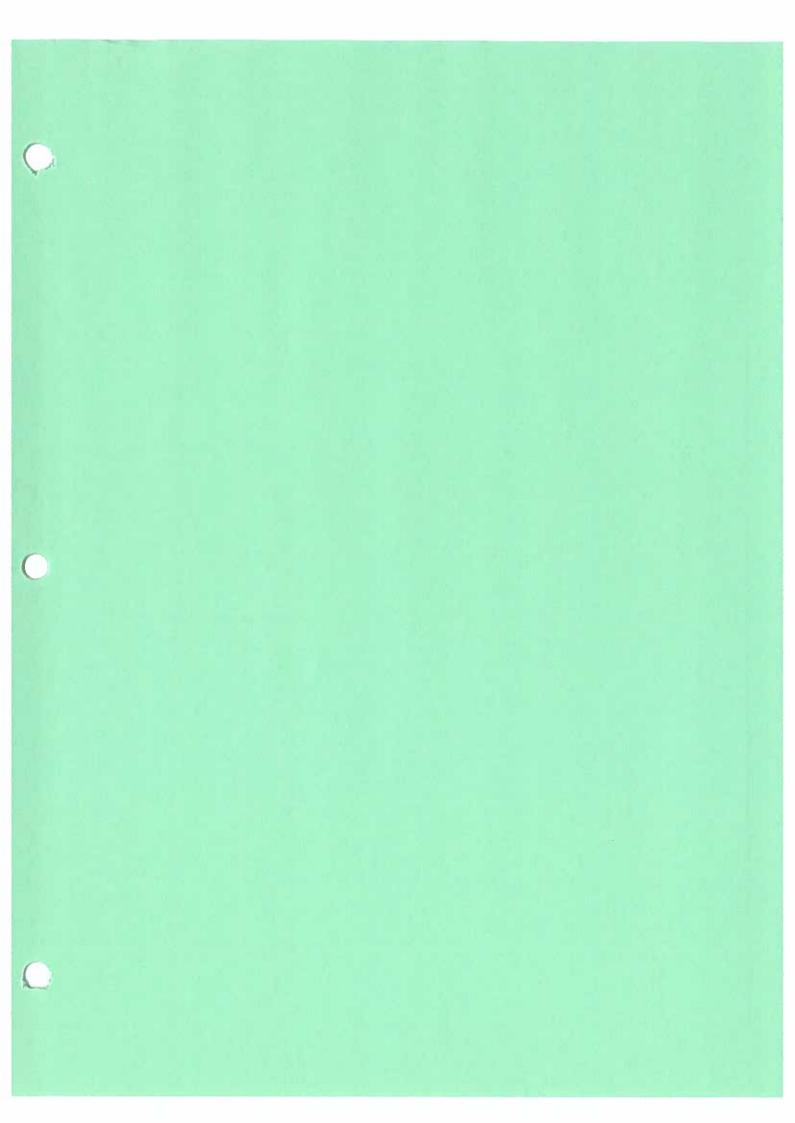

LEA NAME: Greater Clark County Schools

BUILDING NAME: Jonathan Jennings Elementary

HA#: 02

TYPE OF MATERIAL: Thermal Material

QUANTITY OF MATERIAL: 156LF

MATERIAL LOCATION:

Boiler Room and Throughout the Building

MATERIAL DESCRIPTION:

4" Fitting Insulation

COMMENTS:

Good Condition

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE: 06/01/88

CURRENT SURVEILLANCE DATE: 12/07/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: YES

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

STATE: Indiana

INSPECTOR NAME:

LEA NAME:

Greater Clark County Schools

BUILDING NAME:

Jonathan Jennings Elementary

HA#:

03

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL: 32SF

MATERIAL LOCATION:

Boiler Room

MATERIAL DESCRIPTION:

Boiler Gaskets

COMMENTS:

Good Condition

IS MATERIAL FRIABLE?

NO

ORIGINAL INSPECTION DATE: 06/01/88

CURRENT SURVEILLANCE DATE: 12/07/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE:

No Damage

ACCESSIBLE:

YES

POTENTIAL FOR DAMAGE:

Low

REMOVED:

NO

STATE:

Indiana

INSPECTOR NAME:

LEA NAME:

Greater Clark County Schools

BUILDING NAME:

Jonathan Jennings Elementary

HA#:

05

TYPE OF MATERIAL:

Miscellaneous Material

QUANTITY OF MATERIAL: 27,000SF

MATERIAL LOCATION:

Classrooms, Storeroom, and Office Areas

MATERIAL DESCRIPTION:

Floor Tile

COMMENTS:

Good Condition. Walkway by the courtyard is non ACM.

IS MATERIAL FRIABLE?

NO

ORIGINAL INSPECTION DATE: 06/01/88

CURRENT SURVEILLANCE DATE: 12/07/95

No Damage

CURRENT ASSESSMENT RATING:

NR Not Required

CAUSE OF DAMAGE:

ACCESSIBLE:

YES

POTENTIAL FOR DAMAGE:

Low

REMOVED:

NO

STATE:

Indiana

INSPECTOR NAME:

LEA NAME:

Greater Clark County Schools

BUILDING NAME:

Jonathan Jennings Elementary

HA#:

TYPE OF MATERIAL:

Miscellaneous Material

QUANTITY OF MATERIAL: 27,000SF

MATERIAL LOCATION:

Throughout the Building

MATERIAL DESCRIPTION:

Floor Tile Mastic

COMMENTS:

Material is assumed. It was not addressed in the original inspection.

IS MATERIAL FRIABLE?

NO

ORIGINAL INSPECTION DATE: 06/01/88

CURRENT SURVEILLANCE DATE: 12/07/95

CURRENT ASSESSMENT RATING:

NR Not Required

CAUSE OF DAMAGE:

No Damage

ACCESSIBLE:

NO

POTENTIAL FOR DAMAGE:

Low

REMOVED:

NO

STATE:

Indiana

INSPECTOR NAME:

LEA NAME:

Greater Clark County Schools

BUILDING NAME:

Jonathan Jennings Elementary

HA#:

В

TYPE OF MATERIAL:

Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout the Building

MATERIAL DESCRIPTION:

Cove-base Molding

COMMENTS:

Good condition. Material was not addressed in the original inspection.

IS MATERIAL FRIABLE?

NO

ORIGINAL INSPECTION DATE:

CURRENT SURVEILLANCE DATE:

12/07/95

CURRENT ASSESSMENT RATING:

NR

Not Required

CAUSE OF DAMAGE:

No Damage

ACCESSIBLE:

YES

POTENTIAL FOR DAMAGE:

Low

REMOVED:

NO

STATE:

Indiana

INSPECTOR NAME:

LEA NAME:

Greater Clark County Schools

BUILDING NAME:

Jonathan Jennings Elementary

HA#:

C

TYPE OF MATERIAL:

Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout the Building

MATERIAL DESCRIPTION:

Cove-base Mastic

COMMENTS:

Good condition. Material was not addressed in the original inspection.

IS MATERIAL FRIABLE?

NO

ORIGINAL INSPECTION DATE:

CURRENT SURVEILLANCE DATE:

12/07/95

CURRENT ASSESSMENT RATING:

NR

Not Required

CAUSE OF DAMAGE:

No Damage

ACCESSIBLE:

NO

POTENTIAL FOR DAMAGE:

Low

REMOVED:

NO

STATE:

Indiana

INSPECTOR NAME:

THIRD YEAR REINSPECTIONS

REINSPECTION PLAN

GREATER CLARK COUNTY SCHOOLS

Reinspection by an accredited building inspector will be scheduled to be performed not more than three years from the date of the original inspection. The reinspection report will then be made a permanent part of this Management Plan. Reinspections will be performed every three years for as long as the building contains ACBM, and will be reinspected once within three years from the date that all ACBM has been removed.

Records of each reinspection should be maintained in this binder.

DATE PLANNED	DATE COMPLETED	COMPLETED BY
JUNE 2007	July 2007	Bill Ogle
JUNE 2010	June 2010	SandyShadley
JUNE 2013	April 2013	Jeff hechtin
JUNE 2016	April 2016	Bijan (ka)
JUNE 2019	May 2019	
JUNE 2022		
_JUNE_2025_		

REINSPECTION PLAN

GREATER CLARK COUNTY SCHOOLS

JONATHAN JENNINGS ELEMENTARY SCHOOL

The ACBM in this building shall be reinspected every three years to determine any change in the condition of the materials for as long they remain in the building. This reinspection will be conducted tri-annually by an accredited inspector.

The following table outlines the dates on which these inspections should take place in this school building.

REINSPECTION SCHEDULE

DATE PLANNED	DATE COMPLETED	COMPLETED BY
JUNE 1992	JUNE 1992	ASBESTECH
JUNE 1995	June '95	alliance
JUNE 1998	June '98	alliance
JUNE 2001	July '01	4. Wilson
JUNE 2004	July '04	C. Spicks

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 02

HA Description 4"+ 2" fitting insulation

HA Type Thermal System Insulation (TSI)

HA Location Boiler room and throughout the building

Quantity 156 LF

Comments This material was not in poor condition overall. Kitchen storage stage ends and

custodial closet by room A-1 have visible fittings; small amount of debris found in kitchen storage. Minor patch and repair needed. Material is also located in

hallways

above ceilings. There is no access to pipe chases. This material needs asbestos

labels on all of the locations.

Asbestos Known

Friable Yes

Original Inspection 6/1/1988

Current Inspection 5/16/2019

Material Assessment

<u>Assessment Rating</u> 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact Vibration Air

Low/None Low/None Low/None

Planned Response Action O&M

Inspector

Sean Stults

State IN Accreditation Number 19A007184

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 05-A

HA Type Floor tile - under carpet

Miscellaneous Material

HA Location Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under

Carpet)

Quantity 27000 SF

Comments The material was under carpet therefore not visible to inspect.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Sean Stults

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 05-B

HA Type Floor tile- Green 12" X 12"

HA Type Miscellaneous Material

HA Location Principals office and Breezeway

Quantity Unquantified SF

Comments This material was not in poor condition.

Asbestos Known

Friable No

Original Inspection 6/1/1988

Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Sean Stults

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HAID A

HA Description Floor Tile Mastic

HA Type Miscellaneous Material
HA Location Throughout building

Quantity 27000 SF

Comments This material was not in poor condition. It was installed in 1987 when Gym was

added

on to building.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Sean Stults

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID B

HA Description Cove Base Moldign

HA Type Miscellaneous Material

HA Location Throughout the building - Light Gray, Cafeteria and Gym

Quantity Approx. 3700 LF

Comments This material has minor scrapes, but was not in poor condition overall.

Asbestos Assumed

Friable No

Original Inspection 5/31/1996

Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Sean Stults

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HAID C

HA Description Cove Base Castic

HA Type Miscellaneous Material

HA Location Throughout building

Quantity Approx. 1200 SF

Comments The material was not visible to inspect.

Asbestos Assumed

Friable No

Original Inspection 5/31/1996

Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Sean Stults

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID D

HA Description Cloth expansion jointsHA Type Miscellaneous MaterialHA Location Kitchen storage room

Quantity 2 Unit(s)

Comments This material was not assessed in the original inspection and will be added to

the

management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 12/15/2011

Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Sean Stults

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 02

HA Description 4"+ 2" fitting insulation

HA Type Thermal System Insulation (TSI)

HA Location Boiler room and throughout the building

Quantity 156 LF

Comments This material was not in poor condition overall. Kitchen storage stage ends and

custodial closet by room A-1 have visible fittings; small amount of debris found in kitchen storage. Minor patch and repair needed. Material is also located in

hallways

above ceilings. There is no access to pipe chases. This material needs asbestos

labels on all of the locations.

Asbestos Known

Friable Yes

Original Inspection 6/1/1988

Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN Accreditation Number 19A001039

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 05-A

HA Type Floor tile - under carpet Miscellaneous Material

HA Location Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under

Carpet)

Quantity 27000 SF

Comments The material was under carpet therefore not visible to inspect.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID 05-B

HA Type Floor tile- Green 12" X 12" **HA Type** Miscellaneous Material

HA Location Principals office and Breezeway

Quantity Unquantified SF

Comments This material was not in poor condition.

Asbestos Known

Friable No

Original Inspection 6/1/1988

Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HAID A

HA Description Floor Tile Mastic

HA Type Miscellaneous Material

HA Location Throughout building

Quantity 27000 SF

Comments This material was not in poor condition. It was installed in 1987 when Gym was

added

on to building.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

 Physical Contact
 Vibration
 Air

 Low/None
 Low/None
 Low/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID B

HA Description Cove Base Moldign

HA Type Miscellaneous Material

HA Location Throughout the building - Light Gray, Cafeteria and Gym

Quantity Approx. 3700 LF

Comments This material has minor scrapes, but was not in poor condition overall.

Asbestos Assumed

Friable No

Original Inspection 5/31/1996

Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Jonathan Jennings Elementary School **Building Name**

Building Number 09

HAID С

HA Location

HA Description Cove Base Castic

HA Type Miscellaneous Material Throughout building

Quantity Approx. 1200 SF

Comments The material was not visible to inspect.

Asbestos Assumed

Friable No

Original Inspection 5/31/1996 **Current Inspection** 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged Good Condition

> **Physical Contact** Vibration <u>Air</u> Low/None Low/None Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

State IN

LEA Name Greater Clark County School Corporation

Building Name Jonathan Jennings Elementary School

Building Number 09

HA ID D

HA Description Cloth expansion jointsHA Type Miscellaneous MaterialHA Location Kitchen storage room

Quantity 2 Unit(s)

Comments This material was not assessed in the original inspection and will be added to the

management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 12/15/2011

Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical ContactVibrationAirLow/NoneLow/NoneLow/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

State IN

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4"+ 2" fitting insulation

Comments

This material was not in poor condition overall. Kitchen storage stage ends and custodial closet by room A-1 have visible fittings. Material is also located in hallways above ceilings. There is no access to pipe chases.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Reinspection Date

4/24/2013

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05-A

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center, and office areas (Under

Carpet)

Material Description

Floor tile - under carpet

Comments

The material was under carpet therefore not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/27/2011

Current Reinspection Date

4/24/2013

Current Assessment Rating

NA

Not Applicable

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05-B

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified SF

Material Location

Principals office and Breezeway

Material Description

Floor tile- Green 12" X 12"

Comments

This material was not in poor condition.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Reinspection Date

4/24/2013

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05-C

Type of Material

Miscellaneous Material

Quantity of Material

Unquantified SF

Material Location

Gym Floor

Material Description

12"X 12" White Floor tile

Comments

This material was not in poor condition. It was installed in 1987 when Gym was added on to building.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/27/2011

Current Reinspection Date

4/24/2013

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Reinspection Date

4/24/2013

No Damage

Current Assessment Rating

NR

Not Rated

Cause of Damage

No

Accessible

140

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building - Light Gray, Cafeteria and Gym

Material Description

Cove base molding

Comments

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

is it Friable?

No

Original Inspection Date

5/31/1996

Current Reinspection Date

4/24/2013

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Reinspection Date

4/24/2013

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

D

Type of Material

Miscellaneous Material

Quantity of Material

2 Each

Material Location

Kitchen storage room

Material Description

Cloth expansion joints

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

12/15/2011

Current Reinspection Date

4/24/2013

Current Assessment Rating

NR

Not Rated

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Jeffrey P. Rechtin

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

This material was not in poor condition overall. Kitchen storage and stage ends have visible fittings. Material is also located in hallways above ceilings. There is no access to pipe chases.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Reinspection Date

6/30/2010

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Sandra Shadley

State

IN

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under

Carpet)

Material Description

Floor tile

Comments

This material was under carpet therefore not visible to inspect.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Reinspection Date

6/30/2010

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Sandra Shadley

State

IN

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Reinspection Date

6/30/2010

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Sandra Shadley

State

ΙN

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Reinspection Date

6/30/2010

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Sandra Shadley

State

IN

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Reinspection Date

6/30/2010

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

Νo

Planned Response Action

O & M

Inspector

Sandra Shadley

State

IN

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

This material was not in poor condition overall.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Reinspection Date

7/11/2007

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

George William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, "D" pod teacher's storeroom, Media Center and office areas (Under

Carpet)

Material Description

Floor tile

Comments

This material was not visible to inspect.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Reinspection Date

7/11/2007

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

eorge/William O

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

No mastic was exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Reinspection Date

7/11/2007

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

eorge/William Øgle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material has minor scrapes, but was not in poor condition overall.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Reinspection Date

7/11/2007

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Sporab William Ogle

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

The material was not visible to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/1996

Current Reinspection Date

7/11/2007

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

George/William Ogle

State

Indiana

Accreditation Number



LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

02

Type of Material

Thermal Material

Quantity of Material

156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

This material was not in poor condition overall.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/1/1988

Current Reinspection Date

6/28/2004

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M


Inspector

Christiaan Sparks

State

Indiana

Accreditation Number

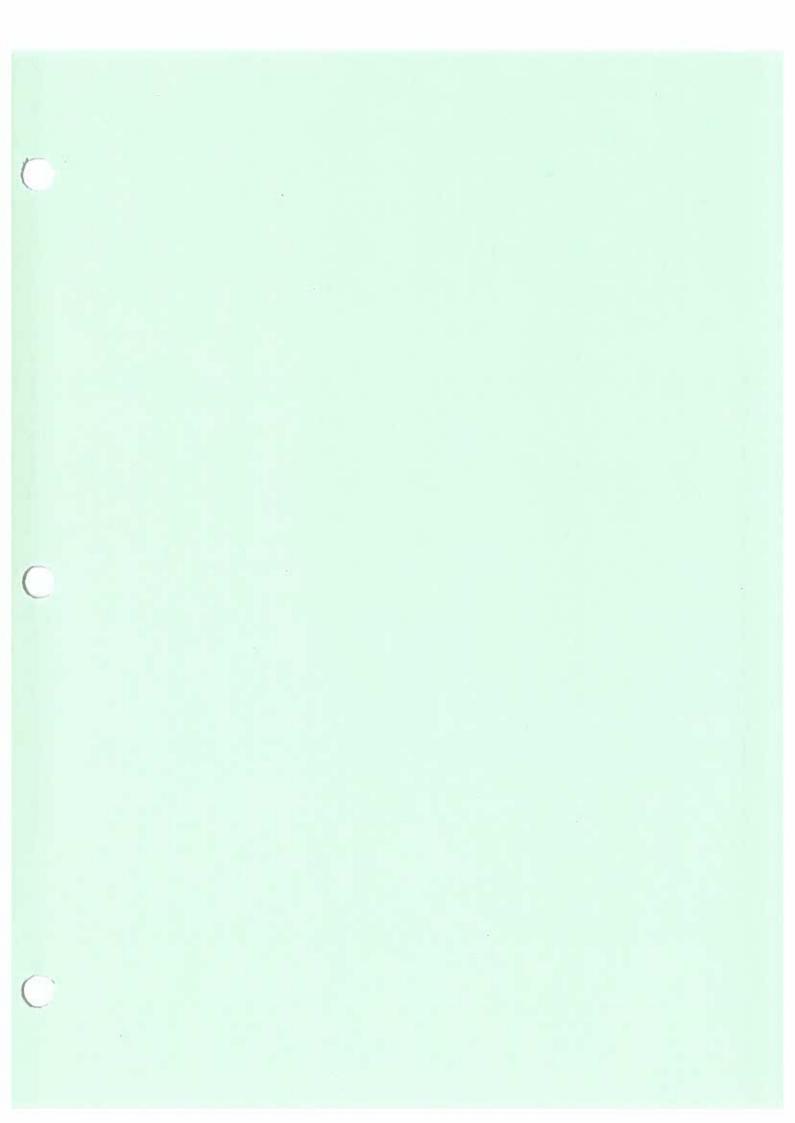

Greater Clark County Schools LEA Name

Jonathan Jennings Elementary **Building Name**

02 HA#

Thermal Material Type of Material

Quantity of Material 156 LF

Material Location

Boiler room and throughout the building

Material Description

4" fitting insulation

Comments

Inspector

Repair work has been done in the boiler room. However, more O & M is needed. Material

is in good condition overall.

Does Material Contain Asbestos? Yes Is it Friable? No

06/01/1988 **Original Inspection Date** 07/10/2001 **Current Reinspection Date**

Not Required **Current Assessment Rating** NR

Deterioration & Age Cause of Damage

Accessible Yes Low Potential for Damage Removed No

0 & M Planned Response Action

Indiana

State

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, storeroom, and office areas

Material Description

Floor tile

Comments

Floor tile is in good condition with minor chipping and cracking throughout.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Reinspection Date

07/10/2001

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Patrick Wilson NW
Patrick E. Wilson

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

Α

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

Material was not exposed to inspect.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

06/01/1988

Current Reinspection Date

07/10/2001

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Patrick Wilson w

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

Approx. 3,700 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

Material is in good condition with minor scraping observed in kitchen area.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

05/31/1996

Current Reinspection Date

07/10/2001

Current Assessment Rating

NR

Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Patrick E. Wilson

State

Indiana

Accreditation Number

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# C

Type of Material Miscellaneous Material

Quantity of Material Approx. 1,200 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

Small section of wall base carpet has pulled away between B4 and B5 exposing old cove base mastic which is in good condition.

Does Material Contain Asbestos? Assumed

Is it Friable?

Original Inspection Date 05/31/1996
Current Reinspection Date 07/10/2001

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low


Removed No

Planned Response Action 0 & M

Inspector Patrick Wilson Kw
Patrick E. Wilson

I dilick E. Wilson

State Indiana

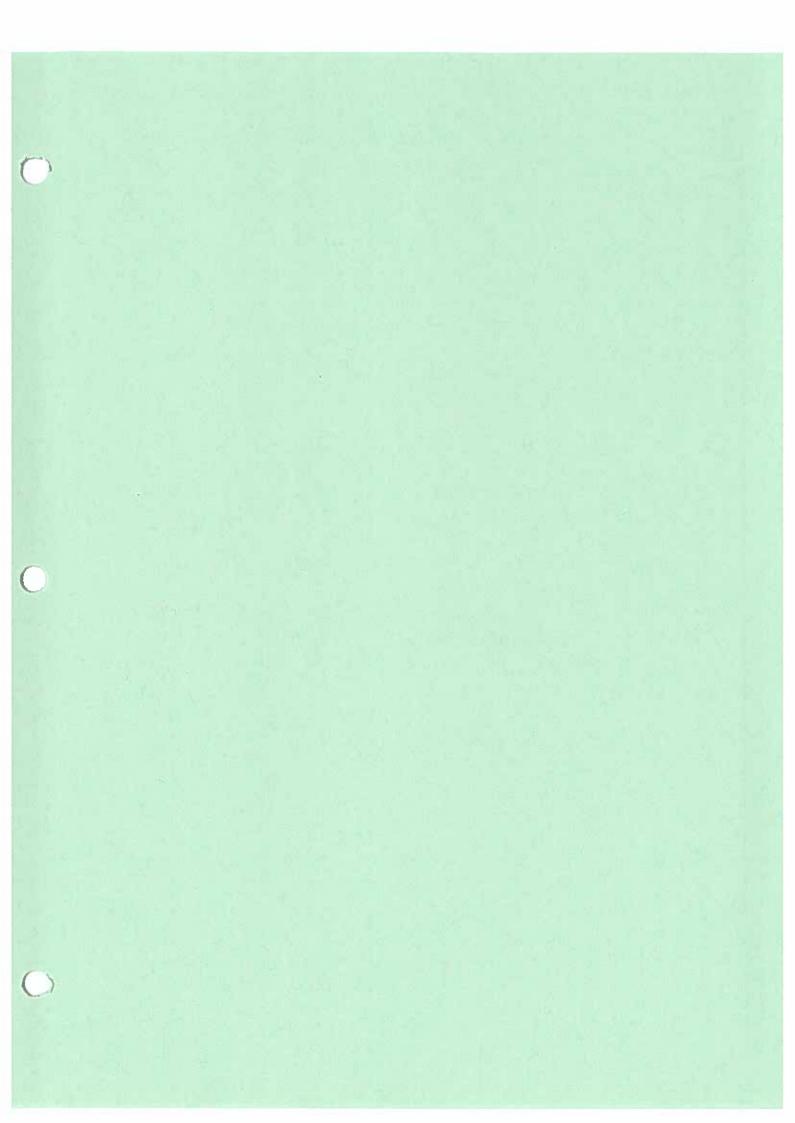

LEA Name Greater Clark County Schools

Building Name Jonathan Jennings Elementary

HA# 02

Type of Material Thermal Material

Quantity of Material 156 LF

Material Location

Boiler room and throughout the building

Material Description

4" Fitting Insulation

Comments

Approximately 20 mudded fittings found in the boiler room. All in good condition.

Clint Yates

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/ 1/88
Current Reinspection Date 6/ 1/98

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

State Indiana

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

05

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Classrooms, Storeroom, and Office Areas

Material Description

Floor Tile

Comments

Good Condition. Walkway by the courtyard is non ACM.

Does Material Contain Asbestos?

Yes

Is it Friable?

No

Original Inspection Date

6/ 1/88

Current Reinspection Date

6/ 1/98

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O&M

Inspector

≱int Yates

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

A

Type of Material

Miscellaneous Material

Quantity of Material

27,000 SF

Material Location

Throughout the building

Material Description

Floor Tile Mastic

Comments

Material is not exposed. It is assumed to be in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

6/ 1/88

Current Reinspection Date

6/ 1/98

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M

Inspector

Clint Yates

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

В

Type of Material

Miscellaneous Material

Quantity of Material

LF

Material Location

Throughout the building

Material Description

Cove Base Molding

Comments

Material is in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/96

Current Reinspection Date

6/ 1/98

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

Yes

Potential for Damage

Low

Removed

No

Planned Response Action

O & M

Inspector

Clint Yates

State

Indiana

Accreditation Number

LEA Name

Greater Clark County Schools

Building Name

Jonathan Jennings Elementary

HA#

C

Type of Material

Miscellaneous Material

Quantity of Material

LF

Material Location

Throughout the building

Material Description

Cove Base Mastic

Comments

Material is not exposed. It is assumed to be in good condition.

Does Material Contain Asbestos?

Assumed

Is it Friable?

No

Original Inspection Date

5/31/96

Current Reinspection Date

6/ 1/98

Current Assessment Rating

NR Not Required

Cause of Damage

No Damage

Accessible

No

Potential for Damage

Low

Removed

No

Planned Response Action

0 & M


Inspector

Clint Yate:

State

Indiana

Accreditation Number

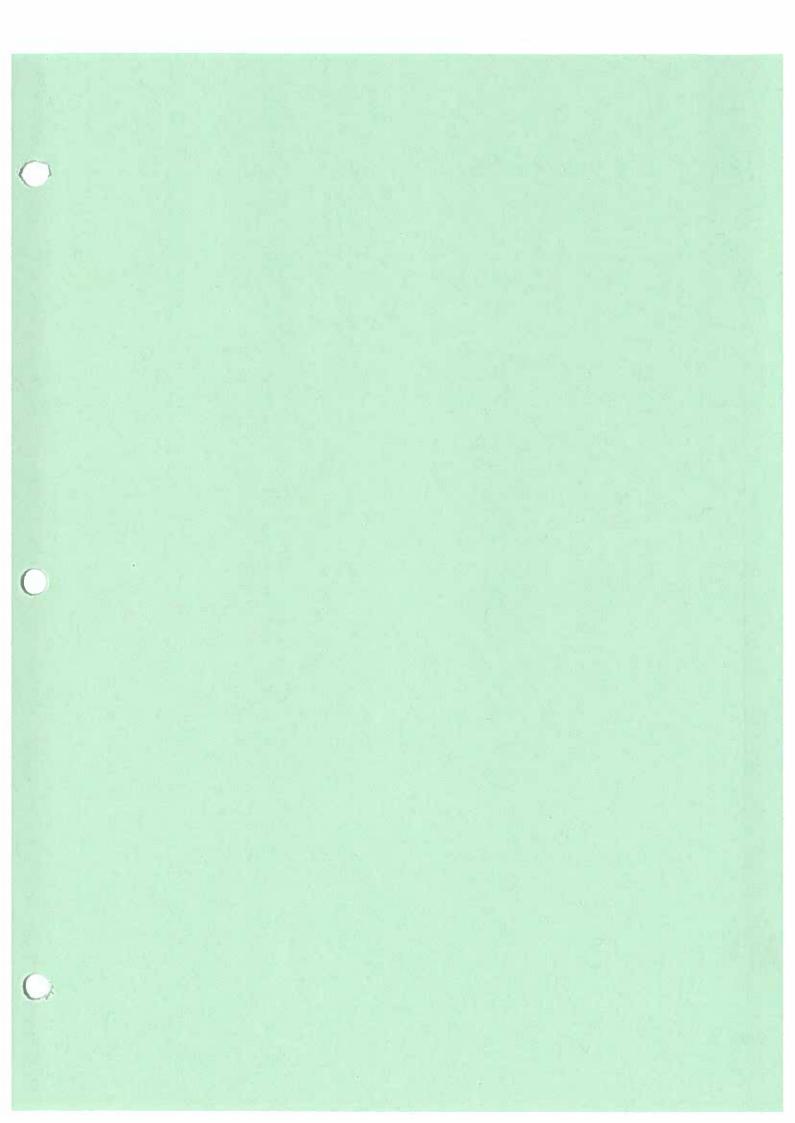

LEA NAME:

Greater Clark County School Corp.

BUILDING NAME:

Jonathan Jennings Elementary

HA#:

02

TYPE OF MATERIAL:

Thermal Material

QUANTITY OF MATERIAL:

156LF

MATERIAL LOCATION:

Boiler Room and Throughout the Building

MATERIAL DESCRIPTION:

4" Fitting Insulation

COMMENTS:

Good Condition

IS MATERIAL FRIABLE?

ORIGINAL INSPECTION DATE:

06/01/88

NO

CURRENT REINSPECTION DATE: 06/26/95

CURRENT ASSESSMENT RATING:

NR Not Required

CAUSE OF DAMAGE:

No Damage

ACCESSIBLE:

NO

POTENTIAL FOR DAMAGE:

Low

REMOVED:

NO

CURRENT VIDEO TAPE:

(TAPE NO/FOOTAGE)

INSPECTOR NAME:

STATE:

Indiana

ACCREDITATION NO.:

LEA NAME:

Greater Clark County School Corp.

BUILDING NAME:

Jonathan Jennings Elementary

HA#:

03

TYPE OF MATERIAL:

Miscellaneous Material

QUANTITY OF MATERIAL:

32SF

MATERIAL LOCATION:

Boiler Room

MATERIAL DESCRIPTION:

Boiler Gaskets

COMMENTS:

Good Condition

IS MATERIAL FRIABLE?

NO

ORIGINAL INSPECTION DATE:

06/01/88

CURRENT REINSPECTION DATE:

06/26/95

CURRENT ASSESSMENT RATING:

NR Not Required

CAUSE OF DAMAGE:

No Damage

ACCESSIBLE:

NO

POTENTIAL FOR DAMAGE:

Low

REMOVED:

NO

CURRENT VIDEO TAPE:

(TAPE NO/FOOTAGE)

INSPECTOR NAME:

STATE:

Indiana

ACCREDITATION NO.:

LEA NAME:

Greater Clark County School Corp.

BUILDING NAME:

Jonathan Jennings Elementary

HA#:

05

TYPE OF MATERIAL:

Miscellaneous Material

QUANTITY OF MATERIAL: 27,000SF

MATERIAL LOCATION:

Classrooms, Storeroom, and Office Areas

MATERIAL DESCRIPTION:

Floor Tile

COMMENTS:

Good Condition. Walkway by the courtyard is non ACM.

IS MATERIAL FRIABLE?

NO

ORIGINAL INSPECTION DATE:

06/01/88

CURRENT REINSPECTION DATE:

06/26/95

CURRENT ASSESSMENT RATING:

NR Not Required

CAUSE OF DAMAGE:

No Damage

ACCESSIBLE:

NO

POTENTIAL FOR DAMAGE:

Low

REMOVED:

NO

CURRENT VIDEO TAPE:

(TAPE NO/FOOTAGE)

INSPECTOR NAME:

STATE:

Indiana

ACCREDITATION NO .:

LEA NAME:

Greater Clark County School Corp.

BUILDING NAME:

Jonathan Jennings Elementary

HA#:

A

TYPE OF MATERIAL:

Miscellaneous Material

QUANTITY OF MATERIAL:

27,000SF

MATERIAL LOCATION:

Throughout the Building

MATERIAL DESCRIPTION:

Floor Tile Mastic

COMMENTS:

Material is assumed. It was not addressed in the original inspection.

IS MATERIAL FRIABLE?

NO

ORIGINAL INSPECTION DATE:

06/01/88

CURRENT REINSPECTION DATE:

06/26/95

CURRENT ASSESSMENT RATING:

NR Not Required

CAUSE OF DAMAGE:

No Damage

ACCESSIBLE:

NO

POTENTIAL FOR DAMAGE:

Low

REMOVED:

NO

CURRENT VIDEO TAPE:

(TAPE NO/FOOTAGE)

/

INSPECTOR NAME:

Rex Gaddis

STATE:

Indiana

ACCREDITATION NO.:

LEA NAME:

Greater Clark County School Corp.

BUILDING NAME:

Jonathan Jennings Elementary

HA#:

TYPE OF MATERIAL:

Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout the Building

MATERIAL DESCRIPTION:

Cove-base Molding

COMMENTS:

Good condition. Material was not addressed in the original inspection.

IS MATERIAL FRIABLE?

NO

ORIGINAL INSPECTION DATE:

CURRENT REINSPECTION DATE:

06/26/95

CURRENT ASSESSMENT RATING:

NR Not Required

CAUSE OF DAMAGE:

No Damage

ACCESSIBLE:

NO

POTENTIAL FOR DAMAGE:

Low

REMOVED:

NO

CURRENT VIDEO TAPE:

(TAPE NO/FOOTAGE)

INSPECTOR NAME:

STATE:

Indiana

ACCREDITATION NO.:

LEA NAME:

Greater Clark County School Corp.

BUILDING NAME:

Jonathan Jennings Elementary

HA#:

C

TYPE OF MATERIAL:

Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout the Building

MATERIAL DESCRIPTION:

Cove-base Mastic

COMMENTS:

Good condition. Material was not addressed in the original inspection.

IS MATERIAL FRIABLE?

NO

ORIGINAL INSPECTION DATE:

CURRENT REINSPECTION DATE:

06/26/95

CURRENT ASSESSMENT RATING:

NR

Not Required

CAUSE OF DAMAGE:

No Damage

ACCESSIBLE:

NO

POTENTIAL FOR DAMAGE:

Low

REMOVED:

NO

CURRENT VIDEO TAPE:

(TAPE NO/FOOTAGE)

,

INSPECTOR NAME:

Por Caddia

STATE:

Indiana

ACCREDITATION NO.:

ADDITIONAL BULK SAMPLES

ATC ASSOCIATES INC. BULK SAMPLE ANALYSIS REPORT

NVLAP Accredited NVLAP Code Number 101265-00

Date: July 24, 1997

Client: Alliance Indiana, Inc.

Project Identification:

NGR-00A02 - Greater Clark County Schools

Date Sample Received:

July 9, 1997

ATC Lab Batch Number:

Lab <u>ID</u>	Client ID	Color / Description	Laver(s)	Asbestos Type	%	Other Fibrous Material	<u>%</u>	Non-Fibrous Material
001	PV-01	Tan Covebase	1	No Asbestos Detec	cted	None Detected	ī	Binder
002	PV-01	Yellow Mastic	1	No Asbestos Detec	eted	None Detected	l	Adhesive
003	JJ-01 C	Tan Material	den	No Asbestos Detec	eted	Glass	80-90	Binder
004	CT-01	Black Mastic	1	No Asbestos Detec	ted	Manmade	2-3	Adhesive
005	CT-02	Brown Mastic	1	No Asbestos Detec	ted	Cellulose Wollastonite	<1 2-3	Adhesive
006	SH-01	Tan Floor Tile	1	Chrysotile	5-10	None Detected		Vinyl Binder
007	SH-01	Black Mastic	1	Chrysotile	3-5	Cellulose	<1	Adhesive
008	SH-02	Black Covebase	1	No Asbestos Detec	ted	None Detected		Vinyl Binder

Analytical Methods: EPA 600/M4-82-020, December 82, EPA 600/R-93/116, July 1993

Enclosed test results relates only to items tested.

This report shall not be reproduced, except in full without written approval of the laboratory.

This report can not be used to claim product endorsement by NVLAP or any agency of the U.S. Government.

Method limitations: Analysis of floor tile and other resinously bound materials by Polarized Light Microscopy (PLM) may yield false negative results due to method limitations. In these cases ATC recommends alternative methods of analysis.

For all heterogeneous samples easily separated into sub-samples each component will be analyzed separately. When layers cannot be separated without compromising the layer they will be analyzed as one sample. When a heterogeneous sample contains no asbestos in any layer reported results will be combined into one. When asbestos is detected in a layer or layers of a heterogeneous sample each individual layer will be reported separately.

ATC ASSOCIATES INC. **BULK SAMPLE ANALYSIS REPORT**

NVLAP Accredited NVLAP Code Number 101265-00

Date: July 24, 1997

Client: Alliance Indiana, Inc.

Project Identification:

NGR-00A02 - Greater Clark County Schools

1

Date Sample Received:

July 9, 1997

ATC Lab Batch Number:

971246

Lab

Laver(s) % Other Fibrous

Non-Fibrous

<u>ID</u> Client ID Color / Description

Asbestos Type

Material

Material

009 SH-02

Brown Mastic

No Asbestos Detected

Cellulose

<1

Adhesive

Scott Frosch (95)
Scott Frosch, Analyst

- Analytical Methods: EPA 600/M4-82-020, December 82, EPA 600/R-93/116, July 1993
- Enclosed test results relates only to items tested.
- This report shall not be reproduced, except in full without written approval of the laboratory.
- This report can not be used to claim product endorsement by NVLAP or any agency of the U.S. Government.
- Analysis of floor tile and other resinously bound materials by Polarized Light Microscopy (PLM) may yield false negative results due to method limitations. In these cases ATC recommends alternative methods of analysis.
- For all heterogeneous samples easily separated into sub-samples each component will be analyzed separately. When layers cannot be separated without compromising the layer they will be analyzed as one sample. When a heterogeneous sample contains no asbestos in any layer reported results will be combined into one. When asbestos is detected in a layer or layers of a heterogeneous sample each individual layer will be reported separately.

ALLIANCE INDIANA, INC.

1433 Sadlier Circle West Dr. Indianapolis, IN 46239 317/351-5600 Fax 317/351-5610 971246 7/9

Project Name- <u>Jesater Clark County Schoole</u>

Project Location
City/State- <u>Sellepsonville</u> Indiana

Project Number- NGR 00A02

Date- 3 July 97

Samples Collected By- Karen Jo ++

	•	· · · · · · · · · · · · · · · · · · ·
SAMPLE I.D. NUMBER	LOCATION OF SAMPLE	DESCRIPTION OF SAMPLE MATERIAL
PV-01	min Wall	martie M-NAD
JJ-01	borler	gasket NAD 19
CT-01	Main Hall	floor Tile Mastie NA
CT-OZ.	main Wall	Cove Base Mastic NA
SH-01	Classroom	Floor lile & FT - Chr 5-10 / martie M - Chr 3-5
SH-02	Classroom	Cove base & CR- NAD mastic M- NAD
		-022-9+
		1.73
		12
		<u> </u>

CHAIN OF CUSTODY

Sample By: KAREN FOXX
Date: 3 July 97
Signature: Kacan John
Date Shipped: 9 Quely 97

Received By: DC 247	Recorded By:	
Date: 7 9 9 7	Date:	Log#:
Signature: OPM	Signature:	
Shipped Via:	Shipped To:	

ANNUAL NOTIFICATIONS
ACCREDITATIONS
TRAINING
INFORMATION

Indiana Department of Environmental Management 100 N. Senate Avenue Mail Code 61-52 IGCN 1003 Indianapolis, IN 46204-2251

April 17, 2014

RECEIVED APR 22 2014



Benjamin S. Hood Alliance Environmental Group 5340 Commerce Circle, Ste E Indianapolis IN 46237

Re: Asbestos Inspector # 19A001039

Based upon the review of your license application, the Office of Air Quality has determined that you have fulfilled the requirements of 326 IAC 18 and are eligible for licensing in the following discipline:

Asbestos Inspector

Your Asbestos Inspector license is attached below. The license is waterproof and tear resistant. Please sign your license and do not laminate or alter your license in anyway. Your license must be available for review at all times while implementing an asbestos project. This license may be revoked, pursuant to 326 IAC 18-1-7, if you:

- (1) Violate any requirements of these rules (326 IAC 18), 326 IAC 14-10, or any requirement of the Asbestos-Containing Materials in Schools Rule or any other federal, state, or local regulation pertaining to asbestos in buildings or to asbestos projects.
- (2) Falsify information on your application for licensing.
- (3) Fail to meet any qualifications specified in 326-IAC 18-1-4.
- (4) Conduct asbestos project, or related asbestos handling activity, in a manner which is hazardous to the public health.

Your license is valid effective 05/05/2014, and will expire on 05/05/2015, as indicated on your card. We suggest that you attend the required training and submit an application for license renewal early to insure your license does not lapse. NOTE: 326 IAC 18-1-4(h) and 326 IAC 18-1-6(e) require that any individual who has an eighteen (18) month lapse between any two training courses of the same discipline to attend an initial training course for the discipline in which they are seeking a license. In order to avoid re-taking the initial training course you must have attended a refresher in the discipline you are seeking a license within eighteen (18) months from the date of issuance of your last training course certificate.

Office of Air Quality, Asbestos Licensina Section (317) 233-3861



Indiana Dept. of Environmental Management

Benjamin S. Hood

Asbestos Inspector License #: 19A001039

Effective: 05/05/2014

Expiration: 05/05/2015 Gender: M

Birth Date: 04/10/1978 Height: 6-00

Eye Color: Brown

Weight: 285

Hair Color: Brown

NOTICES

NOTIFICATION LOG

GREATER CLARK COUNTY SCHOOLS

DATE OF NOTIFICATION	<u>COPY IN BOOK</u>
YEAR	(X)
2009 2010 2011 2012	
2013 2014 2015	
2016 2017 2018 2019	
2020 2021 2022 2023	
2024 2025 2026	
2027 2028 2029 2030	

NOTIFICATION LOG

LEA Name - Greater Clark County Schools

Date of Notification	Copy of Notification in Supplemental Book?
1989	
1990	
1991	
1992	
1993	
1994	
1995	
1996	
1997	
1998	
1999	
2000	
2001	
2002	
2003	
2004	
2005	
2006	
2007	
2008	

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services at River Valley Middle School, which is located at 2220 Veteran's Parkway, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, Service Center, Corden Porter Storage, Auto Tech Program- Witten Property, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2015/2016 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- * The required triennial re-inspection will be performed in April 2016.
- * The required six month periodic surveillance was performed in October 2014.
- * The required six month periodic surveillance activities are scheduled for April and October each year.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2220 Veteran's Parkway, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, Corden Porter Storage, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2014/2015 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- * The required triennial re-inspection will be performed in April 2013.
- * The required six month periodic surveillance was performed in October 2013.
- * The required six month periodic surveillance activities are scheduled for April and October each year.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, Corden Porter Storage, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2013/2014 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- * The required triennial re-inspection will be performed in April 2013.
- * The required six month periodic surveillance was performed in October 2012.
- * The required six month periodic surveillance activities are scheduled for April and October each year.
- * Projects completed in 2012: Parkview Middle School.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2012/2013 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- * The required triennial re-inspection will be performed in June 2013.
- * The required six month periodic surveillance was performed in December 2011.
- * The required six month periodic surveillance activities are scheduled for June and December each year.
- * Projects completed in 2011: Options building and Parkwood Elementary.
- * Projects scheduled for 2012: Parkview Middle School and Bridgepoint Elementary.
- * Cordon Porter storage building was sold in 2012.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxillary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, Options and Corden Porter Center Buildings and Alternative School-

- * The required triennial reinspection will be performed in June 2013.
- * The required six month periodic surveillance was performed in December 2010.
- * The next scheduled activity is the required six month periodic surveillance in June 2011.
- * Charlestown High School asbestos removal project was completed in 2010.
- * Options Building is under renovation in 2011.
- * Parkwood Elementary is under renovation in 2011.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free and Riverside Elementary was demolished in 2006.

No surveillances or reinspections are required for these buildings.

March 2011

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxillary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection will be performed in June 2010.
- * The required six month periodic surveillance was performed in December 2009.
- * The next scheduled activity is the required six month periodic surveillance in December 2010.

 Charlestown High School is an ongoing asbestos removal project which will be complete prior to partial demolition.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free and Riverside Elementary was demolished in 2006. No surveillances or reinspections are required for these buildings.

March 2010

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2007.
- * The required six month periodic surveillance was performed in December 2008.
- * The next scheduled activities are the required six month periodic surveillance in June 2009 and Dec 2009. Charlestown High School has undergone an asbestos removal project prior to partial demolition.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free and Riverside Elementary was demolished in 2006. No surveillances or re-inspections are required for these buildings.

April 2009

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- Provide awareness training and additional training to selected school employees.
- Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number (812)288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2007.
- * The required six month periodic surveillance was performed in December 2007.
- * The next scheduled activities are the required six month periodic surveillance in June 2008 and Dec 2008.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free. Riverside Elementary was Demolition in 2006. No surveillances or reinspections are required.

April 2008

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required six month periodic surveillance was performed in June 2006.
- * The required six month periodic surveillance was performed in December 2006.
- * The next scheduled activities are the required six month periodic surveillance in June 2007 and Dec 2007.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free. Riverside Elementary was Demolition in 2006. No surveillances or reinspections are required.

March 2007

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2005.
- * The required six month periodic surveillance was performed in December 2005.
- * The next scheduled activities are the required six month periodic surveillance in June 2006 and Dec 2006.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free. No surveillances or reinspections are required.

March 2006

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2004.
- * The required six month periodic surveillance was performed in December 2004.
- * The next scheduled activities are the required six month periodic surveillance in June 2005 and December 2005.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

* These buildings are asbestos free. No surveillances or reinspections are required.

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required six month periodic surveillance was performed in June 2003.
- * The required six month periodic surveillance was performed in December 2003.
- * The next scheduled activities are the required triennial reinspection in June 2004 and a required six month periodic surveillance in December 2004.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

* These buildings are asbestos free. No surveillances or reinspections are required.

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required six month periodic surveillance was performed in June 2002.
- * The required six month periodic surveillance was performed in December 2002.
- * The next scheduled activity is the required periodic surveillance in June 2003.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

* These buildings are asbestos free. No surveillances or reinspections are required.

May 2003

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in July 2001.
- * The required six month periodic surveillance was performed in December 2001.
- * The next scheduled activities are the required periodic surveillances in June 2002 and December 2002.

Pleasant Ridge Elementary School and (New) Utica Elementary School -

* These buildings are asbestos free. No surveillances or reinspections are required.

(Old) Utica Elementary School -

* In accordance with information collected from the GCCS this building has been deeded to the town of Utica. No further AHERA periodic surveillances or triennial reinspections will be conducted by the designated person.

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, (Old) Utica, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center -

- * The required six month periodic surveillance was performed in June 2000.
- * The required six month periodic surveillance was performed in January 2001.
- * The next scheduled activity is a required triennial reinspection in June 2001.

Pleasant Ridge Elementary School and (New) Utica Elementary School -

* This building is asbestos free. No surveillances or reinspections are required.

June 2001

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, Utica, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center -

- * The required six month periodic surveillance was performed in June 1999.
- * The required six month periodic surveillance was performed in December 1999.
- * The next scheduled activity is a required periodic surveillance in June 2000.

Pleasant Ridge Elementary School -

* This building is asbestos free. No surveillances or reinspections are required.

June 2000

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required six month periodic surveillance was performed in June 1998.
- * The required six month periodic surveillance was performed in December 1998.
- * The next scheduled activity is a required periodic surveillance in June 1999.

Parkwood Elementary School

* O & M was performed in the boiler room in May 1998.

June 1999

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1997 and December 1997.
- * Next activity scheduled activity is a required third year reinspection in June 1998.

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available, should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1996 and December 1996.
- * The next required periodic surveillance will be performed in June 1997 and December 1997.

June 97

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Denny Johanson at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All buildings where it is required -

- * The required third year reinspection was performed in June 1995.
- * The required periodic surveillance was performed in December 1995.
- * Next activity scheduled is a periodic surveillance in June 1996.

Charlestown High School -

* Transite panels were compliantly removed from the exterior of the building.

Corden Porter Building #3 -

* TSI was compliantly removed from the boiler room.

June 96

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available, should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Dennis Johanson at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1995 and December 1995.
- * The required triennial reinspection was performed in June 1995.
- * The next required periodic surveillance will be performed in June 1996 and December 1996.

June 95

ACCREDITATIONS



Environmental Management Institute

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846 www.envtlmgmt.org

This confirms that

Sandy Shadley

Completed the Required Initial Training for
Asbestos Accreditation Under TSCA Title II
and has
passed with a Score of 70 or Greater the Examination for

Asbestos Management Planner

Course Date
December 10 - 11, 2009

Examination Date

2000 December 11

Jack E. Leonard, President

Certificate: MP(I) 2248

Expires: December 11, 2010

Approved by::

Illinois Department of Public Health

Indiana Department of Environmental Management

Indiana Department of Environmental Management 100 N. Senate Avenue Mail Code 61-52 IGCN 1003 **dianapolis, IN 46204-2251

January 21, 2010

RECEIVED JAN 23 2010

Sandra S. Shadley Alliance Environmental Grp 5340 Commerce Circle Ste E Indianapolis IN 46237



Re: Asbestos Management Planner # 19A002720

Based upon the review of your license application, the Office of Air Quality has determined that you have fulfilled the requirements of 326 IAC 18 and are eligible for licensing in the following discipline:

Asbestos Management Planner

Your Asbestos Management Planner Ilcense is attached below. The license is waterproof and tear resistant. Please sign your license and do not laminate or alter your license in anyway. Your license must be available for review at all times while implementing an asbestos project. This license may be revoked, pursuant to 326 IAC 18-1-7, if you:

- (1) Violate any requirements of these rules (326 IAC 18), 326 IAC 14-10, or any requirement of the Asbestos-Containing Materials in Schools Rule or any other federal, state, or local regulation pertaining to asbestos in buildings or to asbestos projects.
- (2) Falsify information on your application for licensing.
- (3) Fail to meet any qualifications specified in 326-IAC 18-1-4.
- (4) Conduct asbestos project, or related asbestos handling activity, in a manner which is hazardous to the public health.

Your license is valid effective 01/21/2010, and will expire on 01/21/2011, as indicated on your card. We suggest that you attend the required training and submit an application for license renewal early to insure your license does not lapse. NOTE: 326 IAC 18-1-4(h) and 326 IAC 18-1-6(e) require that any individual who has an eighteen (18) month lapse between any two training courses of the same discipline to attend an initial training course for the discipline in which they are seeking a license. In order to avoid re-taking the initial training course you must have attended a refresher in the discipline you are seeking a license within eighteen (18) months from the date of issuance of your last training course certificate.

Office of Air Quality, Asbestos Licensing Section (317) 233-3861



Indiana Dept. of Environmental Management

Sandra S. Shadley


Asbestos Management Planner License #: 19A002720


Effective: 01/21/2010

Expiration: 01/21/2011


Birth Date: 04/21/1959 Height: 5-08 Gender: F

Height: 5-08 Weight: 140 Eye Color: Blue Hair Color: Brown

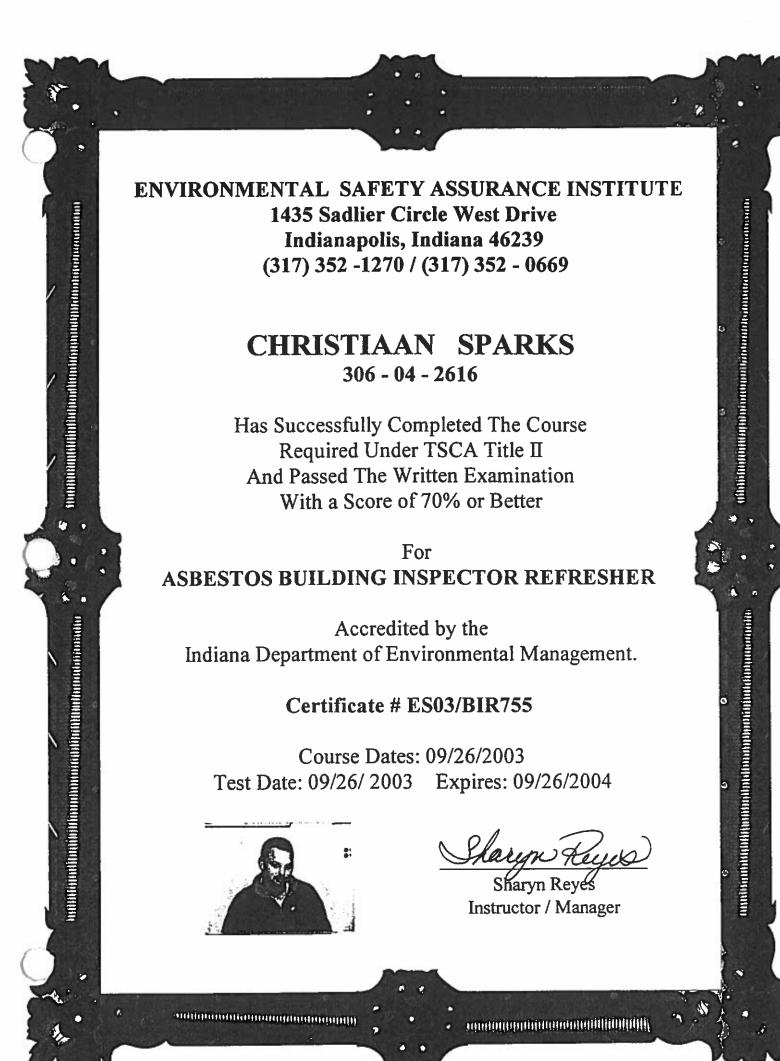

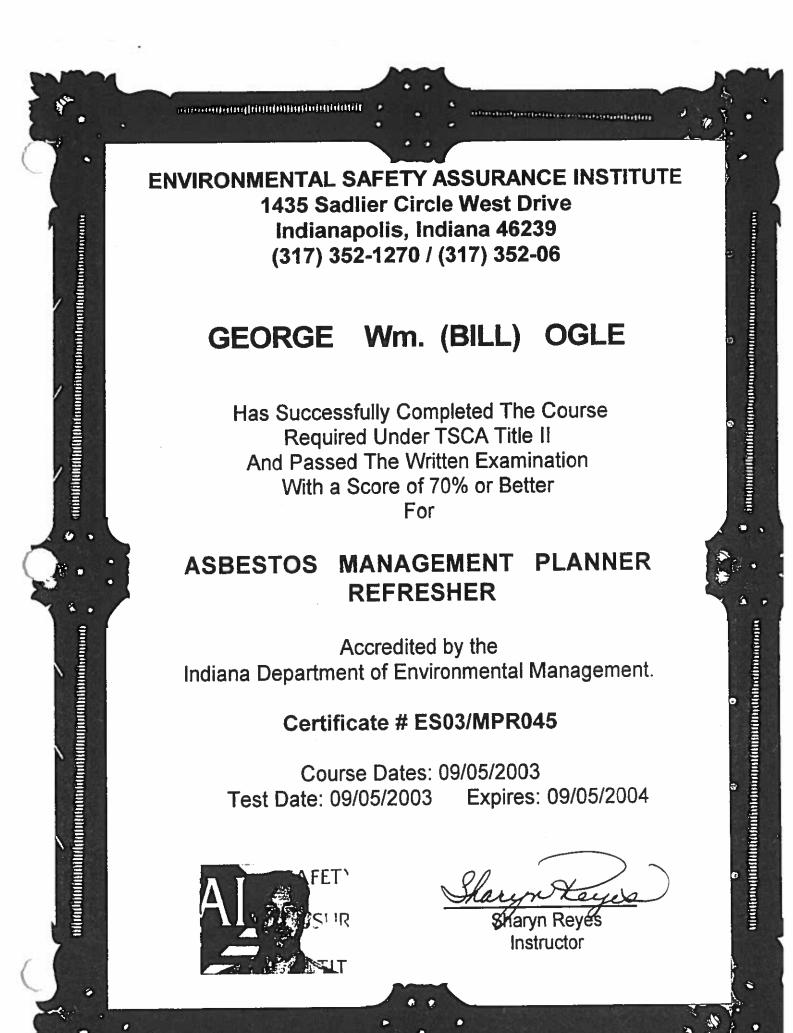





PATRICK E. WILSON 309 - 90 - 6909

Has Successfully Completed The Course Required Under TSCA Title II And Passed The Written Examination With a Score of 70% or Better For

ASBESTOS BUILDING INSPECTOR REFRESHER

Accredited by the Indiana Department of Environmental Management.

Certificate # ES00/BIR482

Course Dates: 11/29/2000

Test Date: 11/29/2000 Expires: 11/29/2001

Sharyn Reyes

Instructor

អាសាសាអាជាពីព្រៃអាស្តាំការអាលាលលេខបានការការការអាសាសា



Environmental Management Institute

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846 www.spea.iupui.edu/Envtl_mgmt

This confirms that

George Wm. (Bill) Ogle

Completed the Requisite Initial Training for Asbestos Accreditation Under TSCA Title II and has Passed with a Score of 70 or Greater the Examination for

Asbestos Management Planner

Course date March 2 - 3, 2000

Examination Date March 3, 2000


Jack E. Leonard, President

Certificate: MP(I) 2157 Expires March 3, 2001

Approved by:

Illinois Department of Public Health

Indiana Department of Environmental Managemen



CLINT YATES

316 - 92 - 7065

Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better
For

ASBESTOS BUILDING INSPECTOR REFRESHER

Accredited by the Indiana Department of Environmental Management.


Certificate # ES/BIR98/004.


Course Dates: 01/22/98 - 01/22/98

Test Date: 01/22/98 Expires: 01/22/99

Slaryn Reyco

Assistant / Instructor

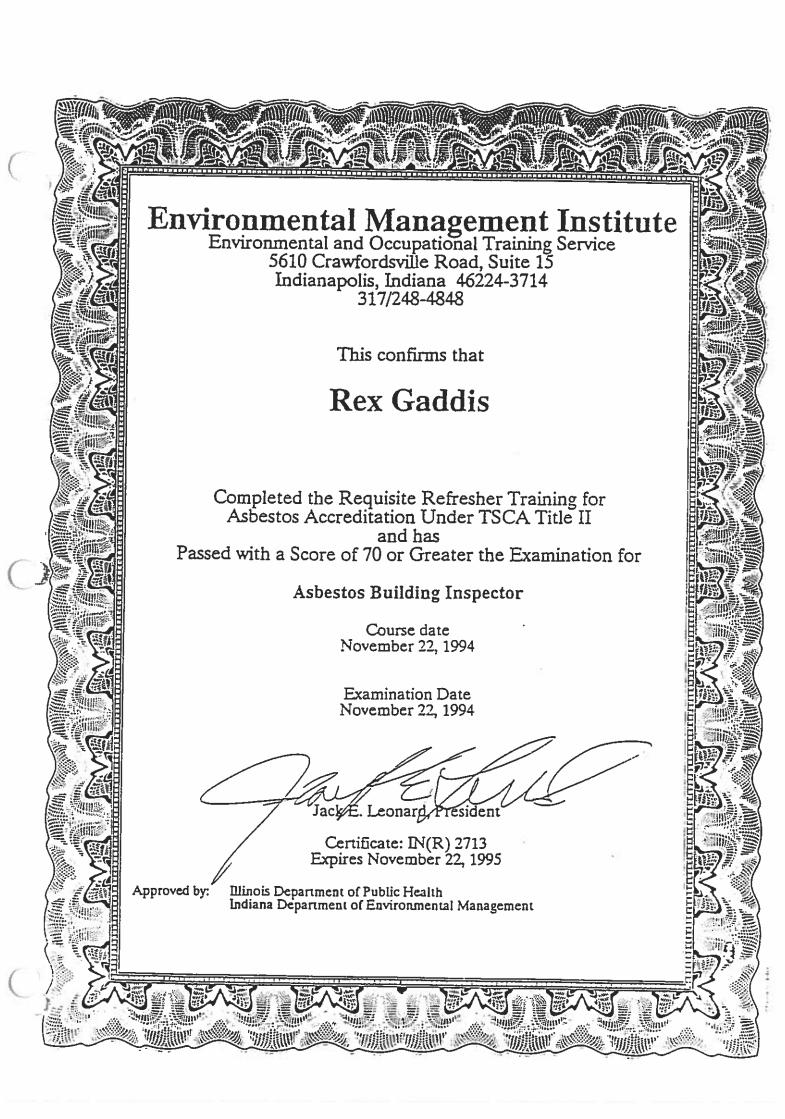

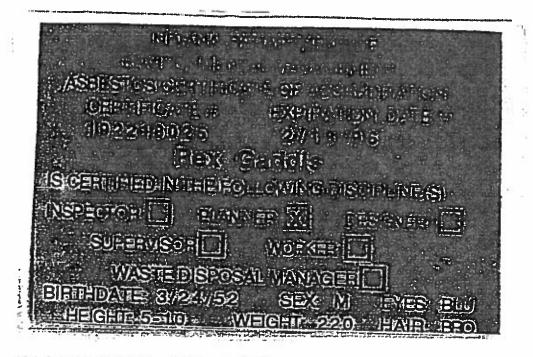

INDIANA DEPARTMENT OF
TO A DETAIL MENT OF THE PROPERTY OF THE PROPER
ENVIRONMENTAL MANAGEMENT AND ASSESSED
ASBESTOS CERTIFICATE OF ACCREDITATION / FULL
OF THE STATE OF AUCHEUITATION SEEDING
CERTIFICATE # EXPIRATION DATE 2
. 190900082 3//16/96
Rex Gaddis
IS CEDTIFIED WITH THE PARTY OF
ASCERIFEDINATHEFOLLOWING DISCIPLINES)
INSPECTOR X PLANNER DESIGNER DESIGNER
DESIGNER IN THE
SUPERVISOR WORKER
WASTE DISPOSAL MANAGER
DIDTIID TOOL DISTOSAL MANAGER
BIRTHDATE: 3/24/52 SEX: M EYES: BLU
HEIGHT: 5-10 WEIGHT: 220 HAIR: BRO
A TO THE TOTAL A TENTE OF THE T

TRAINING

OPERATIONS AND MAINTENANCE INFORMATION

MINOR FIBER RELEASE EPISODE

The local education agency shall ensure that the procedures described below are followed in the event of a minor fiber release episode (i.e., the falling or dislodging of not more than 3 square or linear feet of friable ACBM):

- 1. Thoroughly saturate the debris using wet methods.
- 2. Clean the area using wet methods, protective clothing, HEPA-vacuums, mini-enclosures, glove bags, as necessary to inhibit the spread of any released fibers. At a minimum, workers should use air-purifying respirators with HEPA filters.
- 3. Place the asbestos debris in a sealed, leak-tight container, preferably a 6 mil. labeled plastic bag.
- 4. Repair the area of damaged ACM with materials such as asbestosfree spackling, plaster, cement, or insulation, or seal with latex paint or an encapsulant, or immediately have the appropriate response action implemented.
- 5. Each fiber release episode should be documented.

MAJOR FIBER RELEASE EPISODE

The local education agency shall ensure that the procedures described below are followed in the event of a major fiber release episode (i.e., the falling or dislodging of more than 3 square or linear feet of friable ACBM):

- 1. Restrict entry into the area and post signs to prevent entry into the area by persons other than those necessary to perform the response action.
- 2. Shut off or temporarily modify the air-handling system to prevent the distribution of fibers to other areas in the building.
- 3. AHERA requires that major fiber release episodes be designed by accredited Project Designers. However, the following response procedures should form the basis for response actions.
- 4. All the procedures recommended by EPA and required by OSHA for large-scale removal of ACM should be used. These include containment barrier, negative pressure ventilation, personal respiratory protection and protective clothing, decontamination facilities, and air testing.
- 5. Workers should wear "type C" respirators and protective clothing, including a body suit, hood, boots and gloves. Personal air monitoring may be conducted on representative workers, but is not required by OSHA when "type C" respirators are used.
- 6. Fallen debris should be sprayed with amended water and placed in plastic bags for disposal. Shovels are useful for collecting the debris. The floor should be thoroughly cleaned with a HEPA vacuum cleaner.
- 7. Walls, ceiling, pipes, boilers, or other surfaces where ACM was damaged or delaminated should be repaired temporarily. This might involve replastering with asbestos-free material, spraying with an encapsulant, or taping with duct tape. In some cases, ACM beyond the immediate area of damage may need to be removed to prevent additional episodes.
- 8. The air should be tested for asbestos fibers before the plastic barriers are removed and the area reoccupied. Testing should follow guidelines in Chapter 6 of the Purple Book and Chapter 4 of the Silver Book. That is, air should be sampled at the specified number of locations and analyzed by either phase contrast microscopy or transmission electron microscopy. However, sampling should not be done aggressively since the use of blowers and fans may dislodge fibers from the remaining ACM.

- 9. After the barriers have been taken down, a decontamination of the entire building or a portion of it should be considered. The need for this will depend on how rapidly the response team reacted to the episode and, in particular, how quickly the HVAC system was turned off. A thorough decontamination includes HEPA-vacuuming and/or wet wiping all carpets, furniture, and other surfaces. Decontamination of the HVAC system would involve disassembling and cleaning (HEPA-vacuuming or wet wiping) ducts, ventilators, registers, and other system parts. System filters should also be removed and replaced.
- 10. All equipment used in the cleanup operation should be washed or wiped with damp cloths. All disposable materials (e.g., cloths, mop heads, filters, coveralls) should be discarded as asbestos wastes.
- 11. Each fiber release episode should be documented.

OPERATIONS AND MAINTENANCE REPORT

(Use only for O&M work less than 3 square or 3 linear feet)

L.E.	A.:				
					psulation LF _LF _LF A Vacuum Enclosure
DAT	E:	formation is provided in accordance with 40 CFR 763.91 and 763.94. neous Area/Material Description E: Clean Repair Encapsulation Enclosure Removal Scription: Start Stop Start Stop Surface SF Thermal LF SF or LF Control Method: Wet Methods Glovebag Mini-Enclosure			
			provided in accordance with 40 CFR 763.91 and 763.94. Material Description		
1.	Location:	-			
2.	Response:	Clean	Repair	_ Encaps	ulation
		Enclosure _	Removal		
3.	Work Descri	ption:			
4.	Date:	Start		Stop	<u></u>
	Time:	Start		Stop	
5.	Material:	Surface	SF	Thermal	LF
	Other:		SF or		LF
6.	Asbestos Control Method:		Wet Methods	HEPA V	acuum
			Glovebag	Mini-End	closure
7.	Respiratory F	Protection:	N.A.P.R	P.A.P.R	
	Were all emp	oloyees proper	ly fit tested? YES	NO NOT	APPLICABLE

8.	Equipment Used:					
	Low Vol. Pumps FAM HEPA Vac		High AFD	Vol. Pumps		_
	Other:				_	
9.	Material Used:					
	6 Mil. Disposable Bags Glovebags Duct Tape Disposable Coveralls Sponges		Poly HEPA Filters Spray Glue 3M Pads			
	Encapsulants: Penet	rating	Bridging	_		
	Other:					
10.	Work Personnel:					
	NAME		16 HOUR TE	RAINED - IDEN	<u>/ ACCF</u>	REDITED
Supe	rvisor:	<u> </u>	YES	NO	YES	<u>NO</u>
Work	er(s):	<u> </u>	YES	NO	YES	NO
			YES	NO	YES	NO
			YES	NO	YES	<u>NO</u>
			YES	NO	YES	<u>NO</u>
			YES	NO	YES	NO
11.	ACBM Disposal: Storag		O_, If yes, whe			
12.	Final Visual Inspection Appr	oved:				
		(LEA	Designated Pe	rson - Signatu	re)	

REMOVAL PROJECT INFORMATION

SHORT TERM WORKER PROGRAM

Greater Clark County Schools

Short Term Worker

GREATER CLARK COUNTY SCHOOLS

SHORT-TERM WORKER SIGN OFF SHEET

This form should be signed each and every time before a "short-term worker" (telephone repair worker, utility worker, etc.) performs work that may cause him to come in contact with ACBM or suspected ACBM assumed to be ACM. One copy of this form should then be forwarded to the LEA designated person, and one copy should be maintained in the school building's copy of the supplemental binder provided by Alliance Indiana, Inc., in order to fulfill the LEA's recordkeeping requirements. The third copy should be forwarded to Alliance Indiana, Inc. for placement in its copy of the supplemental binder.

School Building Name - <u>Jonathan Jennings Elementary School</u> Date
I certify that before performing any work which would possibly cause me to come in contact with Asbestos Containing Building Materials (ACBM), I was provided with adequate information regarding the locations of ACBM and suspected ACBM assumed to be ACM in the above-mentioned school building where I performed the work.
Signature -
Company
Description of work (including number of days on site) -

Alliance	Indiana.	Inc
Allialice	madiana.	1110.

GREATER CLARK COUNTY SCHOOLS

SHORT-TERM WORKER SIGN IN LOG

ALL SHORT-TERM WORKERS MUST S	IGN THIS LOG CONFIRMING	3 THAT THEY HAVE SIGN	IED A "SHORT-
TERM WORKER SIGN OFF SHEET"			

BUILDING	NAME - Jonathan Jenning	s Elementary School	
ATE	NAME(print)	COMPANY	SIGNATURE
		27	
	10410		
			24/cdisate 0.02/d
- 8			
		26	
-		WE 37 9 19 19 19 19 19 19 19 19 19 19 19 19 1	
	inches in	<u> </u>	
areater C	ark County Schools		Short Term Work