

THE ENVIRONMENTAL SOLUTION

GREATER CLARK COUNTY SCHOOLS

NORTHHAVEN ELEMENTARY SCHOOL

AHERA

ASBESTOS MANAGEMENT PLAN

DESIGNATED PERSON TRUTH AND CORRECT STATEMENT

Local Education Agency –	Greater Clark County Schools 2112 Utica-Sellersburg Road Jeffersonville, Indiana 47130
Designated Person -	Alliance Environmental Group, Inc. Sandra Shadley 5153 Commerce Square Drive, Suite E Indianapolis, Indiana 46237

This Truth and Correct Statement, as outlined in 40 CFR 763.93(i), certifies that the general, local education agency responsibilities, as stipulated by 40 CFR 763.84, have been or will be met. These responsibilities include:

- 1. Ensure that the activities of any persons who perform inspections, reinspections, and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with 40 CFR 763 Subpart E.
- 2. Ensure all custodial and maintenance employees are properly trained as required by 40 CFR 763 Subpart E and other applicable Federal and/or State regulations (e.g., the Occupational Safety and Health Administration Asbestos Standard for Construction, the EPA Worker Protection Rule, or applicable State regulations).
- 3. Ensure that workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress.
- 4. Ensure that short-term workers (e.g., telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.
- 5. Ensure that warning labels are posted in accordance with Section 763.95.
- 6. Ensure management plans are available for inspection and notification of such availability has been provided as specified in the management plan under Section 763.93(g).
- 7. The undersigned person designated by the LEA pursuant to Section 763.84(g) (1) has received adequate training as stipulated in Section 763.84(g) (2).
- 8. The LEA has and will consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under Part 763.

Shadlee)and Date: November 6, 2016 Signature:

Sandra S. Shadley

ASBESTOS PROGRAM MASTER INDEX

The following volumes are part of the Asbestos Program for the **GREATER CLARK COUNTY SCHOOLS**:

- A. Original Asbestos Management Plan for each school building.
- B. Asbestos Management Plan Supplement for each school building.
 - 1. Amendments to Management Plan
 - 2. Remaining Materials Report
 - 3. Surveillance, Reinspection and Additional Bulk Sampling Information
 - 4. Annual Notifications, Accreditations and Training Records
 - 5. Operations and Maintenance Records
 - 6. Asbestos Removal Projects
 - 7. Short Term Worker Program

Copies of both volumes are found in the respective buildings. The Administration Building also contains duplicate copies of both volumes for each building in their entirety.

GREATER CLARK COUNTY SCHOOLS NORTHAVEN ELEMENTARY SCHOOL TABLE OF CONTENTS

AMENDMENTS TO MANAGEMENT PLAN	1
REMAINING MATERIALS REPORT	2
SURVEILLANCE, REINSPECTION AND ADDITIONAL BULK SAMPLING INFORMATION	3
ANNUAL NOTIFICATIONS, ACCREDITATIONS, AND TRAINING	4
OPERATIONS AND MAINTENANCE RECORDS	5
ASBESTOS REMOVAL PROJECTS	6
SHORT TERM WORKER INFORMATION	7

(

AMENDMENTS TO THE MANAGEMENT PLAN

Greater Clark County Schools

AHERA Program

GREATER CLARK COUNTY SCHOOLS NORTHAVEN ELEMENTARY SCHOOL

LEA RESPONSIBILITY CERTIFICATION

LEA Designated Person - ALLIANCE INDIANA, INC.

Signature - Bruce Wallace, President/CEO

May 1, 1995 Date

ACCREDITATION STATEMENT

The Greater Clark County Schools ensures that the following items will be carried out:

Activities of any persons who perform inspections, reinspections, and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with Subpart E of this part.

All custodial and maintenance employees are properly trained as required by this Subpart E and other applicable Federal and/or State regulations (e.g., the OSHA asbestos standard for construction, the EPA worker protection rule, or applicable State regulations).

Workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, and post response action activities, including periodic reinspection and surveillance activities that are planned or in progress.

Short-term workers (e.g., telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.

Warning labels are posted in accordance with 763.95.

Management plans are available for inspection and notification of such availability has been provided as specified in the management plan under 763.93(g).

Designate a person to ensure that requirements under this section are properly implemented.

Designated person receives adequate training to perform duties assigned under this section. Such training shall provide, as necessary, basic knowledge of:

Health effects of asbestos

Detection, identification, and assessment of ACM

Options for controlling ACBM

Asbestos management programs

Relevant Federal and State regulations concerning asbestos, including those in this Subpart E and those of the OSHA, U.S. Department of Labor, the U.S. Department of Transportation and the u.S. Environmental Protection Agency.

Consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under this subpart.

AMENDMENT TO THE MANAGEMENT PLAN

Greater Clark County Schools

LEA Name -

Building -Northaven Elementary School

Subject -LEA Designated Person Change

> Effective May 1, 1995 the Designated Person for the Greater Clark County Schools is:

Alliance Indiana, Inc. 1433 Sadlier Circle West Drive Indianapolis, Indiana 46239 (317) 351-5600

Management Planner: Rex Gaddis Accreditation No. 192218025

> X Xladdan

Signature

May 1, 1995 Date

Indianapolis, Indiana

AMENDMENT TO THE AHERA MANAGEMENT PLAN

Building - Northaven Elementary School

Subject- New material

Reference - HA B Cove Base

Original Assessment - No assessment in original inspection.

Amended Assessment - The cove base in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025

of Xaddes

Signature

7/5/95

Date

AMENDMENT TO THE AHERA MANAGEMENT PLAN

Building - Northaven Elementary School

Subject- New material

Reference - HA C Cove Base Mastic

Original Assessment - No assessment in original inspection.

Amended Assessment - The cove base mastic in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025

et Xadda

Signature

9/5/95

Date

Indianapolis, Indiana

AMENDMENT TO THE AHERA MANAGEMENT PLAN

Building -Northaven Elementary School

Subject-New material

Reference - HA A Transite Walls

Original Assessment - No assessment in original inspection.

Amended Assessment - Some walls at the entry and in the cafeteria may be transite. This material often contains asbestos. This was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025

V XTadas

Signatúre

9/5/95

AMENDMENT TO THE AHERA MANAGEMENT PLAN

Building - Northaven Elementary School

Subject- New material

Reference - HA D Transite Walls

Original Assessment - No assessment in original inspection.

Amended Assessment - The moveable walls between some classrooms in the building often contain transite. This was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025

at Staddos

Signatúre

Date

AMENDMENT TO MANAGEMENT PLAN

Building Name -Northaven Elementary School

Subject -Removal of Homogeneous Areas from Management Plan

Amendment -Homogeneous area designation "A" covering transite panels at entryway and possibly in cafeteria will be removed from the Management Plan. This material was inspected and found to be plywood (at entryway) and drywall (in cafeteria). These materials area not suspect for asbestos content.

> Homogeneous area designation "D" covering movable walls between two classrooms will be removed from the Management Plan. It was suspected that the walls were made of transite material. Upon closer inspection it was found that the walls are constructed of metal. These walls are not suspect for asbestos content.

Management Planner: George Wm. Ogle

Accreditation Number: 191928071

ge W Vale Signature

06 Aucenter 2000

Date

Amendment

Alliance Environmental Group, Inc.

AHERA

AMENDMENT TO MANAGEMENT PLAN

Greater Clark County Schools

LEA Name -

Subject - LEA Designated Person Change

Amendment -

County Schools is: Alliance Environmental Group, Inc. 5340 Commerce Circle, Suite E Indianapolis, Indiana 46237 (317) 865-3400

Personnel contributing to this Management Plan are licensed in according with 40 CFR 763.93(e)(12).

Effective March 2005, the Designated Person for the Greater Clark

Management Planner: Sandra S. Shadley

Accreditation Number: 19A002720

Signature

Amendment

Alliance Environmental Group, Inc.

AMENDMENT TO MANAGEMENT PLAN

Building Name -Northaven Elementary School

Subject -Addition of Homogeneous Area E

Amendment -Fire doors were found throughout the building that were not included in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Management Planner: Sandra Shadley

Accreditation Number: 19A002720

adl anature

cember 2011 Date

Greater Clark County Schools

Alliance Environmental Group, Inc.

AMENDMENT TO MANAGEMENT PLAN

Northaven Elementary School **Building Name -**

Subject -Addition of Homogeneous Area F

White sink insulation was not included in the original inspection. This Amendment material is suspect to contain asbestos; therefore, it is being added to the management plan until properly sampled.

Management Planner: Sandra Shadley

Accreditation Number: 19A002720

hadly MS Signature

2011 cen les 0 Date

AHERA

Greater Clark County Schools

REMAINING MATERIALS

Greater Clark County Schools

AHERA Program

Remaining Materials Report

4/23/2020

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action				
Northhaven Elementary School										
06	Floor Tile Mastic	15190	SF	Assumed	Throughout building	O&M				
В	Cove base molding (brown)	Approx. 1650	LF	Assumed	Throughout the building (except the gymnasium)	0&M				
С	Cove Base Mastic	Approx. 1200	SF	Assumed	Throughout building	O&M				
E	Fire Rated Doors	Unquantified	Unit(s)	Assumed	Throughout the building except Rooms 113, 116 and 120.	0&M				
F	Sink Insulation	Unquantified	SF	Assumed	Classrooms	0&M				
FT-01	9" x 9" Off-White with Streaks and Splotches Floor Tile	Unquantified	SF	Assumed	Cafeteria, Nurse, Artroom, Closet, Stage and Storage Room, Workrooms of Main Office	O&M				
FTM-01	Mastic Associated with 9" x 9" Off- White with Streaks and Splotches Floor Tile	Unquantified	SF	Assumed	Cafeteria, Nurse, Artroom, Closet, Stage and Storage Room, Workrooms of Main Office	O&M				

Remaining Materials Report

1/14/2020

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action				
Northhaven Elementary School										
06	Floor Tile Mastic	15190	SF	Assumed	Throughout building	O&M				
В	Cove base molding (brown)	Approx. 1650	LF	Assumed	Throughout the building (except the gymnasium)	0&M				
С	Cove Base Mastic	Approx. 1200	SF	Assumed	Throughout building	O&M				
E	Fire Rated Doors	Unquantified	Unit(s)	Assumed	Throughout the building except Rooms 113, 116 and 120.	O&M				
F	Sink Insulation	Unquantified	SF	Assumed	Classrooms	O&M				
FT-01	9" x 9" Off-White with Streaks and Splotches Floor Tile	Unquantified	SF	Assumed	Cafeteria, Nurse, Artroom, Closet, Stage and Storage Room, Workrooms of Main Office	O&M				
FTM-01	Mastic Associated with 9" x 9" Off- White with Streaks and Splotches Floor Tile	Unquantified	SF	Assumed	Cafeteria, Nurse, Artroom, Closet, Stage and Storage Room, Workrooms of Main Office	O&M				

Remaining Materials Report

5/16/2019

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
Northha	ven Elementary School					
06	Floor Tile Mastic	15190	SF	Assumed	Throughout building	0&M
В	Cove base molding (brown)	Approx. 1650	LF	Assumed	Throughout the building (except the gymnasium)	0&M
С	Cove Base Mastic	Approx. 1200	SF	Assumed	Throughout building	0&M
Е	Fire Rated Doors	Unquantified	Unit(s)	Assumed	Throughout the building except Rooms 113, 116 and 120.	0&M
F	Sink Insulation	Unquantified	SF	Assumed	Classrooms	0&M

Remaining Materials Report

11/13/2018

HA ID	HA Description	Quant	ity	Asbestos	HA Location	Plannned Response Action
Northha	ven Elementary School					
06	Floor Tile Mastic	15190	SF	Assumed	Throughout building	0&M
В	Cove base molding (brown)	Approx. 1650	LF	Assumed	Throughout the building (except the gymnasium)	0&M
С	Cove Base Mastic	Approx. 1200	SF	Assumed	Throughout building	0&M
E	Fire Rated Doors	Unquantified	Unit(s)	Assumed	Throughout the building except Rooms 113, 116 and 120.	0&M
F	Sink Insulation	Unquantified	SF	Assumed	Classrooms	0&M

Remaining Materials Report

5/2/2018

HA ID	HA Description	Quant	Quantity		HA Location	Plannned Response Action
Northhav	ven Elementary School					
06	Floor Tile Mastic	15190	SF	Assumed	Throughout building	0&M
В	Cove base molding (brown)	Approx. 1650	LF	Assumed	Throughout the building (except the gymnasium)	O&M
С	Cove Base Mastic	Approx. 1200	SF	Assumed	Throughout building	0&M
E	Fire Rated Doors	Unquantified	Unit(s)	Assumed	Throughout the building except Rooms 113, 116 and 120.	0&M
F	Sink Insulation	Unquantified	SF	Assumed	Classrooms	0&M

Remaining Materials Report

10/18/2017

HA ID	HA Description	Quantit	ty	Asbestos	HA Location	Plannned Response Action
Northhave	en Elementary School					
06	Floor Tile Mastic	15190	SF	Assumed	Throughout building	0&M
В	Cove base molding (brown)	Approx. 1650	LF	Assumed	Throughout the building (except the gymnasium)	0&M
С	Cove Base Mastic	Approx. 1200	SF	Assumed	Throughout building	0&M
E	Fire Rated Doors	Unquantified	Unit(s)	Assumed	Throughout the building except Rooms 113, 116 and 120.	0&M
F	Sink Insulation	Unquantified	SF	Assumed	Classrooms	0&M

Remaining Materials Report

4/13/2017

HA ID	HA Description	Quantit	ty	Asbestos	HA Location	Plannned Response Action
Northhave	en Elementary School					
06	Floor Tile Mastic	15190	SF	Assumed	Throughout building	0&M
В	Cove base molding (brown)	Approx. 1650	LF	Assumed	Throughout the building (except the gymnasium)	0&M
С	Cove Base Mastic	Approx. 1200	SF	Assumed	Throughout building	O&M
E	Fire Rated Doors	Unquantified	Unit(s)	Assumed	Throughout the building except Rooms 113, 116 and 120.	0&M
F	Sink Insulation	Unquantified	SF	Assumed	Classrooms	0&M

Remaining Materials Report

11/3/2016

HA ID	HA Description	Quantity	Asbestos	HA Location	Plannned Response Action
Northhav	en Elementary School				
06	Floor Tile Mastic	15190 SF	Assumed	Throughout building	0&M
В	Cove base molding (brown)	Approx. 1650 LF	Assumed	Throughout the building (except the gymnasium)	0&M
С	Cove Base Mastic	Approx. 1200 SF	Assumed	Throughout building	0&M
E	Fire Rated Doors	Unquantified Un	it(s) Assumed	Throughout the building except Rooms 113, 116 and 120.	0&M
F	Sink Insulation	Unquantified SF	Assumed	Classrooms	0&M

Remaining Materials Report

4/28/2016

HA ID	HA Description	Quantit	ty	Asbestos	HA Location	Plannned Response Action
Northhav	en Elementary School					
06	Floor Tile Mastic	15190	SF	Assumed	Throughout building	0&M
В	Cove base molding (brown)	Approx. 1650	LF	Assumed	Throughout the building (except the gymnasium)	0&M
С	Cove Base Mastic	Approx. 1200	SF	Assumed	Throughout building	0&M
E	Fire Rated Doors	Unquantified	Unit(s)	Assumed	Throughout the building except Rooms 113, 116 and 120.	0&M
F	Sink Insulation	Unquantified	SF	Assumed	Classrooms	0&M

Remaining Materials Report

10/20/2015

HA ID	HA Description	Quantit	ty	Asbestos	HA Location	Plannned Response Action
Northhav	en Elementary School					
06	Floor Tile Mastic	15190	SF	Assumed	Throughout building	0&M
В	Cove base molding (brown)	Approx. 1650	LF	Assumed	Throughout the building (except the gymnasium)	0&M
С	Cove Base Mastic	Approx. 1200	SF	Assumed	Throughout building	O&M
E	Fire Rated Doors	Unquantified	Unit(s)	Assumed	Throughout the building except Rooms 113, 116 and 120.	0&M
F	Sink Insulation	Unquantified	SF	Assumed	Classrooms	0&M

Greater Clark County Schools Remaining Materials Report April 22, 2015

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Northav</u>	en Elementary School				
06	Floor tile mastic	15,190 SF	А	Throughout the building	O & M
В	Cove base molding (brown)	Approx. 1,650 LF	A	Throughout the building (except the gymnasium)	O & M
С	Cove base mastic	Approx. 1,200 SF	А	Throughout the building	O & M
E	Fire Rated Doors	Unquantified Eac	A	Throughout the building except Rooms 113, 116 and 120.	O & M
F	Sink Insulation	Unquantified LF	А	Classrooms	O & M

Greater Clark County Schools Remaining Materials Report October 22, 2014

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Northav</u>	en Elementary School				
06	Floor tile mastic	15,190 SF	А	Throughout the building	O & M
В	Cove base molding (brown)	Approx. 1,650 LF	A	Throughout the building (except the gymnasium)	O & M
С	Cove base mastic	Approx. 1,200 SF	А	Throughout the building	O & M
Е	Fire Rated Doors	Unquantified Eac	A	Throughout the building except Rooms 113, 116 and 120.	O & M
F	Sink Insulation	Unquantified LF	А	Classrooms	O & M

Greater Clark County Schools Remaining Materials Report April 21, 2014

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Northav</u>	en Elementary School				
06	Floor tile mastic	15,190 SF	А	Throughout the building	O & M
В	Cove base molding (brown)	Approx. 1,650 LF	A	Throughout the building (except the gymnasium)	O & M
С	Cove base mastic	Approx. 1,200 SF	А	Throughout the building	O & M
E	Fire Rated Doors	Unquantified Eac	A	Throughout the building except Rooms 113, 116 and 120.	O & M
F	Sink Insulation	Unquantified LF	А	Classrooms	O & M

Greater Clark County Schools Remaining Materials Report October 24, 2013

·_/

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Northa</u>	ven Elementary School				
06	Floor tile mastic	15,190 SF	А	Throughout the building	O & M
В	Cove base molding (brown)	Approx. 1,650 LF	A	Throughout the building (except the gymnasium)	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M
E	Fire Rated Doors	Unquantified Eac	Α	Throughout the building except Rooms 113, 116 and 120.	O & M
F	Sink Insulation	Unquantified LF	Α	Classrooms	O & M

(1 - 1)

Greater Clark County Schools Remaining Materials Report April 24, 2013

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
Northa	ven Elementary School				
06	Floor tile mastic	15,190 SF	А	Throughout the building	O & M
В	Cove base molding (brown)	Approx. 1,650 LF	А	Throughout the building (except the gymnasium)	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M
Е	Fire Rated Doors	Unquantified Eac	A	Throughout the building except Rooms 113, 116 and 120.	O & M
F	Sink Insulation	Unquantified LF	А	Classrooms	O & M

Greater Clark County Schools Remaining Materials Report October 24, 2012

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Northav</u>	en Elementary School				
06	Floor tile mastic	15,190 SF	А	Throughout the building	O & M
В	Cove base molding (brown)	Approx. 1,650 LF	Α	Throughout the building (except the gymnasium)	O & M
С	Cove base mastic	Approx. 1,200 SF	А	Throughout the building	O & M
E	Fire Rated Doors	Unquantified Eac	A	Throughout the building except Rooms 113, 116 and 120.	O & M
F	Sink Insulation	Unquantified LF	Α	Classrooms	O & M

HA#	Material	Quantity	АСВМ У/А	Location	Planned Activities
<u>Northa</u>	ven Elementary School				
06	Floor tile mastic	15,190 SF	А	Throughout the building	O & M
В	Cove base molding (brown)	Approx. 1,650 LF	Α	Throughout the building (except the gymnasium)	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M
Е	Fire Rated Doors	Unquantified Eac	Α	Throughout the building except Rooms 113, 116 and 120.	O & M
F	Sink Insulation	Unquantified LF	Α	Classrooms	O & M

Greater Clark County Schools Remaining Materials Report June 28, 2011

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Northa</u>	ven Elementary School				
06	Floor tile mastic	15,190 SF	А	Throughout the building	O & M
В	Cove base molding (brown)	Approx. 1,650 LF	A	Throughout the building (except the gymnasium)	O & M
С	Cove base mastic	Approx. 1,200 SF	А	Throughout the building	O & M
E	Fire Rated Doors	Unquantified Eac	А	Throughout the building except Rooms 113, 116 and 120.	O & M
F	White Sink Insulation	Unquantified LF	Α	Sink	O & M

Greater Clark County Schools Remaining Materials Report December 6, 2010

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Northa</u>	ven Elementary School				
06	Floor tile mastic	15,190 SF	А	Throughout the building	O & M
В	Cove base molding (brown)	Approx. 1,650 LF	А	Throughout the building (except the gymnasium)	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M



Greater Clark County Schools Remaining Materials Report June 30, 2010

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Northa</u>	ven Elementary School				
06	Floor tile mastic	15,190 SF	А	Throughout the building	0 & M
В	Cove base molding (brown)	Approx. 1,650 LF	Α	Throughout the building (except the gymnasium)	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M

\bigcirc

Greater Clark County Schools Remaining Materials Report December 7, 2009

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
Northa	ven Elementary School				
)6	Floor tile mastic	15,190 SF	А	Throughout the building	O & M
	Cove base molding (brown)	Approx. 1,650 LF	А	Throughout the building (except the gymnasium)	O & M
;	Cove base mastic	Approx. 1,200 SF	А	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report June 10, 2009

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Northa</u>	ven Elementary School				
06	Floor tile mastic	15,190 SF	Α	Throughout the building	0 & M
В	Cove base molding (brown)	Approx. 1,650 LF	Α	Throughout the building (except the gymnasium)	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M

\bigcirc

Greater Clark County Schools Remaining Materials Report December 10, 2008

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Northa</u>	ven Elementary School				
06	Floor tile mastic	15,190 SF	Α	Throughout the building	O & M
В	Cove base molding (brown)	Approx. 1,650 LF	Α	Throughout the building (except the gymnasium)	O & M
с	Cove base mastic	Approx. 1,200 SF	А	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report June 30, 2008

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Northa</u>	ven Elementary School				
06	Floor tile mastic	15,190 SF	А	Throughout the building	O & M
В	Cove base molding (brown)	Approx. 1,650 LF	Α	Throughout the building (except the gymnasium)	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M

÷.,

Greater Clark County Schools Remaining Materials Report December 14, 2007

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
Northa	ven Elementary School				
06	Floor tile mastic	15,190 SF	Α	Throughout the building	O & M
3	Cove base molding (brown)	Approx. 1,650 LF	Α	Throughout the building (except the gymnasium)	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report July 9, 2007

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Northa</u>	ven Elementary School				
06	Floor tile mastic	15,190 SF	А	Throughout the building	O & M
В	Cove base molding (brown)	Approx. 1,650 LF	Α	Throughout the building (except the gymnasium)	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M



Greater Clark County Schools Remaining Materials Report December 18, 2006

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
Northa	ven Elementary School				
06	Floor tile mastic	15,190 SF	А	Throughout the building	O & M
3	Cove base molding (brown)	Approx. 1,650 LF	Α	Throughout the building (except the gymnasium)	O & M
С	Cove base mastic	Approx. 1,200 SF	А	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report June 28, 2006

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
Northa	ven Elementary School				
06	Floor tile mastic	15,190 SF	А	Throughout the building	O & M
В	Cove base molding (brown)	Approx. 1,650 LF	Α	Throughout the building (except the gymnasium)	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report January 25, 2006

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Northa</u>	ven Elementary School				
06	Floor tile mastic	15,190 SF	А	Throughout the building	O & M
В	Cove base molding (brown)	Approx. 1,650 LF	Α	Throughout the building (except the gymnasium)	O & M
С	Cove base mastic	Approx. 1,200 SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report July 20, 2005

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>Northa</u>	ven Elementary School					
06	Floor tile mastic	15,190	SF	А	Throughout the building	O & M
3	Cove base molding (brown)	Approx. 3,600	LF	Α	Throughout the building (except the gymnasium)	O & M
C	Cove base mastic	Approx. 1,200	SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report December 9, 2004

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>Northa</u>	ven Elementary School					
06	Floor tile mastic	15,190	SF	А	Throughout the building	O & M
В	Cove base molding	Approx. 3,600	LF	А	Throughout the building	O & M
С	Cove base mastic	Approx. 1,200	SF	А	Throughout the building	O & M

14

Greater Clark County Schools Remaining Materials Report July 2, 2004

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
Northa	ven Elementary School					
06	Floor tile mastic	15,190	SF	А	Throughout the building	O & M
В	Cove base molding	Approx. 3,600	LF	А	Throughout the building	O & M
С	Cove base mastic	Approx. 1,200	SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report December 9, 2003

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
Northa	ven Elementary School					
06	Floor tile mastic	15,190	SF	А	Throughout the building	O & M
В	Cove base molding	Approx. 3,600	LF	А	Throughout the building	O & M
С	Cove base mastic	Approx. 1,200	SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report June 13, 2003

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>Northa</u>	ven Elementary School					
06	Floor tile mastic	15,190	SF	А	Throughout the building	O & M
В	Cove base molding	Approx. 3,600	LF	Α	Throughout the building	O & M
С	Cove base mastic	Approx. 1,200	SF	А	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report December 18, 2003

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>Northay</u>	ven Elementary School					
06	Floor tile mastic	15,190	SF	А	Throughout the building	O & M
В	Cove base molding	Approx. 3,600	LF	А	Throughout the building	O & M
С	Cove base mastic	Approx. 1,200	SF	А	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report June 19, 2002

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
Northa	ven Elementary School					
06	Floor tile mastic	15,190	SF	А	Throughout the building	O & M
в	Cove base molding	Approx. 3,600	LF	Α	Throughout the building	O & M
С	Cove base mastic	Approx. 1,200	SF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report December 12, 2001

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>Northa</u>	ven Elementary School					
06	Floor tile mastic	15,190	SF	А	Throughout the building	O & M
В	Cove base molding	Approx. 3,600	LF	А	Throughout the building	O & M
С	Cove base mastic	Approx. 1,200	SF	А	Throughout the building	0 & M

Greater Clark County Schools Remaining Materials Report July 12, 2001

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>Northa</u>	ven Elementary School					
06	Floor tile mastic	15,190	SF	А	Throughout the building	0 & M
В	Cove base molding	Approx. 3,600	LF	А	Throughout the building	O & M
С	Cove base mastic	Approx. 1,200	SF	Α	Throughout the building	0 & M

Greater Clark County Schools Remaining Materials Report January 11, 2001

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>Northa</u>	ven Elementary School					
06	Floor tile mastic	15,190	SF	А	Throughout the building	O & M
в	Cove base molding	Approx. 3,600	LF	Α	Throughout the building	O & M
С	Cove base mastic	Approx. 1,200	SF	А	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report June 29, 2000

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
Northa	ven Elementary School					
06	Floor Tile Mastic	15190	SF	А	Throughout the building	O & M
В	Cove Base Molding	Unquantified	LF	А	Throughout the building	O & M
С	Cove Base Mastic	Unquantified	LF	Α	Throughout the building	O & M

Greater Clark County Schools Remaining Materials Report February 23, 2000

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
Northa	ven Elementary School					÷.
06	Floor Tile Mastic	15190	SF	А	Throughout the building	O & M
Ą	Transite Panels	Unquantified	SF	А	At Entryway and possibly Cafeteri	a O&M
3	Cove Base Molding	Unquantified	LF	А	Throughout the building 4	O & M
0	Cove Base Mastic	Unquantified	LF	Α	Throughout the building	O & M
D	Movable Walls	Unquantified	SF	А	Between two classrooms	O & M

5

Greater Clark County Schools Remaining Materials Report July 6, 1999

HA#	Material	Quantity		ACBM Y/A	Location	Planned Activities
<u>Northa</u>	ven Elementary School					
06	Floor Tile Mastic	15190	SF	А	Throughout the building	O & M
4	Transite Panels	Unquantified	SF	А	At Entryway and possibly Cafeteria	O & M
3	Cove Base Molding	Unquantified	LF	А	Throughout the building	O & M
0	Cove Base Mastic	Unquantified	LF	А	Throughout the building	O & M
D	Movable Walls	Unquantified	SF	А	Between two classrooms	0 & M

PERIODIC SURVEILLANCE REINSPECTION ADDITIONAL BULK SAMPLING INFORMATION

ASSESSMENTS FOR AHERA

- 1. Damaged or significantly damaged thermal systems insulation.
- 2. Damaged friable surfacing ACM,

j:

- 3. Significantly damaged friable surfacing ACM.
- 4. Damaged or significantly damaged friable miscellaneous ACM.
- 5. ACBM with potential for damage.
- 6. ACBM with potential for significant damage.
- 7. Any remaining friable ACBM or friable suspected ACBM.

If a material is non-friable, it does not require an assessment rating under AHERA.

Due to the differences in what is required of the LEA for damaged material compared to significantly damaged material, Alliance has modified the assessment scale to the following:

1A. Significantly damaged thermal systems insulation.

1B. Damaged thermal systems insulation.

4A. Significantly damaged friable miscellaneous ACM.

4B. Damaged friable miscellaneous ACM.

PERIODIC SURVEILLANCES

Greater Clark County Schools

AHERA Program

SURVEILLANCE INFORMATION PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

DATE PLANNED	DATE COMPLETED	COMPLETED BY
October 2014	October 22, 2014	Rojun to
<u>April 2015</u>	April 22, 2015	Binjun (Ker
October 2015	October 20, 2016	Brigan Hoo
<u>April 2016</u>	RE-INSPECTION	Roigen (How
October 2016	November 3, 2016	D-AA-C
<u>April 2017</u>	April 13, 2017	Gerie Arkan.
October 2017	October 18, 2017	D-AA-C
<u>April 2018</u>	May 2, 2018	Projen (Kor
October 2018	November 13, 2018	Beijain (He
<u>April 2019</u>	RE-INSPECTION	5000
October 2019	January 14, 2020	Null Les
<u>April 2020</u>	April 23, 2020	Null LS
October 2020		

SURVEILLANCE INFORMATION

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

<u>April 2021</u>		
October 2021		
<u>April 2022</u>	RE-INSPECTION	
October 2022		
<u>April 2023</u>		
October 2023		
<u>April 2024</u>		
October 2024		
<u>April 2025</u>	RE-INSPECTION	
October 2025		
<u>April 2026</u>		
October 2026		

SURVEILLANCE INFORMATION

PERIODIC SURVEILLANCE PLAN SCHEDULE

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

DATE PLANNED

DATE COMPLETED

COMPLETED BY

JUNE 2009

DECEMBER 2009

JUNE 2010

DECEMBER 2010

JUNE 2011

DECEMBER 2011_

JUNE 2012

DECEMBER 2012

JUNE 2013

DECEMBER 2013

Dec. 2009 Re-Inspection December 2010 June 2011

Greater Clark County Schools

Surveillance Plan

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each reinspection will be maintained in this binder.

DATE PLANNED DATE COMPLETED une '03 JUNE 2003 ec. '03 DECEMBER 2003 JUNE 2004 REINSPECTION ec. '04 DECEMBER 2004 JUNE 2005 un de DECEMBER 2005 Sunc de JUNE 2006 UR DECEMBER 2006 4 2007 REINSPECTION JUNE 2007 DECEMBER 2007

_JUNE 2008

DECEMBER 2008


Alliance Indiana, Inc.

COMPLETED BY

C. Aparks C. Aparks C. Aparks

Spacks,



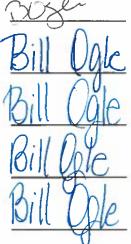

()

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

NORTHAVEN ELEMENTARY SCHOOL

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long they remain in the building. This inspection will be conducted semi-annually.

The following table outlines the dates on which these inspections should take place in this school building.

PERIODIC SURVEILLANCE SCHEDULE

DATE PLANNED	DATE COMPLETED
DECEMBER_1995	12-95
JUNE 1996	6-96
DECEMBER 1996	12-96
JUNE 1997	7-97
DECEMBER 1997	1-98
JUNE 1998	REINSPECTION
DECEMBER 1998	12-98
JUNE 1999	June '99
DECEMBER 1999	Dec '99
JUNE 2000	June 2000
DECEMBER 2000	Jan. '01
JUNE 2001	() RÉINSPECTION
DECEMBER 2001	Dec. '01
JUNE 2002	June 'OZ
DECEMBER 2002	Dec. OZ

COMPLETED BY liance lance and A 1.0 RO igh

Surveillance Schedule

LEA Name	Greater Clark County School Corporation	
Building Name	Northhaven Elementary School	
Building Number	04	
HA ID	06	
HA Description	Floor Tile Mastic	
НА Туре	Miscellaneous Material	
HA Location	Throughout building	
Quantity	15190	SF
Comments	This material was not exposed to inspect.	
Asbestos	Assumed	
Friable	No	
Original Inspection	6/1/1988	
Current Inspection	4/23/2020	

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action O&M

%

Mili

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation	
Building Name	Northhaven Elementary School	
Building Number	04	
HA ID	В	
HA Description	Cove base molding (brown)	
НА Туре	Miscellaneous Material	
HA Location	Throughout the building (except the gymnasium)	
Quantity	Approx. 1650 LF	
Comments	This material was not in poor condition overall.	
Asbestos	Assumed	
Friable	No	
Original Inspection	5/31/1996	
Current Inspection	4/23/2020	

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Mil.

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation	
Building Name	Northhaven Elementary School	
Building Number	04	
HA ID	C	
HA Description	Cove Base Mastic	
НА Туре	Miscellaneous Material	
HA Location	Throughout building	
Quantity	Approx. 1200 SF	
Comments	Where exposed in the stage storage room and boys dressing room, this material	
	was not in poor condition.	
Asbestos	Assumed	
Friable	No	
Original Inspection	5/31/1996	
Current Inspection	4/23/2020	

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation	
Building Name	Northhaven Elementary School	
Building Number	04	
HA ID	E	
HA Description	Fire Rated Doors	
НА Туре	Miscellaneous Material	
HA Location	Throughout the building except Rooms 113, 116 and 120.	
Quantity	Unquantified Unit(s)	
Comments	These doors were noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled.	
Asbestos	Assumed	
Friable	No	
Original Inspection	6/27/2011	
Current Inspection	4/23/2020	

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged %

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation	
Building Name	Northhaven Elementary School	
Building Number	04	
HA ID	F	
HA Description	Sink Insulation	
НА Туре	Miscellaneous Material	
HA Location	Classrooms	
Quantity	Unquantified SF	
Comments	This material was noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled.	
Asbestos	Assumed	
Friable	No	
Original Inspection	6/27/2011	
Current Inspection	4/23/2020	

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Low/None

Percent Damaged %

Good Condition

Physical Contact Low/None Vibration

<u>Air</u> Low/None

Planned Response Action 0&M

0,

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation	
Building Name	Northhaven Elementary School	
Building Number	04	
HA ID	FT-01	
HA Description	9" x 9" Off-White with Streaks and Splotches Floor Tile	
НА Туре	Miscellaneous Material	
HA Location	Cafeteria, Nurse, Artroom, Closet, Stage and Storage Room, Workrooms of Main Office	
Quantity	Unquantified	SF
Comments	This material was noted during the January 2019 inspection. No sampling data could be identified. This material will be added to the management plan. Overall, this material was not in poor condition.	
Asbestos	Assumed	
Friable	No	
Original Inspection	1/14/2020	
Current Inspection	4/23/2020	

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation			
Building Name	Northhaven Elementary School			
Building Number	04			
HA ID	FTM-01			
HA Description	Mastic Associated with 9" x 9" Off-White with Streaks and Splotches Floor Tile			
НА Туре	Miscellaneous Material			
HA Location	Cafeteria, Nurse, Artroom, Closet, Stage and Storage Room, Workrooms of Main Office			
Quantity	Unquantified	SF		
Comments	This material was noted during the January 2020 inspection. No sampling data could be identified. This material will be added to the management plan. No mastic was visible to be inspected.			
Asbestos	Assumed	Assumed		
Friable	No			
Original Inspection	1/14/2020			
Current Inspection	4/23/2020			

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	06		
HA Description	Floor Tile Mastic		
НА Туре	Miscellaneous Material		
HA Location	Throughout building		
Quantity	15190	SF	
Comments	This material was not exposed to inspect.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/1/1988		
Current Inspection 1/14/2020			

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action O&M

%

Mile.

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	В		
HA Description	Cove base molding (brown)		
НА Туре	Miscellaneous Material		
HA Location	Throughout the building (except the gymnasium)		
Quantity	Approx. 1650 LF		
Comments	This material was not in poor condition overall.		
Asbestos	Assumed		
Friable	No		
Original Inspection	5/31/1996		
Current Inspection	1/14/2020		

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action O&M

%

Mile.

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	C		
HA Description	Cove Base Mastic		
НА Туре	Miscellaneous Material		
HA Location	Throughout building		
Quantity	Approx. 1200 SF		
Comments	Where exposed in the stage storage room and boys dressing room, this material was not in poor condition.		
Asbestos	Assumed		
Friable	No		
Original Inspection	5/31/1996		
Current Inspection	1/14/2020		

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Michael J. Ardis

Greater Clark County School Corporation		
Northhaven Elementary School		
04		
E		
Fire Rated Doors		
Miscellaneous Material		
Throughout the building except Rooms 113, 116 and 120.		
Unquantified Unit(s)		
These doors were noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled.		
Assumed		
Νο		
6/27/2011		
1/14/2020		

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged %

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary Schoo	d	
Building Number	04		
HA ID	F		
HA Description	Sink Insulation		
НА Туре	Miscellaneous Material		
HA Location	Classrooms		
Quantity	Unquantified	SF	
Comments	This material was noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/27/2011		
Current Inspection	1/14/2020		

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged %

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

0,

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	FT-01		
HA Description	9" x 9" Off-White with Streaks and Splotches Floor Tile		
НА Туре	Miscellaneous Material		
HA Location	Cafeteria, Nurse, Artroom, Closet, Stage and Storage Room, Workrooms of Main Office		
Quantity	Unquantified	SF	
Comments	This material was noted during the January 2020 inspection. No sampling data could be identified. This material will be added to the management plan. Overall, this material was not in poor condition.		
Asbestos	Assumed		
Friable	No		
Original Inspection	1/14/2020		
Current Inspection	1/14/2020		

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Michael J. Ardis

LEA Name	Greater Clark County School Corporation			
Building Name	Northhaven Elementary School			
Building Number	04	04		
HA ID	FTM-01			
HA Description	Mastic Associated with 9" x 9" Off-White with Streaks and Splotches Floor Tile			
НА Туре	Miscellaneous Material			
HA Location	Cafeteria, Nurse, Artroom, Closet, Stage and Storage Room, Workrooms of Main Office			
Quantity	Unquantified	SF		
Comments	This material was noted during the January 2020 inspection. No sampling data could be identified. This material will be added to the management plan. No mastic was visible to be inspected.			
Asbestos	Assumed			
Friable	No			
Original Inspection	1/14/2020			
Current Inspection	1/14/2020			
	• • • • • •			

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Michael J. Ardis

	LEA Name	Greater Clark County School Corporation			
	Building Name	Northhaven Elementary School			
	Building Number	04			
	HA ID	06			
	HA Description	Floor Tile Mastic			
	НА Туре	Miscellaneous Material			
	HA Location	Throughout building			
	Quantity	15190	SF		
	Comments	This material was partially removed during renovations 2017/2018. This material remains in the center of the building			
	Asbestos	Assumed			
	Friable	No			
(Driginal Inspection	6/1/1988			
(Current Inspection	11/13/2018			

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	
-----------------	---	--

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation			
Building Name	Northhaven Elementary School			
Building Number	04			
HA ID	В			
HA Description	Cove base molding (brown)			
НА Туре	Miscellaneous Material			
HA Location	Throughout the building (except the gymnasium)			
Quantity	Approx. 1650 LF			
Comments	This material was not in poor condition overall.			
Asbestos	Assumed			
Friable	No			
Original Inspection	5/31/1996			
Current Inspection	11/13/2018			

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
<u>Physical Co</u>	ontact	<u>Vibration</u>	<u>Air</u>
Low/No	ne	Low/None	Low/None

Planned Response Action O&M

Inspector

Benjamin S. Hood

LE	EA Name	Greater Clark County School Corporation		
В	uilding Name	Northhaven Elementary School		
В	uilding Number	04		
H.	A ID	С		
H.	A Description	Cove Base Mastic		
H.	А Туре	Miscellaneous Material		
H.	A Location	Throughout building		
Q	uantity	Approx. 1200	SF	
C	omments	Where exposed in the stage storage room and boys dressing room, this material was not in poor condition.		
A	sbestos	Assumed		
Fr	riable	No		
Orig	ginal Inspection	5/31/1996		
Cur	rent Inspection	11/13/2018		

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	E		
HA Description	Fire Rated Doors		
НА Туре	Miscellaneous Material		
HA Location	Throughout the building except Rooms 113, 116 and 120.		
Quantity	Unquantified Unit(s)		
Comments	These doors were noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/27/2011		
Current Inspection	11/13/2018		
	Matarial Assassment		

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged 9	%	G
-------------------	---	---

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	F		
HA Description	Sink Insulation		
НА Туре	Miscellaneous Material		
HA Location	Classrooms		
Quantity	Unquantified SF		
Comments	This material was noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/27/2011		
Current Inspection	11/13/2018		
	Matarial Accordment		

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	C
-----------------	---	---

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	06		
HA Description	Floor Tile Mastic		
НА Туре	Miscellaneous Material		
HA Location	Throughout building		
Quantity	15190	SF	
Comments	This material was not exposed to inspect.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/1/1988		
Current Inspection	5/2/2018		

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Co	<u>ontact</u>	Vibration	<u>Air</u>
Low/No	one	Low/None	Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	В		
HA Description	Cove base molding (brown)		
НА Туре	Miscellaneous Material		
HA Location	Throughout the building (except the gymnasium)		
Quantity	Approx. 1650 LF		
Comments	This material was not in poor condition overall.		
Asbestos	Assumed		
Friable	No		
Original Inspection	5/31/1996		
Current Inspection	5/2/2018		

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical C	<u>ontact</u>	Vibration	Air
Low/No	one	Low/None	Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation			
Building Name	Northhaven Elementary School			
Building Number	04			
HA ID	C			
HA Description	Cove Base Mastic			
НА Туре	Miscellaneous Material			
HA Location	Throughout building			
Quantity	Approx. 1200 SF			
Comments	Where exposed in the stage storage room and boys dressing room, this material was not in poor condition.			
Asbestos	Assumed			
Friable	No			
Original Inspection	5/31/1996			
Current Inspection	5/2/2018			

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	E		
HA Description	Fire Rated Doors		
НА Туре	Miscellaneous Material		
HA Location	Throughout the building except Rooms 113, 116 and 120.		
Quantity	Unquantified Unit(s)		
Comments	These doors were noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/27/2011		
Current Inspection 5/2/2018			

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%
-----------------	---

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School C	orporation
Building Name	Northhaven Elementary Schoo	1
Building Number	04	
HA ID	F	
HA Description	Sink Insulation	
НА Туре	Miscellaneous Material	
HA Location	Classrooms	
Quantity	Unquantified	SF
Comments	This material was noted during management plan until prope	g the 6/27/2011 inspection and will remain in the rly sampled.
Asbestos	Assumed	
Friable	No	
Original Inspection	6/27/2011	
Current Inspection	5/2/2018	
	_	

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%
-----------------	---

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	06		
HA Description	Floor Tile Mastic		
НА Туре	Miscellaneous Material		
HA Location	Throughout building		
Quantity	15190	SF	
Comments	This material was not exposed to inspect.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/1/1988		
Current Inspection	10/18/2017		

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical C	<u>ontact</u>	<u>Vibration</u>	Air
Low/No	one	Low/None	Low/None

Planned Response Action 0&M

X-C

Inspector

Dustin Hawkins

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	В		
HA Description	Cove base molding (brown)		
НА Туре	Miscellaneous Material		
HA Location	Throughout the building (except the gymnasium)		
Quantity	Approx. 1650 LF		
Comments	This material was not in poor condition overall.		
Asbestos	Assumed		
Friable	No		
Original Inspection	5/31/1996		
Current Inspection	10/18/2017		

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical C	<u>ontact</u>	<u>Vibration</u>	Air
Low/No	one	Low/None	Low/None

Planned Response Action 0&M

X-C

Inspector

Dustin Hawkins

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	C		
HA Description	Cove Base Mastic		
НА Туре	Miscellaneous Material		
HA Location	Throughout building		
Quantity	Approx. 1200 SF		
Comments	Where exposed in the stage storage room and boys dressing room, this material was		
	not in poor condition.		
Asbestos	Assumed		
Friable	No		
Original Inspection	5/31/1996		
Current Inspection	10/18/2017		

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Dustin Hawkins

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	E		
HA Description	Fire Rated Doors		
НА Туре	Miscellaneous Material		
HA Location	Throughout the building except Rooms 113, 116 and 120.		
Quantity	Unquantified Unit(s)		
Comments	These doors were noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/27/2011		
Current Inspection	10/18/2017		

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

ŀ

Inspector

Dustin Hawkins

LEA Name	Greater Clark County School Co	orporation		
Building Name	Northhaven Elementary School			
Building Number	04			
HA ID	F			
HA Description	Sink Insulation			
НА Туре	Miscellaneous Material	Miscellaneous Material		
HA Location	Classrooms			
Quantity	Unquantified	SF		
Comments	This material was noted during management plan until proper	g the 6/27/2011 inspection and will remain in the ly sampled.		
Asbestos	Assumed			
Friable	No			
Original Inspection	6/27/2011			
Current Inspection	10/18/2017			

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good
-----------------	---	------

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Dustin Hawkins

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary Schoo	bl	
Building Number	04		
HA ID	06		
HA Description	Floor Tile Mastic		
НА Туре	Miscellaneous Material		
HA Location	Throughout building		
Quantity	15190	SF	
Comments	This material was not exposed to inspect.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/1/1988		
Current Inspection	4/13/2017		

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical C	<u>ontact</u>	<u>Vibration</u>	Air
Low/No	one	Low/None	Low/None

Planned Response Action 0&M

Janie Attain

Inspector

Jamie Hosier

LEA Name	Greater Clark County School Corporation	
Building Name	Northhaven Elementary School	
Building Number	04	
HA ID	В	
HA Description	Cove base molding (brown)	
НА Туре	Miscellaneous Material	
HA Location	Throughout the building (except the gymnasium)	
Quantity	Approx. 1650 LF	
Comments	This material was not in poor condition overall.	
Asbestos	Assumed	
Friable	No	
Original Inspection	5/31/1996	
Current Inspection	4/13/2017	

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical C	<u>ontact</u>	Vibration	Air
Low/No	one	Low/None	Low/None

Planned Response Action 0&M

Janie Attain

Inspector

Jamie Hosier

LEA Name	Greater Clark County School Corporation
Building Name	Northhaven Elementary School
Building Number	04
HA ID	C
HA Description	Cove Base Mastic
НА Туре	Miscellaneous Material
HA Location	Throughout building
Quantity	Approx. 1200 SF
Comments	Where exposed in the stage storage room and boys dressing room, this material was not in poor condition.
Asbestos	Assumed
Friable	No
Original Inspection	5/31/1996
Current Inspection	4/13/2017

Material Assessment

Assessment Rating 5

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Good Condition

Percent Damaged %

Contact

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Janie Attain

Inspector

Jamie Hosier

LEA Name	Greater Clark County School Corporation	
Building Name	Northhaven Elementary School	
Building Number	04	
HA ID	E	
HA Description	Fire Rated Doors	
НА Туре	Miscellaneous Material	
HA Location	Throughout the building except Rooms 113, 116 and 120.	
Quantity	Unquantified Unit(s)	
Comments	These doors were noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled.	
Asbestos	Assumed	
Friable	No	
Original Inspection	6/27/2011	
Current Inspection	4/13/2017	

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition
-----------------	---	----------------

Contact Vibration

Physical Contact Low/None

Low/None

<u>Air</u> Low/None

Planned Response Action 0&M

Janie Attain

Inspector

Jamie Hosier

LEA Name	Greater Clark County School C	orporation
Building Name	Northhaven Elementary Schoo	I
Building Number	04	
HA ID	F	
HA Description	Sink Insulation	
НА Туре	Miscellaneous Material	
HA Location	Classrooms	
Quantity	Unquantified	SF
Comments	This material was noted during management plan until proper	g the 6/27/2011 inspection and will remain in the rly sampled.
Asbestos	Assumed	
Friable	No	
Original Inspection	6/27/2011	
Current Inspection	4/13/2017	

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition
-----------------	---	----------------

Physical Contact Vibration

Low/None

Low/None

<u>Air</u> Low/None

Planned Response Action 0&M

Janie Attain

Inspector

Jamie Hosier

LEA Name	Greater Clark County School Corporation	
Building Name	Northhaven Elementary School	
Building Number	04	
HA ID	06	
HA Description	Floor Tile Mastic	
НА Туре	Miscellaneous Material	
HA Location	Throughout building	
Quantity	15190 SF	
Comments	This material was not exposed to inspect.	
Asbestos	Assumed	
Friable	No	
Original Inspection	6/1/1988	
Current Inspection	11/3/2016	

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Co	ontact	<u>Vibration</u>	Air
Low/No	one	Low/None	Low/None

Planned Response Action 0&M

X-C

Inspector

Dustin Hawkins

LEA Name	Greater Clark County School Corporation	
Building Name	Northhaven Elementary School	
Building Number	04	
HA ID	В	
HA Description	Cove base molding (brown)	
НА Туре	Miscellaneous Material	
HA Location	Throughout the building (except the gymnasium)	
Quantity	Approx. 1650 LF	
Comments	This material was not in poor condition overall.	
Asbestos	Assumed	
Friable	No	
Original Inspection	5/31/1996	
Current Inspection	11/3/2016	

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Co	ontact	Vibration	Air
Low/No	one	Low/None	Low/None

Planned Response Action O&M

X-C

Inspector

Dustin Hawkins

	LEA Name	Greater Clark County School Corporation		
	Building Name	Northhaven Elementary School		
	Building Number	04		
	HA ID	C		
	HA Description	Cove Base Mastic		
	НА Туре	Miscellaneous Material		
	HA Location	Throughout building		
	Quantity	Approx. 1200 SF		
	Comments	Where exposed in the stage storage room and boys dressing room, this material was not in poor condition.		
	Asbestos	Assumed		
	Friable	No		
(Driginal Inspection	5/31/1996		
(Current Inspection	11/3/2016		

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Dustin Hawkins

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	E		
HA Description	Fire Rated Doors		
НА Туре	Miscellaneous Material		
HA Location	Throughout the building except Rooms 113, 116 and 120.		
Quantity	Unquantified Unit(s)		
Comments	These doors were noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/27/2011		
Current Inspection	11/3/2016		

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition
-----------------	---	----------------

Physical Contact Vibration

Low/None

Low/None

<u>Air</u> Low/None

Planned Response Action 0&M

KIC

Inspector

Dustin Hawkins

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary Schoo	bl	
Building Number	04		
HA ID	F		
HA Description	Sink Insulation		
НА Туре	Miscellaneous Material		
HA Location	Classrooms		
Quantity	Unquantified	SF	
Comments	This material was noted durin management plan until prope	g the 6/27/2011 inspection and will remain in the orly sampled.	
Asbestos	Assumed		
Friable	No		
Original Inspection	6/27/2011		
Current Inspection	11/3/2016		

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

KIC

Inspector

Dustin Hawkins

LEA Name	Greater Clark County School Corporation	
Building Name	Northhaven Elementary School	
Building Number	04	
HA ID	06	
HA Description	Floor Tile Mastic	
НА Туре	Miscellaneous Material	
HA Location	Throughout building	
Quantity	15190	SF
Comments	This material was not exposed to inspect.	
Asbestos	Assumed	
Friable	No	
Original Inspection	6/1/1988	
Current Inspection	10/20/2015	

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Co	ontact	<u>Vibration</u>	<u>Air</u>
Low/No	ne	Low/None	Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	В		
HA Description	Cove base molding (brown)		
НА Туре	Miscellaneous Material		
HA Location	Throughout the building (except the gymnasium)		
Quantity	Approx. 1650 LF		
Comments	This material was not in poor condition overall.		
Asbestos	Assumed		
Friable	No		
Original Inspection	5/31/1996		
Current Inspection	10/20/2015		

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical C	ontact	<u>Vibration</u>	<u>Air</u>
Low/No	one	Low/None	Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	C		
HA Description	Cove Base Mastic		
НА Туре	Miscellaneous Material		
HA Location	Throughout building		
Quantity	Approx. 1200 SF		
Comments	Where exposed in the stage storage room and boys dressing room, this material was not in poor condition.		
Asbestos	Assumed		
Friable	No		
Original Inspection	5/31/1996		
Current Inspection	10/20/2015		

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

Periodic Surveillance

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	E		
HA Description	Fire Rated Doors		
НА Туре	Miscellaneous Material		
HA Location	Throughout the building except Rooms 113, 116 and 120.		
Quantity	Unquantified Unit(s)		
Comments	These doors were noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/27/2011		
Current Inspection	10/20/2015		
	Matarial Accordment		

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	e
-----------------	---	---

Good Condition

Physical Contact Low/None Vibration Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

State IN Accreditation Number 19A001039

Periodic Surveillance

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	F		
HA Description	Sink Insulation		
НА Туре	Miscellaneous Material		
HA Location	Classrooms		
Quantity	Unquantified SF		
Comments	This material was noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/27/2011		
Current Inspection	10/20/2015		
	Matorial Accossment		

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	0
-----------------	---	---

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

State IN Accreditation Number 19A001039

LEA Name	Greater Clark County Schools			
Building Name	Northaven Elementary School			
HA#	06			
Type of Material	Miscellaneous Material			
Quantity of Material	15,190 SF			
Material Location				
Throughout the bu	uilding			
Material Description				
Floor tile mastic				
Comments				
This material was	not exposed to inspect.			
Does Material Contain Asbes	stos? Assumed			
Is it Friable?	No			
Original Inspection Date	6/1/1988			
Current Surveillance Date	4/22/2015			
Current Assessment Rating	NR Not Rated			
Cause of Damage	No Damage			
Accessible	No			
Potential for Damage	Low			
Removed	No			
Planned Response Action	O&M Benjani Acco			
La constante de				

Inspector

Benjamin S. Hood

State Accreditation Number

LEA Name	Greater Clark County Schools	
Building Name	Northaven Elementary School	
HA#	3	
Type of Material	Viscellaneous Material	
Quantity of Material	Approx. 1,650 LF	
Material Location		
Throughout the bu	lding (except the gymnasium)	
Material Description		
Cove base moldin	(brown)	
Comments		
This material was	ot in poor condition overall.	
Does Material Contain Asbes	os? Assumed	
Is it Friable?	No	
Original Inspection Date	5/31/1996	
Current Surveillance Date	4/22/2015	
Current Assessment Rating	NR No	t Rated
Cause of Damage	No Damage	
Accessible	Yes	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O&M Benja	nin Aco

Inspector

Benjamin S. Hood

State Accreditation Number

LEA Name	Greater Cla	ark County S	Schools	
Building Name	Northaven Elementary School			
HA#	С			
Type of Material	Miscellaneo	ous Material		
Quantity of Material	Approx. 1,2	200 SF		
Material Location				
Throughout the bu	iilding			
Material Description				
Cove base mastic				
Comments				
Where exposed in not in poor condition		torage room	and boys dressing room, this m	aterial was
Does Material Contain Asbes	stos?	Assumed		
Is it Friable?		No		
Original Inspection Date		5/31/1996		
Current Surveillance Date		4/22/2015		
Current Assessment Rating		NR	Not Rated	
Cause of Damage		No Damage)	
Accessible		No		
Potential for Damage		Low		
Removed		No		
Planned Response Action		O & M	Benjamin Acco	
Inspector				
			Benjamin S. Hood	

State	
Accreditation	Number

LEA Name	Greater Clark County Schools
Building Name	Northaven Elementary School
HA#	E
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified Each
Material Location	
Throughout the bu	ilding except Rooms 113, 116 and 120.
Material Description	
Fire Rated Doors	
Comments	
	noted during the 6/27/2011 inspection and will remain in the until properly sampled.
Does Material Contain Asbes	tos? Assumed
Is it Friable?	No
Original Inspection Date	6/27/2011
Current Surveillance Date	4/22/2015
Current Assessment Rating	NA Not Applicable
Cause of Damage	
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O&M Benjamin Hoo
Inspector	
	Benjamin S. Hood

State	
Accreditation	Number

LEA Name	Greater Clark	County Sc	hools
Building Name		•	
-	Northaven Elementary School		
HA#	F		
Type of Material	Miscellaneous	Material	
Quantity of Material	Unquantified L	.F	
Material Location			
Classrooms			
Material Description			
Sink Insulation			
Comments			
This material was management plan			11 inspection and will remain in the
Does Material Contain Asbes	tos? As	sumed	
Is it Friable?	No		
Original Inspection Date	6/2	7/2011	
Current Surveillance Date	4/2	2/2015	
Current Assessment Rating	NA	L .	Not Applicable
Cause of Damage			
Accessible	Ye	s	
Potential for Damage	Lov	N	
Removed	No		
Planned Response Action	08	& M	Benjamin Acco
Inspector			Benjamin S. Hood

State	
Accreditation	Number

LEA Name	Greater Cla	lark County Schools
Building Name	Northaven	e Elementary School
HA#	06	
Type of Material	Miscellane	eous Material
Quantity of Material	15,190 SF	-
Material Location		
Throughout the bu	uilding	
Material Description		
Floor tile mastic		
Comments		
This material was	not expose	ed to inspect.
Does Material Contain Asbestos?		Assumed
Is it Friable?		No
Original Inspection Date		6/1/1988
Current Surveillance Date		10/22/2014
Current Assessment Rating		NR Not Rated
Cause of Damage		No Damage
Accessible		No
Potential for Damage		Low
Removed		No D.
Planned Response Action		0&M Benjamen Alle

Inspector

Benjamin S. Hood

State Accreditation Number

			<u>.</u>		
LEA Name	Greater Cla	ark County	y Schools		
Building Name	Northaven	Elementa	ry School		
HA#	В				
Type of Material	Miscellaneo	ous Mater	ial		
Quantity of Material	Approx. 1,6	650 LF			
Material Location					
Throughout the bu	ilding (exce	pt the gyn	nnasium)		
Material Description	_				
Cove base moldin	g (brown)				
Comments					
This material was	not in poor (condition	overall.		
Does Material Contain Asbes	stos?	Assumed	l		
Is it Friable?		No			
Original Inspection Date		5/31/1996	6		
Current Surveillance Date		10/22/20	14		
Current Assessment Rating		NR	N	lot Rated	
Cause of Damage		No Dama	ige		
Accessible		Yes			
Potential for Damage		Low			
Removed		No	$\left(\right)$	· 、 、	And
Planned Response Action		O & M	B	enfarre	RCOT

Inspector

Benjamin S. Hood

State Accreditation Number

LEA Name	Greater Cla	•			
Building Name	Northaven	Elementary	y Schoo	I	
HA#	С				
Type of Material	Miscellaneo	ous Materia	al		
Quantity of Material	Approx. 1,2	200 SF			
Material Location					
Throughout the bu	iilding				
Material Description					
Cove base mastic					
Comments					
Where exposed in not in poor condition		torage rooi	m and b	oys dressing ro	oom, this material was
Does Material Contain Asbes	stos?	Assumed			
Is it Friable?		No			
Original Inspection Date		5/31/1996			
Current Surveillance Date		10/22/2014	4		
Current Assessment Rating		NR		Not Rated	
Cause of Damage		No Damag	ge		
Accessible		No			
Potential for Damage		Low			\sim
Removed		No)	And
Planned Response Action		O & M	K	Jenjanen	, Ales
Inspector					
			I	Benjamin S. He	bod

State	
Accreditation I	Number

LEA Name	Greater Clark County Schools
Building Name	Northaven Elementary School
HA#	Ε
	-
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified Each
Material Location	
Throughout the bu	ilding except Rooms 113, 116 and 120.
Material Description	
Fire Rated Doors	
Comments	
	noted during the 6/27/2011 inspection and will remain in the until properly sampled.
Does Material Contain Asbes	stos? Assumed
Is it Friable?	No
Original Inspection Date	6/27/2011
Current Surveillance Date	10/22/2014
Current Assessment Rating	NA Not Applicable
Cause of Damage	
Accessible	Yes
Potential for Damage	Low
Removed	No R
Planned Response Action	O&M Denjamen Mit
Inspector	
	Benjamin S. Hood

State
Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	Northaven Elementary School
HA#	F
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Classrooms	
Material Description	
Sink Insulation	
Comments	
	noted during the 6/27/2011 inspection and will remain in the until properly sampled.
Does Material Contain Asbes	stos? Assumed
Is it Friable?	No
Original Inspection Date	6/27/2011
Current Surveillance Date	10/22/2014
Current Assessment Rating	NA Not Applicable
Cause of Damage	
Accessible	Yes
Potential for Damage	Low
Removed	No D
Planned Response Action	0&M Benjamen Alt
Inspector	
	Benjamin S. Hood
State	Indiana
Accreditation Number	19A001039

LEA Name	Greater Clark County Schools	
Building Name	Northaven Elementary School	
HA#	06	
Type of Material	Miscellaneous Material	
Quantity of Material	15,190 SF	
Material Location		
Throughout the bu	uilding	
Material Description		
Floor tile mastic		
Comments		
This material was	not exposed to inspect.	
Does Material Contain Asbes	stos? Assumed	
Is it Friable?	No	
Original Inspection Date	6/1/1988	
Current Surveillance Date	4/21/2014	
Current Assessment Rating	NR Not Rated	
Cause of Damage	No Damage	
Accessible	No	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O&M	
	CHAD	1

Inspector

CAPD

Jeffrey P. Rechtin

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	Northaven Elementary School
HA#	В
Type of Material	Miscellaneous Material
Quantity of Material	Approx. 1,650 LF
Material Location	
Throughout the bu	ilding (except the gymnasium)
Material Description	
Cove base moldin	g (brown)
Comments	
This material was	not in poor condition overall.
Does Material Contain Asbes	stos? Assumed
Is it Friable?	No
Original Inspection Date	5/31/1996
Current Surveillance Date	4/21/2014
Current Assessment Rating	NR Not Rated
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O&M
	CAR
	$() \cup$

Inspector

Jeffrey P. Rechtin

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	Northaven Elementary School
HA#	С
Type of Material	Miscellaneous Material
Quantity of Material	Approx. 1,200 SF
Material Location	
Throughout the bu	ilding
Material Description	
Cove base mastic	
Comments	
Where exposed in not in poor conditi	the stage storage room and boys dressing room, this material was on.
Does Material Contain Asbes	stos? Assumed
Is it Friable?	No
Original Inspection Date	5/31/1996
Current Surveillance Date	4/21/2014
Current Assessment Rating	NR Not Rated
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
Inspector	ABD

Jeffrey P. Rechtin

State Accreditation Number

Building Name Northaven Elementary School HA# E Type of Material Miscella=us Material Quantity of Material Unquantifie Each Material Location Throughout the building except Rooms 113, 116 and 120. Material Description Fire Rated Doors Fire Rated Doors Fire Rated Doors Comment Assumed Independent ration Assumed Independent ration No No No Original Inspection Date 6/27/2011 Current Xurveillance Date No Current Surveillance Date 0/27/2011 Current Assessment Rating Na Accessible Va Accessible Yes Accessible Kes Potential for Damage Low Removed No		
HA# E Type of Material Miscellane∪us Material Quantity of Material Unquantified Each Material Location Throughout the building except Rooms 113, 116 and 120. Material Description Fire Rated Doors Comments These doors were noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled. Does Material Contain Asbestos? Assumed Is it Friable? No Original Inspection Date 6/27/2011 Current Assessment Rating NA Not Applicable Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action Other Other Contain Asbesto No Planned Response Action Material Contain Asbesto No Material Contain Asbesto No Material Contain Asbesto Planage Cove Material Contain Asbesto Planage Cove Material C	LEA Name	Greater Clark County Schools
Type of Material Miscellaneous Material Quantity of Material Unquantified Each Material Location Throughout the building except Rooms 113, 116 and 120. Material Description Fire Rated Doors Comments These doors were noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled. Does Material Contain Asbestos? Assumed Is it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Surveillance Date 4/21/2014 Current Assessment Rating NA Not Applicable Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M	Building Name	Northaven Elementary School
Quantity of Material Unquantified Each Material Location Throughout the building except Rooms 113, 116 and 120. Material Description Fire Rated Doors Comments Fire Rated Doors Comments These doors were noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled. Does Material Contain Asbestos? Assumed Is it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Assessment Rating NA No Not Applicable Cause of Damage Low Removed No Planned Response Action O & M	HA#	E
Material Location Throughout the building except Rooms 113, 116 and 120. Material Description Fire Rated Doors Comments These doors were noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled. Does Material Contain Asbestos? Assumed Is it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Assessment Rating NA Not Applicable Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action	Type of Material	Miscellaneous Material
Throughout the building except Rooms 113, 116 and 120. Material Description Fire Rated Doors Comments These doors were noted during the 6/27/2011 inspection and will remain in the management plan until property sampled. Does Material Contain Asbestos? Assumed Is it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Assessment Rating NA Not Applicable Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M	Quantity of Material	Unquantified Each
Material Description Fire Rated Doors Comments These doors were noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled. Does Material Contain Asbestos? Assumed Is it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Assessment Rating NA Not Applicable Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M	Material Location	
Fire Rated Doors Fire Rated Doors These doors were noted during the 6/27/2011 inspection and will remain in the management plan until property sampled. Does Material Contain Asbestos? Assumed Bis it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Assessment Rating NA Not Applicable Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M	Throughout the bu	uilding except Rooms 113, 116 and 120.
Comments These doors were noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled. Does Material Contain Asbestos? Assumed Is it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Assessment Rating NA Not Applicable Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M	Material Description	
These doors were noted during the 6/27/2011 inspection and will remain in the management plan until property sampled. Does Material Contain Asbestos? Assumed Is it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Assessment Rating NA Not Applicable Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M	Fire Rated Doors	
management plan until properly sampled. Does Material Contain Asbestos? Assumed Is it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Assessment Rating NA Not Applicable Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M	Comments	
Is it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Assessment Rating NA Not Applicable Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M		e
Original Inspection Date6/27/2011Current Surveillance Date4/21/2014Current Assessment RatingNANot ApplicableCause of DamageYesAccessibleYesPotential for DamageLowRemovedNoPlanned Response ActionO & MCause of DamageComment of the second of the	Does Material Contain Asbe	stos? Assumed
Current Surveillance Date4/21/2014Current Assessment RatingNANot ApplicableCause of DamageYesAccessibleYesPotential for DamageLowRemovedNoPlanned Response ActionO & MAccessibleAdditional Accession	Is it Friable?	No
Current Assessment RatingNANot ApplicableCause of DamageYesAccessibleYesPotential for DamageLowRemovedNoPlanned Response ActionO & MAccessibleAccessibleAccessibleMAccessib	Original Inspection Date	6/27/2011
Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M	Current Surveillance Date	4/21/2014
Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M	Current Assessment Rating	NA Not Applicable
Potential for Damage Low Removed No Planned Response Action O & M	Cause of Damage	
Removed No Planned Response Action O & M	Accessible	Yes
Planned Response Action O & M	Potential for Damage	Low
Apt	Removed	No
Inspector Add	Planned Response Action	0 & M
Inspector		CARD
	Inspector	(10)

Jeffrey P. Rechtin

State Accreditation Number

LEA Name Greater Clark County Schools Building Name Northaven Elementary School HA# F Type of Material Miscellaneous Material Quantity of Material Unquantified LF Material Location Classrooms Material Description Sink Insulation Comments This material was noted during the 6/27/2011 inspection and will remain in the management plan until property sampled. Does Material Contain Asbesson No Original Inspection Date 6/27/2011 inspection and will remain in the management plan until property sampled. Does Material Contain Asbesson No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2011 Current Assessment Rating NA Not Applicable Cause of Damage Ves Potential for Damage Ves Potential for Damage Ves Removed No Planned Response Action Ves Ves Na Not Applicable Material Na Not Applicable Materi		
HA# F Type of Material Miscellane∪us Material Quantity of Material Unquantified LF Material Location Classrooms Material Description Sink Insulation Comments This material was noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled. Does Material Contain Asbestos? Assumed Is it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Assessment Rating NA Not Applicable Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action Other Surveillance Cause of Damage Na Not Applicable	LEA Name	Greater Clark County Schools
Type of Material Miscellane∪us Material Quantity of Material Unquantified LF Material Location Classrooms Material Description Sink Insulation Comments This material was noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled. Does Material Contain Asbestos? Assumed No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Surveillance Date 4/21/2014 Current Surveillance Date Yes Potential for Damage Low Removel No Planned Response Action O & M	Building Name	Northaven Elementary School
Quantity of Material Unquantified LF Material Location Classrooms Classrooms Sink Insulation Comments This material was noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled. Does Material Contain Asbestos? Assumed Is it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Assessment Rating NA Not Applicable Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M	HA#	F
Material Location Classrooms Material Description Sink Insulation Comments This material was noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled. Does Material Contain Asbestos? Assumed Is it Friable? No Original Inspection Date G/27/2011 Current Surveillance Date Urrent Assessment Rating Cause of Damage Accessible Potential for Damage Removed No Planned Response Action Classible Classible Cause of Damage Cause of Damage Comment Comments Cause of Damage Cause of Damage	Type of Material	Miscellaneous Material
Classrooms Material Description Sink Insulation Comments This material was noted durity the 6/27/2011 inspection and will remain in the management plan until property sampled. Does Material Contain Asbestos? Assumed Is it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 6/27/2011 Current Assessment Rating No Cause of Damage NA Accessible Yes Potential for Damage Low Removed No Planned Response Action O'& M	Quantity of Material	Unquantified LF
Material Description Sink Insulation Comments This material was noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled. Does Material Contain Asbestos? Assumed Is it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Assessment Rating NA Not Applicable Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M	Material Location	
Sink Insulation Comments This material was noted duris the 6/27/2011 inspection and will remain in the management plan until property sampled. Does Material Contain Asbestos? Assumed Is it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Assessment Rating NA Not Applicable Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M	Classrooms	
Comments This material was noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled. Does Material Contain Asbestos? Assumed Does Material Contain Asbestos? Assumed Is it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Assessment Rating NA Not Applicable Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M	Material Description	
This material was noted during the 6/27/2011 inspection and will remain in the management plan until property sampled. Does Material Contain Asbestos? Assumed Is it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Assessment Rating NA Not Applicable Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M	Sink Insulation	
management plan until properly sampled. Does Material Contain Asbestos? Assumed Is it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Assessment Rating NA Not Applicable Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M	Comments	
Is it Friable? No Original Inspection Date 6/27/2011 Current Surveillance Date 4/21/2014 Current Assessment Rating NA Not Applicable Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M		V
Original Inspection Date6/27/2011Current Surveillance Date4/21/2014Current Assessment RatingNANot ApplicableCause of DamageYesAccessibleYesPotential for DamageLowRemovedNoPlanned Response ActionO & MAccessibleSame ActionCause of DamageAccessibleCause of DamageLowRemovedNoCause Of DamageCause ActionCause Of DamageCause ActionCause Of DamageLowRemovedNoCause Of DamageCause ActionCause Of DamageCause Action <t< th=""><th>Does Material Contain Asbes</th><th>stos? Assumed</th></t<>	Does Material Contain Asbes	stos? Assumed
Current Surveillance Date4/21/2014Current Assessment RatingNANot ApplicableCause of DamageYesAccessibleYesPotential for DamageLowRemovedNoPlanned Response ActionO & MAccessibleAdd Add Add Add Add Add Add Add Add Ad	Is it Friable?	No
Current Assessment RatingNANot ApplicableCause of DamageYesAccessibleYesPotential for DamageLowRemovedNoPlanned Response ActionO & MAccessibleAccessibleAccessibleMAccessib	Original Inspection Date	6/27/2011
Cause of Damage Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M	Current Surveillance Date	4/21/2014
Accessible Yes Potential for Damage Low Removed No Planned Response Action O & M Accessible Yes Low No Mathematical Structure Str	Current Assessment Rating	NA Not Applicable
Potential for Damage Low Removed No Planned Response Action O & M	Cause of Damage	
Removed No Planned Response Action O & M	Accessible	Yes
Planned Response Action 0 & M	Potential for Damage	Low
AND	Removed	No
Inspector ADA	Planned Response Action	O&M
	Inspector	410

Jeffrey P. Rechtin

State

Accreditation Number

LEA Name	Greater Clark County Schools			
Building Name	Northaver	n Elementary Scho	ol	
HA#	06			
Type of Material	Miscellan	eous Material		
Quantity of Material	15,190 SF	=		
Material Location				
Throughout the b	uilding			
Material Description				
Floor tile mastic				
Comments				
This material was	not expose	ed to inspect.		
Does Material Contain Asbe	sbestos? Assumed			
Is it Friable?		No		
Original Inspection Date		6/1/1988		
Current Surveillance Date		10/24/2013		
Current Assessment Rating	I	NR	Not Rated	
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage		Low		
Removed		No		
Planned Response Action		O & M		

- -

Inspector

Jeffrey P: Rechtin

State Accreditation Number

			,	
<u>,</u>	LEA Name	Greater Cl	lark County School	s
	Building Name	Northaven	Elementary School	วโ
	HA#	В		
	Type of Material	Miscellane	eous Material	
	Quantity of Material	Approx. 1,	650 LF	
	-	uilding (exc	ept the gymnasium)
	Material Description			
	Cove base moldir	ıg (brown)		
	Comments			
	This material was	not in poor	condition overall.	
	Does Material Contain Asbe	stos?	Assumed	
	Is it Friable?		No	
	Original Inspection Date		5/31/1996	
	Current Surveillance Date		10/24/2013	
	Current Assessment Rating		NR	Not Rated
	Cause of Damage		No Damage	
_	Accessible		Yes	
/	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		O & M	

- - - -

Inspector

 $\hat{}$

Jeffrey P. Rechtin

State Accreditation Number

-	LEA Name	Greater C	lark County S	chools
	Building Name	Northaver	n Elementary	School
	HA#	С		
	Type of Material	Miscellane	eous Material	
	Quantity of Material	Approx. 1,	,200 SF	
	Material Location Throughout the b	uilding		
	Material Description			
	Cove base mastic	2		
	Where exposed in not in poor condit		storage room	and boys dressing room, this material was
	Does Material Contain Asbe	stos?	Assumed	
	Is it Friable?		No	
	Original Inspection Date		5/31/1996	
	Current Surveillance Date		10/24/2013	
	Current Assessment Rating		NR	Not Rated
$\overline{}$	Cause of Damage		No Damage	
_	Accessible		No	
	Potential for Damage		Low	
	Removed		Νο	
	Planned Response Action		O & M	CAA-D-
	Inspector			- 110

Jeffrey P. Rechtin

State Accreditation Number

.

, ,

LE.	A Name	Greater Cla	ark County Sc	hools
Bu	ilding Name	Northaven	Elementary S	chool
HA	#	E		
Туј	pe of Material	Miscellane	ous Material	
Qu	antity of Material	Unquantifie	ed Each	
Ma	terial Location			
	Throughout the bi	uilding exce	pt Rooms 113	, 116 and 120.
Ма	terial Description			
	Fire Rated Doors			
Co	mments			
	These doors were management plar	e noted durir 1 until prope	ng the 6/27/20 rly sampled.	11 inspection and will remain in the
Do	es Material Contain Asbe	stos?	Assumed	
is i	t Friable?		No	
Ori	ginal Inspection Date		6/27/2011	
Cu	rrent Surveillance Date		10/24/2013	
Cu	rrent Assessment Rating		NA	Not Applicable
Ca	use of Damage			
Ac	cessible		Yes	
Po	tential for Damage		Low	
Re	moved		No	
Pla	nned Response Action		O & M	نو دنيو
				Alt F
اسم	noctor			-(10

Inspector

•---

Jeffrey P. Rechtin

- -

State Accreditation Number

	LEA Name	Greater C	lark County Sch	ools
_	Building Name	Northaver	n Elementary Sc	hool
	HA#	F		
	Type of Material	Miscellane	eous Material	
	Quantity of Material	Unquantifi	ied LF	
	Material Location Classrooms			
	Material Description			
	Sink Insulation			
	Comments			
	This material was management plar			1 inspection and will remain in the
	Does Material Contain Asbe	stos?	Assumed	
	Is it Friable?		No	
	Original Inspection Date		6/27/2011	
	Current Surveillance Date		10/24/2013	
	Current Assessment Rating		NA	Not Applicable
``\	Cause of Damage			
~	Accessible		Yes	
	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		O & M	
				The Francisco -

Inspector

- ~ -----

Jeffrey P. Rechtin

State **Accreditation Number**

LEA Name	Greater C	lark County Sch	ools
Building Name	Northaven	Elementary Sc	hool
HA#	06		
Type of Material	Miscellane	ous Material	
Quantity of Material	15,190 SF	•	
Material Location			
Throughout the be	uilding		
Material Description			
Floor tile mastic			
Comments			
This material was	not expose	d to inspect.	
Does Material Contain Asbe	stos?	Assumed	
ls it Friable?		No	
Original Inspection Date		6/1/1988	
Current Surveillance Date		10/24/2012	
Current Assessment Rating		NR	Not Rated
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action		O & M	
			- St. I's

Inspector

Jeffrey P. Rechtin

Z - X

State Accreditation Number

LEA Name	Greater Clark County Schools	
Building Name	Northaven Elementary School	
HA#	В	
Type of Material	Miscellaneous Material	
Quantity of Material	Approx. 1,650 LF	
Material Location		
Throughout the b	uilding (except the gymnasium)	
Material Description		
Cove base moldi	ng (brown)	
Comments		
This material was	not in poor condition overall.	
Does Material Contain Asbe	estos? Assumed	
Is it Friable?	No	
Original Inspection Date	5/31/1996	
Current Surveillance Date	10/24/2012	
Current Assessment Rating	NR Not Rated	
Cause of Damage	No Damage	
Accessible	Yes	
Potential for Damage	Low	
Removed	No	
Planned Response Action	0 & M	
	AND D	

Inspector

Jeffrey P. Rechtin

State Accreditation Number

LEA Name	Greater (Clark County So	hools
Building Name	Northave	n Elementary S	chool
HA#	С		
Type of Material	Miscellar	eous Material	
Quantity of Material	Approx. 1	1,200 SF	
Material Location			
Throughout the	building		
Material Description			
Cove base mast	ic		
Comments			
Where exposed not in poor cond	in the stage ition.	e storage room a	and boys dressing room, this material was
Does Material Contain Asb	estos?	Assumed	
Is it Friable?		No	
Original Inspection Date		5/31/1996	
Current Surveillance Date		10/24/2012	
Current Assessment Ratin	9	NR	Not Rated
Cause of Damage		No Damage	25
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action		O & M	CAPA TO-
Inspector		<u> </u>	Jeffrev P. Rechtin

State

(

(

Accreditation Number

LEA Name	Greater Clark Cou	nty Schools
Building Name	Northaven Elemen	tary School
HA#	E	
Type of Material	Miscellaneous Mat	erial
Quantity of Material	Unquantified Each	
Material Location		
Throughout the t	uilding except Room	is 113, 116 and 120.
Material Description		
Fire Rated Doors	5	
Comments		
These doors wer management pla	e noted during the 6/ n until properly samp	27/2011 inspection and will remain in the led.
Does Material Contain Asb	estos? Assume	ed
Is it Friable?	No	
Original Inspection Date	6/27/20	11
Current Surveillance Date	10/24/2	012
Current Assessment Rating	NA NA	Not Applicable
Cause of Damage		
Accessible	Yes	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	
Inspector		CAPA TO-

inspector

Jeffrey P. Rechtin

State **Accreditation Number**

LEA Name	Greater Clark County	Schools
Building Name	Northaven Elementary	School
HA#	F	
Type of Material	Miscellaneous Materia	l
Quantity of Material	Unquantified LF	
Material Location Classrooms		
Material Description		
Sink Insulation		
Comments		
	noted during the 6/27/2 n until properly sampled	2011 inspection and will remain in the
Does Material Contain Asbe	estos? Assumed	
Is it Friable?	No	
Original Inspection Date	6/27/2011	
Current Surveillance Date	10/24/2012	2
Current Assessment Rating	NA	Not Applicable
Cause of Damage		
Accessible	Yes	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	
Inspector		
		Jeffrey P. Rechtin
State	Indiana	

19A003594

(

Accreditation Number

LEA Name	Greater Cla	ark County Scho	ols
Building Name	Northaven I	Elementary Scho	100
HA#	06		
Type of Material	Miscellaneo	ous Material	
Quantity of Material	15,190 SF		
Material Location			
Throughout the bu	uilding		
Material Description			
Floor tile mastic			
Comments			
This material was	not exposed	l to inspect.	
Does Material Contain Asbes	stos? /	Assumed	
Is it Friable?	1	No	
Original Inspection Date	e	6/1/1988	
Current Surveillance Date	e	6/25/2012	
Current Assessment Rating	h	NR	Not Rated
Cause of Damage	١	No Damage	
Accessible	1	No	
Potential for Damage	L	Low	
Removed	٢	No	
Planned Response Action	C	D & M	1
Inspector	-	-4	peffery P. Rechtin

State Accreditation Number

LEA Name	Greater C	lark County	Schools	
Building Name	Northave	n Elementary	School	
HA#	В			
Type of Material	Miscellan	eous Materia	1	
Quantity of Material	Approx. 1	,650 LF		
Material Location				
Throughout the b	uilding (exc	ept the gymr	nasium)	
Material Description				
Cove base moldir	ng (brown)			
Comments				
This material was	not in pool	r condition ov	verall.	
Does Material Contain Asbe	stos?	Assumed		
Is it Friable?		No		
Original Inspection Date		5/31/1996		
Current Surveillance Date		6/25/2012		
Current Assessment Rating		NR	Not Rated	
Cause of Damage		No Damage	9	
Accessible		Yes		
Potential for Damage		Low		
Removed		No		
Planned Response Action		O & M		
Inspector			AL FF	\sum
			Jeffery P. Rechtin	
State		Indiana	V	

State Accreditation Number

LEA Name	Greater Clar	k County Schoo	ls
Building Name	Northaven Elementary School		
HA#	С		
Type of Material	Miscellaneou	us Material	
Quantity of Material	Approx. 1,20	00 SF	
Material Location			
Throughout the b	uilding		
Material Description			
Cove base mastic			
Comments			
Where exposed ir not in poor conditi	n the stage sto on.	orage room and	boys dressing room, this material was
Does Material Contain Asbe	stos? A	ssumed	
Is it Friable?	N	lo	
Original Inspection Date	5/	/31/1996	
Current Surveillance Date	6/	/25/2012	
Current Assessment Rating	N	R	Not Rated
Cause of Damage	N	o Damage	
Accessible	N	0	
Potential for Damage	Lo	w	
Removed	N	o	20
Planned Response Action	0	& M	
Inspector	_	-9	Jeffery P. Rechtin
State	Inc	diana	

Accreditation Number

(

(

LEA Name	Greater Clark County Schools		
Building Name	Northaven Elementary School		
HA#	E		
Type of Material	Miscellaneous Material		
Quantity of Material	Unquantified Each		
Material Location			
Throughout the bu	ilding except Rooms 113, 116 and 120.		
Material Description			
Fire Rated Doors			
Comments			
	noted during the 6/27/2011 inspection and will remain in the until properly sampled.		
Does Material Contain Asbes	stos? Assumed		
Is it Friable?	No		
Original Inspection Date	6/27/2011		
Current Surveillance Date	6/25/2012		
Current Assessment Rating	NA Not Applicable		
Cause of Damage			
Accessible	Yes		
Potential for Damage	Low		
Removed	No		
Planned Response Action	O & M		
Inspector	MAR		
	deffery P. Rechtin		

State

(

(

Accreditation Number

LEA Name	Greater Clark County Schools		
Building Name	Northaven Elementary School		
HA#	F		
Type of Material	Miscellane	eous Material	
Quantity of Material	Unquantif	ied LF	
Material Location			
Classrooms			
Material Description			
Sink Insulation			
Comments			
This material was management plar	noted duri 1 until prope	ng the 6/27/2 erly sampled.	011 inspection and will remain in the
Does Material Contain Asbe	stos?	Assumed	
Is it Friable?		No	
Original Inspection Date		6/27/2011	
Current Surveillance Date		6/25/2012	
Current Assessment Rating		NA	Not Applicable
Cause of Damage			
Accessible		Yes	
Potential for Damage		Low	
Removed		No	
Planned Response Action		O & M	
Inspector			MAR.5
			Deffer P. Rechtin
State		Indiana	~

Accreditation Number

(

(

19A003594

LEA Name	Greater Cl	lark County Scho	ols
Building Name		Elementary Scho	
HA#	06	•	
Type of Material		eous Material	
Quantity of Material	15,190 SF		
Material Location			
Throughout the b	uilding		
Material Description			
Floor tile mastic			
Comments			
This material was	not expose	ed to inspect.	
Does Material Contain Asbe	stos?	Assumed	
Is it Friable?		No	
Original Inspection Date		6/1/1988	
Current Surveillance Date		6/27/2011	
Current Assessment Rating		NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action		O & M	
Inspector	<	Sand	Sandra Shadley

Sandra Shadley

State

Indiana

Accreditation Number

19A002323

LEA Name	Greater Clark County Schools			
Building Name	Northaven Elementary School			
HA#	В			
Type of Material	Miscellaneous Material			
Quantity of Material	Approx. 1,650 LF			
Material Location				
Throughout the t	puilding (except the gymnasium)			
Material Description				
Cove base moldi	ing (brown)			
Comments				
This material was	s not in poor condition overall.			
Does Material Contain Asb	estos? Assumed			
Is it Friable?	No			
Original Inspection Date	5/31/1996			
Current Surveillance Date	6/27/2011			
Current Assessment Rating	g NR Not Required			
Cause of Damage	No Damage			
Accessible	Yes			
Potential for Damage	Low			
Removed	No			
Planned Response Action	O & M			

Inspector

Sandra Shadlog Sandra Shadley

State Accreditation Number

LEA Name	Greater C	lark County So	chools
Building Name	Northaver	n Elementary S	School
HA#	С		
Type of Material	Miscellan	eous Material	
Quantity of Material	Approx. 1	,200 SF	
Material Location			
Throughout the t	ouilding		
Material Description			
Cove base masti	с		
Comments			
Where exposed not in poor condi		storage room	and boys dressing room, this material was
Does Material Contain Asb	estos?	Assumed	
Is it Friable?		No	
Original Inspection Date		5/31/1996	
Current Surveillance Date		6/27/2011	
Current Assessment Rating	9	NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action		O & M	
Inspector		San	dia Sladley

State Accreditation Number

(

LEA Name	Greater Clark County Schools
Building Name	Northaven Elementary School
HA#	E
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified Each
Material Location	
Throughout the t	puilding except Rooms 113, 116 and 120.
Material Description	
Fire Rated Doors	
Comments	
	e noted during the 6/27/2011 inspection and will remain in the nuntil properly sampled.
Does Material Contain Asb	estos? Assumed
Is it Friable?	No
Original Inspection Date	6/27/2011
Current Surveillance Date	6/27/2011
Current Assessment Rating	NA Not Applicable
Cause of Damage	
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
Inspector	Sandea Slady.

Sandra Shadley

State

Accreditation Number

LEA Name	Greater C	lark County S	chools
Building Name	Northaver	n Elementary	School
HA#	F		
Type of Material	Miscellan	eous Material	
Quantity of Material	Unquantif	ied LF	
Material Location Sink			
Material Description			
White Sink Insula	ation		
Comments			
This material was management pla			011 inspection and will remain in the
Does Material Contain Asb	estos?	Assumed	
Is it Friable?		No	
Original Inspection Date		6/27/2011	
Current Surveillance Date		6/27/2011	
Current Assessment Rating	9	NA	Not Applicable
Cause of Damage			
Accessible		Yes	
Potential for Damage		Low	
Removed		No	
Planned Response Action		O & M	
Inspector	¢	San	dia Alad Sandra Shadley
			, C

State Accreditation Number

(

Indiana 19A002323

LEA Name	Greater C	lark County Sci	hools	
Building Name	Northaver	Elementary So	chool	
HA#	06			
Type of Material	Miscellane	eous Material		
Quantity of Material	15,190 SF	-		
Material Location				
Throughout the b	uilding			
Material Description			9g	
Floor tile mastic			•	
Comments				
This material was	not expose	ed to inspect.		
Does Material Contain Asbe	estos?	Assumed		
Is it Friable?		No		
Original Inspection Date		6/1/1988		
Current Surveillance Date		12/6/2010		
Current Assessment Rating		NR	Not Required	
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage		Low		
Removed		No		
Planned Response Action		O & M		
Inspector			Paul W. Krick	

State Accreditation Number

LEA Name	Greater C	lark County Sch	ools
Building Name	Northaven	Elementary Sc	hool
HA#	В		
Type of Material	Miscellane	eous Material	
Quantity of Material	Approx. 1,	650 LF	
Material Location			
Throughout the b	uilding (exc	ept the gymnasi	ium)
Material Description			
Cove base moldir	ng (brown)		
Comments			
This material was	not in poor	condition overa	dl.
Does Material Contain Asbe	stos?	Assumed	
ls it Friable?		No	
Original Inspection Date		5/31/1996	
Current Surveillance Date		12/6/2010	
Current Assessment Rating		NR	Not Required
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage	S2	Low	
Removed		No	
Planned Response Action		0 & M	
Inspector			Paul W. Krick

State Accreditation Number

LEA Name	Greater Cl	ark County	School	ls	
Building Name	Northaven	Elementar	y Schoo	bl	
HA#	С				
Type of Material	Miscellane	ous Materi	al		
Quantity of Material	Approx. 1,	200 SF			
Material Location Throughout the bi	uilding				
Material Description					
Cove base mastic	;				
Comments					
Where exposed ir not in poor conditi		storage roo	om and	boys dressing room, this material was	
Does Material Contain Asbe	stos?	Assumed			
Is it Friable?	No				
Original Inspection Date		5/31/1996			
Current Surveillance Date		12/6/2010)		
Current Assessment Rating		NR		Not Required	
Cause of Damage		No Damage			
Accessible		No			
Potential for Damage		Low			
Removed		No			
Planned Response Action		O & M			
Inspector			4	Paul W. Krick	
* 2		2	્ય		
State		Indiana			

Accreditation Number

197812124

LEA Name	Greater Cla	ark County Schoo	ls
uilding Name	Northaven	Elementary Scho	ol
HA#	06		
Type of Material	Miscellane	ous Material	
Quantity of Material	15,190 SF		
Material Location			
Throughout the bi	uilding		
Material Description			
Floor tile mastic			
Comments			
This material was	not expose		
Does Material Contain Asbe	estos?	Assumed	
Is it Friable?		No	
Original Inspection Date		6/1/1988	
Current Surveillance Date		12/3/2009	
Current Assessment Rating	1	NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
otential for Damage		Low	
Removed		No	
Planned Response Action		O & M	
			A

Inspector

George William Ogle

State Accreditation Number



LEA Name	Greater Clark County Schoo	ols
ilding Name	Northaven Elementary Scho	lol
HA#	В	
Type of Material	Miscellaneous Material	
Quantity of Material	Approx. 1,650 LF	
	uilding (except the gymnasiu	m)
Material Description		
Cove base moldir	ng (brown)	
Comments		
This material was	not in poor condition overall.	
Does Material Contain Asbe	stos? Assumed	
Is it Friable?	No	
Original Inspection Date	5/31/1996	
Current Surveillance Date	12/3/2009	
Current Assessment Rating	NR NR	Not Required
Cause of Damage	No Damage	
Accessible	Yes	
otential for Damage	Low	
Removed	No	
Planned Response Action	O & M	

Inspector

State Accreditation Number Indiana 191003027 George William Ogle

	LEA Name	Greater Cla	ark County Scho	ols
	uilding Name	Northaven	Elementary Scho	bol
5	HA#	С		
	Type of Material	Miscellane	ous Material	
	Quantity of Material	Approx. 1,	200 SF	
	Material Location			
	Throughout the b	uilding		
	Material Description			
	Cove base mastic	C		
	Comments			
	Where exposed i not in poor condit	n the stage tion.	storage room an	d boys dressing room, this material was
	Does Material Contain Asbe	estos?	Assumed	
	Is it Friable?		Νο	
	Original Inspection Date		5/31/1996	
	Current Surveillance Date		12/3/2009	
	Current Assessment Rating	3	NR	Not Required
	Cause of Damage		No Damage	
-	ccessible		No	
-	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		O & M	
				A. WAL

Inspector

é

C

George William Ogle

State Accreditation Number

LEA Name	Greater Cla	ark County School	S
Building Name	Northaven	Elementary School	bl
HA#	06		
Type of Material	Miscellane	ous Material	
Quantity of Material	15,190 SF		
Material Location Throughout the bu	ulding		
Material Description	licing		
Floor tile mastic			
Comments			
This material was	not expose	d to inspect.	
Does Material Contain Asbe	stos?	Assumed	
Is it Friable?		Νο	
Original Inspection Date		6/1/1988	
Current Surveillance Date		6/10/2009	
Current Assessment Rating		NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action		0 & M	

inspector

C

George William Ogle

State Accreditation Number IN 191003027

_	LEA Name	Greater Cla	ark County Schools	3
	uilding Name	Northaven	Elementary Schoo	l
	HA#	В		
	Type of Material	Miscellaneo	ous Material	
	Quantity of Material	Approx. 1,6	50 LF	
	Material Location			
	Throughout the bu	uilding (exce	pt the gymnasium)
	Material Description			
	Cove base moldin	g (brown)		
	Comments			
	This material was	not in poor	condition overall.	
	Does Material Contain Asbe	stos?	Assumed	
	ls it Friable?		No	
	Original Inspection Date		5/31/1996	
	Current Surveillance Date		6/10/2009	
	Current Assessment Rating		NR	Not Required
	Cause of Damage		No Damage	
_	Accessible		Yes	
	otential for Damage		Low	
	Removed		No	
	Planned Response Action		O & M	

inspector

George William Ogle

State **Accreditation Number** IN 191003027

LEA Name	Greater C	lark County Scho	ols
uilding Name	Northave	n Elementary Sch	ool
HA#	С		
Type of Material	Miscellan	eous Material	
Quantity of Material	Approx. 1	,200 SF	
Material Location			
Throughout the	building		
Material Description			
Cove base mas	tic		
Comments			
Where exposed not in poor cond		e storage room an	d boys dressing room, this material was
Does Material Contain As	bestos?	Assumed	
is it Friable?		No	
Original Inspection Date		5/31/1996	
Current Surveillance Date)	6/10/2009	
Current Assessment Rati	ng	NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		Νο	
Planned Response Action	n	O & M	
Inspector			George Wille

George William øgle

State Accreditation Number

C

IN 191003027

LEA Name	Greater C	lark County Schoo	ls
Building Name	Northaven	Elementary Scho	ol
HA#	06		
Type of Material	Miscellane	eous Material	
Quantity of Material	15,190 SF	:	
Material Location			
Throughout the b	uilding		
Material Description			
Floor tile mastic			
Comments			
This material was	not expose	ed to inspect.	
Does Material Contain Asbe	stos?	Assumed	
ls it Friable?		No	
Original Inspection Date		6/1/1988	
Current Surveillance Date		12/10/2008	
Current Assessment Rating		NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action		O & M	

Inspector

C

(

George William Ogle

State Accreditation Number

LEA Name	Greater C	lark County Schoo	ls
Building Name	Northaver	Elementary Scho	ol
HA#	В		
Type of Material	Miscellane	eous Material	
Quantity of Material	Approx. 1,	650 LF	
Material Location			
Throughout the b	ouilding (exc	ept the gymnasiun	n)
Material Description			
Cove base moldi	ng (brown)		
Comments			
This material was	s not in poor	condition overall.	
Does Material Contain Asb	estos?	Assumed	
Is it Friable?		Νο	
Original Inspection Date		5/31/1996	
Current Surveillance Date		12/10/2008	
Current Assessment Rating	9	NR	Not Required
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage		Low	
Removed		No	
Planned Response Action		O & M	

Inspector

George William Ogle

State Accreditation Number

LEA Name	Greater Cl	lark County Scho	pols	
Building Name	Northaven	Elementary Sch	nool	
HA#	С			
Type of Material	Miscellane	ous Material		
Quantity of Material	Approx. 1,	200 SF	2	
Material Location				
Throughout the b	uilding			
Material Description				
Cove base mastic				
Comments				
Where exposed in not in poor condit		storage room an	d boys dressing room, this material was	
Does Material Contain Asbe	stos?	Assumed		
Is it Friable?		No		
Original Inspection Date		5/31/1996		
Current Surveillance Date		12/10/2008		
Current Assessment Rating		NR	Not Required	
Cause of Damage		No Damage		
Accessible		Νο		
Potential for Damage		Low		
Removed		Νο		
Planned Response Action		O & M		
			2 112/1	

Inspector

George William Ogle

State Accreditation Number

LEA Name	Greater Cla	ark County School	s
Building Name	Northaven	Elementary School	bl
HA#	06		
Type of Material	Miscellane	ous Material	
Quantity of Material	15,190 SF		
Material Location			
Throughout the bu	uilding		
Material Description			
Floor tile mastic			
Comments			
This material was	not expose	d to inspect.	
Does Material Contain Asbe	stos?	Assumed	
Is it Friable?		No	
Original Inspection Date		6/1/1988	
Current Surveillance Date		6/30/2008	
Current Assessment Rating		NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action		O & M	
			And Inthat

Inspector

George William/Ogle

State Accreditation Number

LEA Name	Greater Cl	ark County Schoo	ls	
Building Name	Northaven	Elementary Scho	ol	
HA#	В			
Type of Material	Miscellane	ous Material		
Quantity of Material	Approx. 1,	650 LF		
Material Location Throughout the built Material Description Cove base moldin Comments This material was Does Material Contain Asbes Is it Friable? Original Inspection Date Current Surveillance Date Current Assessment Rating Cause of Damage Accessible Potential for Damage	ig (brown) not in poor	condition overall. Assumed No 5/31/1996 6/30/2008 NR No Damage Yes Low	n) Not Required	τ
Removed		No		
Planned Response Action		O & M		

inspector

______ Seørge William Ogle

State Accreditation Number

	LEA Name	Greater Cl	ark County Sch	nools			
	Building Name	Northaven Elementary School					
	HA#	С					
	Type of Material	Miscellane	ous Material				
	Quantity of Material	Approx. 1,	200 SF				
	Material Location Throughout the bu	uilding					
	Material Description						
	Cove base mastic	:					
	Comments						
	Where exposed ir not in poor conditi		storage room a	ind boys	s dressing ro	om, this material was	
	Does Material Contain Asbe	stos?	Assumed				
	Is it Friable?		No				
	Original Inspection Date		5/31/1996				
	Current Surveillance Date		6/30/2008				
	Current Assessment Rating		NR	Not	t Required		
-	Cause of Damage		No Damage				
	Accessible		No	Ξ.			
	Potential for Damage		Low				
	Removed		No				
	Planned Response Action		O & M				
	Inspector			<u> </u>	<i>ng ////</i> ge William Ø	gle	

State

Accreditation Number

100				
<	LEA Name	Greater Cla	ark County School	6
	Building Name	Northaven	Elementary Schoo	
	HA#	06		
	Type of Material	Miscellane	ous Material	
	Quantity of Material	15,190 SF		
	Material Location			
	Throughout the bu	uilding		
	Material Description			
	Floor tile mastic			
	Comments			
	This material was	not expose	d to inspect.	
	Does Material Contain Asbe	stos?	Assumed	
	Is it Friable?		No	
	Original Inspection Date		6/1/1988	
	Current Surveillance Date		12/7/2007	
	Current Assessment Rating		NR	Not Required
	Cause of Damage		No Damage	
	Accessible		Νο	
U	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		O & M	

Inspector

<u>George William Ogle</u>

State **Accreditation Number**

LEA Name	Greater Cla	ark County School	S	
Building Name	Northaven	Elementary School	l	
HA#	В			
Type of Material	Miscellane	ous Material		
Quantity of Material	Approx. 1,6	650 LF		
Material Description	Throughout the building (except the gymnasium)			
Comments				
This material was	not in poor	condition overall.		
Does Material Contain Asbe	stos?	Assumed		
Is it Friable?		No		
Original Inspection Date		5/31/1996		
Current Surveillance Date		12/7/2007		
Current Assessment Rating		NR	Not Required	
Cause of Damage		No Damage		
Accessible		Yes		
Potential for Damage		Low		
Removed		No		
Planned Response Action		O & M		

Inspector

George William Ogle

State **Accreditation Number**

\bigcap		Greater Cl	ark County Sch	ools
C	LEA Name		Elementary Sc	
	Building Name		Elementary OC	
	HA#	С		
	Type of Material	Miscellane	ous Material	
	Quantity of Material	Арргох. 1,	200 SF	
	Material Location			
	Throughout the b	uilding		
	Material Description			
	Cove base mastic			
	Comments			
	Where exposed in not in poor condit	n the stage ion.	storage room a	nd boys dressing room, this material was
	Does Material Contain Asbe	stos?	Assumed	
	Is it Friable?		No	
	Original Inspection Date		5/31/1996	
	Current Surveillance Date		12/7/2007	
	Current Assessment Rating)	NR	Not Required
	Cause of Damage		No Damage	
	Accessible		No	
	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		O & M	
	Inspector			Genge W Velc George William Ogle

State Accreditation Number

C

1		Creater Cl	ark County Sabaal	-	
	LEA Name		ark County School		
	Building Name	Northaven	Elementary Schoo	DI	
	HA#	06			
	Type of Material	Miscellane	ous Material		
	Quantity of Material	15,190 SF			
	Material Location Throughout the bu	uildina			
	Material Description				
	Floor tile mastic				
	Comments				
	This material was	not expose	d to inspect.		
	Does Material Contain Asbe	stos?	Assumed		
	Is it Friable?		No		
	Original Inspection Date		6/1/1988		
	Current Surveillance Date		7/9/2007		
	Current Assessment Rating		NR	Not Required	
-	Cause of Damage		No Damage		
()	Accessible		No		
V	Potential for Damage		Low		
	Removed		No		
	Planned Response Action		O & M		
				•	01

Inspector

<u>Jenge //Jele_</u> George William Ogle

State Accreditation Number

LEA Name	Greater Cla	ark County School	s	
Building Name	Northaven	Elementary Schoo	bi	
HA#	В			
Type of Material	Miscellane	ous Material		
Quantity of Material	Approx. 1,6	550 LF		
Material Location Throughout the bu Material Description	uilding (exce	ept the gymnasium)	
Cove base moldin Comments	g (brown)			
This material was	not in poor	condition overall.		
Does Material Contain Asbe	stos?	Assumed		
ls it Friable?		No		
Original Inspection Date		5/31/1996		
Current Surveillance Date		7/9/2007		
Current Assessment Rating		NR	Not Requ	ired
Cause of Damage		No Damage		
Accessible		Yes		
Potential for Damage		Low		
Removed		No		
Planned Response Action		O & M		
			17	115/0 1

Inspector

George William Ogle

State Accreditation Number

LEA Name	Greater Clark County Schools				
Building Name	Northaven Elementary School				
HA#	С				
Type of Material	Miscellaneous Materia	al			
Quantity of Material	Approx. 1,200 SF				
Material Location Throughout the b Material Description	building				
Cove base masti	c				
Comments					
Where exposed i main office (to th	in the stage storage roo e south). This material	m, boys dressing room and across from the was not in poor condition.			
Does Material Contain Asb	estos? Assumed				
Is it Friable?	No				
Original Inspection Date	5/31/1996				
Current Surveillance Date	7/9/2007				
Current Assessment Rating) NR	Not Required			
Cause of Damage	No Damag	e			
Accessible	No				
Potential for Damage	Low				
Removed	No				
Planned Response Action	O & M				
Inspector		 Seorge/William Ogle			

State Accreditation Number

	LEA Name		ark County School			
	Building Name	Northaven	Elementary School	bl		
	HA#	06				
	Type of Material	Miscellane	ous Material			
	Quantity of Material	15,190 SF				
	Material Location Throughout the built Material Description Floor tile mastic Comments This material was Does Material Contain Asbes Is it Friable? Original Inspection Date Current Surveillance Date	not expose	Assumed No 6/1/1988 12/19/2006 NR	Not Requ	uired	
0	Cause of Damage		No Damage No			
1	•		Low			
	Potential for Damage					
	Removed		Νο			
	Planned Response Action		0 & M			
				6	IMAA	

Inspector

<u> Yeage (K lyle</u> George/William Ogle

State Accreditation Number

	LEA Name	Greater Cla	ark County School	S	
	Building Name	Northaven	Elementary Schoo	bl	
	HA#	В			
	Type of Material	Miscellane	ous Material		
	Quantity of Material	Approx. 1,6	550 LF		
	Material Location Throughout the building (except the gymnasium) Material Description Cove base molding (brown) Comments				
	This material was	not in poor	condition overall.		
	Does Material Contain Asbe		Assumed		
	ls it Friable?		No		
	Original Inspection Date		5/31/1996		
	Current Surveillance Date		12/19/2006		
	Current Assessment Rating		NR	Not Required	
	Cause of Damage		No Damage		
)	Accessible		Yes		
	Potential for Damage		Low		
	Removed		No		
	Planned Response Action		O & M		
				A. 1401	

Inspector

<u> George William Ogle</u>

State Accreditation Number

	LEA Name Building Name		ark County Sch Elementary Scl	
	HA#	С		
	Type of Material	Miscellane	ous Material	
	Quantity of Material	Approx. 1,3	200 SF	
	Material Location Throughout the bu	uilding		
	Material Description			
	Cove base mastic			
	Comments			
Where exposed in the stage s south). This material was not			storage room a t in poor conditi	nd across from the main office (to the on.
	Does Material Contain Asbe	stos?	Assumed	
	is it Friable?		No	
	Original Inspection Date		5/31/1996	
	Current Surveillance Date		12/19/2006	
	Current Assessment Rating		NR	Not Required
	Cause of Damage		No Damage	
	Accessible		No	
	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		O & M	
	Inspector	27	<u></u>	George/William Ogle

State

Accreditation Number

	LEA Name	Greater Cla	ark County Scl	hools	
	Building Name	Northaven	Elementary So	chool	
	HA#	06			
	Type of Material	Miscellane	ous Material	5 C	
	Quantity of Material	15,190 SF			
	Material Location		14		
	Throughout the bu	uilding			
	Material Description				
	Floor tile mastic				
	Comments				
	This material was	not expose	d to inspect.		
	Does Material Contain Asbe	stos?	Assumed		
	Is it Friable?		No		
	Original Inspection Date		6/1/1988		
	Current Surveillance Date		6/28/2006		
	Current Assessment Rating		NR	Not Required	
	Cause of Damage		No Damage		
-	Accessible		No		
\cup	Potential for Damage		Low		
	Removed		No		
	Planned Response Action		O & M	n N	
	Inspector			Christopher Ames	

State Accreditation Number

1	LEA Name	Greater Cla	ark County Sch	nools	
5	Building Name	Northaven	Elementary So	hool	
	HA#	В			
	Type of Material	Miscellane			
	Quantity of Material	Approx. 1,6	650 LF		
	Material Location				
	Throughout the bi	uilding (exce	ept the gymnas	ium)	
	Material Description				
	Cove base moldin	g (brown)			
	Comments				
	This material was has been a lot of quantity is now es	black cove b	base used whe	all. The quantity is not accurate as there n the new flooring was installed. The	
	Does Material Contain Asbestos?		Assumed		
	Is it Friable?		No		
	Original Inspection Date		5/31/1996		
	Current Surveillance Date		6/28/2006		
~	Current Assessment Rating		NR	Not Required	
C	Cause of Damage		No Damage		
	Accessible		Yes		
	Potential for Damage		Low		
	Removed		No	Λ	
	Planned Response Action		O & M		
	Inspector			Christopher Ames	
	State		Indiana		
			400640404		

Accreditation Number

198612124

(LEA Name	Greater Cla	ark County Scho	ols	
	Building Name	Northaven	Elementary Sch	ool	
	HA#	С			
	Type of Material	Miscellaneous Material			
	Quantity of Material	Approx. 1,2	200 SF		
	Material Location				
	Throughout the b	uilding			
	Material Description				
	Cove base mastic	2			
	Comments				
	Where exposed in	n the stage :	storage room, th	is material was not in poor condition.	
	Does Material Contain Asbestos?		Assumed		
	ls it Friable?		No		
	Original Inspection Date		5/31/1996		
	Current Surveillance Date		6/28/2006		
	Current Assessment Rating		NR	Not Required	
	Cause of Damage		No Damage		
\bigcap	Accessible		No		
1	Potential for Damage		Low		
	Removed		No	1	
	Planned Response Action		O & M		
	inspector			Christopher Ames	

State Accreditation Number

(

LEA Name	Greater Clark County Schools		
Building Name	Northaven Elementary School		
HA#	06		
Type of Material	Miscellaneous Material		
Quantity of Material	15,190 SF		
Material Location			
Throughout the b	uilding		
Material Description			
Floor tile mastic			
Comments	2		
This material was	not exposed	I to inspect.	
Does Material Contain Asbe	estos?	Assumed	
Is it Friable?	I	No	
Original Inspection Date	(6/1/1988	
Current Surveillance Date		1/24/2006	
Current Assessment Rating	j l	NR	Not Required
Cause of Damage	8	No Damage	
Accessible	1	No	
Potential for Damage	I	Low	
Removed	I	No	
Planned Response Action	(O & M	

Inspector

George William Ogle

State Accreditation Number

LEA Name	Greater Ck	ark County Scho	ole	
		Clark County Schools		
Building Name	Normaven	Elementary Scho	001	
HA#	В			
Type of Material	Miscellaneo	ous Material		
Quantity of Material	Approx. 1,6	50 LF		
Material Location				
Throughout the I	ouilding (exce	pt the gymnasiu	m)	
Material Description				
Cove base mold	ng (brown)			
Comments				
	black cove b	ase used when t	The quantity is not accurate he new flooring was installed.	
Does Material Contain Asb	estos?	Assumed		
ls it Friable?		No		
Original Inspection Date		5/31/1996		
Current Surveillance Date		1/24/2006		
Current Assessment Rating]	NR	Not Required	
Cause of Damage		No Damage		
Accessible		Yes		
Potential for Damage		Low		
Removed		No		
Planned Response Action		O & M		
Increasing			anne ut the	

Inspector

-

<u>Yeinge William Ogte</u>

as there The


State Accreditation Number

LEA Name	Greater Clark County Schools		
Building Name	Northaven Elementary School		
HA#	С		
Type of Material	Miscellaneous Material		
Quantity of Material	Approx. 1,200 SF		
Material Location			
Throughout the bu	uilding		
Material Description			
Cove base mastic			
Comments			
Where exposed in	the stage	storage room, this	s material was not in poor condition.
Does Material Contain Asbe	stos?	Assumed	
Is it Friable?		No	
Original Inspection Date		5/31/1996	
Current Surveillance Date		1/24/2006	
Current Assessment Rating		NR	Not Required
Cause of Damage		No Damage	
Accessible	20	No	
Potential for Damage		Low	
Removed		Νο	
Planned Response Action		O & M	

Inspector

George William Ogle

State Accreditation Number

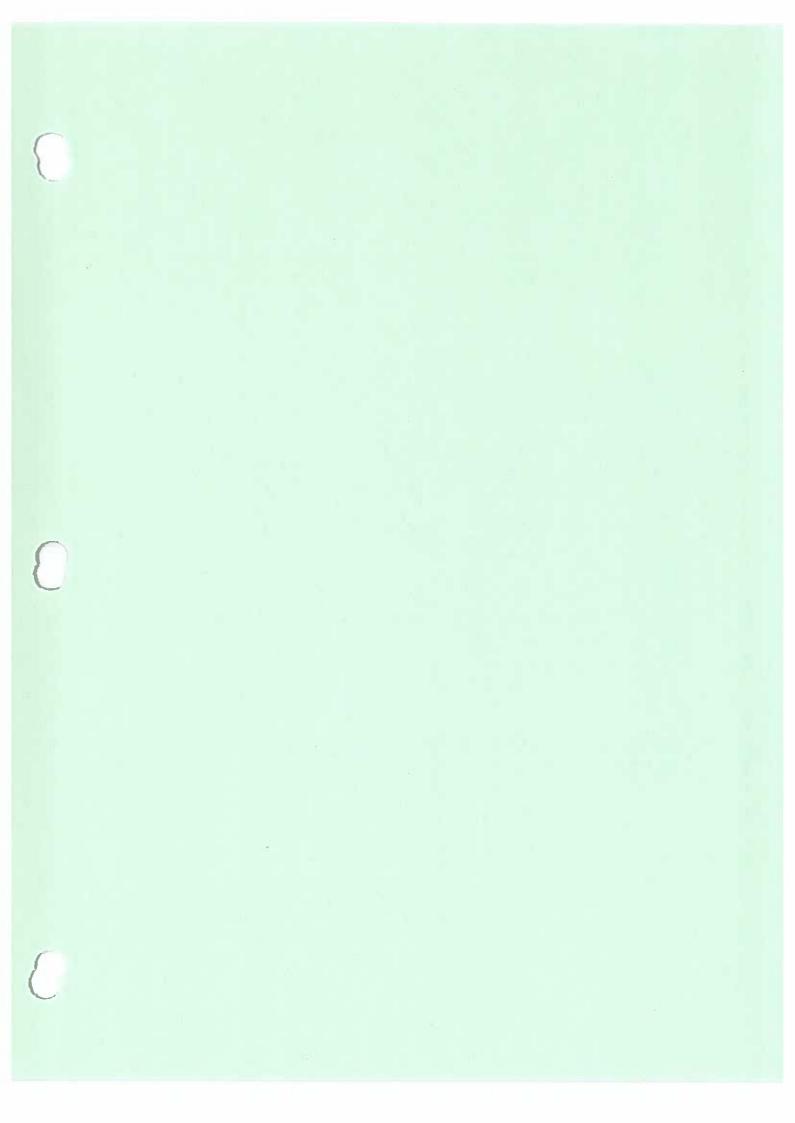

LEA Name	Greater Clark County Schools				
Building Name	Northaven Elementary School				
HA#	06				
Type of Material	Miscellaneous	Material			
Quantity of Material	15,190 SF				
Material Location Throughout the I	ouilding				
Material Description Floor tile mastic					
Comments This material was not exposed to inspect.					
Does Material Contain Asbes	tos? As	Assumed			
Is it Friable?	No	1			
Original Inspection Date		6/1/1988			
Current Surveillance Date	7/1	18/2005			
Current Assessment Rating	NR	ł	Not Required		
Cause of Damage	No	Damage			
Accessible	No)			
Potential for Damage	Lov	w			
Removed	No)			
Planned Response Action	0	& M			

Inspector

Sing <u>III Affe</u> George William Ogle

State Accreditation Number

	LEA Name	Greater Cl	ark County Schoo	bls
	Building Name	Northaven	Elementary Scho	ol
	HA#	в		
	Type of Material	Miscellane	ous Material	
	Quantity of Material	Approx. 3	,600 LF	
Material Location Throughout the building (ex			cept the gymnasiu	(mi
	Material Description Cove base molding	ng (brown)		
on the corner of the cabin			in the art room a	II. However, there is one small piece missing nd one at the main entrance. The cafeteria mall chips missing from edges throughout the
	Does Material Contain Asbes	tos?	Assumed	
	ls it Friable?		No	
	Original Inspection Date		5/31/1996	
	Current Surveillance Date		7/18/2005	
	Current Assessment Rating		NR	Not Required
2	Cause of Damage		No Damage	
1	Accessible		Yes	
	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		O & M	
	Inspector			Genar INT Ale

George William Ogle

State


Accreditation Number

L	EA Name	Greater Clark County Schools				
В	uilding Name	Northaven Elementary School				
Н	A#	С				
т	ype of Material	Miscella	neous Material			
a	luantity of Material	Approx.	1,200 SF			
N	laterial Location Throughout the b	ouilding				
Material Description Cove base mastic						
Comments Where exposed (main entrance, art room, cafeteria), this material was not in				cafeteria), this material was not in poor condition.		
D	oes Material Contain Asbes	tos?	Assumed			
ls	s it Friable?		No			
0	riginal Inspection Date		5/31/1996			
C	urrent Surveillance Date		7/18/2005			
С	urrent Assessment Rating		NR	Not Required		
С	ause of Damage		No Damage			
A	ccessible		No			
P	otential for Damage		Low			
R	lemoved		No			
P	lanned Response Action		0 & M			

Inspector

George William Ogle

State Accreditation Number



LEA Name	Greater C	Clark County Scho	ools	
Building Name	Northaven Elementary School			
HA#	06	06		
Type of Material	Miscellan	eous Material		
Quantity of Material	15,190 5	6F		
Material Location Throughout the I	building			
Material Description Floor tile mastic				
Comments This material wa	is not expo	sed to inspect.		
Does Material Contain As	bestos?	Assumed		
Is it Friable?		No		
Original Inspection Date		6/1/1988		
Current Surveillance Date	;	12/8/2004		
Current Assessment Ration	ng	NR	Not Required	
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage		Low		
Removed		No	1	
Planned Response Action		0 & M -	Mar 1	
Inspector			Christiaan Sparks	

State Accreditation Number

1

LEA Name	Greater Clark County Schools
Building Name	Northaven Elementary School
HA#	В
Type of Material	Miscellaneous Material
Quantity of Material	Approx. 3,600 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

This material was not in poor condition overall. However, there is one small piece missing on the corner of the cabinet in the art room, and at the main entrance. The cafeteria has several small pieces missing. The material in the gymnasium was removed non-friable and replaced with new cove base molding.

Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	5/31/1996	
Current Surveillance Date	12/8/2004	
Current Assessment Rating	NR	Not Required
Cause of Damage	No Damage	
Accessible	Yes	
Potential for Damage	Low	
Removed	No -	/
Planned Response Action	0 & M	Dul.
		HAHH /
Inspector		Unit

Christiaan Sparks

State Accreditation Number

LEA Name	Greater (Clark County Sch	ools		
Building Name	Northave	Northaven Elementary School			
HA#	С				
Type of Material	Miscellar	neous Material			
Quantity of Material	Approx.	1,200 SF			
Material Location Throughout the	building				
Material Description Cove base mast	tic				
Comments Where exposed	(main entr	ance, art room, c	afeteria), this material was not in poor condition.		
Does Material Contain A	sbestos?	Assumed			
Is it Friable?		No			
Original Inspection Date		5/31/1996			
Current Surveillance Dat	е	12/8/2004			
Current Assessment Rat	ing	NR	Not Required		
Cause of Damage		No Damage			
Accessible		No			
Potential for Damage		Low			
Removed		No	/		
Planned Response Action	า	0 & M	hele		
Inspector		-	the		
			Christiaan Sparks		

State Accreditation Number

()

C

0



LEA Name	Greater Clark County Schools			
Building Name	Northaven Elementary School			
HA#	06			
Type of Material	Miscellane	ous Material		
Quantity of Material	15,190 SF	Ξ		
Material Location Throughout the b	ouilding			
Material Description Floor tile mastic				
Comments This material was	s not expos	ed to inspect.		
Does Material Contain As	bestos?	Assumed		
Is it Friable?		No		
Original Inspection Date		06/01/1988		
Current Surveillance Date		12/09/2003		
Current Assessment Ratin	g	NR	Not Required	
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage		Low		
Removed		No	/	
Planned Response Action		0 & M	Atol.	
• •			11stl/	

Inspector

(

Christiaan Sparks

State Accreditation Number

LEA Name	Greater C	lark County Sc	hools			
Building Name	Northave	Northaven Elementary School				
HA#	в	В				
Type of Material	Miscellan	eous Material				
Quantity of Material	Approx. 3	3,600 LF				
Material Location Throughout the	building					
Material Description Cove base mold	ing					
on the corner of	the cabine	t in the art room g. The materia	rerall. However, there is one small piece missing m, and at the main entrance. The cafeteria has Il in the gymnasium was removed non-friable and			
Does Material Contain A	sbestos?	Assumed				
Is it Friable?		No				
Original Inspection Date		05/31/1996				
Current Surveillance Dat	е	12/09/2003				
Current Assessment Rat	ing	NR	Not Required			
Cause of Damage		No Damage				
Accessible		Yes				
Potential for Damage		Low				
Removed		Νο	7			
Planned Response Action	ו	O & M	Alth			
Inspector			Christiaan Sparks			

StateInAccreditation Number19

C


(

LEA Name	Greater Clark County Schools		
Building Name	Northaven Elementary School		
HA#	С		
Type of Material	Miscellan	eous Material	
Quantity of Material	Approx. 1	,200 SF	
Material Location Throughout the t	ouilding		
Material Description Cove base mastic	С		
Comments Where exposed (main entra	ince, art room, ca	feteria), this material was not in poor condition.
Does Material Contain As	bestos?	Assumed	
Is it Friable?		No	
Original Inspection Date		05/31/1996	
Current Surveillance Date		12/09/2003	
Current Assessment Ratin	ıg	NR	Not Required
Cause of Damage		No Damage	
Accessible		Νο	
Potential for Damage		Low	
Removed		No	/
Planned Response Action		0 & M	
Inspector			Christiaan Sparks

State	
Accreditation	Number

 \bigcirc

C

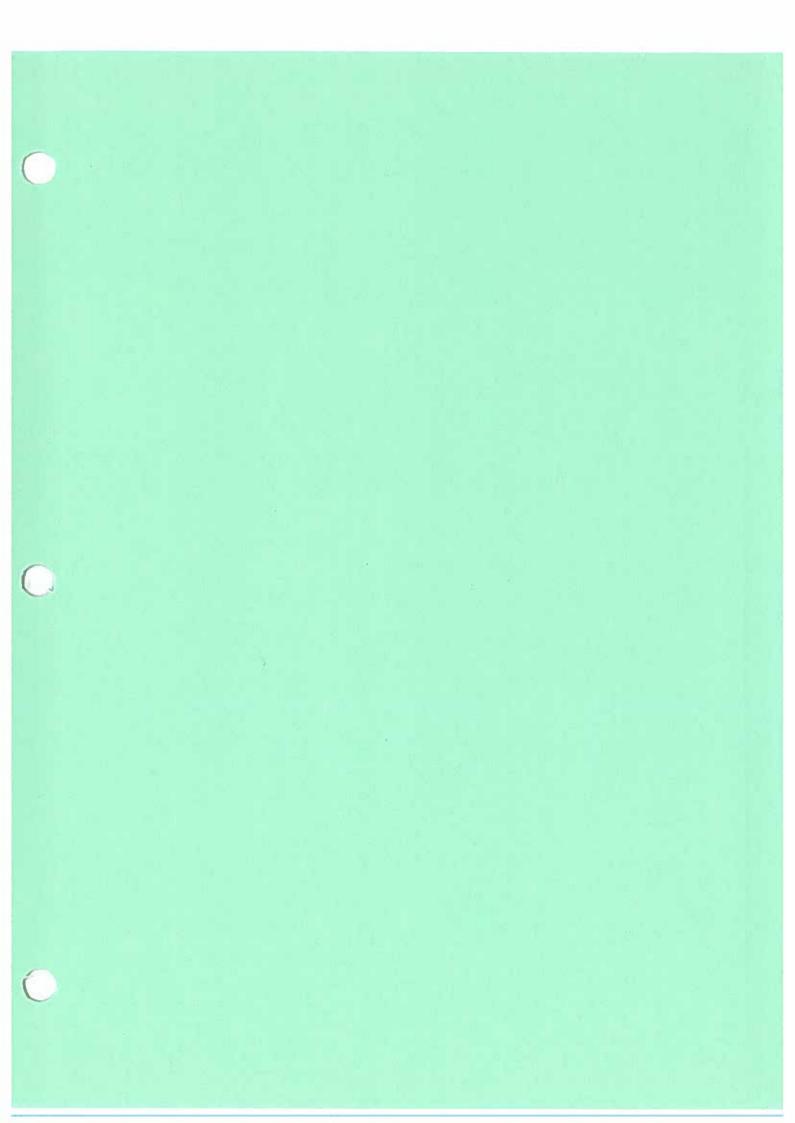

LEA Name	Greater Clark County Schools			
Building Name	Northaven Elementary School			
HA#	06			
Type of Material	Miscellane	eous Material		
Quantity of Material	15,190 SI	F		
Material Location Throughout the b	ouilding			
Material Description Floor tile mastic				
Comments This material was	s not expos	sed to inspect.		
Does Material Contain Ast	pestos?	Assumed		
Is it Friable?		No		
Original Inspection Date		06/01/1988		
Current Surveillance Date		06/13/2003		
Current Assessment Ratin	g	NR	Not Required	
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage		Low	/	
Removed		No		
Planned Response Action		0 & M	Ato//	
Inspector			about	

Christiaan Sparks

State **Accreditation Number**

C	LEA Name	Greater C	lark County Sch	ools	
	Building Name	Northave	n Elementary Sci	hool	
	HA#	В			
	Type of Material	Miscellan	eous Material		
	Quantity of Material	Approx. 3	3,600 LF		
	Material Location Throughout the b	ouilding			
	Material Description Cove base moldi	ng			
	corner of the cat	n poor condition overall. However, there is one small piece missing on t binet in the art room, and at the main entrance. The cafeteria has seve ssing. The material in the gymnasium was removed non-friable and repl pase molding.			
	Does Material Contain As	bestos?	Assumed		
	Is it Friable?		No		
	Original Inspection Date		05/31/1996		
	Current Surveillance Date		06/13/2003		
	Current Assessment Rating		NR	Not Required	
\bigcirc	Cause of Damage		No Damage		
	Accessible		Yes		
	Potential for Damage		Low	,	
	Removed		No		
	Planned Response Action		0 & M	ACT	
	Inspector			Christiaan Sparks	

State Indiana **Accreditation Number**

1


190804103

LEA Name	Greater Clark (County Schoo	ols		
Building Name	Northaven Elementary School				
HA#	С				
Type of Material	Miscellaneous	Material			
Quantity of Material	Approx. 1,200	SF			
Material Location Throughout the	building				
Material Description Cove base mast	ic				
Comments Where exposed	(main entrance,	art room, caf	feteria), this material was not in poor condition.		
Does Material Contain As	sbestos? Ass	umed			
Is it Friable?	No				
Original Inspection Date	05/3	31/1996			
Current Surveillance Date	e 06/1	13/2003			
Current Assessment Rati	ng NR		Not Required		
Cause of Damage	No I	Damage			
Accessible	No				
Potential for Damage	Low	1			
Removed	No		ſ		
Planned Response Action	N 0&	LМ	$\Delta I I a$		
Inspector			Christiaan Sparks		
State	Indi	ana			

Accreditation Number

 \bigcirc

(

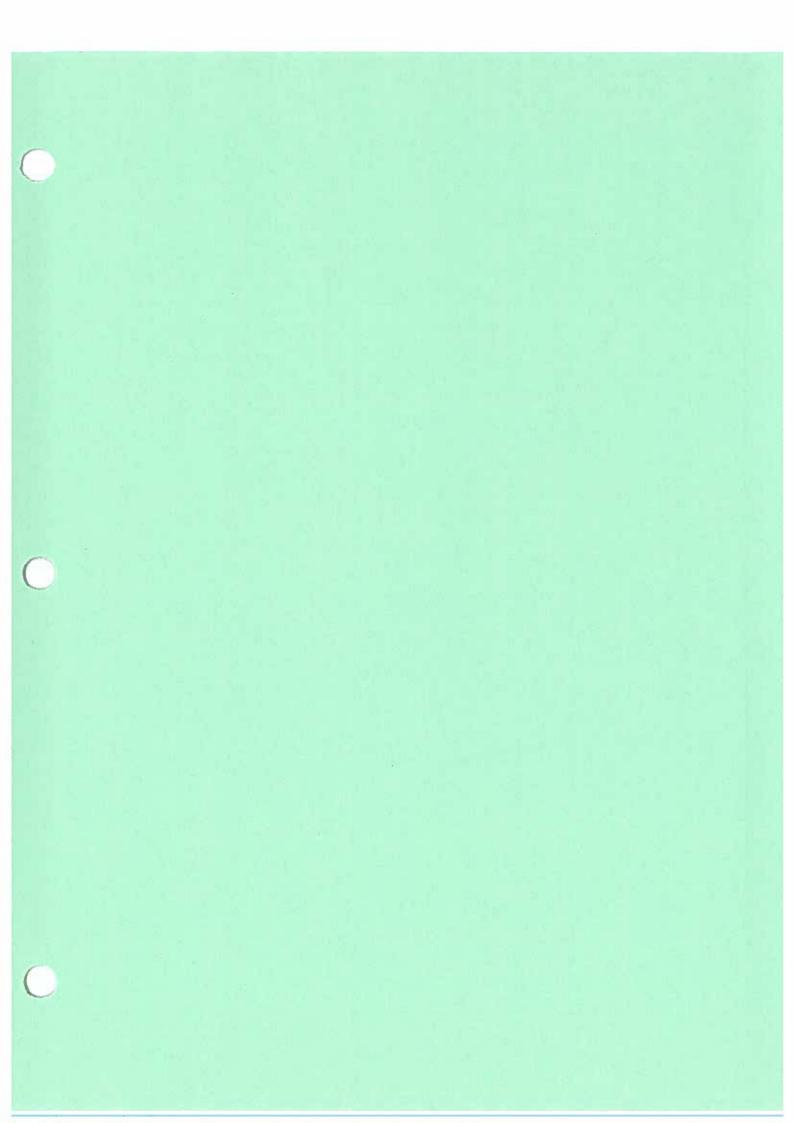

LEA Name	Graatar C	lark County Scho	
		·	
Building Name	Northaven Elementary School		
HA#	06		
Type of Material	Miscellan	eous Material	
Quantity of Material	15,190 S	F	
Material Location Throughout the b	ouilding		
Material Description Floor tile mastic			
Comments This material was	s not expo	sed to inspect.	
Does Material Contain Asl	bestos?	Assumed	
Is it Friable?		No	
Original Inspection Date		06/01/1988	
Current Surveillance Date		12/17/2002	
Current Assessment Ratin	g	NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	į
Planned Response Action		O & M	Adda
Inspector			Christiaan Sparks

State	
Accreditation	Number

LEA Name	Greater C	lark County Sch	ools		
Building Name	Northaven Elementary School				
HA#	В				
Type of Material	Miscellan	eous Material			
Quantity of Material	Approx. 3	3,600 LF			
Material Location Throughout the b	ouilding				
Material Description Cove base moldin	ng				
corner of the cab	inet in the sing. The s	art room, and a material in the g	wever, there is one small piece missing on the t the main entrance. The cafeteria has several ymnasium was removed non-friable and replaced		
Does Material Contain Asl	bestos?	Assumed			
Is it Friable?		No			
Original Inspection Date		05/31/1996			
Current Surveillance Date		12/17/2002			
Current Assessment Rating		NR	Not Required		
Cause of Damage		No Damage			
Accessible		Yes			
Potential for Damage		Low			
Removed		No			
Planned Response Action		O & M	Adeta		
Inspector			Christiaan Sparks		
State		Indiana			

Accreditation Number

C

190804103


LEA Name	Greater Clark County Schools				
Building Name	Northaven Elementary School				
HA#	С				
Type of Material	Miscellaneous Material				
Quantity of Material	Approx. 1,200 SF				
Material Location Throughout the	building				
Material Description Cove base mast	tic				
Comments Where exposed	(main entrance, art room	n, cafeteria), this material was not in poor condition.			
Does Material Contain A	sbestos? Assumed				
Is it Friable?	No				
Original Inspection Date	05/31/1996	6			
Current Surveillance Date	e 12/17/2002	2			
Current Assessment Rati	ing NR	Not Required			
Cause of Damage	No Damage				
Accessible	No				
Potential for Damage	Low				
Removed	Νο	<i>[</i>			
Planned Response Action	n O&M	$\Delta \phi$			
Inspector		Christiaan Sparks			
State	Indiana				

Accreditation	Number
Aconcatation	rearriser

(

Ć

(

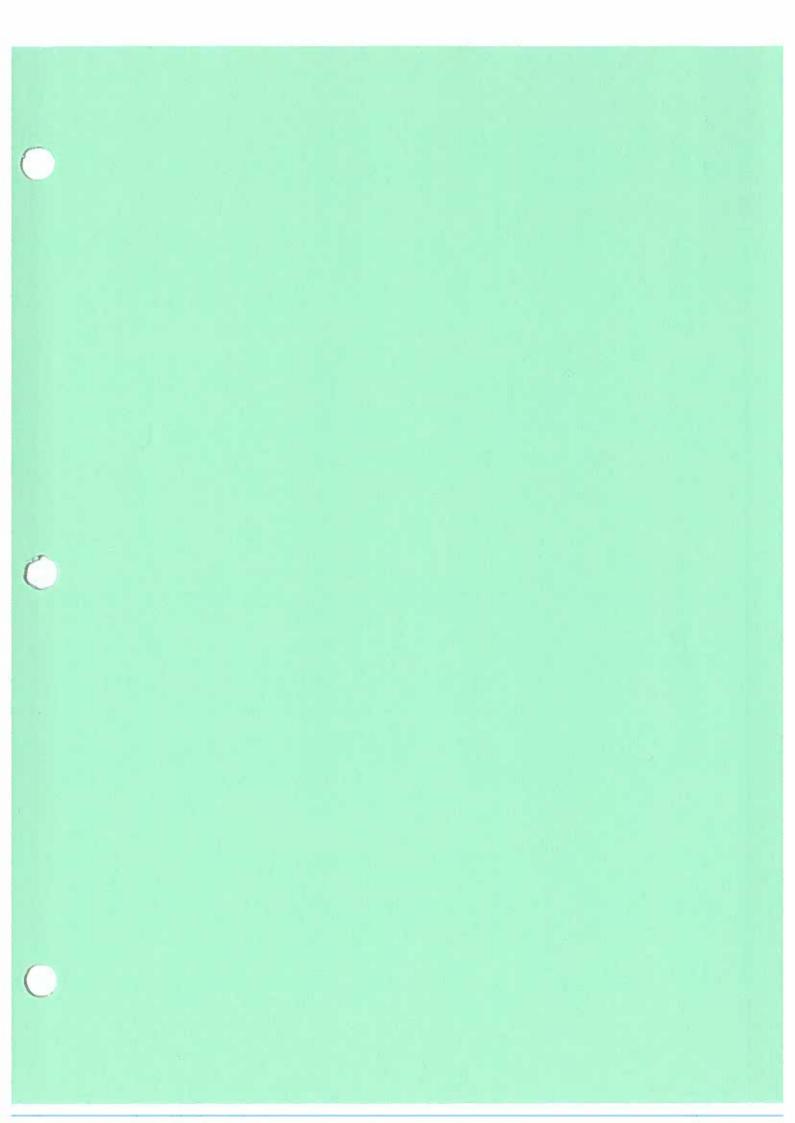

LEA Name	Greater Clark County Schools		
Building Name	Northave	n Elementary Sci	hool
HA#	06		
Type of Material	Miscellan	eous Material	
Quantity of Material	15,190 S	SF	
Material Location Throughout the I	building		
Material Description Floor tile mastic			
Comments No mastic was e	exposed to	inspect.	
Does Material Contain As	bestos?	Assumed	
Is it Friable?		No	
Original Inspection Date		06/01/1988	
Current Surveillance Date		06/19/2002	
Current Assessment Ratir	ng	NR	Not Required
Cause of Damage		No Damage	
Accessible		Νο	
Potential for Damage		Low	
Removed		No	
Planned Response Action		0 & M	$(\bigcap \cap A)$
Inspector		Duh	Richard D. Calvert

State Accreditation Number

	LEA Name	Greater Clark County Schools					
	Building Name	Northaver	n Elementary So	hool			
	HA#	В					
	Type of Material	Miscellan	Miscellaneous Material				
	Quantity of Material	Approx. 3,600 LF					
	Material Location Throughout the building						
	Material Description Cove base moldir	ng					
		ia and at tl	he main entranc	owever, there is one small piece missing in the e. The material in the gymnasium was removed se molding.			
	Does Material Contain Asl	pestos?	Assumed				
	Is it Friable?		No				
	Original Inspection Date		05/31/1996				
	Current Surveillance Date		06/19/2002				
	Current Assessment Rating		NR	Not Required			
C 12	Cause of Damage		No Damage				
()	Accessible		Yes				
~	Potential for Damage		Low				
	Removed		No				
	Planned Response Action		O & M	Richard D. Calvert			

State **Accreditation Number**

C


C

1	LEA Name	Greater Clark County Schools				
	Building Name	Northaven Elementary School				
	HA#	C				
	Type of Material	Miscellaneous Material				
	Quantity of Material	Approx. 1	,200 SF			
	Material Location Throughout the b	uilding				
	Material Description Cove base mastic	5				
	Comments Where exposed (main entra	nce, art room, c	afeteria) material is not in poor condition.		
	Does Material Contain Asl	pestos?	Assumed			
	Is it Friable?		No			
	Original Inspection Date		05/31/1996			
	Current Surveillance Date		06/19/2002			
	Current Assessment Ratin	g	NR	Not Required		
	Cause of Damage		No Damage			
	Accessible		No			
(·	Potential for Damage		Low			
\cup	Removed		No			
	Planned Response Action		0 & M	7		
	Inspector		Jul	Richard D. Calvert		

State	
Accreditation	Number

(

(

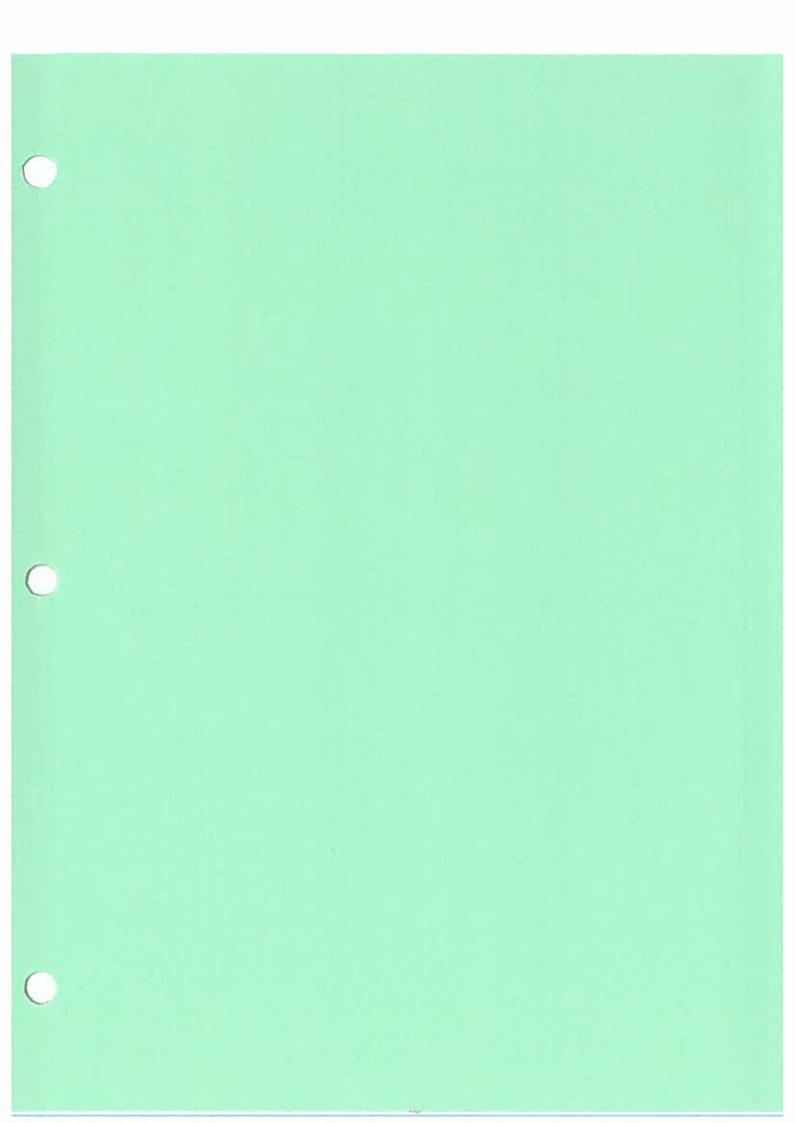

LEA Name	Greater Clark County Schools			
Building Name	Northaven Elementary School			
HA#	06			
Type of Material	Miscellane	eous Material		
Quantity of Material	15,190 S	F		
Material Location Throughout the b	uilding			
Material Description Floor tile mastic				
Comments No mastic was ex	kposed to i	inspect.		
Does Material Contain Ast	pestos?	Assumed		
ls it Friable?		Νο		
Original Inspection Date		06/01/1988		
Current Surveillance Date		12/11/2001		
Current Assessment Ratin	g	NR	Not Required	
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage		Low		
Removed		Νο		
Planned Response Action		0 & M	1	
Inspector		Steph-	Stephen Kimbrough	

State **Accreditation Number**

LEA Name	Greater C	lark County Sci	nools
Building Name	Northaver	Elementary So	hool
HA#	В		*
Type of Material	Miscellane	eous Material	
Quantity of Material	Approx. 3	,600 LF	
Material Location Throughout the	building		
Material Description Cove base mold	ing		
	ria and at th	ne main entrand	owever, there is one small piece missing in the e. The material in the gymnasium was removed se molding.
Does Material Contain As	bestos?	Assumed	
Is it Friable?		No	
Original Inspection Date		05/31/1996	
Current Surveillance Date	<u>!</u>	12/11/2001	
Current Assessment Ration	ng	NR	Not Required
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage		Low	
Removed		No	
Planned Response Action		0 & M	/
Inspector		Aleph p	inbrough Stepher Kimbrough

State Accreditation Number


-

LEA Name	Greater (Clark County Schools			
Building Name	Northave	en Elementary School			
HA#	С				
Type of Materia	l Miscellar	neous Material			
Quantity of Mat	erial Approx.	1,200 SF			
Material Locatio Throug	n hout the building				
Material Descrip Cove b	otion ase mastic				
Comments Where	exposed (main entra	rance, art room, cafeteria) material is not in poor condition.			
Does Material C	ontain Asbestos?	Assumed			
Is it Friable?		Νο			
Original Inspecti	ion Date	05/31/1996			
Current Surveilla	ance Date	12/11/2001			
Current Assessr	nent Rating	NR Not Required			
Cause of Damag	ge	No Damage			
Accessible		Νο			
Potential for Da	mage	Low			
Removed		Νο			
Planned Respon	se Action	0&M /			
Inspector		Atech Lickough Stephen Kizibrough			
State		Indiana			

Accreditation Number

C

C

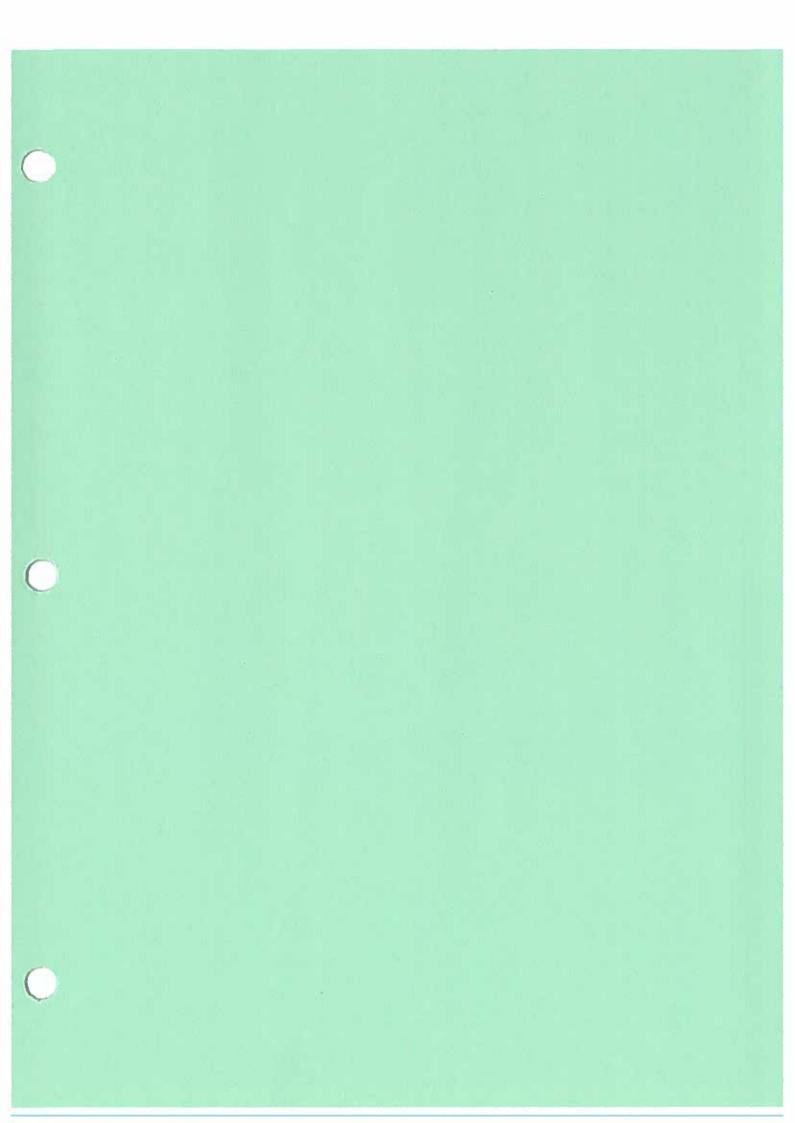

LEA Name	Greater (Clark County	Schools
Building Name	Northave	n Elementary	School
HA#	06		
Type of Material	Miscellar	neous Materia	af
Quantity of Material	15,190 \$	SF	
Material Location Throughout the i	building		
Material Description Floor tile mastic			
Comments No mastic was e	exposed to	inspect.	
Does Material Contain As	bestos?	Assumed	
Is it Friable?		No	
Original Inspection Date		06/01/198	8
Current Surveillance Date	!	01/09/200	1
Current Assessment Ratio	ng	NR	Not Required
Cause of Damage		No Damage	9
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action		0 & M	
			PAL - NO

Inspector

Patrick E. Wilson

State Accreditation Number

LEA Name	Greater C	lark County	/ Scho	pols	
Building Name	Northaver	n Elementar	y Sch	nool	
HA#	В				
Type of Material	Miscellan	eous Materi	ial		
Quantity of Material	Approx. 3	,600 LF			
Material Location Throughout the I	ouilding				
Material Description Cove base moldi	ng				
Comments Material is in ove room, cafeteria a non-friable and r	and at the r	main entrar	nce. T	er, there is one small piece missing in the art The material in the gymnasium was removed e molding.	
Does Material Contain As	bestos?	Assumed			
Is it Friable?		No			
Original Inspection Date		05/31/1996			
Current Surveillance Date	•	01/09/2001			
Current Assessment Rati	ng	NR		Not Required	
Cause of Damage		No Dama	ge		
Accessible		Yes			
Potential for Damage		Low			
Removed		No			
Planned Response Actior	ı	0 & M	_		
Inspector			(-	LK C. WIL Patrick E. Wilson	


State

Accreditation Number

1	LEA Name	Greater Cla	ark County S	Greater Clark County Schools		
	Building Name	Northaven Elementary School				
	HA#	C				
	Type of Material	Miscellane	ous Material			
	Quantity of Material	Approx. 1,	,200 SF			
	Material Location Throughout the b	uilding				
	Material Description Cove base masti	2				
	Comments Where exposed (main entrar	nce, art room	, cafeteria) material is in good condition.		
	Does Material Contain Asbestos?		Assumed			
	Is it Friable?		No			
	Original Inspection Date		05/31/1996	ì		
	Current Surveillance Date		01/09/2001			
	Current Assessment Ratir	ıg	NR	Not Required		
	Cause of Damage		No Damage			
	Accessible		No			
-	Potential for Damage		Low			
1	Removed		Νο			
	Planned Response Action		0 & M	2		
	Inspector			Patrick E. Wilson		

State Accreditation Number

0

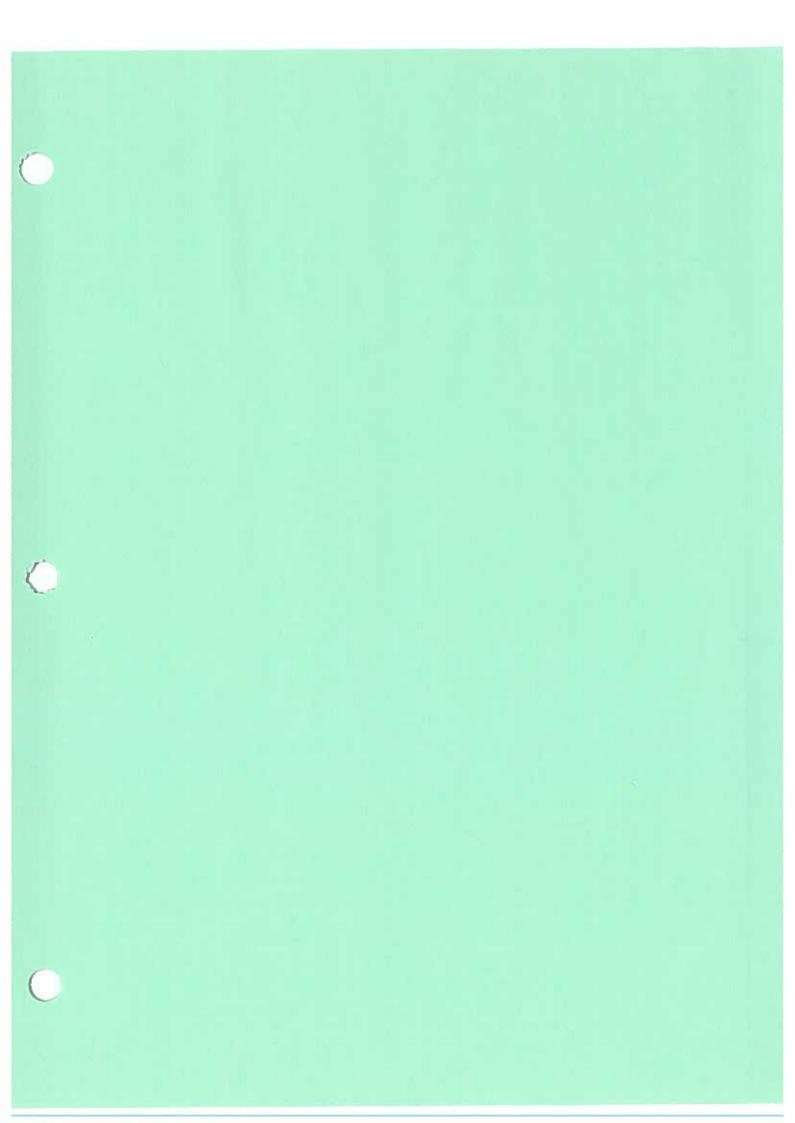

LEA Name	Greater (Clark County Scl	hools
Building Name	Northave	en Elementary So	chool
HA#	06		
Type of Material	Miscellar	neous Material	
Quantity of Material	15190 S	F	
Material Location Throughout the	e building		
Material Description Floor Tile Mast	ic		
Comments No mastic was	exposed to	inspect.	
Does Material Contain A	Asbestos?	Assumed	
Is it Friable?		No	
Original Inspection Date	•	06/01/1988	
Current Surveillance Da	te	06/29/2000	
Current Assessment Ra	ting	NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action	on	0 & M	
			A INAI

Inspector

George William Ogle

State Accreditation Number

e.	LEA Name	Greater Clark County Schools			
·	Building Name	Northaven Elementary School			
	HA#	A			
	Type of Material	Miscellaneous Material			
	Quantity of Material	Unquantified SF			
	Material Location At Entryway and	possibly Cafeteria			
	Material Description Transite Panels				
	•	inspected and found to be made of plywood and drywall. Neither material bestos content. This homogeneous area will be removed from the n.			
	Does Material Contain Asl	estos? No			
	Is it Friable?	No			
	Original Inspection Date	05/31/1995			
	Current Surveillance Date	06/29/2000			
	Current Assessment Ratin	g NA Not Applicable			
_	Cause of Damage	Not Applicable			
D	Accessible	Yes			
	Potential for Damage	NA			
	Removed	No			
	Planned Response Action	None			
	Increator	Cenan Ist Cal.			

Inspector

Jeorge William Ogle

State Accreditation Number

Northaven Elementary School **Building Name** В

HA#

Miscellaneous Material Type of Material

Unquantified LF Quantity of Material

Material Location

Throughout the building

Material Description

Cove Base Molding

Comments

Material is in overall good condition, however, there is one small piece missing in the art room, cafeteria and at the main entrance. The material in the gymnasium was removed non-friable and replaced with new cove base molding.

	Does Material Contain Asbestos?	Assumed	
	Is it Friable?	No	
	Original Inspection Date	05/31/1996	
	Current Surveillance Date	06/29/2000	
	Current Assessment Rating	NR	Not Required
	Cause of Damage	No Damage	
	Accessible	Yes	
	Potential for Damage	Low	
	Removed	No	
	Planned Response Action	0 & M	

Inspector

State Accreditation Number

LEA Name Greater Clark County S				hools		
	Building Name	Northaven	Elementary S	chool		
	HA#	C				
	Type of Material	Miscellane	ous Material			
	Quantity of Material	Unquantifi	ed LF			
	Material Location Throughout the building					
	Material Description Cove Base Mastic					
	Comments Where exposed (main entrance, art room, cafeteria) material is in good condition.					
	Does Material Contain Asbestos?		Assumed			
	Is it Friable?		No			
	Original Inspection Date		05/31/1996			
	Current Surveillance Date		06/29/2000			
	Current Assessment Ratio	ng	NR	Not Required		
	Cause of Damage Accessible		No Damage			
			No			
ñ	Potential for Damage		Low			
۲	Removed		No			
	Planned Response Action		0 & M			
	Inspector			George W Ogle George William Ogle	-	

State Accreditation Number

C

(

	LEA Name		ark County School				
	Building Name	Northaven Elementary School					
	HA#	D					
	Type of Material	Miscellane	ous Material				
	Quantity of Material	Unquantifi	ed SF				
	Material Location Between two cla	ssrooms					
	Material Description Movable Walls						
	Comments The walls were i material used in Management Pla	their constr	nd found to be ma uction. This home	de of metal panels with no sign of transite ogeneous area will be removed from the			
	Does Material Contain As	bestos?	Νο				
	Is it Friable?		No				
Original Inspection Date			05/31/1996				
	Current Surveillance Date	•	06/29/2000				
	Current Assessment Rating		NA	Not Applicable			
-	Cause of Damage		Not Applicable	Not Applicable			
)	Accessible		Yes				
	Potential for Damage		NA				
	Removed		Νο				
Planned Response Action Inspector			None				
			g	George William Øgle			
	State		Indiana				
	Accreditation Number		191523030				

C



LEA Name	Greater Clark County Schools			
Building Name	Northaven Elementary School			
HA#	06			
Type of Material	Miscellane	ous Material		
Quantity of Material	15190 SF			
Material Location Throughout the b	ouilding			
Material Description Floor Tile Mastic				
Comments Material is assun	ned to be in	good condition.	a	
Does Material Contain As	bestos?	Assumed		
Is it Friable?		No		
Original Inspection Date		06/01/1988		
Current Surveillance Date		12/08/1999		
Current Assessment Ratin	ng	NR	Not Required	
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage		Low		
Removed		No		
Planned Response Action		0 & M		

Inspector

Matthew Wallace

State Accreditation Number

LEA Name	Greater Cl	ark County Scho	ols
Building Name	Northaven	ool	
HA#	Α		
Type of Material	Miscellane	ous Material	
Quantity of Material	Unquantifi	ied SF	
Material Location At Entryway and	possibly C	afeteria	
Material Description Transite Panels			
Comments These panels app	ear to be v	wood.	
Does Material Contain Asl	pestos?	Assumed	
Is it Friable?		No	2
Original Inspection Date		05/31/1995	
Current Surveillance Date		12/08/1999	
Current Assessment Ratin	g	NR	Not Required
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage		Low	
Removed		No	
Planned Response Action		0 & M	

Inspector

Matthew Wallace

State Accreditation Number

LEA Name	Greater Clark County Schools

В

Building Name Northaven Elementary School

HA#

Type of Material Miscellaneous Material

Quantity of Material Unquantified LF

Material Location Throughout the building

Material Description

Cove Base Molding

Comments -

Material is in overall good condition, however, it is missing around the gymnasium and there is minor damage in the art room, cafeteria and at the main entrance.

Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	05/31/1996
Current Surveillance Date	12/08/1999
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Inspector

Matthew Wallace

State Accreditation Number

LEA Name	Greater C	lark County Scho	pols
Building Name	Northaver	n Elementary Sch	nooi
HA#	С		
Type of Material	Miscellane	eous Material	
Quantity of Material	Unquantif	ied LF	
Material Location Throughout the t	building		
Material Description Cove Base Masti	с		
Comments Where exposed (main entra	nce, gymnasium	, cafeteria) material is in good condition.
Does Material Contain As	bestos?	Assumed	
Is it Friable?		No	
Original Inspection Date		05/31/1996	
Current Surveillance Date		12/08/1999	
Current Assessment Ratir	ng	NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action		0 & M	
Inspector		/	llattale

Matthew Wallace

State Accreditation Number

2

LEA Name	Greater Cl	ark County Sch	nools	
Building Name	Northaven	Elementary So	:hool	
HA# 👒	D			
Type of Material	Miscellane	ous Material		
Quantity of Material	Unquantifi	ed SF		
Material Location Between two cla	ssrooms			
Material Description Movable Walls				***
Comments Walls may contai	in transite.	Material is in g	good condition.	
Does Material Contain Asi	bestos?	Assumed		
Is it Friable?		Νο		
Original Inspection Date		05/31/1996		
Current Surveillance Date		12/08/1999		
Current Assessment Ratin	Ig	NR	Not Required	
Cause of Damage		No Damage		
Accessible		Yes		
Potential for Damage		High		
Removed		No		
Planned Response Action		0 & M		
			11/11/	//

Inspector

Une

Matthew Wallace

State Accreditation Number



			1-
LEA Name	Greater C	lark County Sch	00IS
Building Name	Northaver	n Elementary Sc	hool
HA#	06		
Type of Material	Miscellan	eous Material	
Quantity of Material	15190 SF	:	
Material Location Throughout the	building		
Material Description Floor Tile Mastic	:		
Comments Material is assur	ned to be in	n good conditior	n.
Does Material Contain As	bestos?	Assumed	
Is it Friable?		No	
Original Inspection Date		06/01/1988	
Current Surveillance Date	•	06/24/1999	
Current Assessment Rati	ng	NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Actior	1	0 & M	MIM- LI
Inspector		/	Matthew Wallace

State Accreditation Number

LEA Name	Greater C	Clark County Sci	nools
Building Name	Northave	n Elementary Se	shool
HA#	Α		
Type of Material	Miscellan	eous Material	
Quantity of Material	Unquanti	fied SF	
Material Location At Entryway and	d possibly (Cafeteria	
Material Description Transite Panels			
Comments These panels ap	pear to be	wood.	
Does Material Contain As	sbestos?	Assumed	
Is it Friable?		No	
Original Inspection Date		05/31/1995	
Current Surveillance Date	B	06/24/1999	
Current Assessment Rati	ing	NR	Not Required
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage		Low	
Removed		No	
Planned Response Action	า	0 & M	. In MI . h
Inspector			Matthew Wallace

State Accreditation Number

LEA Name	Greater C	lark County Scho	pols	
Building Name	Northaver	n Elementary Sch	nool	
HA#	в			
Type of Material	Miscellan	eous Material		
Quantity of Material	Unquantif	ied LF		
Material Location Throughout the b	ouilding			
Material Description Cove Base Moldi	ng			
			nspection. Material is in overall good oom and cafeteria.	1 condition,
Does Material Contain As	bestos?	Assumed		
Is it Friable?		No		
Original Inspection Date		05/31/1996		
Current Surveillance Date		06/24/1999		
Current Assessment Ratir	ng	NR	Not Required	
Cause of Damage		No Damage		
Accessible		Yes		
Potential for Damage		Low		
Removed		No		
Planned Response Action		0 & M	MANT. 11	
Inspector			Matthew Wallace	

State Accreditation Number


 $(\)$

LEA Name	Greater C	lark Count	ty Schools
Building Name	Northave	n Elementa	ary School
HA#	С		
Type of Material	Miscellan	eous Mate	erial
Quantity of Material	Unquanti	fied LF	
Material Location Throughout the	building		
Material Description Cove Base Mast	tic		
Comments Material is assu	med to be i	n good cor	ndition.
Does Material Contain As	sbestos?	Assumed	d
Is it Friable?		No	
Original Inspection Date		05/31/19	996
Current Surveillance Date	e	06/24/19	999
Current Assessment Rati	ing	NR	Not Required
Cause of Damage		No Dama	age
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action	ı	0 & M	INA LA IN
Inspector			Matthew Wallace

State Accreditation Number

LEA Name	Greater C	lark County S	Schools
Building Name	Northaver	n Elementary	School
HA#	D		
Type of Material	Miscellan	eous Material	l .
Quantity of Material	Unquantif	ied SF	
Material Location Between two cl	assrooms		
Material Description Movable Walls			
Comments Walls may cont	ain transite.	Material is ir	n good condition.
Does Material Contain A	sbestos?	Assumed	
Is it Friable?		No	
Original Inspection Date		05/31/1996	6
Current Surveillance Date	9	06/24/1999	9
Current Assessment Rati	ng	NR	Not Required
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage		High	
Removed		No	
Planned Response Action	ו	0 & M	Mattin
Inspector			Matthew Wallace

State Accreditation Number

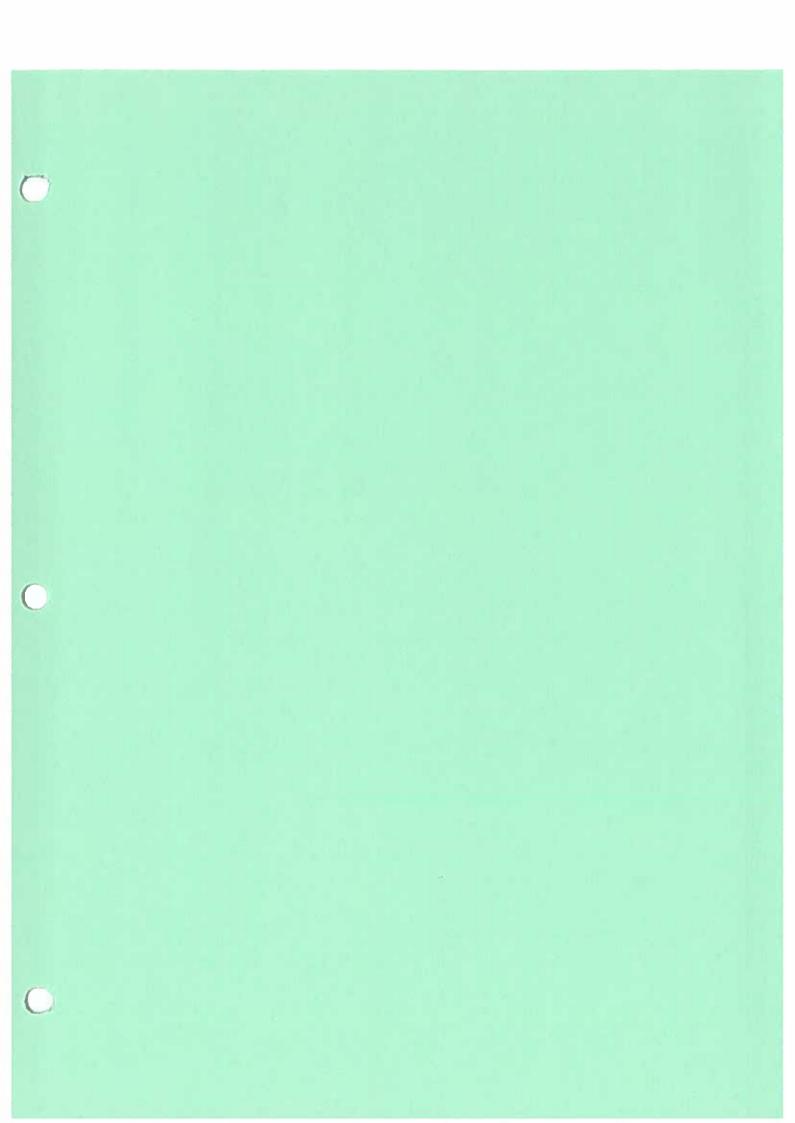

LEA Name	Greater Cl	lark County Schools
Building Name	Northaven	Elementary School
HA#	06	
Type of Material Quantity of Material Material Location Throughout the b	15190 SF	eous Material
Material Description Floor Tile Mastic		
Comments		
Material is assum		-
Does Material Contain As	bestos?	Assumed
ls it Friable?		No
Original Inspection Date		06/01/1988
Current Surveillance Date	e	12/29/1998
Current Assessment Rati	ng	NR Not Required
Cause of Damage		No Damage
Accessible		No
Potential for Damage		Low
Removed		No
Planned Response Action	n	0&M
Inspector		Clint Vates
State	/	Indiana
Accreditation Number		193804035

(

LEA Name	Greater Clark County Schools
	-
Building Name	Northaven Elementary School
HA#	A
Type of Material Quantity of Material Material Location At Entryway and p	Miscellaneous Material Unquantified SF possibly Cafeteria
Material Description Transite Panels	
Comments	
These panels app	pear to be wood.
Does Material Contain As	bestos? Assumed
Is it Friable?	No
Original Inspection Date	05/31/1995
Current Surveillance Date	e 12/29/1998
Current Assessment Rati	ng NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	n O&M /

Inspector

State

Clipt Yates Indiana

Accreditation Number

193804035

LEA Name	Greater Clark County Schools
Building Name	Northaven Elementary School
HA#	В
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Throughout the bu	uilding
Material Description	
Cove Base Moldin	ng
Comments	
	addressed in the original inspection. Material is in overall good or, there is minor damage in the art room and cafeteria.

Does Material Contain Asbestos? Assumed Is it Friable? No **Original Inspection Date** 05/31/1996 Current Surveillance Date 12/29/1998 **Current Assessment Rating** NR Not Required Cause of Damage No Damage Accessible Yes Potential for Damage Low Removed No **Planned Response Action** 0 & M Inspector Clint Aates Indiana State

Accreditation Number

193804035


LEA Name	Greater Clark County Schools							
Building Name	Northaven	Elementary School						
HA#	С							
Type of Material	Miscellane	eous Material						
Quantity of Material	Unquantifi	ied LF						
Material Location Throughout the b	uilding							
Material Description								
Cove Base Masti	C							
Comments Material is assum	ed to be in	good condition.						
Does Material Contain As	bestos?	Assumed						
Is it Friable?		No						
Original Inspection Date		05/31/1996						
Current Surveillance Date	е	12/29/1998						
Current Assessment Rati	ng	NR Not Required						
Cause of Damage		No Damage						
Accessible		No						
Potential for Damage		Low						
Removed		No						
Planned Response Action	n	O & M						
Inspector		Clip(Yates						
	/	Ciliux Tales						
State	/	Indiana						

Accreditation Number

16

LEA Name	Greater Clark County Schools					
Building Name	Northaven Elementary School					
HA#	D					
Type of Material Quantity of Material Material Location Between two clas	Miscellaneous Material Unquantified SF ssrooms					
Material Description Movable Walls						
Comments Walls may conta	n transite. Material is in good condition.					
Does Material Contain As	bestos? Assumed					
ls it Friable?	No					
Original Inspection Date	05/31/1996					
Current Surveillance Dat	e 12/29/1998					
Current Assessment Rat	ng NR Not Required					
Cause of Damage	No Damage					
Accessible	Yes					
Potential for Damage	High					
Removed	No					
Planned Response Actio	n O&M					
Inspector	Clint Yates					

State Accreditation Number

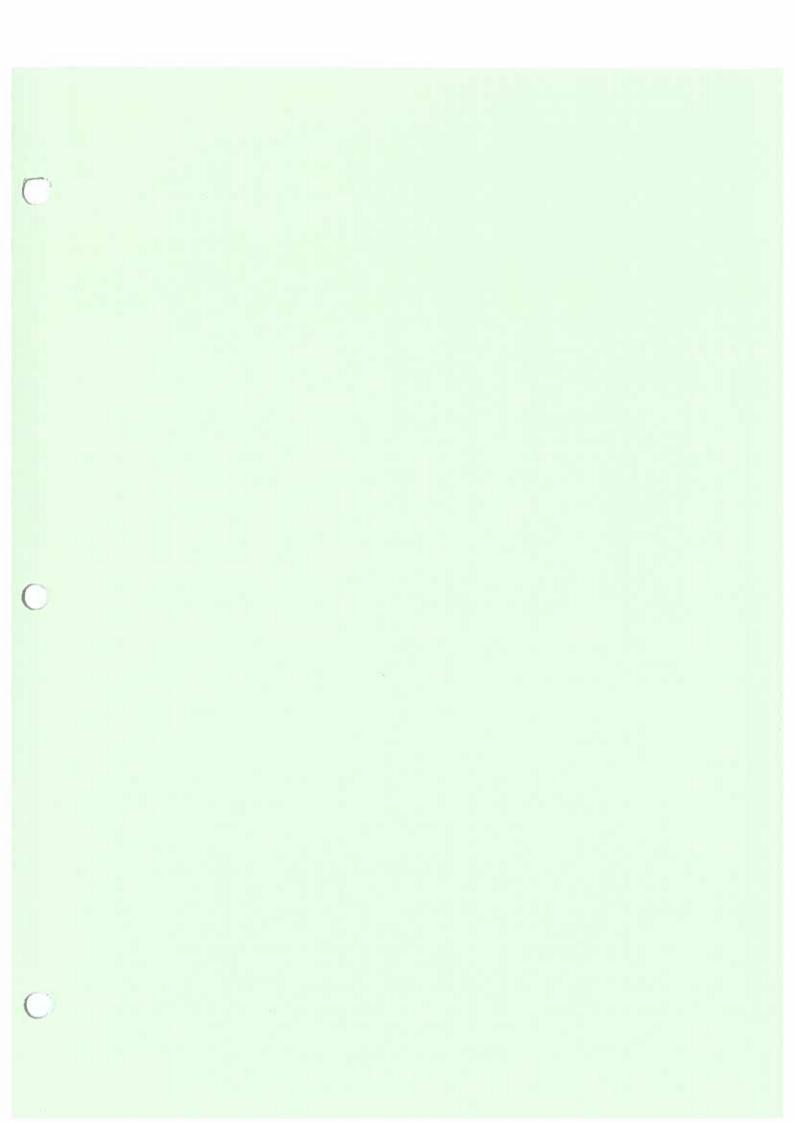

	•				
ŝ	LEA Name	Greater (Clark Co	ounty Schools	
	Building Name	Northave	n Elem	entary School	
	HA#	06			
	Type of Material	Miscellar	neous N	laterial	
	Quantity of Material	15,190	SF		
	Material Location Throughout the b	uilding			
	Material Description Floor Tile Mastic				
	Comments Material is assum	ed to be ir	n good	condition.	
	Does Material Contain As	bestos?	Assu	imed	
	Is it Friable?		No		
	Original Inspection Date		6/ 1/	88	
	Current Surveillance Date	Э	1/14	/98	
	Current Assessment Rati	ng	NR	Not Required	
	Cause of Damage		No E	Damage	
	Accessible		No		
	Potential for Damage		Low		
	Removed		No		
	Planned Response Action	n	0&	М	

Inspector

Karen Foxx

State Accreditation Number

LEA Name	Greater Cl	ark Co	ounty Schools	
Building Name	Northaven	Elem	entary School	
HA#	Α			
Type of Material	Miscellane	ous N	laterial	
Quantity of Material	5	SF		
Material Location At Entryway and p	possibly Ca	feteria	3	
Material Description Transite Panels				
Comments These panels app	pear to be w	vood.		
Does Material Contain As	bestos?	Assu	umed	
Is it Friable?		No		
Original Inspection Date		5/31	/95	
Current Surveillance Date	e	1/14	/98	
Current Assessment Rati	ng	NR	Not Required	
Cause of Damage		No E	Damage	
Accessible		Yes		
Potential for Damage		Low		
Removed		No		
Planned Response Action	n	0&	M	

Inspector

Karen John Karen Foxx

State **Accreditation Number**

LEA Name	Greater Cla	Greater Clark County Schools				
Building Name	Northaven	n Elementary School				
HA#	В					
Type of Material	Miscellaneo	eous Material				
Quantity of Material	L	LF				
Material Location Throughout the	e building	uilding				
Material Description Cove Base Mo	lding	ing				
	ot addressed in the original inspection. Material is in overall gever, there is minor damage in the art room and cafeteria.					
Does Material Contain	Asbestos?	Assumed				
Is it Friable?		No				
Original Inspection Dat	te	5/31/96				
Current Surveillance D	ate	1/14/98				
Current Assessment R	ating	NR Not Required				
Cause of Damage		No Damage				
Accessible		Yes				
Potential for Damage	Low					
Removed		No				
Planned Response Act	tion	O & M				

Inspector

Karen Foxx 0-4

State **Accreditation Number**

2	LEA Name	Greater C	lark C	o	unty	y So	chools	i				
	Building Name	Northaven Elementary School			I							
	HA#	С										
	Type of Material	Miscellan	eous N	Ma	ater	ial						
	Quantity of Material		LF									
	Material Location Throughout the b	uilding										
	Material Description Cove Base Mastic	5										
	Comments Material is assum	ed to be ir	n good	c	onc	litio	n.					
	Does Material Contain As	bestos?	Assi	ur	ned	I						
	Is it Friable?		No									
	Original Inspection Date		5/31	1/9	96							
	Current Surveillance Date	9	1/14	4/9	98							
	Current Assessment Rati	ng	NR		Not	Re	quire	t				
	Cause of Damage		No [Da	ama	age						
	Accessible		No									
	Potential for Damage		Low	/								
	Removed		No									
	Planned Response Action	n	0&	N	٨							
						L	1			1	1	

Inspector

Kapen Jort

Karen Foxx

State Accreditation Number


2	LEA Name	Greater C	lark Co	ounty Schools	
	Building Name	Northave	n Elem	entary School	
	HA#	D			
	Type of Material	Miscellan	eous N	laterial	
	Quantity of Material		SF		
	Material Location Between two clas	srooms			
	Material Description Movable Walls				
	Comments Walls may contain	n transite.	Materi	al is in good condition.	
	Does Material Contain As	bestos?	Assu	umed	
	ls it Friable?		No		
	Original Inspection Date		5/31	/96	
	Current Surveillance Date	e	1/14	/98	
	Current Assessment Rati	ng	NR	Not Required	
	Cause of Damage		No E	Damage	
	Accessible		Yes		
	Potential for Damage		High	l	
	Removed		No		
	Planned Response Action	n	0&	M	
				(-1)	1

Inspector

Kapen Jort

Karen Foxx

State Accreditation Number

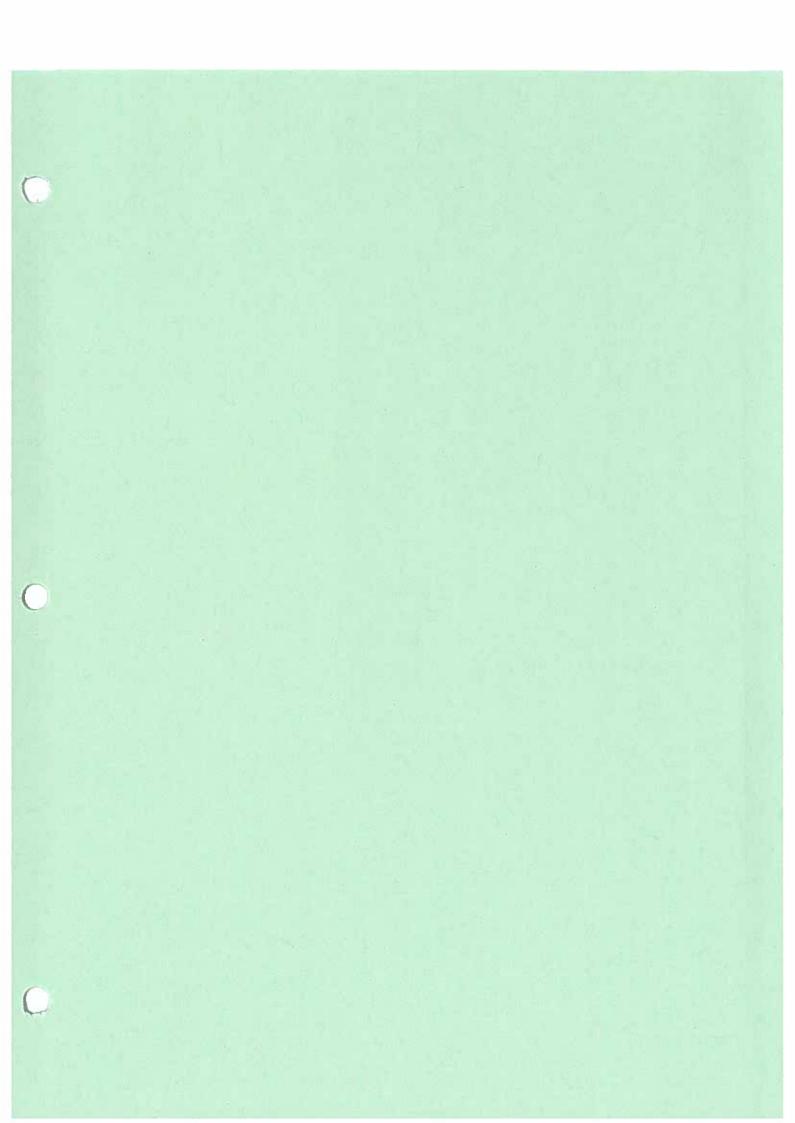

LEA Name	Greater Cl	ark C	County Schools
Building Name	Northaven	Elen	nentary School
HA#	06		
Type of Material	Miscellane	ous N	Material
Quantity of Material	15,190 \$	SF	
Material Location Throughout the b	uilding		
Material Description Floor Tile Mastic			
Comments Material is assum	ed to be in	good	l condition.
Does Material Contain As	bestos?	Ass	umed
Is it Friable?		No	
Original Inspection Date		6/ 1/	/88
Current Surveillance Date	e	7/2	/97
Current Assessment Rati	ng	NR	Not Required
Cause of Damage		No I	Damage
Accessible		No	
Potential for Damage		Low	V
Removed		No	
Planned Response Action	n	0&	M
Inspector			Kacen John Karen Foxx

L

State **Accreditation Number**

LEA Name	Greater Cl	lark County Schools				
Building Name	Northaven	Northaven Elementary School				
HA#	А	A				
Type of Material	Miscellane	eous Material				
Quantity of Material	Ş	SF				
Material Location At Entryway and	and possibly Cafeteria					
Material Description Transite Panels	•					
Comments Good condition. These panels appear to be transite. There are some in the cafeteria that may also be transite.						
Does Material Contain As	sbestos?	Assumed				
ls it Friable?		No				
Original Inspection Date		5/31/95				
Current Surveillance Dat	e	7/ 2/97				
Current Assessment Rat	ing	NR Not Required				
Cause of Damage		No Damage				
Accessible		Yes				
Potential for Damage		Low				
Removed		No				
Planned Response Actio	n	O & M				
		1				

Inspector

Karen Joh Karen Foxx

State Accreditation Number

LEA Name	Greater Clark County Schools					
Building Name	Northaven Elementary School					
HA#	В					
Type of Material	Miscellaneous Material					
Quantity of Material	LF					
Material Location Throughout the b	uilding					
Material Description Cove Base Moldi	ng					
	ot addressed in the original inspection. Material is in overall good ever, there is minor damage in the art room and cafeteria.					
Does Material Contain As	bestos? Assumed					
Is it Friable?	No					
Original Inspection Date	5/31/96					
Current Surveillance Dat	e 7/ 2/97					
Current Assessment Rat	ng NR Not Required					
Cause of Damage	No Damage					
Accessible	Yes					
Potential for Damage	Low					
Removed	No					
Planned Response Actio	n O&M					

Inspector

Karen Foxx

State Accreditation Number

LEA Name	Greater C	lark County Schools
Building Name		Elementary School
HA#	С	
Type of Material	Miscellane	eous Material
Quantity of Material		LF
Material Location Throughout the I	ouilding	
Material Description Cove Base Mast	ic	
Comments Material is assur	ned to be in	good condition.
Does Material Contain A	sbestos?	Assumed
Is it Friable?		No
Original Inspection Date		5/31/96
Current Surveillance Dat	te	7/ 2/97
Current Assessment Rat	ing	NR Not Required
Cause of Damage		No Damage
Accessible		Νο
Potential for Damage		Low
Removed		No
Planned Response Actio	on	O & M

Inspector

Karen Foxx


State Accreditation Number

LEA Name	Greater C	lark County Schools
Building Name	Northaver	Elementary School
HA#	D	
Type of Material	Miscellane	eous Material
Quantity of Material	:	SF
Material Location Between two cla	ssrooms	
Material Description Movable Walls		
Comments Walls may conta	iin transite.	Material is in good condition.
Does Material Contain A	sbestos?	Assumed
Is it Friable?		No
Original Inspection Date		5/31/96
Current Surveillance Da	te	7/ 2/97
Current Assessment Rat	ting	NR Not Required
Cause of Damage		No Damage
Accessible		Yes
Potential for Damage		High
Removed		No
Planned Response Actio	on	O & M
		,

Inspector

Kacin Arty Karen Foxx

State Accreditation Number

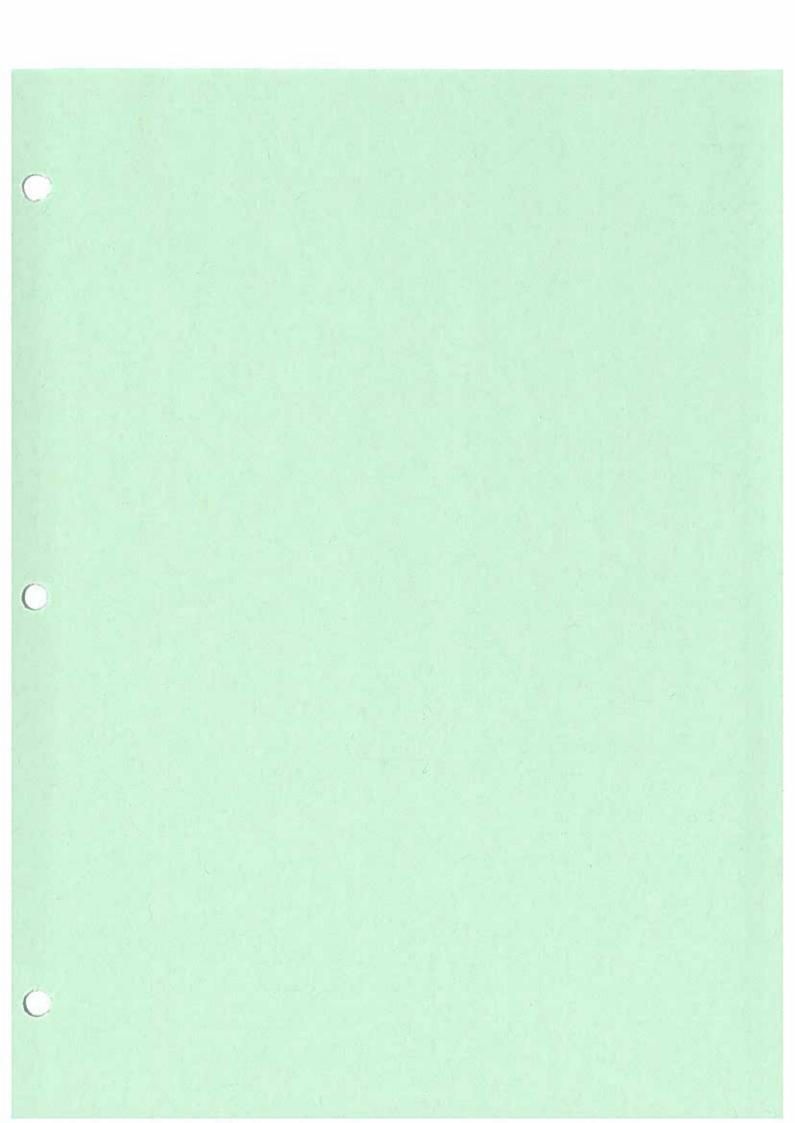

LEA Name	e Greater Clark County Schools		
Building Name	Northaven	Northaven Elementary School	
HA#	06		
Type of Material	Miscellane	ous Material	
Quantity of Material	15,190 S	F	
Material Location Throughout the building			
Material Description Floor Tile Mastic	-		
Comments			
Good condition.	No change.		
Does Material Contain As	sbestos?	Assumed	
ls it Friable?		No	
Original Inspection Date		6/ 1/88	
Current Surveillance Date		12/16/96	
Current Assessment Rating		NR Not Required	

Current Assessment RatingNCause of DamageNAccessibleNPotential for DamageLRemovedNPlanned Response ActionC

6/ 1/88 12/16/96 NR Not Required No Damage No Low No O & M

Inspector

Clint Yates

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	Northaven Elementary School
HA#	A
Type of Material	Miscellaneous Material
Quantity of Material	SF
Material Location At Entryway and p	possibly Cafeteria
Material Description Transite Panels	

Comments

Good condition. These panels appear to be transite. There are some in the cafeteria that may also be transite. Material is assumed.

Does Material Contain Asbestos? Assumed Is it Friable? No **Original Inspection Date** 5/31/95 **Current Surveillance Date** 12/16/96 **Current Assessment Rating** NR Not Required Cause of Damage No Damage Accessible Yes Potential for Damage Low Removed No **Planned Response Action** 0 & M

Clint Yates

State Accreditation Number

Inspector

LEA Name	Greater Clark County Schools	
Building Name	Northaven Elementary School	
HA#	В	
Type of Material	Miscellaneous Material	
Quantity of Material	LF	
Material Location Throughout the building		
Material Description		
Cove Base Moldi	ng	
Comments		

Good condition. Material was not addressed in the original inspection. It is assumed to be asbestos containing. No change.

Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	5/31/96
Current Surveillance Date	12/16/96
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed Planned Response Action	No O & M

Inspector

Clint Yates

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	Northaven Elementary School
HA#	C
Type of Material	Miscellaneous Material
Quantity of Material	LF
Material Location Throughout the t	puilding
Material Description Cove Base Mast	ic
	Material was not addressed in the original inspection. It is assumed ontaining. No change.

Does Material Contain Asbestos? Assumed Is it Friable? No **Original Inspection Date** 5/31/96 **Current Surveillance Date** 12/16/96 **Current Assessment Rating** NR Not Required Cause of Damage No Damage Accessible No Potential for Damage Low Removed No Planned Response Action 0 & M


Inspector

Clint Tates

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	Northaven Elementary School
HA#	D
Type of Material	Miscellaneous Material
Quantity of Material	SF
Material Location Between two cla	ssrooms
Material Description Movable Walls	
Comments	
Walls may conta No change.	in transite. They are to be assumed. Material is in good condition.
Does Material Contain A	sbestos? Assumed
ls it Friable?	No
Original Inspection Date	5/31/96
Current Surveillance Dat	te 12/16/96
Current Assessment Rat	ing NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	High
Removed	No
Planned Response Actio	on O&M
	/ /
Inspector	/_//

State Accreditation Number Indiana 193804035 **Clint Yates**

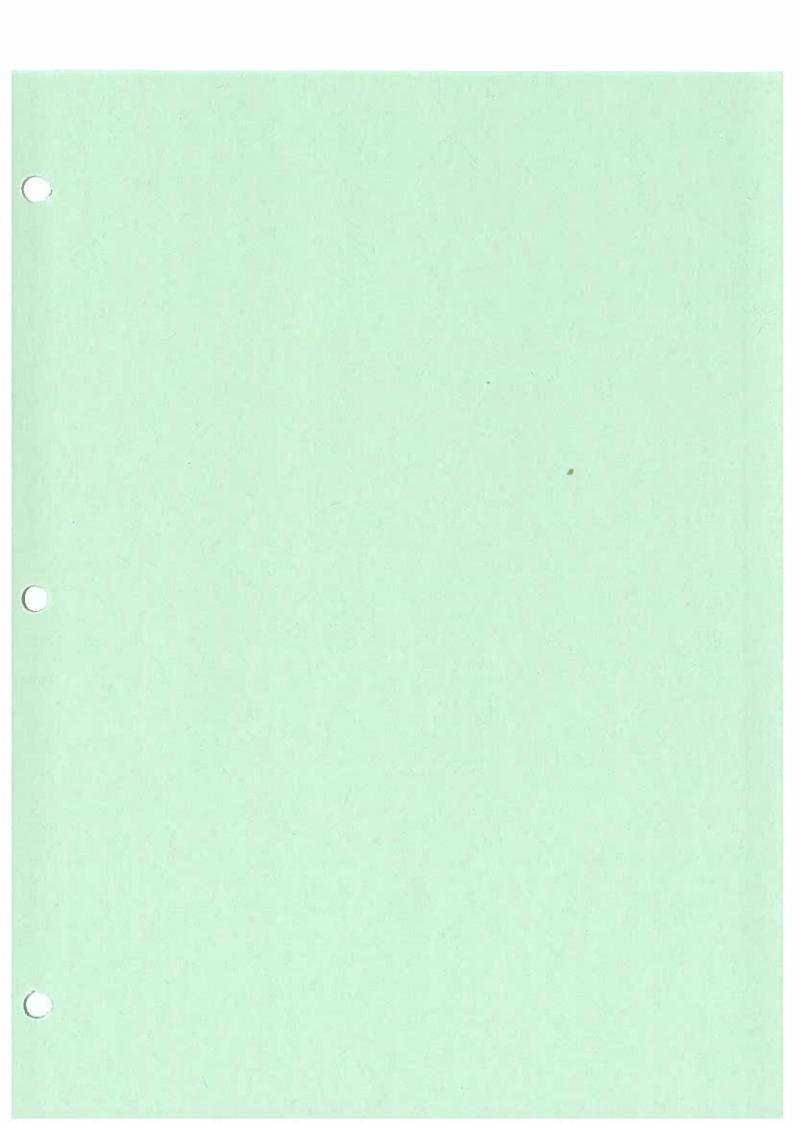

LEA Name	Greater Cl	ark County Schools
Building Name	Northaven	Elementary School
HA#	06	
Type of Material	Miscellane	ous Material
Quantity of Material	15,190 \$	SF
Material Location Throughout the	building	
Material Description Floor Tile Mastic	:	
Comments Good condition.	No change	
Does Material Contain A	sbestos?	Assumed
Is it Friable?		No
Original Inspection Date	1	6/ 1/88
Current Surveillance Da	te	6/24/96
Current Assessment Rat	ting	NR Not Required
Cause of Damage		No Damage
Accessible		No
Potential for Damage		Low
Removed		No
Planned Response Action	on 👘	0 & M

Inspector

f Sada

Rex Gaddis

State Accreditation Number

LEA Name

HA#

Building Name

Greater Clark County Schools Northaven Elementary School

Type of Material Miscellaneous Material

SF

Material Location

Quantity of Material

At Entryway and possibly Cafeteria

Α

Material Description Transite Panels

Comments

Good condition. These panels appear to be transite. There are some in the cafeteria that may also be transite. Material is assumed.

Does Material Contain Asbestos?	Assumed
ls it Friable?	No
Original Inspection Date	5/31/95
Current Surveillance Date	6/24/96
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Tex Saddes

Rex Gaddis

Inspector

State

Accreditation Number

LEA Name	Greater Cla	rk Co	ounty Schools	
Building Name	Northaven E	Eleme	entary School	
HA#	В			
Type of Material	Miscellaneo	us M	aterial	
Quantity of Material	LF	=		
Material Location				
Throughout the	building			
Material Description				
Cove Base Molo	ling			
Comments	12			
			addressed in the original inspection.	It is assumed
to be asbestos o	containing. No	o cha	nge.	
Does Material Contain A	sbestos?	Assı	umed	
Is it Friable?		No		- 4 ()
Original Inspection Date)	5/31	/96	
Current Surveillance Da	te	6/24	/96	
Current Assessment Ra	ting	NR	Not Required	

Does Material Contain Asbestos?	Assumed
Is it Friable?	Νο
Original Inspection Date	5/31/96
Current Surveillance Date	6/24/96
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	0 & M

Tax Daddes

Rex Gaddis

Inspector

State

Accreditation Number

LEA Name	Greater Clark County Schools	
Building Name	Northaven Elementary School	
HA#	С	
Type of Material	Miscellaneous Material	
Quantity of Material	LF	
Material Location Throughout the building		
Material Description Cove Base Masti	c	

Comments

Good condition. Material was not addressed in the original inspection. It is assumed to be asbestos containing. No change.

Does Material Contain Asbestos?	Assumed
ls it Friable?	No
Original Inspection Date	5/31/96
Current Surveillance Date	6/24/96
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Jaddus

Rex Gaddis

Inspector

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	Northaven Elementary School
HA#	D
Type of Material	Miscellaneous Material
Quantity of Material	SF
Material Location Between two cla	assrooms
Material Description Movable Walls	
Comments Walls may conta No change.	ain transite. They are to be assumed. Material is in good condition.

Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	5/31/96
Current Surveillance Date	6/24/96
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	High
Removed	No
Planned Response Action	O & M
•	

By Xaddes

Rex Gaddis

Inspector

State Accreditation Number

LEA NAME:

Greater Clark County Schools

BUILDING NAME: Northaven Elementary School

HA#:

TYPE OF MATERIAL: Miscellaneous Material

06

QUANTITY OF MATERIAL: 15,190SF

MATERIAL LOCATION:

Throughout the Building

MATERIAL DESCRIPTION:

Floor Tile Mastic

COMMENTS:

Good condition.

IS MATERIAL FRIABLE?	NO
ORIGINAL INSPECTION DATE:	06/01/88
CURRENT SURVEILLANCE DATE:	12/06/95
CURRENT ASSESSMENT RATING:	NR Not Required
CAUSE OF DAMAGE:	No Damage
ACCESSIBLE:	NO
POTENTIAL FOR DAMAGE:	Low
REMOVED:	NO
STATE:	Indiana

INSPECTOR NAME: Clinte Yates

LEA NAME:

Greater Clark County Schools

BUILDING NAME: Northaven Elementary School

HA#:

TYPE OF MATERIAL: Miscellaneous Material

B

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout the Building

MATERIAL DESCRIPTION:

Cove Base Molding

COMMENTS:

Good condition. Material was not addressed in the original inspection. It is assumed to be asbestos containing.

IS MATERIAL FRIABLE?	NO
ORIGINAL INSPECTION DATE:	
CURRENT SURVEILLANCE DATE:	12/06/95
CURRENT ASSESSMENT RATING:	NR Not Required
CAUSE OF DAMAGE:	No Damage
ACCESSIBLE:	YES
POTENTIAL FOR DAMAGE:	Low
REMOVED:	NO
STATE:	Indiana

INSPECTOR NAME: Clint Yates

LEA NAME:

Greater Clark County Schools

BUILDING NAME: Northaven Elementary School

HA#:

TYPE OF MATERIAL: Miscellaneous Material

С

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout the Building

MATERIAL DESCRIPTION:

Cove Base Mastic

COMMENTS:

Good condition. Material was not addressed in the original inspection. It is assumed to be asbestos containing.

IS MATERIAL FRIABLE?	NO
ORIGINAL INSPECTION DATE:	
CURRENT SURVEILLANCE DATE:	12/06/95
CURRENT ASSESSMENT RATING:	NR Not Required
CAUSE OF DAMAGE:	No Damage
ACCESSIBLE:	NO
POTENTIAL FOR DAMAGE:	Low
REMOVED:	NO
STATE:	Indiana
	/
INSPECTOR NAME:	
	Clint Yates

LEA NAME:

Greater Clark County Schools

BUILDING NAME: Northaven Elementary School

HA#:

TYPE OF MATERIAL: Miscellaneous Material

D

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Between two Classrooms

MATERIAL DESCRIPTION:


Movable Walls

COMMENTS:

Walls may contain transite. They are to be assumed. Material i in good condition.

IS MATERIAL FRIABLE?	NO
ORIGINAL INSPECTION DATE:	
CURRENT SURVEILLANCE DATE:	12/06/95
CURRENT ASSESSMENT RATING:	NR Not Required
CAUSE OF DAMAGE:	No Damage
ACCESSIBLE:	YES
POTENTIAL FOR DAMAGE:	High
REMOVED:	NO
STATE:	Indiana

INSPECTOR NAME: Clint'Yates

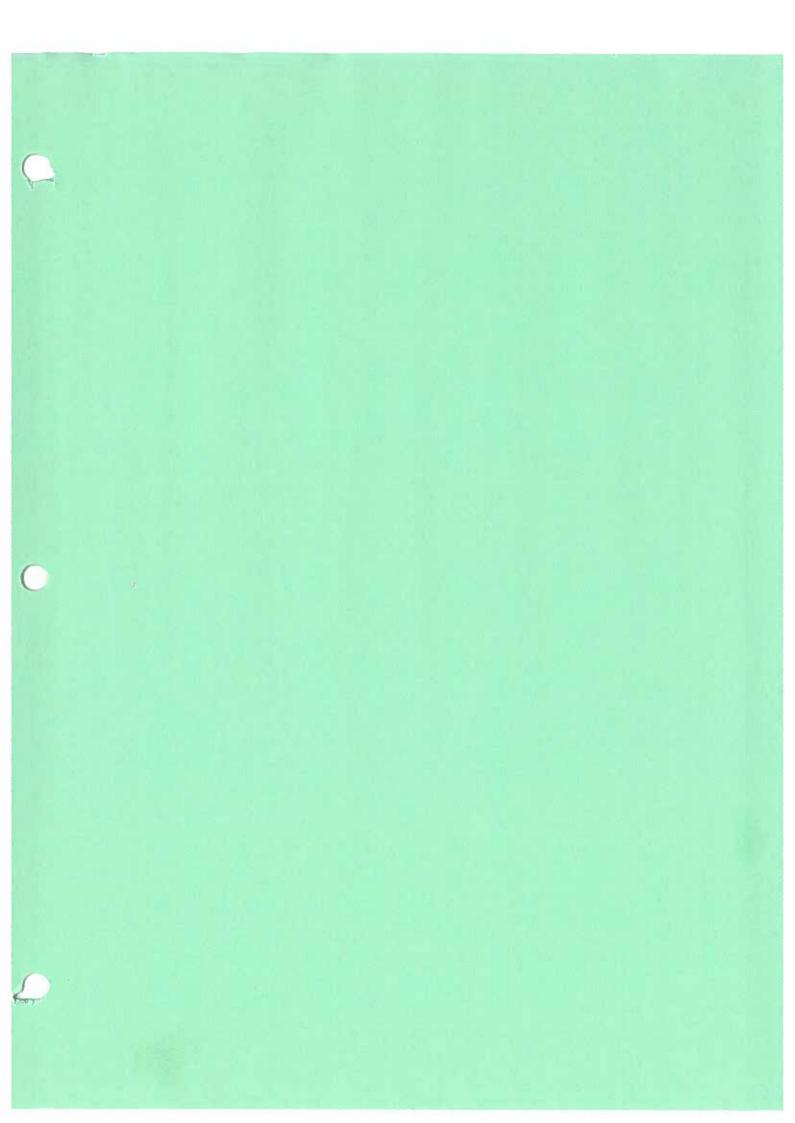

THIRD YEAR REINSPECTIONS

1

REINSPECTION PLAN

GREATER CLARK COUNTY SCHOOLS

Reinspection by an accredited building inspector will be scheduled to be performed not more than three years from the date of the original inspection. The reinspection report will then be made a permanent part of this Management Plan. Reinspections will be performed every three years for as long as the building contains ACBM, and will be reinspected once within three years from the date that all ACBM has been removed.

Records of each reinspection should be maintained in this binder.

DATE PLANNED	DATE COMPLETED	COMPLETED BY
JUNE 2007	July 2007	Bill Ogle
JUNE 2010	June 2010	Sandy Shadley
JUNE 2013	April 2013	Jeff hechtin
JUNE 2016	April 2016	Prizan Her
JUNE 2019	May 2019	562
JUNE 2022		
JUNE 2025		

Reinspection Plan

REINSPECTION PLAN

GREATER CLARK COUNTY SCHOOLS

NORTHAVEN ELEMENTARY SCHOOL

The ACBM in this building shall be reinspected every three years to determine any change in the condition of the materials for as long they remain in the building. This reinspection will be conducted tri-annually by an accredited inspector.

The following table outlines the dates on which these inspections should take place in this school building.

REINSPECTION SCHEDULE

DATE PLANNED

DATE COMPLETED

JUNE 1992

COMPLETED BY

JUNE 1992

JUNE 1995

JUNE 1998

JUNE 2001

JUNE 2004

une '95

ly '04

ASBESTECH

<u>Alliance</u> <u>Alliance</u> <u>I. Wilson</u> <u>C. Spicks</u>

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	06		
HA Description	Floor Tile Mastic		
НА Туре	Miscellaneous Material		
HA Location	Throughout building		
Quantity	15190 SF		
Comments	This material was not exposed to inspect.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/1/1988		
Current Inspection	5/16/2019		

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged %	, 5	Good Condition	
Physical Conta	<u>ict</u>	<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector

Sean Stults

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	В		
HA Description	Cove base molding (brown)		
НА Туре	Miscellaneous Material		
HA Location	Throughout the building (except the gymnasium)		
Quantity	Approx. 1650 LF		
Comments	This material was not in poor condition overall.		
Asbestos	Assumed		
Friable	No		
Original Inspection	5/31/1996		
Current Inspection	5/16/2019		

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Co	ontact	<u>Vibration</u>	Air
Low/No	ne	Low/None	Low/None

Planned Response Action O&M

Inspector

Sean Stults

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	C		
HA Description	Cove Base Mastic		
НА Туре	Miscellaneous Material		
HA Location	Throughout building		
Quantity	Approx. 1200 SF		
Comments	Where exposed in the stage storage room and boys dressing room, this material was not in poor condition.		
Asbestos	Assumed		
Friable	No		
Original Inspection	5/31/1996		
Current Inspection	5/16/2019		

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged

Inspector

Good Condition

Physical Contact Low/None

Vibration Low/None <u>Air</u> Low/None

Planned Response Action O&M

%

Sean Stults

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	E		
HA Description	Fire Rated Doors		
НА Туре	Miscellaneous Material		
HA Location	Throughout the building except Rooms 113, 116 and 120.		
Quantity	Unquantified Unit(s)		
Comments	These doors were noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/27/2011		
Current Inspection	5/16/2019		

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Go
-----------------	---	----

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action O&M

Inspector

Sean Stults

LEA Name	Greater Clark County School Corporation			
Building Name	Northhaven Elementary Schoo	Northhaven Elementary School		
Building Number	04			
HA ID	F			
HA Description	Sink Insulation			
НА Туре	Miscellaneous Material			
HA Location	Classrooms			
Quantity	Unquantified	SF		
Comments	This material was noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled.			
Asbestos	Assumed			
Friable	No			
Original Inspection	6/27/2011			
Current Inspection	5/16/2019			

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	G
-----------------	---	---

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Sean Stults

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	06		
HA Description	Floor Tile Mastic		
НА Туре	Miscellaneous Material		
HA Location	Throughout building		
Quantity	15190	SF	
Comments	This material was not exposed to inspect.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/1/1988		
Current Inspection	4/27/2016		

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical Co	<u>ontact</u>	Vibration	<u>Air</u>
Low/No	one	Low/None	Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	В		
HA Description	Cove base molding (brown)		
НА Туре	Miscellaneous Material		
HA Location	Throughout the building (except the gymnasium)		
Quantity	Approx. 1650 LF		
Comments	This material was not in poor condition overall.		
Asbestos	Assumed		
Friable	No		
Original Inspection	5/31/1996		
Current Inspection	4/27/2016		

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%	Good Condition	
Physical C	<u>ontact</u>	<u>Vibration</u>	<u>Air</u>
Low/No	one	Low/None	Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation	
Building Name	Northhaven Elementary School	
Building Number	04	
HA ID	C	
HA Description	Cove Base Mastic	
НА Туре	Miscellaneous Material	
HA Location	Throughout building	
Quantity	Approx. 1200 SF	
Comments	Where exposed in the stage storage room and boys dressing room, this material	
	was not in poor condition.	
Asbestos	Assumed	
Friable	No	
Original Inspection	5/31/1996	
Current Inspection	4/27/2016	

Material Assessment

Assessment Rating

5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged

Good Condition

Physical Contact Low/None

<u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

%

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Corporation		
Building Name	Northhaven Elementary School		
Building Number	04		
HA ID	E		
HA Description	Fire Rated Doors		
НА Туре	Miscellaneous Material		
HA Location	Throughout the building except Rooms 113, 116 and 120.		
Quantity	Unquantified Unit(s)		
Comments	These doors were noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled.		
Asbestos	Assumed		
Friable	No		
Original Inspection	6/27/2011		
Current Inspection	4/27/2016		

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%
-----------------	---

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Clark County School Cor	poration
Building Name	Northhaven Elementary School	
Building Number	04	
HA ID	F	
HA Description	Sink Insulation	
НА Туре	Miscellaneous Material	
HA Location	Classrooms	
Quantity	Unquantified SI	F
Comments	This material was noted during t management plan until properly	he 6/27/2011 inspection and will remain in the sampled.
Asbestos	Assumed	
Friable	No	
Original Inspection	6/27/2011	
Current Inspection	4/27/2016	
	.	

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged	%
-----------------	---

Good Condition

Physical Contact Low/None <u>Vibration</u> Low/None <u>Air</u> Low/None

Planned Response Action 0&M

Inspector

Benjamin S. Hood

LEA Name	Greater Cl	lark County S	Schools	
Building Name	Northaven	Elementary	/ School	
HA#	06			
Type of Material	Miscellane	ous Materia	al de la companya de	
Quantity of Material	15,190 SF			
Material Location				
Throughout the b	uilding			
Material Description				
Floor tile mastic				
Comments				
This material was	not expose	ed to inspect.	•	
Does Material Contain Asbe	stos?	Assumed		
Is it Friable?		No		
Original Inspection Date		6/1/1988		
Current Reinspection Date		4/24/2013		
Current Assessment Rating		NR	Not Rated	
Cause of Damage		No Damage	e	
Accessible		No		
Potential for Damage		Low		
Removed		No		
Planned Response Action		O & M	*1	
			CAAD	

Inspector

770--

Jeffrey P. Rechtin

State **Accreditation Number**

LEA Name	Greater Cla	ark County Scho	ols
Building Name	Northaven	Elementary Sch	ool
HA#	В		
Type of Material	Miscellane	ous Material	
Quantity of Material	Approx. 1,6	350 LF	
Material Location			
Throughout the b	uilding (exce	ept the gymnasiu	m)
Material Description			
Cove base moldir	ng (brown)		
Comments			
This material was	not in poor	condition overall.	
Does Material Contain Asbe	stos?	Assumed	
Is it Friable?		No	
Original Inspection Date		5/31/1996	
Current Reinspection Date		4/24/2013	
Current Assessment Rating		NR	Not Rated
Cause of Damage		No Damage	
Accessible		Yes	
Potential for Damage		Low	
Removed	[No	
Planned Response Action	(0 & M	The Trees
		C-	AM)

Inspector

1 (,

Jeffrey P. Rechtin

State **Accreditation Number**

LEA Name	Greater Clark County Schools
Building Name	Northaven Elementary School
HA#	с
Type of Material	Miscellaneous Material
Quantity of Material	Approx. 1,200 SF
Material Location	
Throughout the bu	uilding
Material Description	
Cove base mastic	:
Comments	
10/1	

Where exposed in the stage storage room and boys dressing room, this material was not in poor condition.

Does Material Contain Asbestos?	Assumed	
ls it Friable?	No	
Original Inspection Date	5/31/1996	
Current Reinspection Date	4/24/2013	
Current Assessment Rating	NR	Not Rated
Cause of Damage	No Damage	
Accessible	No	
Potential for Damage	Low	
Removed	No	
Planned Response Action	0 & M	

Inspector

Jeffrey P. Rechtin

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	Northaven Elementary School
HA#	E
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified Each
Material Location	
Throughout the b	uilding except Rooms 113, 116 and 120.
Material Description	

Fire Rated Doors

Comments

These doors were noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled.

Does Material Contain Asbestos?	Assumed
ls it Friable?	No
Original Inspection Date	6/27/2011
Current Reinspection Date	4/24/2013
Current Assessment Rating	NA Not Applicable
Cause of Damage	
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
Inspector	CAB D
manegroi	

Inspector

Jeffrey P. Rechtin

State **Accreditation Number**

LEA Name	Greater Clark County Schools
Building Name	Northaven Elementary School
HA#	F
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	
Classrooms	đ
Material Description	
Sink Insulation	
Comments	

This material was noted during the 6/27/2011 inspection and will remain in the management plan until properly sampled.

Does Material Contain Asbestos?	Assumed	
is it Friable?	No	
Original Inspection Date	6/27/2011	
Current Reinspection Date	4/24/2013	
Current Assessment Rating	NA Not Applicable	
Cause of Damage		
Accessible	Yes	
Potential for Damage	Low	
Removed	No	
Planned Response Action	0 & M	
Inspector	APO D	-

Inspector

Jeffrey P. Rechtin

State **Accreditation Number**

LEA Name	Greater Cl	ark County Schoo	ols	
Building Name	Northaven	Elementary Scho	ol	
HA#	06			
Type of Material	Miscellane	ous Material		
Quantity of Material	15,190 SF			
Material Location				
Throughout the bu	ilding			
Material Description				
Floor tile mastic				
Comments				
This material was	This material was not exposed to inspect.			
Does Material Contain Asbes	stos?	Assumed		
Is it Friable?		No		
Original Inspection Date		6/1/1988		
Current Reinspection Date		6/30/2010		
Current Assessment Rating		NR	Not Required	
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage		Low		
Removed		No		
Planned Response Action		O & M		
Inspector	\subset	Sende	<u>A Sha alle</u> Sandra Shadley	<u>'</u>

State Accreditation Number

C

19A002323

IN

-3	LEA Name	Greater Cl	ark County	/ Schools	
	Building Name	Northaven	Elementar	ry School	
	HA#	B			
	Type of Material	Miscellane	ous Materi	al	
	Quantity of Material	Approx. 1,	650 LF		
	Material Location				
	Throughout the bi	uilding (exce	ept the gym	nnasium)	
	Material Description				
	Cove base moldin	g (brown)			
	Comments				
This material was not in poor condition overall.					
	Does Material Contain Asbe	stos?	Assumed		
	ls it Friable?		No		
	Original Inspection Date		5/31/1996	i	
	Current Reinspection Date		6/30/2010)	
	Current Assessment Rating	34	NR	Not Required	
	Cause of Damage		No Damag	ge	
	Accessible		Yes		
Ż	Potential for Damage		Low		
	Removed		No		
	Planned Response Action		O & M		
			_ 1	dia SR.	ΛΛ
	for an an address				

Inspector

ØK and Sandra Shadley 8

i

State Accreditation Number IN 19A002323

1	LEA Name	Greater C	lark County Scho	pols
	Building Name	Northaver	n Elementary Sch	ool
	HA#	С		
	Type of Material	Miscellaneous Material		
	Quantity of Material	Approx. 1,200 SF		
	Material Location Throughout the b	uilding		ж.
	Material Description			
	Cove base mastic	;		
	Comments			
	Where exposed in not in poor conditi	n the stage ion.	storage room an	d boys dressing room, this material was
	Does Material Contain Asbestos?		Assumed	
	Is it Friable?		No	
	Original Inspection Date		5/31/1996	
	Current Reinspection Date		6/30/2010	
	Current Assessment Rating		NR	Not Required
~	Cause of Damage		No Damage	
	Accessible		No	
	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		O & M	
31	Inspector	<	Sand	Sandra Shadley

State Accreditation Number

C

IN 19A002323

-	LEA Name	Greater Cl	ark County School	s
	Building Name	Northaven	Elementary School	l
	HA#	06		
	Type of Material	Miscellane	ous Material	
	Quantity of Material	15,190 SF		
	Material Location Throughout the bu Material Description Floor tile mastic	uilding		
	Comments			
This material was not expose			d to inspect.	
	Does Material Contain Asbe	stos?	Assumed	
	Is it Friable?		No	
	Original Inspection Date		6/1/1988	
	Current Reinspection Date		7/9/2007	
	Current Assessment Rating		NR	Not Required
	Cause of Damage		No Damage	
2	Accessible		No	
2	Potential for Damage		Low	
	Removed		Νο	
	Planned Response Action		O & M	
				DUNDA

Inspector

George William Ogle

State Accreditation Number

-	LEA Name	Greater Cl	ark County Schoo	ls
	Building Name	Northaven	Elementary Scho	ol
	HA#	В		
	Type of Material	Miscellane	ous Material	
	Quantity of Material	Approx. 1,	650 LF	
	Material Location Throughout the bu Material Description	uilding (exc	ept the gymnasiur	n)
	Cove base moldir Comments	ig (brown)		
This material was not in poor condition			condition overall.	
	Does Material Contain Asbe	stos?	Assumed	
	Is it Friable?		No	
	Original Inspection Date		5/31/1996	
	Current Reinspection Date		7/9/2007	
	Current Assessment Rating		NR	Not Required
	Cause of Damage		No Damage	
	Accessible		Yes	
2	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		O & M	
				B MAL

Inspector

State Accreditation Number

LEA Name	Greater Clark County Schools			
Building Name	Northaven Elementary School			
HA#	С			
Type of Material	Miscellaneous Material			
Quantity of Material	Approx. 1,200 SF			
Material Location Throughout the building				
Material Description				
Cove base mastic	;			
Comments				
Millions averaged in	, the stage storage room, hove dr			


Where exposed in the stage storage room, boys dressing room and across from the main office (to the south). This material was not in poor condition.

	Does Material Contain Asbestos?	Assumed	
	is it Friable?	Νο	
	Original Inspection Date	5/31/1996	
	Current Reinspection Date	7/9/2007	
	Current Assessment Rating	NR	Not Required
-	Cause of Damage	No Damage	
,	Accessible	No	
	Potential for Damage	Low	
	Removed	No	
	Planned Response Action	O & M	

Inspector

ge William Ogle Ģ

State Accreditation Number

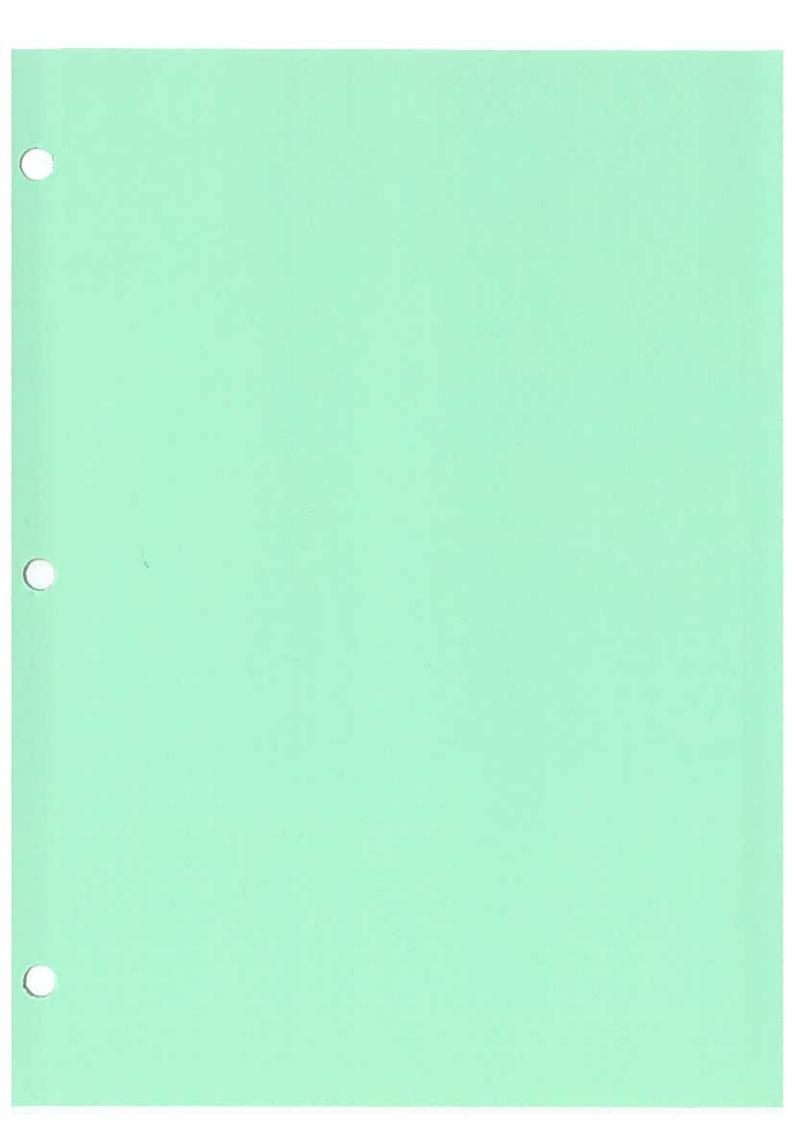

LEA Name	Greater Cl	ark County Scho	ols
Building Name	Northaven	Elementary Scho	lool
HA#	06		
Type of Material	Miscellane	eous Material	
Quantity of Material	15,190 SI	F	
Material Location Throughout the b	ouilding		
Material Description Floor tile mastic			
Comments This material wa	s not expos	sed to inspect.	
Does Material Contain As	bestos?	Assumed	
Is it Friable?		No	
Original Inspection Date		6/1/1988	
Current Reinspection Date	Ð	7/2/2004	
Current Assessment Ratin	ng	NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	/
Planned Response Action		0 & M	NA
Inspector			W/h

Christiaan Sparks

State	
Accreditation	Number

<u></u>	LEA Name	Greater C	ark County Sch	nools			
	Building Name	Northaven Elementary School					
	HA#	В					
	Type of Material	Miscellaneous Material					
	Quantity of Material	Approx. 3,600 LF					
	Material Location Throughout the t	ouilding					
	Material Description Cove base moldi	Material Description Cove base molding					
	on the corner of	the cabinet ces missing	t in the art room g. The material	erall. However, there is one small piece missing n, and at the main entrance. The cafeteria has I in the gymnasium was removed non-friable and			
	Does Material Contain As	bestos?	Assumed				
	Is it Friable?		No				
	Original Inspection Date		5/31/1996				
	Current Reinspection Date	3	7/2/2004				
\frown	Current Assessment Ratin	ng	NR	Not Required			
	Cause of Damage		No Damage				
\smile	Accessible		Yes				
	Potential for Damage		Low				
	Removed		No	<u></u>			
	Planned Response Action		0 & M	Arta a			
	Inspector			Christiaan Sparks			

State	
Accreditation	Number


(

LEA Name	Greater Clark County Schools			
Building Name	Northaven Elementary School			
HA#	С			
Type of Material	Miscellane	ous Material		
Quantity of Material	Approx. 1,	200 SF		
Material Location Throughout the	building			
Material Description Cove base mast	ic			
Comments Where exposed (main entrance, art room, cafeteria), this material was not in poor condition.				
Does Material Contain A	sbestos?	Assumed		
Is it Friable?		No		
Original Inspection Date		5/31/1996		
Current Reinspection Da	te	7/2/2004		
Current Assessment Rat	ing	NR	Not Required	
Cause of Damage		No Damage		
Accessible		No		
Potential for Damage		Low		
Removed		No	1	
Planned Response Action	ו	0 & M	Aleha	
Inspector			Christiaan Sparks	

State	
Accreditation	Number

 \bigcirc

(

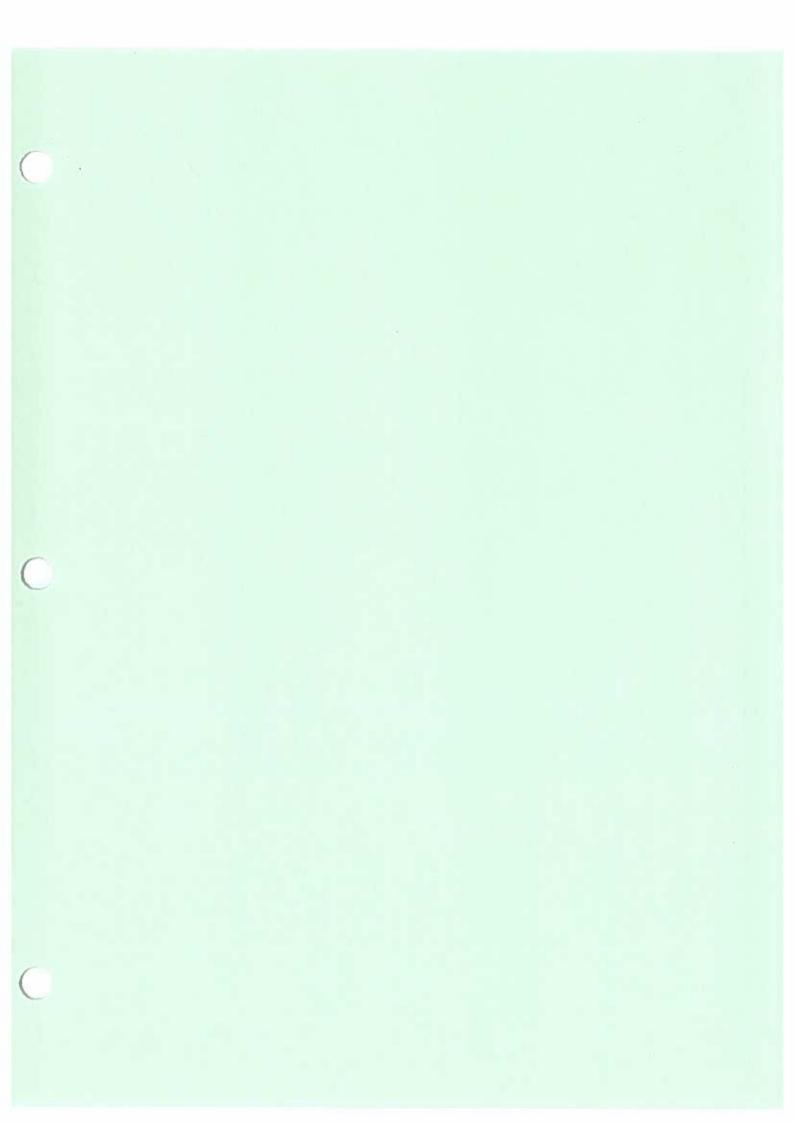

LEA Name	Greater C	Clark County S	chools
Building Name	Northave	n Elementary	School
HA#	06		
Type of Material	Miscellan	neous Material	
Quantity of Material	15,190 5	SF	
Material Location Throughout the	building		
Material Description Floor tile mastic			
Comments No mastic was e	exposed to	inspect.	
Does Material Contain As	bestos?	Assumed	
Is it Friable?		No	
Original Inspection Date		06/01/1988	
Current Reinspection Date	e	07/10/2001	
Current Assessment Ratio	ng	NR	Not Required
Cause of Damage		No Damage	
Accessible		No	
Potential for Damage		Low	
Removed		No	
Planned Response Action		0 & M	

Inspector

Patrick Wilson 1000 Patrick E. Wilson

State **Accreditation Number**

	LEA Name	Greater Cl	ark County Sch	ools
	Building Name	Northaven	Elementary Scl	וססר
	HA#	В		
	Type of Material	Miscellane	eous Material	
	Quantity of Material	Approx. 3	,600 LF	
	Material Location Throughout the b	ouilding		
	Material Description Cove base moldin	ng		
		nd at the n	nain entrance.	er, there is one small piece missing in the art Fhe material in the gymnasium was removed e molding.
	Does Material Contain Asl	bestos?	Assumed	
	Is it Friable?		No	
	Original Inspection Date		05/31/1996	
	Current Reinspection Date	2	07/10/2001	
	Current Assessment Ratin	g	NR	Not Required
	Cause of Damage		No Damage	
	Accessible		Yes	
7	Potential for Damage		Low	
	Removed		No	
	Planned Response Action		0 & M	
				truck 11/1 and

Patrick E. Wilson

Inspector


State **Accreditation Number**

LEA Name	Greater Clark County	Schools
Building Name	Northaven Elementary	School
HA#	С	
Type of Material	Miscellaneous Materia	l l
Quantity of Material	Approx. 1,200 SF	
Material Location Throughout the b	uilding	
Material Description Cove base mastic	•	
Comments Where exposed (main entrance, art roor	n, cafeteria) material is in good condition.
Does Material Contain Asl	bestos? Assumed	
Is it Friable?	No	
Original Inspection Date	05/31/199	6
Current Reinspection Date	07/10/200	1
Current Assessment Ratin	g NR	Not Required
Cause of Damage	No Damage	9
Accessible	No	
Potential for Damage	Low	
Removed	No	
Planned Response Action	0 & M	
	(Detrick Ist Anno

Inspector

Patrick Wilson KW Patrick E. Wilson

State **Accreditation Number**

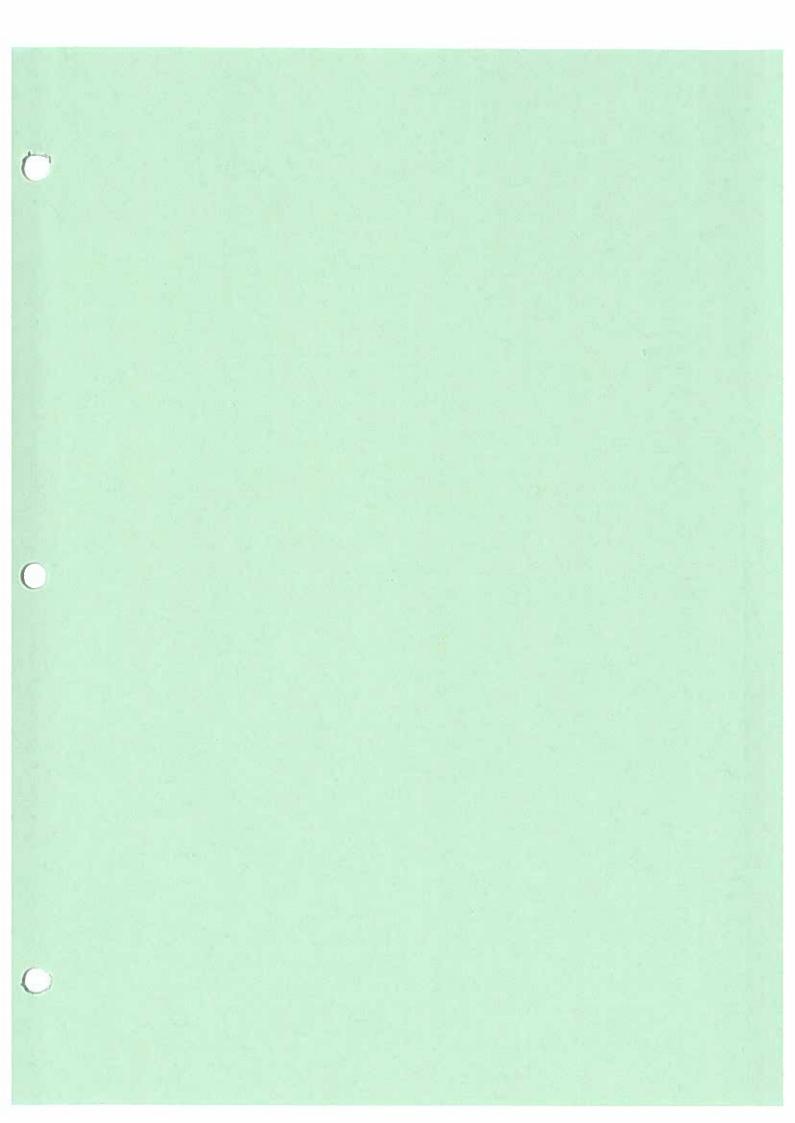

LEA Name	Greater (Clark County Schools
Building Name		en Elementary School
HA#	06	
Type of Material	Miscellan	neous Material
Quantity of Material	15,190	SF
Material Location Throughout the	building	
Material Description Floor Tile Mastic	:	
Comments Material is assur	ned to be ir	in good condition.
Does Material Contain A	sbestos?	Assumed
Is it Friable?		No
Original Inspection Date		6/ 1/88
Current Reinspection Date	ate	6/ 1/98
Current Assessment Ra	ting	NR Not Required
Cause of Damage		No Damage
Accessible		No
Potential for Damage		Low
Removed		No
Planned Response Actio	on	O & M
		2

Inspector

Clint Yates

State Accreditation Number

LEA Name	Greater C	lark County Schools
Building Name		n Elementary School
HA#	A	
Type of Material	Miscellane	eous Material
Quantity of Material	:	SF
Material Location At Entryway and	possibly Ca	afeteria
Material Description Transite Panels		
Comments These panels ap	pear to be v	wood.
Does Material Contain As	sbestos?	Assumed
ls it Friable?		No
Original Inspection Date		5/31/95
Current Reinspection Da	te	6/ 1/98
Current Assessment Rat	ing	NR Not Required
Cause of Damage		No Damage
Accessible		Yes
Potential for Damage		Low
Removed		No
Planned Response Actio	n	O & M

Inspector

0

Clint Yates

State Accreditation Number

LEA Name	Greater C	Clark County Schools
Building Name	Northaver	n Elementary School
HA#	В	
Type of Material	Miscellan	eous Material
Quantity of Material		LF
Material Location Throughout the I	building	
Material Description Cove Base Mold	ing	
Comments Material was not condition, howey	addressed er, there is	in the original inspection. Material is in overall good minor damage in the art room and cafeteria.
Does Material Contain A		Assumed
Is it Friable?		No
Original Inspection Date		5/31/96
Current Reinspection Da	ite	6/ 1/98
Current Assessment Rat	ing	NR Not Required
Cause of Damage		No Damage
Accessible		Yes
Potential for Damage		Low
Removed		No
Planned Response Actic	n	O & M

Inspector

Clint Yates

State Accreditation Number

LEA Name	Greater Clark County Schools
Building Name	Northaven Elementary School
HA#	С
Type of Material	Miscellaneous Material
Quantity of Material	LF
Material Location Throughout the b	uilding
Material Description Cove Base Mastic	
Comments Material is assum	ed to be in good condition.
Does Material Contain As	bestos? Assumed
Is it Friable?	No
Original Inspection Date	5/31/96
Current Reinspection Dat	e 6/ 1/98
Current Assessment Rati	ng NR Not Required
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Actior	O & M

Inspector

Clint Yates

State Accreditation Number


LEA Name	Greater Clark County Schools	
Building Name	Northaven Elementary School	
HA#	D	
Type of Material	Miscellaneous Material	
Quantity of Material	SF	
Material Location Between two cla	ssrooms	
Material Description Movable Walls		
Comments Walls may conta	in transite. Material is in good condition.	
Does Material Contain A	sbestos? Assumed	
Is it Friable?	No	
Original Inspection Date	5/31/96	
Current Reinspection Da	ite 6/ 1/98	
Current Assessment Rat	ing NR Not Required	
Cause of Damage	No Damage	
Accessible	Yes	
Potential for Damage	High	
Removed	No	
Planned Response Actic	n O&M	

Inspector

C

Clint Yates _

State Accreditation Number

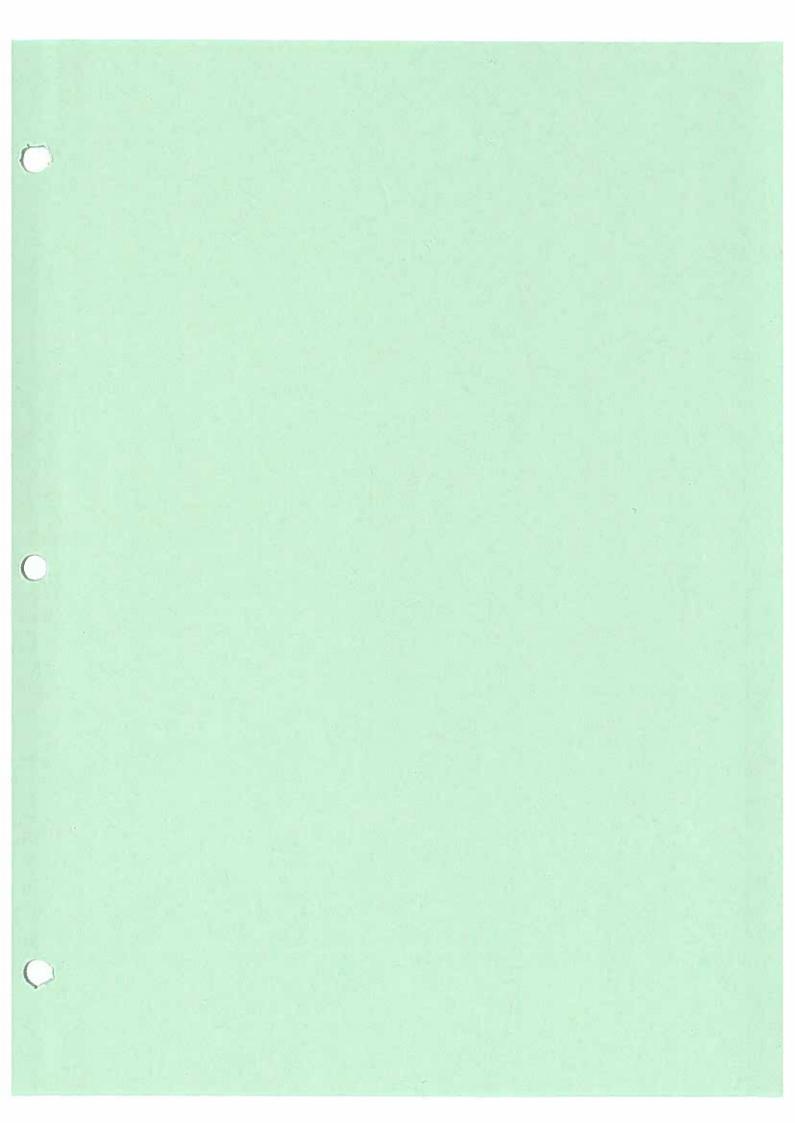

LEA NAME: Greater Clark County School Corp.

BUILDING NAME: Northaven Elementary School

HA#: 06

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL: 15,190SF

MATERIAL LOCATION:

Throughout the Building

MATERIAL DESCRIPTION:

Floor Tile Mastic

COMMENTS:

Good condition.

IS MATERIAL FRIABLE?	NO
ORIGINAL INSPECTION DATE:	06/01/88
CURRENT REINSPECTION DATE:	06/26/95
CURRENT ASSESSMENT RATING:	NR Not Required
CAUSE OF DAMAGE:	No Damage
ACCESSIBLE:	NO
POTENTIAL FOR DAMAGE:	Low
REMOVED:	NO
CURRENT VIDEO TAPE: (TAPE NO/FOOTAGE)	

INSPECTOR NAME:

STATE:

ACCREDITATION NO.:

Rex Gaddis

LEA NAME: Greater Clark County School Corp.

BUILDING NAME: Northaven Elementary School

HA#:

TYPE OF MATERIAL: Miscellaneous Material

Α

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

At Entryway and possibly Cafeteria

MATERIAL DESCRIPTION:

Transite Panels

COMMENTS:

Good condition. These panels appear to be transite. There are some in the cafeteria that may also be transite. Material is assumed.

IS MATERIAL FRIABLE? NO ORIGINAL INSPECTION DATE: CURRENT REINSPECTION DATE: 06/26/95 CURRENT ASSESSMENT RATING: NR Not Required CAUSE OF DAMAGE: No Damage ACCESSIBLE: NO POTENTIAL FOR DAMAGE: Low **REMOVED:** NO CURRENT VIDEO TAPE: / (TAPE NO/FOOTAGE) INSPECTOR NAME: Rex Gaddis STATE: Indiana ACCREDITATION NO .: 190908032

LEA NAME: Greater Clark County School Corp.

BUILDING NAME: Northaven Elementary School

HA#:

TYPE OF MATERIAL: Miscellaneous Material

В

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout the Building

MATERIAL DESCRIPTION:

Cove Base Molding

COMMENTS:

Good condition. Material was not addressed in the original inspection. It is assumed to be asbestos containing.

IS MATERIAL FRIABLE?	NO
ORIGINAL INSPECTION DATE:	
CURRENT REINSPECTION DATE:	06/26/95
CURRENT ASSESSMENT RATING:	NR Not Required
CAUSE OF DAMAGE:	No Damage
ACCESSIBLE:	NO
POTENTIAL FOR DAMAGE:	Low
REMOVED:	NO
CURRENT VIDEO TAPE: (TAPE NO/FOOTAGE) INSPECTOR NAME:	1 Red Madela
INSPECIOR NAME:	Rex Gaddis
STATE:	Indiana
ACCREDITATION NO .:	190908032

LEA NAME: Greater Clark County School Corp.

BUILDING NAME: Northaven Elementary School

C

HA#:

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout the Building

MATERIAL DESCRIPTION:

Cove Base Mastic

COMMENTS:

Good condition. Material was not addressed in the original inspection. It is assumed to be asbestos containing.

IS MATERIAL FRIABLE? NO ORIGINAL INSPECTION DATE: CURRENT REINSPECTION DATE: 06/26/95 CURRENT ASSESSMENT RATING: NR Not Required CAUSE OF DAMAGE: No Damage ACCESSIBLE: NO POTENTIAL FOR DAMAGE: Low **REMOVED:** NO CURRENT VIDEO TAPE: (TAPE NO/FOOTAGE) INSPECTOR NAME: STATE: Indiana 190908032

ACCREDITATION NO .:

Greater Clark County School Corp.

Northaven Elementary School

LEA NAME:

BUILDING NAME:

HA#:

TYPE OF MATERIAL: Miscellaneous Material

D

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Between two Classrooms

MATERIAL DESCRIPTION:

Movable Walls

COMMENTS:

Walls may contain transite. They are to be assumed. Material is in good condition.

IS MATERIAL FRIABLE? NO ORIGINAL INSPECTION DATE: CURRENT REINSPECTION DATE: 06/26/95 CURRENT ASSESSMENT RATING: NR Not Required CAUSE OF DAMAGE: No Damage ACCESSIBLE: NO POTENTIAL FOR DAMAGE: High **REMOVED:** NO CURRENT VIDEO TAPE: / (TAPE NO/FOOTAGE)

INSPECTOR NAME:

STATE:

Box Standalos

/ Rex Gaddi

Indiana

ACCREDITATION NO .:

190908032

ADDITIONAL BULK SAMPLES

.

Greater Clark County Schools

AHERA Program

Alliance Indiana, Inc.

ANNUAL NOTIFICATIONS ACCREDITATIONS TRAINING INFORMATION

(

NOTICES

NOTIFICATION LOG

GREATER CLARK COUNTY SCHOOLS

DATE OF NOTIFICATION COPY IN BOOK


1

YEAR	(X)
2000	
2009	·. · · · · · · · · · · · · · · · · · ·
2010	
2011	
2012	
2013	
2014	
2015	
2016	
2017	
2018	
2019	······································
2020	
2021	
2022	
2023	
2024	
2025	
2026	
2027	
2028	
2029	
2030	
40JV	

NOTIFICATION LOG

LEA Name - Greater Clark County Schools

Date of Notification

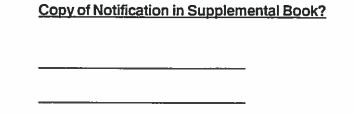

Greater Clark County Schools

Notification Log

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services at River Valley Middle School, which is located at 2220 Veteran's Parkway, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, Service Center, Corden Porter Storage, Auto Tech Program-Witten Property, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2015/2016 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- * The required triennial re-inspection will be performed in April 2016.
- * The required six month periodic surveillance was performed in October 2014.
- * The required six month periodic surveillance activities are scheduled for April and October each year.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2220 Veteran's Parkway, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, Corden Porter Storage, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2014/2015 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- * The required triennial re-inspection will be performed in April 2013.
- * The required six month periodic surveillance was performed in October 2013.
- * The required six month periodic surveillance activities are scheduled for April and October each year.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

March 2013

AHERA ANNUAL NOTICE GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this iocal education agency are available in the Auxiliary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, Corden Porter Storage, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2013/2014 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- * The required triennial re-inspection will be performed in April 2013.
- * The required six month periodic surveillance was performed in October 2012.
- * The required six month periodic surveillance activities are scheduled for April and October each year.
- * Projects completed in 2012: Parkview Middle School.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

March 2012

AHERA ANNUAL NOTICE GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- 3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2012/2013 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- * The required triennial re-inspection will be performed in June 2013.
- * The required six month periodic surveillance was performed in December 2011.
- * The required six month periodic surveillance activities are scheduled for June and December each year.
- * Projects completed in 2011: Options building and Parkwood Elementary.
- * Projects scheduled for 2012: Parkview Middle School and Bridgepoint Elementary.
- * Cordon Porter storage building was sold in 2012.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- 1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxillary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, Options and Corden Porter Center Buildings and Alternative School-

- * The required triennial reinspection will be performed in June 2013.
- * The required six month periodic surveillance was performed in December 2010.
- * The next scheduled activity is the required six month periodic surveillance in June 2011.
- * Charlestown High School asbestos removal project was completed in 2010.
- * Options Building is under renovation in 2011.
- * Parkwood Elementary is under renovation in 2011.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building - These buildings are asbestos free and Riverside Elementary was demolished in 2006. No surveillances or reinspections are required for these buildings.

March 2011

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxillary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection will be performed in June 2010.
- * The required six month periodic surveillance was performed in December 2009.
- * The next scheduled activity is the required six month periodic surveillance in December 2010.
- Charlestown High School is an ongoing asbestos removal project which will be complete prior to partial demolition.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free and Riverside Elementary was demolished in 2006. No surveillances or reinspections are required for these buildings.

March 2010

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2007.
- * The required six month periodic surveillance was performed in December 2008.
- * The next scheduled activities are the required six month periodic surveillance in June 2009 and Dec 2009. Charlestown High School has undergone an asbestos removal project prior to partial demolition.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free and Riverside Elementary was demolished in 2006. No surveillances or re-inspections are required for these buildings.

April 2009

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number (812)288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2007.
- * The required six month periodic surveillance was performed in December 2007.
- * The next scheduled activities are the required six month periodic surveillance in June 2008 and Dec 2008.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free. Riverside Elementary was Demolition in 2006. No surveillances or reinspections are required.

April 2008

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required six month periodic surveillance was performed in June 2006.
- * The required six month periodic surveillance was performed in December 2006.
- * The next scheduled activities are the required six month periodic surveillance in June 2007 and Dec 2007.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free. Riverside Elementary was Demolition in 2006. No surveillances or reinspections are required.

March 2007

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

- Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
- 2. Provide awareness training and additional training to selected school employees.
- Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2005.
- * The required six month periodic surveillance was performed in December 2005.
- * The next scheduled activities are the required six month periodic surveillance in June 2006 and Dec 2006.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free. No surveillances or reinspections are required.

March 2006

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2004.
- * The required six month periodic surveillance was performed in December 2004.
- * The next scheduled activities are the required six month periodic surveillance in June 2005 and December 2005.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

* These buildings are asbestos free. No surveillances or reinspections are required.

April 2005

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

* The required six month periodic surveillance was performed in June 2003.

* The required six month periodic surveillance was performed in December 2003.

* The next scheduled activities are the required triennial reinspection in June 2004 and a required six month periodic surveillance in December 2004.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

* These buildings are asbestos free. No surveillances or reinspections are required.

March 2004

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

* The required six month periodic surveillance was performed in June 2002.

* The required six month periodic surveillance was performed in December 2002.

* The next scheduled activity is the required periodic surveillance in June 2003.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

* These buildings are asbestos free. No surveillances or reinspections are required.

May 2003

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in July 2001.
- * The required six month periodic surveillance was performed in December 2001.
- * The next scheduled activities are the required periodic surveillances in June 2002 and December 2002.

Pleasant Ridge Elementary School and (New) Utica Elementary School -

* These buildings are asbestos free. No surveillances or reinspections are required.

(Old) Utica Elementary School -

* In accordance with information collected from the GCCS this building has been deeded to the town of Utica. No further AHERA periodic surveillances or triennial reinspections will be conducted by the designated person.

June 2002

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, (Old) Utica, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center -

- * The required six month periodic surveillance was performed in June 2000.
- * The required six month periodic surveillance was performed in January 2001.
- * The next scheduled activity is a required triennial reinspection in June 2001.

Pleasant Ridge Elementary School and (New) Utica Elementary School -

* This building is asbestos free. No surveillances or reinspections are required.

June 2001

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required six month periodic surveillance was performed in June 1998.
- * The required six month periodic surveillance was performed in December 1998.
- * The next scheduled activity is a required periodic surveillance in June 1999.

Parkwood Elementary School

* O & M was performed in the boiler room in May 1998.

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1997 and December 1997.
- * Next activity scheduled activity is a required third year reinspection in June 1998.

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available, should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

* The required periodic surveillance was performed in June 1996 and December 1996.

* The next required periodic surveillance will be performed in June 1997 and December 1997.

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Denny Johanson at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All buildings where it is required -

- * The required third year reinspection was performed in June 1995.
- * The required periodic surveillance was performed in December 1995.
- * Next activity scheduled is a periodic surveillance in June 1996.

Charlestown High School -

* Transite panels were compliantly removed from the exterior of the building.

Corden Porter Building #3 -

* TSI was compliantly removed from the boiler room.

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.

2. Provide awareness training and additional training to selected school employees.

3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available, should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Dennis Johanson at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1995 and December 1995.
- * The required triennial reinspection was performed in June 1995.
- * The next required periodic surveillance will be performed in June 1996 and December 1996.

Alliance Indiana, Inc.

ACCREDITATIONS

ς.

Greater Clark County Schools

AHERA Program



Environmental Management Institute

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846 www.envtlmgmt.org

This confirms that

Sandy Shadley

Completed the Required Initial Training for Asbestos Accreditation Under TSCA Title II and has passed with a Score of 70 or Greater the Examination for

Asbestos Management Planner

Course Date December 10 - 11, 2009

Examination-Date ecember 2009 Jack E. Leonard, President

Certificate: MP(I) 2248 Expires: December 11, 2010

Approved by::

Illinois Department of Public Health Indiana Department of Environmental Management Indiana Department of Environmental Management 100 N. Senate Avenue Mail Code 61-52 IGCN 1003 * dianapolis, IN 46204-2251

January 21, 2010

RECEIVED JAN 2 3 2010

Sandra S. Shadley Alliance Environmental Grp 5340 Commerce Circle Ste E Indianapolis IN 46237

Re: Asbestos Management Planner # 19A002720

Based upon the review of your license application, the Office of Air Quality has determined that you have fulfilled the requirements of 326 IAC 18 and are eligible for licensing in the following discipline:

Asbestos Management Planner

Your Asbestos Management Planner license is attached below. The license is waterproof and tear resistant. Please sign your license and do not laminate or alter your license in anyway. Your license must be available for review at all times while implementing an asbestos project. This license may be revoked, pursuant to 326 IAC 18-1-7, if you:

- (1) Violate any requirements of these rules (326 IAC 18), 326 IAC 14-10, or any requirement of the Asbestos-Containing Materials in Schools Rule or any other federal, state, or local regulation pertaining to asbestos in buildings or to asbestos projects.
- (2) Falsify information on your application for licensing.
- (3) Fail to meet any qualifications specified in 326-IAC 18-1-4.
- (4) Conduct asbestos project, or related asbestos handling activity, in a manner which is hazardous to the public health.

Your license is valid effective 01/21/2010, and will expire on 01/21/2011, as indicated on your card. We suggest that you attend the required training and submit an application for license renewal early to insure your license does not lapse. NOTE: 326 IAC 18-1-4(h) and 326 IAC 18-1-6(e) require that any individual who has an eighteen (18) month lapse between any two training courses of the same discipline to attend an initial training course for the discipline in which they are seeking a license. In order to avoid re-taking the initial training course you must have attended a refresher in the discipline you are seeking a license within eighteen (18) months from the date of issuance of your last training course certificate.

Office of Air Quality, Asbestos Licensing Section (317) 233-3861

Indiana Dept. of Environmental Management

Sandra S. Shadley

Asbestos Management Planner License #: 19A002720

Effective: 01/21/2010 Birth Date: 04/21/1959 Height: 5-08 Weight: 140 Expiration: 01/21/2011 Gender: F Eye Color: Blue Hair Color: Brown



Indiana Department of Environmental Management 100 N. Senate Avenue Mail Code 61-52 IGCN 1003 Indianapolis, IN 46204-2251

RECEIVED APR 2.2 2014

April 17, 2014

Benjamin S. Hood Alliance Environmental Group 5340 Commerce Circle, Ste E Indianapolis IN 46237



Based upon the review of your license application, the Office of Air Quality has determined that you have fulfilled the requirements of 326 IAC 18 and are eligible for licensing in the following discipline:

Asbestos Inspector

Your Asbestos Inspector license is attached below. The license is waterproof and tear resistant. Please sign your license and do not laminate or alter your license in anyway. Your license must be available for review at all times while implementing an asbestos project. This license may be revoked, pursuant to 326 IAC 18-1-7, if you:

- (1) Violate any requirements of these rules (326 IAC 18), 326 IAC 14-10, or any requirement of the Asbestos-Containing Materials in Schools Rule or any other federal, state, or local regulation pertaining to asbestos in buildings or to asbestos projects.
- (2) Falsify information on your application for licensing.
- (3) Fail to meet any qualifications specified in 326-IAC 18-1-4.
- (4) Conduct asbestos project, or related asbestos handling activity, in a manner which is hazardous to the public health.

Your license is valid effective 05/05/2014, and will expire on 05/05/2015, as indicated on your card. We suggest that you attend the required training and submit an application for license renewal early to insure your license does not lapse. NOTE: 326 IAC 18-1-4(h) and 326 IAC 18-1-6(e) require that any individual who has an eighteen (18) month lapse between any two training courses of the same discipline to attend an initial training course for the discipline in which they are seeking a license. In order to avoid re-taking the initial training course you must have attended a refresher in the discipline you are seeking a license within eighteen (18) months from the date of issuance of your last training course certificate.

Office of Air Quality, Asbestos Licensing Section (317) 233-3861



Indiana Dept. of Environmental Management

Benjamin S. Hood

Asbestos Inspector License #: 19A001039

Effective: 05/05/2014 Birth Date: 04/10/1978 Height: 6-00 Weight: 285 Expiration: 05/05/2015 Gender: M Eye Color: Brown Hair Color: Brown



ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE 1435 Sadlier Circle West Drive Indianapolis, Indiana 46239 (317) 352 -1270 / (317) 352 - 0669

CHRISTIAAN SPARKS 306 - 04 - 2616

Has Successfully Completed The Course Required Under TSCA Title II And Passed The Written Examination With a Score of 70% or Better

For ASBESTOS BUILDING INSPECTOR REFRESHER

Accredited by the Indiana Department of Environmental Management.

Certificate # ES03/BIR755

Course Dates: 09/26/2003 Test Date: 09/26/2003 Expires: 09/26/2004



<u>nanahankinikinikininahanan</u>

1971119114114119351191111

uithnimituittittitti

and the statement of the second s

oppedsparation in the production of the second s

Sharyn Reyes Instructor / Manager

nederficherungestiftungesandestellingblieftebebestifti

unitien eregelegistang fillesteint biestiesteinen ite

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE 1435 Sadlier Circle West Drive Indianapolis, Indiana 46239 (317) 352-1270 / (317) 352-06

GEORGE Wm. (BILL) OGLE

Has Successfully Completed The Course Required Under TSCA Title II And Passed The Written Examination With a Score of 70% or Better For

ASBESTOS MANAGEMENT PLANNER REFRESHER

Accredited by the Indiana Department of Environmental Management.

Certificate # ES03/MPR045

Course Dates: 09/05/2003 Test Date: 09/05/2003 Expires: 09/05/2004



numproversited and a second second

itteitisteitistittittittinistuttova

Sharyn Reyés Instructor

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE 1435 Sadlier Circle West Drive Indianapolis, Indiana 46236 (317) 352-1270 / (317) 352 - 0669

77 321-1-1

, Ð

annederstanktigenskifeliering

International fridama and and a second

PATRICK E. WILSON 309 - 90 - 6909

Has Successfully Completed The Course Required Under TSCA Title II And Passed The Written Examination With a Score of 70% or Better For

ASBESTOS BUILDING INSPECTOR REFRESHER

Accredited by the Indiana Department of Environmental Management.

Certificate # ES00/BIR482

Course Dates: 11/29/2000 Test Date: 11/29/2000 Expires: 11/29/2001

Sharyn Reyes Instructor

aberfleben eine beine bereine bester bereine bereinen bereiten bereiten bereiten bereiten bereiten bereiten ber

មានអាមារមានអាមាននៅតែពិធីដែលក្រោមអាមារអាមារអាមារអាមារអាមារ

historia in the first of the second second

printed international and a statistical statis



Environmental Management Institute

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846 www.spea.iupui.edu/Envtl_mgmt

This confirms that

George Wm. (Bill) Ogle

Completed the Requisite Initial Training for Asbestos Accreditation Under TSCA Title II and has Passed with a Score of 70 or Greater the Examination for

Asbestos Management Planner

Course date March 2 - 3, 2000

Examination Date March 3, 2000

Jack E. Leonard, President

Certificate: MP(I) 2157 Expires March 3, 2001

Approved by:

Illinois Department of Public Health Indiana Department of Environmental Management



ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE 1435 Sadlier Circle West Drive Indianapolis, Indiana 46239 (317) 352-1270 / (317) 352-0669

CLINT YATES

316 - 92 - 7065

Has Successfully Completed The Course Required Under TSCA Title II And Passed The Written Examination With a Score of 70% or Better For

ASBESTOS BUILDING INSPECTOR REFRESHER


Accredited by the Indiana Department of Environmental Management.


Certificate # ES/BIR98/004.

Course Dates: 01/22/98 - 01/22/98 Test Date: 01/22/98 Expires: 01/22/99

Sharyn Reyce Sharyn Reyes

Assistant / Instructor

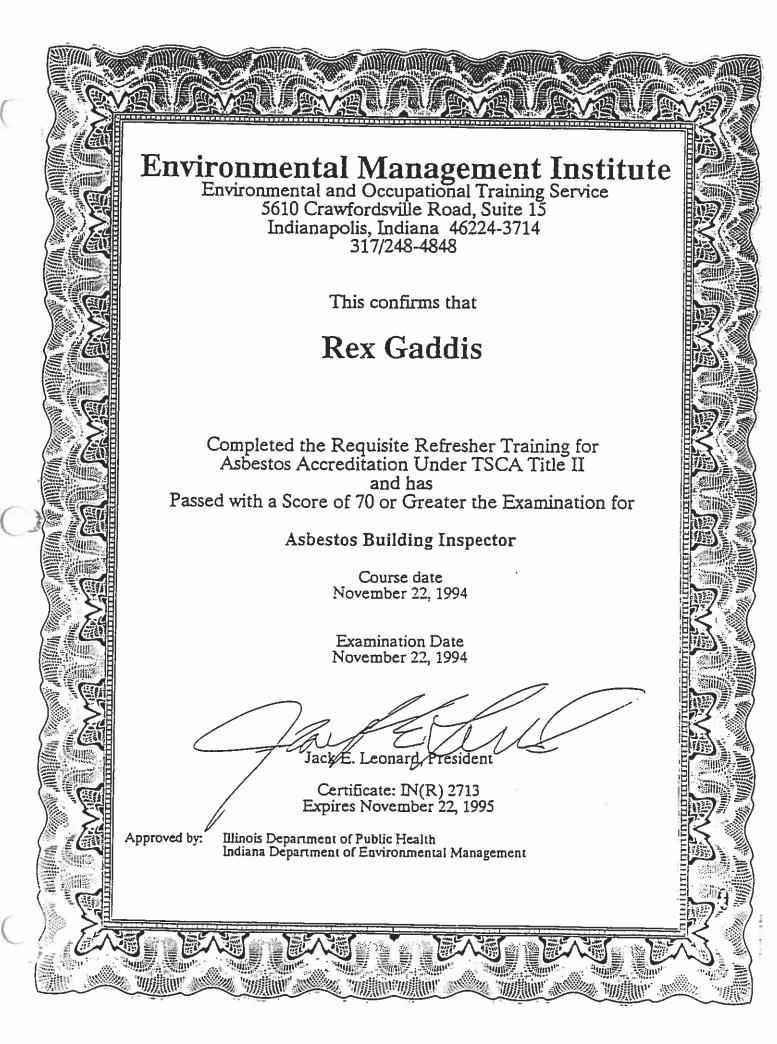

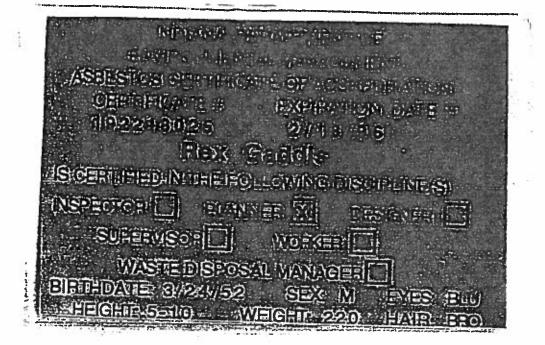

INDIANA DEPARTMENTOF ENVIRONMENTAL MANAGEMENT ASBESTOS CERTIFICATE OF ACCREDITATION CERTIFICATE # EXPIRATION DATE 190903032 3/16/96 Rex Gaddis IS CERTIFIED IN THE FOLLOWING DISCIPLINE(S) INSPECTOR PLANNER DESGNER : SUPERVISOR WORKER : WASTE DISPOSAL MANAGER BIRTHDATE: 3/24/52 SEX: M EYES BLU HEIGHT: 5-10 WEIGHT: 220 - HAIR: BRO TRAINING

Greater Clark County Schools

AHERA Program

OPERATIONS AND MAINTENANCE INFORMATION

Greater Clark County Schools

AHERA Program

MINOR FIBER RELEASE EPISODE

The local education agency shall ensure that the procedures described below are followed in the event of a minor fiber release episode (i.e., the falling or dislodging of not more than 3 square or linear feet of friable ACBM):

- 1. Thoroughly saturate the debris using wet methods.
- 2. Clean the area using wet methods, protective clothing, HEPAvacuums, mini-enclosures, glove bags, as necessary to inhibit the spread of any released fibers. At a minimum, workers should use air-purifying respirators with HEPA filters.
- 3. Place the asbestos debris in a sealed, leak-tight container, preferably a 6 mil. labeled plastic bag.
- 4. Repair the area of damaged ACM with materials such as asbestosfree spackling, plaster, cement, or insulation, or seal with latex paint or an encapsulant, or immediately have the appropriate response action implemented.
- 5. Each fiber release episode should be documented.

MAJOR FIBER RELEASE EPISODE

The local education agency shall ensure that the procedures described below are followed in the event of a major fiber release episode (i.e., the falling or dislodging of more than 3 square or linear feet of friable ACBM):

1. Restrict entry into the area and post signs to prevent entry into the area by persons other than those necessary to perform the response action.

2. Shut off or temporarily modify the air-handling system to prevent the distribution of fibers to other areas in the building.

3. AHERA requires that major fiber release episodes be designed by accredited Project Designers. However, the following response procedures should form the basis for response actions.

4. All the procedures recommended by EPA and required by OSHA for large-scale removal of ACM should be used. These include containment barrier, negative pressure ventilation, personal respiratory protection and protective clothing, decontamination facilities, and air testing.

5. Workers should wear "type C" respirators and protective clothing, including a body suit, hood, boots and gloves. Personal air monitoring may be conducted on representative workers, but is not required by OSHA when "type C" respirators are used.

6. Fallen debris should be sprayed with amended water and placed in plastic bags for disposal. Shovels are useful for collecting the debris. The floor should be thoroughly cleaned with a HEPA vacuum cleaner.

7. Walls, ceiling, pipes, boilers, or other surfaces where ACM was damaged or delaminated should be repaired temporarily. This might involve replastering with asbestos-free material, spraying with an encapsulant, or taping with duct tape. In some cases, ACM beyond the immediate area of damage may need to be removed to prevent additional episodes.

8. The air should be tested for asbestos fibers before the plastic barriers are removed and the area reoccupied. Testing should follow guidelines in Chapter 6 of the Purple Book and Chapter 4 of the Silver Book. That is, air should be sampled at the specified number of locations and analyzed by either phase contrast microscopy or transmission electron microscopy. However, sampling should not be done aggressively since the use of blowers and fans may dislodge fibers from the remaining ACM.

Major Fiber Release

9. After the barriers have been taken down, a decontamination of the entire building or a portion of it should be considered. The need for this will depend on how rapidly the response team reacted to the episode and, in particular, how quickly the HVAC system was turned off. A thorough decontamination includes HEPA-vacuuming and/or wet wiping all carpets, furniture, and other surfaces. Decontamination of the HVAC system would involve disassembling and cleaning (HEPA-vacuuming or wet wiping) ducts, ventilators, registers, and other system parts. System filters should also be removed and replaced.

10. All equipment used in the cleanup operation should be washed or wiped with damp cloths. All disposable materials (e.g., cloths, mop heads, filters, coveralls) should be discarded as asbestos wastes.

11. Each fiber release episode should be documented.

OPERATIONS AND MAINTENANCE REPORT

 $\mathbf{y}_{1,1} \in \mathbf{y}$

 $(\$

 \bigcirc

(Use only for O&M work less than 3 square or 3 linear feet)

BUILDING:					
				th 40 CFR 763.91 and 763.94.	
,	Location:				
	Response:	Clean	Repair	Encapsulation	
		Enclosure	Removal		
	Reason:				
	<u></u>				
	Work Description:				
	Date:	Start		Stop	
	Time:	Start		Stop	
	Material:	Surface	SF	Thermal LF	
	Other:		 SF or	LF	
	Asbestos Co	ntrol Method:	Wet Methods	HEPA Vacuum	
			Glovebag	Mini-Enclosure	
	Respiratory F	Protection:	N.A.P.R	P.A.P.R	
		1	fit tested? YES		

8.	Equipment Used:				
	Low Vol. Pumps FAM HEPA Vac	High AFD	Vol. Pumps		
	Other:			·	
9.	Material Used:				
	6 Mil. Disposable Bags Glovebags Duct Tape Disposable Coveralls Sponges	Poly HEPA Filters Spray Glue 3M Pads			
	Encapsulants: Penetrating	Bridging			
	Other:		·		
10.	Work Personnel:				
	NAME	16 HOUR TI	RAINED - IDE		REDITED
Super	visor:	YES	NO	YES	NO
Worke	er(s):	YES	NO	YES	NO
	<u> </u>	YES	NO	YES	NO
		YES	NO	YES	NO
		YES	NO	YES	NO
		YES	_NO	YES	NO
11.	ACBM Disposal: Storage: YES	<u>NO_</u> , If yes, whe	re stored:		
	If no, where disposed: Landfill:_				
12.	Final Visual Inspection Approved:(LE	A Designated Pe	rson - Printed	Name)	
	(LE	A Designated Pe	rson - Signatu	ıre)	

-4

×

C

 $\langle C \rangle$

C

page 2 of 2

REMOVAL PROJECT INFORMATION

,

Greater Clark County Schools

AHERA Program

SHORT TERM WORKER PROGRAM

Greater Clark County Schools

AHERA Program

Alliance Indiana, Inc.

GREATER CLARK COUNTY SCHOOLS

SHORT-TERM WORKER SIGN OFF SHEET

This form should be signed each and every time before a "short-term worker" (telephone repair worker, utility worker, etc.) performs work that may cause him to come in contact with ACBM or suspected ACBM assumed to be ACM. One copy of this form should then be forwarded to the LEA designated person, and one copy should be maintained in the school building's copy of the supplemental binder provided by Alliance Indiana, Inc., in order to fulfill the LEA's recordkeeping requirements. The third copy should be forwarded to Alliance Indiana, Inc. for placement in its copy of the supplemental binder.

School Building Name -	Northaven Elementar	v School	Date	
Solicor Banalig Harlo	Tortilaron Eloniona	0011001		_

I certify that before performing any work which would possibly cause me to come in contact with Asbestos Containing Building Materials (ACBM), I was provided with adequate information regarding the locations of ACBM and suspected ACBM assumed to be ACM in the above-mentioned school building where I performed the work.

Signature -			
0			

Company -

Description of work (including number of days on site) - _____

T

GREATER CLARK COUNTY SCHOOLS

SHORT-TERM WORKER SIGN IN LOG

ALL SHORT-TERM WORKERS MUST SIGN THIS LOG CONFIRMING THAT THEY HAVE SIGNED A "SHORT-TERM WORKER SIGN OFF SHEET"

	1149° 0
and the second	
2.A. 48 (C), 1074	
- Merez	

Greater Clark County Schools

Short Term Worker