

**GREATER CLARK COUNTY SCHOOLS**

**SERVICE CENTER BUS GARAGE**

**AHERA**

**ASBESTOS MANAGEMENT PLAN**

**DESIGNATED PERSON  
TRUTH AND CORRECT STATEMENT**

**Local Education Agency –** Greater Clark County Schools  
2112 Utica-Sellersburg Road  
Jeffersonville, Indiana 47130

**Designated Person -** Alliance Environmental Group, Inc.  
Sandra Shadley  
5153 Commerce Square Drive, Suite E  
Indianapolis, Indiana 46237

This Truth and Correct Statement, as outlined in 40 CFR 763.93(i), certifies that the general, local education agency responsibilities, as stipulated by 40 CFR 763.84, have been or will be met.

These responsibilities include:

1. Ensure that the activities of any persons who perform inspections, reinspections, and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with 40 CFR 763 Subpart E.
2. Ensure all custodial and maintenance employees are properly trained as required by 40 CFR 763 Subpart E and other applicable Federal and/or State regulations (e.g., the Occupational Safety and Health Administration Asbestos Standard for Construction, the EPA Worker Protection Rule, or applicable State regulations).
3. Ensure that workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress.
4. Ensure that short-term workers (e.g., telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.
5. Ensure that warning labels are posted in accordance with Section 763.95.
6. Ensure management plans are available for inspection and notification of such availability has been provided as specified in the management plan under Section 763.93(g).
7. The undersigned person designated by the LEA pursuant to Section 763.84(g) (1) has received adequate training as stipulated in Section 763.84(g) (2).
8. The LEA has and will consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under Part 763.

Signature:  Date: November 6, 2016

Sandra S. Shadley

**ASBESTOS PROGRAM MASTER INDEX**

The following volumes are part of the Asbestos Program for the **GREATER CLARK COUNTY SCHOOLS**:

- A. Original Asbestos Management Plan for each school building.
- B. Asbestos Management Plan Supplement for each school building.
  - 1. Amendments to Management Plan
  - 2. Remaining Materials Report
  - 3. Surveillance, Reinspection and Additional Bulk Sampling Information
  - 4. Annual Notifications, Accreditations and Training Records
  - 5. Operations and Maintenance Records
  - 6. Asbestos Removal Projects
  - 7. Short Term Worker Program

Copies of both volumes are found in the respective buildings. The Administration Building also contains duplicate copies of both volumes for each building in their entirety.

GREATER CLARK COUNTY SCHOOLS

SERVICE CENTER

TABLE OF CONTENTS


AMENDMENTS TO MANAGEMENT PLAN	1
REMAINING MATERIALS REPORT	2
SURVEILLANCE, REINSPECTION AND ADDITIONAL BULK SAMPLING INFORMATION	3
ANNUAL NOTIFICATIONS, ACCREDITATIONS, AND TRAINING	4
OPERATIONS AND MAINTENANCE RECORDS	5
ASBESTOS REMOVAL PROJECTS	6
SHORT TERM WORKER INFORMATION	7

*AMENDMENTS TO THE MANAGEMENT PLAN*

**GREATER CLARK COUNTY SCHOOLS  
SERVICE CENTER**

**LEA RESPONSIBILITY CERTIFICATION**

LEA Designated Person - ALLIANCE INDIANA, INC.

  
Signature - Bruce Wallace, President/CEO

May 1, 1995  
Date

**ACCREDITATION STATEMENT**

The Greater Clark County Schools ensures that the following items will be carried out:

Activities of any persons who perform inspections, reinspections, and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with Subpart E of this part.

All custodial and maintenance employees are properly trained as required by this Subpart E and other applicable Federal and/or State regulations (e.g., the OSHA asbestos standard for construction, the EPA worker protection rule, or applicable State regulations).

Workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, and post response action activities, including periodic reinspection and surveillance activities that are planned or in progress.

Short-term workers (e.g., telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACM and suspected ACM assumed to be ACM.

Warning labels are posted in accordance with 763.95.

Management plans are available for inspection and notification of such availability has been provided as specified in the management plan under 763.93(g).

Designate a person to ensure that requirements under this section are properly implemented.

Designated person receives adequate training to perform duties assigned under this section. Such training shall provide, as necessary, basic knowledge of:

Health effects of asbestos

Detection, identification, and assessment of ACM

Options for controlling ACM

Asbestos management programs

Relevant Federal and State regulations concerning asbestos, including those in this Subpart E and those of the OSHA, U.S. Department of Labor, the U.S. Department of Transportation and the U.S. Environmental Protection Agency.

Consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under this subpart.

**AMENDMENT TO THE MANAGEMENT PLAN**

**LEA Name -** Greater Clark County Schools

**Building -** Service Center

**Subject -** LEA Designated Person Change

Effective May 1, 1995 the Designated Person for the  
Greater Clark County Schools is:

Alliance Indiana, Inc.  
1433 Sadlier Circle West Drive  
Indianapolis, Indiana 46239  
(317) 351-5600

---

Management Planner: Rex Gaddis

Accreditation No. 192218025

  
\_\_\_\_\_  
Signature

May 1, 1995  
Date

**AMENDMENT TO THE  
AHERA MANAGEMENT PLAN**

**Building -** Service Center

**Subject-** New material

**Reference -** HA A Cove Base

**Original Assessment -** No assessment in original inspection.

**Amended Assessment -** The cove base in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

---

Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025

  
\_\_\_\_\_  
Signature

  
\_\_\_\_\_  
Date



**AMENDMENT TO THE  
AHERA MANAGEMENT PLAN**

**Building -** Service Center

**Subject-** New material

**Reference -** HA B Cove Base Mastic

**Original Assessment -** No assessment in original inspection.

**Amended Assessment -** The cove base mastic in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.


---


Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025

  
\_\_\_\_\_  
Signature

  
\_\_\_\_\_  
Date

**AMENDMENT TO MANAGEMENT PLAN**

**Building Name -** (Now Former) Administration Building, W.E. Wilson Elementary School, Thomas Jefferson Elementary School, Jeffersonville High School, River Valley Middle School, Corden Porter Center, Corden Porter Building #3, Corden Porter Building #4, and the Service Center/Bus Garage

**Subject -** Typographical Error

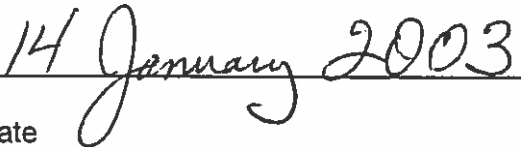
**Amendment -** A typographical error was made on the paperwork for the Periodic Surveillance that was conducted in December 2001. The pages in the Management Plan Supplement which are dated 12/10/2002 should read 12/10/2001.

---

Management Planner: George Wm. Ogle

Accreditation Number: 191523030

  
\_\_\_\_\_  
Signature

  
\_\_\_\_\_  
Date

**AMENDMENT TO MANAGEMENT PLAN**

**LEA Name -** Greater Clark County Schools  
**Subject -** LEA Designated Person Change  
**Amendment -** Effective March 2005, the Designated Person for the Greater Clark County Schools is:

Alliance Environmental Group, Inc.  
5340 Commerce Circle, Suite E  
Indianapolis, Indiana 46237  
(317) 865-3400

Personnel contributing to this Management Plan are licensed in according with 40 CFR 763.93(e)(12).

---

Management Planner: Sandra S. Shadley

Accreditation Number: 19A002720

  
Signature

  
Date

**AMENDMENT TO MANAGEMENT PLAN**

**Building Name -** Service Center/Garage

**Subject -** Removal of Homogeneous Area A

**Amendment -** All old cove base was removed in 2005, non-friable and replaced with new cove base; therefore, this homogeneous area is removed from the management plan.

Management Planner: Sandra Shadley

Accreditation Number: 19A002720

  
Signature

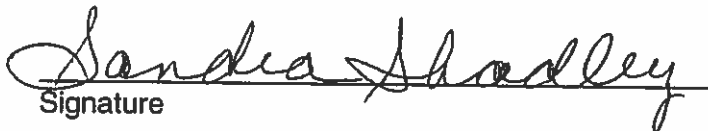
  
Date


**AMENDMENT TO MANAGEMENT PLAN**

**Building Name -** Service Center/Garage  
**Subject -** Quantity Update of Homogeneous Area "05"  
**Amendment -** A fire door between the front bay and service center office was located that was not assessed in the initial inspection. The core material is suspect and is being added to the management plan until proper sampling has been completed.

Management Planner: Sandra Shadley

Accreditation Number: 19A002720

  
Signature

  
Date

*REMAINING MATERIALS*

Greater Clark County School Corporation

Remaining Materials Report

4/23/2020

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action	
<b><u>Service Center Bus Garage</u></b>						
05	Fire Doors	3	Unit(s)	Assumed	Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)	O&M
06	Mastic	196	SF	Assumed	Throughout building	O&M
B	Cove Base Mastic	Approx. 270	SF	Assumed	Throughout building	O&M

Greater Clark County School Corporation

Remaining Materials Report

1/14/2020

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action	
<b><u>Service Center Bus Garage</u></b>						
05	Fire Doors	3	Unit(s)	Assumed	Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)	O&M
06	Mastic	196	SF	Assumed	Throughout building	O&M
B	Cove Base Mastic	Approx. 270	SF	Assumed	Throughout building	O&M



Greater Clark County School Corporation

Remaining Materials Report

5/16/2019

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action	
<b><u>Service Center Bus Garage</u></b>						
05	Fire Doors	3	Unit(s)	Assumed	Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)	O&M
06	Mastic	196	SF	Assumed	Throughout building	O&M
B	Cove Base Mastic	Approx. 270	SF	Assumed	Throughout building	O&M

Greater Clark County School Corporation

Remaining Materials Report

11/13/2018

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action	
<b><u>Service Center Bus Garage</u></b>						
05	Fire Doors	3	Unit(s)	Assumed	Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)	O&M
06	Mastic	196	SF	Assumed	Throughout building	O&M
B	Cove Base Mastic	Approx. 270	SF	Assumed	Throughout building	O&M

Greater Clark County School Corporation

Remaining Materials Report

5/2/2018

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action	
<b><u>Service Center Bus Garage</u></b>						
05	Fire Doors	3	Unit(s)	Assumed	Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)	O&M
06	Mastic	196	SF	Assumed	Throughout building	O&M
B	Cove Base Mastic	Approx. 270	SF	Assumed	Throughout building	O&M

Greater Clark County School Corporation

Remaining Materials Report

10/18/2017

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action	
<b><u>Service Center Bus Garage</u></b>						
05	Fire Doors	3	Unit(s)	Assumed	Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)	O&M
06	Mastic	196	SF	Assumed	Throughout building	O&M
B	Cove Base Mastic	Approx. 270	SF	Assumed	Throughout building	O&M

Greater Clark County School Corporation

Remaining Materials Report

4/13/2017

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action	
<b><u>Service Center Bus Garage</u></b>						
05	Fire Doors	3	Unit(s)	Assumed	Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)	O&M
06	Mastic	196	SF	Assumed	Throughout building	O&M
B	Cove Base Mastic	Approx. 270	SF	Assumed	Throughout building	O&M

Greater Clark County School Corporation

Remaining Materials Report

11/3/2016

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action	
<b><u>Service Center Bus Garage</u></b>						
05	Fire Doors	3	Unit(s)	Assumed	Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)	O&M
06	Mastic	196	SF	Assumed	Throughout building	O&M
B	Cove Base Mastic	Approx. 270	SF	Assumed	Throughout building	O&M

Greater Clark County School Corporation

Remaining Materials Report

4/28/2016

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action	
<b><u>Service Center Bus Garage</u></b>						
05	Fire Doors	3	Unit(s)	Assumed	Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)	O&M
06	Mastic	196	SF	Assumed	Throughout building	O&M
B	Cove Base Mastic	Approx. 270	SF	Assumed	Throughout building	O&M

Greater Clark County School Corporation

Remaining Materials Report

10/20/2015

HA ID	HA Description	Quantity	Asbestos	HA Location	Planned Response Action	
<b><u>Service Center Bus Garage</u></b>						
05	Fire Doors	3	Unit(s)	Assumed	Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)	O&M
06	Mastic	196	SF	Assumed	Throughout building	O&M
B	Cove Base Mastic	Approx. 270	SF	Assumed	Throughout building	O&M



**Greater Clark County Schools  
Remaining Materials Report  
April 22, 2015**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>					
05	Fire doors	3 Eac	A	Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

**Greater Clark County Schools  
Remaining Materials Report  
October 22, 2014**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>					
05	Fire doors	3 Eac	A	Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

**Greater Clark County Schools  
Remaining Materials Report  
April 21, 2014**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>					
05	Fire doors	3 Eac	A	Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

**Greater Clark County Schools  
 Remaining Materials Report  
 October 24, 2013**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>					
05	Fire doors	3 Eac	A	Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

**Greater Clark County Schools  
Remaining Materials Report  
October 24, 2012**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>					
05	Fire doors	3 Eac	A	Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

**Greater Clark County Schools  
Remaining Materials Report  
April 24, 2013**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>					
05	Fire doors	3 Eac	A	Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

**Greater Clark County Schools  
Remaining Materials Report  
June 25, 2012**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>					
05	Fire doors	3 Eac	A	Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

**Greater Clark County Schools  
 Remaining Materials Report  
 June 27, 2011**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>					
05	Fire doors	3 Eac	A	Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M



**Greater Clark County Schools  
 Remaining Materials Report  
 December 6, 2010**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>					
05	Fire doors	2 Eac	A	Between warehouse and office in Service Center (1) Between front bay and office in service center (1)	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

**Greater Clark County Schools  
Remaining Materials Report  
June 30, 2010**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>					
05	Fire doors	2 Eac	A	Between warehouse and office in Service Center (1) Between front bay and office in service center (1)	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

**Greater Clark County Schools  
Remaining Materials Report  
December 7, 2009**

<b>HA#</b>	<b>Material</b>	<b>Quantity</b>	<b>ACBM Y/A</b>	<b>Location</b>	<b>Planned Activities</b>
<b><u>Service Center/Garage</u></b>					
05	Fire door	36 SF	A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
A	Cove base	Approx. 800 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

**Greater Clark County Schools  
Remaining Materials Report  
June 10, 2009**

<b>HA#</b>	<b>Material</b>	<b>Quantity</b>	<b>ACBM Y/A</b>	<b>Location</b>	<b>Planned Activities</b>
<b><u>Service Center/Garage</u></b>					
05	Fire door	36 SF	A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
A	Cove base	Approx. 800 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

**Greater Clark County Schools  
 Remaining Materials Report  
 December 10, 2008**

<b>HA#</b>	<b>Material</b>	<b>Quantity</b>	<b>ACBM Y/A</b>	<b>Location</b>	<b>Planned Activities</b>
<b><u>Service Center/Garage</u></b>					
05	Fire door	36 SF	A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
A	Cove base	Approx. 800 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

**Greater Clark County Schools  
Remaining Materials Report  
June 30, 2008**

<b>HA#</b>	<b>Material</b>	<b>Quantity</b>	<b>ACBM Y/A</b>	<b>Location</b>	<b>Planned Activities</b>
<b><u>Service Center/Garage</u></b>					
05	Fire door	36 SF	A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
A	Cove base	Approx. 800 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

**Greater Clark County Schools  
Remaining Materials Report  
December 14, 2007**

<b>HA#</b>	<b>Material</b>	<b>Quantity</b>	<b>ACBM Y/A</b>	<b>Location</b>	<b>Planned Activities</b>
<b><u>Service Center/Garage</u></b>					
05	Fire door	36 SF	A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
A	Cove base	Approx. 800 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

**Greater Clark County Schools  
Remaining Materials Report  
July 9, 2007**

<b>HA#</b>	<b>Material</b>	<b>Quantity</b>	<b>ACBM Y/A</b>	<b>Location</b>	<b>Planned Activities</b>
<b><u>Service Center/Garage</u></b>					
05	Fire door	36 SF	A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
A	Cove base	Approx. 800 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M



**Greater Clark County Schools  
 Remaining Materials Report  
 December 18, 2006**

<b>HA#</b>	<b>Material</b>	<b>Quantity</b>	<b>ACBM Y/A</b>	<b>Location</b>	<b>Planned Activities</b>
<b><u>Service Center/Garage</u></b>					
05	Fire door	36 SF	A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
A	Cove base	Approx. 800 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

**Greater Clark County Schools  
Remaining Materials Report  
June 28, 2006**

<b>HA#</b>	<b>Material</b>	<b>Quantity</b>	<b>ACBM Y/A</b>	<b>Location</b>	<b>Planned Activities</b>
<b><u>Service Center/Garage</u></b>					
05	Fire door	36 SF	A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
A	Cove base	Approx. 800 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

**Greater Clark County Schools  
Remaining Materials Report  
January 25, 2006**

<b>HA#</b>	<b>Material</b>	<b>Quantity</b>	<b>ACBM Y/A</b>	<b>Location</b>	<b>Planned Activities</b>
<b><u>Service Center/Garage</u></b>					
05	Fire door	36 SF	A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
A	Cove base	Approx. 800 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

**Greater Clark County Schools  
 Remaining Materials Report  
 July 20, 2005**

<b>HA#</b>	<b>Material</b>	<b>Quantity</b>	<b>ACBM Y/A</b>	<b>Location</b>	<b>Planned Activities</b>
<b><u>Service Center/Garage</u></b>					
05	Fire door	36 SF	A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
A	Cove base	Approx. 800 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

Greater Clark County Schools  
 Remaining Materials Report  
 December 9, 2004

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>					
05	Fire door	36 SF	A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
A	Cove base	Approx. 800 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

Greater Clark County Schools  
 Remaining Materials Report  
 July 2, 2004

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>					
05	Fire door	36 SF	A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
A	Cove base	Approx. 800 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

Greater Clark County Schools  
 Remaining Materials Report  
 December 9, 2003

HA#	Material	Quantity	ACBM	Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>						
05	Fire door	36 SF		A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF		A	Throughout the building	O & M
A	Cove base	Approx. 800 LF		A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF		A	Throughout the building	O & M

**Greater Clark County Schools**  
**Remaining Materials Report**  
**June 13, 2003**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>					
05	Fire door	36 SF	A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
A	Cove base	Approx. 800 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M



**Greater Clark County Schools  
 Remaining Materials Report  
 December 18, 2003**

<b>HA#</b>	<b>Material</b>	<b>Quantity</b>	<b>ACBM Y/A</b>	<b>Location</b>	<b>Planned Activities</b>
<b><u>Service Center/Garage</u></b>					
05	Fire door	36 SF	A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
A	Cove base	Approx. 800 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

Greater Clark County Schools  
 Remaining Materials Report  
 June 19, 2002

HA#	Material	Quantity	ACBM	Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>						
05	Fire door	36 SF		A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF		A	Throughout the building	O & M
A	Cove base	Approx. 800 LF		A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF		A	Throughout the building	O & M

**Greater Clark County Schools**  
**Remaining Materials Report**  
**December 12, 2001**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>					
05	Fire door	36 SF	A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF	A	Throughout the building	O & M
A	Cove base	Approx. 800 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF	A	Throughout the building	O & M

**Greater Clark County Schools**  
**Remaining Materials Report**  
**July 12, 2001**

HA#	Material	Quantity	ACBM	Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>						
05	Fire door	36 SF		A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF		A	Throughout the building	O & M
A	Cove base	Approx. 800 LF		A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF		A	Throughout the building	O & M

**Greater Clark County Schools**  
**Remaining Materials Report**  
**January 11, 2001**

HA#	Material	Quantity	ACBM	Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>						
05	Fire door	36 SF		A	Between warehouse and office in Service Center	O & M
06	Mastic	196 SF		A	Throughout the building	O & M
A	Cove base	Approx. 800 LF		A	Throughout the building	O & M
B	Cove base mastic	Approx. 270 SF		A	Throughout the building	O & M

**Greater Clark County Schools**  
**Remaining Materials Report**  
**June 29, 2000**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>					
05	Fire Door	36 SF	A	Between Warehouse and Office in Service Center	O & M
06	Mastic	196 SF	A	Throughout building	O & M
A	Cove Base	Unquantified LF	A	Throughout building	O & M
B	Cove Base Mastic	Unquantified LF	A	Throughout building	O & M

**Greater Clark County Schools**  
**Remaining Materials Report**  
**February 23, 2000**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>					
05	Fire Door	36 SF	A	Between Warehouse and Office in Service Center	O & M
06	Mastic	196 SF	A	Throughout building	O & M
A	Cove Base	Unquantified LF	A	Throughout building	O & M
B	Cove Base Mastic	Unquantified LF	A	Throughout building	O & M

Greater Clark County Schools  
 Remaining Materials Report  
 July 6, 1999

HA#	Material	Quantity	ACBM	Y/A	Location	Planned Activities
<b><u>Service Center/Garage</u></b>						
05	Fire Door	36 SF		A	Between Warehouse and Office in Service Center	O & M
06	Mastic	196 SF		A	Throughout building	O & M
A	Cove Base	Unquantified LF		A	Throughout building	O & M
B	Cove Base Mastic	Unquantified LF		A	Throughout building	O & M



*PERIODIC SURVEILLANCE  
REINSPECTION  
ADDITIONAL BULK SAMPLING  
INFORMATION*

## ASSESSMENTS FOR AHERA

1. Damaged or significantly damaged thermal systems insulation.
2. Damaged friable surfacing ACM.
3. Significantly damaged friable surfacing ACM.
4. Damaged or significantly damaged friable miscellaneous ACM.
5. ACBM with potential for damage.
6. ACBM with potential for significant damage.
7. Any remaining friable ACBM or friable suspected ACBM.

If a material is non-friable, it does not require an assessment rating under AHERA.

Due to the differences in what is required of the LEA for damaged material compared to significantly damaged material, Alliance has modified the assessment scale to the following:

- 1A. Significantly damaged thermal systems insulation.
- 1B. Damaged thermal systems insulation.
- 4A. Significantly damaged friable miscellaneous ACM.
- 4B. Damaged friable miscellaneous ACM.

*PERIODIC SURVEILLANCES*








# SURVEILLANCE INFORMATION

## PERIODIC SURVEILLANCE PLAN

### GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>October 2014</u>	October 22, 2014	
<u>April 2015</u>	April 22, 2015	
<u>October 2015</u>	October 20, 2016	
<u>April 2016</u>	RE-INSPECTION	
<u>October 2016</u>	November 3, 2016	
<u>April 2017</u>	April 13, 2017	
<u>October 2017</u>	October 18, 2017	
<u>April 2018</u>	May 2, 2018	
<u>October 2018</u>	November 13, 2018	
<u>April 2019</u>	RE-INSPECTION	
<u>October 2019</u>	January 14, 2020	
<u>April 2020</u>	April 23, 2020	
<u>October 2020</u>		

# SURVEILLANCE INFORMATION

## PERIODIC SURVEILLANCE PLAN

### GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

<u>April 2021</u>	_____	_____
<u>October 2021</u>	_____	_____
<u>April 2022</u>	RE-INSPECTION	_____
<u>October 2022</u>	_____	_____
<u>April 2023</u>	_____	_____
<u>October 2023</u>	_____	_____
<u>April 2024</u>	_____	_____
<u>October 2024</u>	_____	_____
<u>April 2025</u>	RE-INSPECTION	_____
<u>October 2025</u>	_____	_____
<u>April 2026</u>	_____	_____
<u>October 2026</u>	_____	_____

## SURVEILLANCE INFORMATION

### PERIODIC SURVEILLANCE PLAN SCHEDULE

#### GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>JUNE 2009</u>	<u>June 2009</u>	<u>Bill Ogle</u>
<u>DECEMBER 2009</u>	<u>Dec 2009</u>	<u>Bill Ogle</u>
<u>JUNE 2010</u>	<u>Reinspection</u>	<u>Sandy Shadley</u>
<u>DECEMBER 2010</u>	<u>December 2010</u>	<u>Paul Krich</u>
<u>JUNE 2011</u>	<u>June 2011</u>	<u>Sandy Shadley</u>
<u>DECEMBER 2011</u>	<u>_____</u>	<u>_____</u>
<u>JUNE 2012</u>	<u>June 2012</u>	<u>Jeff Hechtin</u>
<u>DECEMBER 2012</u>	<u>October 2012</u>	<u>Jeff Hechtin</u>
<u>JUNE 2013</u>	<u>Reinspection</u>	<u>Jeff Hechtin</u>
<u>DECEMBER 2013</u>	<u>_____</u>	<u>_____</u>

**PERIODIC SURVEILLANCE PLAN**

**GREATER CLARK COUNTY SCHOOLS**

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each reinspection will be maintained in this binder.

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>JUNE 2003</u>	<u>June '03</u>	<u>C. Sparks</u>
<u>DECEMBER 2003</u>	<u>Dec '03</u>	<u>C. Sparks</u>
<u>JUNE 2004</u>	<u>REINSPECTION</u>	<u>C. Sparks</u>
<u>DECEMBER 2004</u>	<u>Dec '04</u>	<u>C. Sparks</u>
<u>JUNE 2005</u>	<u>July '05</u>	<u>J. Ogle</u>
<u>DECEMBER 2005</u>	<u>Nov 05</u>	<u>Boggs</u>
<u>JUNE 2006</u>	<u>June 06</u>	<u>C. Ames</u>
<u>DECEMBER 2006</u>	<u>Dec 06</u>	<u>Boggs</u>
<u>JUNE 2007</u>	<u>July 2007</u> <u>REINSPECTION</u>	<u>Bill Ogle</u>
<u>DECEMBER 2007</u>	<u>December 2007</u>	<u>Bill Ogle</u>
<u>JUNE 2008</u>	<u>June 2008</u>	<u>Bill Ogle</u>
<u>DECEMBER 2008</u>	<u>December 2008</u>	<u>Bill Ogle</u>

PERIODIC SURVEILLANCE PLAN

## GREATER CLARK COUNTY SCHOOLS

## SERVICE CENTER

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long they remain in the building. This inspection will be conducted semi-annually.

The following table outlines the dates on which these inspections should take place in this school building.

PERIODIC SURVEILLANCE SCHEDULE

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>DECEMBER 1995</u>	<u>12-95</u>	<u>Alliance</u>
<u>JUNE 1996</u>	<u>6-96</u>	<u>Alliance</u>
<u>DECEMBER 1996</u>	<u>12-96</u>	<u>Alliance</u>
<u>JUNE 1997</u>	<u>7-97</u>	<u>Alliance</u>
<u>DECEMBER 1997</u>	<u>1-98</u>	<u>Alliance</u>
<u>JUNE 1998</u>	<u>REINSPECTION</u>	<u>Alliance</u>
<u>DECEMBER 1998</u>	<u>12-98</u>	<u>Alliance</u>
<u>JUNE 1999</u>	<u>June '99</u>	<u>Alliance</u>
<u>DECEMBER 1999</u>	<u>Dec '00</u>	<u>Alliance</u>
<u>JUNE 2000</u>	<u>June 2000</u>	<u>Alliance</u>
<u>DECEMBER 2000</u>	<u>Jan '01</u>	<u>Pat Wilson</u>
<u>JUNE 2001</u>	<u>REINSPECTION</u>	<u>P. Wilson</u>
<u>DECEMBER 2001</u>	<u>Dec '01</u>	<u>A. Kimbrough</u>
<u>JUNE 2002</u>	<u>June '02</u>	<u>R. Calvert</u>
<u>DECEMBER 2002</u>	<u>Dec. '02</u>	<u>C. Sparks</u>



# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 05  
**HA Description** Fire Doors  
**HA Type** Miscellaneous Material  
**HA Location** Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)  
**Quantity** 3 Unit(s)  
**Comments** Door shells are intact, with no core material visible to inspect.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 4/23/2020

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

<b>Percent Damaged</b>	%	Good Condition	
<b>Physical Contact</b>		<b>Vibration</b>	<b>Air</b>
Low/None		Low/None	Low/None

**Planned Response Action** O&M

**Inspector**



Michael J. Ardis

**State** IN

**Accreditation Number** 19A007304

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 06  
**HA Description** Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** 196 SF  
**Comments** This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 4/23/2020

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

**Percent Damaged** % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

**Planned Response Action** O&M

**Inspector**



Michael J. Ardis

**State** IN

**Accreditation Number** 19A007304

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** B  
**HA Description** Cove Base Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** Approx. 270 SF

**Comments** This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.

**Asbestos** Assumed  
**Friable** No

**Original Inspection** 5/31/1995  
**Current Inspection** 4/23/2020

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

<b>Percent Damaged</b>	%	Good Condition	
<b>Physical Contact</b>		<b>Vibration</b>	<b>Air</b>
Low/None		Low/None	Low/None

**Planned Response Action** O&M

**Inspector**



Michael J. Ardis

**State** IN

**Accreditation Number** 19A007304

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 05  
**HA Description** Fire Doors  
**HA Type** Miscellaneous Material  
**HA Location** Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)  
**Quantity** 3 Unit(s)  
**Comments** Door shells are intact, with no core material visible to inspect.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 1/14/2020

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

<b>Percent Damaged</b>	%	Good Condition	
<b>Physical Contact</b>		<b>Vibration</b>	<b>Air</b>
Low/None		Low/None	Low/None

**Planned Response Action** O&M

**Inspector**



Michael J. Ardis

**State** IN

**Accreditation Number** 19A007304

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 06  
**HA Description** Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** 196 SF  
**Comments** This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 1/14/2020

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

**Percent Damaged** % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

**Planned Response Action** O&M

**Inspector**



Michael J. Ardis

**State** IN

**Accreditation Number** 19A007304

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** B  
**HA Description** Cove Base Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** Approx. 270 SF

**Comments** This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.

**Asbestos** Assumed  
**Friable** No

**Original Inspection** 5/31/1995  
**Current Inspection** 1/14/2020

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

**Percent Damaged** % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

**Planned Response Action** O&M

**Inspector**



Michael J. Ardis

**State** IN

**Accreditation Number** 19A007304

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 05  
**HA Description** Fire Doors  
**HA Type** Miscellaneous Material  
**HA Location** Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)  
**Quantity** 3 Unit(s)  
**Comments** Door shells are intact, with no core material visible to inspect.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 11/13/2018

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

<b>Percent Damaged</b>	%	Good Condition	
<b>Physical Contact</b>		<b>Vibration</b>	<b>Air</b>
Low/None		Low/None	Low/None

**Planned Response Action** O&M

**Inspector**



Benjamin S. Hood

**State** IN

**Accreditation Number** 19A001039

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 06  
**HA Description** Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** 196 SF  
**Comments** This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 11/13/2018

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

**Percent Damaged** % Good Condition

**Physical Contact**

Low/None

**Vibration**

Low/None

**Air**

Low/None

**Planned Response Action** O&M

**Inspector**



Benjamin S. Hood

**State** IN

**Accreditation Number** 19A001039



# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** B  
**HA Description** Cove Base Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** Approx. 270 SF  
**Comments** This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 5/31/1995  
**Current Inspection** 11/13/2018

## Material Assessment


**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

**Percent Damaged** % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

**Planned Response Action** O&M

**Inspector**   
\_\_\_\_\_  
Benjamin S. Hood

**State** IN  
**Accreditation Number** 19A001039

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 05  
**HA Description** Fire Doors  
**HA Type** Miscellaneous Material  
**HA Location** Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)  
**Quantity** 3 Unit(s)  
**Comments** Door shells are intact, with no core material visible to inspect.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 5/2/2018


## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

<b>Percent Damaged</b>	%	Good Condition	
<b>Physical Contact</b>		<b>Vibration</b>	<b>Air</b>
Low/None		Low/None	Low/None

**Planned Response Action** O&M

**Inspector**   
Benjamin S. Hood

**State** IN

**Accreditation Number** 19A001039

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 06  
**HA Description** Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** 196 SF  
**Comments** This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 5/2/2018

## Material Assessment


**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

**Percent Damaged** % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

**Planned Response Action** O&M

**Inspector**   
\_\_\_\_\_  
Benjamin S. Hood

**State** IN  
**Accreditation Number** 19A001039

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** B  
**HA Description** Cove Base Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** Approx. 270 SF  
**Comments** This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 5/31/1995  
**Current Inspection** 5/2/2018

## Material Assessment


**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

**Percent Damaged** % Good Condition

<b>Physical Contact</b>	<b>Vibration</b>	<b>Air</b>
Low/None	Low/None	Low/None

**Planned Response Action** O&M

**Inspector**   
Benjamin S. Hood

**State** IN  
**Accreditation Number** 19A001039

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 05  
**HA Description** Fire Doors  
**HA Type** Miscellaneous Material  
**HA Location** Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)  
**Quantity** 3 Unit(s)  
**Comments** Door shells are intact, with no core material visible to inspect.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 10/18/2017

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

<b>Percent Damaged</b>	%	Good Condition	
<b>Physical Contact</b>		<b>Vibration</b>	<b>Air</b>
Low/None		Low/None	Low/None

**Planned Response Action** O&M



**Inspector** \_\_\_\_\_  
Dustin Hawkins

**State** IN

**Accreditation Number** 19A007194

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 06  
**HA Description** Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** 196 SF  
**Comments** This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 10/18/2017

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

**Percent Damaged** % Good Condition

<b>Physical Contact</b>	<b>Vibration</b>	<b>Air</b>
Low/None	Low/None	Low/None

**Planned Response Action** O&M



**Inspector** \_\_\_\_\_  
Dustin Hawkins

**State** IN  
**Accreditation Number** 19A007194

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** B  
**HA Description** Cove Base Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** Approx. 270 SF  
**Comments** This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 5/31/1995  
**Current Inspection** 10/18/2017

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

**Percent Damaged** % Good Condition

<b>Physical Contact</b>	<b>Vibration</b>	<b>Air</b>
Low/None	Low/None	Low/None

**Planned Response Action** O&M



**Inspector** \_\_\_\_\_  
Dustin Hawkins

**State** IN  
**Accreditation Number** 19A007194

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 05  
**HA Description** Fire Doors  
**HA Type** Miscellaneous Material  
**HA Location** Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)  
**Quantity** 3 Unit(s)  
**Comments** Door shells are intact, with no core material visible to inspect.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 4/13/2017

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

<b>Percent Damaged</b>	%	Good Condition	
<b>Physical Contact</b>		<b>Vibration</b>	<b>Air</b>
Low/None		Low/None	Low/None

**Planned Response Action** O&M

**Inspector**



Jamie Hosier

**State** Indiana

**Accreditation Number** 19A007179



# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 06  
**HA Description** Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** 196 SF  
**Comments** This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 4/13/2017

## Material Assessment


**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

**Percent Damaged** % Good Condition

<b>Physical Contact</b>	<b>Vibration</b>	<b>Air</b>
Low/None	Low/None	Low/None

**Planned Response Action** O&M

**Inspector**   
\_\_\_\_\_  
Jamie Hosier

**State** Indiana  
**Accreditation Number** 19A007179

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** B  
**HA Description** Cove Base Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** Approx. 270 SF  
**Comments** This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 5/31/1995  
**Current Inspection** 4/13/2017

## Material Assessment


**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

**Percent Damaged** % Good Condition

<b>Physical Contact</b>	<b>Vibration</b>	<b>Air</b>
Low/None	Low/None	Low/None

**Planned Response Action** O&M

**Inspector**   
\_\_\_\_\_  
Jamie Hosier

**State** Indiana  
**Accreditation Number** 19A007179

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 05  
**HA Description** Fire Doors  
**HA Type** Miscellaneous Material  
**HA Location** Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)  
**Quantity** 3 Unit(s)  
**Comments** Door shells are intact, with no core material visible to inspect.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 11/3/2016

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

<b>Percent Damaged</b>	%	Good Condition	
<b>Physical Contact</b>		<b>Vibration</b>	<b>Air</b>
Low/None		Low/None	Low/None

**Planned Response Action** O&M



**Inspector**

Dustin Hawkins

**State** IN

**Accreditation Number** 19A007194

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 06  
**HA Description** Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** 196 SF  
**Comments** This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 11/3/2016

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

**Percent Damaged** % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

**Planned Response Action** O&M



**Inspector** \_\_\_\_\_  
Dustin Hawkins

**State** IN  
**Accreditation Number** 19A007194

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** B  
**HA Description** Cove Base Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** Approx. 270 SF  
**Comments** This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 5/31/1995  
**Current Inspection** 11/3/2016

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

**Percent Damaged** % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

**Planned Response Action** O&M



**Inspector** \_\_\_\_\_  
Dustin Hawkins

**State** IN  
**Accreditation Number** 19A007194

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 05  
**HA Description** Fire Doors  
**HA Type** Miscellaneous Material  
**HA Location** Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)  
**Quantity** 3 Unit(s)  
**Comments** Door shells are intact, with no core material visible to inspect.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 10/20/2015

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

<b>Percent Damaged</b>	%	Good Condition	
<b>Physical Contact</b>		<b>Vibration</b>	<b>Air</b>
Low/None		Low/None	Low/None

**Planned Response Action** O&M

**Inspector**



Benjamin S. Hood

**State** IN

**Accreditation Number** 19A001039

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 06  
**HA Description** Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** 196 SF  
**Comments** This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 10/20/2015

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

<b>Percent Damaged</b>	%	Good Condition	
<b>Physical Contact</b>	Low/None	<b>Vibration</b> Low/None	<b>Air</b> Low/None

**Planned Response Action** O&M

**Inspector**



Benjamin S. Hood

**State** IN

**Accreditation Number** 19A001039

# Periodic Surveillance

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** B  
**HA Description** Cove Base Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** Approx. 270 SF  
**Comments** This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 5/31/1995  
**Current Inspection** 10/20/2015

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

**Percent Damaged** % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

**Planned Response Action** O&M

**Inspector**



Benjamin S. Hood

**State** IN

**Accreditation Number** 19A001039



# PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 3 Each

**Material Location**

Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)

**Material Description**

Fire doors

**Comments**

Door shells are intact, with no core material visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 4/22/2015

**Current Assessment Rating** NR Not Rated


**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M



**Inspector**

---

Benjamin S. Hood

**State** Indiana

**Accreditation Number** 19A001039

# PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 06

**Type of Material** Miscellaneous Material

**Quantity of Material** 196 SF

**Material Location**  
Throughout the building

**Material Description**

Mastic

**Comments**

This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 4/22/2015

**Current Assessment Rating** NR Not Rated


**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M



**Inspector**

---

Benjamin S. Hood

**State** Indiana

**Accreditation Number** 19A001039

# PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** B

**Type of Material** Miscellaneous Material

**Quantity of Material** Approx. 270 SF

**Material Location**  
Throughout the building

**Material Description**  
Cove base mastic

**Comments**  
This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 5/31/1995

**Current Surveillance Date** 4/22/2015

**Current Assessment Rating** NR Not Rated


**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M



**Inspector**

---

Benjamin S. Hood

**State** Indiana

**Accreditation Number** 19A001039

# PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 3 Each

**Material Location**

Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)

**Material Description**

Fire doors

**Comments**

Door shells are intact, with no core material visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 10/22/2014

**Current Assessment Rating** NR Not Rated

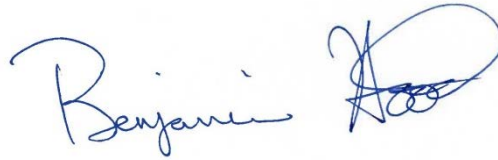
**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M



**Inspector**

---

Benjamin S. Hood

**State** Indiana

**Accreditation Number** 19A001039

# PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 06

**Type of Material** Miscellaneous Material

**Quantity of Material** 196 SF

**Material Location**

Throughout the building

**Material Description**

Mastic

**Comments**

This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 10/22/2014

**Current Assessment Rating** NR Not Rated

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M



**Inspector**

---

Benjamin S. Hood

**State** Indiana

**Accreditation Number** 19A001039

# PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** B

**Type of Material** Miscellaneous Material

**Quantity of Material** Approx. 270 SF

**Material Location**  
Throughout the building

**Material Description**  
Cove base mastic

**Comments**  
This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 5/31/1995

**Current Surveillance Date** 10/22/2014

**Current Assessment Rating** NR Not Rated

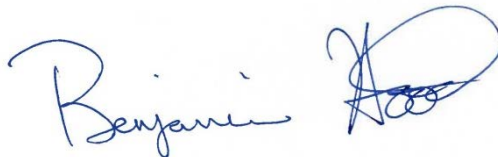
**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M



**Inspector**

---

Benjamin S. Hood

**State** Indiana

**Accreditation Number** 19A001039

# PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 3 Each

**Material Location**

Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)

**Material Description**

Fire doors

**Comments**

Door shells are intact, with no core material visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 4/21/2014

**Current Assessment Rating** NR Not Rated

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**



---

Jeffrey P. Rechten

**State** Indiana

**Accreditation Number** 19A003594

# PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 06

**Type of Material** Miscellaneous Material

**Quantity of Material** 196 SF

**Material Location**  
Throughout the building

**Material Description**

Mastic

**Comments**

This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 4/21/2014

**Current Assessment Rating** NR Not Rated

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**



---

Jeffrey P. Rechten

**State** Indiana

**Accreditation Number** 19A003594



# PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** B

**Type of Material** Miscellaneous Material

**Quantity of Material** Approx. 270 SF

**Material Location**  
Throughout the building

**Material Description**  
Cove base mastic

**Comments**  
This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 5/31/1995

**Current Surveillance Date** 4/21/2014

**Current Assessment Rating** NR Not Rated

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**



---

Jeffrey P. Rehtin

**State** Indiana

**Accreditation Number** 19A003594

# PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 3 Each

**Material Location**

Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)

**Material Description**

Fire doors

**Comments**

Door shells are intact, with no core material visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 10/24/2013

**Current Assessment Rating** NR Not Rated

**Cause of Damage** No Damage


**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**



Jeffrey P. Rehtin

**State** Indiana

**Accreditation Number** 19A003594

# PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 06

**Type of Material** Miscellaneous Material

**Quantity of Material** 196 SF

**Material Location**  
Throughout the building

**Material Description**

Mastic

**Comments**

This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 10/24/2013

**Current Assessment Rating** NR Not Rated

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Jeffrey P. Rehtin

**State** Indiana

**Accreditation Number** 19A003594

# PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** B

**Type of Material** Miscellaneous Material

**Quantity of Material** Approx. 270 SF

**Material Location**

Throughout the building

**Material Description**

Cove base mastic

**Comments**

This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 5/31/1995

**Current Surveillance Date** 10/24/2013

**Current Assessment Rating** NR Not Rated

**Cause of Damage** No Damage


**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**



Jeffrey P. Rechten

**State** Indiana

**Accreditation Number** 19A003594

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 3 Each

**Material Location**

Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)

**Material Description**

Fire doors

**Comments**

Door shells are intact, with no core material visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 10/24/2012

**Current Assessment Rating** NR Not Rated

**Cause of Damage** No Damage


**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**



Jeffrey P. Rehtin

**State** Indiana

**Accreditation Number** 19A003594

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF

**Material Location**  
Throughout the building

**Material Description**

Mastic

**Comments**

This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/1/1992  
**Current Surveillance Date** 10/24/2012  
**Current Assessment Rating** NR Not Rated  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Jeffrey P. Rehtin

**State** Indiana  
**Accreditation Number** 19A003594

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF


**Material Location**  
Throughout the building

**Material Description**  
Cove base mastic

**Comments**

This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Surveillance Date** 10/24/2012  
**Current Assessment Rating** NR Not Rated  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M



**Inspector**

---

Jeffrey P. Rehtin

**State** Indiana  
**Accreditation Number** 19A003594

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 3 Each

**Material Location**

Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)

**Material Description**

Fire doors

**Comments**

Door shells are intact, with no core material visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 6/25/2012

**Current Assessment Rating** NR Not Rated

**Cause of Damage** No Damage

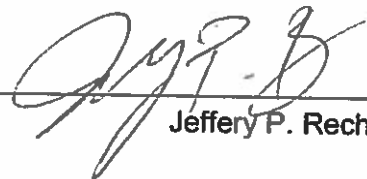
**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Jeffery P. Rechten

**State** Indiana

**Accreditation Number** 19A003594



## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 06

**Type of Material** Miscellaneous Material

**Quantity of Material** 196 SF

**Material Location**

Throughout the building

**Material Description**

Mastic

**Comments**

This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 6/25/2012

**Current Assessment Rating** NR Not Rated

**Cause of Damage** No Damage

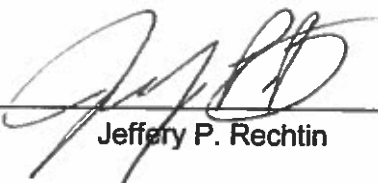
**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Jeffery P. Rehtin

**State** Indiana

**Accreditation Number** 19A003594

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF

**Material Location**  
Throughout the building

**Material Description**

Cove base mastic

**Comments**

This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Surveillance Date** 6/25/2012  
**Current Assessment Rating** NR Not Rated  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Jeffery P. Rechten

**State** Indiana  
**Accreditation Number** 19A003594

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 3 Each

**Material Location**

Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)

**Material Description**

Fire doors

**Comments**

Door shells are intact, with no core material visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 6/27/2011

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
Sandra Shadley

**State** Indiana

**Accreditation Number** 19A002323

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF

**Material Location**  
Throughout the building

**Material Description**  
Mastic

**Comments**

This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/1/1992  
**Current Surveillance Date** 6/27/2011  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
Sandra Shadley

**State** Indiana  
**Accreditation Number** 19A002323

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF

**Material Location**  
Throughout the building

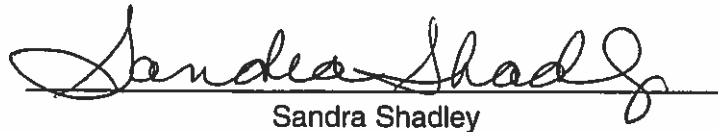
**Material Description**  
Cove base mastic

**Comments**

This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Surveillance Date** 6/27/2011  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
Sandra Shadley

**State** Indiana  
**Accreditation Number** 19A002323

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 2 Each

**Material Location**

Between warehouse and office in Service Center (1) Between front bay and office in service center (1)

**Material Description**

Fire doors

**Comments**

Door shells are intact, with no core material visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 12/6/2010

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage


**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**



Paul W. Krick

**State** Indiana

**Accreditation Number** 197812124

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 06

**Type of Material** Miscellaneous Material

**Quantity of Material** 196 SF

**Material Location**

Throughout the building

**Material Description**

Mastic

**Comments**

This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 12/6/2010

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**



Paul W. Krick

**State** Indiana

**Accreditation Number** 197812124

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF

**Material Location**  
Throughout the building

**Material Description**


Cove base mastic

**Comments**

This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Surveillance Date** 12/6/2010  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**



Paul W. Krick

**State** Indiana  
**Accreditation Number** 197812124



# PERIODIC SURVEILLANCE REPORT

**IEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 05  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 36 SF  
**Material Location**  
Between warehouse and office in Service Center  
**Material Description**  
Fire door  
**Comments**  
Door shell is intact, with no core material visible to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/1/1992  
**Current Surveillance Date** 12/4/2009  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

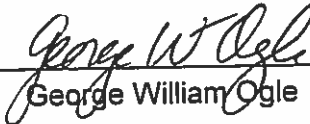
**Inspector** \_\_\_\_\_  
*George William Ogle*  
George William Ogle

**State** Indiana  
**Accreditation Number** 191003027

# PERIODIC SURVEILLANCE REPORT

**EA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Mastic  
**Comments**  
This material was not visible to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/1/1992  
**Current Surveillance Date** 12/4/2009  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State**

Indiana

**Accreditation Number**

191003027

# PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Service Center/Garage

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 800 LF

Material Location  
Throughout the building

Material Description  
Cove base

Comments  
The cove base in the restrooms has been removed non-friable and replaced with new cove base. All cove base was not in poor condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 12/4/2009

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

  
George William Ogle

State Indiana

Accreditation Number 191003027

## PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Service Center/Garage

HA# B

Type of Material Miscellaneous Material

Quantity of Material Approx. 270 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

This material was not visible to inspect. All missing cove base has been replaced, covering the old mastic.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 12/4/2009

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

  
George William Ogle

State Indiana

Accreditation Number 191003027

# PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 05  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 36 SF  
**Material Location**  
Between warehouse and office in Service Center  
**Material Description**  
Fire door  
**Comments**  
Door shell is intact, with no core material visible to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/1/1992  
**Current Surveillance Date** 6/10/2009  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State**

IN

**Accreditation Number**

191003027

# PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Mastic  
**Comments**  
This material was not visible to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/1/1992  
**Current Surveillance Date** 6/10/2009  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector** \_\_\_\_\_  
  
George William Ogle

**State** IN  
**Accreditation Number** 191003027

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** A  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 800 LF  
**Material Location**  
Throughout the building  
**Material Description**  
Cove base  
**Comments**  
The cove base in the restrooms has been removed non-friable.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Surveillance Date** 6/10/2009  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** Yes  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State**

IN

**Accreditation Number**

191003027

# PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF

**Material Location**  
Throughout the building

**Material Description**  
Cove base mastic

**Comments**  
This material was exposed in the restrooms where the cove base had been removed.  
Where exposed it was not in poor condition.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Surveillance Date** 6/10/2009  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** IN  
**Accreditation Number** 191003027



## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 05  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 36 SF

**Material Location**  
Between warehouse and office in Service Center

**Material Description**  
Fire door

**Comments**

Door shell is intact, with no core material visible to inspect.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/1/1992  
**Current Surveillance Date** 12/9/2008  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana  
**Accreditation Number** 191003027

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF

**Material Location**  
Throughout the building

**Material Description**

Mastic

**Comments**

This material was not visible to inspect.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/1/1992  
**Current Surveillance Date** 12/9/2008  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana  
**Accreditation Number** 191003027

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** A  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 800 LF

**Material Location**  
Throughout the building

**Material Description**  
Cove base

**Comments**

The cove base in the restrooms has been removed non-friable.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Surveillance Date** 12/9/2008  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** Yes  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana  
**Accreditation Number** 191003027

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF

**Material Location**  
Throughout the building

**Material Description**  
Cove base mastic

**Comments**

This material was exposed in the restrooms where the cove base had been removed.  
Where exposed it was not in poor condition.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Surveillance Date** 12/9/2008  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana  
**Accreditation Number** 191003027

## PERIODIC SURVEILLANCE REPORT

**EA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 05  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 36 SF

**Material Location**  
Between warehouse and office in Service Center

**Material Description**  
Fire door

**Comments**

Door shell is intact, with no core material visible to inspect.

<b>Does Material Contain Asbestos?</b>	Assumed	
<b>Is it Friable?</b>	No	
<b>Original Inspection Date</b>	6/1/1992	
<b>Current Surveillance Date</b>	6/30/2008	
<b>Current Assessment Rating</b>	NR	Not Required
<b>Cause of Damage</b>	No Damage	
<b>Accessible</b>	No	
<b>Potential for Damage</b>	Low	
<b>Removed</b>	No	
<b>Planned Response Action</b>	O & M	

**Inspector**

  
\_\_\_\_\_  
George William Ogle

**State** Indiana  
**Accreditation Number** 191003027

# PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools  
Building Name Service Center/Garage  
HA# 06  
Type of Material Miscellaneous Material  
Quantity of Material 196 SF

Material Location  
Throughout the building

Material Description  
Mastic

## Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Assumed  
Is it Friable? No  
Original Inspection Date 6/1/1992  
Current Surveillance Date 6/30/2008  
Current Assessment Rating NR Not Required  
Cause of Damage No Damage  
Accessible No  
Potential for Damage Low  
Removed No  
Planned Response Action O & M

Inspector

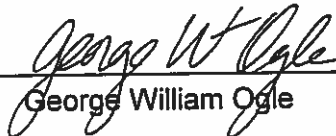
  
George William Ogle

State Indiana  
Accreditation Number 191003027

## PERIODIC SURVEILLANCE REPORT

**EA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** A  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 800 LF  
**Material Location**  
Throughout the building  
**Material Description**  
Cove base  
**Comments**  
The cove base in the restrooms has been removed non-friable.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Surveillance Date** 6/30/2008  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** Yes  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State**

Indiana

**Accreditation Number**

191003027

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** B

**Type of Material** Miscellaneous Material

**Quantity of Material** Approx. 270 SF

**Material Location**  
Throughout the building

**Material Description**  
Cove base mastic

**Comments**

This material was exposed in the restrooms where the cove base had been removed.  
Where exposed it was not in poor condition.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 5/31/1995

**Current Surveillance Date** 6/30/2008

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana

**Accreditation Number** 191003027



## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 05  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 36 SF  
**Material Location**  
Between warehouse and office in Service Center

**Material Description**

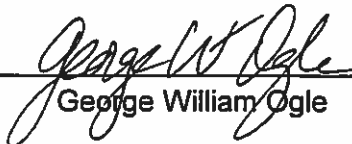
Fire door

**Comments**

Door shell is intact, with no core material visible to inspect.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/1/1992  
**Current Surveillance Date** 12/6/2007  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

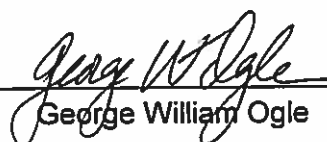
  
George William Ogle

**State** Indiana  
**Accreditation Number** 191003027

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Mastic  
**Comments**  
This material was not visible to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/1/1992  
**Current Surveillance Date** 12/6/2007  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana  
**Accreditation Number** 191003027

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** A  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 800 LF

**Material Location**  
Throughout the building

**Material Description**  
Cove base

**Comments**

The cove base in the restrooms has been removed non-friable.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Surveillance Date** 12/6/2007  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** Yes  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana  
**Accreditation Number** 191003027

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF

**Material Location**  
Throughout the building

**Material Description**  
Cove base mastic

**Comments**

This material was exposed in the restrooms where the cove base had been removed.  
Where exposed it was not in poor condition.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Surveillance Date** 12/6/2007  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana  
**Accreditation Number** 191003027

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 36 SF

**Material Location**

Between warehouse and office in Service Center

**Material Description**

Fire door

**Comments**

Door shell is intact, with no core material visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 12/18/2006

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana

**Accreditation Number** 191003027

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Mastic  
**Comments**  
This material was not visible to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/1/1992  
**Current Surveillance Date** 12/18/2006  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana  
**Accreditation Number** 191003027

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** A

**Type of Material** Miscellaneous Material

**Quantity of Material** Approx. 800 LF

**Material Location**

Throughout the building

**Material Description**

Cove base

**Comments**

This material was not in poor condition overall.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 5/31/1995

**Current Surveillance Date** 12/18/2006

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

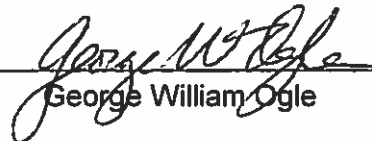
**Accessible** Yes

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
George William Ogle

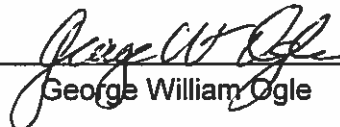
**State** Indiana

**Accreditation Number** 191003027

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Cove base mastic  
**Comments**  
This material was not exposed to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Surveillance Date** 12/18/2006  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

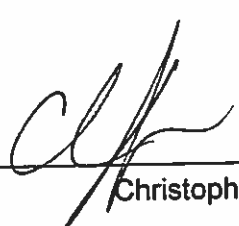
**Inspector**

  
George William Ogle

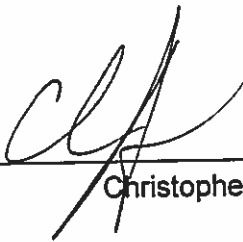
**State** Indiana  
**Accreditation Number** 191003027



## PERIODIC SURVEILLANCE REPORT

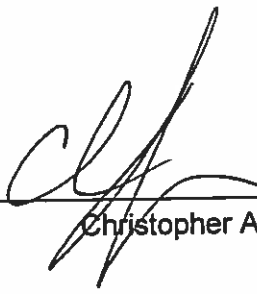
**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 05  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 36 SF  
**Material Location**  
Between warehouse and office in Service Center  
**Material Description**  
Fire door  
**Comments**  
Door shell is intact, with no core material visible to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/1/1992  
**Current Surveillance Date** 6/28/2006  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M  
**Inspector**   
\_\_\_\_\_  
Christopher Ames  
**State** Indiana  
**Accreditation Number** 198612124

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Mastic  
**Comments**  
This material was not visible to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/1/1992  
**Current Surveillance Date** 6/28/2006  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M  
**Inspector**   
\_\_\_\_\_  
Christopher Ames  
**State** Indiana  
**Accreditation Number** 198612124

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** A  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 800 LF  
**Material Location**  
Throughout the building  
**Material Description**  
Cove base  
**Comments**  
This material was not in poor condition overall.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Surveillance Date** 6/28/2006  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** Yes  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector** \_\_\_\_\_  
  
Christopher Ames

**State** Indiana  
**Accreditation Number** 198612124

# PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Cove base mastic  
**Comments**  
this material was not exposed to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Surveillance Date** 6/28/2006  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M  
**Inspector**   
Christopher Ames  
**State** Indiana  
**Accreditation Number** 198612124

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 05  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 36 SF

**Material Location**  
Between warehouse and office in Service Center

**Material Description**


Fire door

**Comments**

Door shell is intact, with no core material visible to inspect.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/1/1992  
**Current Surveillance Date** 1/23/2006  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana  
**Accreditation Number** 191523030

# PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 06

**Type of Material** Miscellaneous Material

**Quantity of Material** 196 SF

**Material Location**  
Throughout the building

**Material Description**

Mastic

**Comments**

This material was not visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 1/23/2006

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana

**Accreditation Number** 191523030

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** A  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 800 LF

**Material Location**  
Throughout the building

**Material Description**  
Cove base

**Comments**

This material was not in poor condition overall.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Surveillance Date** 1/23/2006  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** Yes  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana  
**Accreditation Number** 191523030

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Cove base mastic  
**Comments**  
this material was not exposed to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Surveillance Date** 1/23/2006  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana  
**Accreditation Number** 191523030



## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 36 SF

**Material Location**

Between warehouse and office in Service Center

**Material Description**

Fire door

**Comments**

Door shell is intact, therefore, no material was visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 7/19/2005

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana

**Accreditation Number** 191523030

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Mastic  
**Comments**  
This material was not visible to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/1/1992  
**Current Surveillance Date** 7/19/2005  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana  
**Accreditation Number** 191523030

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** A

**Type of Material** Miscellaneous Material

**Quantity of Material** Approx. 800 LF

**Material Location**  
Throughout the building

**Material Description**  
Cove base

**Comments**  
This material was not in poor condition with minor signs of wear and scraping observed.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 5/31/1995

**Current Surveillance Date** 7/19/2005

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

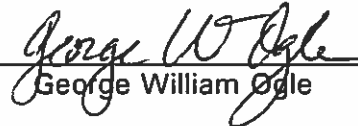
**Accessible** Yes

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana

**Accreditation Number** 191523030

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** B

**Type of Material** Miscellaneous Material

**Quantity of Material** Approx. 270 SF

**Material Location**  
Throughout the building

**Material Description**  
Cove base mastic

**Comments**  
Material was exposed in kitchenette under sink. It was not in poor condition.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 5/31/1995

**Current Surveillance Date** 7/19/2005

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

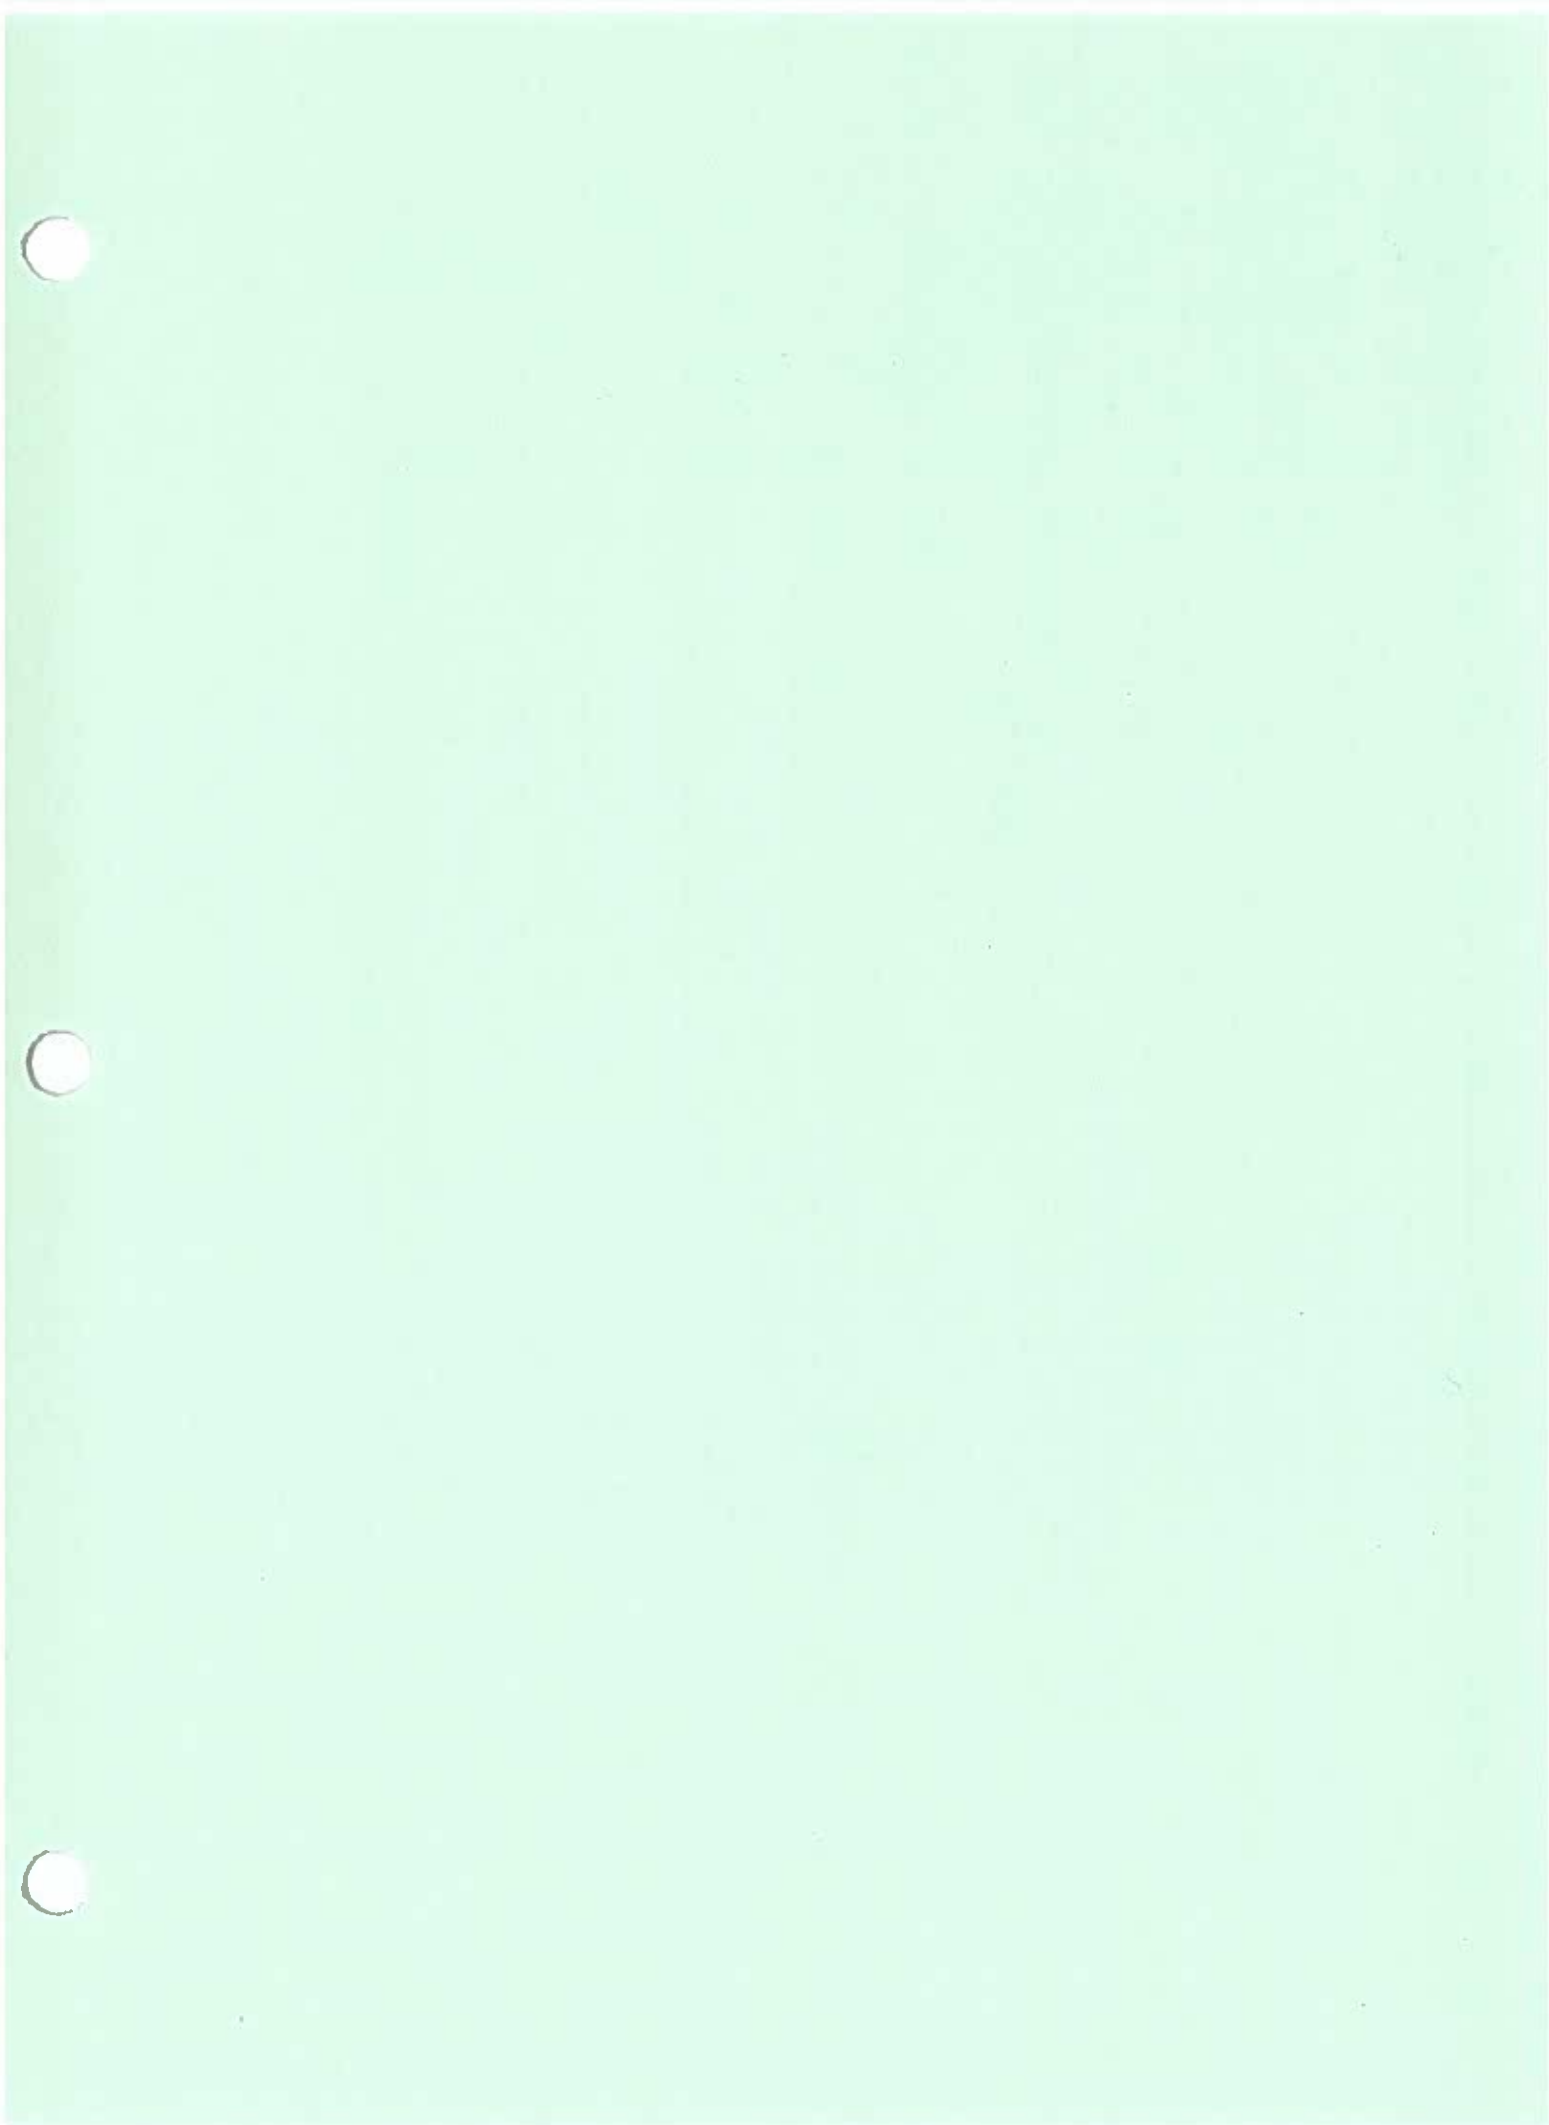
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana

**Accreditation Number** 191523030



## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 36 SF

**Material Location**

Between warehouse and office in Service Center

**Material Description**

Fire door

**Comments**

Door shell is intact. Therefore, no material was visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 12/9/2004

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage


**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Christiaan Sparks

**State** Indiana

**Accreditation Number** 190804103

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 06

**Type of Material** Miscellaneous Material

**Quantity of Material** 196 SF

**Material Location**  
Throughout the building

**Material Description**  
Mastic

**Comments**  
This material was not visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Surveillance Date** 12/9/2004

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Christiaan Sparks

**State** Indiana

**Accreditation Number** 190804103

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** A

**Type of Material** Miscellaneous Material

**Quantity of Material** Approx. 800 LF

**Material Location**  
Throughout the building

**Material Description**  
Cove base

**Comments**  
This material was not in poor condition with minor signs of wear and scraping observed.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 5/31/1995

**Current Surveillance Date** 12/9/2004

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** Yes

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Christiaan Sparks

**State** Indiana

**Accreditation Number** 190804103



## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** B

**Type of Material** Miscellaneous Material

**Quantity of Material** Approx. 270 SF

**Material Location**  
Throughout the building

**Material Description**  
Cove base mastic

**Comments**  
Material was exposed in kitchenette under sink. It was not in poor condition.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 5/31/1995

**Current Surveillance Date** 12/9/2004

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage


**Accessible** No

**Potential for Damage** Low

**Removed** No

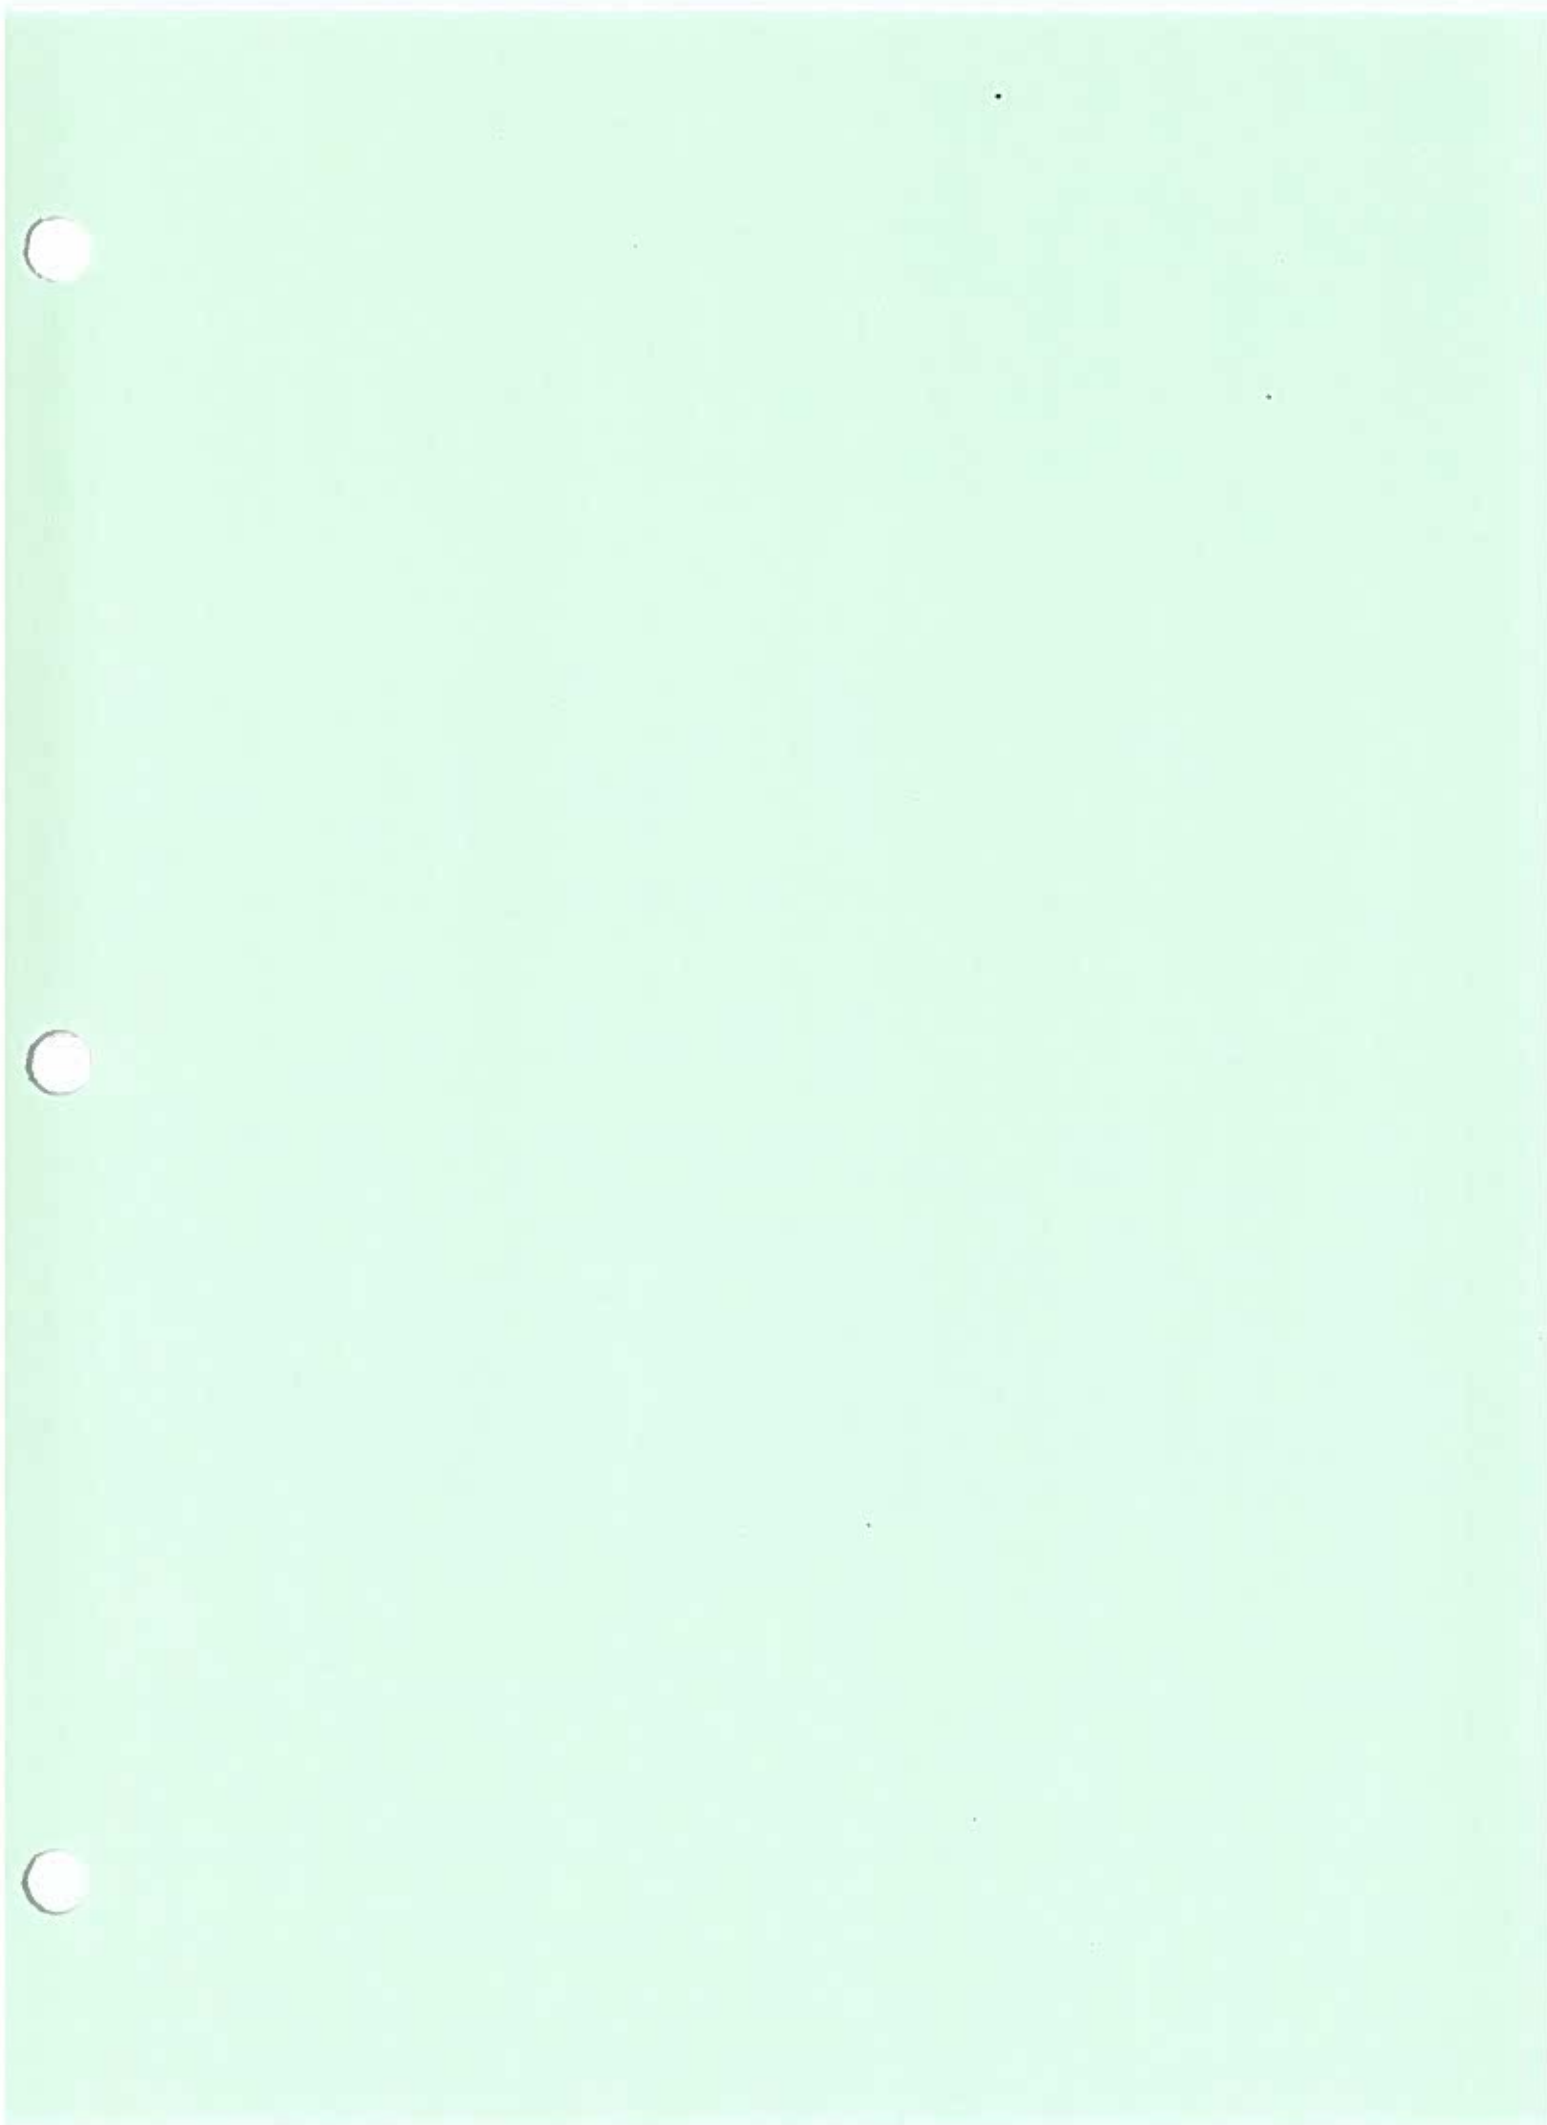
**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Christiaan Sparks

**State** Indiana

**Accreditation Number** 190804103



## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 36 SF

**Material Location**

Between warehouse and office in Service Center

**Material Description**

Fire door

**Comments**

Door shell is intact. Therefore, no material was visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 06/01/1992

**Current Surveillance Date** 12/08/2003

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**



Christiaan Sparks

**State** Indiana

**Accreditation Number** 190804103

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Mastic  
**Comments**  
This material was not visible to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 06/01/1992  
**Current Surveillance Date** 12/08/2003  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Christiaan Sparks

**State** Indiana  
**Accreditation Number** 190804103

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** A

**Type of Material** Miscellaneous Material

**Quantity of Material** Approx. 800 LF

**Material Location**  
Throughout the building

**Material Description**  
Cove base

**Comments**  
This material was not in poor condition with minor signs of wear and scraping observed.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 05/31/1995

**Current Surveillance Date** 12/08/2003

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** Yes

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**


  
\_\_\_\_\_  
Christiaan Sparks

**State** Indiana

**Accreditation Number** 190804103

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Cove base mastic  
**Comments**  
Material was exposed in kitchenette under sink. It was not in poor condition.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 05/31/1995  
**Current Surveillance Date** 12/08/2003  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**   
\_\_\_\_\_  
Christiaan Sparks

**State** Indiana  
**Accreditation Number** 190804103



## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 36 SF

**Material Location**

Between warehouse and office in Service Center

**Material Description**

Fire door

**Comments**

Door shell is intact. Therefore, no material was visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 06/01/1992

**Current Surveillance Date** 06/12/2003

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Christiaan Sparks

**State** Indiana

**Accreditation Number** 190804103



## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 06

**Type of Material** Miscellaneous Material

**Quantity of Material** 196 SF

**Material Location**

Throughout the building

**Material Description**

Mastic

**Comments**

This material was not visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 06/01/1992

**Current Surveillance Date** 06/12/2003

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**



---

Christian Sparks

**State** Indiana

**Accreditation Number** 190804103

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** A

**Type of Material** Miscellaneous Material

**Quantity of Material** Approx. 800 LF

**Material Location**  
Throughout the building

**Material Description**  
Cove base

**Comments**

Material is not in poor condition with minor signs of wear and scraping observed.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 05/31/1995

**Current Surveillance Date** 06/12/2003

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** Yes

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Christiaan Sparks

**State** Indiana

**Accreditation Number** 190804103

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** B

**Type of Material** Miscellaneous Material

**Quantity of Material** Approx. 270 SF

**Material Location**  
Throughout the building

**Material Description**  
Cove base mastic

**Comments**  
Material was exposed in kitchenette under sink. It was not in poor condition.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 05/31/1995

**Current Surveillance Date** 06/12/2003

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**



---

Christiaan Sparks

**State** Indiana

**Accreditation Number** 190804103



## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 05  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 36 SF

**Material Location**  
Between warehouse and office in Service Center

**Material Description**  
Fire door

**Comments**  
Door shell is intact. Therefore, no material was visible to inspect.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 06/01/1992  
**Current Surveillance Date** 12/16/2002  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**



---

Christiaan Sparks

**State** Indiana  
**Accreditation Number** 190804103

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Mastic  
**Comments**  
This material was not visible to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 06/01/1992  
**Current Surveillance Date** 12/16/2002  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**   
\_\_\_\_\_  
Christiaan Sparks

**State** Indiana  
**Accreditation Number** 190804103

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** A  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 800 LF


**Material Location**  
Throughout the building

**Material Description**  
Cove base

**Comments**  
Material is not in poor condition with minor signs of wear and scraping observed.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 05/31/1995  
**Current Surveillance Date** 12/16/2002  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** Yes  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**



Christian Sparks

**State** Indiana  
**Accreditation Number** 190804103

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF

**Material Location**  
Throughout the building

**Material Description**  
Cove base mastic

**Comments**  
Material was exposed in kitchenette under sink. It was not in poor condition.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 05/31/1995  
**Current Surveillance Date** 12/16/2002  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**



Christiaan Sparks

**State** Indiana  
**Accreditation Number** 190804103



## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 36 SF

**Material Location**

Between warehouse and office in Service Center

**Material Description**

Fire door

**Comments**

Fire door is in good condition and no core material is exposed to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 06/01/1992

**Current Surveillance Date** 06/18/2002

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

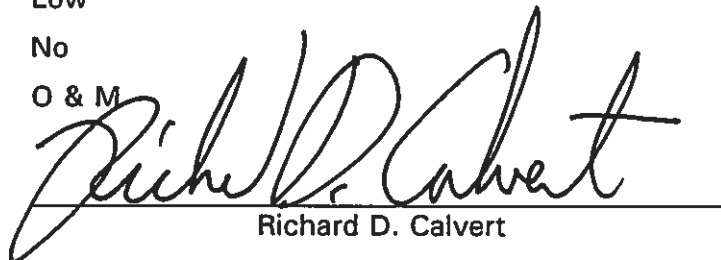
**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**



Richard D. Calvert

**State** Indiana

**Accreditation Number** 315989970

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Mastic  
**Comments**  
Material is not exposed to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 06/01/1992  
**Current Surveillance Date** 06/18/2002  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M  
**Inspector**  
  
Richard D. Calvert  
**State** Indiana  
**Accreditation Number** 315989970

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** A

**Type of Material** Miscellaneous Material

**Quantity of Material** Approx. 800 LF

**Material Location**  
Throughout the building

**Material Description**  
Cove base

**Comments**

Material is not in poor condition with minor signs of wear and scraping observed.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 05/31/1995

**Current Surveillance Date** 06/18/2002

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

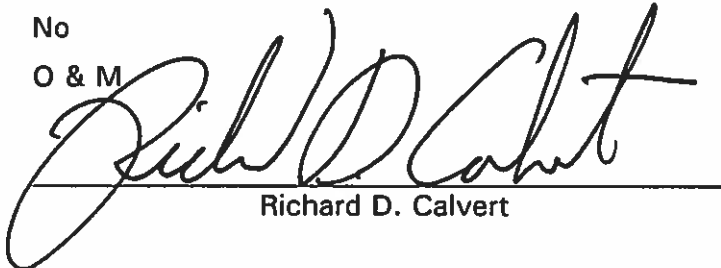
**Accessible** Yes

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**



Richard D. Calvert

**State** Indiana

**Accreditation Number** 315989970

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Cove base mastic  
**Comments**  
No material is exposed to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 05/31/1995  
**Current Surveillance Date** 06/18/2002  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M  
**Inspector**  
  
Richard D. Calvert  
**State** Indiana  
**Accreditation Number** 315989970



## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 36 SF

**Material Location**

Between warehouse and office in Service Center

**Material Description**

Fire door

**Comments**

Fire door is in good condition and no core material is exposed to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 06/01/1992

**Current Surveillance Date** 12/10/2002

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

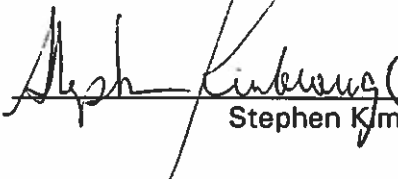
**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Stephen Kimbrough

**State** Indiana

**Accreditation Number** 191914122

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Mastic  
**Comments**  
Material is not exposed to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 06/01/1992  
**Current Surveillance Date** 12/10/2002  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M  
**Inspector**   
Stephen Kimbrough  
**State** Indiana  
**Accreditation Number** 191914122

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** A

**Type of Material** Miscellaneous Material

**Quantity of Material** Approx. 800 LF

**Material Location**  
Throughout the building

**Material Description**  
Cove base

**Comments**

Material is not in poor condition with minor signs of wear and scraping observed.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 05/31/1995

**Current Surveillance Date** 12/10/2002

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

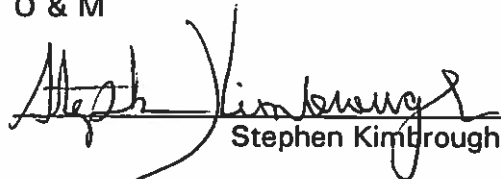
**Accessible** Yes

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Stephen Kimbrough

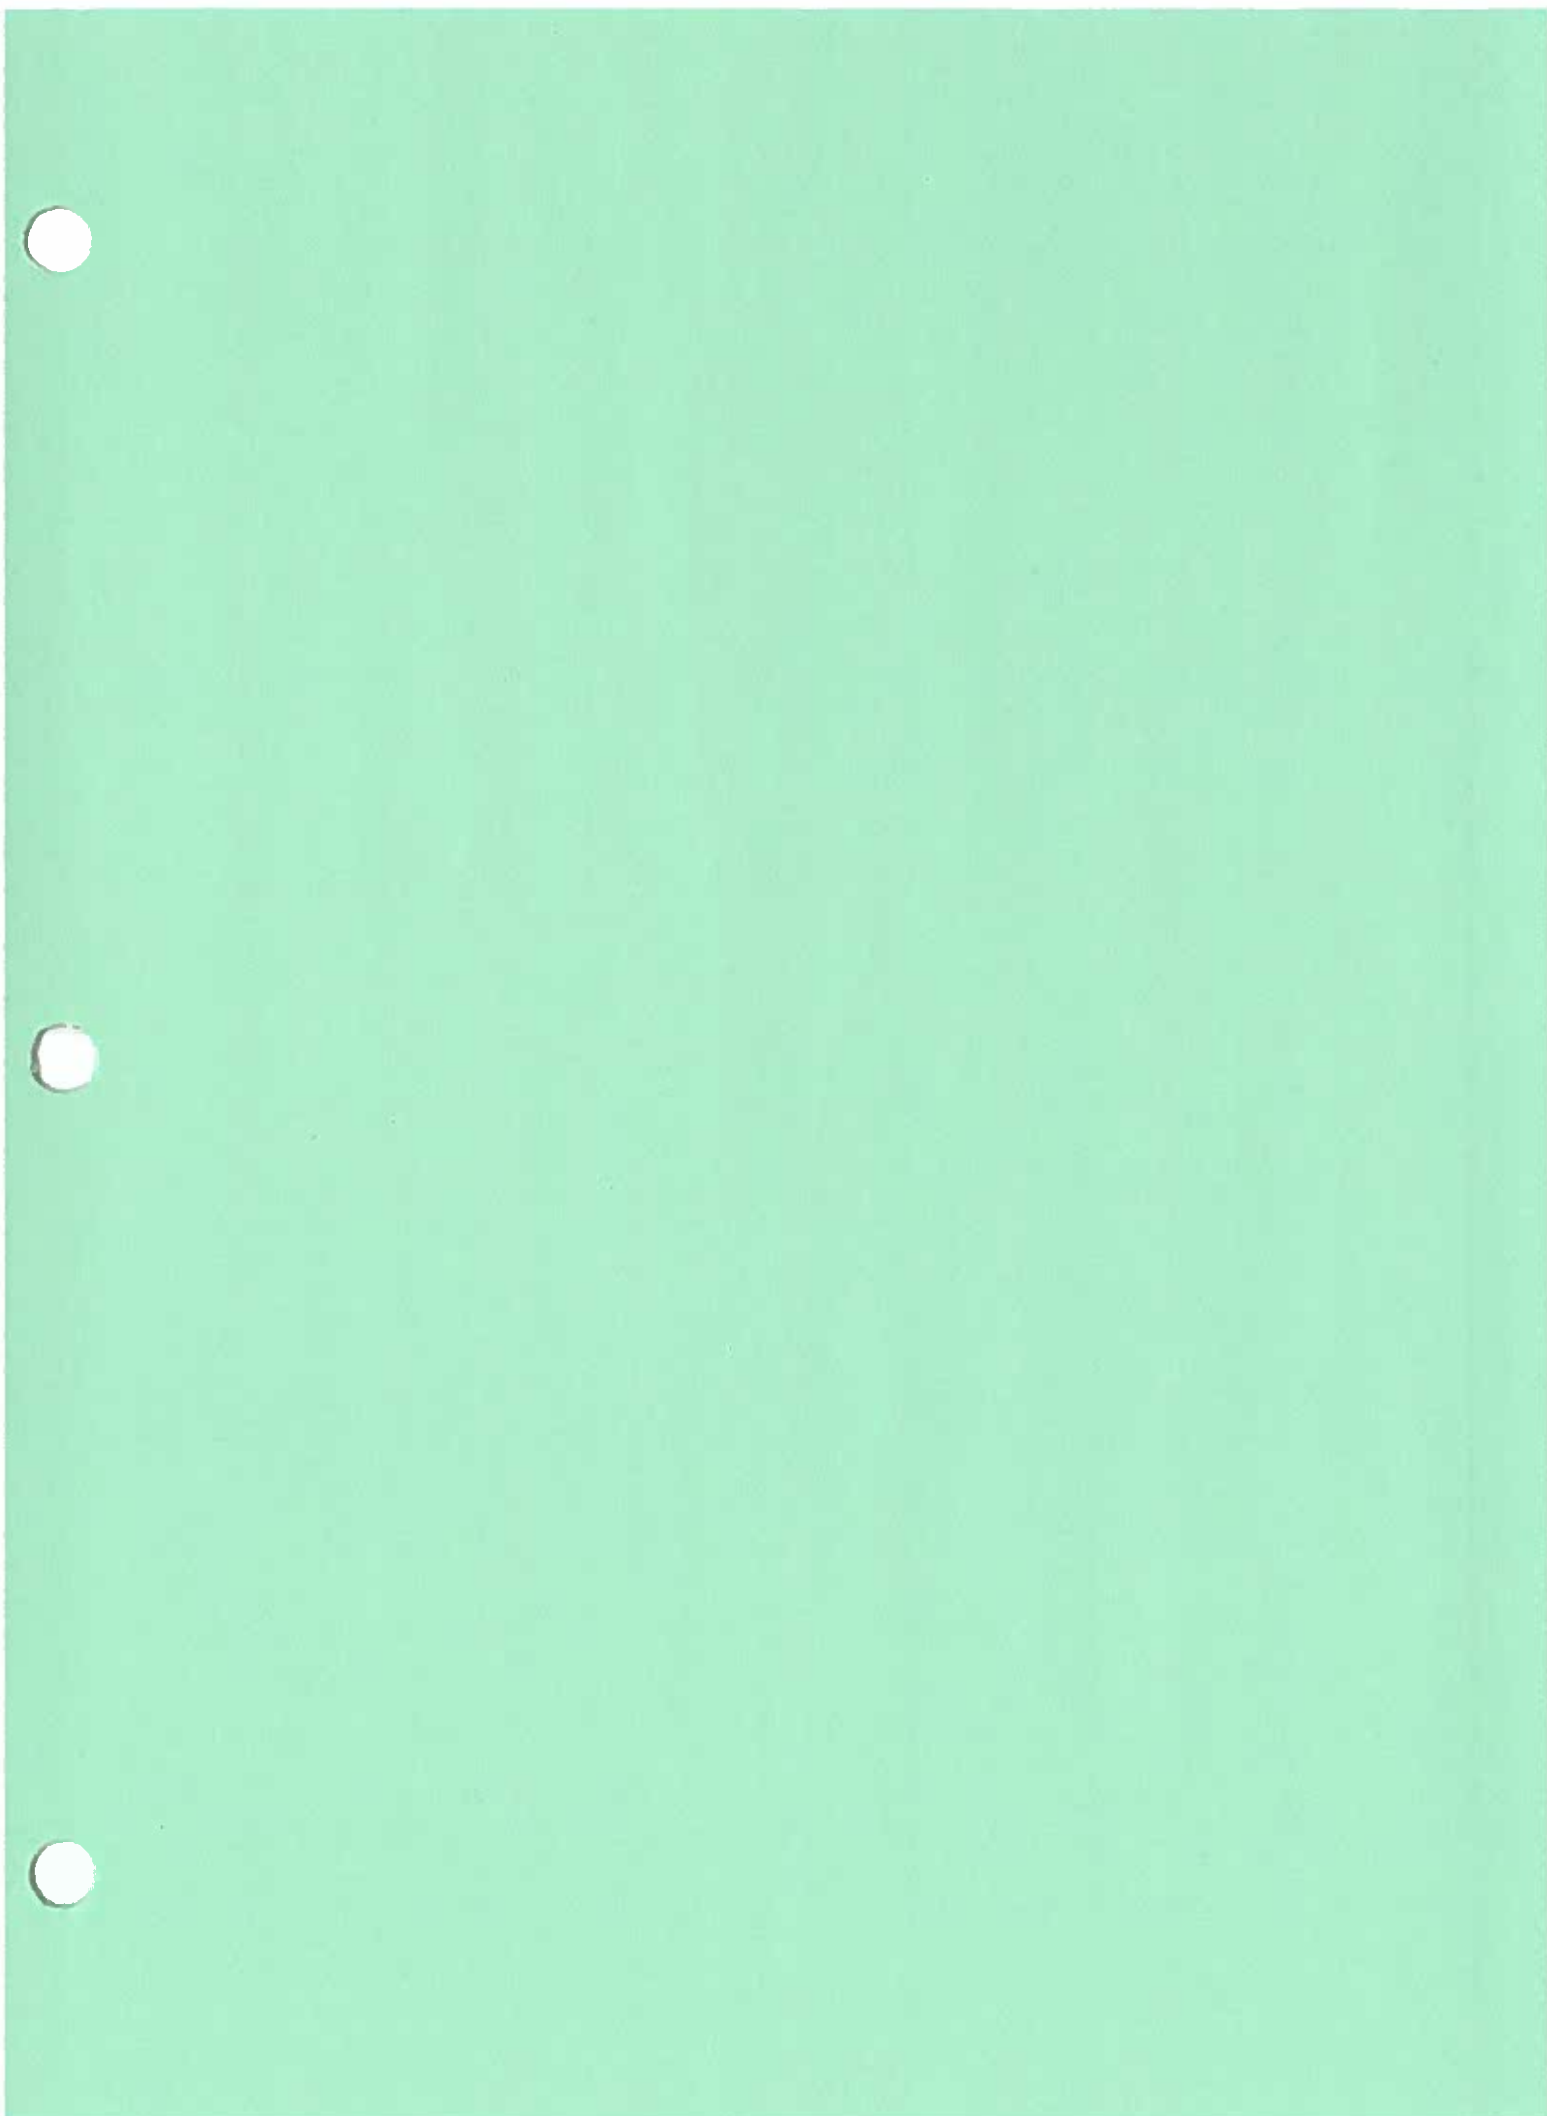
**State** Indiana

**Accreditation Number** 191914122



## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Cove base mastic  
**Comments**  
No material is exposed to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 05/31/1995  
**Current Surveillance Date** 12/10/2002  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M  
**Inspector**   
Stephen Kimbrough  
**State** Indiana  
**Accreditation Number** 191914122



## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 36 SF

**Material Location**  
Between warehouse and office in Service Center

**Material Description**  
Fire door

**Comments**  
Fire door is in good condition and no core material is exposed to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 06/01/1992

**Current Surveillance Date** 01/09/2001

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**



Patrick E. Wilson


**State** Indiana

**Accreditation Number** 190824065

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Mastic  
**Comments**  
Material was not exposed to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 06/01/1992  
**Current Surveillance Date** 01/09/2001  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**



Patrick E. Wilson

**State** Indiana  
**Accreditation Number** 190824065

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** A  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 800 LF  
**Material Location**  
Throughout the building  
**Material Description**  
Cove base  
**Comments**  
Material is in good condition with minor signs of wear.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 05/31/1995  
**Current Surveillance Date** 01/09/2001  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** Yes  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**




Patrick E. Wilson

**State** Indiana  
**Accreditation Number** 190824065

## PERIODIC SURVEILLANCE REPORT

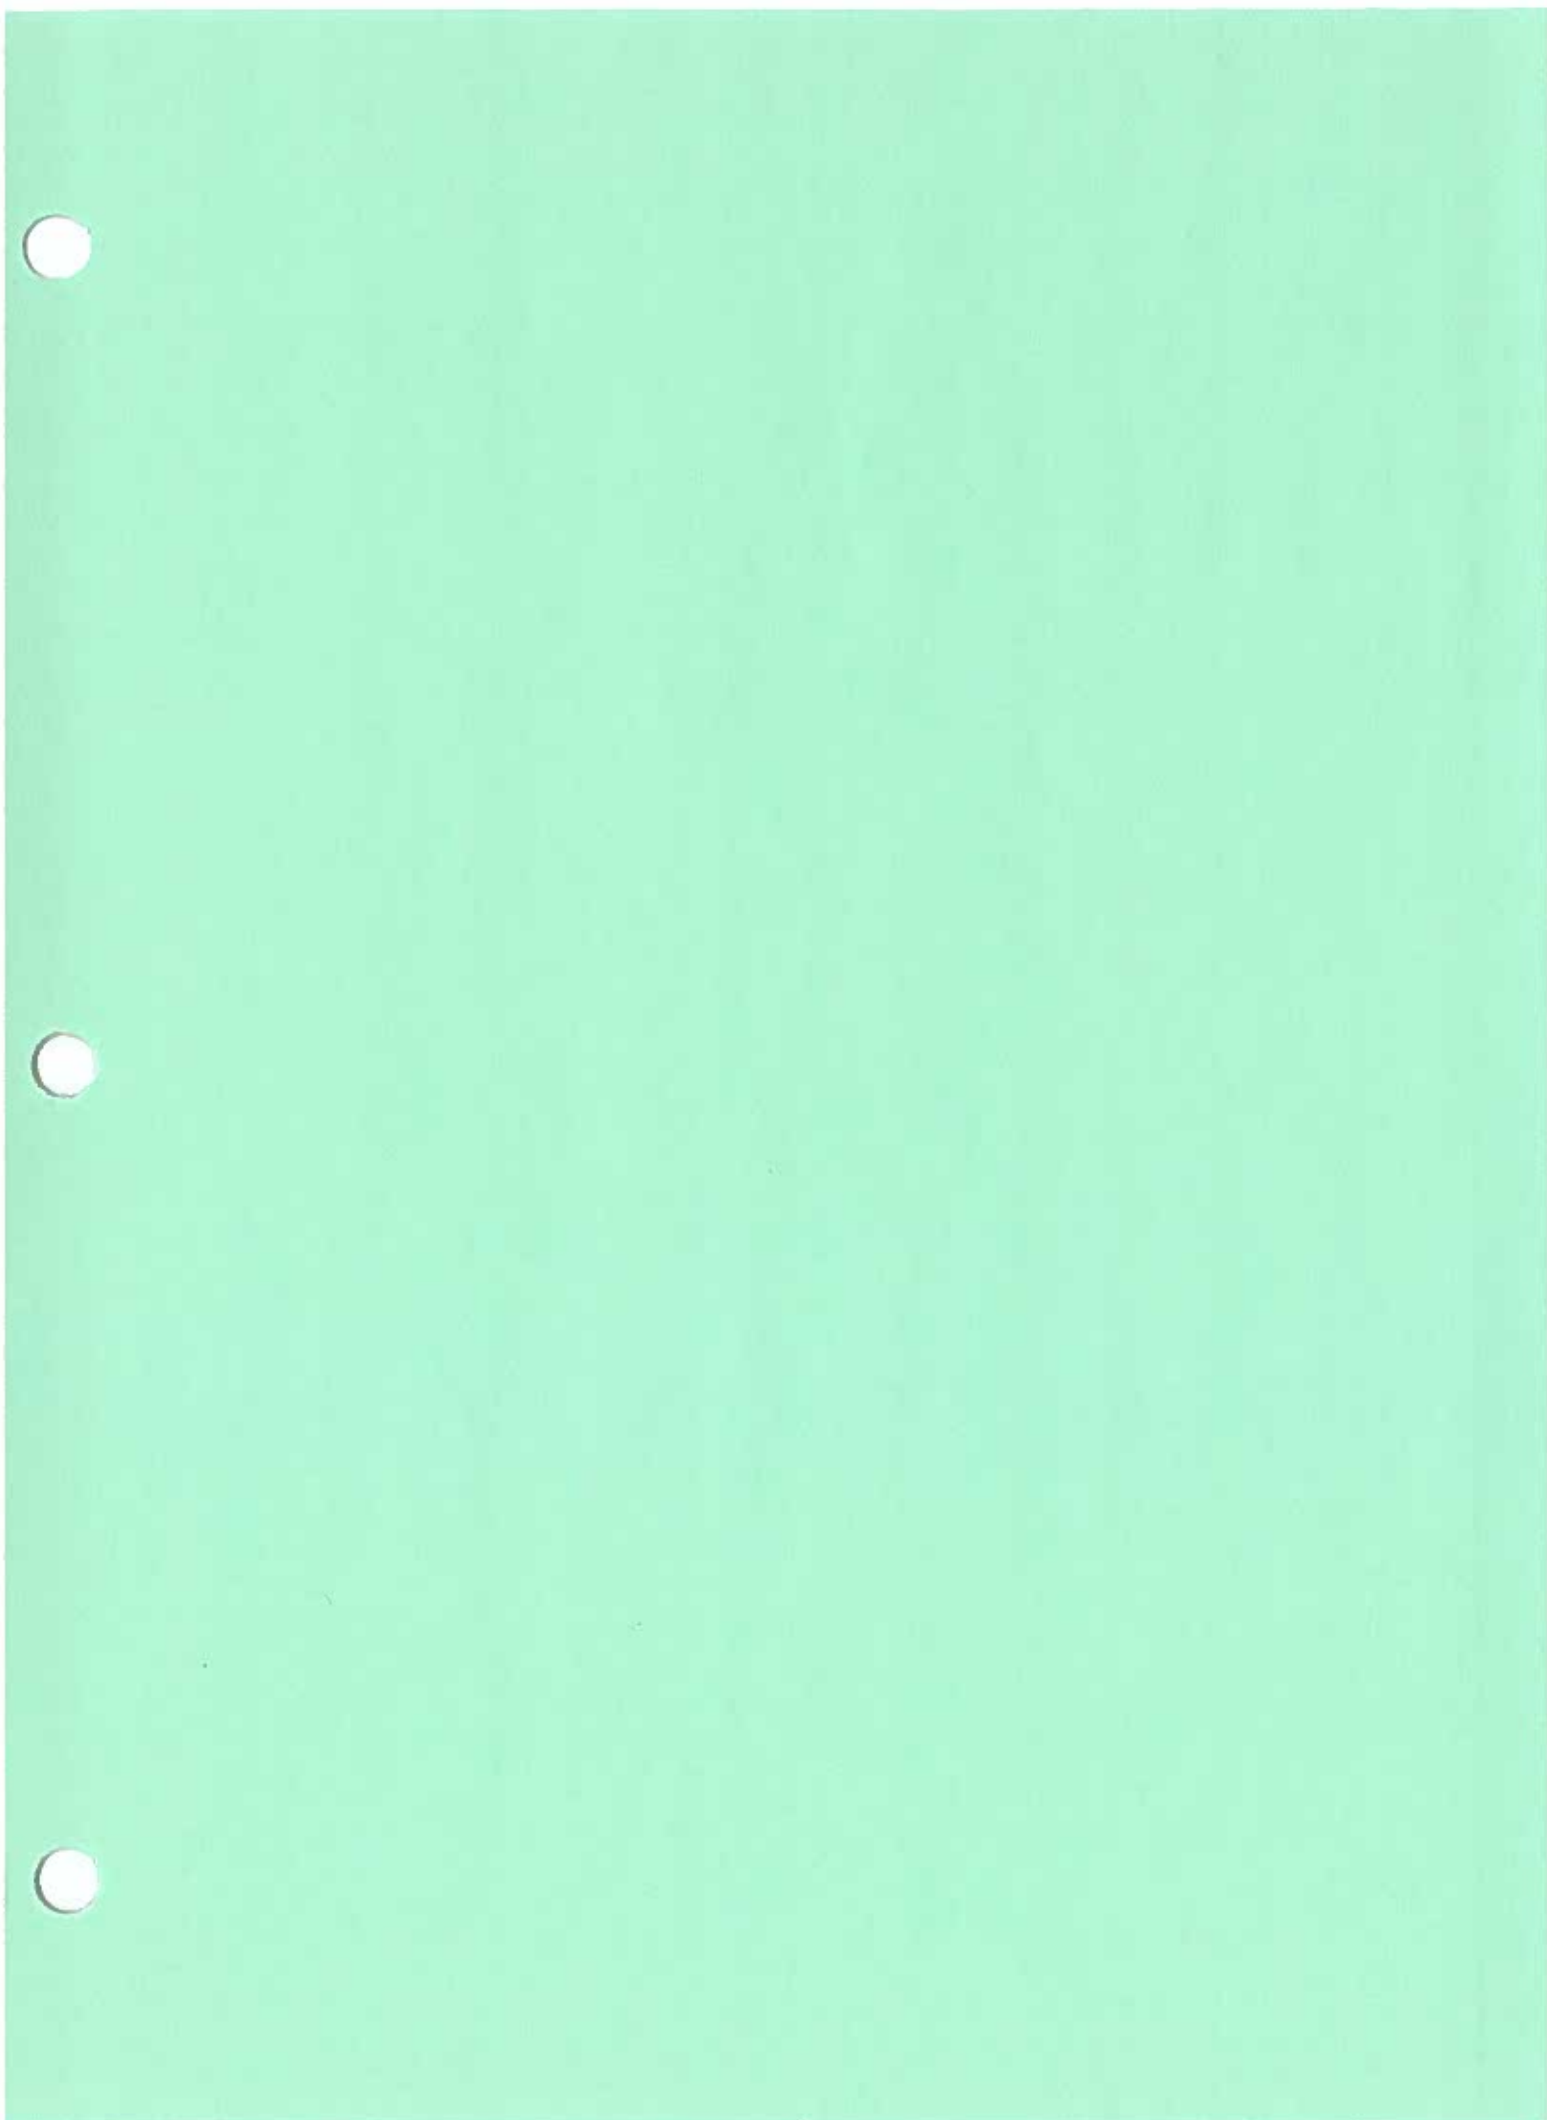
**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Cove base mastic  
**Comments**  
No material is exposed to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 05/31/1995  
**Current Surveillance Date** 01/09/2001  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**



Patrick E. Wilson

**State** Indiana  
**Accreditation Number** 190824065



## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 36 SF

**Material Location**

Between Warehouse and Office in Service Center

**Material Description**

Fire Door

**Comments**

Material is assumed to be in good condition.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 06/01/1992

**Current Surveillance Date** 12/08/1999

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage


**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
Matthew Wallace

**State** Indiana

**Accreditation Number** 191219020



## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout building  
**Material Description**  
Mastic  
**Comments**  
Material is not exposed to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 06/01/1992  
**Current Surveillance Date** 12/08/1999  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M


**Inspector**   
Matthew Wallace

**State** Indiana  
**Accreditation Number** 191219020

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** A  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Unquantified LF  
**Material Location**  
Throughout building  
**Material Description**  
Cove Base  
**Comments**  
Material is in good condition.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 05/31/1995  
**Current Surveillance Date** 12/08/1999  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** Yes  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
Matthew Wallace

**State** Indiana  
**Accreditation Number** 191219020

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 36 SF

**Material Location**  
Between Warehouse and Office in Service Center

**Material Description**  
Fire Door

**Comments**  
Fire door is in good condition and no core material is exposed to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 06/01/1992

**Current Surveillance Date** 06/29/2000

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana

**Accreditation Number** 191523030

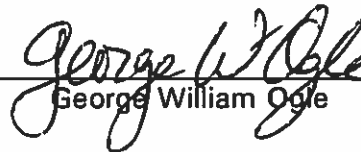
## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout building  
**Material Description**  
Mastic  
**Comments**  
Material was not exposed to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 06/01/1992  
**Current Surveillance Date** 06/29/2000  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M  
  
**Inspector** \_\_\_\_\_  
  
George William Ogle  
  
**State** Indiana  
**Accreditation Number** 191523030

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** A  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Unquantified LF  
**Material Location**  
Throughout building  
**Material Description**  
Cove Base  
**Comments**  
Material is in good condition.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 05/31/1995  
**Current Surveillance Date** 06/29/2000  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** Yes  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana  
**Accreditation Number** 191523030

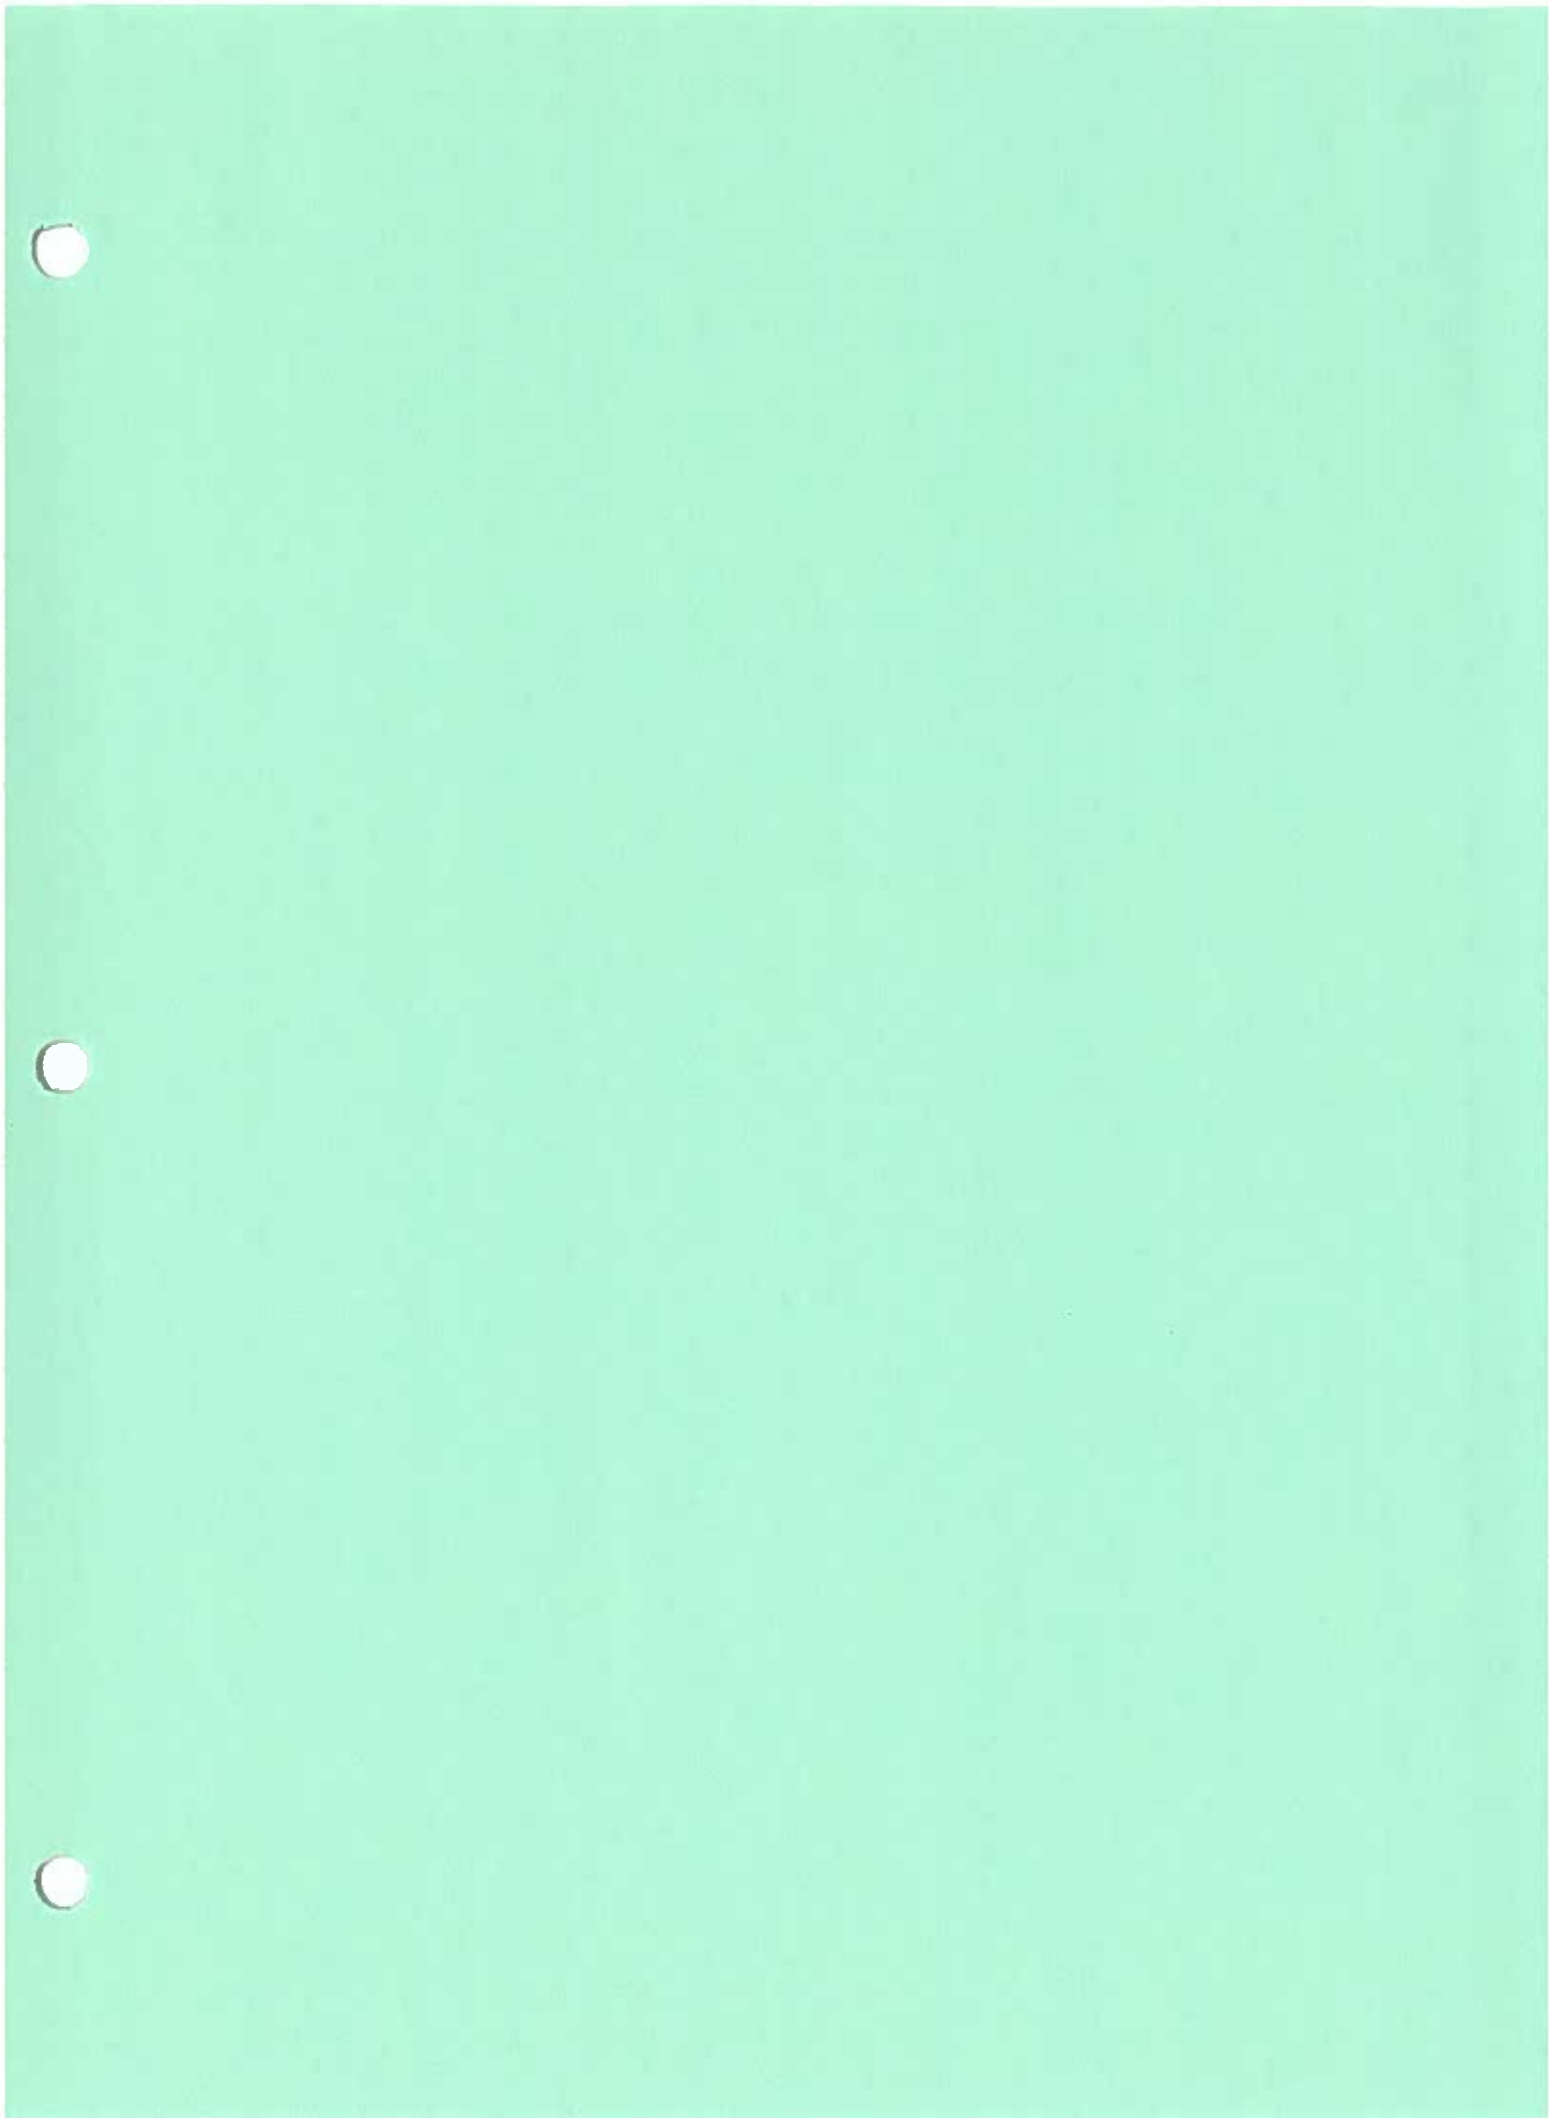
## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Unquantified LF  
**Material Location**  
Throughout building  
**Material Description**  
Cove Base Mastic  
**Comments**  
No material is exposed to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 05/31/1995  
**Current Surveillance Date** 06/29/2000  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogilvie


**State** Indiana  
**Accreditation Number** 191523030



## PERIODIC SURVEILLANCE REPORT

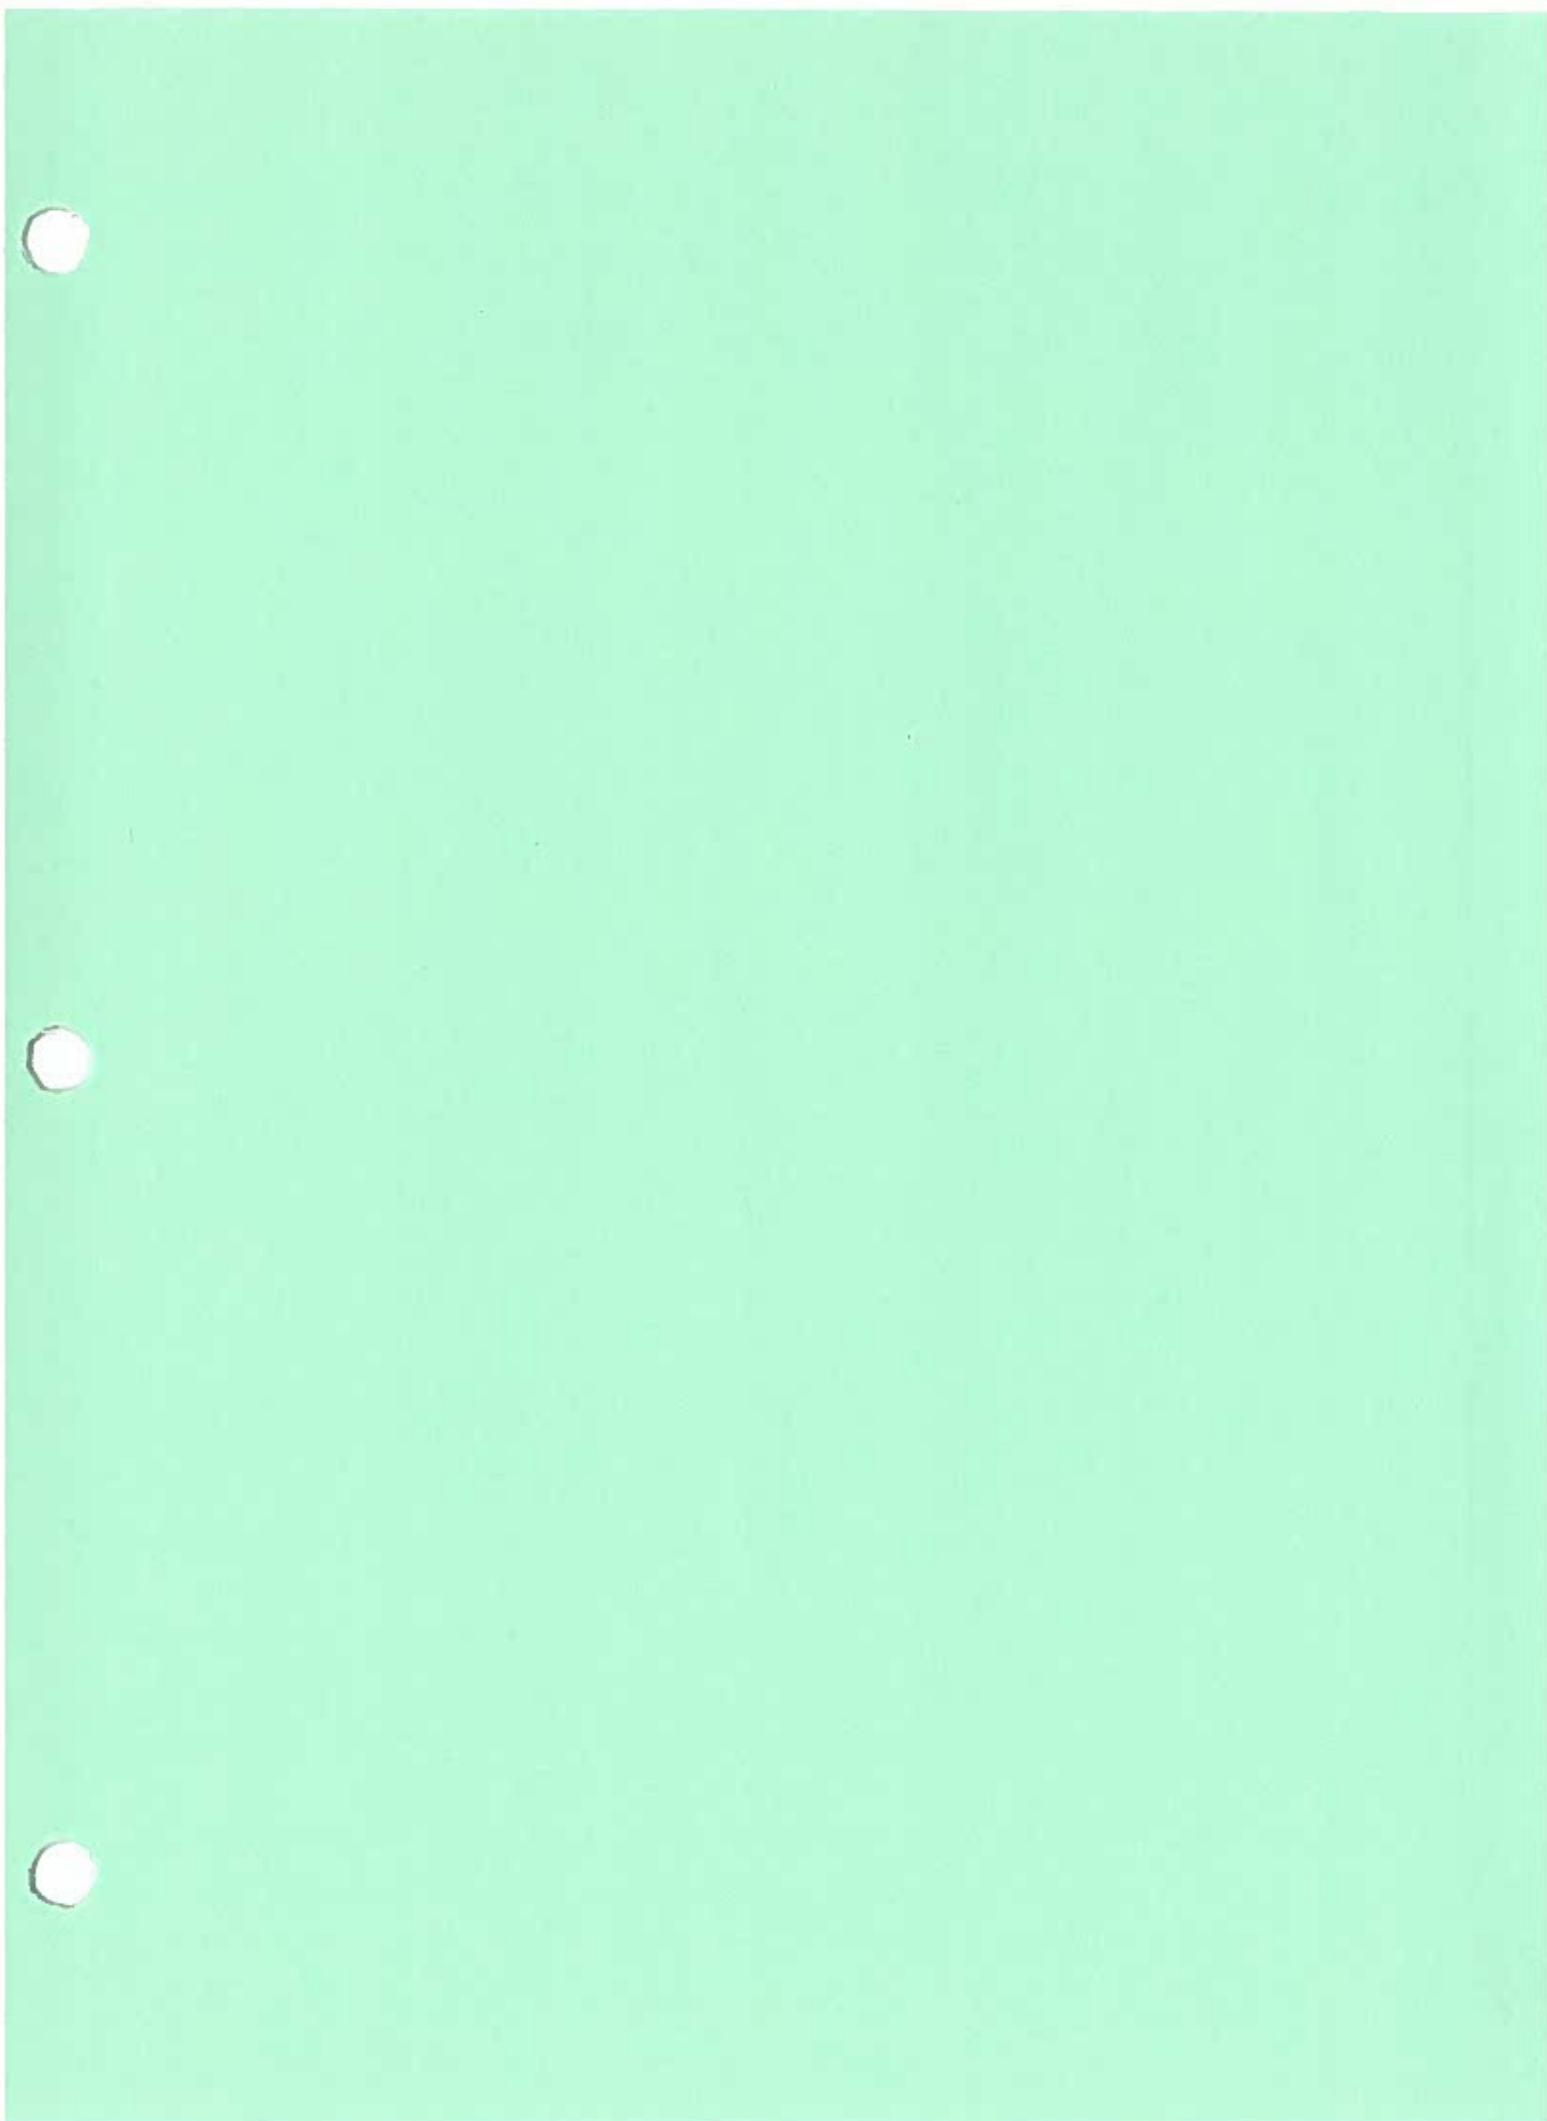
**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Unquantified LF  
**Material Location**  
Throughout building  
**Material Description**  
Cove Base Mastic  
**Comments**  
Material is not exposed to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 05/31/1995  
**Current Surveillance Date** 12/08/1999  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
Matthew Wallace

**State** Indiana  
**Accreditation Number** 191219020





## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 36 SF

**Material Location**

Between Warehouse and Office in Service Center

**Material Description**

Fire Door

**Comments**

Material is assumed to be in good condition.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 06/01/1992

**Current Surveillance Date** 06/24/1999

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
Matthew Wallace

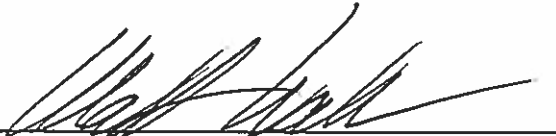
**State** Indiana

**Accreditation Number** 191219020

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout building  
**Material Description**  
Mastic  
**Comments**  
Material is not exposed and is assumed to be in good condition.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 06/01/1992  
**Current Surveillance Date** 06/24/1999  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
Matthew Wallace

**State** Indiana  
**Accreditation Number** 191219020

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** A  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Unquantified LF  
**Material Location**  
Throughout building  
**Material Description**  
Cove Base  
**Comments**  
Material is in good condition.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 05/31/1995  
**Current Surveillance Date** 06/24/1999  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** Yes  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M


**Inspector**   
Matthew Wallace

**State** Indiana  
**Accreditation Number** 191219020

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Unquantified LF  
**Material Location**  
Throughout building  
**Material Description**  
Cove Base Mastic  
**Comments**  
Material is not exposed and is assumed to be in good condition.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 05/31/1995  
**Current Surveillance Date** 06/24/1999  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
Matthew Wallace

**State** Indiana  
**Accreditation Number** 191219020



## PERIODIC SURVEILLANCE REPORT

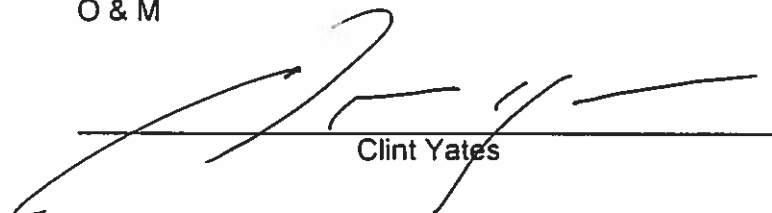
**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 05  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 36 SF  
**Material Location**  
Between Warehouse and Office in Service Center

**Material Description**  
Fire Door

**Comments**  
Material is assumed to be in good condition.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 06/01/1992  
**Current Surveillance Date** 12/29/1998  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**



Clint Yates

**State** Indiana  
**Accreditation Number** 193804035

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 06

**Type of Material** Miscellaneous Material

**Quantity of Material** 196 SF

**Material Location**  
Throughout building

**Material Description**  
Mastic

**Comments**

Material is not exposed and is assumed to be in good condition.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 06/01/1992

**Current Surveillance Date** 12/29/1998

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

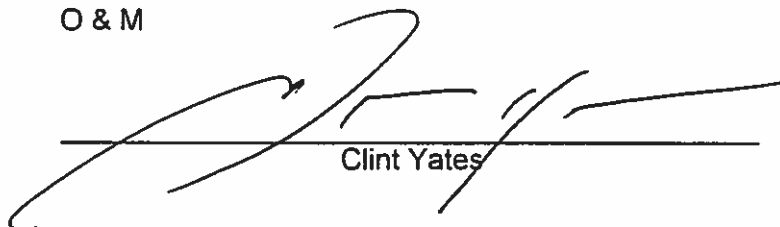
**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**



Clint Yates

**State** Indiana

**Accreditation Number** 193804035



## PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Service Center/Garage

HA# A

Type of Material Miscellaneous Material

Quantity of Material Unquantified LF

Material Location  
Throughout building

Material Description  
Cove Base

Comments  
Material is in good condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 12/29/1998

Current Assessment Rating NR Not Required

Cause of Damage No Damage

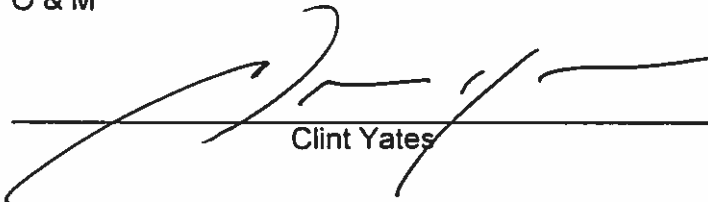
Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

  
Clint Yates

State Indiana

Accreditation Number 193804035

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** B

**Type of Material** Miscellaneous Material

**Quantity of Material** Unquantified LF

**Material Location**  
Throughout building

**Material Description**  
Cove Base Mastic

**Comments**

Material is not exposed and is assumed to be in good condition.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 05/31/1995

**Current Surveillance Date** 12/29/1998

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

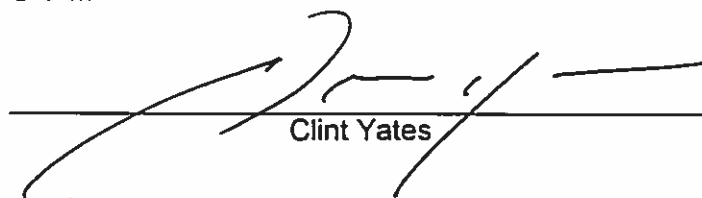
**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
Clint Yates

**State** Indiana

**Accreditation Number** 193804035

## PERIODIC SURVEILLANCE REPORT

LEA Name                    Greater Clark County Schools  
Building Name            Service Center/Garage  
HA#                         05  
Type of Material        Miscellaneous Material  
Quantity of Material    36       SF

Material Location  
                              Between Warehouse and Office in Service Center

Material Description  
                              Fire Door

Comments  
                              Material is assumed to be in good condition.

Does Material Contain Asbestos?    Assumed  
Is it Friable?                            No  
Original Inspection Date                6/ 1/92  
Current Surveillance Date                1/14/98  
Current Assessment Rating                NR   Not Required  
Cause of Damage                         No Damage  
Accessible                                 No  
Potential for Damage                        Low  
Removed                                    No  
Planned Response Action                 O & M

Inspector



---

Karen Foxx

State                                        Indiana  
Accreditation Number                    191129014

## PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Service Center/Garage

HA# 06

Type of Material Miscellaneous Material

Quantity of Material 196 SF

Material Location

Throughout building

Material Description

Mastic

Comments

Material is not exposed and is assumed to be in good condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/ 1/92

Current Surveillance Date 1/14/98

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



---

Karen Foxx

State Indiana

Accreditation Number 191129014

## PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools  
Building Name Service Center/Garage  
HA# A  
Type of Material Miscellaneous Material  
Quantity of Material LF  
Material Location  
Throughout building  
Material Description  
Cove Base  
Comments  
Material is in good condition.  
Does Material Contain Asbestos? Assumed  
Is it Friable? No  
Original Inspection Date 5/31/95  
Current Surveillance Date 1/14/98  
Current Assessment Rating NR Not Required  
Cause of Damage No Damage  
Accessible Yes  
Potential for Damage Low  
Removed No  
Planned Response Action O & M

Inspector



---

Karen Foxx

State Indiana  
Accreditation Number 191129014

## PERIODIC SURVEILLANCE REPORT

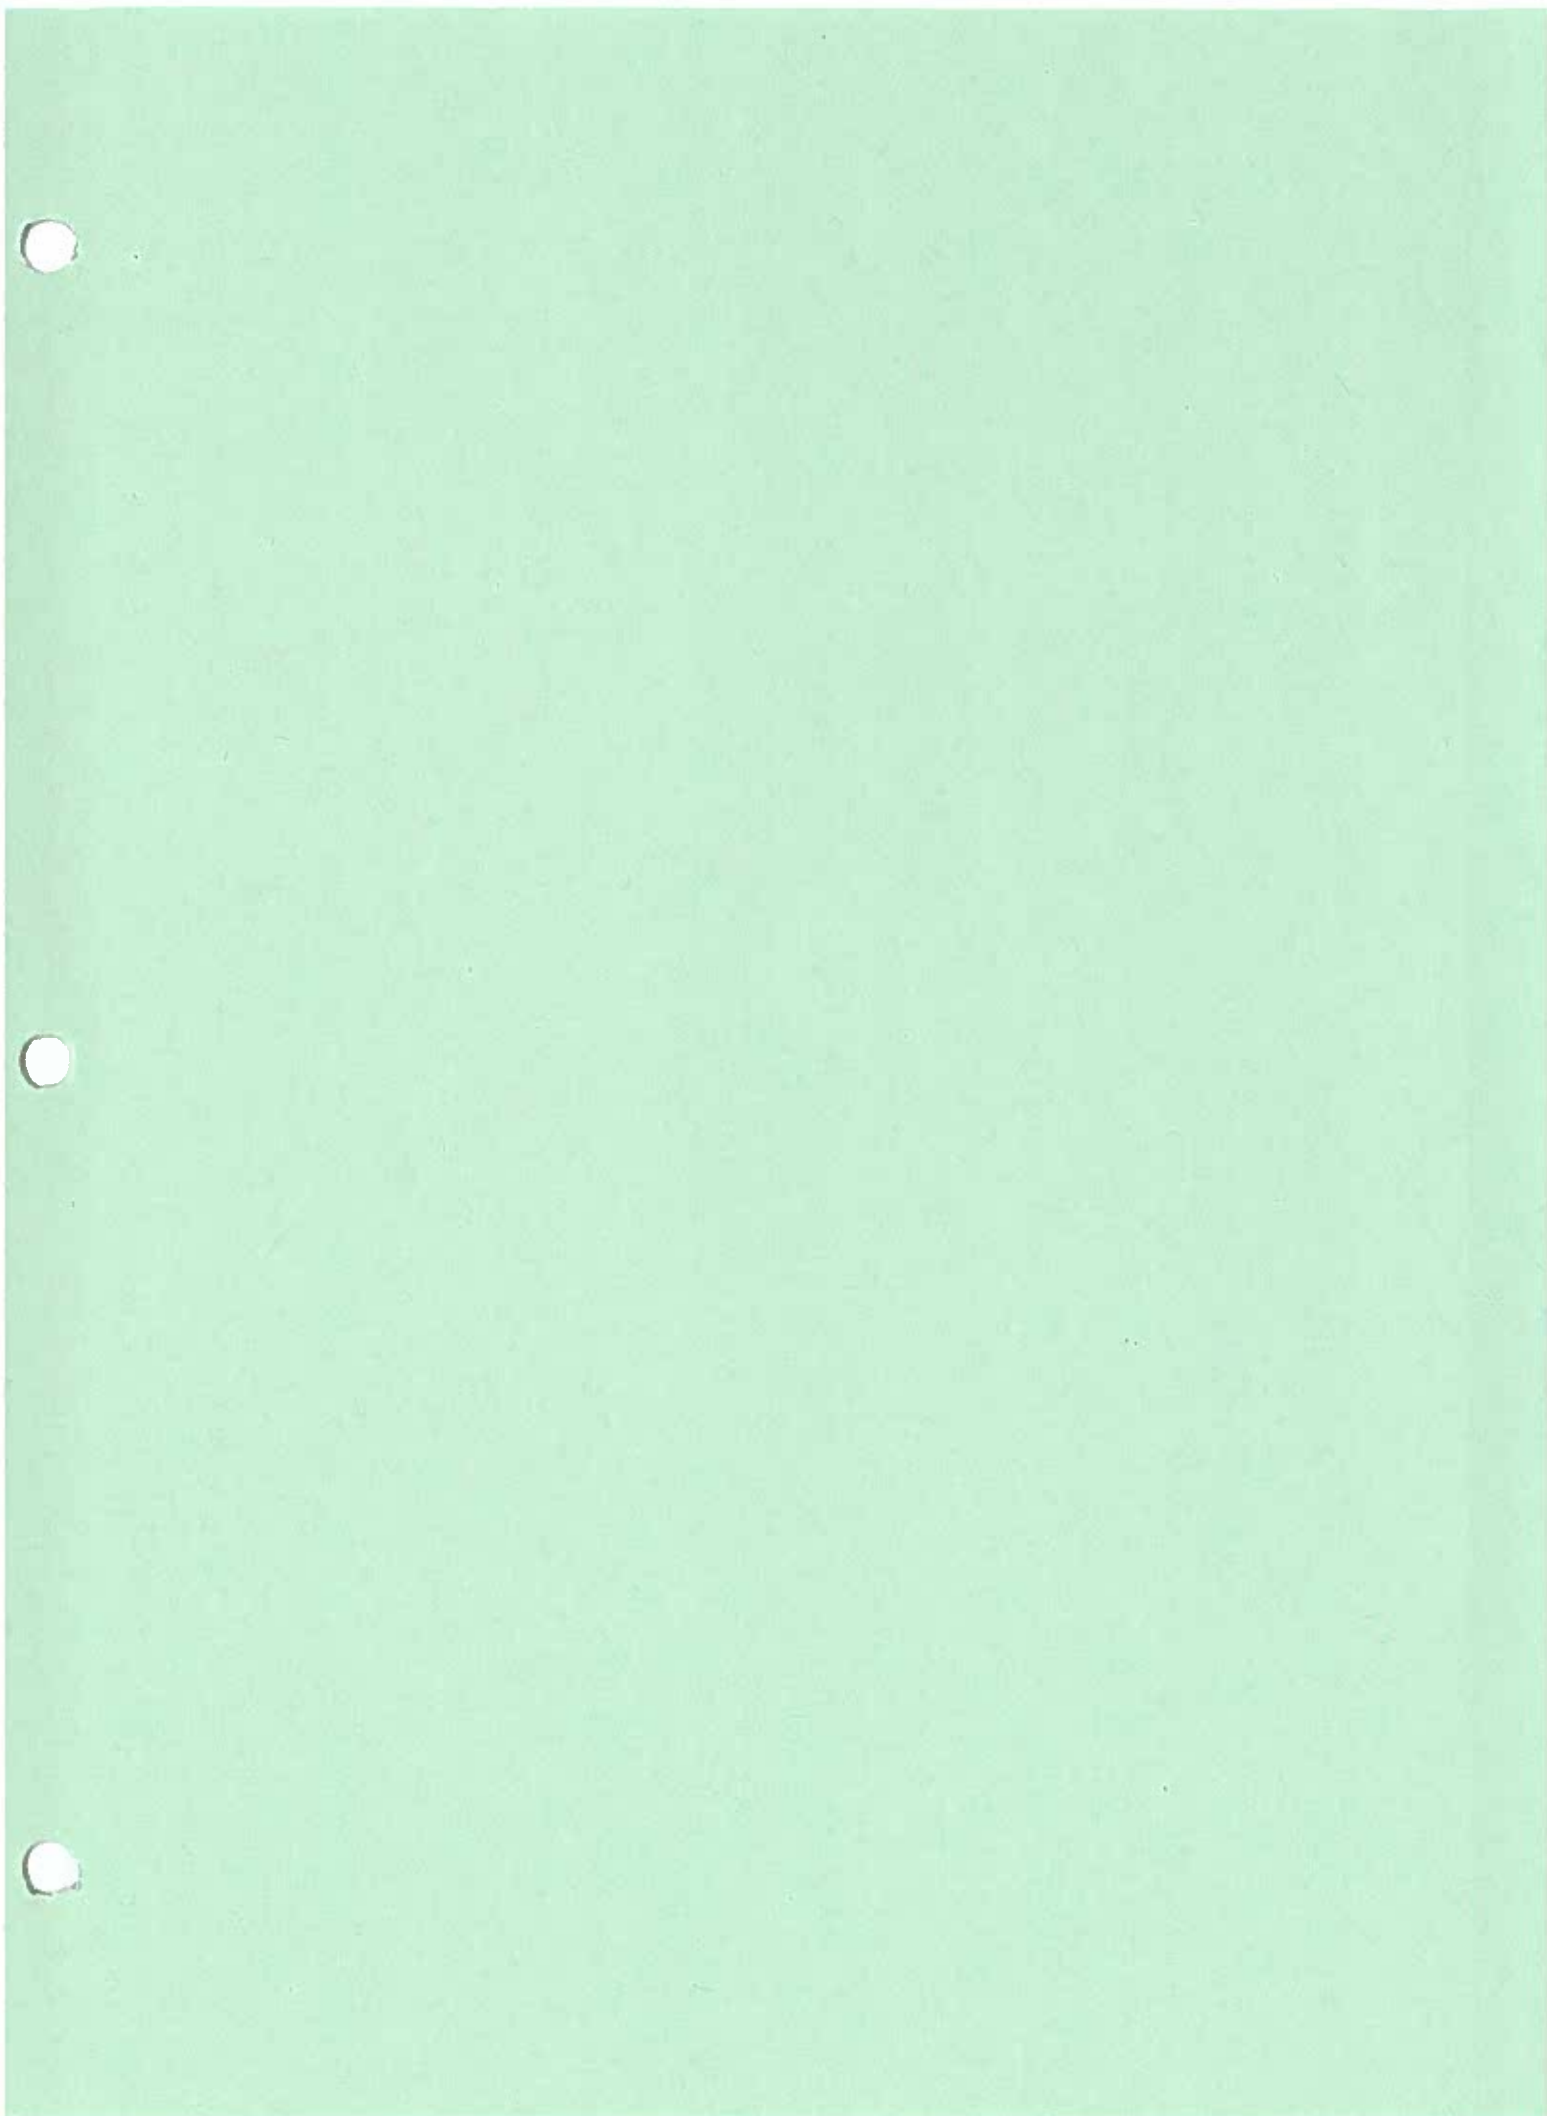
LEA Name Greater Clark County Schools  
Building Name Service Center/Garage  
HA# B  
Type of Material Miscellaneous Material  
Quantity of Material LF  
Material Location Throughout building  
Material Description Cove Base Mastic  
Comments Material is not exposed and is assumed to be in good condition.  
Does Material Contain Asbestos? Assumed  
Is it Friable? No  
Original Inspection Date 5/31/95  
Current Surveillance Date 1/14/98  
Current Assessment Rating NR Not Required  
Cause of Damage No Damage  
Accessible No  
Potential for Damage Low  
Removed No  
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana  
Accreditation Number 191129014



## PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools  
Building Name Service Center/Garage  
HA# 5  
Type of Material Miscellaneous Material  
Quantity of Material 36 SF

Material Location  
Between Warehouse and Office in Service Center

Material Description  
Fire Door

Comments  
Material is assumed to be in good condition.

Does Material Contain Asbestos? Assumed  
Is it Friable? No  
Original Inspection Date 6/ 1/92  
Current Surveillance Date 7/ 3/97  
Current Assessment Rating NR Not Required  
Cause of Damage No Damage  
Accessible No  
Potential for Damage Low  
Removed No  
Planned Response Action O & M

Inspector

  
\_\_\_\_\_  
Karen Foxx

State Indiana  
Accreditation Number 191129014



## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 6

**Type of Material** Miscellaneous Material

**Quantity of Material** 196 SF

**Material Location**  
Throughout building

**Material Description**  
Mastic

**Comments**

Material is not exposed and is assumed to be in good condition.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/ 1/92

**Current Surveillance Date** 7/ 3/97

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Karen Foxx


**State** Indiana

**Accreditation Number** 191129014

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** A  
**Type of Material** Miscellaneous Material  
**Quantity of Material** LF  
**Material Location**  
Throughout building  
**Material Description**  
Cove Base  
**Comments**  
Material is in good condition.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/95  
**Current Surveillance Date** 7/ 3/97  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** Yes  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**



Karen Foxx

**State** Indiana  
**Accreditation Number** 191129014

# PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** B

**Type of Material** Miscellaneous Material

**Quantity of Material** LF

**Material Location**  
Throughout building

**Material Description**  
Cove Base Mastic

**Comments**  
Material is not exposed and is assumed to be in good condition.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 5/31/95

**Current Surveillance Date** 7/3/97

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage


**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

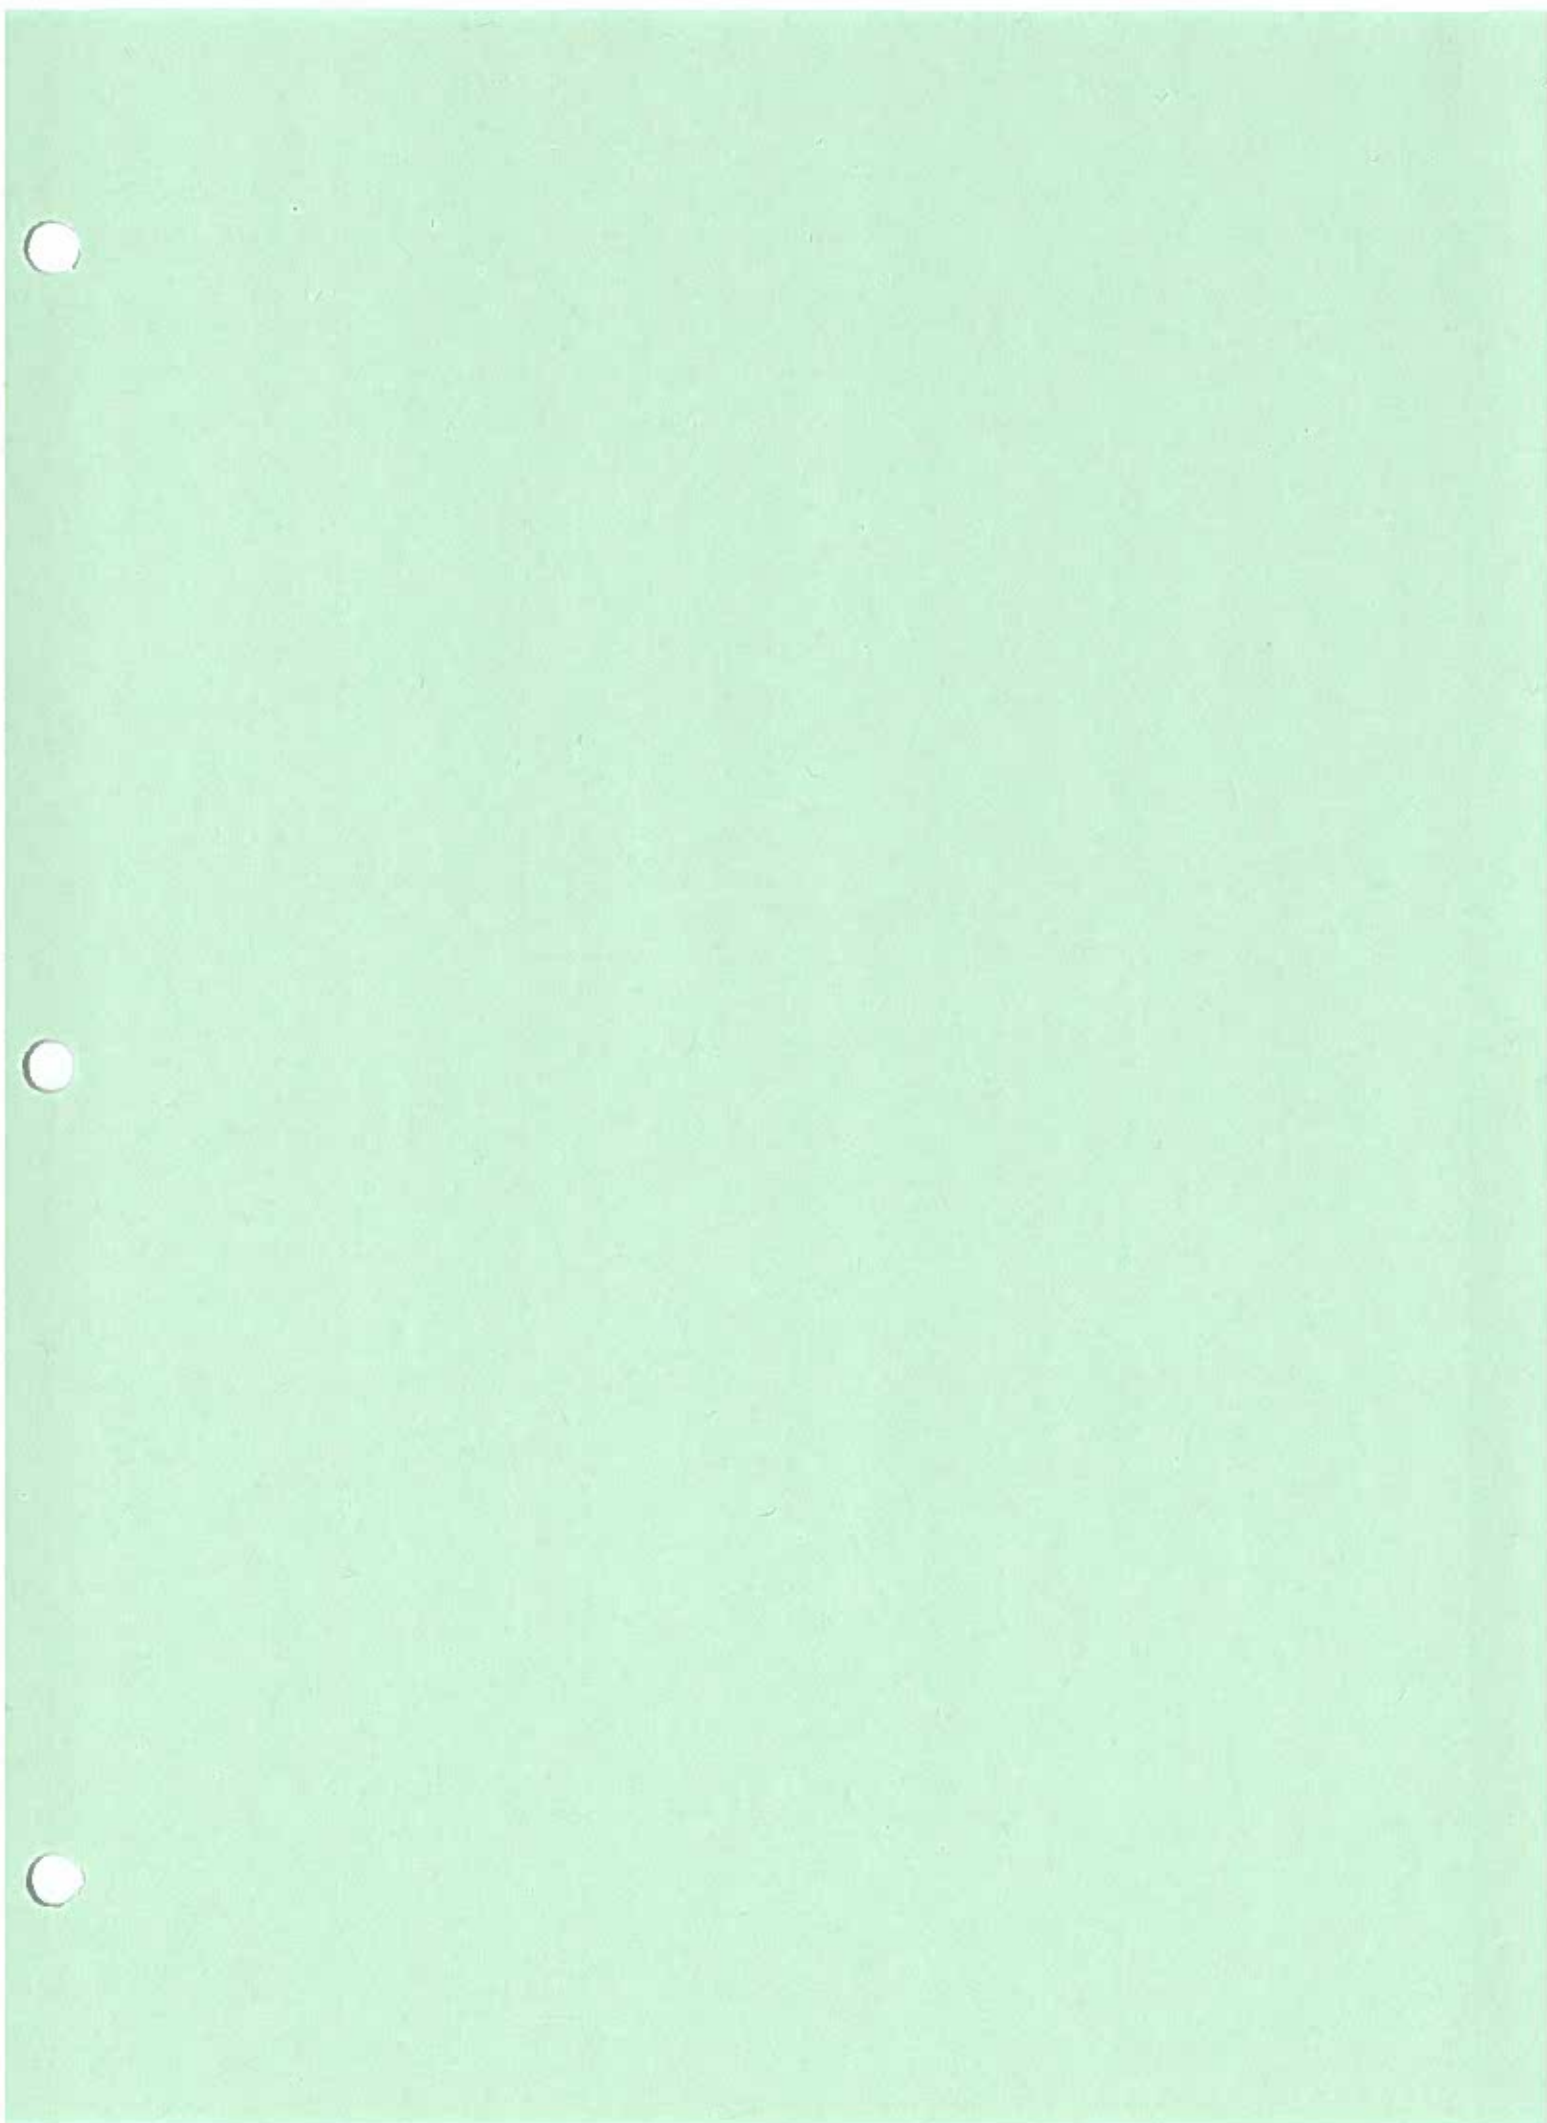
**Inspector**



Karen Foxx

**State** Indiana

**Accreditation Number** 191129014

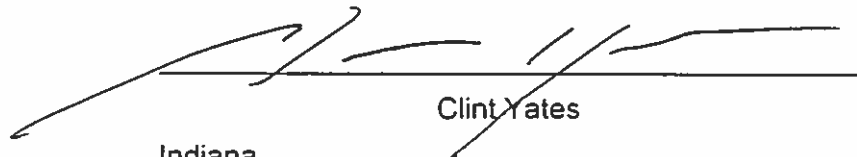


## PERIODIC SURVEILLANCE REPORT

LEA Name                    Greater Clark County Schools  
Building Name             Service Center/Garage  
HA#                         5  
Type of Material           Miscellaneous Material  
Quantity of Material      36       SF  
Material Location  
                                Between Warehouse and Office in Service Center  
Material Description  
                                Fire Door  
Comments  
                                Material is assumed to be asbestos containing. No change.

Does Material Contain Asbestos?    Assumed  
Is it Friable?                         No  
Original Inspection Date             6/ 1/92  
Current Surveillance Date             12/16/96  
Current Assessment Rating          NR Not Required  
Cause of Damage                      No Damage  
Accessible                              No  
Potential for Damage                 Low  
Removed                                 No  
Planned Response Action             O & M

Inspector



Clint Yates

State

Indiana

Accreditation Number

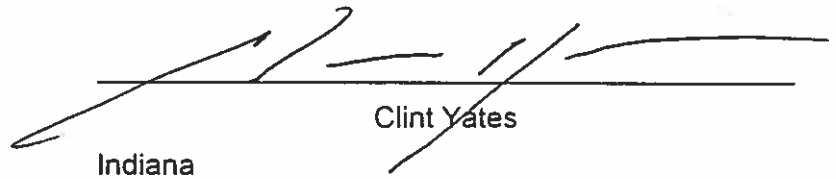
193804035

## PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools  
Building Name Service Center/Garage  
HA# 6  
Type of Material Miscellaneous Material  
Quantity of Material 196 SF  
Material Location Throughout building  
Material Description Mastic  
Comments Material is in good condition. Tile is negative. No change.

Does Material Contain Asbestos? Assumed  
Is it Friable? No  
Original Inspection Date 6/ 1/92  
Current Surveillance Date 12/16/96  
Current Assessment Rating NR Not Required  
Cause of Damage No Damage  
Accessible No  
Potential for Damage Low  
Removed No  
Planned Response Action O & M

Inspector



Clint Yates

State

Indiana

Accreditation Number

193804035

## PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Service Center/Garage

HA# A

Type of Material Miscellaneous Material

Quantity of Material LF

Material Location  
Throughout building

Material Description  
Cove Base

**Comments**

Material is assumed to be positive and will be treated as ACM until it is sampled.  
Material is in good condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/95

Current Surveillance Date 12/16/96

Current Assessment Rating NR Not Required

Cause of Damage No Damage

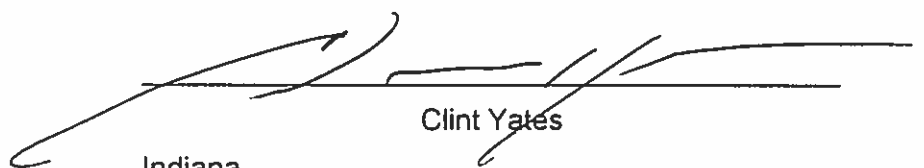
Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Clint Yates

State Indiana

Accreditation Number 193804035

## PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Service Center/Garage

HA# B

Type of Material Miscellaneous Material

Quantity of Material LF

Material Location  
Throughout building

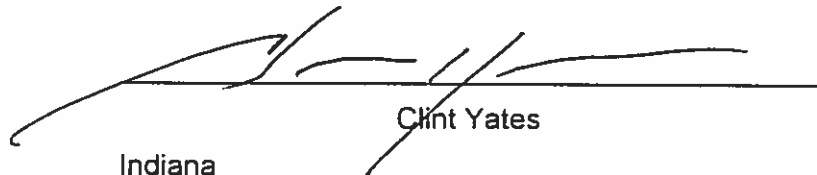
Material Description  
Cove Base Mastic

**Comments**

Material is assumed to be positive and will be treated as ACM until it is sampled.  
Material is in good condition.

Does Material Contain Asbestos? Assumed  
Is it Friable? No  
Original Inspection Date 5/31/95  
Current Surveillance Date 12/16/96  
Current Assessment Rating NR Not Required  
Cause of Damage No Damage  
Accessible No  
Potential for Damage Low  
Removed No  
Planned Response Action O & M

Inspector



Clint Yates

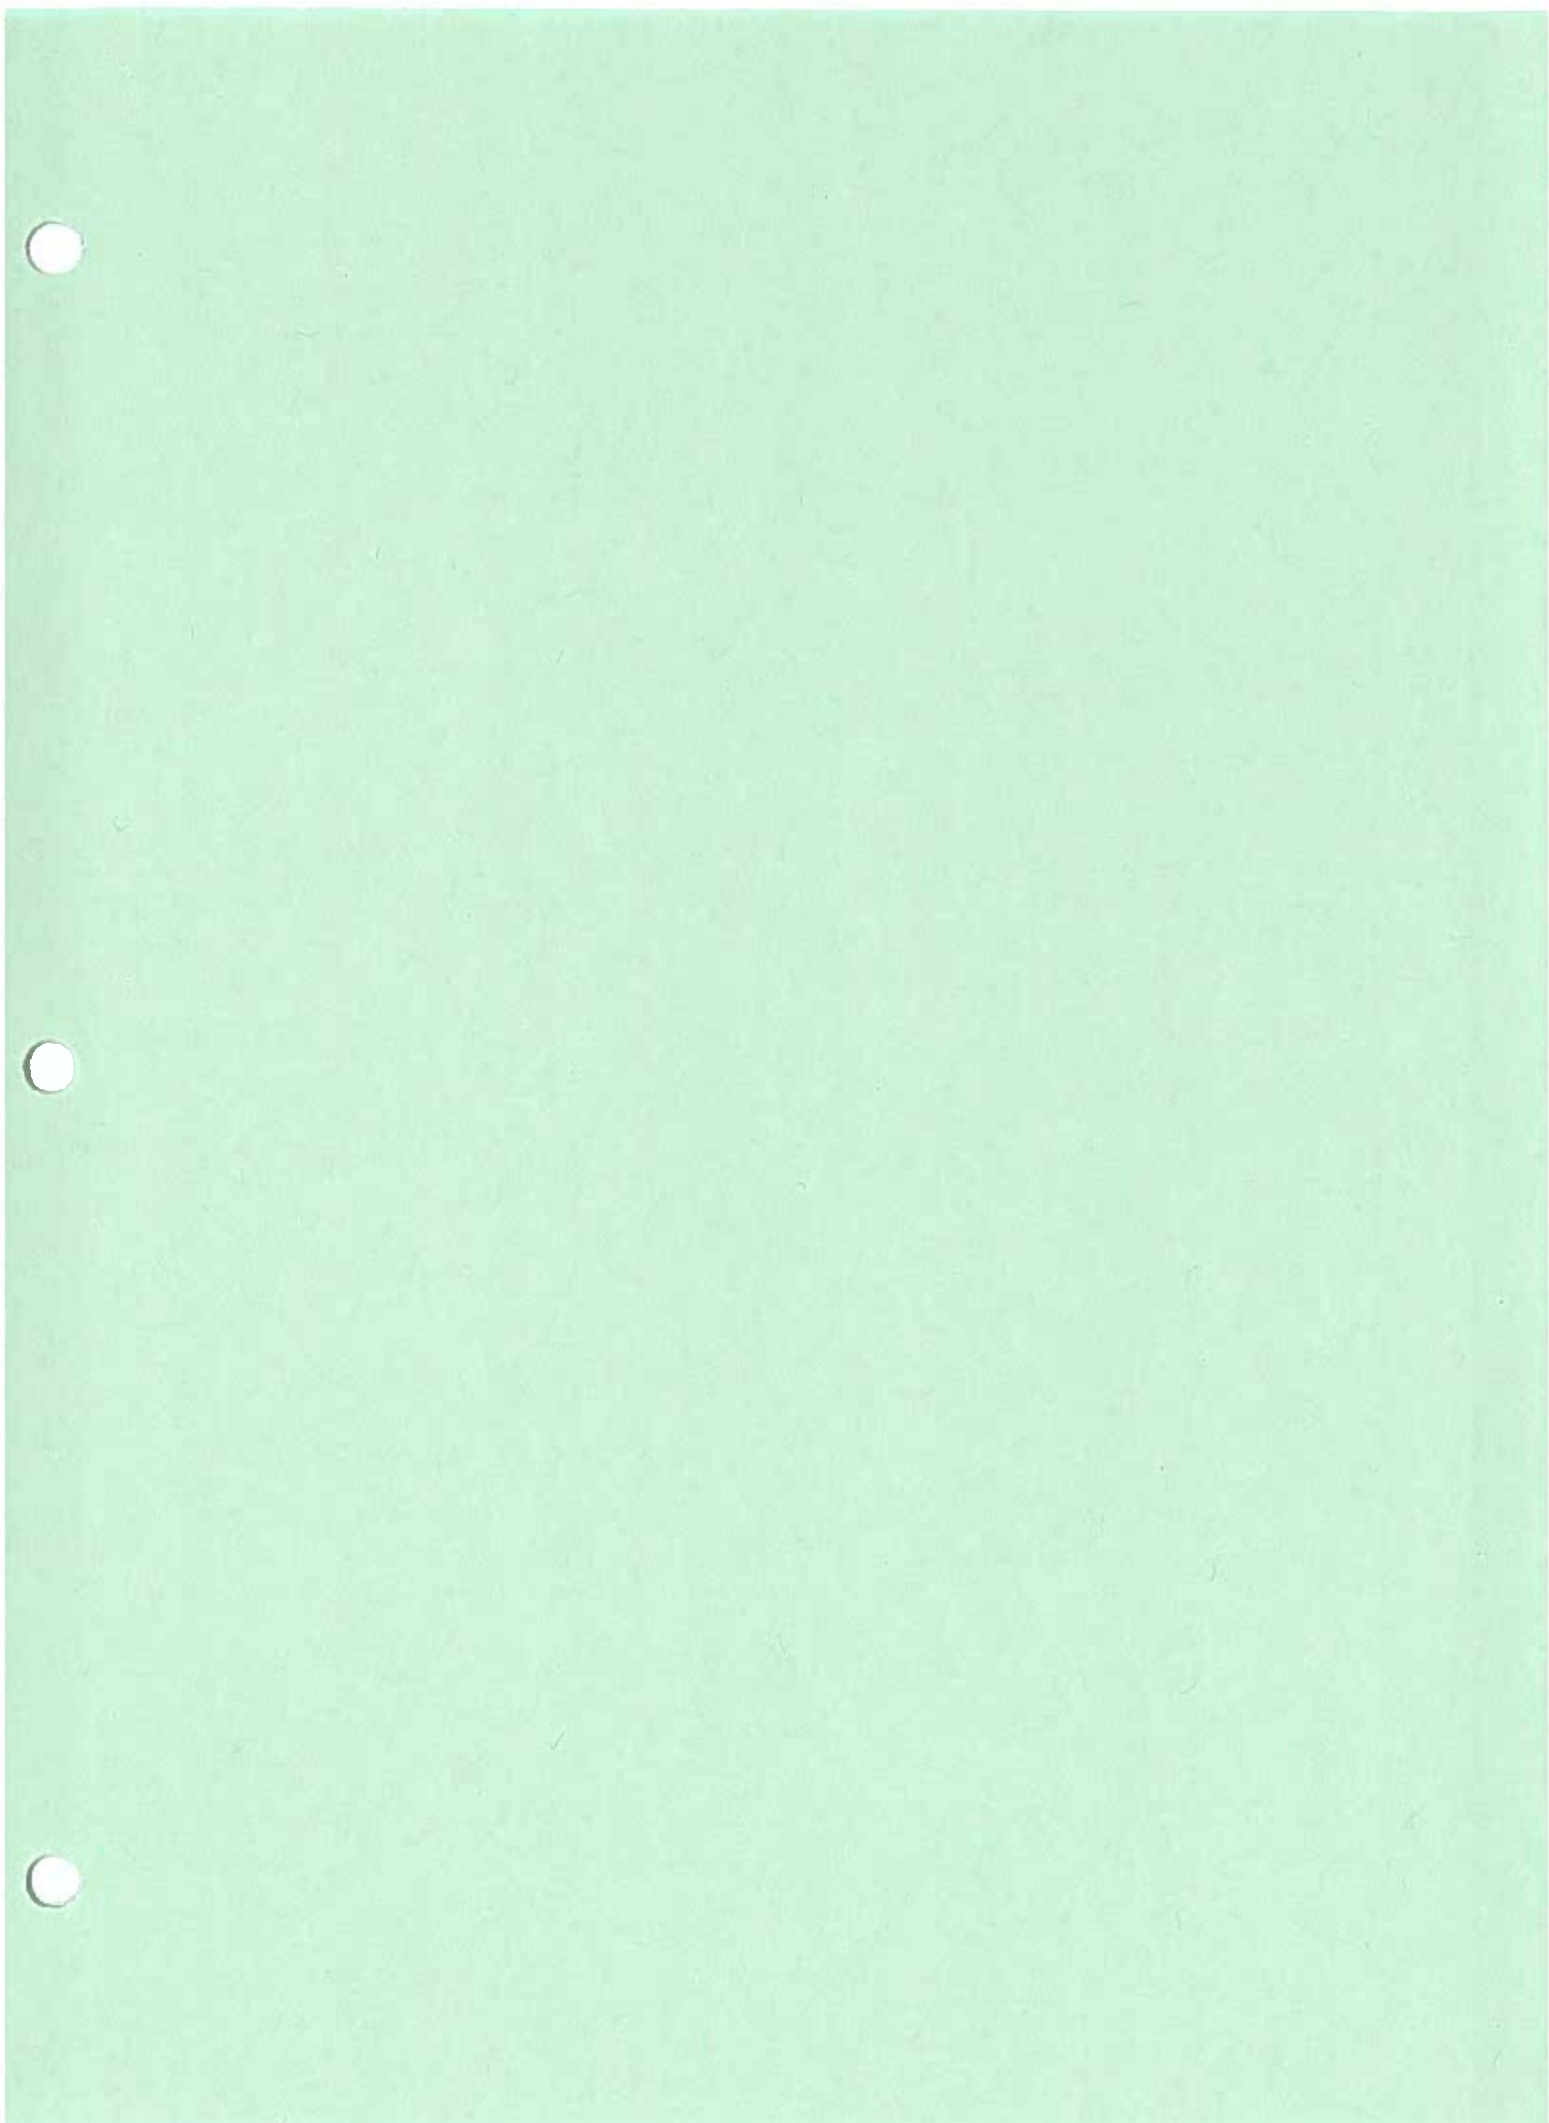
State

Indiana

Accreditation Number

193804035






## PERIODIC SURVEILLANCE REPORT

LEA Name                      Greater Clark County Schools  
Building Name                Service Center/Garage  
HA#                              5  
Type of Material              Miscellaneous Material  
Quantity of Material        36        SF  
Material Location  
                                    Between Warehouse and Office in Service Center  
Material Description  
                                    Fire Door  
Comments  
                                    Material is assumed to be asbestos containing. No change.

Does Material Contain Asbestos?    Assumed  
Is it Friable?                            No  
Original Inspection Date                6/ 1/92  
Current Surveillance Date                6/24/96  
Current Assessment Rating                NR Not Required  
Cause of Damage                         No Damage  
Accessible                                 No  
Potential for Damage                      Low  
Removed                                    No  
Planned Response Action                 O & M

Inspector



Rex Gaddis


State                                        Indiana  
Accreditation Number                    190908032

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 6  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout building  
**Material Description**  
Mastic  
**Comments**  
Material is in good condition. Tile is negative. No change.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/ 1/92  
**Current Surveillance Date** 6/24/96  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**



Rex Gaddis

**State** Indiana  
**Accreditation Number** 190908032

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** A  
**Type of Material** Miscellaneous Material  
**Quantity of Material** LF  
**Material Location**  
Throughout building  
**Material Description**  
Cove Base

**Comments**

Material is assumed to be positive and will be treated as ACM until it is sampled.  
Material is in good condition.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/95  
**Current Surveillance Date** 6/24/96  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** Yes  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**



Rex Gaddis

**State** Indiana  
**Accreditation Number** 190908032

## PERIODIC SURVEILLANCE REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** B

**Type of Material** Miscellaneous Material

**Quantity of Material** LF

**Material Location**  
Throughout building

**Material Description**  
Cove Base Mastic

**Comments**

Material is assumed to be positive and will be treated as ACM until it is sampled.  
Material is in good condition.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 5/31/95

**Current Surveillance Date** 6/24/96

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage


**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

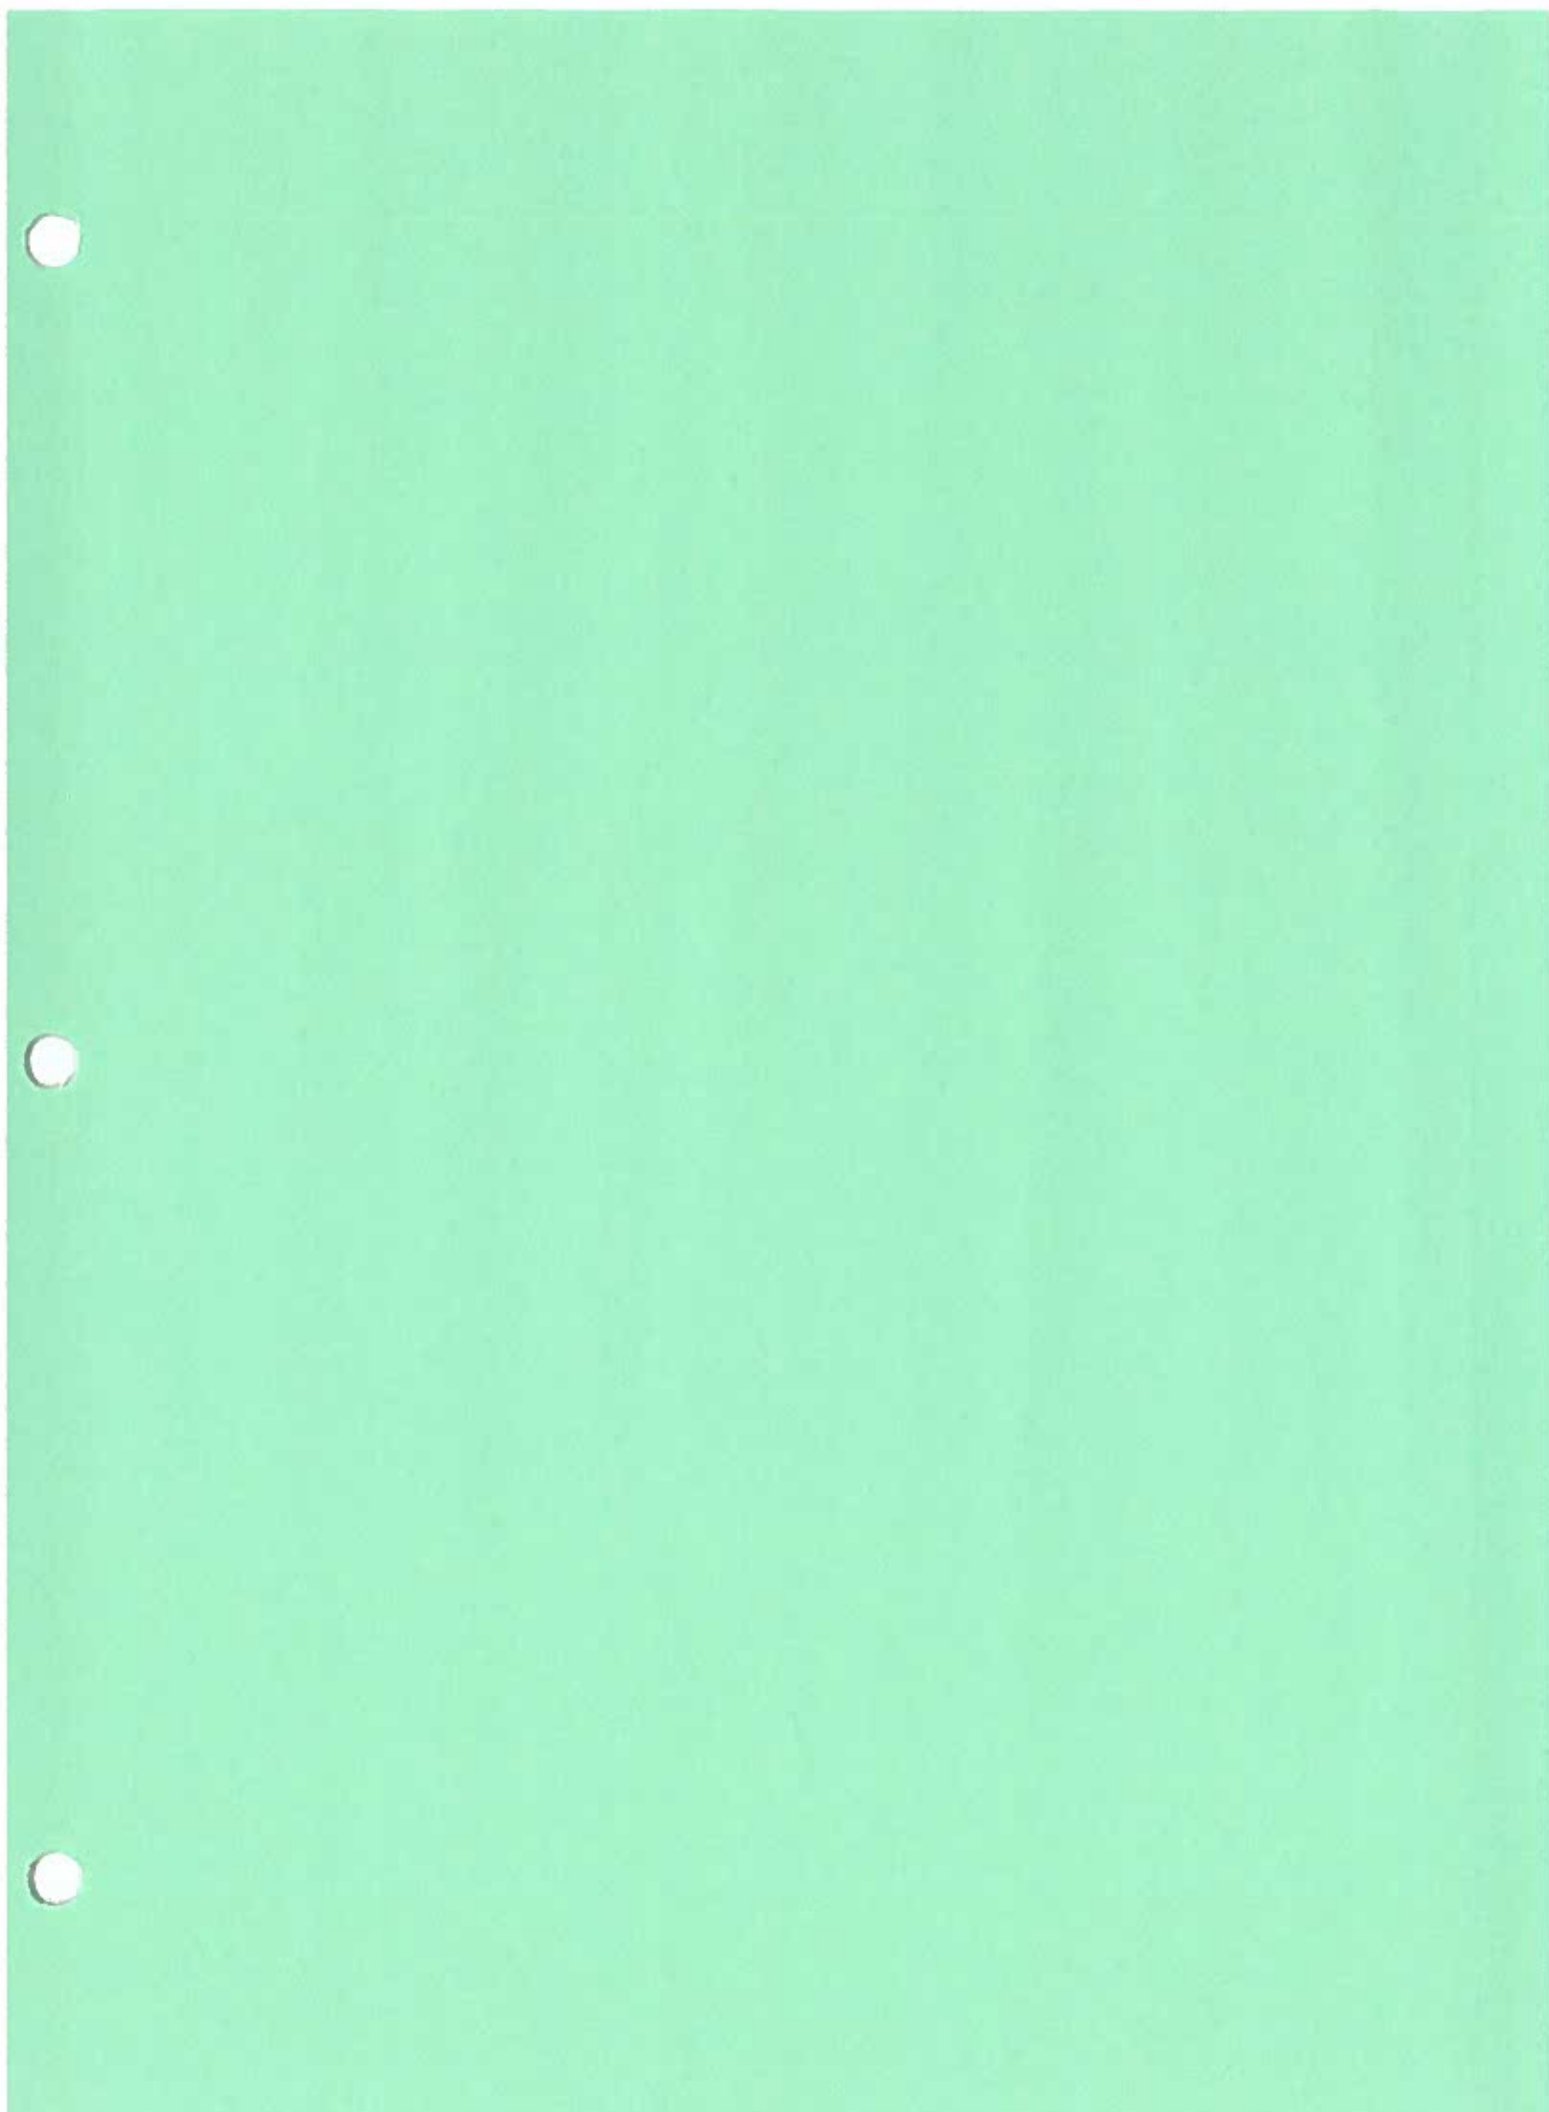
**Inspector**



Rex Gaddis

**State** Indiana

**Accreditation Number** 190908032



PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools

BUILDING NAME: Service Center/Garage

HA#:

TYPE OF MATERIAL:

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

MATERIAL DESCRIPTION:

COMMENTS:

The garage has been inspected. No suspect asbestos material was found in this building.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT SURVEILLANCE DATE: 12/06/95

CURRENT ASSESSMENT RATING:

CAUSE OF DAMAGE:


ACCESSIBLE: NO

POTENTIAL FOR DAMAGE:

REMOVED: NO

STATE: Indiana

INSPECTOR NAME:

  
Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools

BUILDING NAME: Service Center/Garage

HA#: 5

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL: 36SF

MATERIAL LOCATION:

Between Warehouse and Office in Service Center

MATERIAL DESCRIPTION:

Fire Door

COMMENTS:

Material is assumed to be asbestos containing.

IS MATERIAL FRIABLE? NO  
ORIGINAL INSPECTION DATE: 06/01/92  
CURRENT SURVEILLANCE DATE: 12/06/95  
CURRENT ASSESSMENT RATING: NR Not Required  
CAUSE OF DAMAGE: No Damage  
ACCESSIBLE: NO  
POTENTIAL FOR DAMAGE: Low  
REMOVED: NO  
STATE: Indiana

INSPECTOR NAME:

  
Clint Yates



PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools

BUILDING NAME: Service Center/Garage

HA#: 6

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL: 196SF

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Mastic

COMMENTS:

Material is in good condition. Tile is negative.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE: 06/01/92

CURRENT SURVEILLANCE DATE: 12/06/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

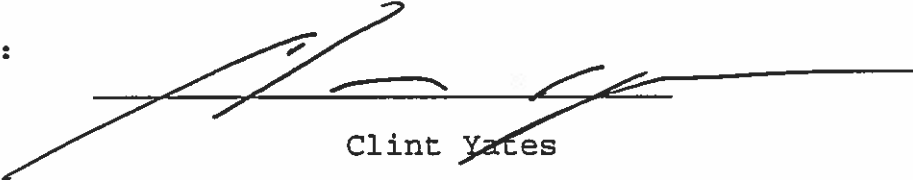
ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

STATE: Indiana

INSPECTOR NAME:

  
Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools

BUILDING NAME: Service Center/Garage

HA#: A

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT SURVEILLANCE DATE: 12/06/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: YES

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

STATE: Indiana

INSPECTOR NAME:



Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools

BUILDING NAME: Service Center/Garage

HA#: B

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base Mastic

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT SURVEILLANCE DATE: 12/06/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

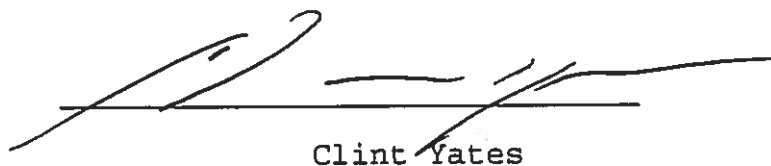
ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

STATE: Indiana

INSPECTOR NAME:

  
Clint Yates

*THIRD YEAR REINSPECTIONS*

**REINSPECTION PLAN**

**GREATER CLARK COUNTY SCHOOLS**

Reinspection by an accredited building inspector will be scheduled to be performed not more than three years from the date of the original inspection. The reinspection report will then be made a permanent part of this Management Plan. Reinspections will be performed every three years for as long as the building contains ACBM, and will be reinspected once within three years from the date that all ACBM has been removed.

Records of each reinspection should be maintained in this binder.

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>JUNE 2007</u>	<u>July 2007</u>	<u>Bill Ogle</u>
<u>JUNE 2010</u>	<u>June 2010</u>	<u>Sandy Shadley</u>
<u>JUNE 2013</u>	<u>April 2013</u>	<u>Jeff Hechtin</u>
<u>JUNE 2016</u>	<u>April 2016</u>	<u>Benjamin B</u>
<u>JUNE 2019</u>	<u>May 2019</u>	<u>[Signature]</u>
<u>JUNE 2022</u>	<u>_____</u>	<u>_____</u>
<u>JUNE 2025</u>	<u>_____</u>	<u>_____</u>

REINSPECTION PLAN

## GREATER CLARK COUNTY SCHOOLS

## SERVICE CENTER

The ACBM in this building shall be reinspected every three years to determine any change in the condition of the materials for as long they remain in the building. This reinspection will be conducted tri-annually by an accredited inspector.

The following table outlines the dates on which these inspections should take place in this school building.

REINSPECTION SCHEDULE

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>JUNE 1992</u>	<u>JUNE 1992</u>	<u>ASBESTECH</u>
<u>JUNE 1995</u>	<u>June '95</u>	<u>Alliance</u>
<u>JUNE 1998</u>	<u>June '98</u>	<u>Alliance</u>
<u>JUNE 2001</u>	<u>July '01</u>	<u>P. Wilson</u>
<u>JUNE 2004</u>	<u>July '04</u>	<u>C. Spucke</u>

# Triennial Reinspection

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 05  
**HA Description** Fire Doors  
**HA Type** Miscellaneous Material  
**HA Location** Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)  
**Quantity** 3 Unit(s)  
**Comments** Door shells are intact, with no core material visible to inspect.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 5/16/2019

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

<b>Percent Damaged</b>	%	Good Condition	
<b>Physical Contact</b>		<b>Vibration</b>	<b>Air</b>
Low/None		Low/None	Low/None

**Planned Response Action** O&M

**Inspector**



Sean Stults

**State** IN

**Accreditation Number** 19A007184

# Triennial Reinspection

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 06  
**HA Description** Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** 196 SF  
**Comments** This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 5/16/2019

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

<b><u>Percent Damaged</u></b>	%	Good Condition
<b><u>Physical Contact</u></b>	<b><u>Vibration</u></b>	<b><u>Air</u></b>
Low/None	Low/None	Low/None

**Planned Response Action** O&M

**Inspector**



Sean Stults

**State** IN

**Accreditation Number** 19A007184



# Triennial Reinspection

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** B  
**HA Description** Cove Base Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** Approx. 270 SF  
**Comments** This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.  
**Asbestos** Assumed  
**Friable** No

**Original Inspection** 5/31/1995  
**Current Inspection** 5/16/2019

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

<b><u>Percent Damaged</u></b>	%	Good Condition	
<b><u>Physical Contact</u></b>		<b><u>Vibration</u></b>	<b><u>Air</u></b>
Low/None		Low/None	Low/None

**Planned Response Action** O&M

**Inspector**



Sean Stults

**State** IN

**Accreditation Number** 19A007184

# Triennial Reinspection

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 05  
**HA Description** Fire Doors  
**HA Type** Miscellaneous Material  
**HA Location** Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)  
**Quantity** 3 Unit(s)  
**Comments** Door shells are intact, with no core material visible to inspect.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 4/27/2016

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

<b><u>Percent Damaged</u></b>	%	Good Condition	
<b><u>Physical Contact</u></b>		<b><u>Vibration</u></b>	<b><u>Air</u></b>
Low/None		Low/None	Low/None

**Planned Response Action** O&M

**Inspector**



Benjamin S. Hood

**State** IN

**Accreditation Number** 19A001039

# Triennial Reinspection

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** 06  
**HA Description** Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** 196 SF  
**Comments** This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 6/1/1992  
**Current Inspection** 4/27/2016

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

**Percent Damaged** % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

**Planned Response Action** O&M

**Inspector**



Benjamin S. Hood

**State** IN

**Accreditation Number** 19A001039

# Triennial Reinspection

**LEA Name** Greater Clark County School Corporation  
**Building Name** Service Center Bus Garage  
**Building Number** 24  
**HA ID** B  
**HA Description** Cove Base Mastic  
**HA Type** Miscellaneous Material  
**HA Location** Throughout building

**Quantity** Approx. 270 SF  
**Comments** This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.  
**Asbestos** Assumed  
**Friable** No  
**Original Inspection** 5/31/1995  
**Current Inspection** 4/27/2016

## Material Assessment

**Assessment Rating** 5 ACBM with potential for damage

## Damage Assessment and Potential for Damage

**Percent Damaged** % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

**Planned Response Action** O&M

**Inspector**



Benjamin S. Hood

**State** IN

**Accreditation Number** 19A001039

# THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 3 Each

**Material Location**

Between warehouse and office in Service Center (1) Between front bay and office in service center (1) Between warehouse and front bay (1)

**Material Description**

Fire doors

**Comments**

Door shells are intact, with no core material visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Reinspection Date** 4/24/2013

**Current Assessment Rating** NR Not Rated

**Cause of Damage** No Damage


**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**



Jeffrey P. Rehtin

**State** Indiana

**Accreditation Number** 19A003594

## THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 06

**Type of Material** Miscellaneous Material

**Quantity of Material** 196 SF

**Material Location**

Throughout the building

**Material Description**

Mastic

**Comments**

This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Reinspection Date** 4/24/2013

**Current Assessment Rating** NR Not Rated

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**



---

Jeffrey P. Rehtin

**State** Indiana

**Accreditation Number** 19A003594

# THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools  
Building Name Service Center/Garage  
HA# B  
Type of Material Miscellaneous Material  
Quantity of Material Approx. 270 SF  
Material Location

Throughout the building

## Material Description


Cove base mastic

## Comments

This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.

Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	5/31/1995	
Current Reinspection Date	4/24/2013	
Current Assessment Rating	NR	Not Rated
Cause of Damage	No Damage	
Accessible	No	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	

Inspector



Jeffrey P. Rehtin

State

Indiana

Accreditation Number

19A003594

## THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 2 Each

**Material Location**

Between warehouse and office in Service Center (1) Between front bay and office in service center (1)

**Material Description**

Fire doors

**Comments**

Door shells are intact, with no core material visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Reinspection Date** 6/30/2010

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage


**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
Sandra Shadley

**State** IN

**Accreditation Number** 19A002323



## THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 06

**Type of Material** Miscellaneous Material

**Quantity of Material** 196 SF

**Material Location**

Throughout the building

**Material Description**

Mastic

**Comments**

This material was not visible to inspect. New floor tile was installed in 2005 during renovation activities.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Reinspection Date** 6/30/2010

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
Sandra Shadley

**State** IN

**Accreditation Number** 19A002323

## THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** A  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 0 LF

**Material Location**  
Throughout the building

**Material Description**  
Cove base

**Comments**

All old cove base was removed in 2005, non-friable and replaced with new cove base.  
This homogeneous area will be removed from the management plan.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Reinspection Date** 6/30/2010  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** Yes  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
Sandra Shadley

**State** IN  
**Accreditation Number** 19A002323

## THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF

**Material Location**  
Throughout the building


**Material Description**  
Cove base mastic

**Comments**

This material was not visible to inspect. All cove base was replaced, covering the old mastic in 2005.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Reinspection Date** 6/30/2010  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
Sandra Shadley

**State** IN  
**Accreditation Number** 19A002323

# THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 05  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 36 SF

**Material Location**  
Between warehouse and office in Service Center

**Material Description**  
Fire door

**Comments**

Door shell is intact, with no core material visible to inspect.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/1/1992  
**Current Reinspection Date** 7/9/2007  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana  
**Accreditation Number** 191003027

## THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Mastic  
**Comments**  
This material was not visible to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/1/1992  
**Current Reinspection Date** 7/9/2007  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

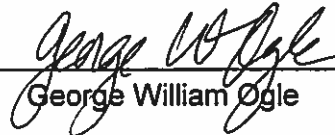
**Inspector** \_\_\_\_\_  
*George W. Ogle*  
George William Ogle

**State** Indiana  
**Accreditation Number** 191003027

# THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** A  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 800 LF  
**Material Location**  
Throughout the building  
**Material Description**  
Cove base  
**Comments**  
The cove base in the restrooms has been removed non-friable.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Reinspection Date** 7/9/2007  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** Yes  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogle

**State** Indiana  
**Accreditation Number** 191003027

# THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF

**Material Location**  
Throughout the building

**Material Description**  
Cove base mastic

**Comments**  
This material was exposed in the restrooms where the cove base had been removed.  
Where exposed it was not in poor condition.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Reinspection Date** 7/9/2007  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
George William Ogie

**State** Indiana  
**Accreditation Number** 191003027

## THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 36 SF

**Material Location**

Between warehouse and office in Service Center

**Material Description**

Fire door

**Comments**

Door shell is intact. Therefore, no material was visible to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 6/1/1992

**Current Reinspection Date** 7/2/2004

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage


**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Christian Sparks

**State** Indiana

**Accreditation Number** 190804103



### THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Mastic  
**Comments**  
This material was not visible to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/1/1992  
**Current Reinspection Date** 7/2/2004  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M  
**Inspector**   
\_\_\_\_\_  
Christian Sparks  
**State** Indiana  
**Accreditation Number** 190804103

## THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** A  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 800 LF

**Material Location**  
Throughout the building

**Material Description**  
Cove base

**Comments**

This material was not in poor condition with minor signs of wear and scraping observed.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Reinspection Date** 7/2/2004  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** Yes  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Christiaan Sparks

**State** Indiana  
**Accreditation Number** 190804103

## THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF


**Material Location**  
Throughout the building

**Material Description**  
Cove base mastic

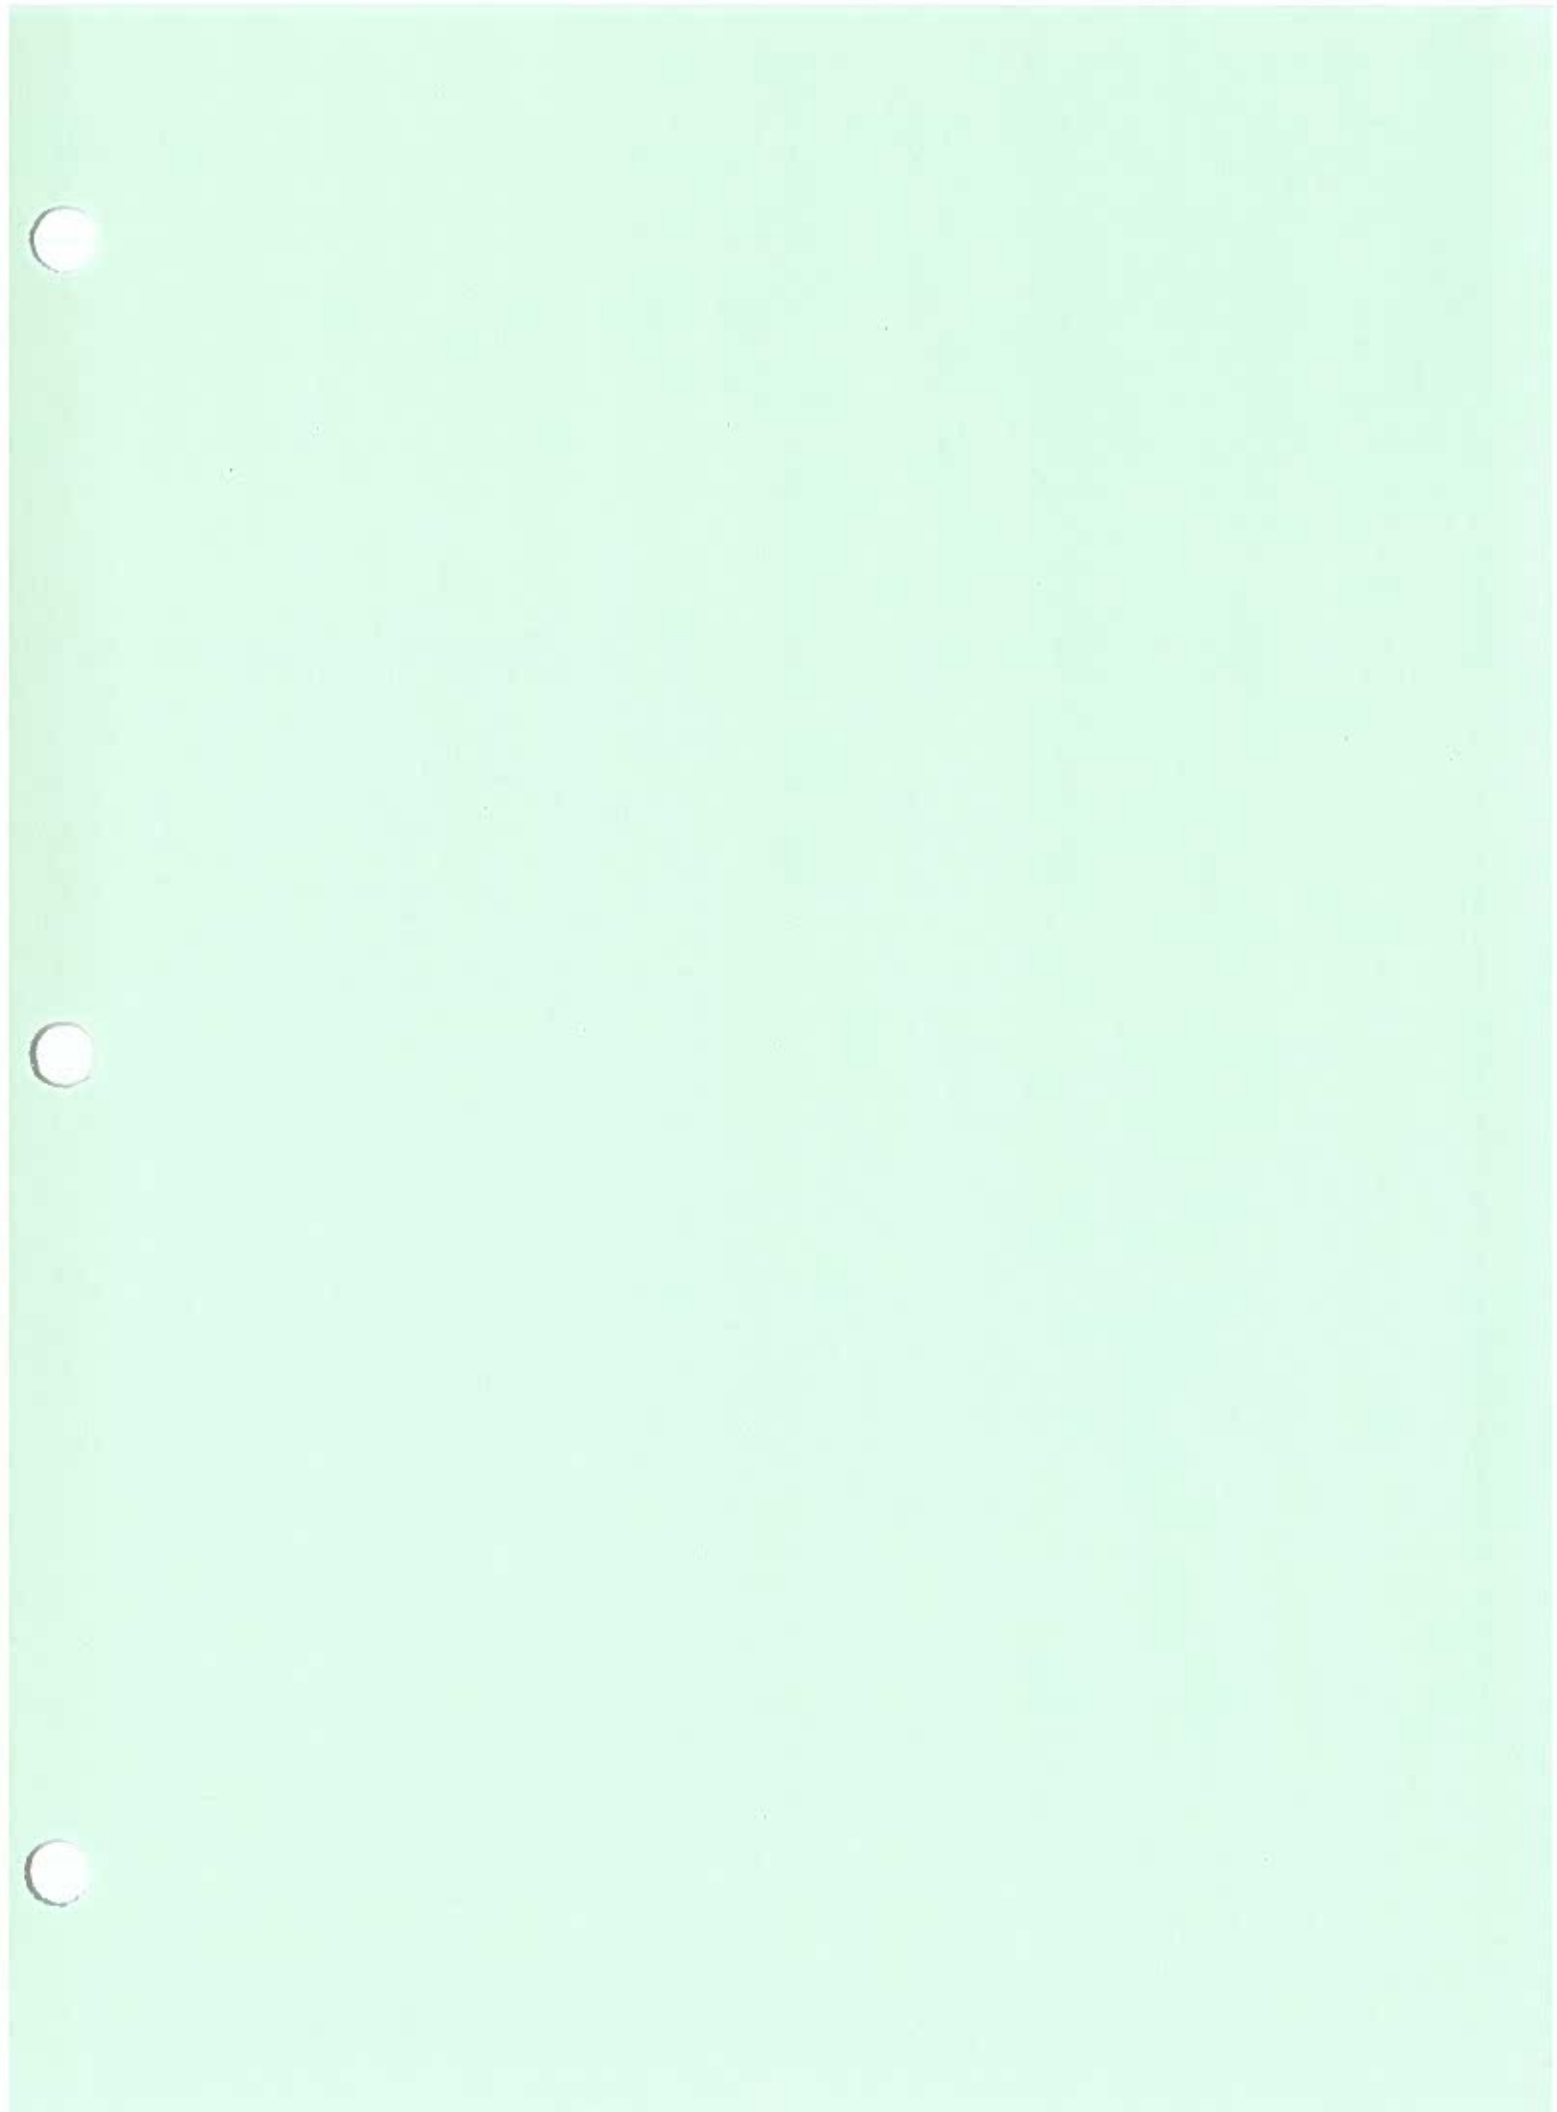
**Comments**  
Material was exposed in kitchenette under sink. It was not in poor condition.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/1995  
**Current Reinspection Date** 7/2/2004  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Christiaan Sparks

**State** Indiana  
**Accreditation Number** 190804103



## THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools

**Building Name** Service Center/Garage

**HA#** 05

**Type of Material** Miscellaneous Material

**Quantity of Material** 36 SF

**Material Location**

Between warehouse and office in Service Center

**Material Description**

Fire door

**Comments**

Fire door is in good condition and no core material is exposed to inspect.

**Does Material Contain Asbestos?** Assumed

**Is it Friable?** No

**Original Inspection Date** 06/01/1992

**Current Reinspection Date** 07/11/2001

**Current Assessment Rating** NR Not Required

**Cause of Damage** No Damage

**Accessible** No

**Potential for Damage** Low

**Removed** No

**Planned Response Action** O & M

**Inspector**

*Patrick Wilson kw*

Patrick E. Wilson

**State** Indiana

**Accreditation Number** 190824065

## THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Mastic  
**Comments**  
Material was not exposed to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 06/01/1992  
**Current Reinspection Date** 07/11/2001  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**



Patrick E. Wilson

**State** Indiana  
**Accreditation Number** 190824065

## THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** A  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 800 LF  
**Material Location**  
Throughout the building  
**Material Description**  
Cove base  
**Comments**  
Material is in good condition with minor signs of wear and scraping observed.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 05/31/1995  
**Current Reinspection Date** 07/11/2001  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** Physical Damage  
**Accessible** Yes  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
\_\_\_\_\_  
Patrick E. Wilson

**State** Indiana  
**Accreditation Number** 190824065

## THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** B  
**Type of Material** Miscellaneous Material  
**Quantity of Material** Approx. 270 SF  
**Material Location**  
Throughout the building  
**Material Description**  
Cove base mastic  
**Comments**  
No material is exposed to inspect.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 05/31/1995  
**Current Reinspection Date** 07/11/2001  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**



Patrick E. Wilson

**State** Indiana  
**Accreditation Number** 190824065





## THIRD YEAR REINSPECTION REPORT

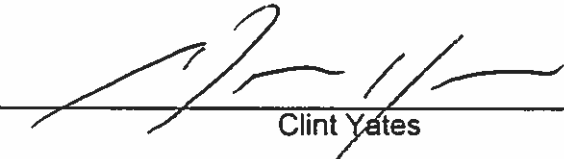
**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 05  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 36 SF  
**Material Location**  
Between Warehouse and Office in Service Center  
**Material Description**  
Fire Door

**Comments**

Material is assumed to be in good condition.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/ 1/92  
**Current Reinspection Date** 6/ 1/98  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
Clint Yates

**State** Indiana  
**Accreditation Number** 193804035

## THIRD YEAR REINSPECTION REPORT

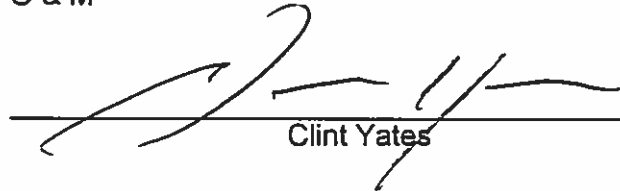
**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** 06  
**Type of Material** Miscellaneous Material  
**Quantity of Material** 196 SF  
**Material Location**  
Throughout building  
**Material Description**  
Mastic

**Comments**

Material is not exposed and is assumed to be in good condition.

**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 6/ 1/92  
**Current Reinspection Date** 6/ 1/98  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** No  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

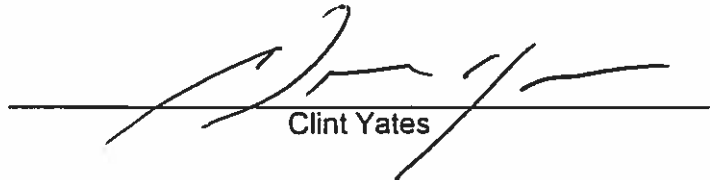
  
Clint Yates

**State** Indiana  
**Accreditation Number** 193804035

## THIRD YEAR REINSPECTION REPORT

**LEA Name** Greater Clark County Schools  
**Building Name** Service Center/Garage  
**HA#** A  
**Type of Material** Miscellaneous Material  
**Quantity of Material** LF  
**Material Location**  
Throughout building  
**Material Description**  
Cove Base  
**Comments**  
Material is in good condition.  
**Does Material Contain Asbestos?** Assumed  
**Is it Friable?** No  
**Original Inspection Date** 5/31/95  
**Current Reinspection Date** 6/ 1/98  
**Current Assessment Rating** NR Not Required  
**Cause of Damage** No Damage  
**Accessible** Yes  
**Potential for Damage** Low  
**Removed** No  
**Planned Response Action** O & M

**Inspector**

  
Clint Yates

**State** Indiana  
**Accreditation Number** 193804035

## THIRD YEAR REINSPECTION REPORT

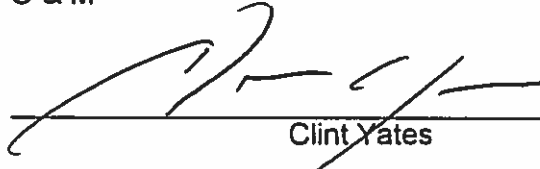
LEA Name Greater Clark County Schools  
Building Name Service Center/Garage  
HA# B  
Type of Material Miscellaneous Material  
Quantity of Material LF  
Material Location  
Throughout building  
Material Description  
Cove Base Mastic

### Comments

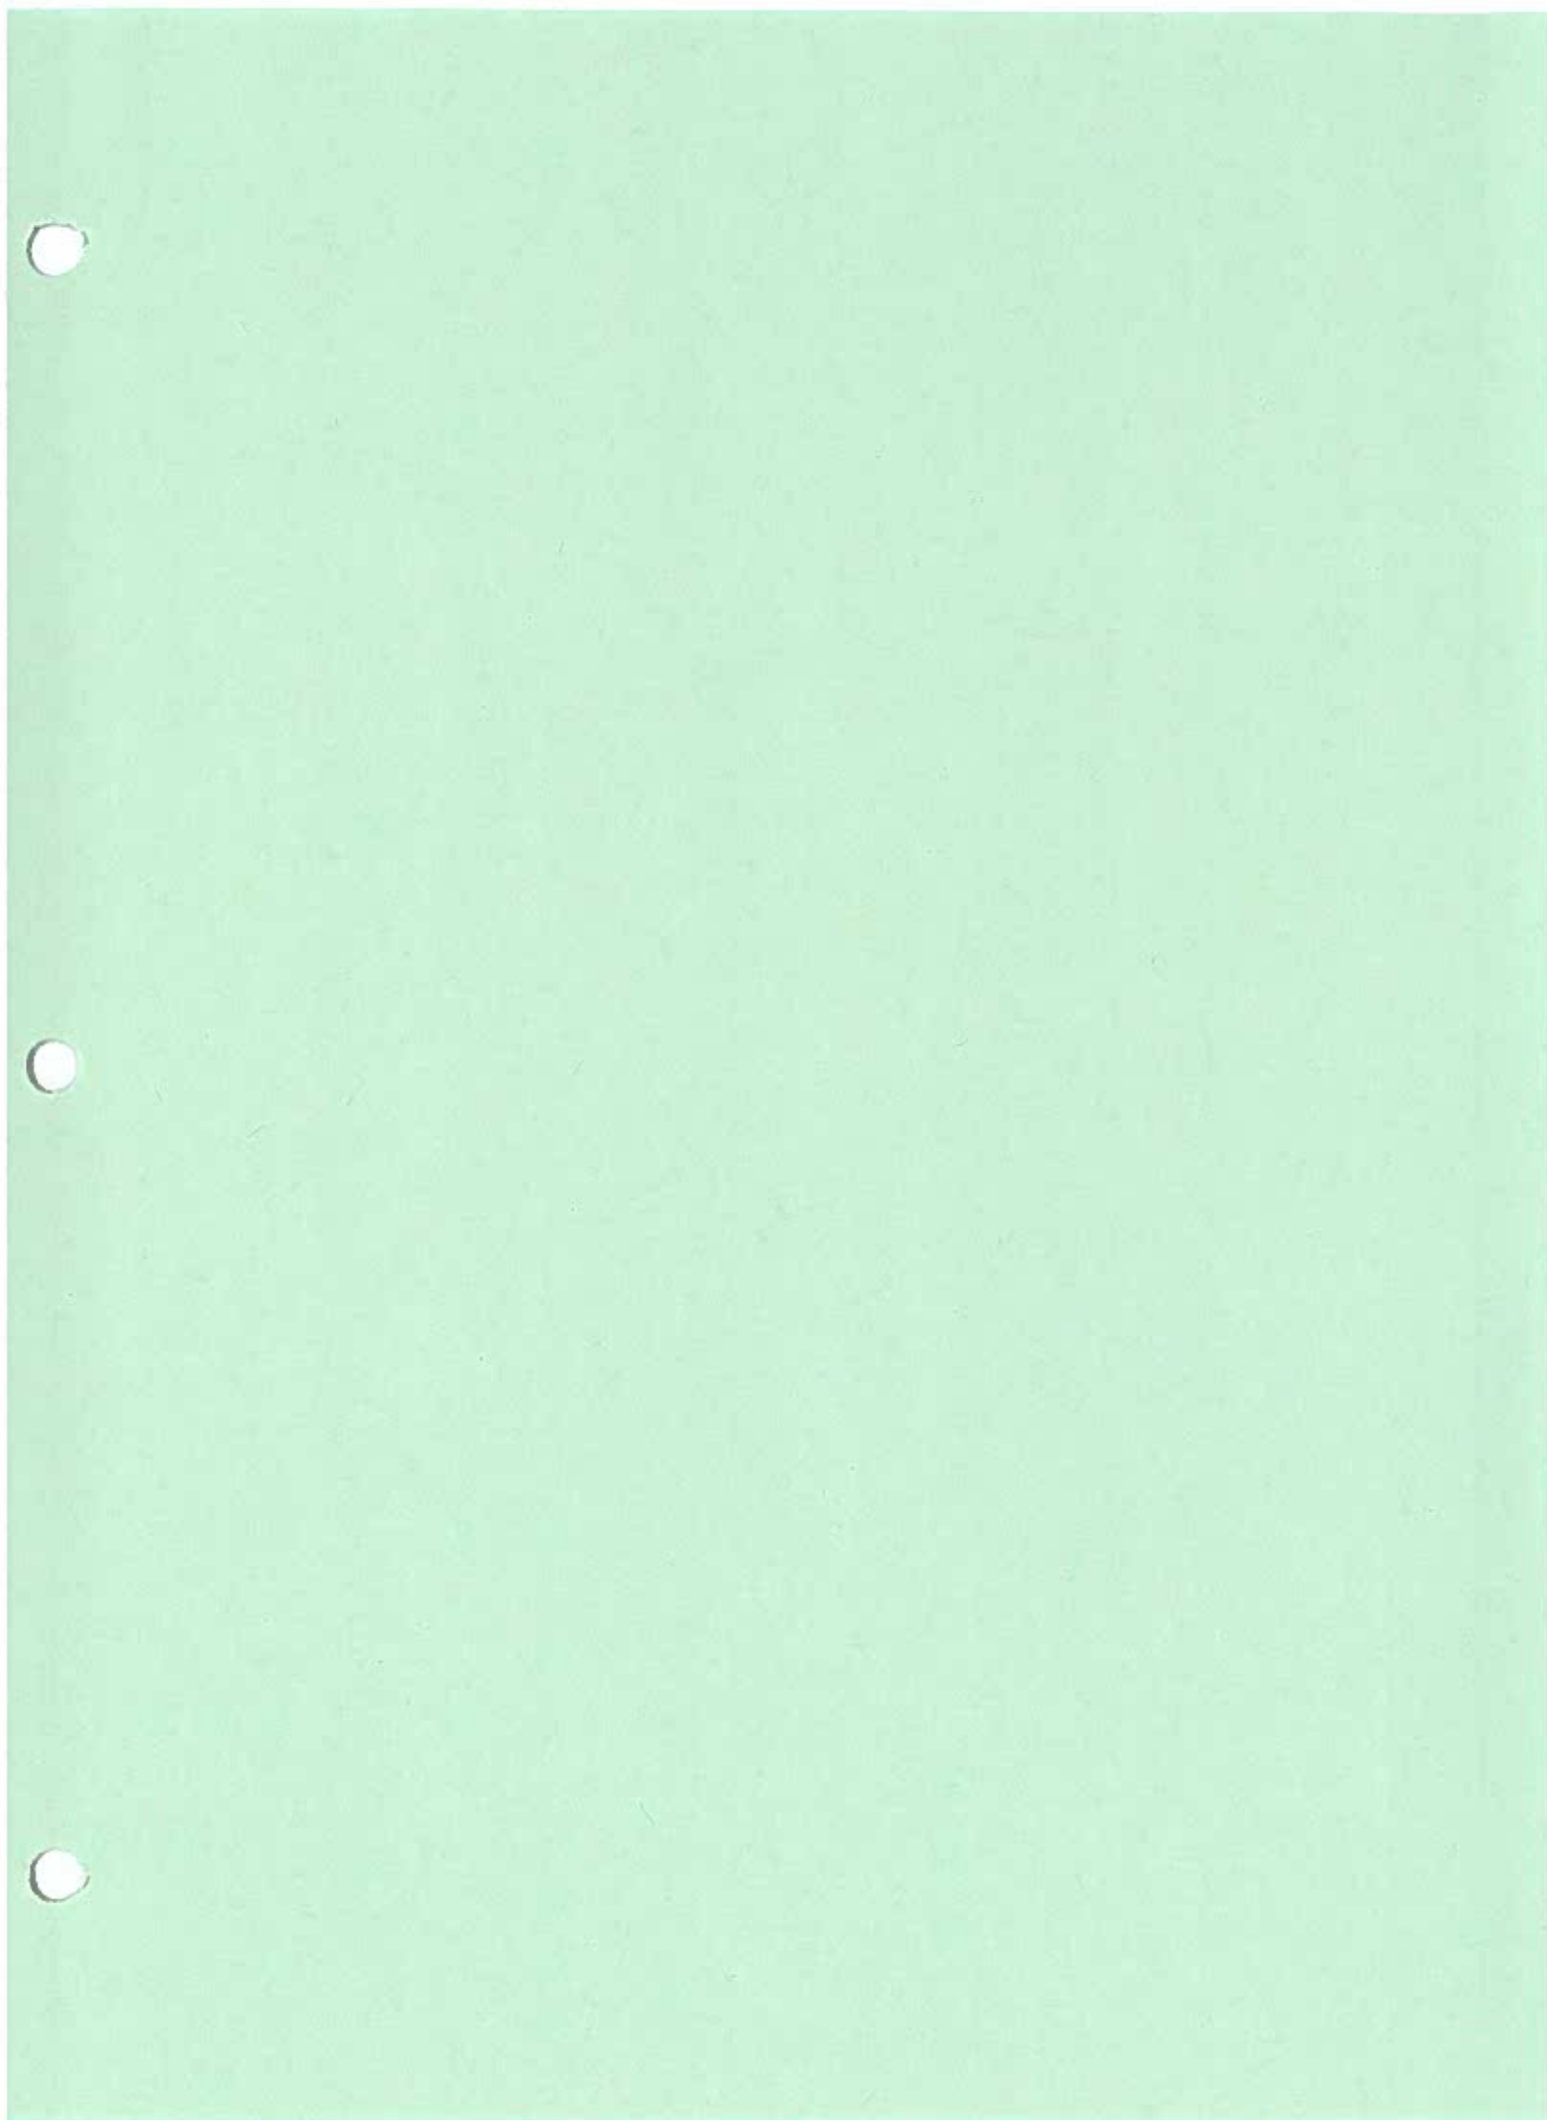
Material is not exposed and is assumed to be in good condition.

Does Material Contain Asbestos? Assumed  
Is it Friable? No  
Original Inspection Date 5/31/95  
Current Reinspection Date 6/ 1/98  
Current Assessment Rating NR Not Required  
Cause of Damage No Damage  
Accessible No  
Potential for Damage Low  
Removed No  
Planned Response Action O & M

Inspector

  
Clint Yates

State Indiana  
Accreditation Number 193804035



THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.

BUILDING NAME: Service Center/Garage

HA#:

TYPE OF MATERIAL:

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

MATERIAL DESCRIPTION:

COMMENTS:

The garage has been inspected. No suspect asbestos material was found in this building.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT REINSPECTION DATE:

CURRENT ASSESSMENT RATING:

CAUSE OF DAMAGE:

ACCESSIBLE: NO

POTENTIAL FOR DAMAGE:

REMOVED: NO

CURRENT VIDEO TAPE:  
(TAPE NO/FOOTAGE) /

INSPECTOR NAME:

  
\_\_\_\_\_  
Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.  
BUILDING NAME: Service Center/Garage  
HA#: 5  
TYPE OF MATERIAL: Miscellaneous Material  
QUANTITY OF MATERIAL: 36SF  
MATERIAL LOCATION:

Between Warehouse and Office *in Service Center*

MATERIAL DESCRIPTION:

Fire Door

COMMENTS:

Material is assumed to be asbestos containing.

IS MATERIAL FRIABLE? NO  
ORIGINAL INSPECTION DATE: 06/01/92  
CURRENT REINSPECTION DATE: 06/26/95  
CURRENT ASSESSMENT RATING: NR Not Required  
CAUSE OF DAMAGE: No Damage  
ACCESSIBLE: NO  
POTENTIAL FOR DAMAGE: Low  
REMOVED: NO  
CURRENT VIDEO TAPE:  
(TAPE NO/FOOTAGE) /

INSPECTOR NAME:

  
\_\_\_\_\_  
Rex Gaddis

STATE: Indiana  
ACCREDITATION NO.: 190908032



THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.  
BUILDING NAME: Service Center/Garage  
HA#: 6  
TYPE OF MATERIAL: Miscellaneous Material  
QUANTITY OF MATERIAL: 196SF

MATERIAL LOCATION:  
Throughout Building

MATERIAL DESCRIPTION:  
Mastic

COMMENTS:  
Material is in good condition. Tile is negative.

IS MATERIAL FRIABLE? NO  
ORIGINAL INSPECTION DATE: 06/01/92  
CURRENT REINSPECTION DATE: 06/26/95  
CURRENT ASSESSMENT RATING: NR Not Required  
CAUSE OF DAMAGE: No Damage  
ACCESSIBLE: NO  
POTENTIAL FOR DAMAGE: Low  
REMOVED: NO  
CURRENT VIDEO TAPE: /  
(TAPE NO/FOOTAGE)

INSPECTOR NAME:

  
\_\_\_\_\_  
Rex Gaddis

STATE: Indiana  
ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.

BUILDING NAME: Service Center/Garage

HA#: A

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT REINSPECTION DATE: 06/26/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

CURRENT VIDEO TAPE: /  
(TAPE NO/FOOTAGE)

INSPECTOR NAME:

  
\_\_\_\_\_  
Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.

BUILDING NAME: Service Center/Garage

HA#: B

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base Mastic

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT REINSPECTION DATE: 06/26/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

CURRENT VIDEO TAPE: /  
(TAPE NO/FOOTAGE)

INSPECTOR NAME:

  
\_\_\_\_\_  
Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

*ADDITIONAL BULK SAMPLES*

**ANNUAL NOTIFICATIONS  
ACCREDITATIONS  
TRAINING  
INFORMATION**

Indiana Department of Environmental Management  
100 N. Senate Avenue  
Mail Code 61-52 IGCN 1003  
Indianapolis, IN 46204-2251



April 17, 2014

RECEIVED APR 22 2014

Benjamin S. Hood  
Alliance Environmental Group  
5340 Commerce Circle, Ste E  
Indianapolis IN 46237

Re: Asbestos Inspector # 19A001039

Based upon the review of your license application, the Office of Air Quality has determined that you have fulfilled the requirements of 326 IAC 18 and are eligible for licensing in the following discipline:

Asbestos Inspector

Your Asbestos Inspector license is attached below. The license is waterproof and tear resistant. Please sign your license and do not laminate or alter your license in anyway. Your license must be available for review at all times while implementing an asbestos project. This license may be revoked, pursuant to 326 IAC 18-1-7, if you:

- (1) Violate any requirements of these rules (326 IAC 18), 326 IAC 14-10, or any requirement of the Asbestos-Containing Materials in Schools Rule or any other federal, state, or local regulation pertaining to asbestos in buildings or to asbestos projects.
- (2) Falsify information on your application for licensing.
- (3) Fail to meet any qualifications specified in 326-IAC 18-1-4.
- (4) Conduct asbestos project, or related asbestos handling activity, in a manner which is hazardous to the public health.

Your license is valid effective 05/05/2014, and will expire on 05/05/2015, as indicated on your card. We suggest that you attend the required training and submit an application for license renewal early to insure your license does not lapse. NOTE: 326 IAC 18-1-4(h) and 326 IAC 18-1-6(e) require that any individual who has an eighteen (18) month lapse between any two training courses of the same discipline to attend an initial training course for the discipline in which they are seeking a license. In order to avoid re-taking the initial training course you must have attended a refresher in the discipline you are seeking a license within eighteen (18) months from the date of issuance of your last training course certificate.

Office of Air Quality, Asbestos Licensing Section (317) 233-3861



Indiana Dept. of Environmental Management

**Benjamin S. Hood**

Asbestos Inspector License #: 19A001039

Effective: 05/05/2014	Expiration: 05/05/2015
Birth Date: 04/10/1978	Gender: M
Height: 6-00	Eye Color: Brown
Weight: 285	Hair Color: Brown

*NOTICES*





**NOTIFICATION LOG**

LEA Name - Greater Clark County Schools

<u>Date of Notification</u>	<u>Copy of Notification in Supplemental Book?</u>
1989	
1990	
1991	
1992	
1993	
1994	
1995	✓
1996	✓
1997	✓
1998	✓
1999	✓
2000	✓
2001	✓
2002	✓
2003	✓
2004	✓
2005	✓
2006	✓
2007	✓
2008	✓

March 2015

AHERA ANNUAL NOTICE  
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services at River Valley Middle School, which is located at 2220 Veteran's Parkway, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

**Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, Service Center, Corden Porter Storage, Auto Tech Program- Witten Property, and Corden Porter Center with Gym.**

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2015/2016 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

\* The required triennial re-inspection will be performed in April 2016.

\* The required six month periodic surveillance was performed in October 2014.

\* The required six month periodic surveillance activities are scheduled for April and October each year.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

**Pleasant Ridge Elementary School, Utica Elementary School, Corden Porter former Options Building and the Administration Building**

March 2014

AHERA ANNUAL NOTICE  
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2220 Veteran's Parkway, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

**Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, Corden Porter Storage, and Corden Porter Center with Gym.**

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2014/2015 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

\* The required triennial re-inspection will be performed in April 2013.

\* The required six month periodic surveillance was performed in October 2013.

\* The required six month periodic surveillance activities are scheduled for April and October each year.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

**Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building**

March 2013

AHERA ANNUAL NOTICE  
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2710 E 10<sup>th</sup> Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

**Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, Corden Porter Storage, and Corden Porter Center with Gym.**

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2013/2014 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- \* The required triennial re-inspection will be performed in April 2013.
- \* The required six month periodic surveillance was performed in October 2012.
- \* The required six month periodic surveillance activities are scheduled for April and October each year.
- \* Projects completed in 2012: Parkview Middle School.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

**Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building**

March 2012

**AHERA ANNUAL NOTICE  
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2710 E 10<sup>th</sup> Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

**Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, and Cordon Porter Center with Gym.**

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2012/2013 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- \* The required triennial re-inspection will be performed in June 2013.
- \* The required six month periodic surveillance was performed in December 2011.
- \* The required six month periodic surveillance activities are scheduled for June and December each year.
- \* Projects completed in 2011: Options building and Parkwood Elementary.
- \* Projects scheduled for 2012: Parkview Middle School and Bridgepoint Elementary.
- \* Cordon Porter storage building was sold in 2012.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

**Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building**

AHERA ANNUAL NOTICE  
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxillary Services building, which is located at 2710 E 10<sup>th</sup> Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

**Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, Options and Corden Porter Center Buildings and Alternative School-**

- \* The required triennial reinspection will be performed in June 2013.
- \* The required six month periodic surveillance was performed in December 2010.
- \* The next scheduled activity is the required six month periodic surveillance in June 2011.
- \* Charlestown High School asbestos removal project was completed in 2010.
- \* Options Building is under renovation in 2011.
- \* Parkwood Elementary is under renovation in 2011.

**Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building**  
– These buildings are asbestos free and **Riverside Elementary** was demolished in 2006.  
No surveillances or reinspections are required for these buildings.

March 2011

AHERA ANNUAL NOTICE  
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxillary Services building, which is located at 2710 E 10<sup>th</sup> Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

**Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -**

\* The required triennial reinspection will be performed in June 2010.

\* The required six month periodic surveillance was performed in December 2009.

\* The next scheduled activity is the required six month periodic surveillance in December 2010.

Charlestown High School is an ongoing asbestos removal project which will be complete prior to partial demolition.

**Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building –** These buildings are asbestos free and **Riverside Elementary** was demolished in 2006. No surveillances or reinspections are required for these buildings.

March 2010

AHERA ANNUAL NOTICE  
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

**Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -**

- \* The required triennial reinspection was performed in June 2007.
- \* The required six month periodic surveillance was performed in December 2008.
- \* The next scheduled activities are the required six month periodic surveillance in June 2009 and Dec 2009. Charlestown High School has undergone an asbestos removal project prior to partial demolition.

**Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building –** These buildings are asbestos free and **Riverside Elementary** was demolished in 2006. No surveillances or re-inspections are required for these buildings.

April 2009



AHERA ANNUAL NOTICE  
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number (812)288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

**Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -**

- \* The required triennial reinspection was performed in June 2007.
- \* The required six month periodic surveillance was performed in December 2007.
- \* The next scheduled activities are the required six month periodic surveillance in June 2008 and Dec 2008.

**Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building –** These buildings are asbestos free. **Riverside Elementary** was Demolition in 2006. No surveillances or reinspections are required.

April 2008

**AHERA ANNUAL NOTICE  
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

**Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -**

\* The required six month periodic surveillance was performed in June 2006.

\* The required six month periodic surveillance was performed in December 2006.

\* The next scheduled activities are the required six month periodic surveillance in June 2007 and Dec 2007.

**Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building –** These buildings are asbestos free. **Riverside Elementary** was Demolition in 2006. No surveillances or reinspections are required.

March 2007

AHERA ANNUAL NOTICE  
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

**Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -**

- \* The required triennial reinspection was performed in June 2005.
- \* The required six month periodic surveillance was performed in December 2005.
- \* The next scheduled activities are the required six month periodic surveillance in June 2006 and Dec 2006.

**Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building –**  
These buildings are asbestos free. No surveillances or reinspections are required.

March 2006

AHERA Annual Notice  
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

**Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -**

- \* The required triennial reinspection was performed in June 2004.
- \* The required six month periodic surveillance was performed in December 2004.
- \* The next scheduled activities are the required six month periodic surveillance in June 2005 and December 2005.

**Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -**

- \* These buildings are asbestos free. No surveillances or reinspections are required.

AHERA Annual Notice  
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

**Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -**

- \* The required six month periodic surveillance was performed in June 2003.
- \* The required six month periodic surveillance was performed in December 2003.
- \* The next scheduled activities are the required triennial reinspection in June 2004 and a required six month periodic surveillance in December 2004.

**Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -**

- \* These buildings are asbestos free. No surveillances or reinspections are required.

AHERA Annual Notice  
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

**Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -**

- \* The required six month periodic surveillance was performed in June 2002.
- \* The required six month periodic surveillance was performed in December 2002.
- \* The next scheduled activity is the required periodic surveillance in June 2003.

**Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -**

- \* These buildings are asbestos free. No surveillances or reinspections are required.

May 2003

AHERA Annual Notice  
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

**Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center Buildings -**

- \* The required triennial reinspection was performed in July 2001.
- \* The required six month periodic surveillance was performed in December 2001.
- \* The next scheduled activities are the required periodic surveillances in June 2002 and December 2002.

**Pleasant Ridge Elementary School and (New) Utica Elementary School -**

- \* These buildings are asbestos free. No surveillances or reinspections are required.

**(Old) Utica Elementary School -**

- \* In accordance with information collected from the GCCS this building has been deeded to the town of Utica. No further AHERA periodic surveillances or triennial reinspections will be conducted by the designated person.

AHERA Annual Notice  
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

**Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, (Old) Utica, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center -**

- \* The required six month periodic surveillance was performed in June 2000.
- \* The required six month periodic surveillance was performed in January 2001.
- \* The next scheduled activity is a required triennial reinspection in June 2001.

**Pleasant Ridge Elementary School and (New) Utica Elementary School -**

- \* This building is asbestos free. No surveillances or reinspections are required.

June 2001



AHERA Annual Notice  
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

**Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, Utica, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center -**

- \* The required six month periodic surveillance was performed in June 1999.
- \* The required six month periodic surveillance was performed in December 1999.
- \* The next scheduled activity is a required periodic surveillance in June 2000.

**Pleasant Ridge Elementary School -**

- \* This building is asbestos free. No surveillances or reinspections are required.

June 2000

## AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

### All school and support buildings where it is required -

- \* The required six month periodic surveillance was performed in June 1998.
- \* The required six month periodic surveillance was performed in December 1998.
- \* The next scheduled activity is a required periodic surveillance in June 1999.

### Parkwood Elementary School

- \* O & M was performed in the boiler room in May 1998.

## AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

### **All school and support buildings where it is required -**

- \* The required periodic surveillance was performed in June 1997 and December 1997.
- \* Next activity scheduled activity is a required third year reinspection in June 1998.

## AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available, should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

### **All school and support buildings where it is required -**

- \* The required periodic surveillance was performed in June 1996 and December 1996.
- \* The next required periodic surveillance will be performed in June 1997 and December 1997.

June 97

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Denny Johanson at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

**All buildings where it is required -**

- \* The required third year reinspection was performed in June 1995.
- \* The required periodic surveillance was performed in December 1995.
- \* Next activity scheduled is a periodic surveillance in June 1996.

**Charlestown High School -**

- \* Transite panels were compliantly removed from the exterior of the building.

**Corden Porter Building #3 -**

- \* TSI was compliantly removed from the boiler room.

June 96

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available, should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Dennis Johanson at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

**All school and support buildings where it is required -**

- \* The required periodic surveillance was performed in June 1995 and December 1995.
- \* The required triennial reinspection was performed in June 1995.
- \* The next required periodic surveillance will be performed in June 1996 and December 1996.

June 95

*ACCREDITATIONS*



# Environmental Management Institute

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846

[www.envtlmgmt.org](http://www.envtlmgmt.org)

This confirms that

## Sandy Shadley

Completed the Required Initial Training for  
Asbestos Accreditation Under TSCA Title II  
and has  
passed with a Score of 70 or Greater the Examination for

### Asbestos Management Planner

Course Date

December 10 - 11, 2009

Examination Date

December 11, 2009



Jack E. Leonard, President

Certificate: MP(I) 2248

Expires: December 11, 2010

Approved by::

Illinois Department of Public Health  
Indiana Department of Environmental Management



Indiana Department of Environmental Management  
100 N. Senate Avenue  
Mail Code 61-52 IGCN 1003  
Indianapolis, IN 46204-2251



January 21, 2010

RECEIVED JAN 23 2010

Sandra S. Shadley  
Alliance Environmental Grp  
5340 Commerce Circle Ste E  
Indianapolis IN 46237

Re: Asbestos Management Planner # 19A002720

Based upon the review of your license application, the Office of Air Quality has determined that you have fulfilled the requirements of 326 IAC 18 and are eligible for licensing in the following discipline:

**Asbestos Management Planner**

Your Asbestos Management Planner license is attached below. The license is waterproof and tear resistant. Please sign your license and do not laminate or alter your license in anyway. Your license must be available for review at all times while implementing an asbestos project. This license may be revoked, pursuant to 326 IAC 18-1-7, if you:

- (1) Violate any requirements of these rules (326 IAC 18), 326 IAC 14-10, or any requirement of the Asbestos-Containing Materials in Schools Rule or any other federal, state, or local regulation pertaining to asbestos in buildings or to asbestos projects.
- (2) Falsify information on your application for licensing.
- (3) Fail to meet any qualifications specified in 326-IAC 18-1-4.
- (4) Conduct asbestos project, or related asbestos handling activity, in a manner which is hazardous to the public health.

Your license is valid effective 01/21/2010, and will expire on 01/21/2011, as indicated on your card. We suggest that you attend the required training and submit an application for license renewal early to insure your license does not lapse. NOTE: 326 IAC 18-1-4(h) and 326 IAC 18-1-6(e) require that any individual who has an eighteen (18) month lapse between any two training courses of the same discipline to attend an initial training course for the discipline in which they are seeking a license. In order to avoid re-taking the initial training course you must have attended a refresher in the discipline you are seeking a license within eighteen (18) months from the date of issuance of your last training course certificate.

Office of Air Quality, Asbestos Licensing Section (317) 233-3861



Indiana Dept. of Environmental Management

**Sandra S. Shadley**

Asbestos Management Planner License #: 19A002720

Effective: 01/21/2010  
Birth Date: 04/21/1959  
Height: 5-08  
Weight: 140

Expiration: 01/21/2011  
Gender: F  
Eye Color: Blue  
Hair Color: Brown

**ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE**  
1435 Sadler Circle West Drive  
Indianapolis, Indiana 46239  
(317) 352 -1270 / (317) 352 - 0669

**CHRISTIAAN SPARKS**  
306 - 04 - 2616

Has Successfully Completed The Course  
Required Under TSCA Title II  
And Passed The Written Examination  
With a Score of 70% or Better

For  
**ASBESTOS BUILDING INSPECTOR REFRESHER**

Accredited by the  
Indiana Department of Environmental Management.

**Certificate # ES03/BIR755**

Course Dates: 09/26/2003  
Test Date: 09/26/ 2003 Expires: 09/26/2004



*Sharyn Reyes*  
Sharyn Reyes  
Instructor / Manager

**ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE**  
1435 Sadlier Circle West Drive  
Indianapolis, Indiana 46239  
(317) 352-1270 / (317) 352-06

**GEORGE Wm. (BILL) OGLE**

Has Successfully Completed The Course  
Required Under TSCA Title II  
And Passed The Written Examination  
With a Score of 70% or Better  
For

**ASBESTOS MANAGEMENT PLANNER  
REFRESHER**

Accredited by the  
Indiana Department of Environmental Management.

**Certificate # ES03/MPR045**

Course Dates: 09/05/2003  
Test Date: 09/05/2003 Expires: 09/05/2004



*Sharyn Reyes*  
Sharyn Reyes  
Instructor

**INDIANA DEPARTMENT OF ENVIRONMENTAL  
MANAGEMENT ASBESTOS LICENSE # 191523030**

INSPECTOR       PLANNER       DESIGNER   
SUPERVISOR       WORKER       WASTE DISP. MGR.



**George (Bill) W. Ogle**  
**Expiration Date: 09/27/2003**

BIRTH DATE: 01/17/1949  
SEX: M  
EYE COLOR: BRO  
HAIR COLOR: BRO  
HEIGHT: 5-08  
WEIGHT: 155

THIS CERTIFICATE IS ISSUED FOR THE SOLE  
USE OF THE UNDERSIGNED AND IS NON-  
TRANSFERABLE. ANY USE OR POSSESSION  
EXCEPT AS PRESCRIBED IS PROHIBITED BY  
LAW. THIS CERTIFICATE MUST BE IN THE  
POSSESSION OF THE UNDERSIGNED WHEN  
PERFORMING ASBESTOS-RELATED ACTIVITIES  
AS PRESCRIBED BY 326 IAC 18.

*George W. Ogle*  
\_\_\_\_\_  
SIGNATURE

**ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE**  
**1435 Sadlier Circle West Drive**  
**Indianapolis, Indiana 46236**  
**(317) 352-1270 / (317) 352 - 0669**

**PATRICK E. WILSON**  
**309 - 90 - 6909**


**Has Successfully Completed The Course**  
**Required Under TSCA Title II**  
**And Passed The Written Examination**  
**With a Score of 70% or Better**  
**For**

**ASBESTOS BUILDING INSPECTOR REFRESHER**

**Accredited by the**  
**Indiana Department of Environmental Management.**

**Certificate # ES00/BIR482**

**Course Dates: 11/29/2000**  
**Test Date: 11/29/2000 Expires: 11/29/2001**

  
**Sharyn Reyes**  
**Instructor**



# Environmental Management Institute

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846  
www.spea.iupui.edu/Envtl\_mgmt

This confirms that

**George Wm. (Bill) Ogle**

Completed the Requisite Initial Training for  
Asbestos Accreditation Under TSCA Title II  
and has  
Passed with a Score of 70 or Greater the Examination for  
**Asbestos Management Planner**

Course date  
March 2 - 3, 2000

Examination Date  
March 3, 2000

Jack E. Leonard, President

Certificate: MP(I) 2157  
Expires March 3, 2001

Approved by: Illinois Department of Public Health  
Indiana Department of Environmental Management



ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE  
1435 Sadlier Circle West Drive  
Indianapolis, Indiana 46239  
(317) 352-1270 / (317) 352-0669

**CLINT YATES**

316 - 92 - 7065

Has Successfully Completed The Course  
Required Under TSCA Title II  
And Passed The Written Examination  
With a Score of 70% or Better  
For

**ASBESTOS BUILDING INSPECTOR REFRESHER**

Accredited by the  
Indiana Department of Environmental Management.

Certificate # ES/BIR98/004.

Course Dates: 01/22/98 - 01/22/98  
Test Date: 01/22/98 Expires: 01/22/99



Sharyn Reyes  
Assistant / Instructor

# Environmental Management Institute

Environmental and Occupational Training Service

5610 Crawfordsville Road, Suite 15

Indianapolis, Indiana 46224-3714

317/248-4848

This confirms that

**Rex Gaddis**

Completed the Requisite Refresher Training for

Asbestos Accreditation Under TSCA Title II

and has

Passed with a Score of 70 or Greater the Examination for

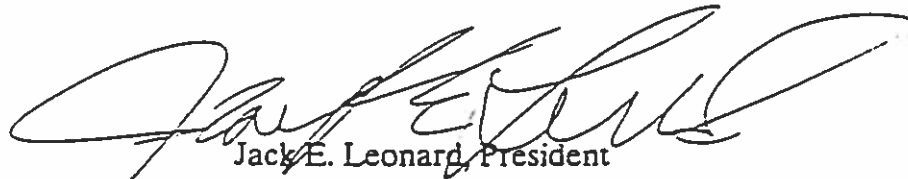
**Asbestos Building Inspector**

Course date

November 22, 1994

Examination Date

November 22, 1994



Jack E. Leonard, President

Certificate: IN(R) 2713

Expires November 22, 1995

Approved by:

Illinois Department of Public Health

Indiana Department of Environmental Management



INDIANA DEPARTMENT OF ENVIRONMENTAL MANAGEMENT  
ASBESTOS CERTIFICATE OF ACCREDITATION  
CERTIFICATE # 192249025      EXPIRATION DATE 2/18/96  
**Rex Gaddis**  
IS CERTIFIED IN THE FOLLOWING DISCIPLINE(S)  
INSPECTOR     PLANNER     DESIGNER   
SUPERVISOR     WORKER   
WASTE DISPOSAL MANAGER   
BIRTHDATE: 3/24/52    SEX: M    EYES: BLU  
HEIGHT: 5-10    WEIGHT: 220    HAIR: BRO

INDIANA DEPARTMENT OF ENVIRONMENTAL MANAGEMENT  
ASBESTOS CERTIFICATE OF ACCREDITATION  
CERTIFICATE # 190908032      EXPIRATION DATE 3/16/96  
**Rex Gaddis**  
IS CERTIFIED IN THE FOLLOWING DISCIPLINE(S)  
INSPECTOR     PLANNER     DESIGNER   
SUPERVISOR     WORKER   
WASTE DISPOSAL MANAGER   
BIRTHDATE: 3/24/52    SEX: M    EYES: BLU  
HEIGHT: 5-10    WEIGHT: 220    HAIR: BRO

*TRAINING*

**OPERATIONS AND MAINTENANCE  
INFORMATION**

### **MINOR FIBER RELEASE EPISODE**

The local education agency shall ensure that the procedures described below are followed in the event of a minor fiber release episode (i.e., the falling or dislodging of not more than 3 square or linear feet of friable ACBM):

1. Thoroughly saturate the debris using wet methods.
2. Clean the area using wet methods, protective clothing, HEPA-vacuums, mini-enclosures, glove bags, as necessary to inhibit the spread of any released fibers. At a minimum, workers should use air-purifying respirators with HEPA filters.
3. Place the asbestos debris in a sealed, leak-tight container, preferably a 6 mil. labeled plastic bag.
4. Repair the area of damaged ACM with materials such as asbestos-free spackling, plaster, cement, or insulation, or seal with latex paint or an encapsulant, or immediately have the appropriate response action implemented.
5. Each fiber release episode should be documented.

## MAJOR FIBER RELEASE EPISODE

The local education agency shall ensure that the procedures described below are followed in the event of a major fiber release episode (i.e., the falling or dislodging of more than 3 square or linear feet of friable ACM):

1. Restrict entry into the area and post signs to prevent entry into the area by persons other than those necessary to perform the response action.
2. Shut off or temporarily modify the air-handling system to prevent the distribution of fibers to other areas in the building.
3. AHERA requires that major fiber release episodes be designed by accredited Project Designers. However, the following response procedures should form the basis for response actions.
4. All the procedures recommended by EPA and required by OSHA for large-scale removal of ACM should be used. These include containment barrier, negative pressure ventilation, personal respiratory protection and protective clothing, decontamination facilities, and air testing.
5. Workers should wear "type C" respirators and protective clothing, including a body suit, hood, boots and gloves. Personal air monitoring may be conducted on representative workers, but is not required by OSHA when "type C" respirators are used.
6. Fallen debris should be sprayed with amended water and placed in plastic bags for disposal. Shovels are useful for collecting the debris. The floor should be thoroughly cleaned with a HEPA vacuum cleaner.
7. Walls, ceiling, pipes, boilers, or other surfaces where ACM was damaged or delaminated should be repaired temporarily. This might involve replastering with asbestos-free material, spraying with an encapsulant, or taping with duct tape. In some cases, ACM beyond the immediate area of damage may need to be removed to prevent additional episodes.
8. The air should be tested for asbestos fibers before the plastic barriers are removed and the area reoccupied. Testing should follow guidelines in Chapter 6 of the Purple Book and Chapter 4 of the Silver Book. That is, air should be sampled at the specified number of locations and analyzed by either phase contrast microscopy or transmission electron microscopy. However, sampling should not be done aggressively since the use of blowers and fans may dislodge fibers from the remaining ACM.

9. After the barriers have been taken down, a decontamination of the entire building or a portion of it should be considered. The need for this will depend on how rapidly the response team reacted to the episode and, in particular, how quickly the HVAC system was turned off. A thorough decontamination includes HEPA-vacuuming and/or wet wiping all carpets, furniture, and other surfaces. Decontamination of the HVAC system would involve disassembling and cleaning (HEPA-vacuuming or wet wiping) ducts, ventilators, registers, and other system parts. System filters should also be removed and replaced.

10. All equipment used in the cleanup operation should be washed or wiped with damp cloths. All disposable materials (e.g., cloths, mop heads, filters, coveralls) should be discarded as asbestos wastes.

11. Each fiber release episode should be documented.

**OPERATIONS AND MAINTENANCE REPORT**  
(Use only for O&M work less than 3 square or 3 linear feet)

L.E.A.: \_\_\_\_\_

BUILDING: \_\_\_\_\_

DATE: \_\_\_\_\_

The following information is provided in accordance with 40 CFR 763.91 and 763.94.

1. Location: \_\_\_\_\_

Homogeneous Area/Material Description \_\_\_\_\_

2. Response: Clean \_\_\_\_\_ Repair \_\_\_\_\_ Encapsulation \_\_\_\_\_

Enclosure \_\_\_\_\_ Removal \_\_\_\_\_

Reason: \_\_\_\_\_

\_\_\_\_\_

3. Work Description: \_\_\_\_\_

\_\_\_\_\_

4. Date: Start \_\_\_\_\_ Stop \_\_\_\_\_

Time: Start \_\_\_\_\_ Stop \_\_\_\_\_

5. Material: Surface \_\_\_\_\_ SF Thermal \_\_\_\_\_ LF

Other: \_\_\_\_\_ SF or \_\_\_\_\_ LF

6. Asbestos Control Method: Wet Methods \_\_\_\_\_ HEPA Vacuum \_\_\_\_\_

Glovebag \_\_\_\_\_ Mini-Enclosure \_\_\_\_\_

7. Respiratory Protection: N.A.P.R. \_\_\_\_\_ P.A.P.R. \_\_\_\_\_

Were all employees properly fit tested? YES NO NOT APPLICABLE

8. Equipment Used:

Low Vol. Pumps	_____	High Vol. Pumps	_____
FAM	_____	AFD	_____
HEPA Vac	_____		

Other: \_\_\_\_\_

9. Material Used:

6 Mil. Disposable Bags	_____	Poly	_____
Glovebags	_____	HEPA Filters	_____
Duct Tape	_____	Spray Glue	_____
Disposable Coveralls	_____	3M Pads	_____
Sponges	_____		

Encapsulants: Penetrating \_\_\_\_\_ Bridging \_\_\_\_\_

Other: \_\_\_\_\_

10. Work Personnel:

<u>NAME</u>	<u>16 HOUR TRAINED - IDEM ACCREDITED</u>			
Supervisor: _____	YES	NO	YES	NO
Worker(s): _____	YES	NO	YES	NO
_____	YES	NO	YES	NO
_____	YES	NO	YES	NO
_____	YES	NO	YES	NO
_____	YES	NO	YES	NO

11. ACBM Disposal: Storage: YES NO, If yes, where stored: \_\_\_\_\_

If no, where disposed: Landfill: \_\_\_\_\_

12. Final Visual Inspection Approved: \_\_\_\_\_

(LEA Designated Person - Printed Name)

\_\_\_\_\_  
(LEA Designated Person - Signature)



**REMOVAL PROJECT  
INFORMATION**

*SHORT TERM WORKER PROGRAM*

**GREATER CLARK COUNTY SCHOOLS**

**SHORT-TERM WORKER SIGN OFF SHEET**

This form should be signed each and every time before a "short-term worker" (telephone repair worker, utility worker, etc.) performs work that may cause him to come in contact with ACBM or suspected ACBM assumed to be ACM. One copy of this form should then be forwarded to the LEA designated person, and one copy should be maintained in the school building's copy of the supplemental binder provided by Alliance Indiana, Inc., in order to fulfill the LEA's recordkeeping requirements. The third copy should be forwarded to Alliance Indiana, Inc. for placement in its copy of the supplemental binder.

School Building Name - Service Center Date \_\_\_\_\_

I certify that before performing any work which would possibly cause me to come in contact with Asbestos Containing Building Materials (ACBM), I was provided with adequate information regarding the locations of ACBM and suspected ACBM assumed to be ACM in the above-mentioned school building where I performed the work.

Signature - \_\_\_\_\_

Company - \_\_\_\_\_

Description of work (including number of days on site) - \_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

