



ALLIANCE
Environmental Group, Inc.

THE ENVIRONMENTAL SOLUTION

GREATER CLARK COUNTY SCHOOLS

CLARK COUNTY MIDDLE HIGH SCHOOL

AHERA

ASBESTOS MANAGEMENT PLAN

**DESIGNATED PERSON
TRUTH AND CORRECT STATEMENT**


Local Education Agency – Greater Clark County Schools
2112 Utica-Sellersburg Road
Jeffersonville, Indiana 47130

Designated Person - Alliance Environmental Group, Inc.
Sandra Shadley
5153 Commerce Square Drive, Suite E
Indianapolis, Indiana 46237

This Truth and Correct Statement, as outlined in 40 CFR 763.93(i), certifies that the general, local education agency responsibilities, as stipulated by 40 CFR 763.84, have been or will be met. These responsibilities include:

1. Ensure that the activities of any persons who perform inspections, reinspections, and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with 40 CFR 763 Subpart E.
2. Ensure all custodial and maintenance employees are properly trained as required by 40 CFR 763 Subpart E and other applicable Federal and/or State regulations (e.g., the Occupational Safety and Health Administration Asbestos Standard for Construction, the EPA Worker Protection Rule, or applicable State regulations).
3. Ensure that workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress.
4. Ensure that short-term workers (e.g., telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.
5. Ensure that warning labels are posted in accordance with Section 763.95.
6. Ensure management plans are available for inspection and notification of such availability has been provided as specified in the management plan under Section 763.93(g).
7. The undersigned person designated by the LEA pursuant to Section 763.84(g) (1) has received adequate training as stipulated in Section 763.84(g) (2).
8. The LEA has and will consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under Part 763.

Signature: _____

Date: November 6, 2016

Sandra S. Shadley

ASBESTOS PROGRAM MASTER INDEX

The following volumes are part of the Asbestos Program for the **GREATER CLARK COUNTY SCHOOLS**:

- A. Original Asbestos Management Plan for each school building.
- B. Asbestos Management Plan Supplement for each school building.
 - 1. Amendments to Management Plan
 - 2. Remaining Materials Report
 - 3. Surveillance, Reinspection and Additional Bulk Sampling Information
 - 4. Annual Notifications, Accreditations and Training Records
 - 5. Operations and Maintenance Records
 - 6. Asbestos Removal Projects
 - 7. Short Term Worker Program

Copies of both volumes are found in the respective buildings. The Administration Building also contains duplicate copies of both volumes for each building in their entirety.

GREATER CLARK COUNTY SCHOOLS
ADMINISTRATION BUILDING
TABLE OF CONTENTS

AMENDMENTS TO MANAGEMENT PLAN	1
REMAINING MATERIALS REPORT	2
SURVEILLANCE, REINSPECTION AND ADDITIONAL BULK SAMPLING INFORMATION	3
ANNUAL NOTIFICATIONS, ACCREDITATIONS, AND TRAINING	4
OPERATIONS AND MAINTENANCE RECORDS	5
ASBESTOS REMOVAL PROJECTS	6
SHORT TERM WORKER INFORMATION	7

AMENDMENTS TO THE MANAGEMENT PLAN

GREATER CLARK COUNTY SCHOOLS
ADMINISTRATION BUILDING

LEA RESPONSIBILITY CERTIFICATION

LEA Designated Person - ALLIANCE INDIANA, INC.


Signature - Bruce Wallace, President/CEO

May 1, 1995
Date

ACCREDITATION STATEMENT

The Greater Clark County Schools ensures that the following items will be carried out:

Activities of any persons who perform inspections, reinspections, and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with Subpart E of this part.

All custodial and maintenance employees are properly trained as required by this Subpart E and other applicable Federal and/or State regulations (e.g., the OSHA asbestos standard for construction, the EPA worker protection rule, or applicable State regulations).

Workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, and post response action activities, including periodic reinspection and surveillance activities that are planned or in progress.

Short-term workers (e.g., telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.

Warning labels are posted in accordance with 763.95.

Management plans are available for inspection and notification of such availability has been provided as specified in the management plan under 763.93(g).

Designate a person to ensure that requirements under this section are properly implemented.

Designated person receives adequate training to perform duties assigned under this section. Such training shall provide, as necessary, basic knowledge of:

Health effects of asbestos

Detection, identification, and assessment of ACM

Options for controlling ACBM

Asbestos management programs

Relevant Federal and State regulations concerning asbestos, including those in this Subpart E and those of the OSHA, U.S. Department of Labor, the U.S. Department of Transportation and the U.S. Environmental Protection Agency.

Consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under this subpart.

AMENDMENT TO THE MANAGEMENT PLAN

LEA Name - Greater Clark County Schools

Building - Administration Building

Subject - LEA Designated Person Change

Effective May 1, 1995 the Designated Person for the
Greater Clark County Schools is:

Alliance Indiana, Inc.
1433 Sadlier Circle West Drive
Indianapolis, Indiana 46239
(317) 351-5600

Management Planner: Rex Gaddis

Accreditation No. 192218025



Signature

May 1, 1995
Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - Administration Building

Subject- New material

Reference - HA A Cove Base

Original Assessment - No assessment in original inspection.

Amended Assessment - The cove base in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025



Signature



Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - Administration Building

Subject- New material

Reference - HA B Cove Base Mastic

Original Assessment - No assessment in original inspection.


Amended Assessment - The cove base mastic in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner


Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025



Signature



Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - Administration Building

Subject- New material

Reference - HA C Transite Walls

Original Assessment - No assessment in original inspection.


Amended Assessment - The moveable walls in the building often contain transite. This was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025



Signature



Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - Administration Building

Subject- New material

Reference - HA D Fittings

Original Assessment - No assessment in original inspection.

Amended Assessment - The fittings in the boiler room were not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner


Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025



Signature



Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - Administration Building

Subject- New material

Reference - HA E Boiler gaskets

Original Assessment - No assessment in original inspection.


Amended Assessment - The gaskets in the boiler room were not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner


Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025



Signature



Date

AMENDMENT TO MANAGEMENT PLAN

Building Name - Administration Building

Subject - Removal of Homogeneous Area from Management Plan

Amendment - Homogeneous area designation "E" covering gaskets on boiler doors in the boiler room will be removed from the Management Plan. The boiler was removed in December 1999 and the gasket material was found to be fiberglass.

Management Planner: George Wm. Ogle

Accreditation Number: 191928071


Signature


Date

AMENDMENT TO MANAGEMENT PLAN


Building Name - (Now Former) Administration Building, W.E. Wilson Elementary School, Thomas Jefferson Elementary School, Jeffersonville High School, River Valley Middle School, Corden Porter Center, Corden Porter Building #3, Corden Porter Building #4, and the Service Center/Bus Garage


Subject - Typographical Error

Amendment - A typographical error was made on the paperwork for the Periodic Surveillance that was conducted in December 2001. The pages in the Management Plan Supplement which are dated 12/10/2002 should read 12/10/2001.

Management Planner: George Wm. Ogle

Accreditation Number: 191523030


Signature

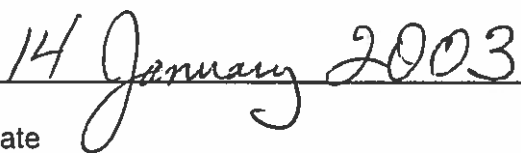
Date

AMENDMENT TO MANAGEMENT PLAN


Building Name - Former Administration Building


Subject - Removal of Materials from Management Plan

Amendment - Homogeneous area designation "A" covering cove base throughout the building; homogeneous area designation "B" covering cove base mastic throughout the building; and homogeneous area designation "C" covering transite walls throughout the building will be removed from the Management Plan. These materials were sampled by an accredited inspector and analyzed by an accredited laboratory. They were found to be negative for asbestos content.

Management Planner: George Wm. Ogle

Accreditation Number: 191523030

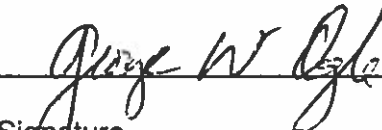
Signature

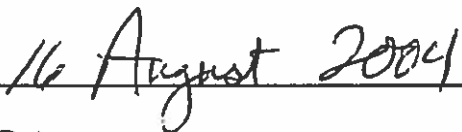
Date

AMENDMENT TO MANAGEMENT PLAN

LEA Name - Greater Clark County Schools

Subject - LEA Designated Person Change

Amendment - Effective March 2005, the Designated Person for the Greater Clark County Schools is:


Alliance Environmental Group, Inc.
5340 Commerce Circle, Suite E
Indianapolis, Indiana 46237
(317) 865-3400

Personnel contributing to this Management Plan are licensed in according with 40 CFR 763.93(e)(12).

Management Planner: Sandra S. Shadley

Accreditation Number: 19A002720


Signature


Date

REMAINING MATERIALS

Greater Clark County School Corporation

Remaining Materials Report

4/23/2020

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>Clark County Middle High School</u>						
01	VAT	957	SF	Known	Options/Admin Office and records room	O&M
02	Mastic	957	SF	Known	Options/Admin Office and records room	O&M

Greater Clark County School Corporation

Remaining Materials Report

1/14/2020

HA ID	HA Description	Quantity		Asbestos	HA Location	Plannned Response Action
<u>Clark County Middle High School</u>						
01	VAT	957	SF	Known	Options/Admin Office and records room	O&M
02	Mastic	957	SF	Known	Options/Admin Office and records room	O&M

Greater Clark County School Corporation

Remaining Materials Report

5/16/2019

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>Clark County Middle High School</u>						
01	VAT	957	SF	Known	Options/Admin Office and records room	O&M
02	Mastic	957	SF	Known	Options/Admin Office and records room	O&M

Greater Clark County School Corporation

Remaining Materials Report

11/13/2018

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>Clark County Middle High School</u>						
01	VAT	957	SF	Known	Options/Admin Office and records room	O&M
02	Mastic	957	SF	Known	Options/Admin Office and records room	O&M

Greater Clark County School Corporation

Remaining Materials Report

5/2/2018

HA ID	HA Description	Quantity		Asbestos	HA Location	Plannned Response Action
<u>Clark County Middle High School</u>						
01	VAT	957	SF	Known	Options/Admin Office and records room	O&M
02	Mastic	957	SF	Known	Options/Admin Office and records room	O&M

Greater Clark County School Corporation

Remaining Materials Report

10/18/2017

HA ID	HA Description	Quantity		Asbestos	HA Location	Plannned Response Action
<u>Clark County Middle High School</u>						
01	VAT	957	SF	Known	Options/Admin Office and records room	O&M
02	Mastic	957	SF	Known	Options/Admin Office and records room	O&M

Greater Clark County School Corporation

Remaining Materials Report

4/13/2017

HA ID	HA Description	Quantity		Asbestos	HA Location	Plannned Response Action
<u>Clark County Middle High School</u>						
01	VAT	957	SF	Known	Options/Admin Office and records room	O&M
02	Mastic	957	SF	Known	Options/Admin Office and records room	O&M

Greater Clark County School Corporation

Remaining Materials Report

11/3/2016

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>Clark County Middle High School</u>						
01	VAT	957	SF	Known	Options/Admin Office and records room	O&M
02	Mastic	957	SF	Known	Options/Admin Office and records room	O&M

Greater Clark County School Corporation

Remaining Materials Report

4/28/2016

HA ID	HA Description	Quantity		Asbestos	HA Location	Plannned Response Action
<u>Clark County Middle High School</u>						
01	VAT	957	SF	Known	Options/Admin Office and records room	O&M
02	Mastic	957	SF	Known	Options/Admin Office and records room	O&M

Greater Clark County School Corporation

Remaining Materials Report

10/20/2015

HA ID	HA Description	Quantity		Asbestos	HA Location	Plannned Response Action
<u>Clark County Middle High School</u>						
01	VAT	957	SF	Known	Options/Admin Office and records room	O&M
02	Mastic	957	SF	Known	Options/Admin Office and records room	O&M

**Greater Clark County Schools
Remaining Materials Report
April 22, 2015**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
-----	----------	----------	----------	----------	--------------------

Clark County Middle High School

01	VAT	957 SF	Y	Options/Admin Office and records room	O & M
02	Mastic	957 SF	Y	Options/Admin Office and records room	O & M

**Greater Clark County Schools
Remaining Materials Report
October 22, 2014**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
-----	----------	----------	----------	----------	--------------------

Clark County Middle High School

01	VAT	957 SF	Y	Options/Admin Office and records room	O & M
02	Mastic	957 SF	Y	Options/Admin Office and records room	O & M

**Greater Clark County Schools
Remaining Materials Report
April 21, 2014**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
-----	----------	----------	----------	----------	--------------------

Clark County Middle High School

01	VAT	957 SF	Y	Options/Admin Office and records room	O & M
02	Mastic	957 SF	Y	Options/Admin Office and records room	O & M

Greater Clark County Schools
Remaining Materials Report
April 24, 2013

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Clark County Middle High School</u>					
01	VAT	957 SF	Y	Options/Admin Office and records room	O & M
02	Mastic	957 SF	Y	Options/Admin Office and records room	O & M

Greater Clark County Schools
Remaining Materials Report
October 24, 2012

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Auxiliary Services</u>					
01	VAT	957 SF	Y	Options/Admin Office and records room	O & M
02	Mastic	957 SF	Y	Options/Admin Office and records room	O & M

Greater Clark County Schools
Remaining Materials Report
June 25, 2012

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Auxiliary Services</u>					
01	VAT	957 SF	Y	Options/Admin Office and records room	O & M
02	Mastic	957 SF	Y	Options/Admin Office and records room	O & M

Greater Clark County Schools
Remaining Materials Report
June 27, 2011

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Auxiliary Services</u>					
01	VAT	957 SF	Y	Options/Admin Office and records room	O & M
02	Mastic	957 SF	Y	Options/Admin Office and records room	O & M

**Greater Clark County Schools
Remaining Materials Report
December 6, 2010**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Former Administration Building</u>					
01	VAT	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M
02	Mastic	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M

**Greater Clark County Schools
Remaining Materials Report
June 30, 2010**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Former Administration Building</u>					
01	VAT	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M
02	Mastic	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M

Greater Clark County Schools
Remaining Materials Report
December 7, 2009

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Former Administration Building</u>					
01	VAT	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M
02	Mastic	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M

Greater Clark County Schools
Remaining Materials Report
June 10, 2009

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Former Administration Building</u>					
01	VAT	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M
02	Mastic	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M

**Greater Clark County Schools
Remaining Materials Report
December 10, 2008**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Former Administration Building</u>					
01	VAT	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M
02	Mastic	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M

**Greater Clark County Schools
Remaining Materials Report
June 30, 2008**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Former Administration Building</u>					
01	VAT	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M
02	Mastic	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M

Greater Clark County Schools
Remaining Materials Report
December 14, 2007

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Former Administration Building</u>					
01	VAT	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M
02	Mastic	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M

Greater Clark County Schools
Remaining Materials Report
July 9, 2007

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Former Administration Building</u>					
01	VAT	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M
02	Mastic	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M

Greater Clark County Schools
Remaining Materials Report
December 18, 2006

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Former Administration Building</u>					
01	VAT	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M
02	Mastic	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M

**Greater Clark County Schools
Remaining Materials Report
June 28, 2006**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Former Administration Building</u>					
01	VAT	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M
02	Mastic	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M

Greater Clark County Schools
Remaining Materials Report
January 25, 2006

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Former Administration Building</u>					
01	VAT	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M
02	Mastic	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M

Greater Clark County Schools
Remaining Materials Report
July 20, 2005

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Former Administration Building</u>					
01	VAT	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M
02	Mastic	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M

Greater Clark County Schools
Remaining Materials Report
December 9, 2004

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Former Administration Building</u>					
01	VAT	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M
02	Mastic	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M

Greater Clark County Schools
 Remaining Materials Report
 July 2, 2004

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Former Administration Building</u>					
01	VAT	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M
02	Mastic	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M

Greater Clark County Schools
Remaining Materials Report
December 9, 2003

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Former Administration Building</u>					
01	VAT	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M
02	Mastic	957 SF	A	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M
A	Cove base	Approx. 1,200 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 400 SF	A	Throughout the building	O & M
C	Transite walls	Approx. 8,900 SF	A	Throughout the building	O & M

**Greater Clark County Schools
Remaining Materials Report
June 13, 2003**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities	
<u>Former Administration Building</u>						
01	VAT	957	SF	Y	Copier and Records Room	O & M
02	Mastic	957	SF	A	Copier and Records Room	O & M
A	Cove base	Approx. 1,200	LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 400	SF	A	Throughout the building	O & M
C	Transite walls	Approx. 8,900	SF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
December 18, 2003

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Former Administration Building</u>					
01	VAT	957 SF	Y	Copier and Records Room	O & M
02	Mastic	957 SF	A	Copier and Records Room	O & M
A	Cove base	Approx. 1,200 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 400 SF	A	Throughout the building	O & M
C	Transite walls	Approx. 8,900 SF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
June 19, 2002

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Greater Clark County Administration Bldg</u>					
01	VAT	957 SF	Y	Copier and Records Room	O & M
02	Mastic	957 SF	A	Copier and Records Room	O & M
A	Cove base	Approx. 1,200 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 400 SF	A	Throughout the building	O & M
C	Transite walls	Approx. 8,900 SF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
December 12, 2001

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities	
<u>Greater Clark County Administration Bldg</u>						
01	VAT	957	SF	Y	Copier and Records Room	O & M
02	Mastic	957	SF	A	Copier and Records Room	O & M
A	Cove base	Approx. 1,200	LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 400	SF	A	Throughout the building	O & M
C	Transite walls	Approx. 8,900	SF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
July 12, 2001

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities	
<u>Greater Clark County Administration Bldg</u>						
01	VAT	957	SF	Y	Copier and Records Room	O & M
02	Mastic	957	SF	A	Copier and Records Room	O & M
A	Cove base	Approx. 1,200	LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 400	SF	A	Throughout the building	O & M
C	Transite walls	Approx. 8,900	SF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
January 11, 2001

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
Greater Clark County Administration Bldg					
01	VAT	957 SF	Y	Copier and Records Room	O & M
02	Mastic	957 SF	A	Copier and Records Room	O & M
A	Cove base	Approx. 1,200 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 400 SF	A	Throughout the building	O & M
C	Transite walls	Approx. 8,900 SF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
June 29, 2000

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Greater Clark County Administration Bldg</u>					
01	VAT	957 SF	Y	Copier and Records Room	O & M
02	Mastic	957 SF	A	Copier and Records Room	O & M
A	Cove Base	Unquantified LF	A	Throughout Building	O & M
B	Cove Base Mastic	Unquantified LF	A	Throughout the building	O & M
C	Transite Walls	Unquantified SF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
February 23, 2000

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities	
Greater Clark County Administration Bldg						
01	VAT	957	SF	Y	Copier and Records Room	O & M
02	Mastic	957	SF	A	Copier and Records Room	O & M
A	Cove Base	Unquantified	LF	A	Throughout Building	O & M
B	Cove Base Mastic	Unquantified	LF	A	Throughout the building	O & M
C	Transite Walls	Unquantified	SF	A	Throughout the building	O & M
E	Gaskets on Boiler Doors	Unquantified	SF	A	Boiler Room	O & M

Greater Clark County Schools
Remaining Materials Report
July 6, 1999

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities	
Greater Clark County Administration Bldg						
01	VAT	957	SF	Y	Copier and Records Room	O & M
02	Mastic	957	SF	A	Copier and Records Room	O & M
A	Cove Base	Unquantified	LF	A	Throughout Building	O & M
B	Cove Base Mastic	Unquantified	LF	A	Throughout the building	O & M
C	Transite Walls	Unquantified	SF	A	Throughout the building	O & M
E	Gaskets on Boiler Doors	Unquantified	SF	A	Boiler Room	O & M

*PERIODIC SURVEILLANCE
REINSPECTION
ADDITIONAL BULK SAMPLING
INFORMATION*

ASSESSMENTS FOR AHERA

1. Damaged or significantly damaged thermal systems insulation.
2. Damaged friable surfacing ACM.
3. Significantly damaged friable surfacing ACM.
4. Damaged or significantly damaged friable miscellaneous ACM.
5. ACBM with potential for damage.
6. ACBM with potential for significant damage.
7. Any remaining friable ACBM or friable suspected ACBM.

If a material is non-friable, it does not require an assessment rating under AHERA.

Due to the differences in what is required of the LEA for damaged material compared to significantly damaged material, Alliance has modified the assessment scale to the following:

- 1A. Significantly damaged thermal systems insulation.
- 1B. Damaged thermal systems insulation.
- 4A. Significantly damaged friable miscellaneous ACM.
- 4B. Damaged friable miscellaneous ACM.

SURVEILLANCE INFORMATION

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

DATE PLANNED	DATE COMPLETED	COMPLETED BY
<u>October 2014</u>	October 22, 2014	
<u>April 2015</u>	April 22, 2015	
<u>October 2015</u>	October 20, 2016	
<u>April 2016</u>	RE-INSPECTION	
<u>October 2016</u>	November 3, 2016	
<u>April 2017</u>	April 13, 2017	
<u>October 2017</u>	October 18, 2017	
<u>April 2018</u>	May 2, 2018	
<u>October 2018</u>	November 13, 2018	
<u>April 2019</u>	RE-INSPECTION	
<u>October 2019</u>		
<u>April 2020</u>		
<u>October 2020</u>		

SURVEILLANCE INFORMATION

PERIODIC SURVEILLANCE PLAN SCHEDULE

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>JUNE 2009</u>	<u>JUNE 2009</u>	<u>Bill Ogle</u>
<u>DECEMBER 2009</u>	<u>Dec 2009</u>	<u>Bill Ogle</u>
<u>JUNE 2010</u>	<u>JUNE 2010</u>	<u>Sandy Shadley</u>
<u>DECEMBER 2010</u>	<u>December 2010</u>	<u>Paul Krick</u>
<u>JUNE 2011</u>	<u>JUNE 2011</u>	<u>Sandy Shadley</u>
<u>DECEMBER 2011</u>	<u>December 2011</u>	<u>Sandy Shadley</u>
<u>JUNE 2012</u>	<u>June 2012</u>	<u>Jeff Hechtin</u>
<u>DECEMBER 2012</u>	<u>October 2012</u>	<u>Jeff Hechtin</u>
<u>JUNE 2013</u>	<u>Reinspection</u>	
<u>DECEMBER 2013</u>		

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each reinspection will be maintained in this binder.

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>JUNE 2003</u>	<u>June '03</u>	<u>C. Sparks</u>
<u>DECEMBER 2003</u>	<u>Dec. '03</u>	<u>C. Sparks</u>
<u>JUNE 2004</u>	<u>REINSPECTION</u>	<u>C. Sparks</u>
<u>DECEMBER 2004</u>	<u>Dec. '04</u>	<u>C. Sparks</u>
<u>JUNE 2005</u>	<u>July '05</u>	<u>G. Ogles</u>
<u>DECEMBER 2005</u>	<u>Jan 06</u>	<u>G Ogles</u>
<u>JUNE 2006</u>	<u>June 06</u>	<u>C Amos</u>
<u>DECEMBER 2006</u>	<u>Dec 18 06</u>	<u>B Ogles</u>
<u>JUNE 2007</u>	<u>July 2007</u> <u>REINSPECTION</u>	<u>Bill Ogles</u>
<u>DECEMBER 2007</u>	<u>December 2007</u>	<u>Bill Ogles</u>
<u>JUNE 2008</u>	<u>June 2008</u>	<u>Bill Ogles</u>
<u>DECEMBER 2008</u>	<u>December 2008</u>	<u>Bill Ogles</u>

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

ADMINISTRATION BUILDING

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long they remain in the building. This inspection will be conducted semi-annually.

The following table outlines the dates on which these inspections should take place in this school building.

PERIODIC SURVEILLANCE SCHEDULE

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>DECEMBER 1995</u>	<u>12-95</u>	<u>Alliance</u>
<u>JUNE 1996</u>	<u>6-96</u>	<u>Alliance</u>
<u>DECEMBER 1996</u>	<u>12-96</u>	<u>Alliance</u>
<u>JUNE 1997</u>	<u>7-97</u>	<u>Alliance</u>
<u>DECEMBER 1997</u>	<u>1-98</u>	<u>Alliance</u>
<u>JUNE 1998</u>	<u>REINSPECTION</u>	<u>Alliance</u>
<u>DECEMBER 1998</u>	<u>12-98</u>	<u>Alliance</u>
<u>JUNE 1999</u>	<u>JUNE 99</u>	<u>ALLIANCE</u>
<u>DECEMBER 1999</u>	<u>DEC. 99</u>	<u>ALLIANCE</u>
<u>JUNE 2000</u>	<u>June 2000</u>	<u>Alliance</u>
<u>DECEMBER 2000</u>	<u>Jan. 01</u>	<u>Pat Wilson</u>
<u>JUNE 2001</u>	<u>REINSPECTION</u>	<u>P. Wilson</u>
<u>DECEMBER 2001</u>	<u>Dec. '01</u>	<u>A. Kimbrough</u>
<u>JUNE 2002</u>	<u>June '02</u>	<u>K. Calvert</u>
<u>DECEMBER 2002</u>	<u>Dec. '02</u>	<u>C. Spocks</u>

PERIODIC SURVEILLANCES

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Clark County Middle High School
Building Number 01
HA ID 01
HA Description VAT
HA Type Miscellaneous Material
HA Location Options/Admin Office and records room

Quantity 957 SF
Comments This material has been covered with carpet and was not visible to inspect.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Clark County Middle High School
Building Number 01
HA ID 02
HA Description Mastic
HA Type Miscellaneous Material
HA Location Options/Admin Office and records room

Quantity 957 SF
Comments This material was not visible to inspect.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Clark County Middle High School
Building Number 01
HA ID 01
HA Description VAT
HA Type Miscellaneous Material
HA Location Options/Admin Office and records room

Quantity 957 SF
Comments This material has been covered with carpet and was not visible to inspect.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Clark County Middle High School
Building Number 01
HA ID 02
HA Description Mastic
HA Type Miscellaneous Material
HA Location Options/Admin Office and records room

Quantity 957 SF
Comments This material was not visible to inspect.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration


Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Clark County Middle High School
Building Number 01
HA ID 01
HA Description VAT
HA Type Miscellaneous Material
HA Location Options/Admin Office and records room

Quantity 957 SF
Comments This material has been covered with carpet and was not visible to inspect.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Clark County Middle High School
Building Number 01
HA ID 02
HA Description Mastic
HA Type Miscellaneous Material
HA Location Options/Admin Office and records room

Quantity 957 SF
Comments This material was not visible to inspect.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None

Planned Response Action O&M

Inspector



Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Clark County Middle High School
Building Number 01
HA ID 01
HA Description VAT
HA Type Miscellaneous Material
HA Location Options/Admin Office and records room

Quantity 957 SF
Comments This material has been covered with carpet and was not visible to inspect.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Clark County Middle High School
Building Number 01
HA ID 02
HA Description Mastic
HA Type Miscellaneous Material
HA Location Options/Admin Office and records room

Quantity 957 SF
Comments This material was not visible to inspect.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Clark County Middle High School
Building Number 01
HA ID 01
HA Description VAT
HA Type Miscellaneous Material
HA Location Options/Admin Office and records room

Quantity 957 SF
Comments This material has been covered with carpet and was not visible to inspect.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Clark County Middle High School
Building Number 01
HA ID 02
HA Description Mastic
HA Type Miscellaneous Material
HA Location Options/Admin Office and records room

Quantity 957 SF
Comments This material was not visible to inspect.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Clark County Middle High School
Building Number 01
HA ID 01
HA Description VAT
HA Type Miscellaneous Material
HA Location Options/Admin Office and records room

Quantity 957 SF
Comments This material has been covered with carpet and was not visible to inspect.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Clark County Middle High School
Building Number 01
HA ID 02
HA Description Mastic
HA Type Miscellaneous Material
HA Location Options/Admin Office and records room

Quantity 957 SF
Comments This material was not visible to inspect.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Clark County Middle High School
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Options/Admin Office and records room


Material Description

VAT

Comments

This material has been covered with carpet and was not visible to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 4/21/2015
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Clark County Middle High School
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Options/Admin Office and records room

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 4/21/2015
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Clark County Middle High School
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location
Options/Admin Office and records room

Material Description

VAT

Comments

This material has been covered with carpet and was not visible to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Clark County Middle High School
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location
Options/Admin Office and records room


Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

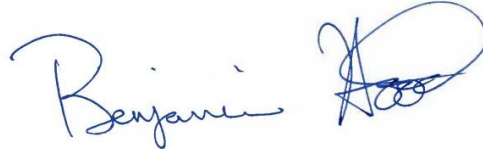

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Clark County Middle High School
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location

Options/Admin Office and records room

Material Description

VAT

Comments

This material has been covered with carpet and was not visible to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 4/21/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Clark County Middle High School
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location
Options/Admin Office and records room

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 4/21/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Auxiliary Services

HA# 01

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Options/Admin Office and records room

Material Description

VAT

Comments

This material has been covered with carpet and was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 10/24/2012

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Auxiliary Services

HA# 02

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Options/Admin Office and records room

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 10/24/2012

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Auxiliary Services

HA# 01

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Options/Admin Office and records room

Material Description

VAT

Comments

This material has been covered with carpet and was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 6/25/2012

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Jeffery R. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Auxiliary Services

HA# 02

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Options/Admin Office and records room

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 6/25/2012

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffery P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Auxiliary Services

HA# 01

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Options/Admin Office and records room

Material Description

VAT

Comments

This material has been covered with carpet and was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 12/15/2011

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana

Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Auxiliary Services

HA# 01

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Options/Admin Office and records room

Material Description

VAT

Comments

This material has been covered with carpet and was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 6/27/2011

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana

Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Auxiliary Services

HA# 02

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Options/Admin Office and records room

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 6/27/2011

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana

Accreditation Number 19A002323

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Former Administration Building

HA# 01

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

VAT

Comments

This material has been covered with carpet and was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 12/6/2010

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Paul W. Krick

State Indiana

Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building

HA# 02

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 12/6/2010

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Paul W. Krick

State Indiana

Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 01

Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

VAT

Comments

This material has been covered with new tile and was not visible to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/3/2009
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/3/2009
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 01

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

VAT

Comments

This material has been covered with new tile and was not visible to inspect.

Does Material Contain Asbestos?	Yes
Is it Friable?	No
Original Inspection Date	6/1/1992
Current Surveillance Date	6/10/2009
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Inspector


George William Ogle

State

IN

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 02

Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos?	Yes
Is It Friable?	No
Original Inspection Date	6/1/1992
Current Surveillance Date	6/10/2009
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Inspector


George William Ogle

State IN
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Former Administration Building

HA# 01

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

VAT

Comments

This material has been covered with new tile and was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 12/10/2008

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Former Administration Building

HA# 02

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 12/10/2008

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

EA Name Greater Clark County Schools
Building Name Former Administration Building

HA# 01

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

VAT

Comments

This material has been covered with new tile and was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 6/30/2008

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description


Mastic

Comments


This material was not visible to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 6/30/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

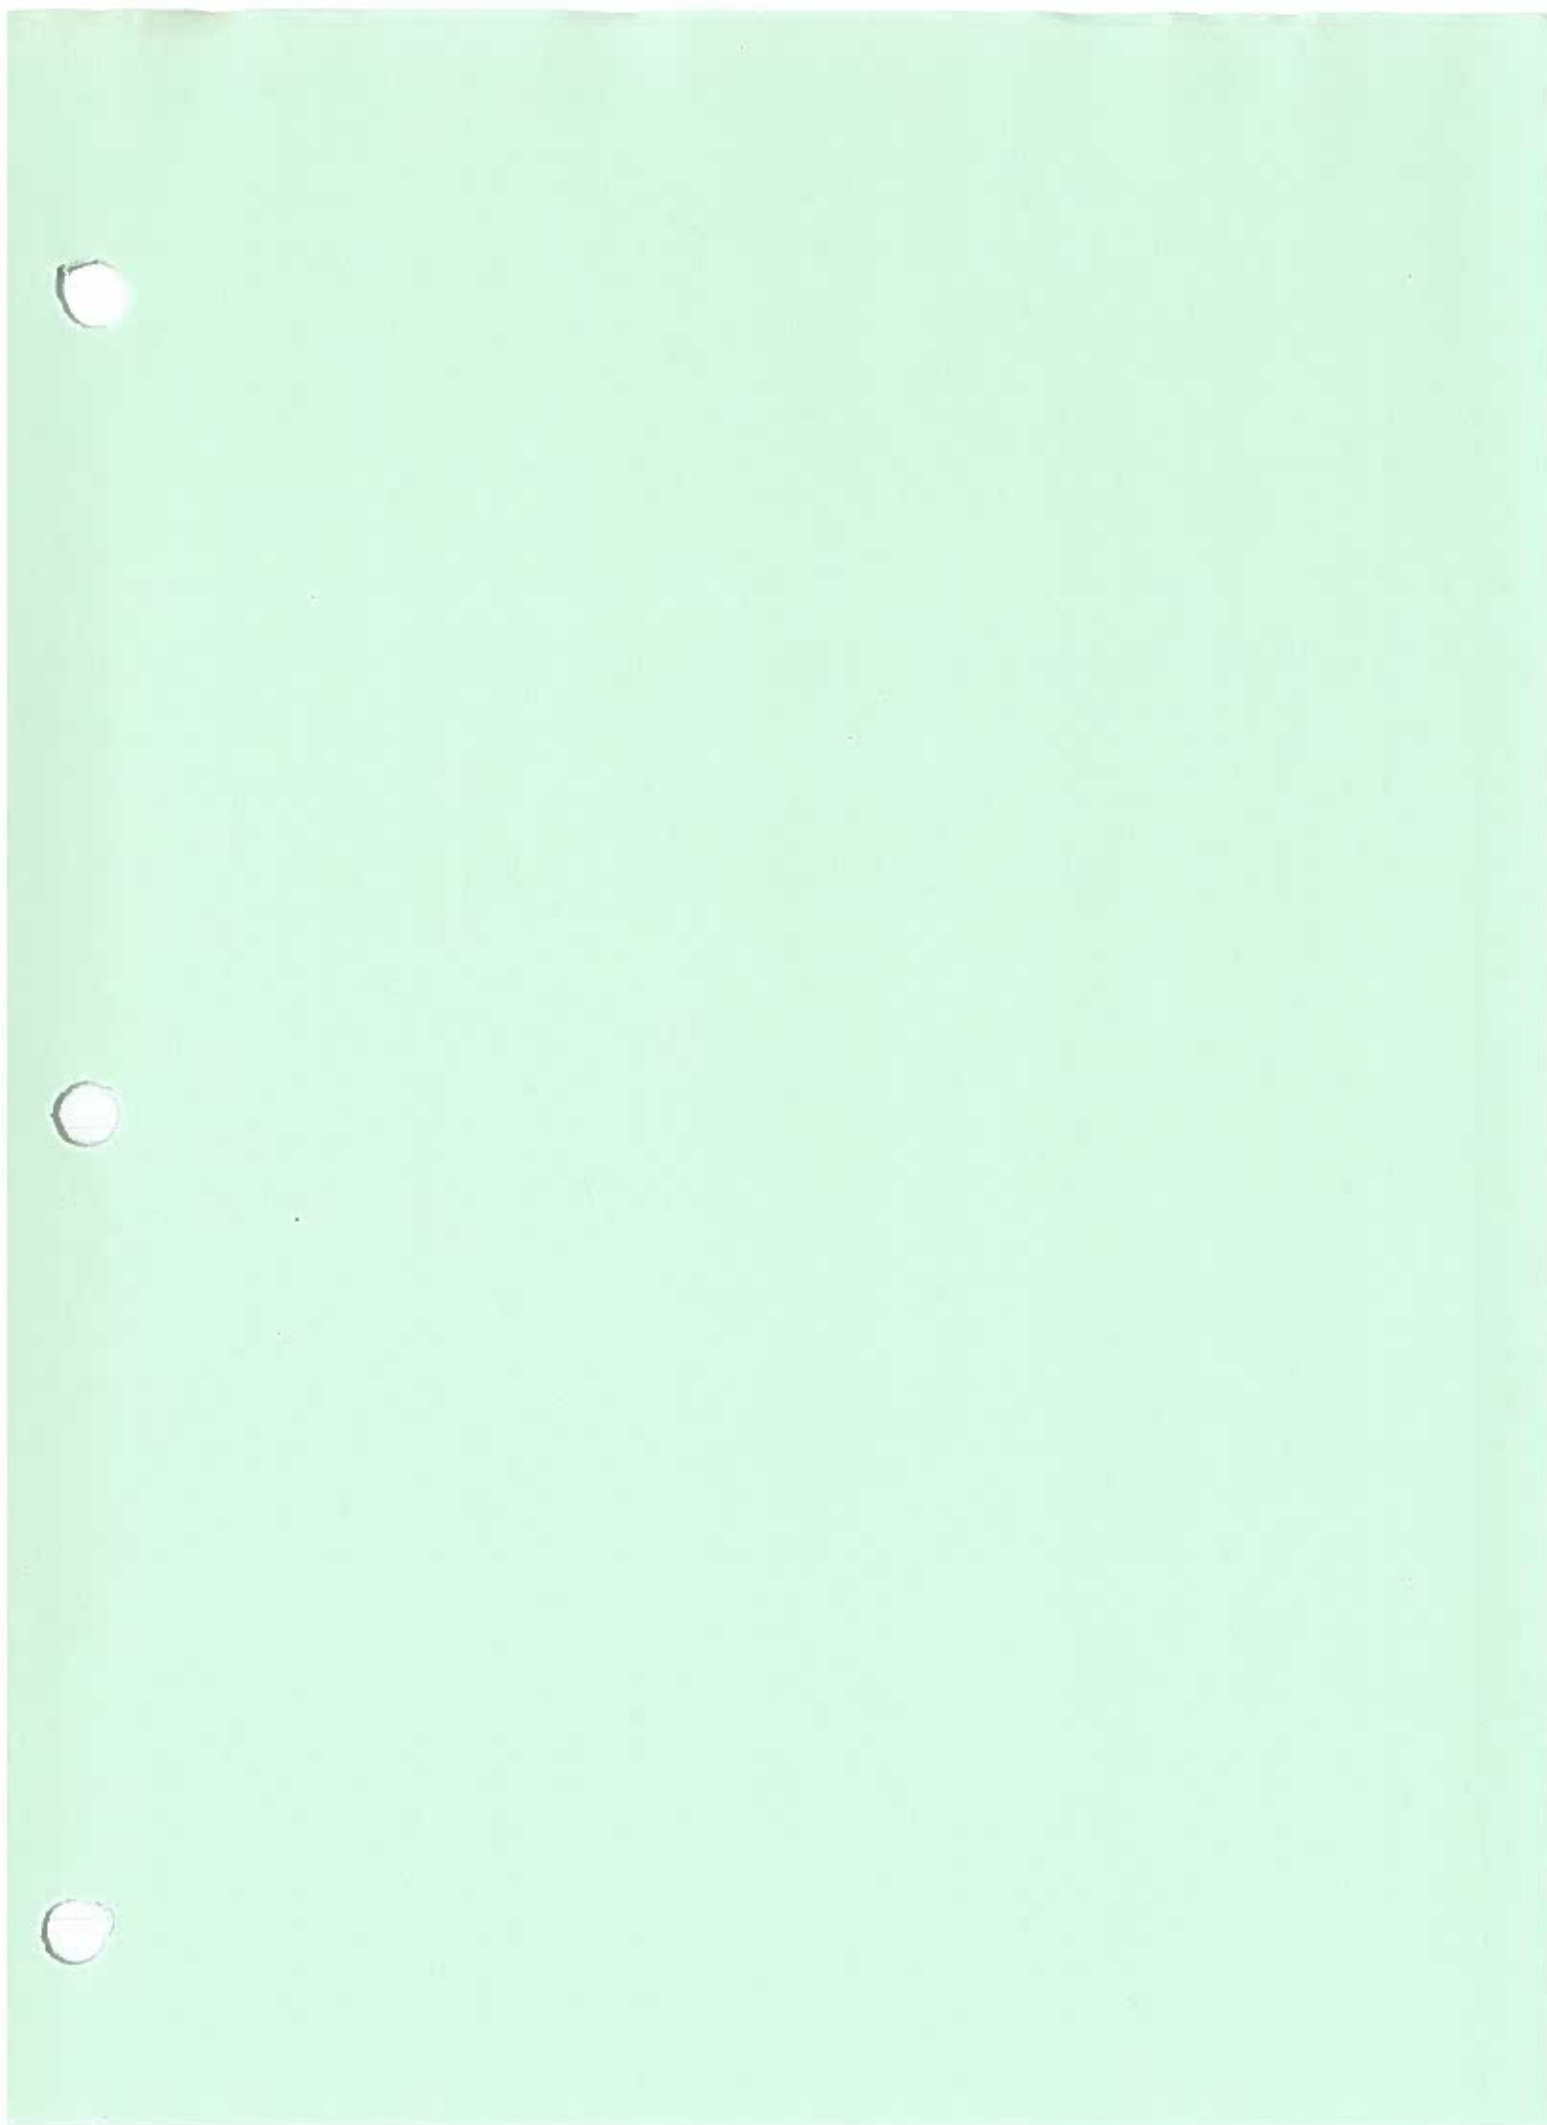

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description


VAT

Comments

This material has been covered with new tile and was not visible to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 7/18/2005
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Former Administration Building

HA# 02

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 7/18/2005

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No


Planned Response Action O & M

Inspector


George William Oggle

State Indiana

Accreditation Number 191523030

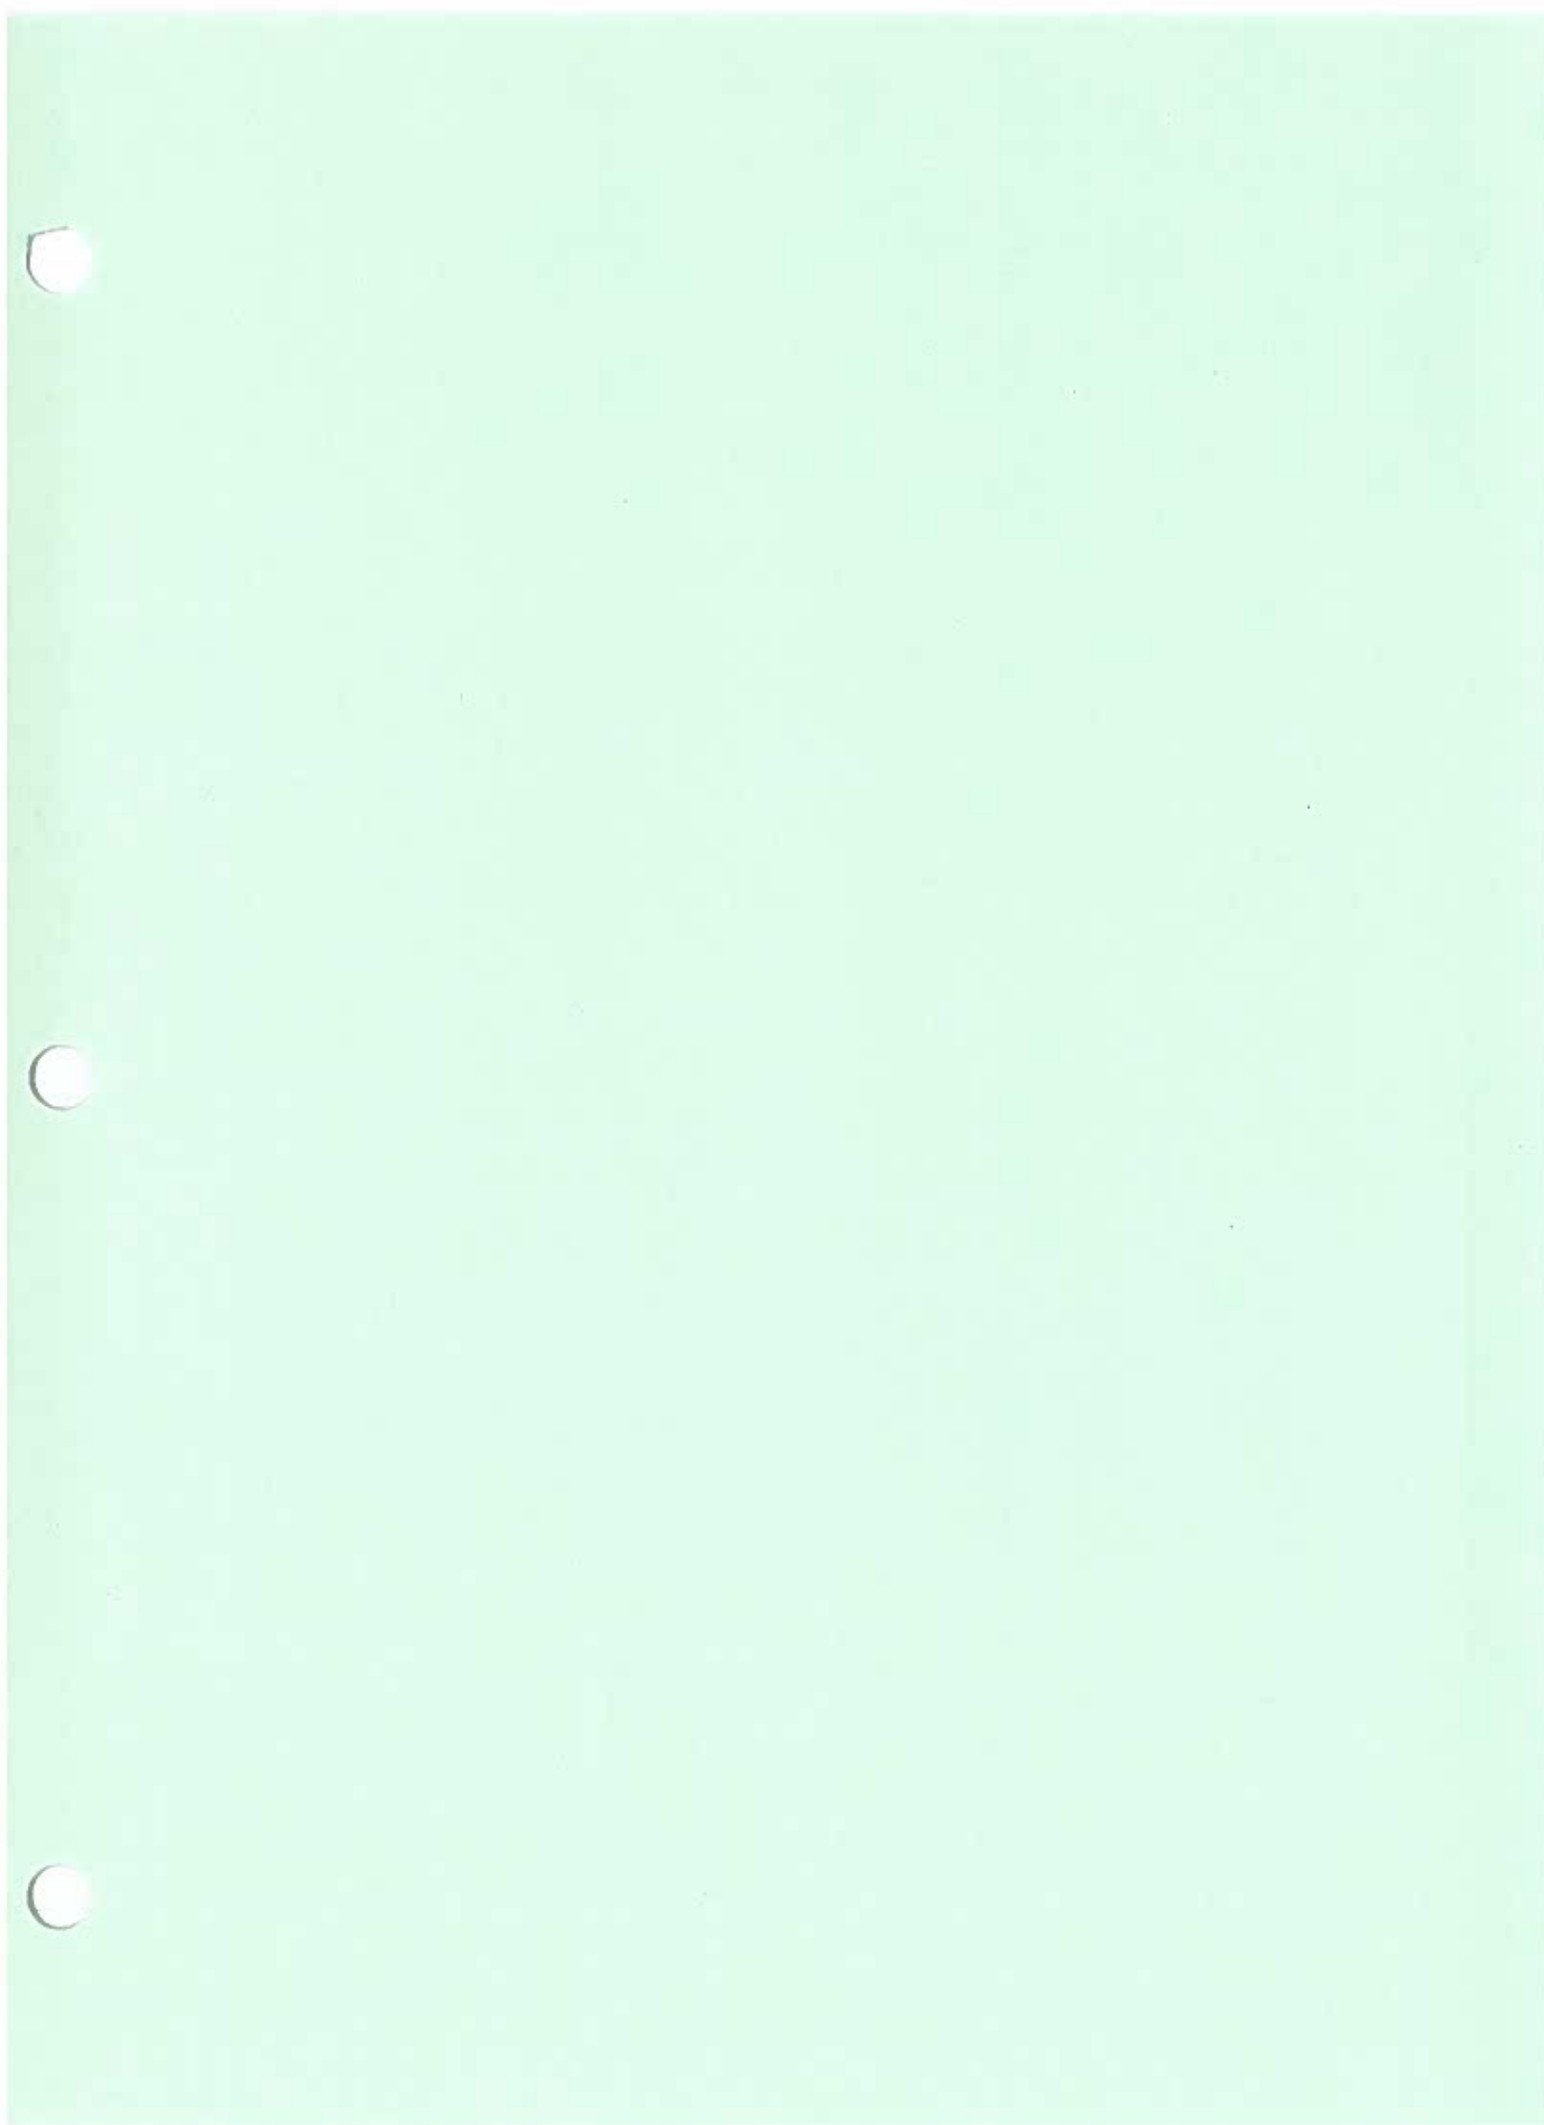

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)


Material Description
VAT

Comments

This material has been covered with new tile and was not visible to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/8/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/8/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Former Administration Building

HA# 01

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

VAT

Comments

This material was not in poor condition.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 06/01/1992

Current Surveillance Date 12/09/2003

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Christiaan Sparks

State Indiana

Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

VAT

Comments

This material has been covered with new tile and was not visible to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 12/6/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Former Administration Building

HA# 02

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 12/6/2007

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Former Administration Building

HA# 01

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

VAT

Comments

This material has been covered with new tile and was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 7/9/2007

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Surveillance Date 7/9/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Former Administration Building

HA# 01

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

VAT

Comments

This material has been covered with new tile and was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 12/18/2006

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Former Administration Building

HA# 02

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 12/18/2006

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Former Administration Building

HA# 01

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

VAT

Comments

This material has been covered with new tile and was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 6/28/2006

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Christopher Ames

State Indiana

Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Former Administration Building

HA# 02

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 6/28/2006

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Christopher Ames

State Indiana

Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Former Administration Building

HA# 01

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

VAT

Comments

This material has been covered with new tile and was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 1/23/2006

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Former Administration Building

HA# 02

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Surveillance Date 1/23/2006

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/09/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,200 LF

Material Location
Throughout the building


Material Description
Cove base

Comments

Several pieces have come loose and/or are missing throughout the building. The remaining material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/09/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector




Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 400 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
Where visible, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/09/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector 
Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# C
Type of Material Miscellaneous Material
Quantity of Material Approx. 8,900 SF


Material Location
Throughout the building

Material Description
Transite walls

Comments
The covering on some walls has separated leaving exposed material. It was not in poor condition.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/09/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

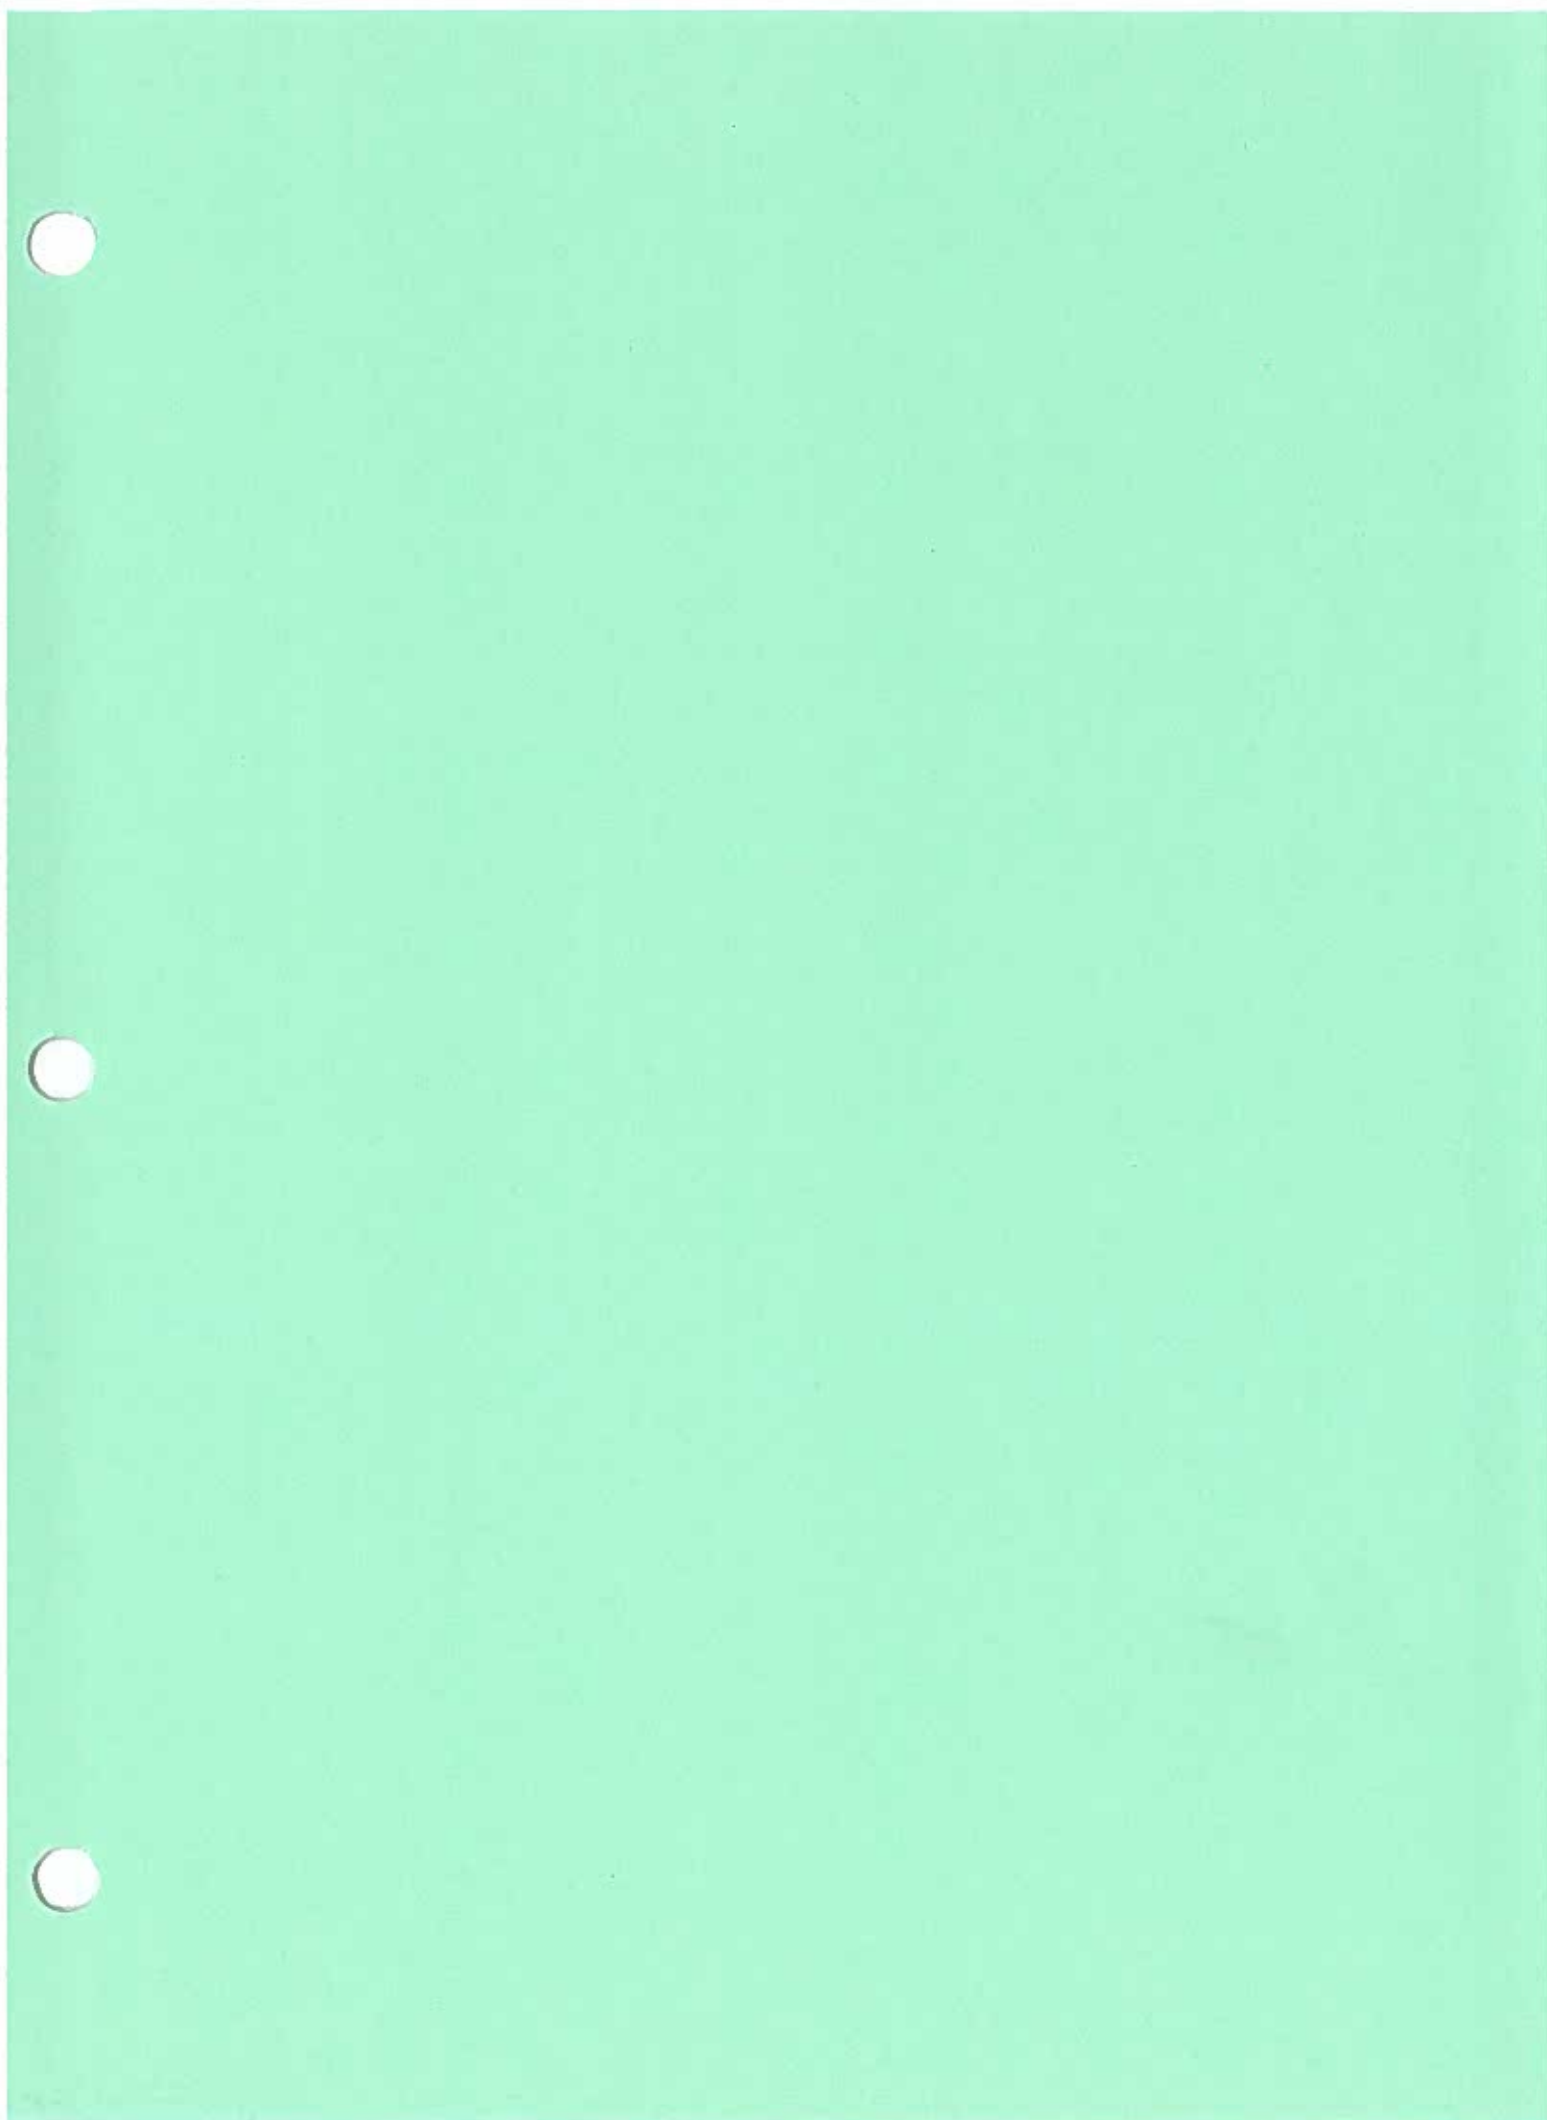

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location
Copier and Records Room

Material Description
VAT

Comments

Several room name tags have been removed and several doors could not be accessed. This material could not be located during this surveillance. Further investigation will be done as to the location of this material. Access to this building is limited to personnel with keys.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/13/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector




Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Copier and Records Room
Material Description
Mastic
Comments
This material was not visible to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/13/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector 

Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,200 LF

Material Location
Throughout the building


Material Description
Cove base

Comments

Several pieces have come loose and/or are missing throughout the building. The remaining material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/13/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

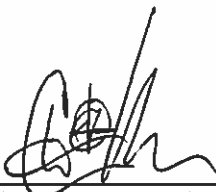

Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 400 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
Where visible, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/13/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# C
Type of Material Miscellaneous Material
Quantity of Material Approx. 8,900 SF

Material Location
Throughout the building

Material Description
Transite walls

Comments
The covering on some walls has separated leaving exposed material. It is not in poor condition.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/13/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

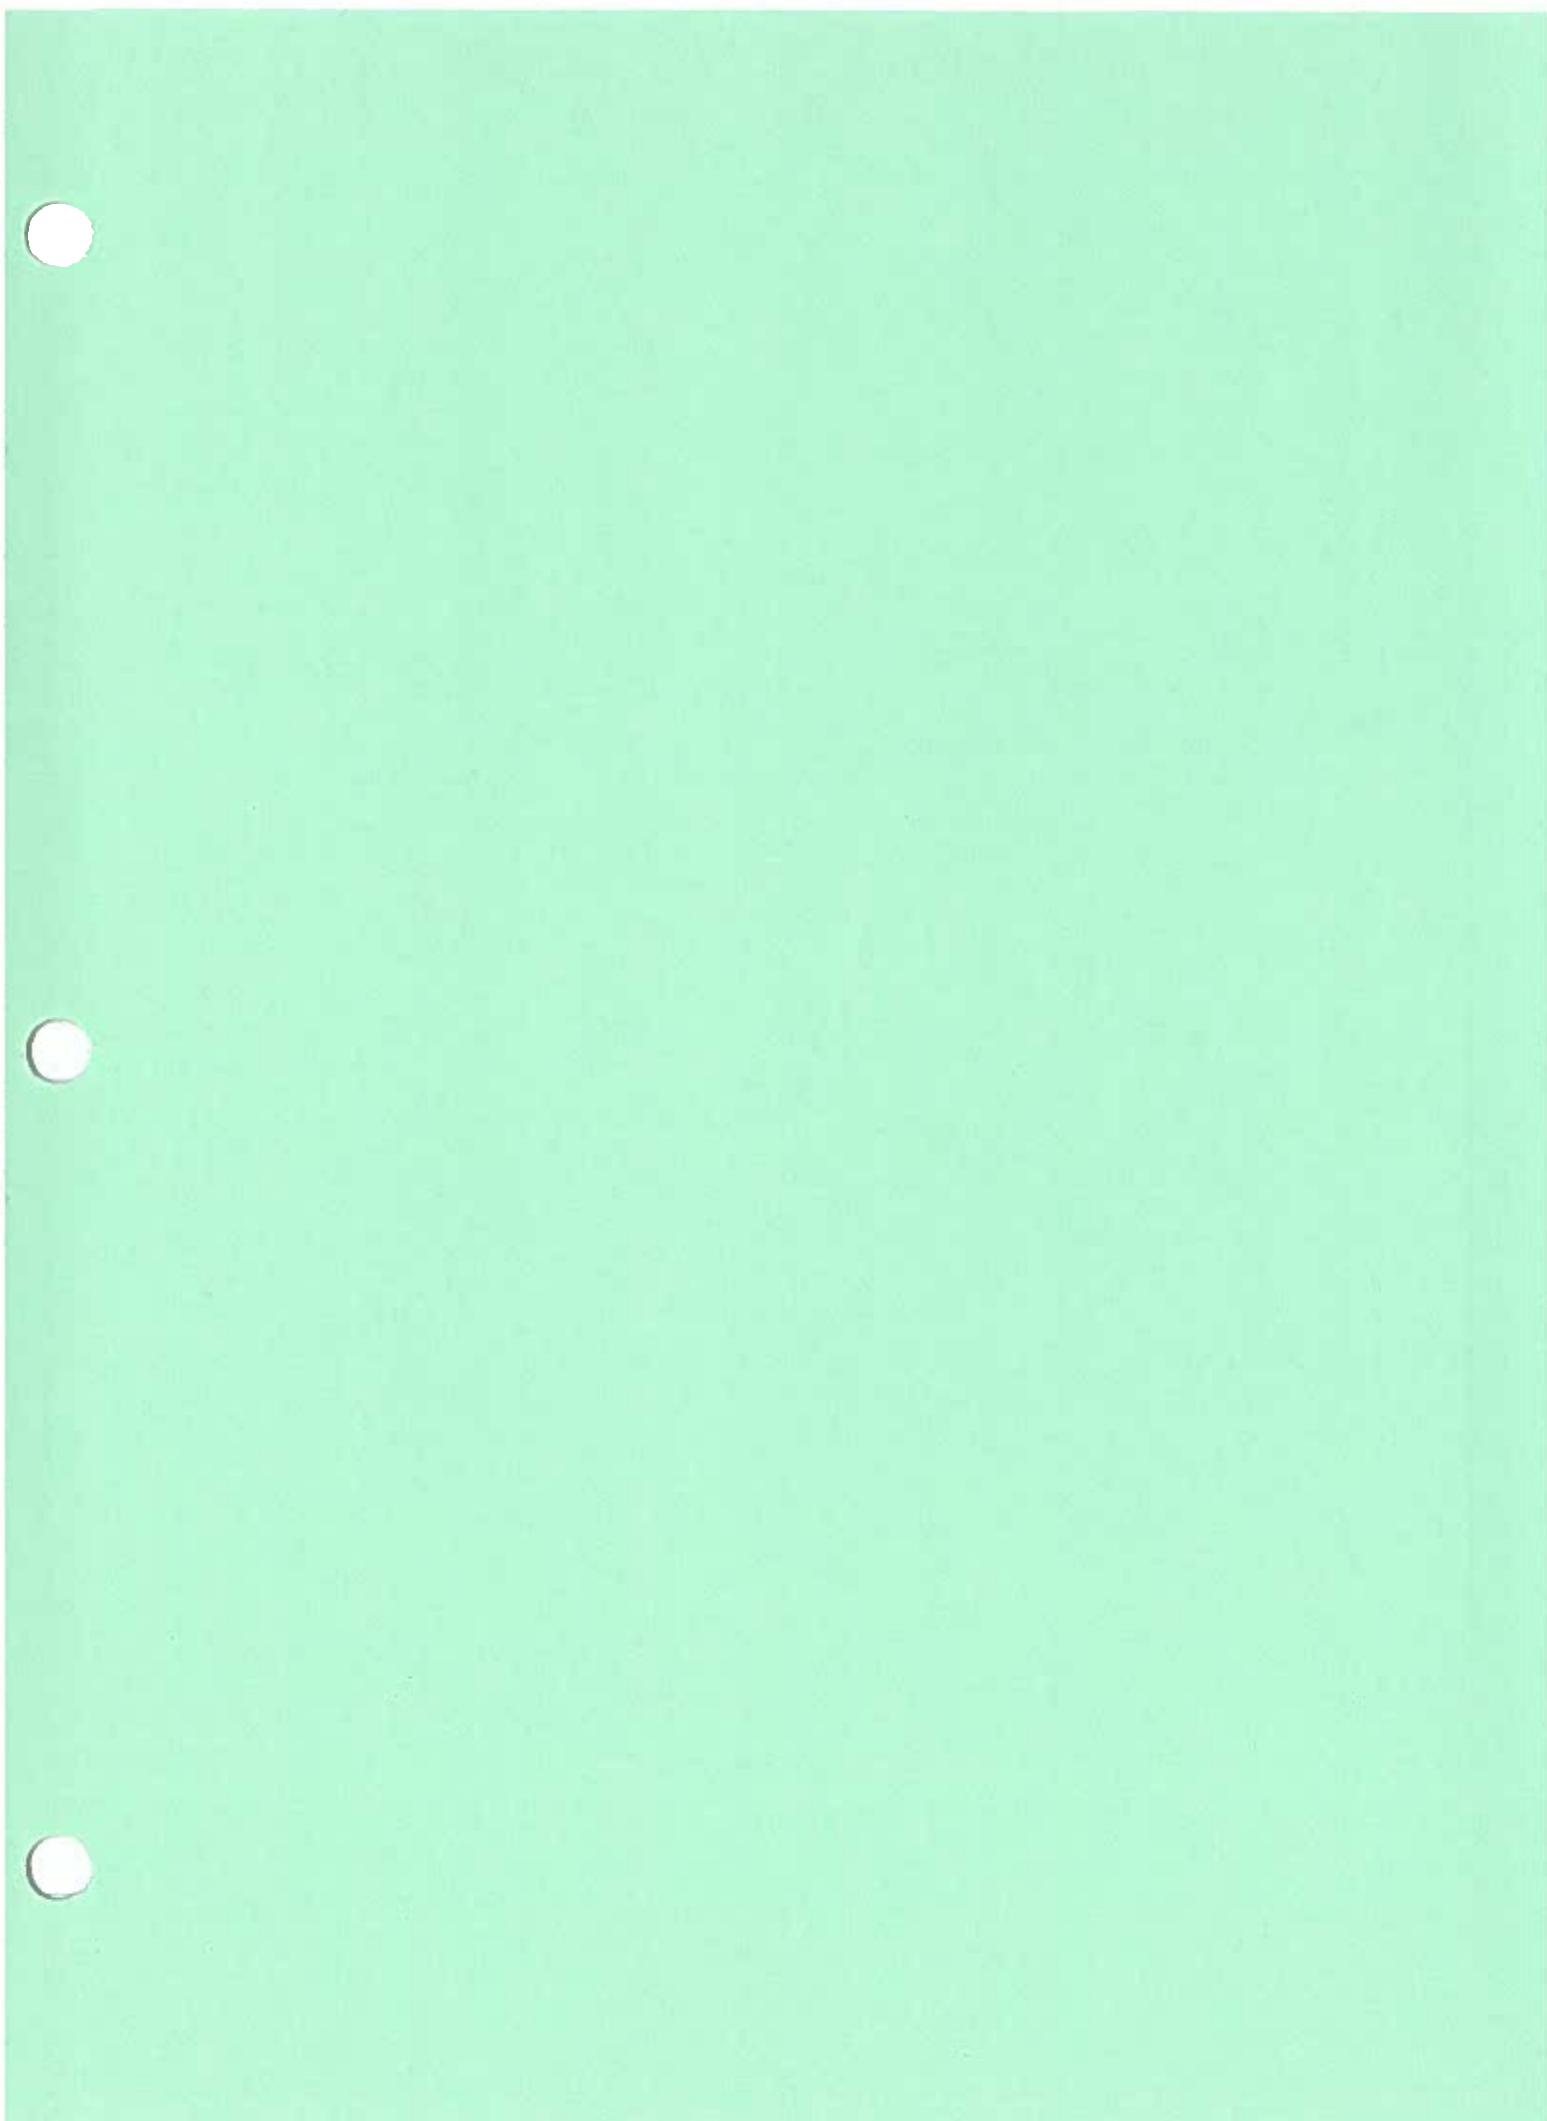

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Copier and Records Room
Material Description
VAT

Comments

Several room name tags have been removed and several doors could not be accessed. This material could not be located during this surveillance. Further investigation will be done as to the location of this material. Access to this building is limited to personnel with keys.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/17/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

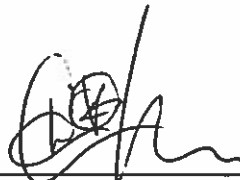

Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location
Copier and Records Room

Material Description
Mastic

Comments

This material could not be located during this surveillance as several doors could not be accessed.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/17/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,200 LF

Material Location
Throughout the building

Material Description
Cove base

Comments

Several pieces have come loose and/or are missing throughout the building. The remaining material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/17/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 400 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
Where visible, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/17/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M
Inspector


Christiaan Sparks
State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# C
Type of Material Miscellaneous Material
Quantity of Material Approx. 8,900 SF

Material Location
Throughout the building

Material Description
Transite walls

Comments
The covering on some walls has separated leaving exposed material. It is not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/17/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christian Sparks

State Indiana
Accreditation Number 190804103



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Copier and Records Room


Material Description
VAT

Comments

This material is not in poor condition with minor chipping and cracking.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/19/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

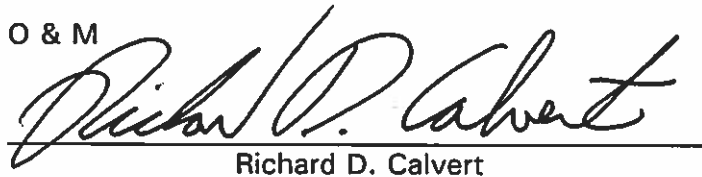
Richard D. Calvert

State Indiana
Accreditation Number 315989970

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF


Material Location
Copier and Records Room

Material Description
Mastic

Comments
Mastic was not exposed to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/19/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

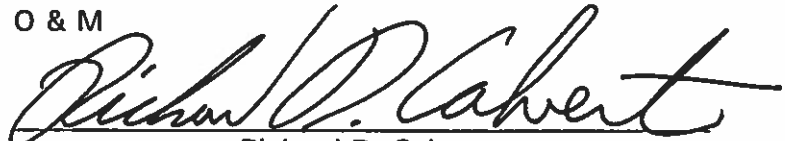
Richard D. Calvert

State Indiana
Accreditation Number 315989970

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,200 LF

Material Location
Throughout the building


Material Description
Cove base

Comments

Material is not in poor condition overall with minor signs of wear. One piece is missing on the glass wall across from the mailroom.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/19/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

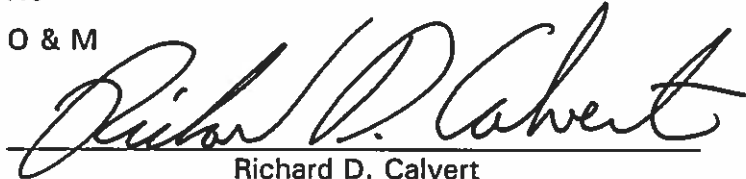
Richard D. Calvert

State Indiana
Accreditation Number 315989970

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 400 SF

Material Location
Throughout the building

Material Description
Cove base mastic

Comments
No mastic was exposed to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/19/2002
Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No


Planned Response Action O & M

Inspector


Richard D. Calvert

State Indiana
Accreditation Number 315989970

PERIODIC SURVEILLANCE REPORT

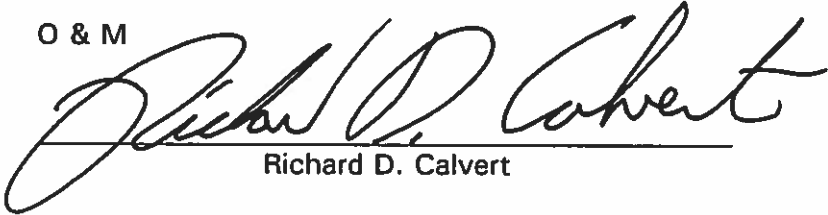LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# C
Type of Material Miscellaneous Material
Quantity of Material Approx. 8,900 SF
Material Location
Throughout the building
Material Description
Transite walls
Comments
Walls are not in poor condition. Edges are exposed on some walls where the covering has separated.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/19/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M
Inspector

Richard D. Calvert
State Indiana
Accreditation Number 315989970



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location
Copier and Records Room

Material Description
VAT

Comments

This material is not in poor condition with minor chipping and cracking.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/10/2002 *12/10*
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Stephen Kimbrough

State Indiana
Accreditation Number 191914122

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location
Copier and Records Room

Material Description
Mastic

Comments
Mastic was not exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 06/01/1992

Current Surveillance Date 12/10/2002 *KN*

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Stephen Kimbrough

State Indiana

Accreditation Number 191914122

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,200 LF
Material Location
Throughout the building
Material Description
Cove base
Comments
Material is not in poor condition overall with minor signs of wear.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/10/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M
Inspector

Stephen Kimbrough
State Indiana
Accreditation Number 191914122

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 400 SF

Material Location
Throughout the building

Material Description
Cove base mastic

Comments
No mastic was exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 12/10/2002

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Stephen Kimbrough

State Indiana

Accreditation Number 191914122

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# C
Type of Material Miscellaneous Material
Quantity of Material Approx. 8,900 SF


Material Location
Throughout the building

Material Description
Transite walls

Comments
Walls are not in poor condition. Edges are exposed on some walls where the covering has separated.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/10/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

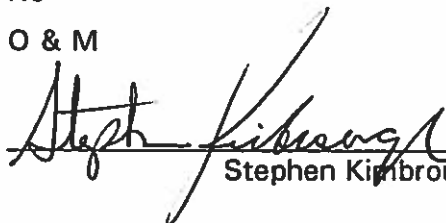

Stephen Kimbrough

State Indiana
Accreditation Number 191914122



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location
Copier and Records Room

Material Description
VAT

Comments
This material is in good condition with minor chipping and cracking.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 01/09/2001
Current Assessment Rating NR Not Required
Cause of Damage Deterioration & Age
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Patrick E. Wilson

State Indiana
Accreditation Number 190824065

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Copier and Records Room

Material Description
Mastic

Comments
Mastic was not exposed to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 01/09/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Patrick E. Wilson

State Indiana
Accreditation Number 190824065

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,200 LF
Material Location
Throughout the building
Material Description
Cove base
Comments
Material is in good condition overall with minor signs of wear.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 01/09/2001
Current Assessment Rating NR Not Required
Cause of Damage Deterioration & Age
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Patrick E. Wilson

State Indiana
Accreditation Number 190824065

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 400 SF

Material Location
Throughout the building

Material Description
Cove base mastic

Comments
No mastic was exposed to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 01/09/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Patrick E. Wilson

State Indiana
Accreditation Number 190824065

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# C
Type of Material Miscellaneous Material
Quantity of Material Approx. 8,900 SF


Material Location
Throughout the building

Material Description
Transite walls

Comments
Walls are in good overall condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 01/09/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Patrick E. Wilson

State Indiana
Accreditation Number 190824065



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Copier and Records Room

Material Description
VAT

Comments
This material is in good condition.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/29/2000
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location
Copier and Records Room

Material Description
Mastic

Comments
Mastic was not exposed to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/29/2000
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# A
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout Building

Material Description
Cove Base

Comments
Material is in good condition overall.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/29/2000
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF

Material Location
Throughout the building

Material Description
Cove Base Mastic

Comments
No mastic was exposed to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/29/2000
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Throughout the building

Material Description
Transite Walls

Comments
Walls are in good overall condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/29/2000
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Boiler Room

Material Description
Gaskets on Boiler Doors

Comments

Boiler was removed during December 1999 and the gaskets were found to be fiberglass.
This homogeneous area will be removed from the Management Plan.

Does Material Contain Asbestos? No
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/29/2000
Current Assessment Rating NA Not Applicable
Cause of Damage Not Applicable
Accessible No
Potential for Damage NA
Removed Yes
Planned Response Action None

Inspector


George William Oggle


State Indiana
Accreditation Number 191523030



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Copier and Records Room
Material Description
VAT
Comments
Material is in good condition.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF


Material Location
Copier and Records Room

Material Description
Mastic

Comments
Material is assumed to be in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# A
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF


Material Location
Throughout Building

Material Description
Cove Base

Comments
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove Base Mastic
Comments
Material is not exposed and is assumed to be in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Matthew Wallace

State Indiana
Accreditation Number 191219020


PERIODIC SURVEILLANCE REPORT

LEA Name	Greater Clark County Schools	
Building Name	Greater Clark County Administration Bldg	
HA#	C	
Type of Material	Miscellaneous Material	
Quantity of Material	Unquantified SF	
Material Location	Throughout the building	
Material Description	Transite Walls	
Comments	Nail holes are noted in the material throughout the building. However, it is in good condition.	
Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	05/31/1995	
Current Surveillance Date	12/08/1999	
Current Assessment Rating	NR	Not Required
Cause of Damage	No Damage	
Accessible	Yes	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	
Inspector	 Matthew Wallace	
State	Indiana	
Accreditation Number	191219020	

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Boiler Room
Material Description
Gaskets on Boiler Doors
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Matthew Wallace

State Indiana
Accreditation Number 191219020



PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Copier and Records Room

Material Description
VAT

Comments
Material is in good condition.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

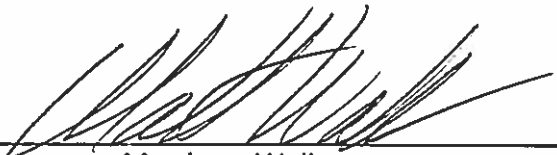
Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Copier and Records Room

Material Description
Mastic

Comments
Material is assumed to be in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# A
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF


Material Location
Throughout Building

Material Description
Cove Base

Comments
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove Base Mastic
Comments
Material is not exposed and is assumed to be in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector 
Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Throughout the building

Material Description
Transite Walls

Comments
Nail holes are noted in the material throughout the building. However, it is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location
Boiler Room

Material Description
Gaskets on Boiler Doors

Comments
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Matthew Wallace

State Indiana
Accreditation Number 191219020



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Copier and Records Room
Material Description
VAT
Comments
Material is in good condition.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/29/1998
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Clint Yates

State Indiana
Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Copier and Records Room


Material Description
Mastic

Comments

Material is assumed to be in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/29/1998
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Clint Yates

State Indiana
Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# A
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout Building
Material Description
Cove Base
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/29/1998
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

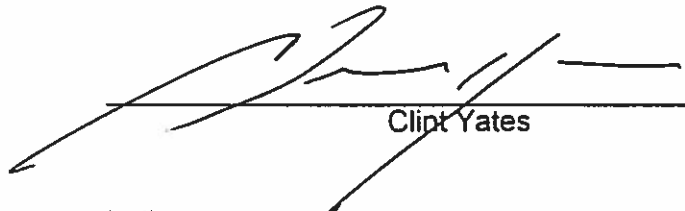
Clint Yates

State Indiana
Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building

Material Description
Cove Base Mastic

Comments
Material is not exposed and is assumed to be in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/29/1998
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

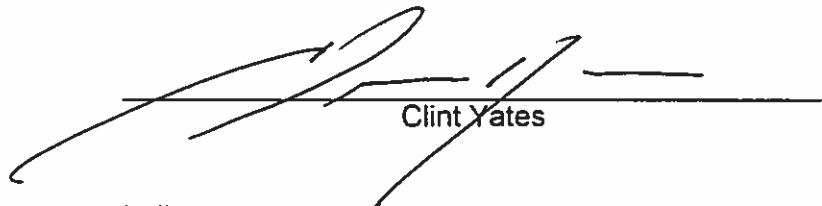

Clint Yates

State Indiana
Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# C
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Throughout the building
Material Description
Transite Walls

Comments

Nail holes are noted in the material throughout the building. However, it is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/29/1998
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector




Clint Yates

State Indiana
Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# D
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Boiler Room
Material Description
Fittings
Comments
Material was found to be fiberglass and will be removed from the Management Plan.
Does Material Contain Asbestos? No
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/29/1998
Current Assessment Rating NA Not Applicable
Cause of Damage Not Applicable
Accessible Yes
Potential for Damage NA
Removed No
Planned Response Action None

Inspector

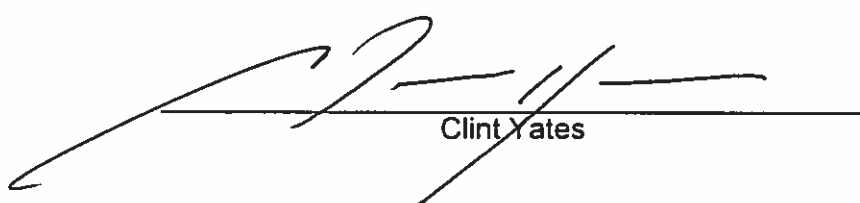
Clint Yates

State

Indiana


Accreditation Number

193804035


PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# E
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Boiler Room
Material Description
Gaskets on Boiler Doors
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/29/1998
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

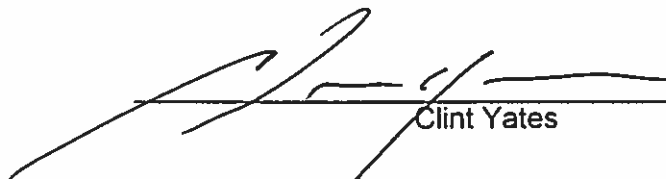
Clint Yates

State Indiana
Accreditation Number 193804035

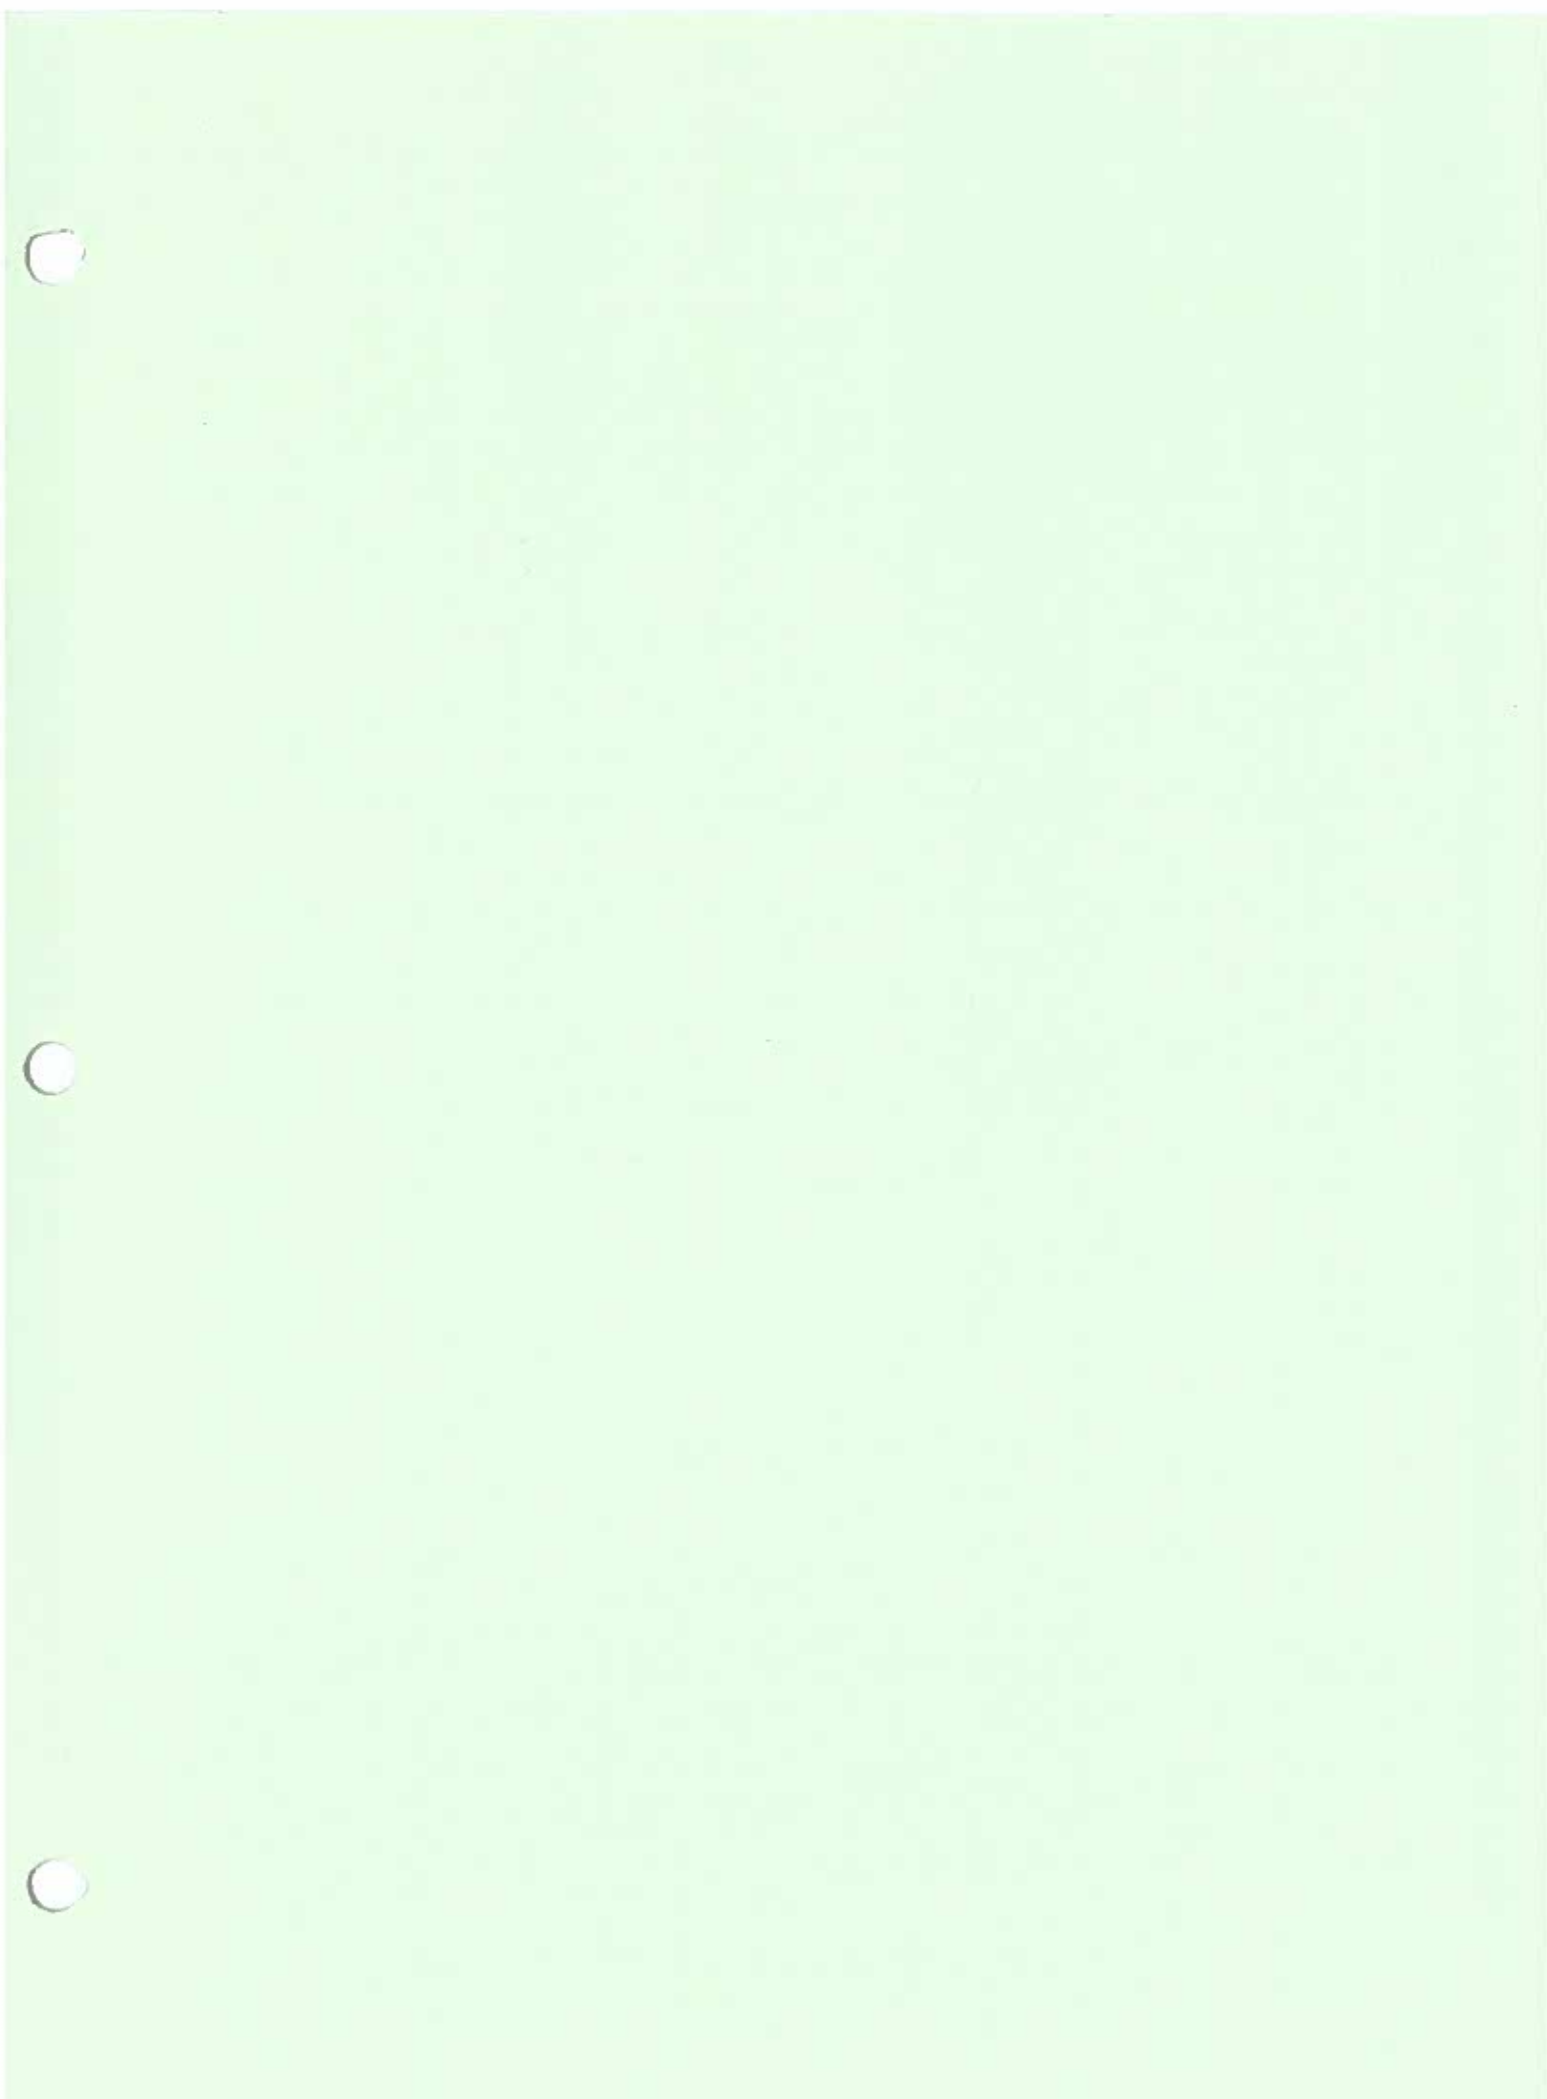

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Copier and Records Room

Material Description
VAT

Comments
Material is in good condition.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 1/14/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State

Indiana

Accreditation Number

191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Copier and Records Room

Material Description
Mastic

Comments
Material is assumed to be in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 1/14/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# A
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout Building
Material Description
Cove Base
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 1/14/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# B
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout the building
Material Description
Cove Base Mastic
Comments
Material is not exposed and is assumed to be in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 1/14/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# C
Type of Material Miscellaneous Material
Quantity of Material SF
Material Location
Throughout the building
Material Description
Transite Walls

Comments

Nail holes are noted in the material throughout the building. However, it is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 1/14/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name	Greater Clark County Schools
Building Name	Greater Clark County Administration Bldg
HA#	D
Type of Material	Miscellaneous Material
Quantity of Material	Each
Material Location	Boiler Room
Material Description	Fittings
Comments	Material shows minor water damage.
Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	5/31/95
Current Surveillance Date	1/14/98
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Inspector



Karen Foxx

State

Indiana

Accreditation Number

191129014

PERIODIC SURVEILLANCE REPORT


LEA Name	Greater Clark County Schools
Building Name	Greater Clark County Administration Bldg
HA#	E
Type of Material	Miscellaneous Material
Quantity of Material	Each
Material Location	Boiler Room
Material Description	Gaskets on Boiler Doors
Comments	Material is in good condition.
Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	5/31/95
Current Surveillance Date	1/14/98
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Inspector



Karen Foxx

State	Indiana
Accreditation Number	191129014

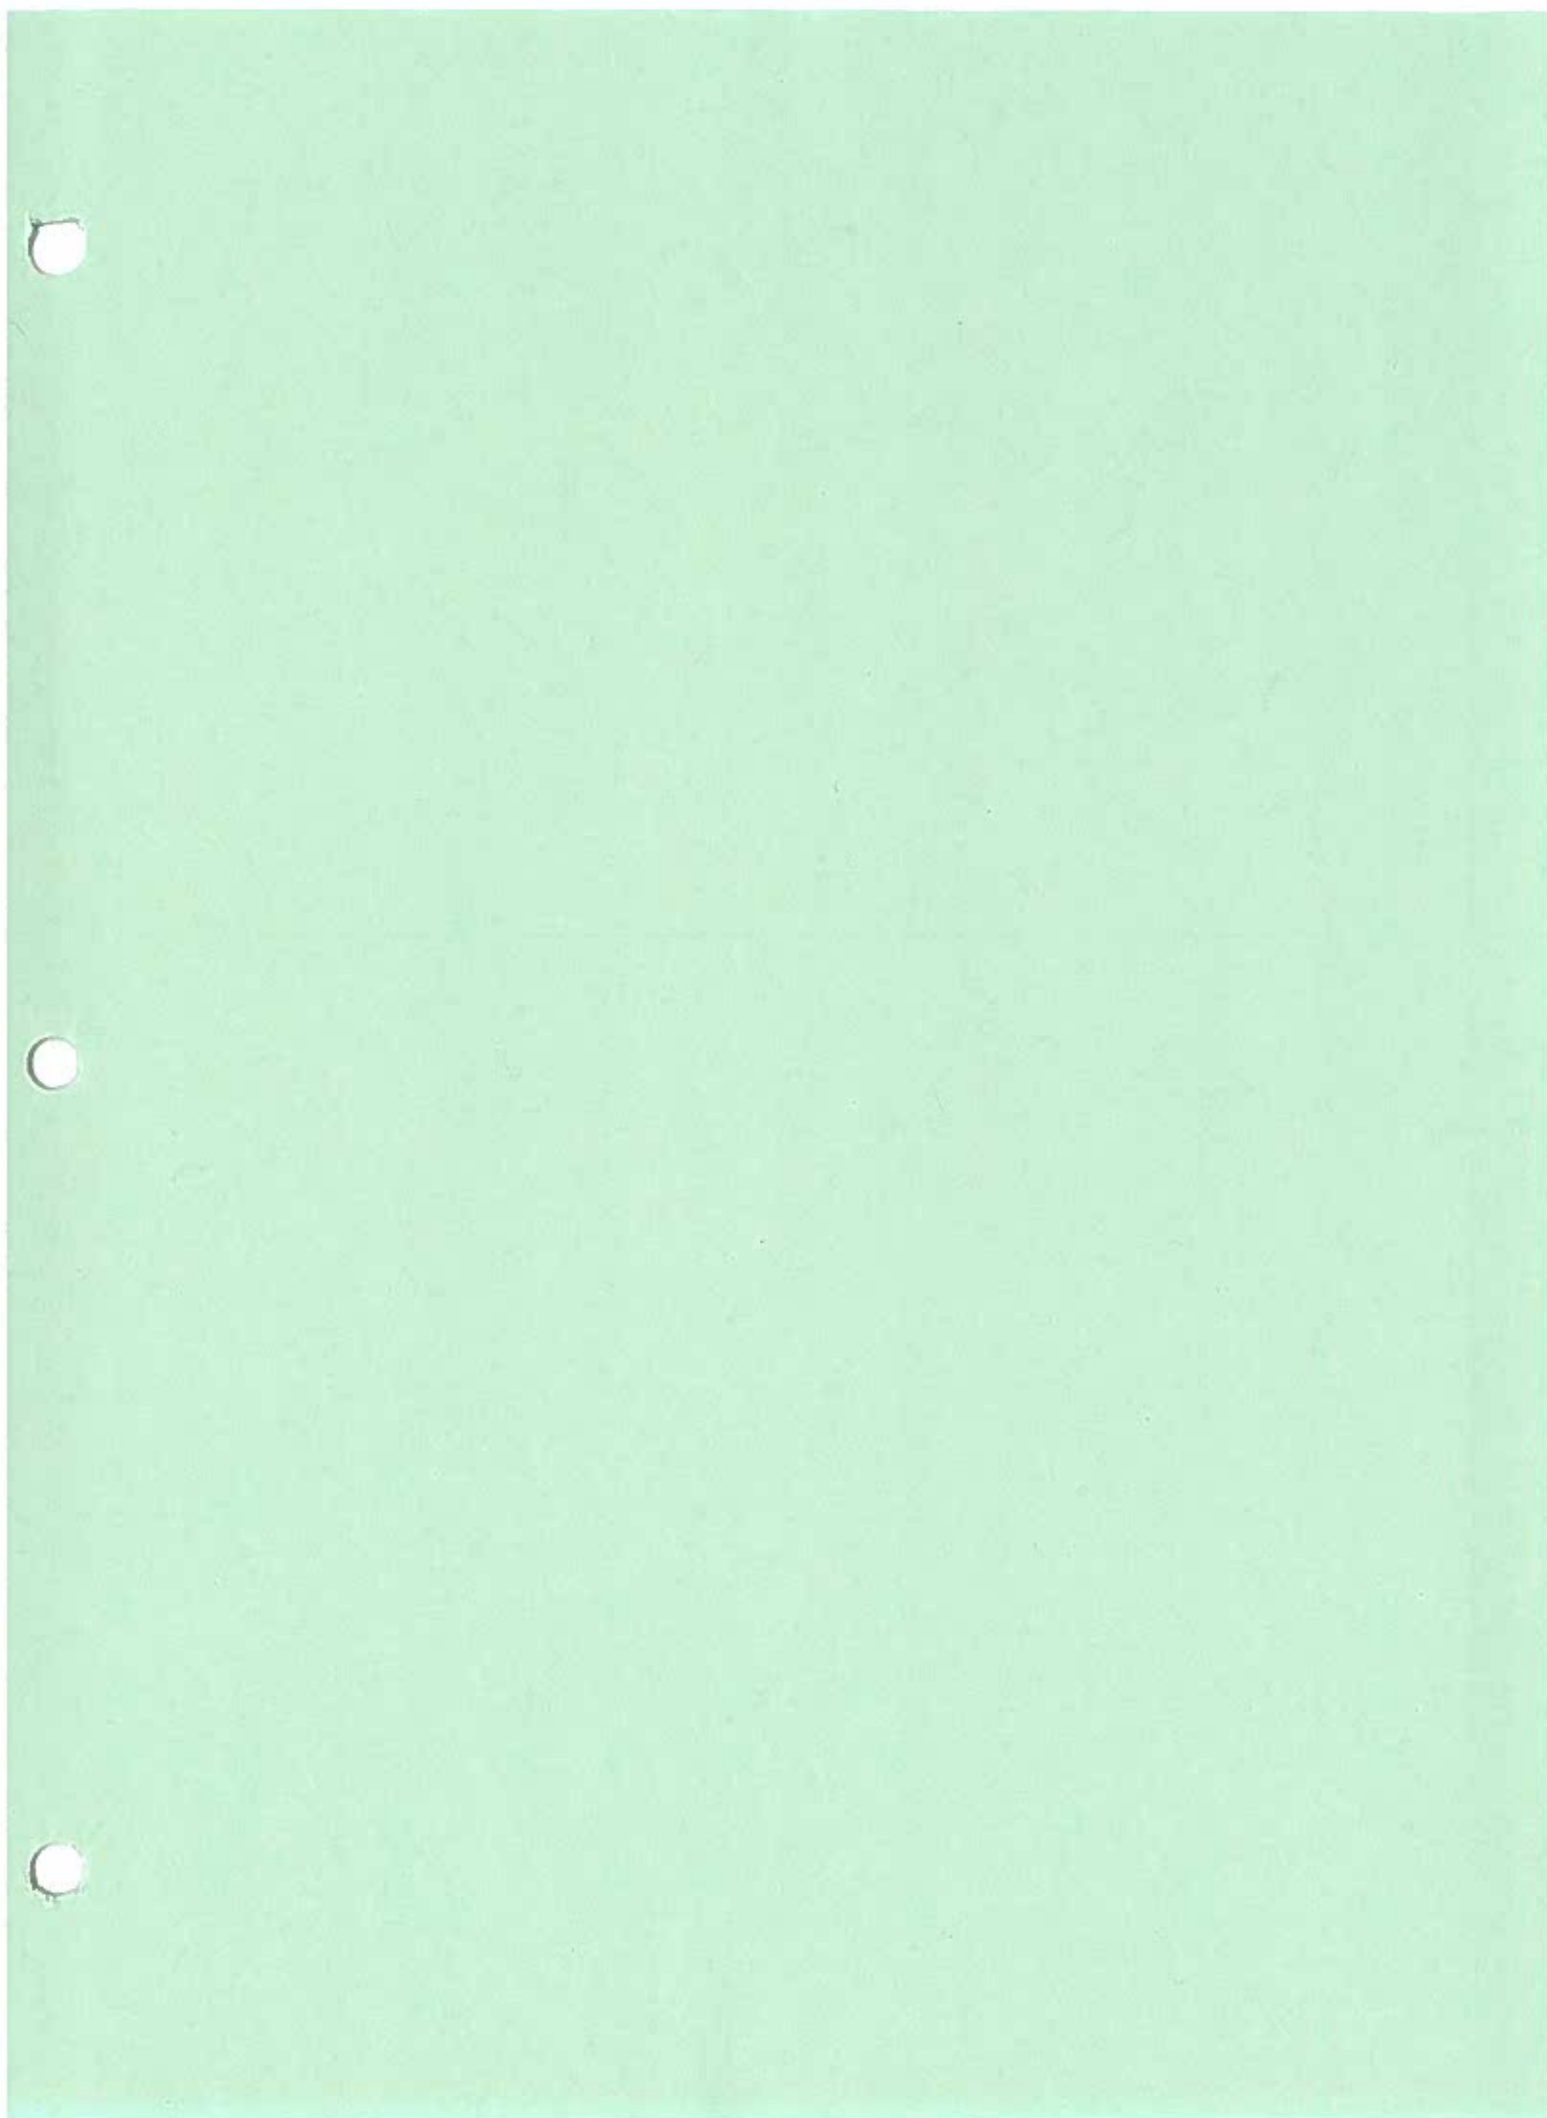

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 1
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Copier and Records Room


Material Description
VAT

Comments

Material is in good condition.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 7/ 2/97
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State

Indiana

Accreditation Number

191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 2
Type of Material Miscellaneous Material
Quantity of Material 957 SF


Material Location
Copier and Records Room

Material Description
Mastic

Comments
Material is assumed to be in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 7/ 2/97
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# A
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout Building
Material Description
Cove Base
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 7/ 2/97
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# B
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout the building
Material Description
Cove Base Mastic
Comments
Material is not exposed and is assumed to be in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 7/ 2/97
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M


Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name	Greater Clark County Schools
Building Name	Greater Clark County Administration Bldg
HA#	C
Type of Material	Miscellaneous Material
Quantity of Material	SF
Material Location	Throughout the building
Material Description	Transite Walls
Comments	Nail holes are noted in the material throughout the building. However, it is in good condition.
Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	5/31/95
Current Surveillance Date	7/ 2/97
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
Inspector	 Karen Foxx
State	Indiana
Accreditation Number	191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# D
Type of Material Miscellaneous Material
Quantity of Material Each
Material Location
Boiler Room
Material Description
Fittings
Comments
Material shows minor water damage.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 7/ 2/97
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State

Indiana

Accreditation Number

191129014

PERIODIC SURVEILLANCE REPORT

LEA Name	Greater Clark County Schools
Building Name	Greater Clark County Administration Bldg
HA#	E
Type of Material	Miscellaneous Material
Quantity of Material	Each
Material Location	
Boiler Room	
Material Description	
Gaskets on Boiler Doors	
Comments	
Material is in good condition.	
Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	5/31/95
Current Surveillance Date	7/ 2/97
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Inspector




Karen Foxx

State

Indiana

Accreditation Number

191129014

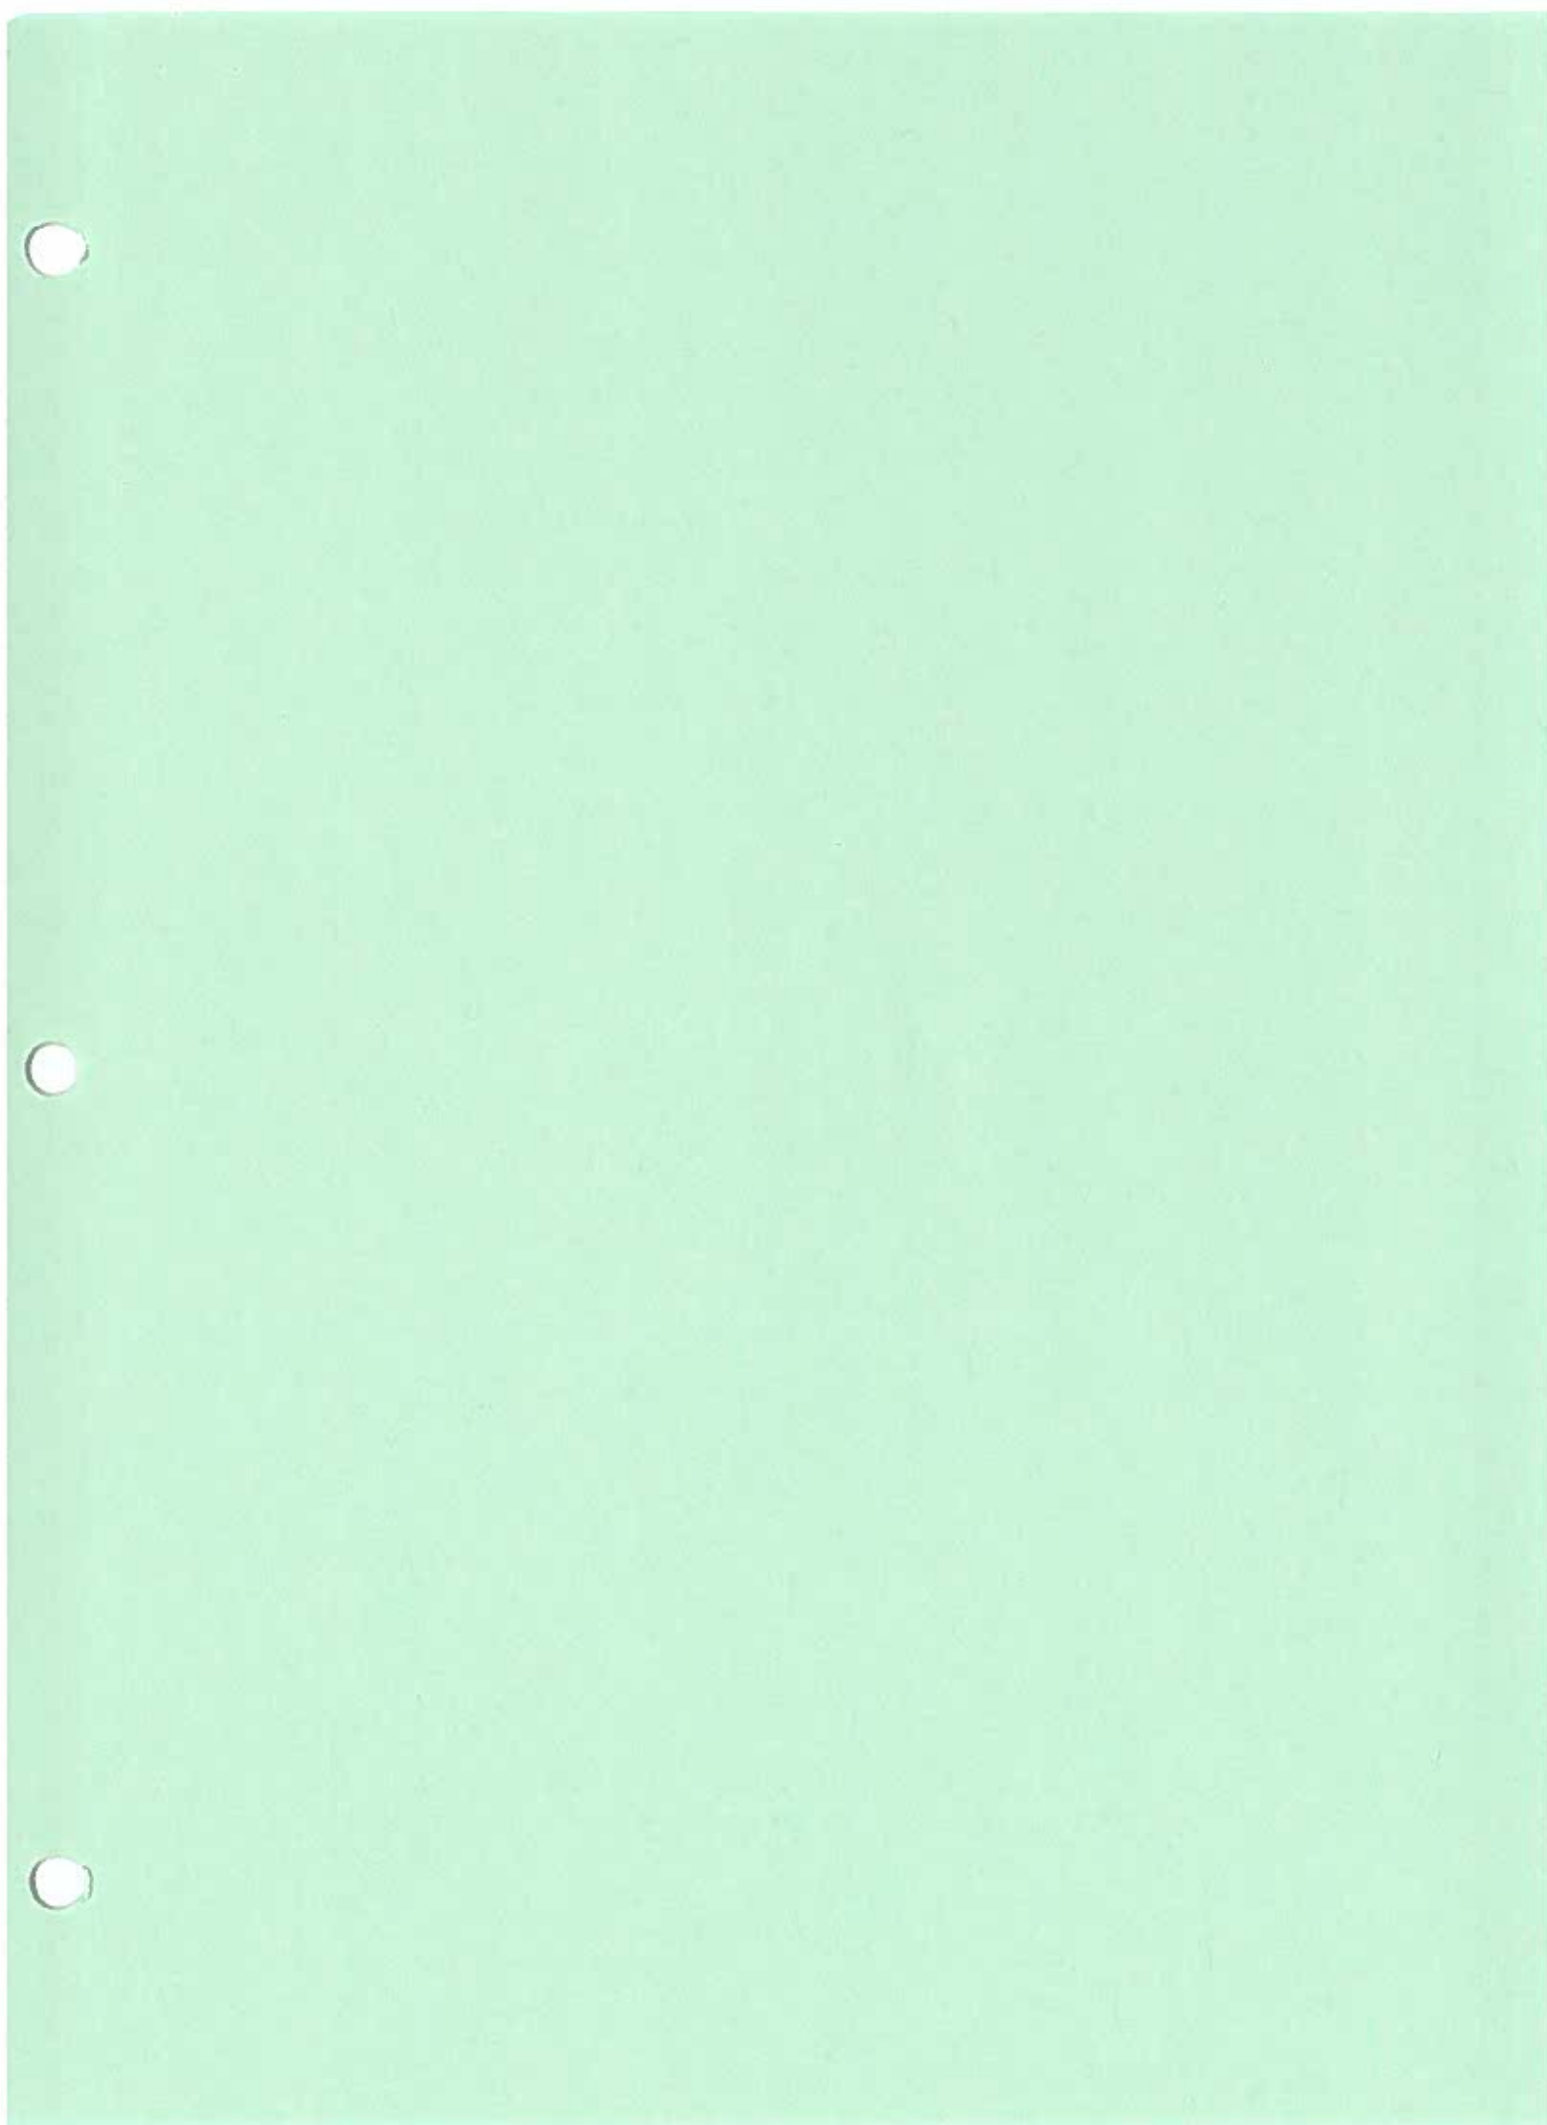


PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 1
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Copier and Records Room
Material Description
VAT
Comments
Material is in good condition.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

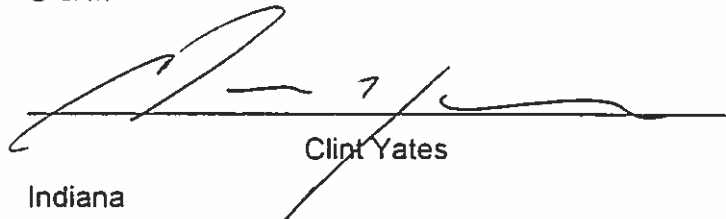

Clint Yates

State

Indiana

Accreditation Number

193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 2
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location
Copier and Records Room


Material Description
Mastic

Comments

Material is in good condition and is assumed to be asbestos containing. No change.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

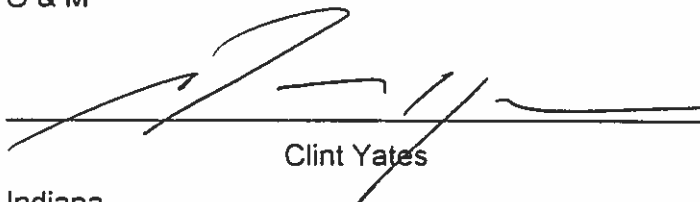
Clint Yates

State Indiana
Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# A
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout Building
Material Description
Cove Base

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

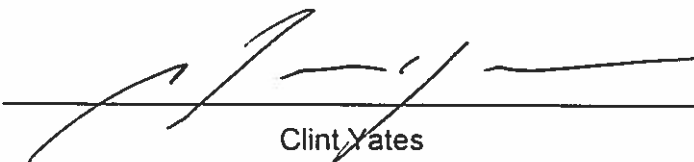
Clint Yates

State

Indiana

Accreditation Number

193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# B
Type of Material Miscellaneous Material
Quantity of Material LF

Material Location
Throughout the building


Material Description
Cove Base Mastic

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

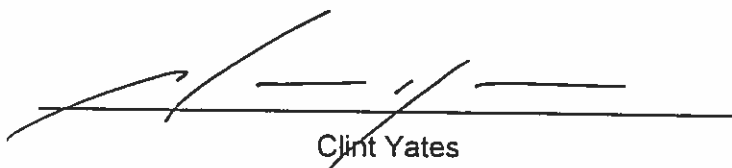

Clint Yates

State Indiana
Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# C

Type of Material

Quantity of Material SF

Material Location

Throughout the building

Material Description


Transite Walls

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

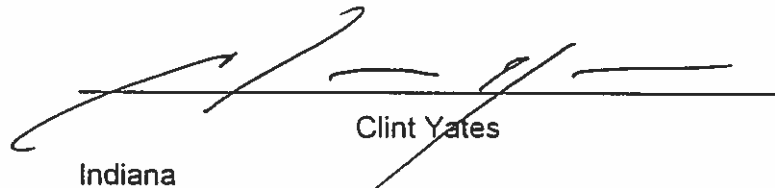

Clint Yates

State

Indiana

Accreditation Number

193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# D
Type of Material Miscellaneous Material
Quantity of Material Each
Material Location
Boiler Room
Material Description
Fittings

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Clint Yates

State

Indiana

Accreditation Number


193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# E
Type of Material Miscellaneous Material
Quantity of Material Each
Material Location
Boiler Room
Material Description
Gaskets on Boiler Doors
Comments
Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector




Clint Yates

State

Indiana

Accreditation Number

193804035

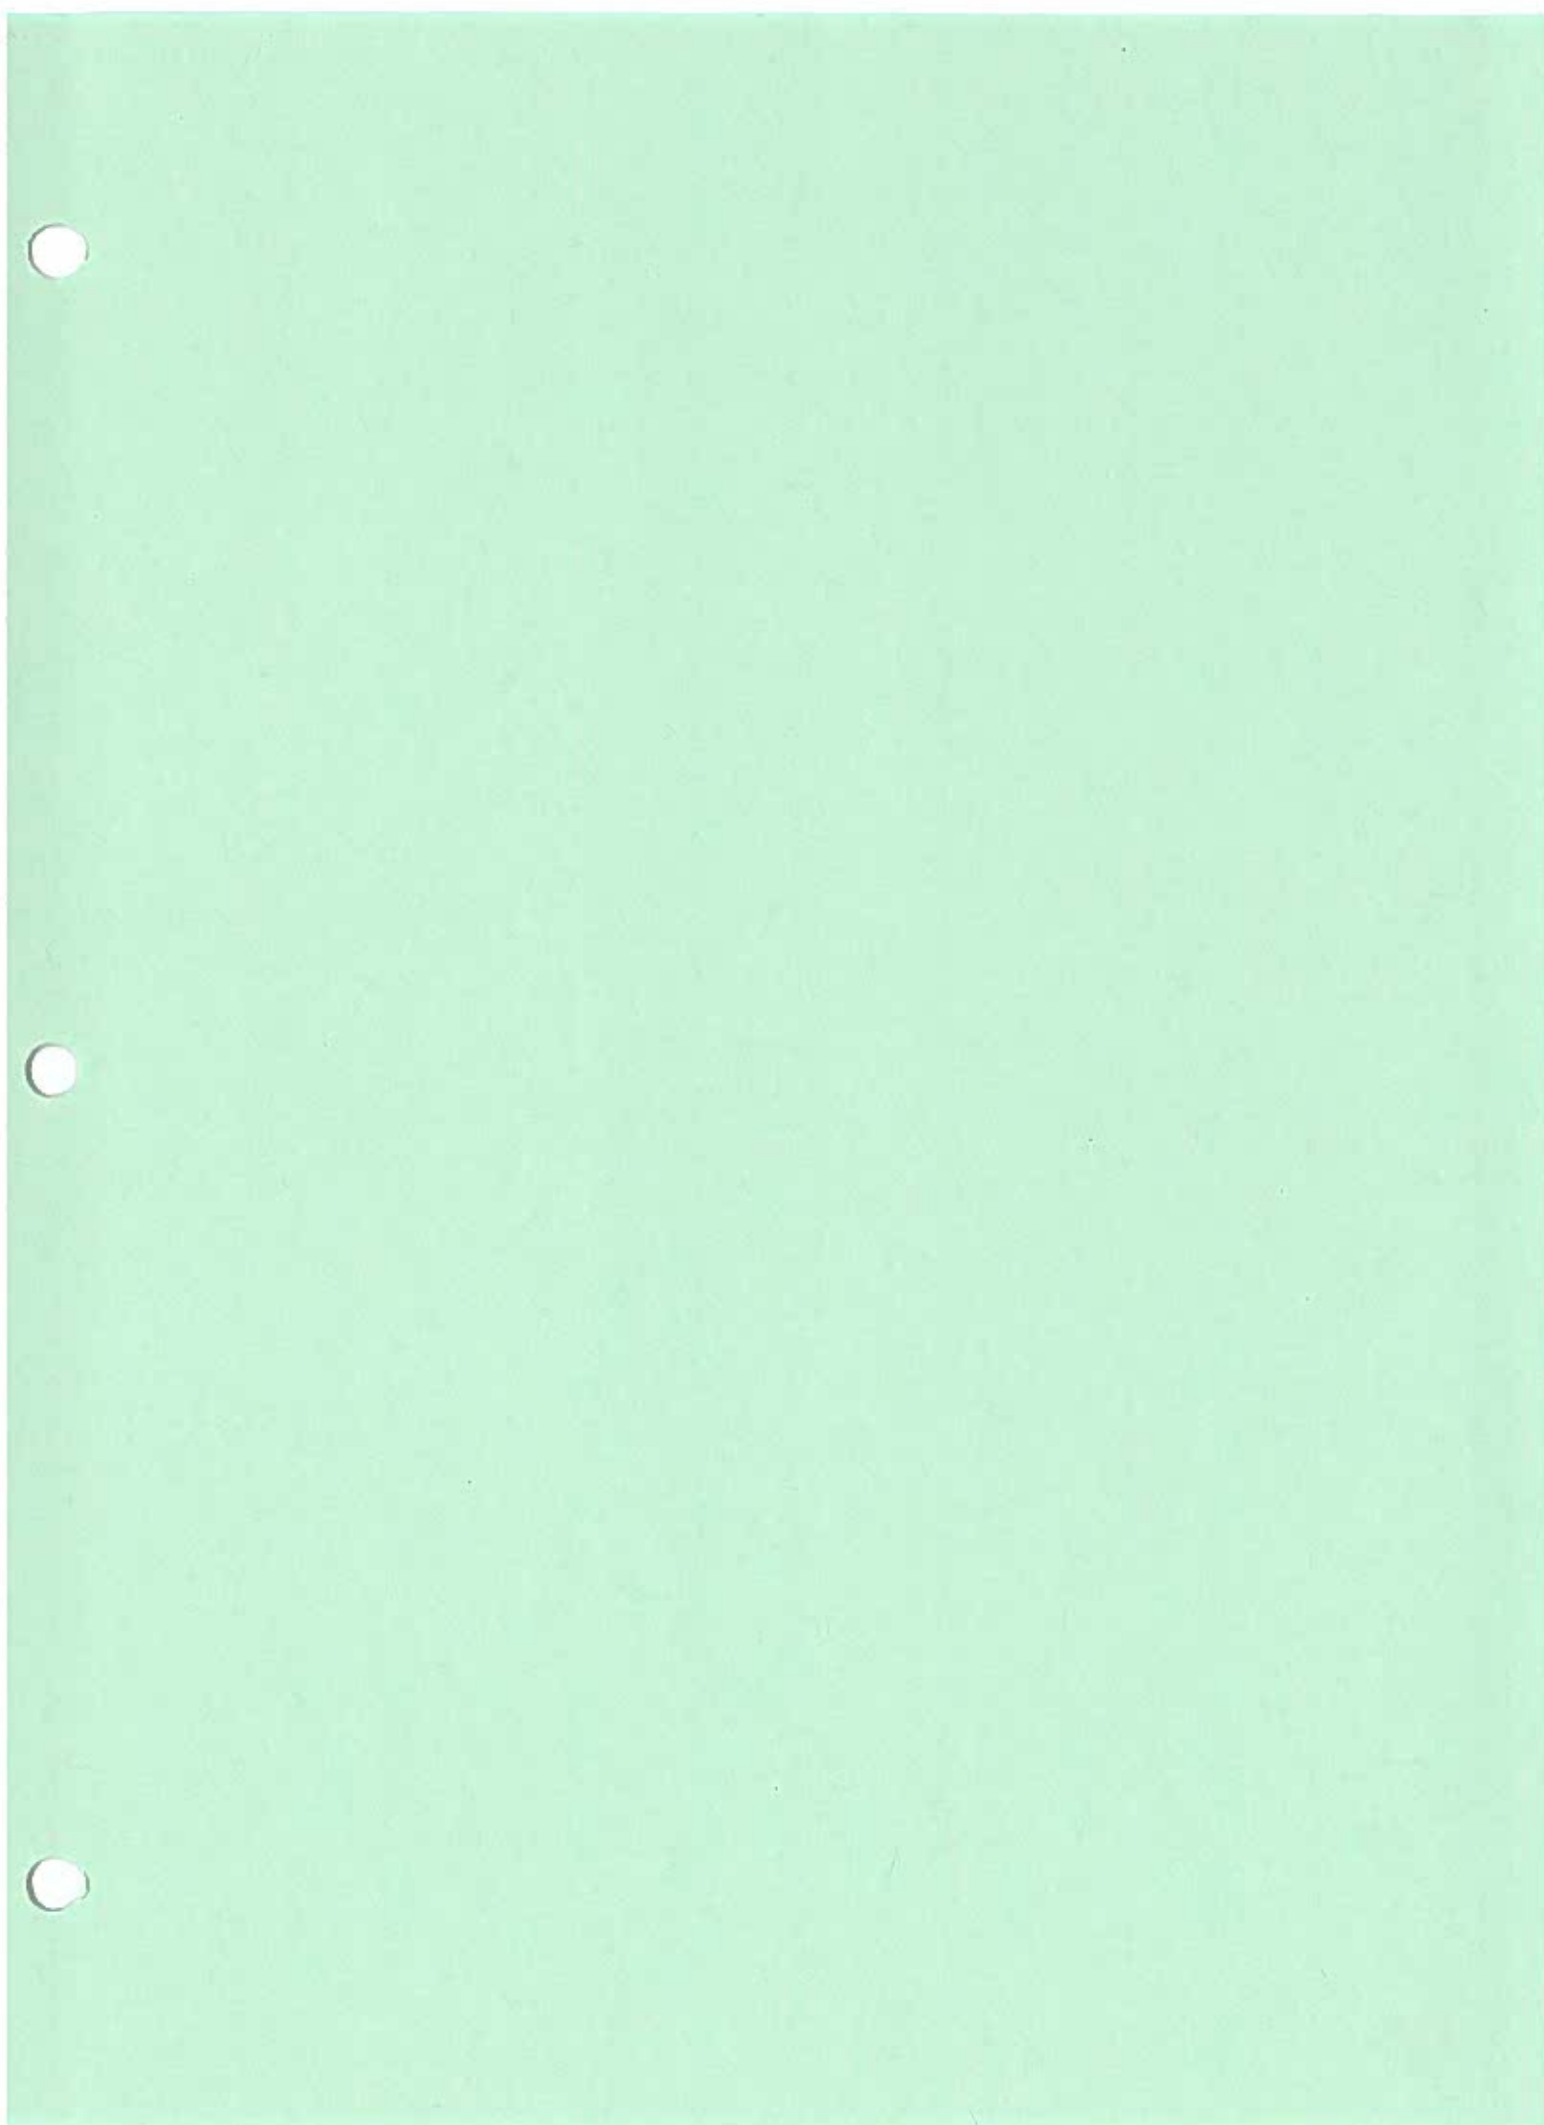


PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 1
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Copier and Records Room
Material Description
VAT
Comments
Material is known to be asbestos containing. No change.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 6/24/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Rex Gaddis

State Indiana
Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 2
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Copier and Records Room
Material Description
Mastic

Comments

Material is in good condition and is assumed to be asbestos containing. No change.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Surveillance Date 6/24/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Rex Gaddis

State Indiana
Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# A
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout Building
Material Description
Cove Base

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 6/24/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Rex Gaddis


State Indiana
Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# B
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout the building
Material Description
Cove Base Mastic
Comments
Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 6/24/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Rex Gaddis

State Indiana
Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# C

Type of Material

Quantity of Material SF

Material Location

Throughout the building

Material Description

Transite Walls

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	5/31/95
Current Surveillance Date	6/24/96
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Inspector



Rex Gaddis

State Indiana
Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# D
Type of Material Miscellaneous Material
Quantity of Material Each
Material Location
Boiler Room
Material Description
Fittings

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 6/24/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Rex Gaddis

State Indiana
Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# E
Type of Material Miscellaneous Material
Quantity of Material Each
Material Location
Boiler Room
Material Description
Gaskets on Boiler Doors

Comments

Material is assumed to be positive and will be treated as ACM until it is sampled.
Material is in good condition.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 6/24/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Rex Gaddis

State Indiana
Accreditation Number 190908032

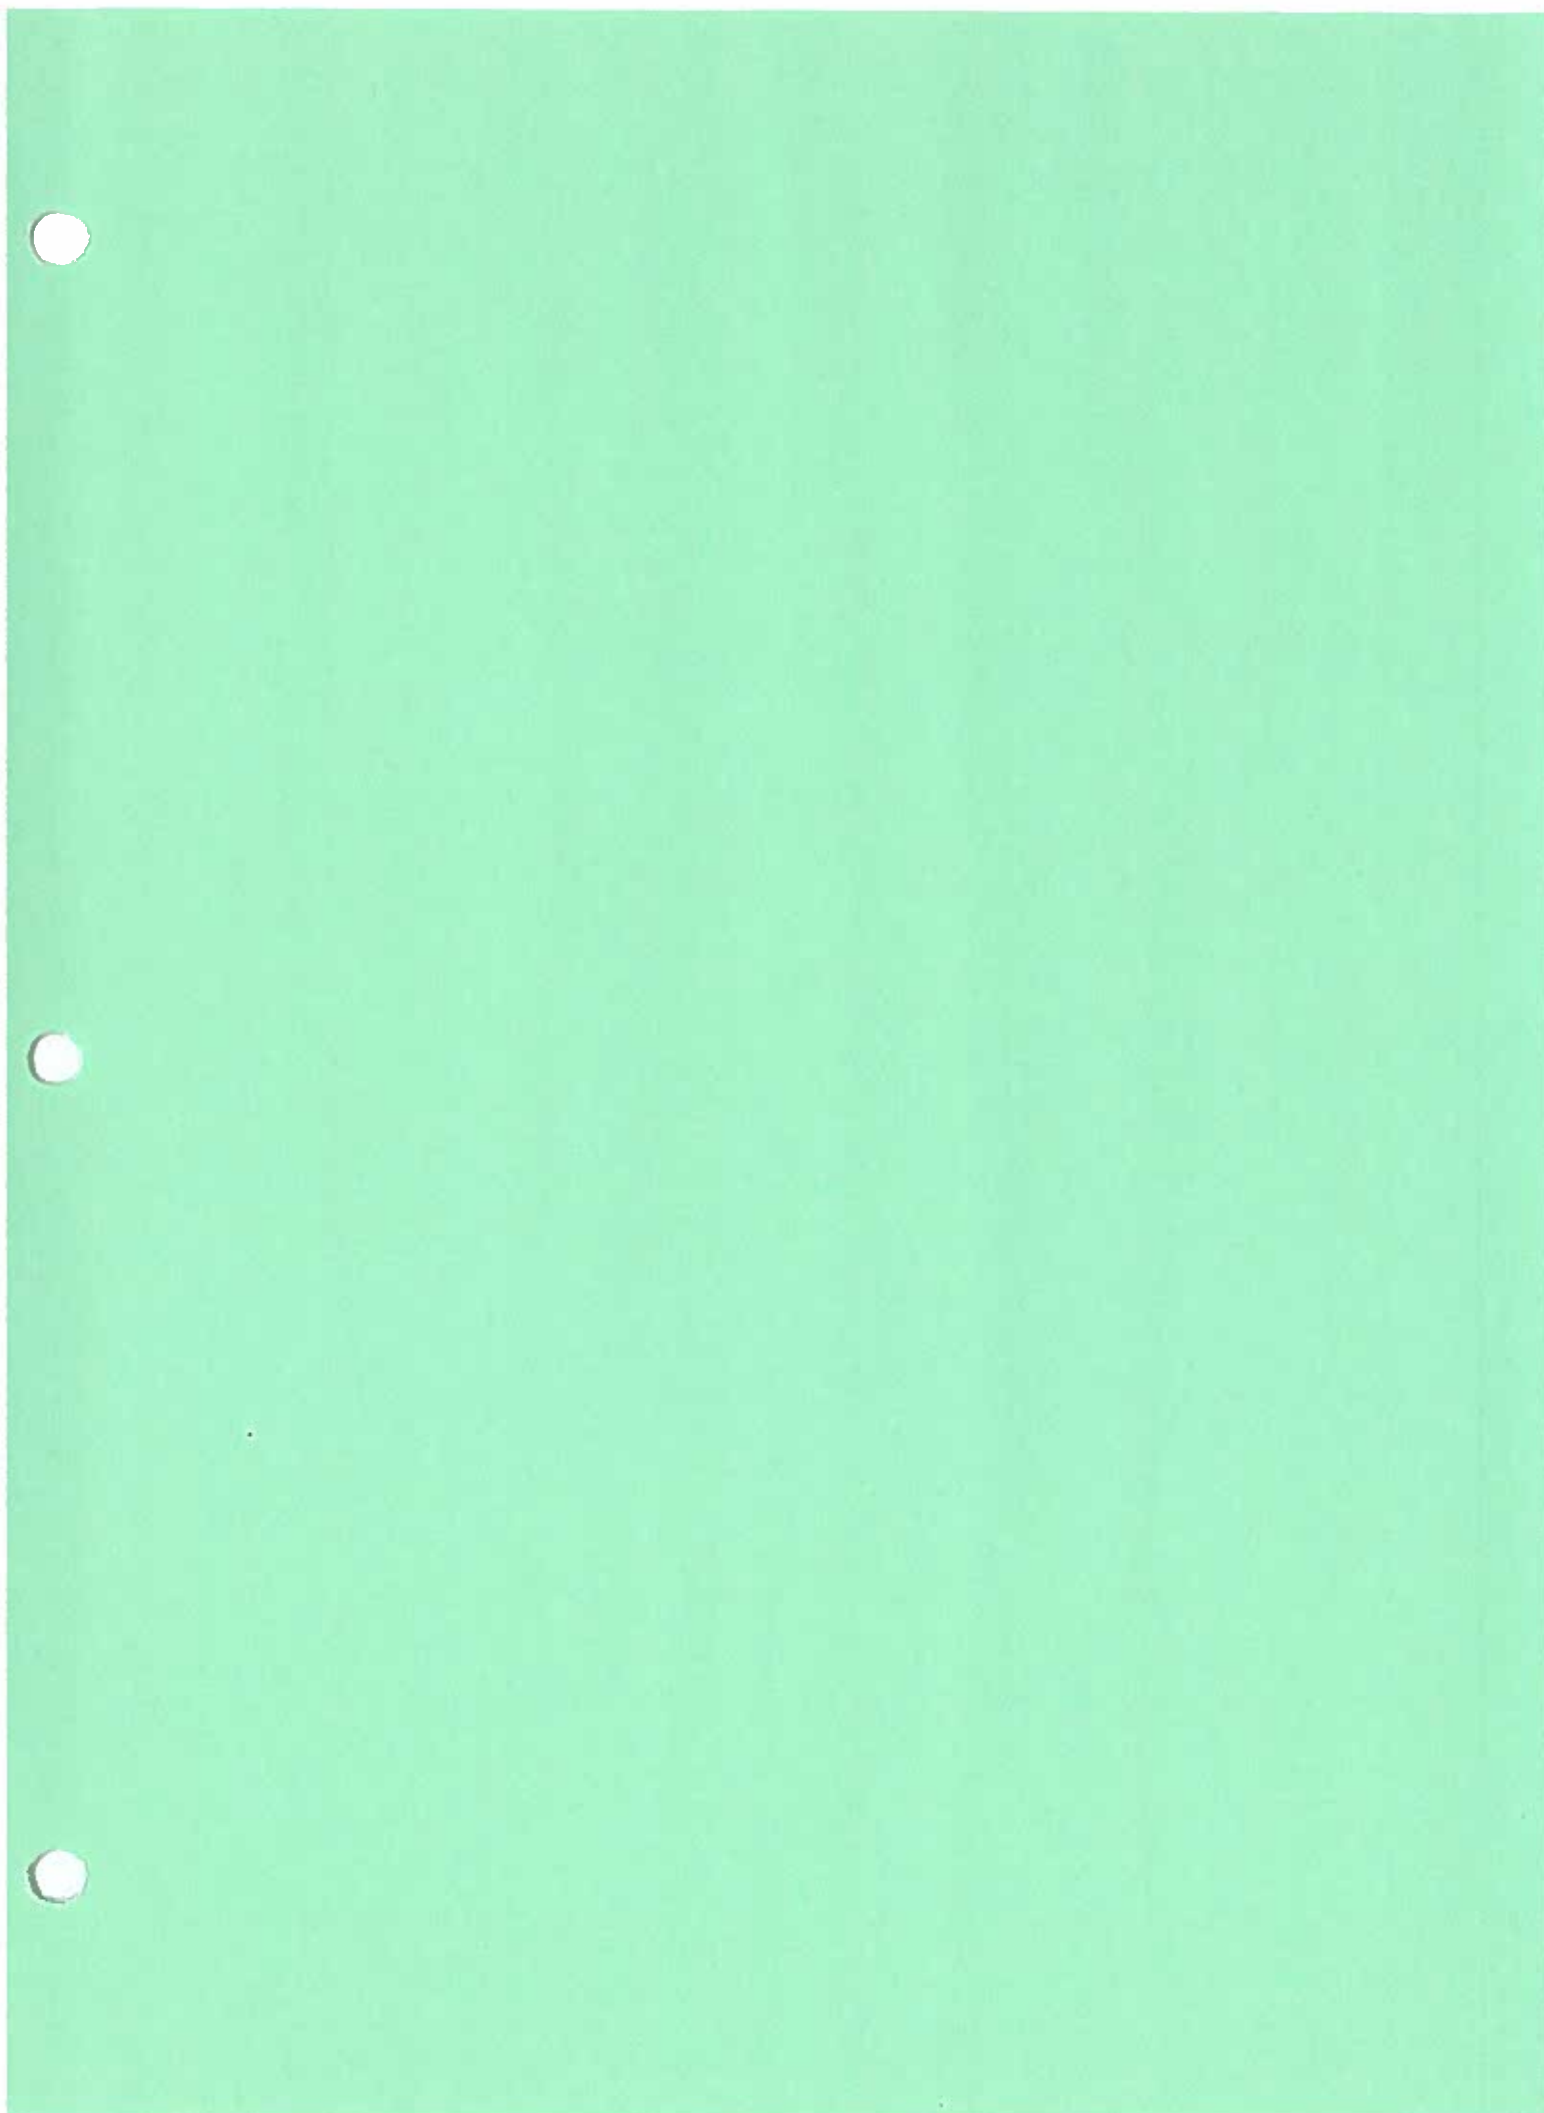

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools
BUILDING NAME: Greater Clark County Administration Bldg
HA#: 1
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL: 957SF
MATERIAL LOCATION:

Copier and Records Room

MATERIAL DESCRIPTION:


VAT

COMMENTS:

Material is known to be asbestos containing.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE: 06/01/92
CURRENT SURVEILLANCE DATE: 12/06/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: YES
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
STATE: Indiana

INSPECTOR NAME:

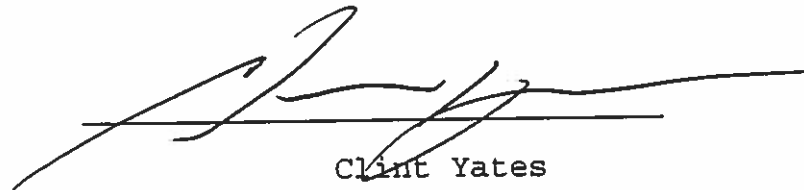
Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools
BUILDING NAME: Greater Clark County Administration Bldg
HA#: 2
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL: 957SF
MATERIAL LOCATION:

Copier and Records Room

MATERIAL DESCRIPTION:


Mastic

COMMENTS:

Material is in good condition and is assumed to be asbestos containing.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE: 06/01/92
CURRENT SURVEILLANCE DATE: 12/06/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
STATE: Indiana

INSPECTOR NAME:

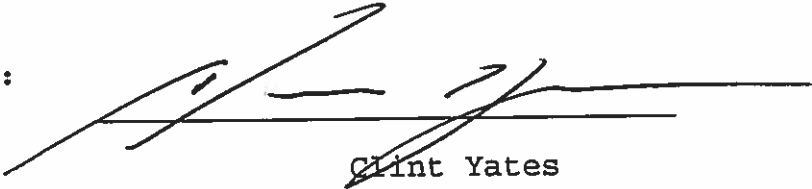

Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools
BUILDING NAME: Greater Clark County Administration Bldg
HA#: A
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL:
MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE: 06/01/92
CURRENT SURVEILLANCE DATE: 12/06/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: YES
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
STATE: Indiana

INSPECTOR NAME:



Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools
BUILDING NAME: Greater Clark County Administration Bldg
HA#: B
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL:
MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:


Cove Base Mastic

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE:
CURRENT SURVEILLANCE DATE: 12/06/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
STATE: Indiana

INSPECTOR NAME:

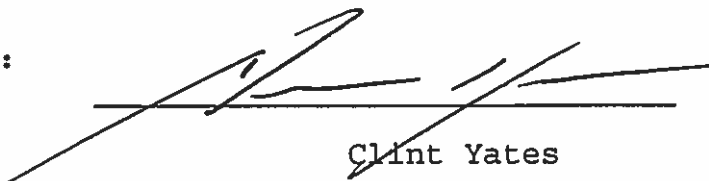

Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools
BUILDING NAME: Greater Clark County Administration Bldg
HA#: C

TYPE OF MATERIAL:

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:


Transite Walls

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE:
CURRENT SURVEILLANCE DATE: 12/06/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: YES
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
STATE: Indiana

INSPECTOR NAME:

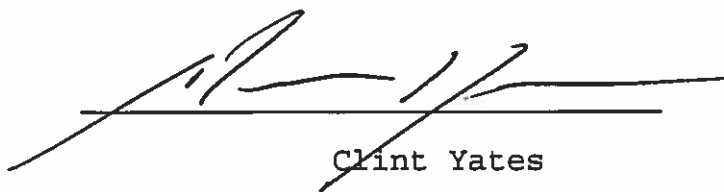
Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools
BUILDING NAME: Greater Clark County Administration Bldg
HA#: D
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL:
MATERIAL LOCATION:

Boiler Room

MATERIAL DESCRIPTION:


Fittings

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE:
CURRENT SURVEILLANCE DATE: 12/06/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: YES
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
STATE: Indiana

INSPECTOR NAME:

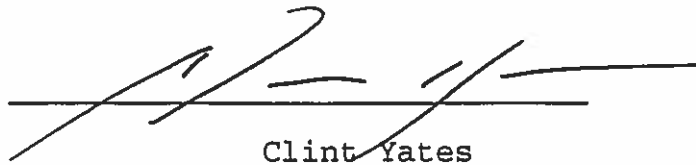
Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools
BUILDING NAME: Greater Clark County Administration Bldg
HA#: E
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL:
MATERIAL LOCATION:

Boiler Room

MATERIAL DESCRIPTION:

Gaskets on Boiler Doors

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE:
CURRENT SURVEILLANCE DATE: 12/06/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: YES
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
STATE: Indiana

INSPECTOR NAME:


Clint Yates

THIRD YEAR REINSPECTIONS

REINSPECTION PLAN**GREATER CLARK COUNTY SCHOOLS**

Reinspection by an accredited building inspector will be scheduled to be performed not more than three years from the date of the original inspection. The reinspection report will then be made a permanent part of this Management Plan. Reinspections will be performed every three years for as long as the building contains ACBM, and will be reinspected once within three years from the date that all ACBM has been removed.

Records of each reinspection should be maintained in this binder.

DATE PLANNED**DATE COMPLETED****COMPLETED BY**JUNE 2007July 2007Bill OgleJUNE 2010June 2010Sandy ShadleyJUNE 2013April 2016BenjaminJUNE 2016May 16, 2019[Signature]JUNE 2019__________JUNE 2022__________JUNE 2025__________

REINSPECTION PLAN**GREATER CLARK COUNTY SCHOOLS****ADMINISTRATION BUILDING**

The ACBM in this building shall be reinspected every three years to determine any change in the condition of the materials for as long they remain in the building. This reinspection will be conducted tri-annually by an accredited inspector.

The following table outlines the dates on which these inspections should take place in this school building.

REINSPECTION SCHEDULE

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>JUNE 1992</u>	<u>JUNE 1992</u>	<u>ASBESTECH</u>
<u>JUNE 1995</u>	<u>June '95</u>	<u>Alliance</u>
<u>JUNE 1998</u>	<u>June '98</u>	<u>Alliance</u>
<u>JUNE 2001</u>	<u>July '01</u>	<u>P. Wilson</u>
<u>JUNE 2004</u>	<u>July '04</u>	<u>C. Sparks</u>

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Clark County Middle High School
Building Number 01
HA ID 01
HA Description VAT
HA Type Miscellaneous Material
HA Location Options/Admin Office and records room

Quantity 957 SF
Comments This material has been covered with carpet and was not visible to inspect.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Clark County Middle High School
Building Number 01
HA ID 02
HA Description Mastic
HA Type Miscellaneous Material
HA Location Options/Admin Office and records room

Quantity 957 SF
Comments This material was not visible to inspect.
Asbestos Known
Friable No

Original Inspection 6/1/1992

Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Clark County Middle High School
Building Number 01
HA ID 01
HA Description VAT
HA Type Miscellaneous Material
HA Location Options/Admin Office and records room

Quantity 957 SF
Comments This material has been covered with carpet and was not visible to inspect.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Clark County Middle High School
Building Number 01
HA ID 02
HA Description Mastic
HA Type Miscellaneous Material
HA Location Options/Admin Office and records room

Quantity 957 SF
Comments This material was not visible to inspect.
Asbestos Known
Friable No

Original Inspection 6/1/1992
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Clark County Middle High School
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location
Options/Admin Office and records room

Material Description

VAT

Comments

This material has been covered with carpet and was not visible to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Clark County Middle High School
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location Options/Admin Office and records room
Material Description Mastic
Comments This material was not visible to inspect.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Jeffrey P. Rehtin

State

Indiana

Accreditation Number

19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Former Administration Building

HA# 01

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

VAT

Comments

This material has been covered with carpet and was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Reinspection Date 6/30/2010

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Sandra Shadley

State IN

Accreditation Number 19A002323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building

HA# 02

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Reinspection Date 6/30/2010

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Sandra Shadley

State IN

Accreditation Number 19A002323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

VAT

Comments

This material has been covered with new tile and was not visible to inspect.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 7/9/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Former Administration Building

HA# 02

Type of Material Miscellaneous Material

Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

Mastic

Comments

This material was not visible to inspect.

Does Material Contain Asbestos? Yes

Is it Friable? No

Original Inspection Date 6/1/1992

Current Reinspection Date 7/9/2007

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

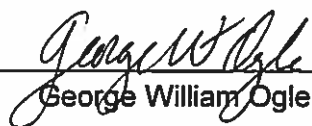
George William Ogle

State Indiana

Accreditation Number 191003027



THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

VAT

Comments

This material was not in poor condition.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 7/2/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location
Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description
Mastic

Comments
This material has been properly sampled and analyzed. It was found to be positive for asbestos content. It was not in poor condition.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/1/1992
Current Reinspection Date 7/2/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,200 LF

Material Location
Throughout the building


Material Description
Cove base

Comments

This material has been properly sampled and analyzed. It was found to be negative for asbestos content. This homogeneous area designation will be removed from the Management Plan.

Does Material Contain Asbestos? No
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 7/2/2004
Current Assessment Rating NA Not Applicable
Cause of Damage Not Applicable
Accessible Yes
Potential for Damage NA
Removed No
Planned Response Action None

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 400 SF

Material Location
Throughout the building

Material Description
Cove base mastic

Comments

This material has been properly sampled and analyzed. It was found to be negative for asbestos content. This homogeneous area designation will be removed from the Management Plan.

Does Material Contain Asbestos? No
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 7/2/2004
Current Assessment Rating NA Not Applicable
Cause of Damage Not Applicable
Accessible No
Potential for Damage NA
Removed No
Planned Response Action None

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# C
Type of Material Miscellaneous Material
Quantity of Material Approx. 8,900 SF
Material Location
Throughout the building
Material Description
Transite walls

Comments

This material has been properly sampled and analyzed. It was found to be negative for asbestos content. This homogeneous area designation will be removed from the Management Plan.


Does Material Contain Asbestos? No
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 7/2/2004
Current Assessment Rating NA Not Applicable
Cause of Damage Not Applicable
Accessible Yes
Potential for Damage NA
Removed No
Planned Response Action None

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

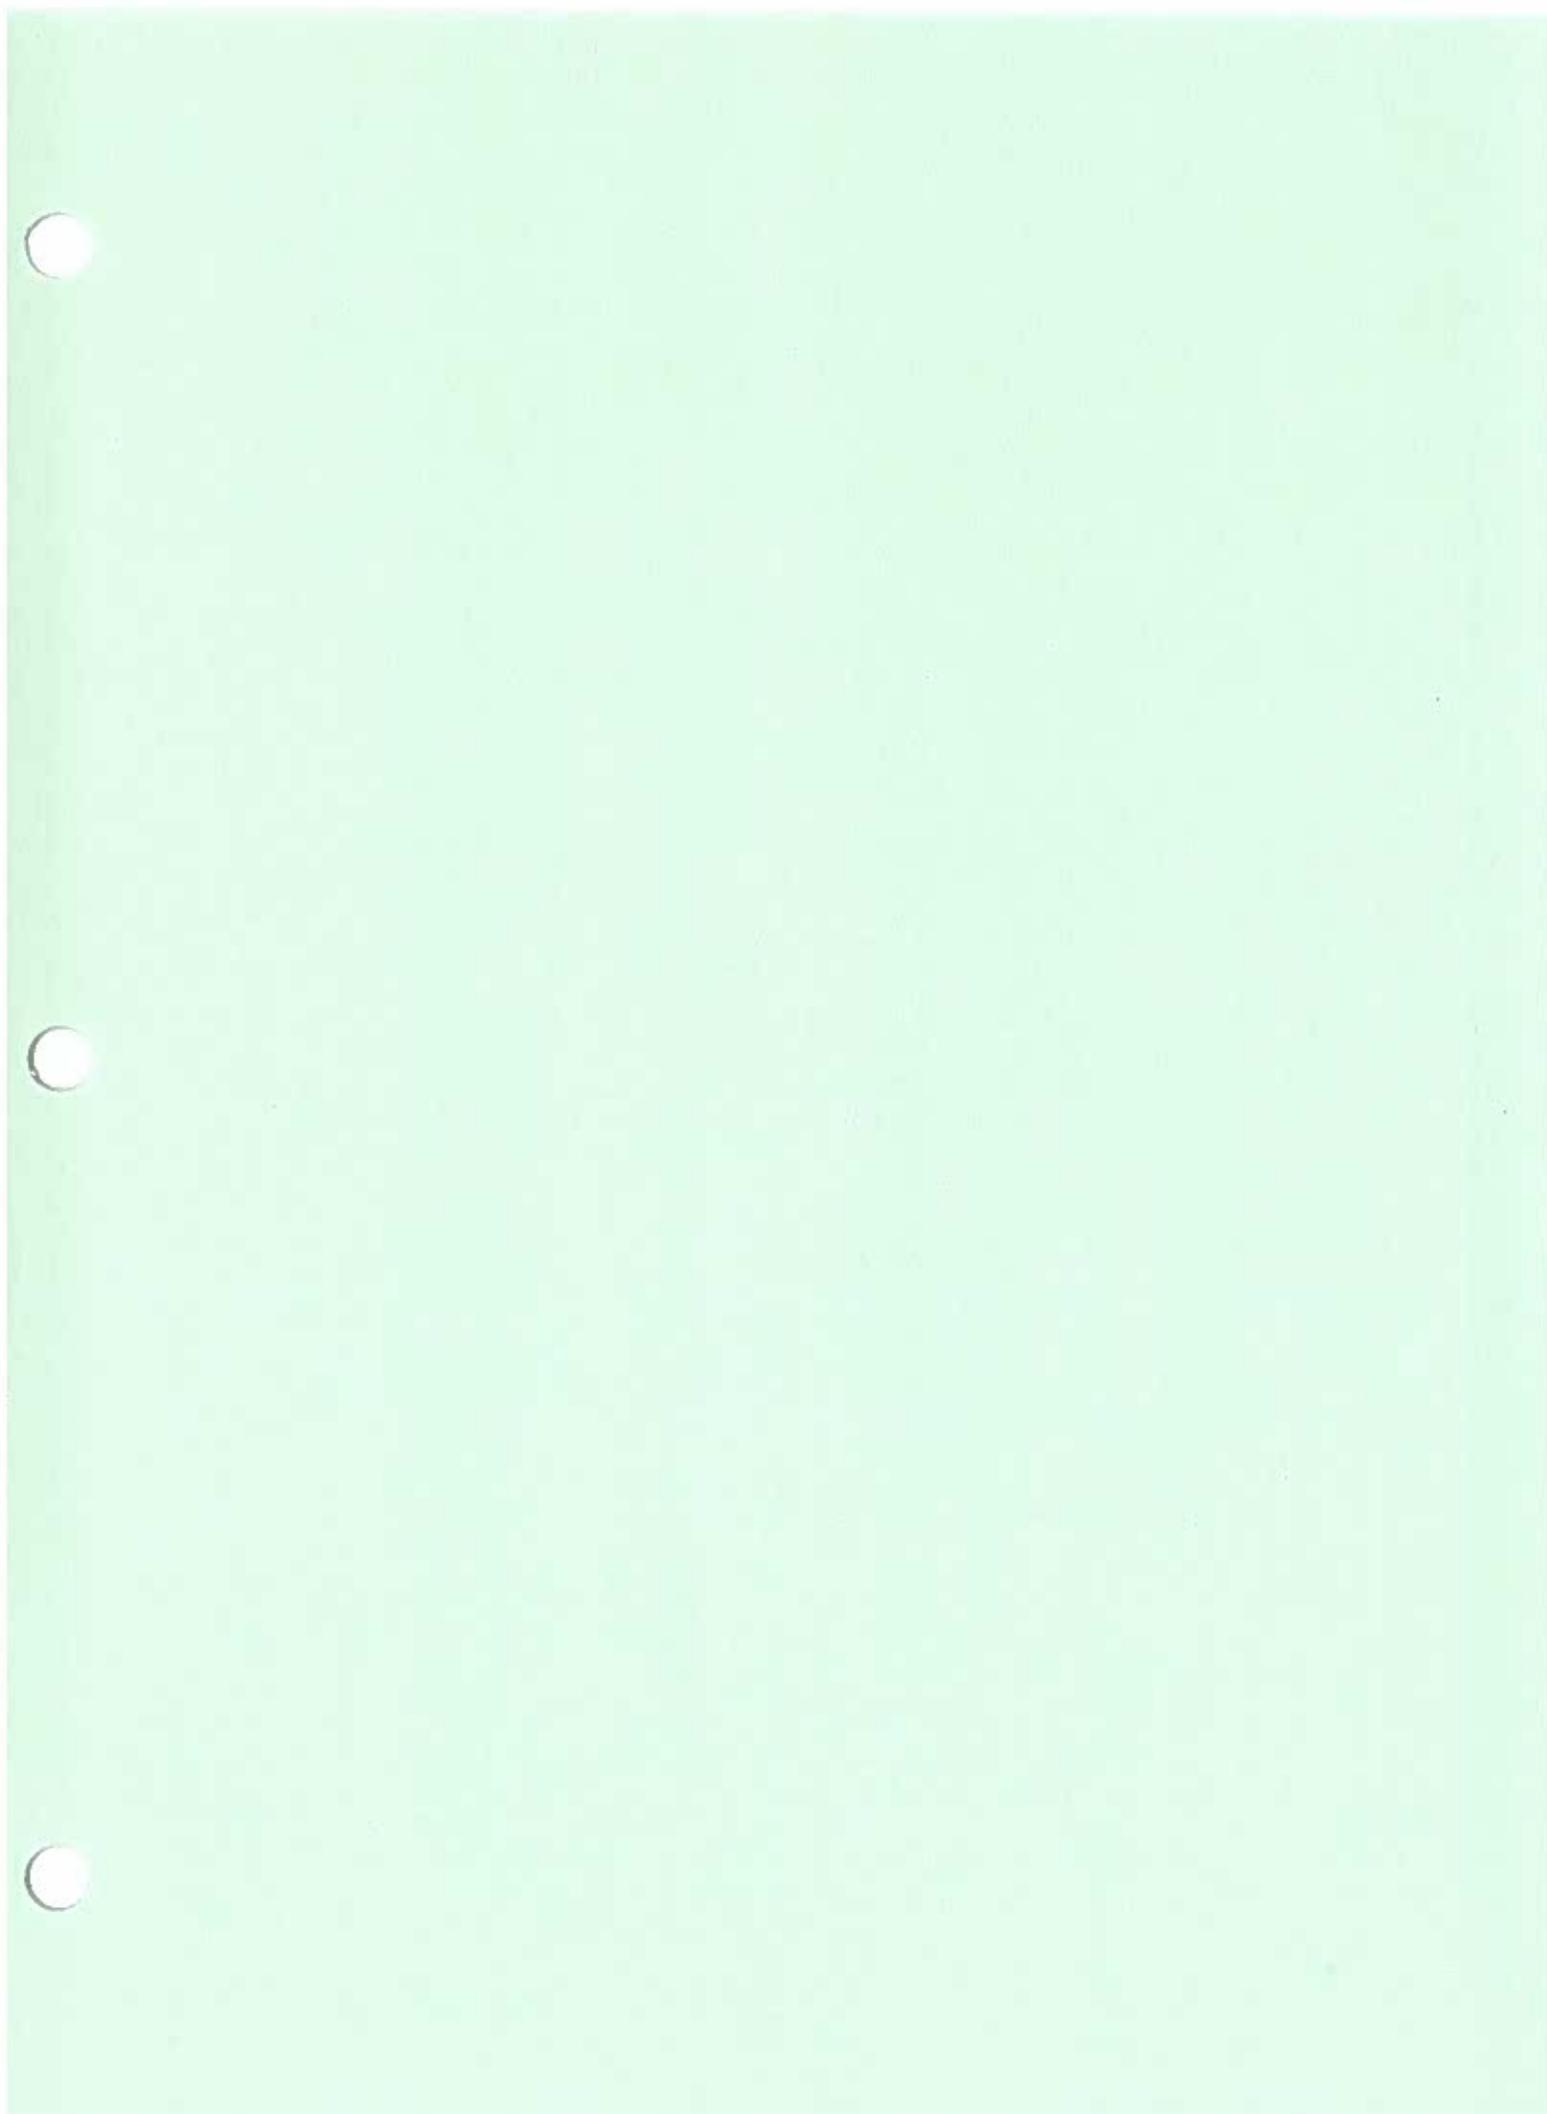

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location
Copier and Records Room

Material Description
VAT

Comments
This material is in good condition with minor chipping and cracking.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Reinspection Date 07/11/2001
Current Assessment Rating NR Not Required
Cause of Damage Deterioration & Age
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

Patrick E. Wilson
Patrick E. Wilson

State Indiana
Accreditation Number 190824065

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF
Material Location
Copier and Records Room

Material Description
Mastic

Comments
Mastic was not exposed to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1992
Current Reinspection Date 07/11/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Patrick E. Wilson

State Indiana
Accreditation Number 190824065

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,200 LF
Material Location
Throughout the building
Material Description
Cove base
Comments
Material is in good condition overall with minor signs of wear.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Reinspection Date 07/11/2001
Current Assessment Rating NR Not Required
Cause of Damage Deterioration & Age
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Patrick E. Wilson

State Indiana
Accreditation Number 190824065

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 400 SF

Material Location
Throughout the building

Material Description
Cove base mastic

Comments
No mastic was exposed to inspect.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Reinspection Date 07/11/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

Patrick E. Wilson ew
Patrick E. Wilson

State Indiana
Accreditation Number 190824065

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# C
Type of Material Miscellaneous Material
Quantity of Material Approx. 8,900 SF

Material Location
Throughout the building

Material Description
Transite walls

Comments
Walls are in good overall condition. Edges are exposed on some walls where the covering has separated.


Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Reinspection Date 07/11/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

Patrick E. Wilson

Patrick E. Wilson

State Indiana
Accreditation Number 190824065

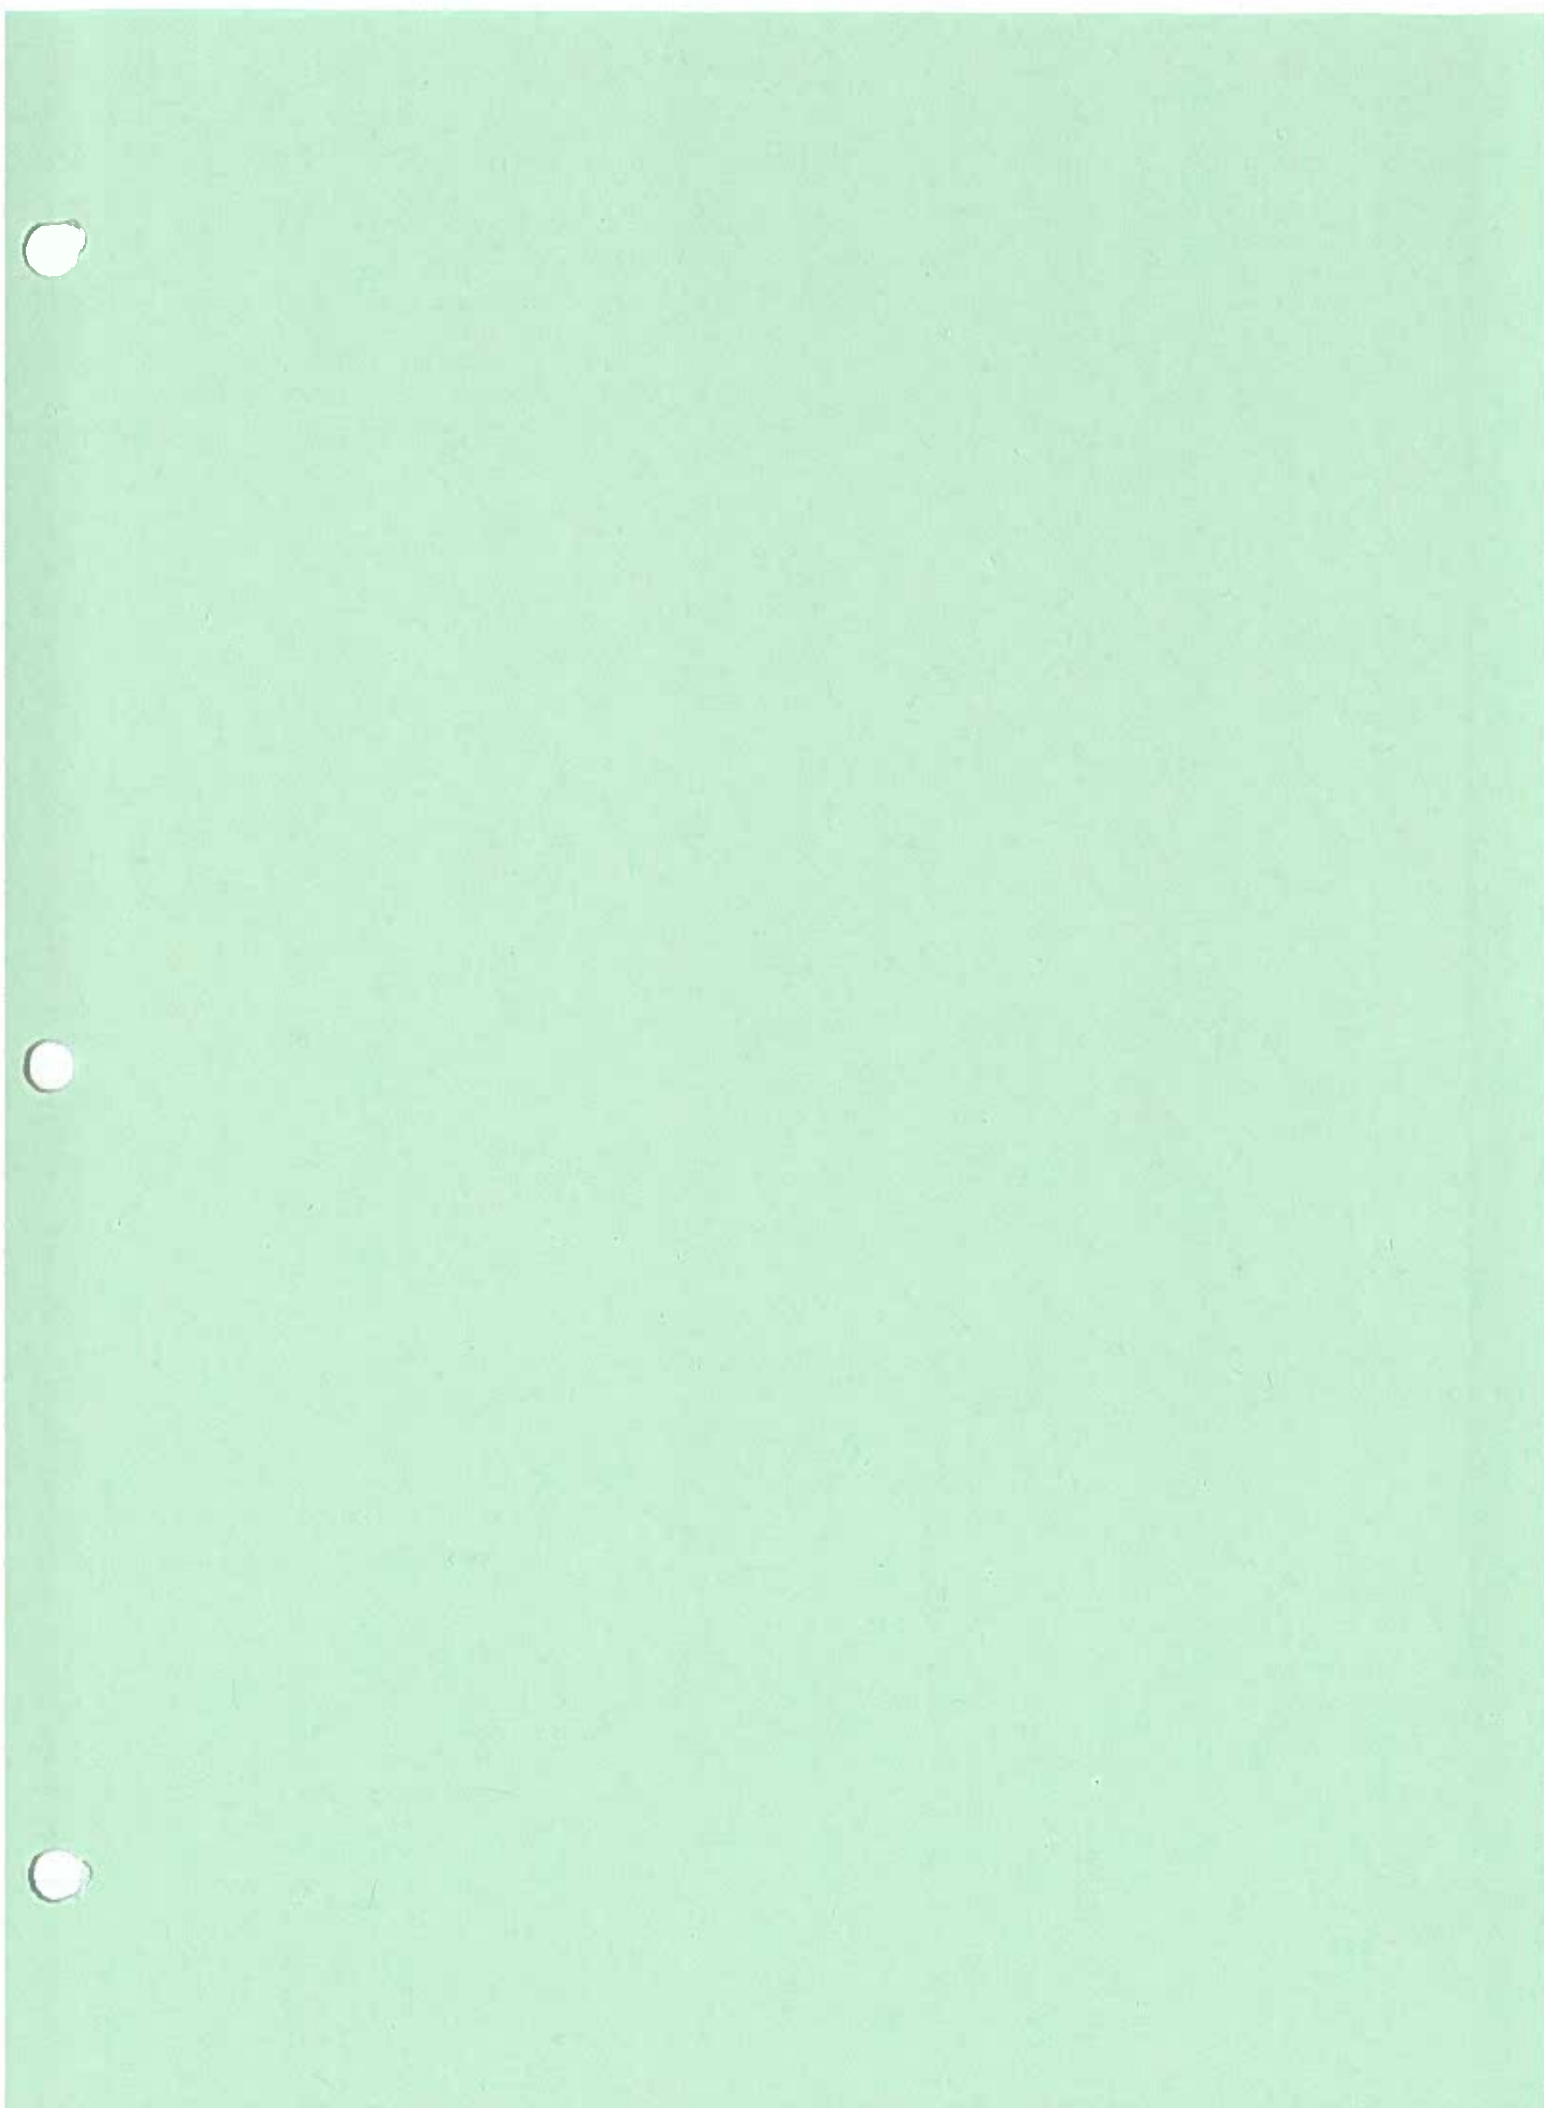

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF


Material Location
Copier and Records Room

Material Description
VAT

Comments
Material is in good condition.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Reinspection Date 6/ 1/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

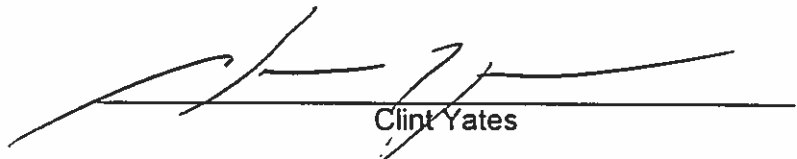

Clint Yates

State Indiana
Accreditation Number 193804035

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# 02
Type of Material Miscellaneous Material
Quantity of Material 957 SF


Material Location
Copier and Records Room

Material Description
Mastic

Comments
Material is assumed to be in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/ 1/92
Current Reinspection Date 6/ 1/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

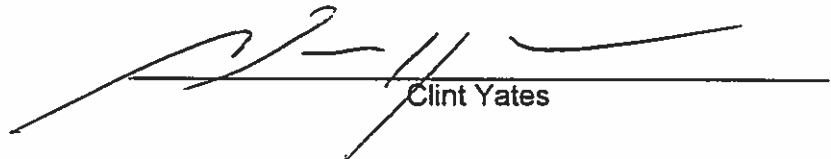

Clint Yates

State Indiana
Accreditation Number 193804035

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# A
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout Building
Material Description
Cove Base
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Reinspection Date 6/ 1/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Clint Yates

State

Indiana

Accreditation Number

193804035

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# B
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout the building


Material Description
Cove Base Mastic

Comments

Material is not exposed and is assumed to be in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Reinspection Date 6/ 1/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

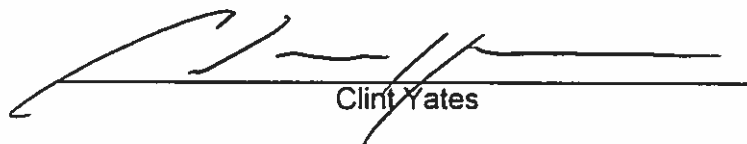

Clint Yates

State Indiana
Accreditation Number 193804035

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# C
Type of Material Miscellaneous Material
Quantity of Material SF

Material Location
Throughout the building


Material Description
Transite Walls

Comments

Nail holes are noted in the material throughout the building. However, it is in good condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Reinspection Date 6/ 1/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

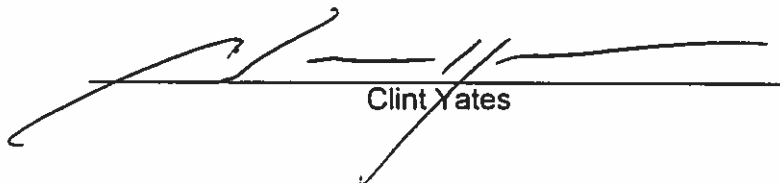
Clint Yates

State Indiana
Accreditation Number 193804035

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# D
Type of Material Miscellaneous Material
Quantity of Material Each
Material Location
Boiler Room
Material Description
Fittings

Comments

Material was found to be fiberglass and will be removed from the Management Plan.

Does Material Contain Asbestos? No
Is it Friable? No
Original Inspection Date 5/31/95
Current Reinspection Date 6/ 1/98
Current Assessment Rating NA Not Applicable
Cause of Damage Not Applicable
Accessible Yes
Potential for Damage NA
Removed No
Planned Response Action None

Inspector




Clint Yates

State Indiana
Accreditation Number 193804035


THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Greater Clark County Administration Bldg
HA# E
Type of Material Miscellaneous Material
Quantity of Material Each
Material Location
Boiler Room
Material Description
Gaskets on Boiler Doors
Comments
Material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Reinspection Date 6/ 1/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

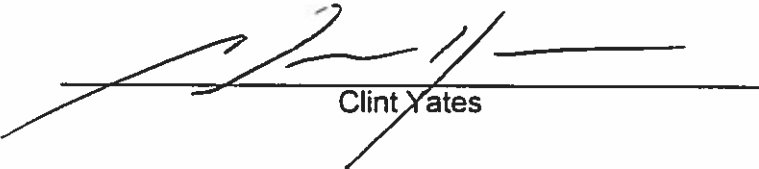
Clint Yates

State Indiana
Accreditation Number 193804035

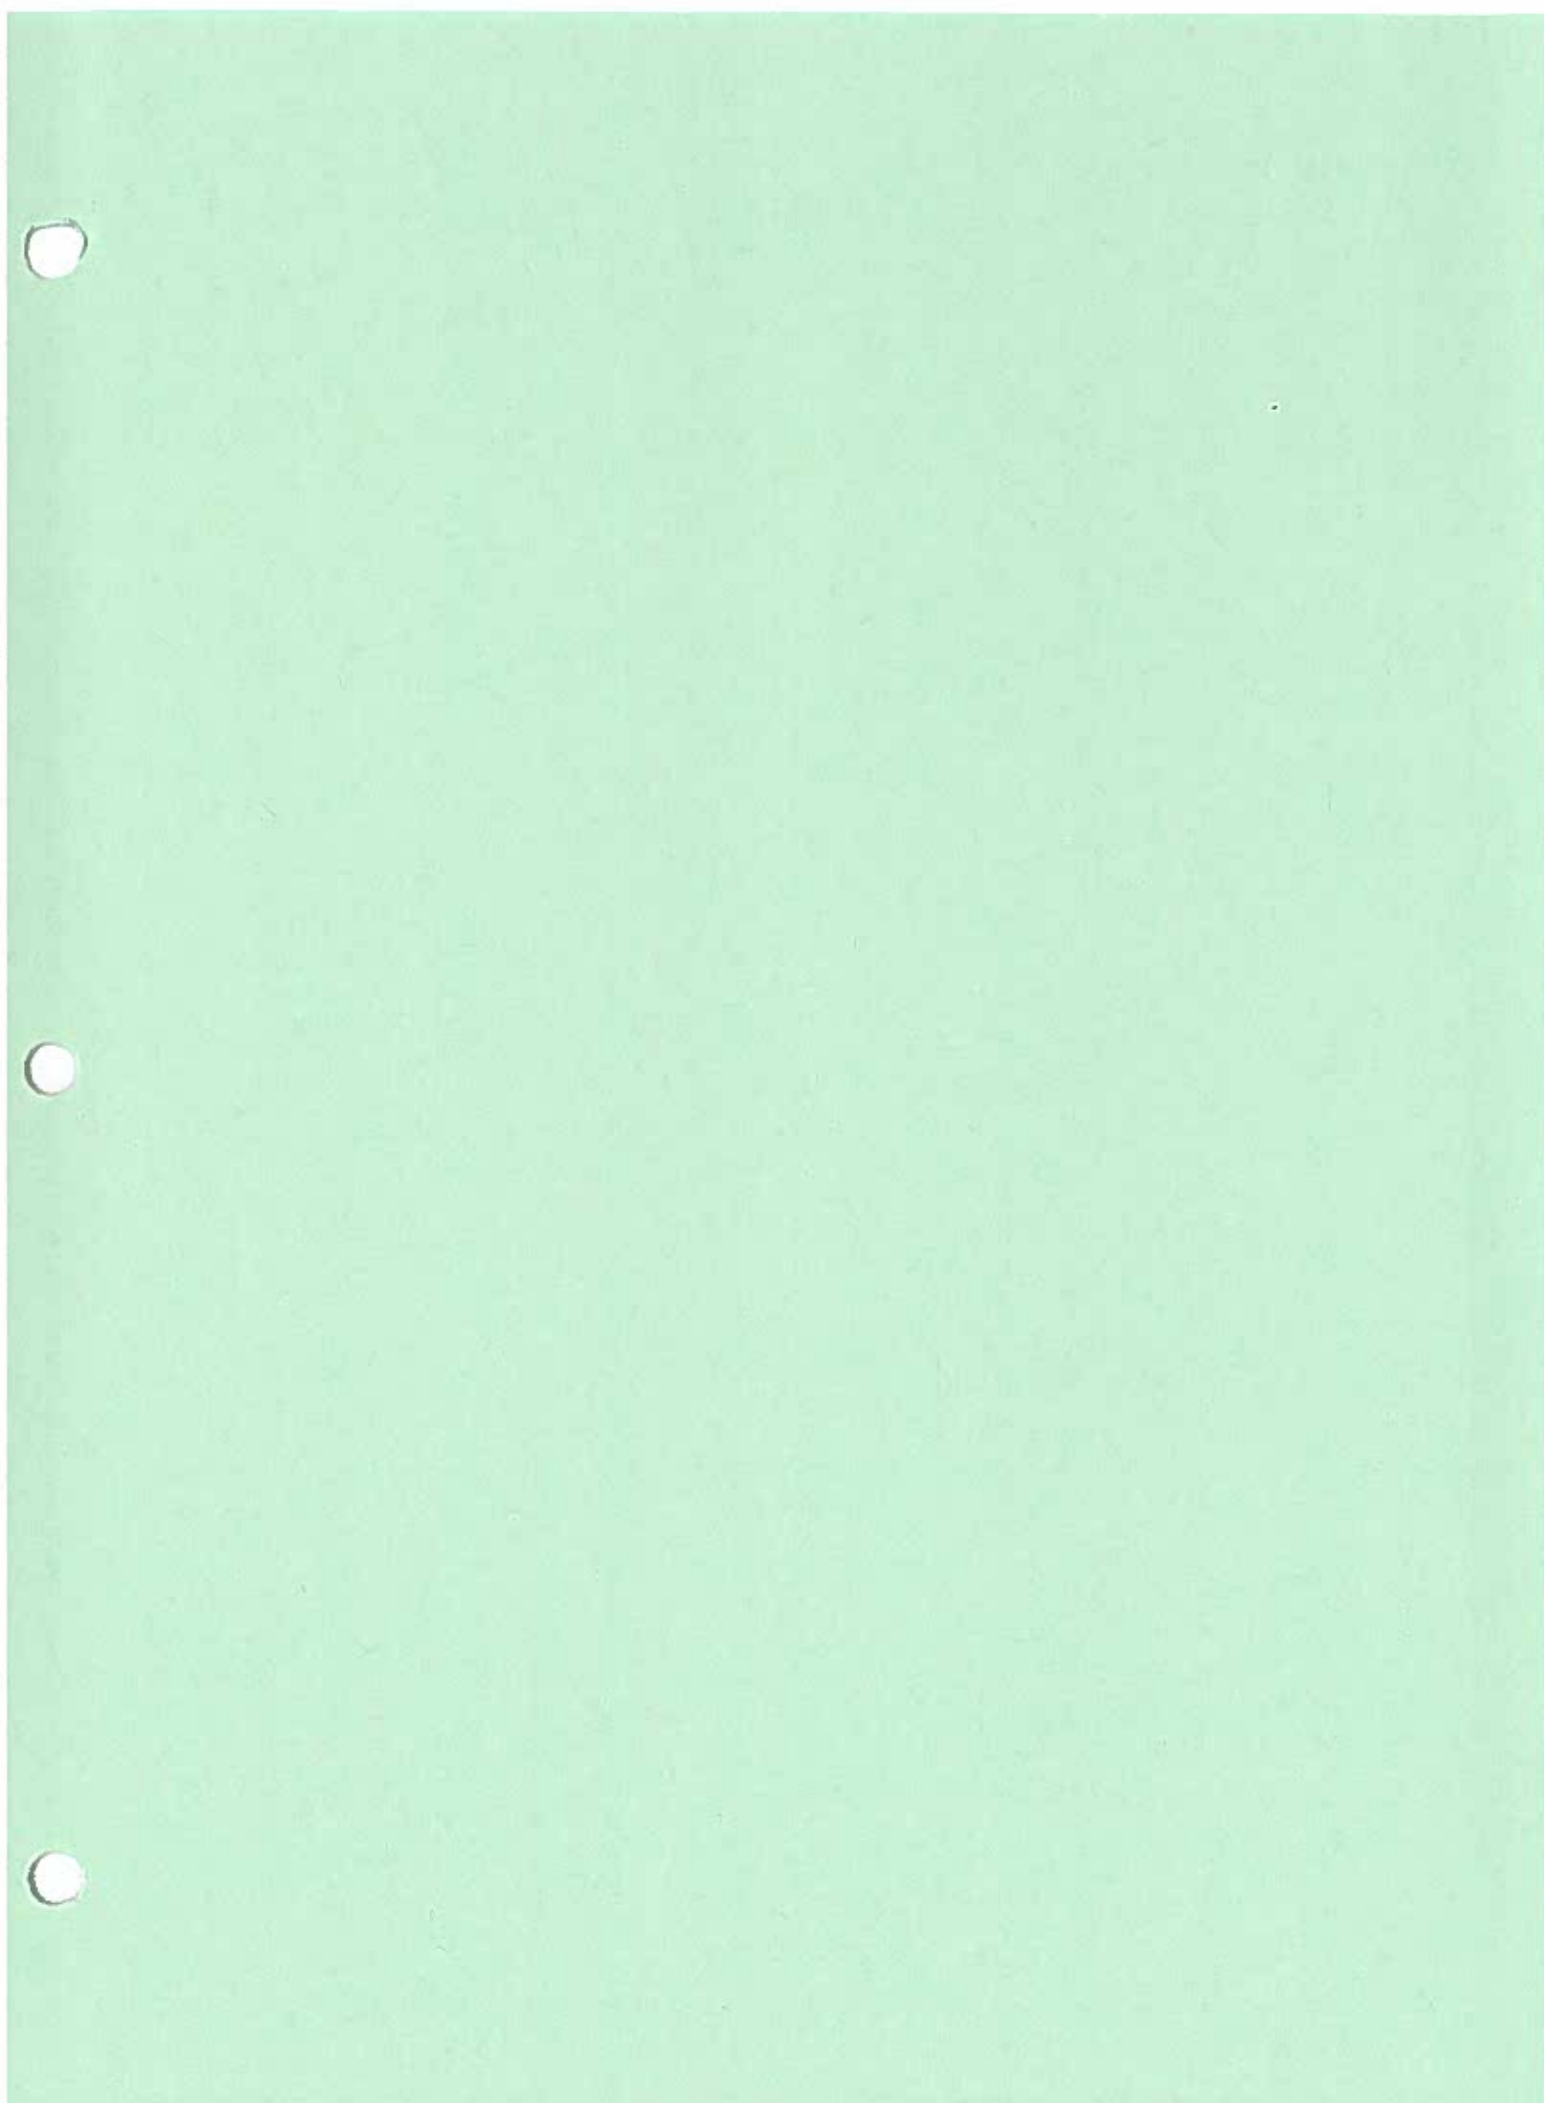

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.
BUILDING NAME: Greater Clark County Administration Bldg
HA#: 1
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL: 957SF
MATERIAL LOCATION:

Copier and Records Room

MATERIAL DESCRIPTION:

VAT

COMMENTS:

Material is known to be asbestos containing.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE: 06/01/92
CURRENT REINSPECTION DATE: 06/26/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)
INSPECTOR NAME: Rex Gaddis
STATE: Indiana
ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.
BUILDING NAME: Greater Clark County Administration Bldg
HA#: 2
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL: 957SF
MATERIAL LOCATION:

Copier and Records Room

MATERIAL DESCRIPTION:

Mastic

COMMENTS:

Material is in good condition and is assumed to be asbestos containing.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE: 06/01/92
CURRENT REINSPECTION DATE: 06/26/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:


Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.
BUILDING NAME: Greater Clark County Administration Bldg
HA#: A
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL:
MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE: 06/01/92
CURRENT REINSPECTION DATE: 06/26/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:



Rex Gaddis

STATE: Indiana
ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.
BUILDING NAME: Greater Clark County Administration Bldg
HA#: B
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL:
MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Cove Base Mastic

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE:
CURRENT REINSPECTION DATE: 06/26/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:



Rex Gaddis

STATE: Indiana
ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.
BUILDING NAME: Greater Clark County Administration Bldg
HA#: C

TYPE OF MATERIAL:

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout Building

MATERIAL DESCRIPTION:

Transite Walls

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT REINSPECTION DATE: 06/26/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

CURRENT VIDEO TAPE:
(TAPE NO/FOOTAGE)

/

INSPECTOR NAME:


Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.
BUILDING NAME: Greater Clark County Administration Bldg
HA#: D
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL:
MATERIAL LOCATION:

Boiler Room

MATERIAL DESCRIPTION:

Fittings

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE:
CURRENT REINSPECTION DATE: 06/26/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:


Rex Gaddis

STATE: Indiana
ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.
BUILDING NAME: Greater Clark County Administration Bldg
HA#: E
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL:
MATERIAL LOCATION:

Boiler Room

MATERIAL DESCRIPTION:

Gaskets on Boiler Doors

COMMENTS:

This material was not addressed in the original inspection. It is assumed to be positive and will be treated as ACM until it is sampled. Material is in good condition and is non-friable and does not need an assessment rating at this time.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE:
CURRENT REINSPECTION DATE: 06/26/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:



Rex Gaddis

STATE: Indiana
ACCREDITATION NO.: 190908032

ADDITIONAL BULK SAMPLES

ALLIANCE INDIANA, INC.

1433 Sadler Circle West Dr.

Indianapolis, IN 46239

317/351-5600 Fax 317/351-5610

24 JATProject Name- GREATER CLARK ADMIN BUILDING (VACANT)Project Location- THROUGHOUT THE BUILDINGCity/State- JEFFERSONVILLE INProject Number- NGR - Date- July 28th 2004Samples Collected By- CHUCK SPARKS

SAMPLE I.D. NUMBER	LOCATION OF SAMPLE	DESCRIPTION OF SAMPLE MATERIAL
P-MD-01	PLASTER FROM MAIN OFFICE AREA	LIGHT GRAY SEMI-CEMENTICIOUS
P-002-01	PLASTER FROM ROOM LABELED 002	LIGHT GRAY SEMI-CEMENTICIOUS
P-004-01	PLASTER FROM ROOM LABELED 004	WHITE SEMI-CEMENTICIOUS
CPTM-001-01	CARPET MASTIC FROM ROOM LABELED AS 001	BLACK TAR MATERIAL
CPTM-003-01	CARPET MASTIC FROM ROOM LABELED AS 003	BLACK TAR MATERIAL
CPTM-004-01	CARPET MASTIC FROM ROOM LABELED AS 004	BLACK TAR MATERIAL
FTM-RR-01	FLOOR TILE MASTIC RECORDS ROOM	BLACK TAR MATERIAL
FTM-CR-01	FLOOR TILE MASTIC COPIER ROOM	BLACK TAR MATERIAL
FTM-CR-02	FLOOR TILE MASTIC COPIER ROOM	BLACK TAR MATERIAL
CBM-RR-01	CONCRETE BASE MASTIC RECORDS ROOM	BROWN MASTIC MATERIAL
CBM-001-01	CONCRETE BASE MASTIC ROOM LABELED 001	BROWN MASTIC MATERIAL
CBM-004-01	CONCRETE BASE MASTIC ROOM LABELED 004	BROWN MASTIC MATERIAL

— PLEASE STOP @ 1st POSITIVE FOR EACH GROUP —
CHAIN OF CUSTODY

Sample By: C. SPARKSDate: 7-28-04Signature: [Signature]Date Shipped: 7-28-04Received By: E. PhillipsDate: 7/28/04Signature: [Signature]

Shipped Via: _____

Recorded By: _____

Date: _____ Log#: _____

Signature: _____

Shipped To: _____

EMSL Analytical

2001 East 52nd St., Indianapolis, IN 46205

Phone: (317) 803-2997 Fax: (317) 803-3047 Email: indianapolislabs@emsl.com

EMSL

Attn: Chris Sparks
Alliance Indiana, Inc.
1433 Sadler Circle West Dr.
Indianapolis, IN 46239

Fax: (317) 351-5610 Phone: (317) 351-5600
Project: Greater Clark Admin Building


Customer ID: ALLI65
Customer PO:
Received: 07/28/04 9:30 AM
EMSL Order: 160406333
EMSL Proj:
Analysis Date: 7/29/2004

Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Location	Appearance	Treatment	Non-Asbestos		Asbestos
				% Fibrous	% Non-Fibrous	% Type
P-MO-01 160406333-0001		White/Gray Non-Fibrous Heterogeneous	Crushed		20% Quartz 80% Non-fibrous (other)	None Detected
P-002-01 160406333-0002		White/Gray Non-Fibrous Heterogeneous	Crushed		20% Quartz 80% Non-fibrous (other)	None Detected
P-004-01 160406333-0003		White Non-Fibrous Homogeneous	Crushed		100% Non-fibrous (other)	None Detected
PTM-001-01 160406333-0004		Yellow/Brown Non-Fibrous Heterogeneous	Melted		100% Non-fibrous (other)	None Detected
CPTM-003-01 160406333-0005		Black/Yellow Non-Fibrous Heterogeneous	Melted		100% Non-fibrous (other)	None Detected
CPTM-004-01 160406333-0006		Black Non-Fibrous Homogeneous	Melted		100% Non-fibrous (other)	None Detected
FTM-RR-01 160406333-0007		Black Non-Fibrous Homogeneous	Melted	2% Cellulose	95% Non-fibrous (other)	3% Chrysotile
FTM-CR-01 160406333-0008						Not Analyzed
FTM-CR-02 160406333-0009						Not Analyzed

Analyst(s)

Margaret Phillips (12)

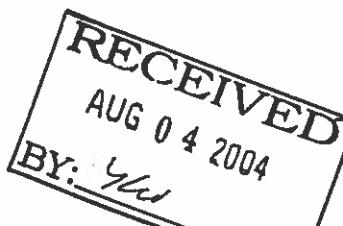

[Signature]
or other approved signatory

Due to magnification limitations inherent in PLM, asbestos fibers in dimensions below the resolution capability of PLM may not be detected. Samples reported as <1% or none detected may require additional testing by TEM to confirm asbestos quantities. The above test report relates only to the items tested and may not be reproduced in any form without the express written approval of EMSL Analytical, Inc. EMSL's liability is limited to the cost of analysis. EMSL bears no responsibility for sample collection activities or analytical method limitations. Interpretation and use of test results are the responsibility of the client.

Analysis performed by EMSL Indianapolis (NVLAP #200188-0)

EMSL Analytical

2001 East 52nd St., Indianapolis, IN 46205

Phone: (317) 803-2997 Fax: (317) 803-3047 Email: indianapolislabs@emsl.com

The logo consists of a dark diamond shape with the word "EMSL" in white, bold, sans-serif capital letters inside it.

Attn: Chris Sparks
Alliance Indiana, Inc.
1433 Sadler Circle West Dr.
Indianapolis, IN 46239

Fax: (317) 351-5610 Phone: (317) 351-5600
Project: Greater Clark Admin Building

Customer ID: ALLI65
Customer PO:
Received: 07/28/04 9:30 AM


EMSL Order: 160406333
EMSL Proj:
Analysis Date: 7/29/2004

Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Location	Appearance	Treatment	Non-Asbestos		Asbestos
				% Fibrous	% Non-Fibrous	% Type
CBM-RR-01 160406333-0010		Brown Non-Fibrous Homogeneous	Melted		100% Non-fibrous (other)	None Detected
CBM-001-01 160406333-0011		Brown Non-Fibrous Homogeneous	Melted	2% Cellulose	98% Non-fibrous (other)	None Detected
CBM-004-01 160406333-0012		Brown Non-Fibrous Homogeneous	Melted		100% Non-fibrous (other)	None Detected

Analyst(s)

Margaret Phillips (12)

A handwritten signature in black ink, appearing to read "Richard H. Harkins".

or other approved signatory

Due to magnification limitations inherent in PLM, asbestos fibers in dimensions below the resolution capability of PLM may not be detected. Samples reported as <1% or none detected may require additional testing by TEM to confirm asbestos quantities. The above test report relates only to the items tested and may not be reproduced in any form without the express written approval of EMSL Analytical, Inc. EMSL's liability is limited to the cost of analysis. EMSL bears no responsibility for sample collection activities or analytical method limitations. Interpretation and use of test results are the responsibility of the client.

Analysis performed by EMSL Indianapolis (NVLAP #200188-0)

ALLIANCE INDIANA, INC.

1433 Sadler Circle West Dr.

Indianapolis, IN 46239

317/351-5600 Fax 317/351-5610

24 TAT

160406353

Project Name- GREATER CLARK ADMIN BUILDING (VACANT)Project Location- THROUGHOUT THE BUILDINGCity/State- JEFFERSONVILLE INProject Number- NGR - Date- JULY 28th 2004Samples Collected By- CHRIS SPARKS

SAMPLE I.D. NUMBER	LOCATION OF SAMPLE	DESCRIPTION OF SAMPLE MATERIAL
P- MD- 01	PLASTER FROM MAIN OFFICE AREA	LIGHT GRAY SEMICEMENTICIOUS
P- 002- 01	PLASTER FROM ROOM LABED 002	LIGHT GRAY SEMICEMENTICIOUS
P- 004- 01	PLASTER FROM ROOM LABED 004	WHITE SEMICEMENTICIOUS
CPTM-001-01	CARPET MASTIC FROM ROOM LABED AS 001	BLACK TAR MATERIAL
CPTM-003-01	CARPET MASTIC FROM ROOM LABED AS 003	BLACK TAR MATERIAL
CPTM-004-01	CARPET MASTIC FROM ROOM LABED AS 004	BLACK TAR MATERIAL
FTM-RR-01	FLOOR TILE MASTIC RECORDS ROOM	BLACK TAR MATERIAL
FTM-CR-01	FLOOR TILE MASTIC COPIER ROOM	BLACK TAR MATERIAL
FTM-CR-02	FLOOR TILE MASTIC COPIER ROOM	BLACK TAR MATERIAL
CBM-RR-01	COUF BASE MASTIC RECORDS ROOM	BROWN MASTIC MATERIAL
CBM-001-01	COUF BASE MASTIC ROOM LABED 001	BROWN MASTIC MATERIAL
CBM-004-01	COUF BASE MASTIC ROOM LABED 004	BROWN MASTIC MATERIAL

— PLEASE STOP @ 1st POSITIVE FOR EACH GROUP —
CHAIN OF CUSTODY

Sample By: C. SPARKSDate: 7-28-04Signature: [Signature]Date Shipped: 7-28-04Received By: SPILLIOSDate: 7/28/04Signature: [Signature]

Shipped Via: _____

Recorded By: _____

Date: _____ Log#: _____

Signature: _____

Shipped To: _____

ALLIANCE INDIANA, INC.

1433 Sadlier Circle West Dr.

Indianapolis, IN 46239

317/351-5600 Fax 317/351-5610

24 TATProject Name- GREATER CLARK ADMIN. BUILDING (VACANT)Project Location- THROUGHOUT THE BUILDINGCity/State- JEFFERSONVILLE INProject Number- NGR — Date- July 28th 2004Samples Collected By- CHAS SPARKS

SAMPLE I.D. NUMBER	LOCATION OF SAMPLE	DESCRIPTION OF SAMPLE MATERIAL
CB-RR-01	COVE BASE RECORDS ROOM	BLACK COVE BASE
CB-001-01	COVE BASE ROOM LABELED 001	BLACK COVE BASE
CB-004-01	COVE BASE ROOM LABELED 004	BLACK COVE BASE
SE-TL-01	SIK INSULATION TEACHERS LOUNGE	GRAY SEMI-CEMENTICIOUS
SE-TL-02	SIK INSULATION TEACHERS LOUNGE	GRAY SEMI-CEMENTICIOUS
SE-TL-03	SIK INSULATION TEACHERS LOUNGE	GRAY SEMI-CEMENTICIOUS
—	STOP @ 1 st	POSITIVE PHASE —
/	/	/
/	/	/
/	/	/
/	/	/

CHAIN OF CUSTODYSample By: C SPARKSDate: 7-28-04Signature: [Signature]Date Shipped: 7-28-04Received By: E PhillipsDate: 7/28Signature: [Signature]

Shipped Via: _____

Recorded By: _____

Date: _____ Log#: _____

Signature: _____

Shipped To: _____

EMSL Analytical

2001 East 52nd St., Indianapolis, IN 46205

Phone: (317) 803-2997 Fax: (317) 803-3047 Email: indianapolislab@emsl.com

EMSL

Attn: Chris Sparks
Alliance Indiana, Inc.
1433 Sadler Circle West Dr.
Indianapolis, IN 46239

Customer ID: ALLI65
Customer PO:
Received: 07/28/04 9:30 AM

Fax: (317) 351-5610 Phone: (317) 351-5600
Project: Greater Clark Admin. Building

EMSL Order: 160406334
EMSL Proj:
Analysis Date: 7/29/2004

Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Location	Appearance	Treatment	Non-Asbestos		Asbestos
				% Fibrous	% Non-Fibrous	% Type
CB_RR-01 160406334-0001		Black Non-Fibrous Homogeneous	Melted		100% Non-fibrous (other)	None Detected
CB-001-01 160406334-0002		Black Non-Fibrous Homogeneous	Melted		100% Non-fibrous (other)	None Detected
CB-004-01 160406334-0003		Black Non-Fibrous Homogeneous	Melted		100% Non-fibrous (other)	None Detected
TL-01 160406334-0004		Gray Non-Fibrous Homogeneous	Ashed	20% Cellulose	80% Non-fibrous (other)	None Detected
SI-TL-02 160406334-0005		Gray Non-Fibrous Homogeneous	Melted	20% Cellulose	80% Non-fibrous (other)	None Detected
SI-TL-03 160406334-0006		Gray Non-Fibrous Homogeneous	Melted	20% Cellulose	80% Non-fibrous (other)	None Detected

Analyst(s)

Margaret Phillips (6)



or other approved signatory

Due to magnification limitations inherent in PLM, asbestos fibers in dimensions below the resolution capability of PLM may not be detected. Samples reported as <1% or none detected may require additional testing by TEM to confirm asbestos quantities. The above test report relates only to the items tested and may not be reproduced in any form without the express written approval of EMSL Analytical, Inc. EMSL's liability is limited to the cost of analysis. EMSL bears no responsibility for sample collection activities or analytical method limitations. Interpretation and use of test results are the responsibility of the client.

Analysis performed by EMSL Indianapolis (NVLAP #200188-0)

ALLIANCE INDIANA, INC.

1433 Sadler Circle West Dr.

Indianapolis, IN 46239

317/351-5600 Fax 317/351-5610

24 TAT

60406334

Project Name- GREATER CLARK ADMIN. BUILDING (VACANT)Project Location- THROUGHOUT THE BUILDINGCity/State- JEFFERSONVILLE INProject Number- NGR - Date- July 28th 2004Samples Collected By- CLARK SPARKS

SAMPLE I.D. NUMBER	LOCATION OF SAMPLE	DESCRIPTION OF SAMPLE MATERIAL
CB-RR-01	COVE BASE RECORDS ROOM	BLACK COVE BASE
CB-001-01	COVE BASE ROOM LABELED 001	BLACK COVE BASE
CB-004-01	COVE BASE ROOM LABELED 004	BLACK COVE BASE
SE-TL-01	SINK INSULATION TEACHERS LOUNGE	GRAY SEMI-CEMENTICIOUS
SE-TL-02	SINK INSULATION TEACHERS LOUNGE	GRAY SEMI-CEMENTICIOUS
SE-TL-03	SINK INSULATION TEACHERS LOUNGE	GRAY SEMI-CEMENTICIOUS
—	Stop @ 1 st	POSITIVE PLEASE —
/	/	/
/	/	/
/	/	/
/	/	/

CHAIN OF CUSTODYSample By: C SPARKSDate: 7-28-04Signature: [Signature]Date Shipped: 7-28-04Received By: E PhillipsDate: 7/28Signature: [Signature]

Shipped Via: _____

Recorded By: _____

Date: _____ Log#: _____

Signature: _____

Shipped To: _____

ALLIANCE INDIANA, INC.

1433 Sadler Circle West Dr.

Indianapolis, IN 46239

317/351-5600 Fax 317/351-5610

(24 TAT)

Project Name- GREATER CLARK ADMIN BUILDING (VACANT)Project Location- THROUGHOUT THE BUILDINGCity/State- JEFFERSONVILLE TNProject Number- NGR- Date- July 28th 2004Samples Collected By- CHICK SPARKS

SAMPLE I.D. NUMBER	LOCATION OF SAMPLE	DESCRIPTION OF SAMPLE MATERIAL
WP-PO-01A	WALL PANEL FROM PRINCIPALS OFFICE	DARK BROWN PRESS BOARD MATERIAL
WP-PO-01B	WALL PANEL FROM PRINCIPALS OFFICE	WHITE SEMI-CEMENTICIOUS MATERIAL
WP-005-01A	WALL PANEL FROM ROOM LABELED 005	DARK BROWN PRESS BOARD MATERIAL
WP-005-01B	WALL PANEL FROM ROOM LABELED 005	WHITE SEMI-CEMENTICIOUS MATERIAL
WP-006-01A	WALL PANEL FROM ROOM LABELED 006	DARK BROWN PRESS BOARD MATERIAL
WP-006-01B	WALL PANEL FROM ROOM LABELED 006	WHITE SEMI-CEMENTICIOUS MATERIAL
WP-007-01A	WALL PANEL FROM ROOM LABELED 007	DARK BROWN PRESS BOARD MATERIAL
WP-007-01B	WALL PANEL FROM ROOM LABELED 007	WHITE SEMI-CEMENTICIOUS MATERIAL
STOP	READING "A" SAMPLES AT 1 st POSITIVE	
STOP	READING "B" SAMPLES AT 1 st POSITIVE	
/	/	/
/	/	/

CHAIN OF CUSTODYSample By: C. SPARKSDate: 7-28-04Signature: [Signature]Date Shipped: 7-28-04Received By: E PhillipsDate: 7/28/04Signature: [Signature]

Shipped Via: _____

Recorded By: _____

Date: _____ Log#: _____

Signature: _____

Shipped To: _____

EMSL Analytical

2001 East 52nd St., Indianapolis, IN 46205

Phone: (317) 803-2997 Fax: (317) 803-3047 Email: indianapolislabs@emsl.com

EMSL

Attn: Chris Sparks
Alliance Indiana, Inc.
1433 Sadler Circle West Dr.
Indianapolis, IN 46239

Fax: (317) 351-5610

Phone: (317) 351-5600

Project: Greater Clark Admin Building

Customer ID: ALLI65

Customer PO:

Received: 07/28/04 9:30 AM

EMSL Order: 160406335

EMSL Proj:


Analysis Date: 7/29/2004

Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Location	Appearance	Treatment	Non-Asbestos		Asbestos
				% Fibrous	% Non-Fibrous	% Type
WP-PO-01A 160406335-0001		White/Brown Fibrous Heterogeneous	Teased	95% Cellulose	5% Non-fibrous (other)	None Detected
WP-PO-01B 160406335-0002		White/Tan Fibrous Heterogeneous	Crushed	40% Cellulose	60% Gypsum	None Detected
WP-005-01A 160406335-0003		White/Brown Fibrous Heterogeneous	Teased	95% Cellulose	5% Non-fibrous (other)	None Detected
WP-005-01B 160406335-0004		White/Tan Fibrous Heterogeneous	Crushed	40% Cellulose	60% Gypsum	None Detected
WP-006-01A 160406335-0005		White/Brown Fibrous Heterogeneous	Teased	95% Cellulose	5% Non-fibrous (other)	None Detected
WP-006-01B 160406335-0006		White/Tan Fibrous Heterogeneous	Crushed	40% Cellulose	60% Gypsum	None Detected
WP-007-01A 160406335-0007		White/Brown Fibrous Heterogeneous	Teased	95% Cellulose	5% Non-fibrous (other)	None Detected
WP-007-01B 160406335-0008		White/Tan Fibrous Heterogeneous	Crushed	40% Cellulose	60% Gypsum	None Detected

Analyst(s)

Margaret Phillips (8)



or other approved signatory

Due to magnification limitations inherent in PLM, asbestos fibers in dimensions below the resolution capability of PLM may not be detected. Samples reported as <1% or none detected may require additional testing by TEM to confirm asbestos quantities. The above test report relates only to the items tested and may not be reproduced in any form without the express written approval of EMSL Analytical, Inc. EMSL's liability is limited to the cost of analysis. EMSL bears no responsibility for sample collection activities or analytical method limitations. Interpretation and use of test results are the responsibility of the client.

Analysis performed by EMSL Indianapolis (NVLAP #200188-0)

ALLIANCE INDIANA, INC.

1433 Sadler Circle West Dr.

Indianapolis, IN 46239

317/351-5600 Fax 317/351-5610

(24 TAT)

160406835

Project Name- GREATER CLARK ADMIN BUILDING (VACANT)Project Location- THROUGHOUT THE BUILDINGCity/State- JEFFERSONVILLE TNProject Number- NGR- Date- JULY 28th 2004Samples Collected By- CHUCK SPARKS

SAMPLE I.D. NUMBER	LOCATION OF SAMPLE	DESCRIPTION OF SAMPLE MATERIAL
WP-PO-01A	WALL PANEL FROM PRINCIPALS OFFICE	DARK BROWN PLYESS BOARD MATERIAL
WP-PO-01B	WALL PANEL FROM PRINCIPALS OFFICE	WHITE SEMI-CEMENTICIOUS MATERIAL
WP-005-01A	WALL PANEL FROM ROOM LABED 005	DARK BROWN PLYESS BOARD MATERIAL
WP-005-01B	WALL PANEL FROM ROOM LABED 005	WHITE SEMI-CEMENTICIOUS MATERIAL
WP-006-01A	WALL PANEL FROM ROOM LABED 006	DARK BROWN PLYESS BOARD MATERIAL
WP-006-01B	WALL PANEL FROM ROOM LABED 006	WHITE SEMI-CEMENTICIOUS MATERIAL
WP-007-01A	WALL PANEL FROM ROOM LABED 007	DARK BROWN PLYESS BOARD MATERIAL
WP-007-01B	WALL PANEL FROM ROOM LABED 007	WHITE SEMI-CEMENTICIOUS MATERIAL
STOP	READING "A" SAMPLES AT 1 st POSITIVE	
STOP	READING "B" SAMPLES AT 1 st POSITIVE	
/	/	/
/	/	/

CHAIN OF CUSTODYSample By: C. SPARKSDate: 7-28-04Signature: [Signature]Date Shipped: 7-28-04Received By: E PhillipsDate: 7/28/04Signature: [Signature]

Shipped Via: _____

Recorded By: _____

Date: _____ Log#: _____

Signature: _____

Shipped To: _____

ALLIANCE INDIANA, INC.

1433 Sadler Circle West Dr.

Indianapolis, IN 46239

317/351-5600 Fax 317/351-5610

3 hr RSHProject Name- GREATER CLARK ADMIN BUILDING (VACANT)Project Location- THROUGHOUT THE BUILDINGCity/State- JEFFERSONVILLE, INProject Number- NGR - Date- July 28th 2004Samples Collected By- CHRIS SPARKS

SAMPLE I.D. NUMBER	LOCATION OF SAMPLE	DESCRIPTION OF SAMPLE MATERIAL
CT1-TL-01	9'X2' CEILING TILE IN TEACHERS LOUNGE	WHITE TILE WITH LARGE RANDOM FISSURE PATTERN
CT1-CR-01	2'X2' CEILING TILE IN COPER ROOM	WHITE TILE WITH LARGE RANDOM FISSURE PATTERN
CT1-MO-01	2'X2' CEILING TILE IN MAIN OFFICE	WHITE TILE WITH LARGE RANDOM FISSURE PATTERN
— PLEASE STOP AT FIRST POSITIVE —		
CT2-003-01	12"X12" CEILING TILE IN ROOM LABELED 003	WHITE TILE WITH MEDIUM RANDOM FISSURE PATTERN
CT2-003-02	12"X12" CEILING TILE IN ROOM LABELED 003	WHITE TILE WITH MEDIUM RANDOM FISSURE PATTERN
CT2-003-03	12"X12" CEILING TILE IN ROOM LABELED 003	WHITE TILE WITH MEDIUM RANDOM FISSURE PATTERN
— PLEASE STOP @ FIRST POSITIVE —		
/	/	/
/	/	/
/	/	/
/	/	/

CHAIN OF CUSTODYSample By: CSPARKSDate: 7-28-04Signature: [Signature]Date Shipped: 7-28-04Received By: E. PhillipsDate: 7/28Signature: E. Phillips

Shipped Via: _____

Recorded By: _____

Date: _____

Signature: _____

Shipped To: _____

EMSL Analytical

2001 East 52nd St., Indianapolis, IN 46205

Phone: (317) 803-2997 Fax: (317) 803-3047 Email: indianapolislab@emsl.com

EMSL

SM

Attn: Chris Sparks
Alliance Indiana, Inc.
1433 Sadler Circle West Dr.
Indianapolis, IN 46239

Fax: (317) 351-5610 Phone: (317) 351-5600

Project: Greater Clark Admn Building (Vacant)

Customer ID: ALLI65

Customer PO:

Received: 07/28/04 9:40 AM

EMSL Order: 160406319

EMSL Proj:

Analysis Date: 7/28/2004

Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Location	Appearance	Treatment	Non-Asbestos		Asbestos
				% Fibrous	% Non-Fibrous	% Type
CT1-TL-01 160406319-0001		White/Silver Fibrous Heterogeneous	Teased	90% Min. Wool	10% Non-fibrous (other)	None Detected
CT1-CR-01 160406319-0002		White/Silver Fibrous Heterogeneous	Teased	90% Min. Wool	10% Non-fibrous (other)	None Detected
CT1-MO-01 160406319-0003		White/Silver Fibrous Heterogeneous	Teased	90% Min. Wool	10% Non-fibrous (other)	None Detected
2-003-01 160406319-0004		White Fibrous Homogeneous	Teased	95% Min. Wool	5% Non-fibrous (other)	None Detected
CT2-003-02 160406319-0005		White Fibrous Homogeneous	Teased	95% Min. Wool	5% Non-fibrous (other)	None Detected
CT2-003-03 160406319-0006		White Fibrous Homogeneous	Teased	95% Min. Wool	5% Non-fibrous (other)	None Detected

Analyst(s)

Craig Nixon (6)



or other approved signatory

Due to magnification limitations inherent in PLM, asbestos fibers in dimensions below the resolution capability of PLM may not be detected. Samples reported as <1% or none detected may require additional testing by TEM to confirm asbestos quantities. The above test report relates only to the items tested and may not be reproduced in any form without the express written approval of EMSL Analytical, Inc. EMSL's liability is limited to the cost of analysis. EMSL bears no responsibility for sample collection activities or analytical method limitations. Interpretation and use of test results are the responsibility of the client.

Analysis performed by EMSL Indianapolis (NVLAP #200188-0)

ALLIANCE INDIANA, INC.
1433 Sadlier Circle West Dr.
Indianapolis, IN 46239
317/351-5600 Fax 317/351-5610

3 hr
Rush

16040631C

Call
459-4222

Project Name- GREATER CLARK ADMIN BUILDING (VACANT)

Project Location- THROUGHOUT THE BUILDING

Pages 307-6497

City/State- JEFFERSONVILLE, IN

Project Number- NGR -

Date- July 28th 2001

Samples Collected By- CHRIS SPARKS

SAMPLE I.D. NUMBER	LOCATION OF SAMPLE	DESCRIPTION OF SAMPLE MATERIAL
CT1-TL-01	9'x2' CEILING TILE IN TEACHERS LOUNGE	WHITE TILE WITH LARGE RANDOM FISSURE PATTERN
CT1-CR-01	9'x2' CEILING TILE IN COPER ROOM	WHITE TILE WITH LARGE RANDOM FISSURE PATTERN
CT1-MO-01	9'x2' CEILING TILE IN MAIN OFFICE	WHITE TILE WITH LARGE RANDOM FISSURE PATTERN
— PLEASE STOP AT FIRST POSITIVE —		
CT2-003-01	12"x12" CEILING TILE IN Room LABSD 003	WHITE TILE WITH MEDIUM RANDOM FISSURE PATTERN
CT2-003-02	12"x12" CEILING TILE IN Room LABSD 003	WHITE TILE WITH MEDIUM RANDOM FISSURE PATTERN
CT2-003-03	12"x12" CEILING TILE IN Room LABSD 003	WHITE TILE WITH MEDIUM RANDOM FISSURE PATTERN
— PLEASE STOP @ FIRST POSITIVE —		
/	/	/
/	/	/
/	/	/
/	/	/

CHAIN OF CUSTODY

Sample By: C SPARKS

Date: 7-28-01

Signature: [Signature]

Date Shipped: 7-28-01

Received By: E Phillips

Date: 7/28

Signature: [Signature]

Shipped Via: _____

Recorded By: _____

Date: _____ Log#: _____

Signature: _____

Shipped To: _____

**ANNUAL NOTIFICATIONS
ACCREDITATIONS
TRAINING
INFORMATION**

NOTICES

NOTIFICATION LOG

GREATER CLARK COUNTY SCHOOLS

DATE OF NOTIFICATION

COPY IN BOOK

YEAR

(X)

2009

2010

2011

2012

2013

2014

2015

2016

2017

2018

2019

2020

2021

2022

2023

2024

2025

2026

2027

2028

2029

2030

NOTIFICATION LOG

LEA Name - Greater Clark County Schools

<u>Date of Notification</u>	<u>Copy of Notification in Supplemental Book?</u>
1989	
1990	
1991	
1992	
1993	
1994	
1995	✓
1996	✓
1997	✓
1998	✓
1999	✓
2000	✓
2001	✓
2002	✓
2003	✓
2004	✓
2005	✓
2006	✓
2007	✓
2008	✓

March 2013

**AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, Corden Porter Storage, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2013/2014 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- * The required triennial re-inspection will be performed in April 2013.
- * The required six month periodic surveillance was performed in October 2012.
- * The required six month periodic surveillance activities are scheduled for April and October each year.
- * Projects completed in 2012: Parkview Middle School.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

March 2012

**AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, and Cordon Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2012/2013 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- * The required triennial re-inspection will be performed in June 2013.
- * The required six month periodic surveillance was performed in December 2011.
- * The required six month periodic surveillance activities are scheduled for June and December each year.
- * Projects completed in 2011: Options building and Parkwood Elementary.
- * Projects scheduled for 2012: Parkview Middle School and Bridgepoint Elementary.
- * Cordon Porter storage building was sold in 2012.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

**AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxillary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, Options and Corden Porter Center Buildings and Alternative School-

- * The required triennial reinspection will be performed in June 2013.
- * The required six month periodic surveillance was performed in December 2010.
- * The next scheduled activity is the required six month periodic surveillance in June 2011.
- * Charlestown High School asbestos removal project was completed in 2010.
- * Options Building is under renovation in 2011.
- * Parkwood Elementary is under renovation in 2011.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building
– These buildings are asbestos free and **Riverside Elementary** was demolished in 2006.
No surveillances or reinspections are required for these buildings.

March 2011

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxillary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection will be performed in June 2010.
- * The required six month periodic surveillance was performed in December 2009.
- * The next scheduled activity is the required six month periodic surveillance in December 2010.
Charlestown High School is an ongoing asbestos removal project which will be complete prior to partial demolition.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -
These buildings are asbestos free and **Riverside Elementary** was demolished in 2006.
No surveillances or reinspections are required for these buildings.

March 2010

**AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2007.
- * The required six month periodic surveillance was performed in December 2008.
- * The next scheduled activities are the required six month periodic surveillance in June 2009 and Dec 2009. Charlestown High School has undergone an asbestos removal project prior to partial demolition.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -
These buildings are asbestos free and **Riverside Elementary** was demolished in 2006.
No surveillances or re-inspections are required for these buildings.

April 2009

**AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number (812)288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2007.
- * The required six month periodic surveillance was performed in December 2007.
- * The next scheduled activities are the required six month periodic surveillance in June 2008 and Dec 2008.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free. **Riverside Elementary** was Demolition in 2006. No surveillances or reinspections are required.

April 2008

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required six month periodic surveillance was performed in June 2006.
- * The required six month periodic surveillance was performed in December 2006.
- * The next scheduled activities are the required six month periodic surveillance in June 2007 and Dec 2007.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building - These buildings are asbestos free. **Riverside Elementary** was Demolition in 2006. No surveillances or reinspections are required.

March 2007

**AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2005.
- * The required six month periodic surveillance was performed in December 2005.
- * The next scheduled activities are the required six month periodic surveillance in June 2006 and Dec 2006.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building –
These buildings are asbestos free. No surveillances or reinspections are required.

March 2006

**AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2004.
- * The required six month periodic surveillance was performed in December 2004.
- * The next scheduled activities are the required six month periodic surveillance in June 2005 and December 2005.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

- * These buildings are asbestos free. No surveillances or reinspections are required.

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required six month periodic surveillance was performed in June 2003.
- * The required six month periodic surveillance was performed in December 2003.
- * The next scheduled activities are the required triennial reinspection in June 2004 and a required six month periodic surveillance in December 2004.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

- * These buildings are asbestos free. No surveillances or reinspections are required.

**AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required six month periodic surveillance was performed in June 2002.
- * The required six month periodic surveillance was performed in December 2002.
- * The next scheduled activity is the required periodic surveillance in June 2003.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

- * These buildings are asbestos free. No surveillances or reinspections are required.

May 2003

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in July 2001.
- * The required six month periodic surveillance was performed in December 2001.
- * The next scheduled activities are the required periodic surveillances in June 2002 and December 2002.

Pleasant Ridge Elementary School and (New) Utica Elementary School -

- * These buildings are asbestos free. No surveillances or reinspections are required.

(Old) Utica Elementary School -

- * In accordance with information collected from the GCCS this building has been deeded to the town of Utica. No further AHERA periodic surveillances or triennial reinspections will be conducted by the designated person.

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, (Old) Utica, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center -

- * The required six month periodic surveillance was performed in June 2000.
- * The required six month periodic surveillance was performed in January 2001.
- * The next scheduled activity is a required triennial reinspection in June 2001.

Pleasant Ridge Elementary School and (New) Utica Elementary School -

- * This building is asbestos free. No surveillances or reinspections are required.

June 2001

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, Utica, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center -

- * The required six month periodic surveillance was performed in June 1999.
- * The required six month periodic surveillance was performed in December 1999.
- * The next scheduled activity is a required periodic surveillance in June 2000.

Pleasant Ridge Elementary School -

- * This building is asbestos free. No surveillances or reinspections are required.

June 2000

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required six month periodic surveillance was performed in June 1998.
- * The required six month periodic surveillance was performed in December 1998.
- * The next scheduled activity is a required periodic surveillance in June 1999.

Parkwood Elementary School

- * O & M was performed in the boiler room in May 1998.

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1997 and December 1997.
- * Next activity scheduled activity is a required third year reinspection in June 1998.

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available, should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1996 and December 1996.
- * The next required periodic surveillance will be performed in June 1997 and December 1997.

June 97

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Denny Johanson at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All buildings where it is required -

- * The required third year reinspection was performed in June 1995.
- * The required periodic surveillance was performed in December 1995.
- * Next activity scheduled is a periodic surveillance in June 1996.

Charlestown High School -

- * Transite panels were compliantly removed from the exterior of the building.

Corden Porter Building #3 -

- * TSI was compliantly removed from the boiler room.

June 96

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available, should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Dennis Johanson at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1995 and December 1995.
- * The required triennial reinspection was performed in June 1995.
- * The next required periodic surveillance will be performed in June 1996 and December 1996.

June 95

ACCREDITATIONS

Indiana Department of Environmental Management
100 N. Senate Avenue
Mail Code 61-52 IGCN 1003
Indianapolis, IN 46204-2251



April 17, 2014

RECEIVED APR 22 2014

Benjamin S. Hood
Alliance Environmental Group
5340 Commerce Circle, Ste E
Indianapolis IN 46237

Re: Asbestos Inspector # 19A001039

Based upon the review of your license application, the Office of Air Quality has determined that you have fulfilled the requirements of 326 IAC 18 and are eligible for licensing in the following discipline:

Asbestos Inspector

Your Asbestos Inspector license is attached below. The license is waterproof and tear resistant. Please sign your license and do not laminate or alter your license in anyway. Your license must be available for review at all times while implementing an asbestos project. This license may be revoked, pursuant to 326 IAC 18-1-7, if you:

- (1) Violate any requirements of these rules (326 IAC 18), 326 IAC 14-10, or any requirement of the Asbestos-Containing Materials in Schools Rule or any other federal, state, or local regulation pertaining to asbestos in buildings or to asbestos projects.
- (2) Falsify information on your application for licensing.
- (3) Fail to meet any qualifications specified in 326-IAC 18-1-4.
- (4) Conduct asbestos project, or related asbestos handling activity, in a manner which is hazardous to the public health.

Your license is valid effective 05/05/2014, and will expire on 05/05/2015, as indicated on your card. We suggest that you attend the required training and submit an application for license renewal early to insure your license does not lapse. NOTE: 326 IAC 18-1-4(h) and 326 IAC 18-1-6(e) require that any individual who has an eighteen (18) month lapse between any two training courses of the same discipline to attend an initial training course for the discipline in which they are seeking a license. In order to avoid re-taking the initial training course you must have attended a refresher in the discipline you are seeking a license within eighteen (18) months from the date of issuance of your last training course certificate.

Office of Air Quality, Asbestos Licensing Section (317) 233-3861



Indiana Dept. of Environmental Management

Benjamin S. Hood

Asbestos Inspector License #: 19A001039

Effective: 05/05/2014	Expiration: 05/05/2015
Birth Date: 04/10/1978	Gender: M
Height: 6-00	Eye Color: Brown
Weight: 285	Hair Color: Brown



Indiana Dept. of Environmental Management

Sandra S. Shadley

Asbestos Project Designer License #: 19A002607

Effective: 12/07/2009
Birth Date: 04/21/1959
Height: 5-08
Weight: 140

Expiration: 12/07/2010
Gender: F
Eye Color: Blue
Hair Color: Brown



Environmental Management Institute

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846
www.envtlmgmt.org

This confirms that

Sandy Shadley

Completed the Required Initial Training for
Asbestos Accreditation Under TSCA Title II
and has
passed with a Score of 70 or Greater the Examination for
Asbestos Management Planner

Course Date
December 10 - 11, 2009

Examination Date
December 11, 2009



Jack E. Leonard, President

Certificate: MP(I) 2248
Expires: December 11, 2010

Approved by:: Illinois Department of Public Health
Indiana Department of Environmental Management

Indiana Department of Environmental Management
100 N. Senate Avenue
Mail Code 61-52 IGCN 1003
Indianapolis, IN 46204-2251



January 21, 2010

RECEIVED JAN 23 2010

Sandra S. Shadley
Alliance Environmental Grp
5340 Commerce Circle Ste E
Indianapolis IN 46237

Re: Asbestos Management Planner # 19A002720

Based upon the review of your license application, the Office of Air Quality has determined that you have fulfilled the requirements of 326 IAC 18 and are eligible for licensing in the following discipline:

Asbestos Management Planner

Your Asbestos Management Planner license is attached below. The license is waterproof and tear resistant. Please sign your license and do not laminate or alter your license in anyway. Your license must be available for review at all times while implementing an asbestos project. This license may be revoked, pursuant to 326 IAC 18-1-7, if you:

- (1) Violate any requirements of these rules (326 IAC 18), 326 IAC 14-10, or any requirement of the Asbestos-Containing Materials in Schools Rule or any other federal, state, or local regulation pertaining to asbestos in buildings or to asbestos projects.
- (2) Falsify information on your application for licensing.
- (3) Fail to meet any qualifications specified in 326-IAC 18-1-4.
- (4) Conduct asbestos project, or related asbestos handling activity, in a manner which is hazardous to the public health.

Your license is valid effective 01/21/2010, and will expire on 01/21/2011, as indicated on your card. We suggest that you attend the required training and submit an application for license renewal early to insure your license does not lapse. NOTE: 326 IAC 18-1-4(h) and 326 IAC 18-1-6(e) require that any individual who has an eighteen (18) month lapse between any two training courses of the same discipline to attend an initial training course for the discipline in which they are seeking a license. In order to avoid re-taking the initial training course you must have attended a refresher in the discipline you are seeking a license within eighteen (18) months from the date of issuance of your last training course certificate.

Office of Air Quality, Asbestos Licensing Section (317) 233-3861



Indiana Dept. of Environmental Management

Sandra S. Shadley

Asbestos Management Planner License #: 19A002720

Effective: 01/21/2010
Birth Date: 04/21/1959
Height: 5-08
Weight: 140

Expiration: 01/21/2011
Gender: F
Eye Color: Blue
Hair Color: Brown

**INDIANA DEPARTMENT OF ENVIRONMENTAL
MANAGEMENT ASBESTOS LICENSE # 191523030**

Inspector ☒
Supervisor ☐

Planner ☒
Worker ☐

Designer ☐
Waste Disp. Mgr ☐

George (Bill) W. Ogle



Effective: 12/11/2003
Expiration: 12/11/2004
BIRTH DATE: 01/17/1949
SEX: M
EYE COLOR: BRO
HAIR COLOR: BRO
HEIGHT: 5-08
WEIGHT: 155

INDIANA DEPARTMENT OF ENVIRONMENTAL
MANAGEMENT ASBESTOS LICENSE # 191523030

INSPECTOR ☒ PLANNER ☒ DESIGNER ☐
SUPERVISOR ☐ WORKER ☐ WASTE DISP. MGR. ☐



George (Bill) W. Ogle
Expiration Date: 09/27/2003

BIRTH DATE: 01/17/1949
SEX: M
EYE COLOR: BRO
HAIR COLOR: BRO
HEIGHT: 5-08
WEIGHT: 155

THIS CERTIFICATE IS ISSUED FOR THE SOLE
USE OF THE UNDERSIGNED AND IS NON-
TRANSFERABLE. ANY USE OR POSSESSION
EXCEPT AS PRESCRIBED IS PROHIBITED BY
LAW. THIS CERTIFICATE MUST BE IN THE
POSSESSION OF THE UNDERSIGNED WHEN
PERFORMING ASBESTOS-RELATED ACTIVITIES
AS PRESCRIBED BY 326 IAC 18.

George W. Ogle
SIGNATURE

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE
1435 Sadlier Circle West Drive
Indianapolis, Indiana 46239
(317) 352-1270 / (317) 352-0669

GEORGE WM. (BILL) OGLE

Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better
For

**ASBESTOS MANAGEMENT PLANNER
REFRESHER**

Management.
Accredited by the
Indiana Department of Environmental

Certificate # ES02/MPR032

Course Dates: 06/21/2002
Test Date: 06/21/2002 Expires: 06/21/2003

Sharyn Reyes

Sharyn Reyes

Instructor / Manager

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE
1435 Sadlier Circle West Drive
Indianapolis, Indiana 46239
(317) 352 -1270 / (317) 352 - 0669

CHRISTIAAN SPARKS
306 - 04 - 2616

Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better


For
ASBESTOS BUILDING INSPECTOR REFRESHER

Accredited by the
Indiana Department of Environmental Management.

Certificate # ES03/BIR755

Course Dates: 09/26/2003
Test Date: 09/26/ 2003 Expires: 09/26/2004




Sharyn Reyes
Instructor / Manager

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE
1435 Sadler Circle West Drive
Indianapolis, Indiana 46239
(317) 352-1270 / (317) 352-06

GEORGE Wm. (BILL) OGLE

Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better
For

**ASBESTOS MANAGEMENT PLANNER
REFRESHER**

Accredited by the
Indiana Department of Environmental Management.

Certificate # ES03/MPR045

Course Dates: 09/05/2003
Test Date: 09/05/2003 Expires: 09/05/2004




Sharyn Reyes
Instructor

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE

**1435 Sadlier Circle West Drive
Indianapolis, Indiana 46236
(317) 352-1270 / (317) 352 - 0669**

PATRICK E. WILSON

309 - 90 - 6909


**Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better
For**

ASBESTOS BUILDING INSPECTOR REFRESHER

**Accredited by the
Indiana Department of Environmental Management.**

Certificate # ES00/BIR482

**Course Dates: 11/29/2000
Test Date: 11/29/2000 Expires: 11/29/2001**



**Sharyn Reyes
Instructor**



Environmental Management Institute

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846

www.spea.iupui.edu/Envtl_mgmt


This confirms that

George Wm. (Bill) Ogle

Completed the Requisite Initial Training for
Asbestos Accreditation Under TSCA Title II
and has
Passed with a Score of 70 or Greater the Examination for
Asbestos Management Planner

Course date
March 2 - 3, 2000

Examination Date
March 3, 2000

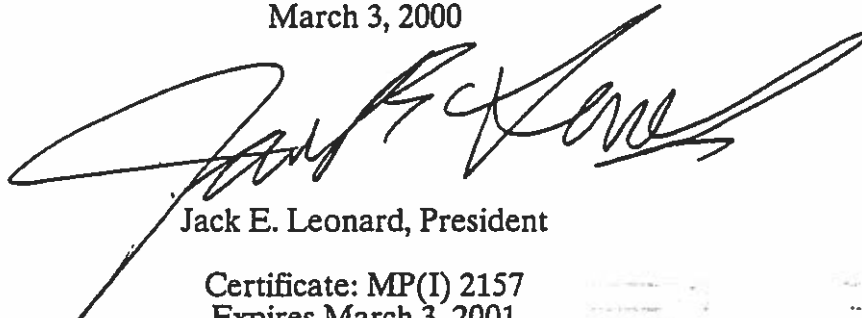

Jack E. Leonard, President

Certificate: MP(I) 2157
Expires March 3, 2001

Approved by: Illinois Department of Public Health
Indiana Department of Environmental Management



ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE
1435 Sadlier Circle West Drive
Indianapolis, Indiana 46239
(317) 352-1270 / (317) 352-0669

CLINT YATES

316 - 92 - 7065


Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better
For

ASBESTOS BUILDING INSPECTOR REFRESHER

Accredited by the
Indiana Department of Environmental Management.

Certificate # ES/BIR98/004.

Course Dates: 01/22/98 - 01/22/98
Test Date: 01/22/98 Expires: 01/22/99



Sharyn Reyes
Assistant / Instructor

Environmental Management Institute

Environmental and Occupational Training Service

5610 Crawfordsville Road, Suite 15

Indianapolis, Indiana 46224-3714

317/248-4848

This confirms that

Rex Gaddis

Completed the Requisite Refresher Training for
Asbestos Accreditation Under TSCA Title II


and has

Passed with a Score of 70 or Greater the Examination for

Asbestos Building Inspector

Course date
November 22, 1994

Examination Date
November 22, 1994

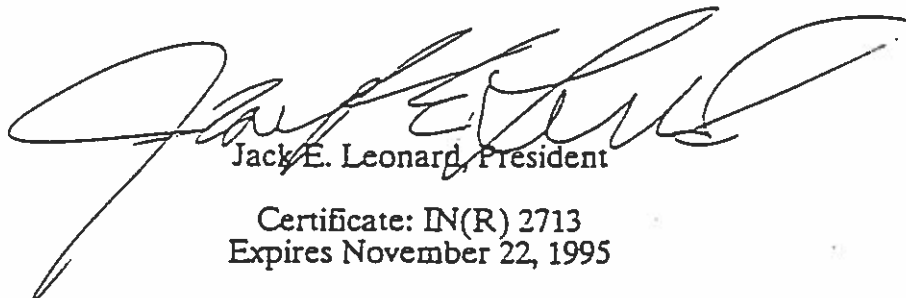

Jack E. Leonard, President

Certificate: IN(R) 2713
Expires November 22, 1995

Approved by: Illinois Department of Public Health
Indiana Department of Environmental Management

INDIANA DEPARTMENT OF
ENVIRONMENTAL MANAGEMENT
ASBESTOS CERTIFICATE OF ACCREDITATION
CERTIFICATE # 102240025 EXPIRATION DATE 2/13/96
Rex Gaddis
IS CERTIFIED IN THE FOLLOWING DISCIPLINE(S)
INSPECTOR ☐ PLANNER ☒ DESIGNER ☐
SUPERVISOR ☐ WORKER ☐
WASTE DISPOSAL MANAGER ☐
BIRTHDATE 3/24/52 SEX M EYES BLU
HEIGHT 5-10 WEIGHT 220 HAIR BRO

INDIANA DEPARTMENT OF
ENVIRONMENTAL MANAGEMENT
ASBESTOS CERTIFICATE OF ACCREDITATION
CERTIFICATE # 190908032 EXPIRATION DATE 3/16/96
Rex Gaddis
IS CERTIFIED IN THE FOLLOWING DISCIPLINE(S)
INSPECTOR ☒ PLANNER ☐ DESIGNER ☐
SUPERVISOR ☐ WORKER ☐
WASTE DISPOSAL MANAGER ☐
BIRTHDATE 3/24/52 SEX M EYES BLU
HEIGHT 5-10 WEIGHT 220 HAIR BRO

TRAINING

**OPERATIONS AND MAINTENANCE
INFORMATION**

MINOR FIBER RELEASE EPISODE

The local education agency shall ensure that the procedures described below are followed in the event of a minor fiber release episode (i.e., the falling or dislodging of not more than 3 square or linear feet of friable ACBM):

1. Thoroughly saturate the debris using wet methods.
2. Clean the area using wet methods, protective clothing, HEPA-vacuums, mini-enclosures, glove bags, as necessary to inhibit the spread of any released fibers. At a minimum, workers should use air-purifying respirators with HEPA filters.
3. Place the asbestos debris in a sealed, leak-tight container, preferably a 6 mil. labeled plastic bag.
4. Repair the area of damaged ACM with materials such as asbestos-free spackling, plaster, cement, or insulation, or seal with latex paint or an encapsulant, or immediately have the appropriate response action implemented.
5. Each fiber release episode should be documented.

MAJOR FIBER RELEASE EPISODE

The local education agency shall ensure that the procedures described below are followed in the event of a major fiber release episode (i.e., the falling or dislodging of more than 3 square or linear feet of friable ACBM):

1. Restrict entry into the area and post signs to prevent entry into the area by persons other than those necessary to perform the response action.
2. Shut off or temporarily modify the air-handling system to prevent the distribution of fibers to other areas in the building.
3. AHERA requires that major fiber release episodes be designed by accredited Project Designers. However, the following response procedures should form the basis for response actions.
4. All the procedures recommended by EPA and required by OSHA for large-scale removal of ACM should be used. These include containment barrier, negative pressure ventilation, personal respiratory protection and protective clothing, decontamination facilities, and air testing.
5. Workers should wear "type C" respirators and protective clothing, including a body suit, hood, boots and gloves. Personal air monitoring may be conducted on representative workers, but is not required by OSHA when "type C" respirators are used.
6. Fallen debris should be sprayed with amended water and placed in plastic bags for disposal. Shovels are useful for collecting the debris. The floor should be thoroughly cleaned with a HEPA vacuum cleaner.
7. Walls, ceiling, pipes, boilers, or other surfaces where ACM was damaged or delaminated should be repaired temporarily. This might involve replastering with asbestos-free material, spraying with an encapsulant, or taping with duct tape. In some cases, ACM beyond the immediate area of damage may need to be removed to prevent additional episodes.
8. The air should be tested for asbestos fibers before the plastic barriers are removed and the area reoccupied. Testing should follow guidelines in Chapter 6 of the Purple Book and Chapter 4 of the Silver Book. That is, air should be sampled at the specified number of locations and analyzed by either phase contrast microscopy or transmission electron microscopy. However, sampling should not be done aggressively since the use of blowers and fans may dislodge fibers from the remaining ACM.

9. After the barriers have been taken down, a decontamination of the entire building or a portion of it should be considered. The need for this will depend on how rapidly the response team reacted to the episode and, in particular, how quickly the HVAC system was turned off. A thorough decontamination includes HEPA-vacuuming and/or wet wiping all carpets, furniture, and other surfaces. Decontamination of the HVAC system would involve disassembling and cleaning (HEPA-vacuuming or wet wiping) ducts, ventilators, registers, and other system parts. System filters should also be removed and replaced.

10. All equipment used in the cleanup operation should be washed or wiped with damp cloths. All disposable materials (e.g., cloths, mop heads, filters, coveralls) should be discarded as asbestos wastes.

11. Each fiber release episode should be documented.

OPERATIONS AND MAINTENANCE REPORT
(Use only for O&M work less than 3 square or 3 linear feet)

L.E.A.: _____

BUILDING: _____

DATE: _____

The following information is provided in accordance with 40 CFR 763.91 and 763.94.

1. Location: _____

Homogeneous Area/Material Description _____

2. Response: Clean _____ Repair _____ Encapsulation _____

Enclosure _____ Removal _____

Reason: _____

3. Work Description: _____

4. Date: Start _____ Stop _____

Time: Start _____ Stop _____

5. Material: Surface _____ SF Thermal _____ LF

Other: _____ SF or _____ LF

6. Asbestos Control Method: Wet Methods _____ HEPA Vacuum _____

Glovebag _____ Mini-Enclosure _____

7. Respiratory Protection: N.A.P.R. _____ P.A.P.R. _____

Were all employees properly fit tested? YES NO NOT APPLICABLE

8. Equipment Used:

Low Vol. Pumps _____
FAM _____
HEPA Vac _____

High Vol. Pumps _____
AFD _____

Other: _____

9. Material Used:

6 Mil. Disposable Bags _____
Glovebags _____
Duct Tape _____
Disposable Coveralls _____
Sponges _____

Poly _____
HEPA Filters _____
Spray Glue _____
3M Pads _____

Encapsulants: Penetrating _____ Bridging _____

Other: _____

10. Work Personnel:

NAME 16 HOUR TRAINED - IDEM ACCREDITED

Supervisor: _____ YES NO YES NO

Worker(s): _____ YES NO YES NO

_____ YES NO YES NO

_____ YES NO YES NO

_____ YES NO YES NO

_____ YES NO YES NO

11. ACBM Disposal: Storage: YES NO, If yes, where stored: _____

If no, where disposed: Landfill: _____

12. Final Visual Inspection Approved: _____
(LEA Designated Person - Printed Name)

(LEA Designated Person - Signature)

***REMOVAL PROJECT
INFORMATION***

SHORT TERM WORKER PROGRAM

GREATER CLARK COUNTY SCHOOLS

SHORT-TERM WORKER SIGN OFF SHEET

This form should be signed each and every time before a "short-term worker" (telephone repair worker, utility worker, etc.) performs work that may cause him to come in contact with ACBM or suspected ACBM assumed to be ACM. One copy of this form should then be forwarded to the LEA designated person, and one copy should be maintained in the school building's copy of the supplemental binder provided by Alliance Indiana, Inc., in order to fulfill the LEA's recordkeeping requirements. The third copy should be forwarded to Alliance Indiana, Inc. for placement in its copy of the supplemental binder.

School Building Name - ADMINISTRATION BUILDING Date _____

I certify that before performing any work which would possibly cause me to come in contact with Asbestos Containing Building Materials (ACBM), I was provided with adequate information regarding the locations of ACBM and suspected ACBM assumed to be ACM in the above-mentioned school building where I performed the work.

Signature - _____

Company - _____

Description of work (including number of days on site) - _____

SHORT-TERM WORKER SIGN IN LOG

BUILDING NAME - Administration Building

SIGNATURE

ALLIANCE INDIANA, INC.

MEMORANDUM

TO: Bruce Wallace

FROM: Chris Sparks

DATE: August 4, 2004

SUBJECT: Sample findings, Greater Clark Former Admin. Building

An inspection was completed on July 27th, 2004 for the former Administration building of Greater Clark County Schools. The inspection was completed per the rules and specifications laid out in National Emission Standard for Asbestos (NESHAP) 40 CFR.

At the time of the inspection the only know ACM material in the building was 12"x12" floor tile located in the records room and in the copier room.

All suspect materials were sampled during the inspection and all were found to be negative with the exception of floor tile mastic located beneath the floor tile in the copier room and records room. This can be referenced via the attached reports from the laboratory

The A.H.E.R.A. Management plan will be changed to reflect this inspection.

Greater Clark County Schools
Remaining Materials Report
December 9, 2003

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
-----	----------	----------	----------	----------	--------------------

Former Administration Building

61	VAT	957 SF	Y	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M
02	Mastic	957 SF	A	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	O & M
A	Cove base	Approx. 1,200 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 400 SF	A	Throughout the building	O & M
C	Transite walls	Approx. 8,900 SF	A	Throughout the building	O & M
D	Sprayed insulation under sink w TEACHERS lounge	3 SR		Gray	Room Key - 0101-0101-0101
E	12x12 CT w/ Room Joist North of records Room	13x4 SF 15x12 SF 16x22 SF		white w/ HARDON fissure	SI - SINK INSULATION TL - TEACHERS lounge CT - CEILING TILE 2'x2' CT - CEILING TILE 12'x12"
F	CEILING + WALL PLASTER	UNDQUANTIFIED		Throughout the Bldg	WP - WALL PANELS P - PLASTER

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# 01
Type of Material Miscellaneous Material
Quantity of Material 957 SF

Material Location

Copier room (labeled as the mail room) and records room (across from student services inside the north door)

Material Description

VAT

Comments

This material was not in poor condition.

Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 06/01/1992
Current Surveillance Date 12/09/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M


Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

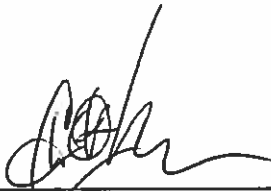LEA Name	Greater Clark County Schools	
Building Name	Former Administration Building	
HA#	02	
Type of Material	Miscellaneous Material	
Quantity of Material	957 SF	
Material Location	Copier room (labeled as the mail room) and records room (across from student services inside the north door)	
Material Description	Mastic	
Comments	This material was not visible to inspect.	
Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	06/01/1992	
Current Surveillance Date	12/09/2003	
Current Assessment Rating	NR	Not Required
Cause of Damage	No Damage	
Accessible	No	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	
Inspector	 _____ Christiaan Sparks	
State	Indiana	
Accreditation Number	190804103	

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,200 LF

Material Location
Throughout the building

Material Description
Cove base

Comments
Several pieces have come loose and/or are missing throughout the building. The remaining material was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/09/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 400 SF

Material Location
Throughout the building

Material Description
Cove base mastic

Comments
Where visible, this material was not in poor condition.

Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	05/31/1995	
Current Surveillance Date	12/09/2003	
Current Assessment Rating	NR	Not Required
Cause of Damage	No Damage	
Accessible	No	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Former Administration Building
HA# C
Type of Material Miscellaneous Material
Quantity of Material Approx. 8,900 SF

Material Location
Throughout the building

Material Description
Transite walls

Comments
The covering on some walls has separated leaving exposed material. It was not in poor condition.


Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	05/31/1995
Current Surveillance Date	12/09/2003
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

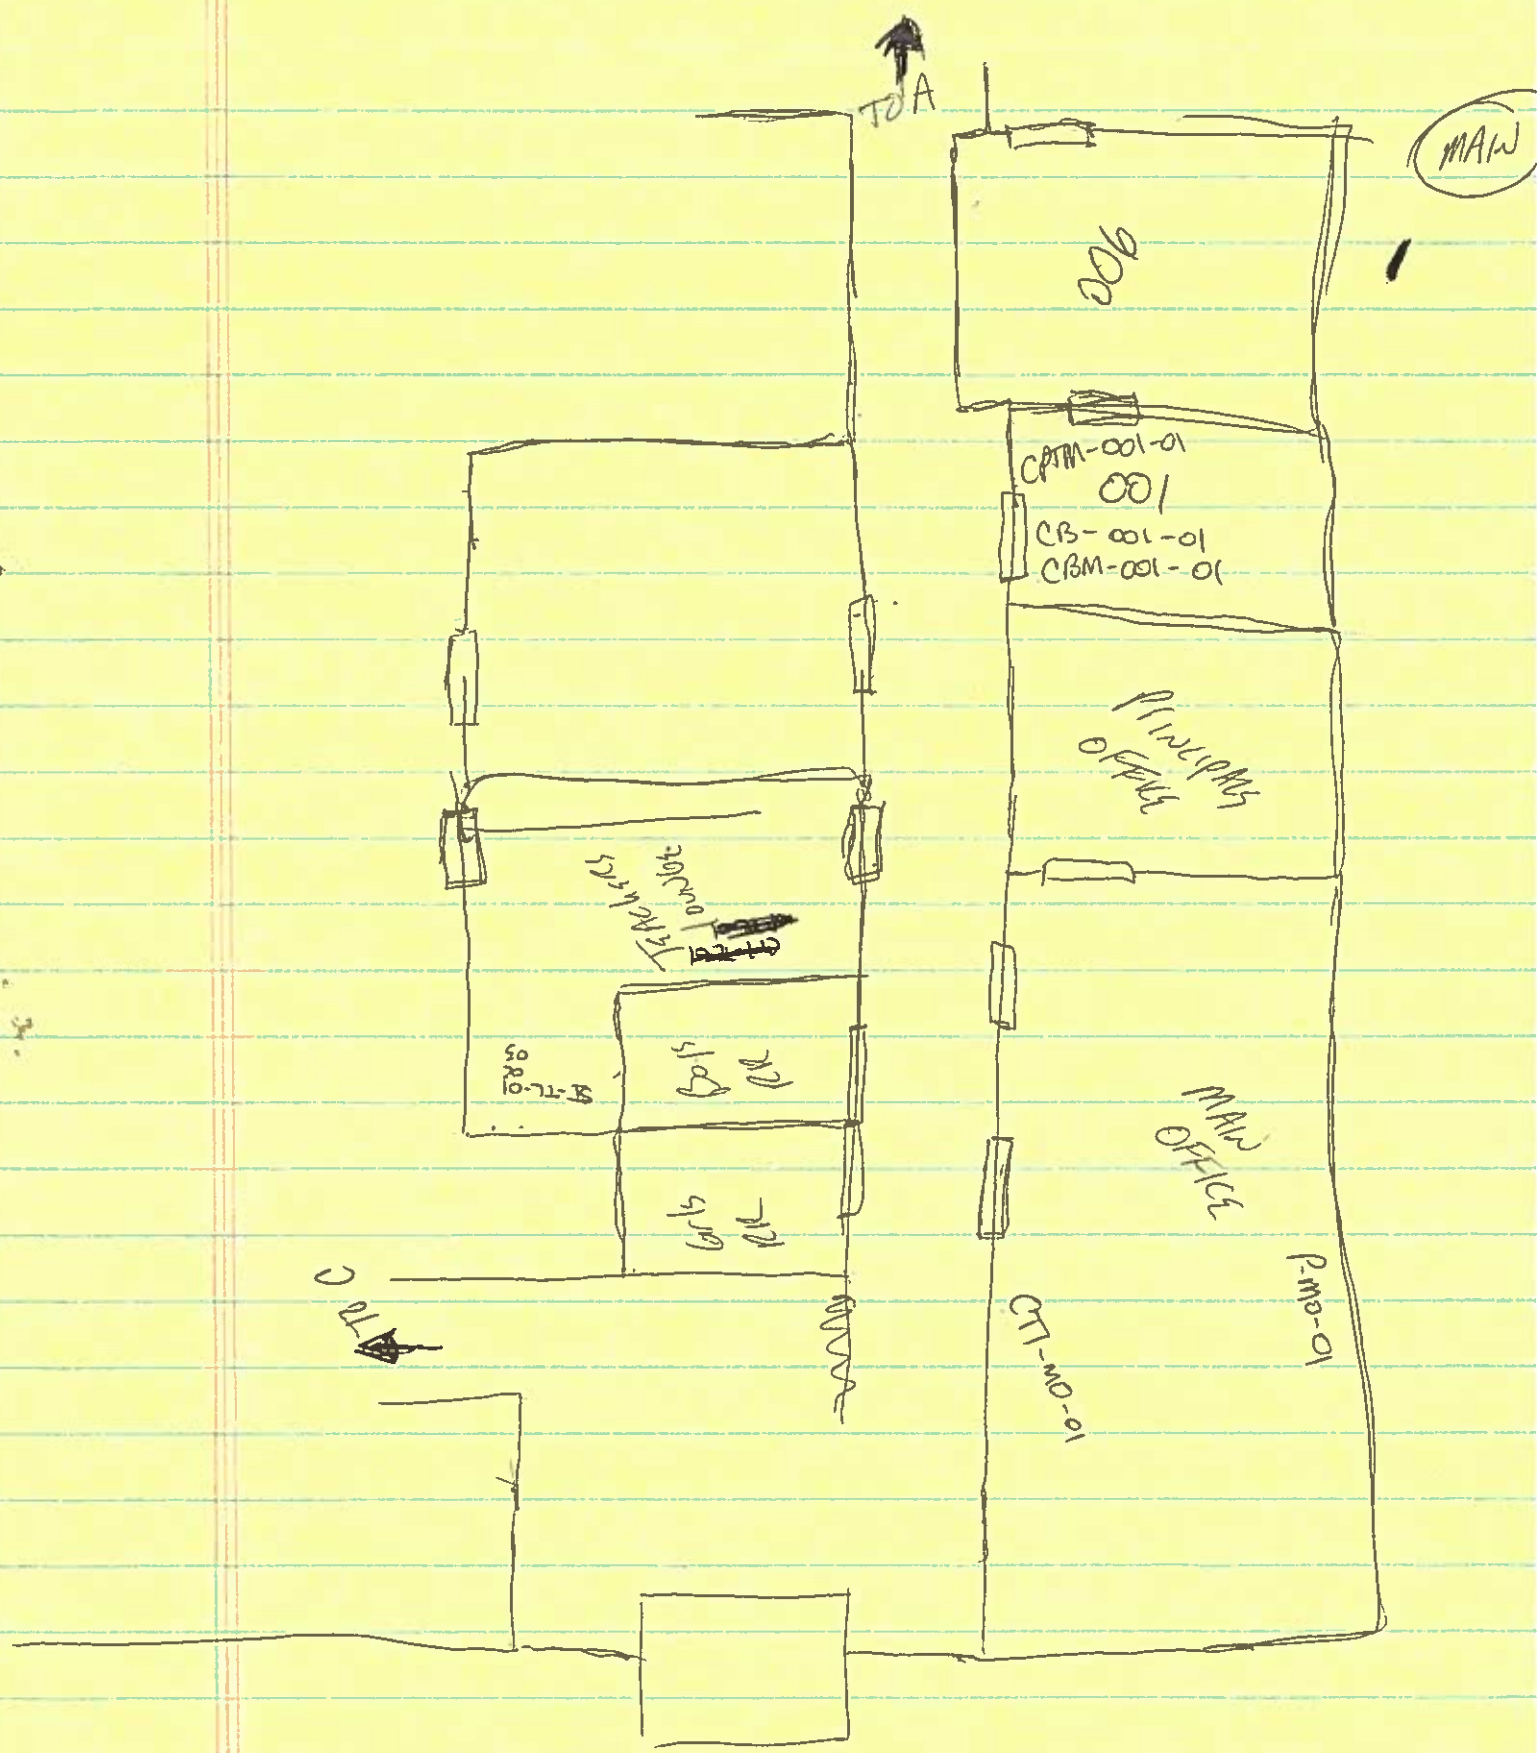

To (B)
A

Locker Room

Room
North of
Records Room
Culprum-
01-005

Records Room


Com-Rm-01
C.B.-R-01
Finn-R-01

EXIT


007

10-202-01

to main

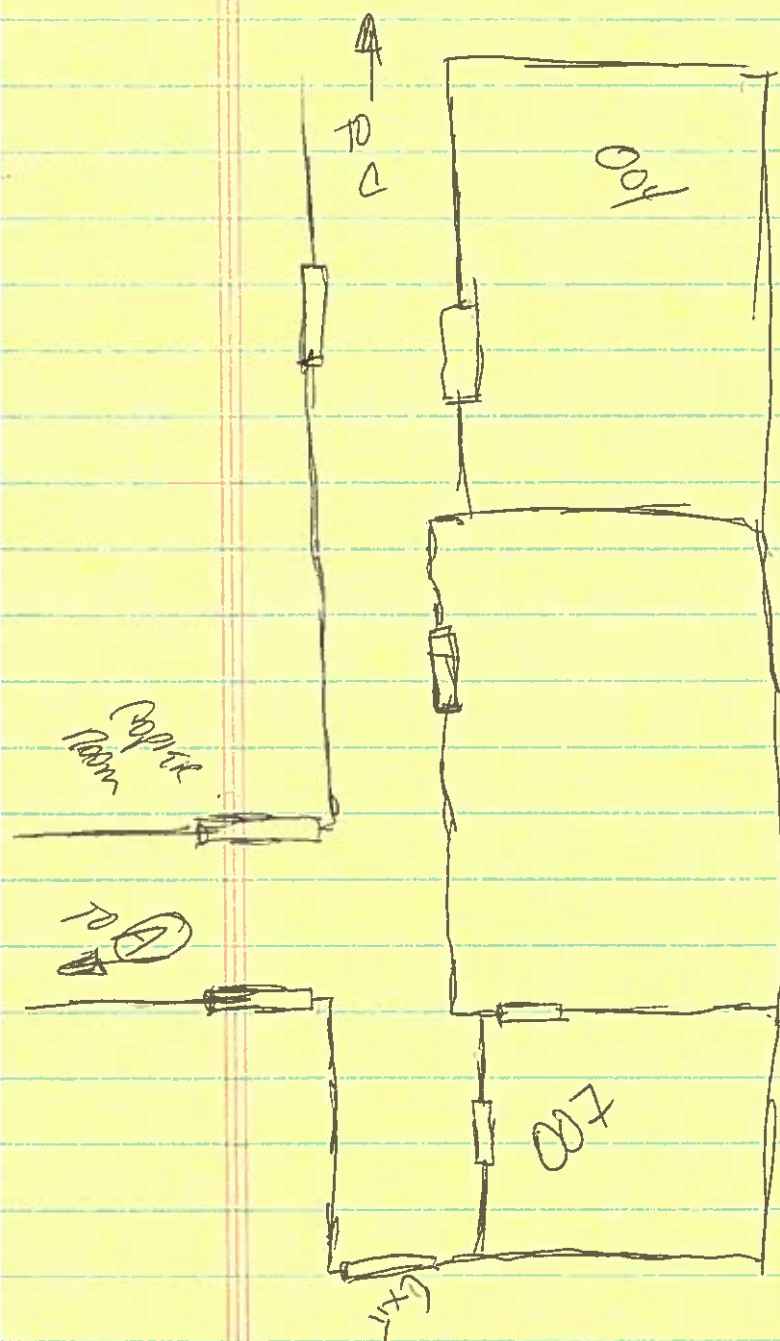

13

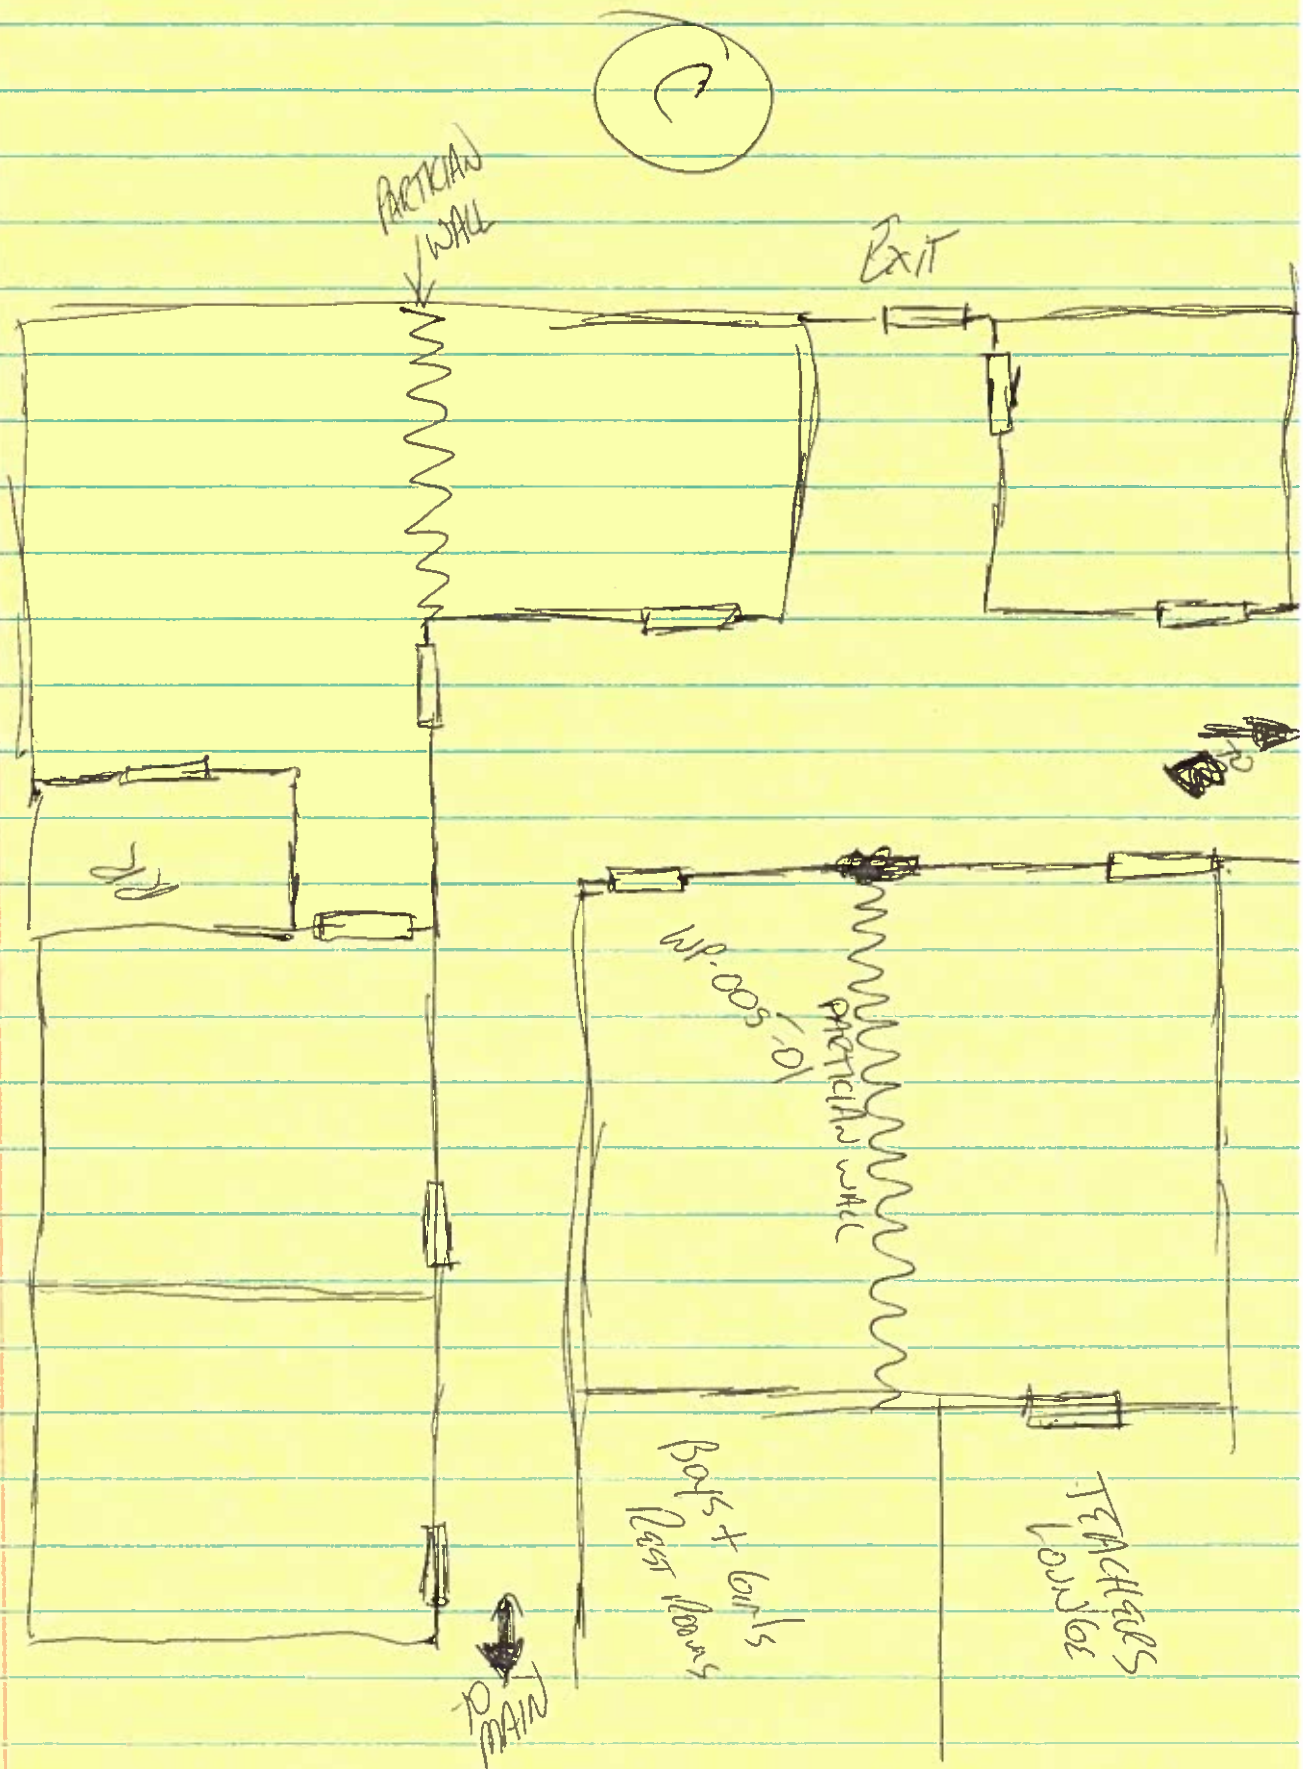

9.7^{hrs} ~~for day~~ HANOVER HIGH (CLEAN) up 7-21-04

7:45 - ARRIVE ON SITE w/ BILL - TALK TO SKILLMAN Guy ABOUT Priority of AREAS.

8:00 3 SAFE ENVIRONMENTAL WORKERS ON SITE. We show them ALL AREAS TO BE CLEANED

8:30 BILL OFF SITE, WORKERS loading tools into Building. They go to work on small cleanup AREA By Room #

9:00 2 workers out + ~~cleaning~~ popping tile By the SODA MACHINES - 3rd worker OFF SITE TO GET SOME 1/2 MINUTE SPTIES - CUSTODIANS MAKING CONTACTS TO MOVE VENDING MACH

10:00 ~~WORKER BACK ON SITE~~ WORKER BACK ON SITE

11:00 VENDING MACHINES BEING MOVED BY ~~HANOVER~~ CEDAR LAKE CONCESSION

12:00 ~~OFF TO LUNCH~~ DAVE w/ CONCESSION AGENT - OFF SITE TO LUNCH - will continue w/ hallway cleanup upon returning

1:00 Spoke w/ Tony P over lunch + he SAID TO HAVE his WORKERS CONTACT ANOTHER Guy so we can remove the CRESTLINE WHIPS + lights

2:00 Spoke w/ JAW who is COORDINATOR ~~of SKILLMAN~~ to see if we can do MORTIC + debris removal in the gym entry AREA tomorrow + hold off on the lighting removal till a later DATE.

2:30 Spoke w/ CUSTODIAN ABOUT ALARM/LEAVING Policies

JAW
219-374-3500

3:45 - ALL OFF SITE

708-417-0272
Tony

3:30

WORKERS CLEANING UP FOR THE DAY

219-322-0844

EX
20

HOWEVER HIGH CLEANUP

7-22-09

6:00 ARRIVE ON SITE - SAFE ENV. ON SITE / sp. 3 WORKERS + Tony P.

6:15 Tony OFF SITE AFTER BEING FILLED IN ON YESTERDAY'S EVENTS + TODAY'S PLANS - 2 WORKERS CLEANING CAFE TERRACE TO MAKE A PATHWAY TO THE FREEZER + 2 WORKERS CLEAN UP DEBRIS IN GYM ENTRY. ALSO HELPING CUSTODIANS TO MOVE 4 LARGE DISPLAY CASES TO REMOVE THE LAST OF THE FT IN THIS AREA

11:00 - OFF SITE FOR 1/2 HOUR LUNCH.

11:30 BACK FROM LUNCH - ALL 4 WORKERS BACK TO GYM AREA TO FINITE CLEAN REMAINING MASTIC

12:30 1 SMALL HALLWAY W/AS FOUND THAT STILL HAD DEBRIS. 2 WORKERS GO TO SWEEP + MOP IT WHILE THE OTHER 2 BEGIN LOADING OUT MATERIALS

1:15 ALL OFF SITE

1
9.50
9.75 -
16
25.75 -
6.50
31.75
35.50
31.75 -
8.25