



ALLIANCE
Environmental Group, Inc.

THE ENVIRONMENTAL SOLUTION

GREATER CLARK COUNTY SCHOOLS

CHARLESTOWN MIDDLE SCHOOL

AHERA

ASBESTOS MANAGEMENT PLAN

**DESIGNATED PERSON
TRUTH AND CORRECT STATEMENT**

Local Education Agency – Greater Clark County Schools
2112 Utica-Sellersburg Road
Jeffersonville, Indiana 47130

Designated Person - Alliance Environmental Group, Inc.
Sandra Shadley
5153 Commerce Square Drive, Suite E
Indianapolis, Indiana 46237

This Truth and Correct Statement, as outlined in 40 CFR 763.93(i), certifies that the general, local education agency responsibilities, as stipulated by 40 CFR 763.84, have been or will be met. These responsibilities include:

1. Ensure that the activities of any persons who perform inspections, reinspections, and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with 40 CFR 763 Subpart E.
2. Ensure all custodial and maintenance employees are properly trained as required by 40 CFR 763 Subpart E and other applicable Federal and/or State regulations (e.g., the Occupational Safety and Health Administration Asbestos Standard for Construction, the EPA Worker Protection Rule, or applicable State regulations).
3. Ensure that workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress.
4. Ensure that short-term workers (e.g., telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.
5. Ensure that warning labels are posted in accordance with Section 763.95.
6. Ensure management plans are available for inspection and notification of such availability has been provided as specified in the management plan under Section 763.93(g).
7. The undersigned person designated by the LEA pursuant to Section 763.84(g) (1) has received adequate training as stipulated in Section 763.84(g) (2).
8. The LEA has and will consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under Part 763.

Signature:  Date: November 6, 2016

Sandra S. Shadley

ASBESTOS PROGRAM MASTER INDEX

The following volumes are part of the Asbestos Program for the **GREATER CLARK COUNTY SCHOOLS**:

- A. Original Asbestos Management Plan for each school building.
- B. Asbestos Management Plan Supplement for each school building.
 - 1. Amendments to Management Plan
 - 2. Remaining Materials Report
 - 3. Surveillance, Reinspection and Additional Bulk Sampling Information
 - 4. Annual Notifications, Accreditations and Training Records
 - 5. Operations and Maintenance Records
 - 6. Asbestos Removal Projects
 - 7. Short Term Worker Program

Copies of both volumes are found in the respective buildings. The Administration Building also contains duplicate copies of both volumes for each building in their entirety.

GREATER CLARK COUNTY SCHOOLS

CHARLESTOWN MIDDLE SCHOOL

TABLE OF CONTENTS

AMENDMENTS TO MANAGEMENT PLAN	1
REMAINING MATERIALS REPORT	2
SURVEILLANCE, REINSPECTION AND ADDITIONAL BULK SAMPLING INFORMATION	3
ANNUAL NOTIFICATIONS, ACCREDITATIONS, AND TRAINING	4
OPERATIONS AND MAINTENANCE RECORDS	5
ASBESTOS REMOVAL PROJECTS	6
SHORT TERM WORKER INFORMATION	7

AMENDMENTS TO THE MANAGEMENT PLAN

GREATER CLARK COUNTY SCHOOLS
CHARLESTOWN MIDDLE SCHOOL

LEA RESPONSIBILITY CERTIFICATION

LEA Designated Person - ALLIANCE INDIANA, INC.


Signature - Bruce Wallace, President/CEO

May 1, 1995
Date

ACCREDITATION STATEMENT

The Greater Clark County Schools ensures that the following items will be carried out:

Activities of any persons who perform inspections, reinspections, and periodic surveillance, develop and update management plans, and develop and implement response actions, including operations and maintenance, are carried out in accordance with Subpart E of this part.

All custodial and maintenance employees are properly trained as required by this Subpart E and other applicable Federal and/or State regulations (e.g., the OSHA asbestos standard for construction, the EPA worker protection rule, or applicable State regulations).

Workers and building occupants, or their legal guardians, are informed at least once each school year about inspections, response actions, and post response action activities, including periodic reinspection and surveillance activities that are planned or in progress.

Short-term workers (e.g., telephone repair workers, utility workers, or exterminators) who may come in contact with asbestos in a school are provided information regarding the locations of ACBM and suspected ACBM assumed to be ACM.

Warning labels are posted in accordance with 763.95.

Management plans are available for inspection and notification of such availability has been provided as specified in the management plan under 763.93(g).

Designate a person to ensure that requirements under this section are properly implemented.

Designated person receives adequate training to perform duties assigned under this section. Such training shall provide, as necessary, basic knowledge of:

Health effects of asbestos

Detection, identification, and assessment of ACM

Options for controlling ACBM

Asbestos management programs

Relevant Federal and State regulations concerning asbestos, including those in this Subpart E and those of the OSHA, U.S. Department of Labor, the U.S. Department of Transportation and the U.S. Environmental Protection Agency.

Consider whether any conflict of interest may arise from the interrelationship among accredited personnel and whether that should influence the selection of accredited personnel to perform activities under this subpart.

AMENDMENT TO THE MANAGEMENT PLAN

LEA Name - Greater Clark County Schools

Building - Charlestown Middle School

Subject - LEA Designated Person Change

Effective May 1, 1995 the Designated Person for the
Greater Clark County Schools is:

Alliance Indiana, Inc.
1433 Sadlier Circle West Drive
Indianapolis, Indiana 46239
(317) 351-5600

Management Planner: Rex Gaddis

Accreditation No. 192218025



Signature

May 1, 1995
Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - Charlestown Middle School

Subject- New material

Reference - HA A Cove Base

Original Assessment - No assessment in original inspection.

Amended Assessment - The cove base in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner


Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025



Signature



Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - Charlestown Middle School

Subject- New material

Reference - HA B Cove Base Mastic

Original Assessment - No assessment in original inspection.

Amended Assessment - The cove base mastic in the building was not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.


Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025


Signature


Date

**AMENDMENT TO THE
AHERA MANAGEMENT PLAN**

Building - Charlestown Middle School

Subject- New material

Reference - HA C Boiler gaskets

Original Assessment - No assessment in original inspection.

Amended Assessment - The gaskets in the boiler room were not addressed in the original inspection. The material is considered to be suspect by EPA. The material will be assumed to contain asbestos and treated as such until a future renovation when it will be sampled.

Management Planner

Rex Gaddis

Indiana Department of Environmental Management Accreditation

192218025



Signature



Date

AMENDMENT TO MANAGEMENT PLAN

LEA Name - Greater Clark County Schools
Subject - LEA Designated Person Change
Amendment - Effective March 2005, the Designated Person for the Greater Clark County Schools is:

Alliance Environmental Group, Inc.
5340 Commerce Circle, Suite E
Indianapolis, Indiana 46237
(317) 865-3400

Personnel contributing to this Management Plan are licensed in according with 40 CFR 763.93(e)(12).

Management Planner: Sandra S. Shadley

Accreditation Number: 19A002720


Signature


Date

AMENDMENT TO MANAGEMENT PLAN


Building Name - Charlestown Middle School


Subject - Addition of Homogeneous Area D

Amendment - Fire doors were found in the mechanical wing and kitchen area that were not included in the original inspection. These doors are suspect to contain asbestos; therefore, they are being added to the management plan until properly sampled.

Management Planner: Sandra Shadley

Accreditation Number: 19A002720

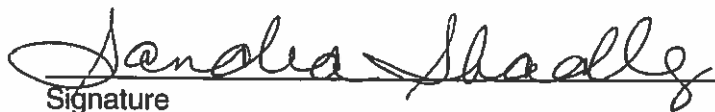
Signature

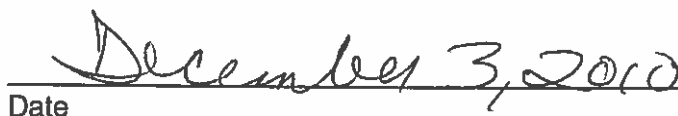
Date

REMAINING MATERIALS

Greater Clark County School Corporation

Remaining Materials Report

4/23/2020

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>Charlestown Middle School</u>						
03	Floor Tile Mastic	2229	SF	Assumed	Throughout building	O&M
A	Cove base molding (color other than black)	4100	LF	Assumed	Throughout the building, some classrooms, library and mechanical area and upper gym.	O&M
B	Cove Base Mastic	1370	SF	Assumed	Throughout building	O&M
D	Fire Doors-Metal clad	Unquantified	Unit(s)	Assumed	Mechanical wing, kitchen area, gym wing and throughout the building.	O&M
E	Stage light wiring	11	Unit(s)	Assumed	Stage	O&M
F	Orange vinyl stair treads	Unquantified	SF	Assumed	Stage near gym	O&M
G	Stair tread mastic	Unquantified	LF	Assumed	Stage near gym	O&M
H	AHU expansion joints	Unquantified	Unit(s)	Assumed	On older ductwork painted green above gym & upper gym	O&M
I	Black sink insulation	Unquantified	Unit(s)	Assumed	Science lab	O&M
J	Sink Tops	Unquantified	Unit(s)	Assumed	Science lab	O&M
K	Fume hood bases	Unquantified	Unit(s)	Assumed	Science lab	O&M

Greater Clark County School Corporation

Remaining Materials Report

4/23/2020

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
L	Kiln insulation	Unquantified	LF	Assumed	Kiln insulation in D206 (33 year old Kiln)	O&M
M	Duct wrap/tape	Unquantified	SF	Assumed	Painted green in upper gym mechanical areas	O&M

Greater Clark County School Corporation

Remaining Materials Report

1/14/2020

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>Charlestown Middle School</u>						
03	Floor Tile Mastic	2229	SF	Assumed	Throughout building	O&M
A	Cove base molding (color other than black)	4100	LF	Assumed	Throughout the building, some classrooms, library and mechanical area and upper gym.	O&M
B	Cove Base Mastic	1370	SF	Assumed	Throughout building	O&M
D	Fire Doors-Metal clad	Unquantified	Unit(s)	Assumed	Mechanical wing, kitchen area, gym wing and throughout the building.	O&M
E	Stage light wiring	11	Unit(s)	Assumed	Stage	O&M
F	Orange vinyl stair treads	Unquantified	SF	Assumed	Stage near gym	O&M
G	Stair tread mastic	Unquantified	LF	Assumed	Stage near gym	O&M
H	AHU expansion joints	Unquantified	Unit(s)	Assumed	On older ductwork painted green above gym & upper gym	O&M
I	Black sink insulation	0	Unit(s)	Assumed	Science lab	Removed
J	Sink Tops	0	Unit(s)	Assumed	Science lab	Removed
K	Fume hood bases	0	Unit(s)	Assumed	Science lab	Removed

Greater Clark County School Corporation

Remaining Materials Report

1/14/2020

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
L	Kiln insulation	0	LF	Assumed	Kiln insulation in D206 (33 year old Kiln)	Removed
M	Duct wrap/tape	Unquantified	SF	Assumed	Painted green in upper gym mechanical areas	O&M

Greater Clark County School Corporation

Remaining Materials Report

5/16/2019

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>Charlestown Middle School</u>						
03	Floor Tile Mastic	2229	SF	Assumed	Throughout building	O&M
A	Cove base molding (color other than black)	4100	LF	Assumed	Throughout the building, some classrooms, library and mechanical area and upper gym.	O&M
B	Cove Base Mastic	1370	SF	Assumed	Throughout building	O&M
D	Fire Doors-Metal clad	Unquantified	Unit(s)	Assumed	Mechanical wing, kitchen area, gym wing and throughout the building.	O&M
E	Stage light wiring	11	Unit(s)	Assumed	Stage	O&M
F	Orange vinyl stair treads	Unquantified	SF	Assumed	Stage near gym	O&M
G	Stair tread mastic	Unquantified	LF	Assumed	Stage near gym	O&M
H	AHU expansion joints	Unquantified	Unit(s)	Assumed	On older ductwork painted green above gym & upper gym	O&M
I	Black sink insulation	Unquantified	Unit(s)	Assumed	Science lab	O&M
J	Sink Tops	Unquantified	Unit(s)	Assumed	Science lab	O&M
K	Fume hood bases	Unquantified	Unit(s)	Assumed	Science lab	O&M

Greater Clark County School Corporation

Remaining Materials Report

5/16/2019

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
L	Kiln insulation	Unquantified	LF	Assumed	Kiln insulation in D206 (33 year old Kiln)	O&M
M	Duct wrap/tape	Unquantified	SF	Assumed	Painted green in upper gym mechanical areas	O&M

Greater Clark County School Corporation

Remaining Materials Report

11/13/2018

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>Charlestown Middle School</u>						
03	Floor Tile Mastic	0	SF	Assumed	Throughout building	Removed
A	Cove base molding (color other than black)	4100	LF	Assumed	Throughout the building, some classrooms, library and mechanical area and upper gym.	O&M
B	Cove Base Mastic	1370	SF	Assumed	Throughout building	O&M
D	Fire Doors-Metal clad	Unquantified	Unit(s)	Assumed	Mechanical wing, kitchen area, gym wing and throughout the building.	O&M
E	Stage light wiring	11	Unit(s)	Assumed	Stage	O&M
F	Orange vinyl stair treads	Unquantified	SF	Assumed	Stage near gym	O&M
G	Stair tread mastic	Unquantified	LF	Assumed	Stage near gym	O&M
H	AHU expansion joints	Unquantified	Unit(s)	Assumed	On older ductwork painted green above gym & upper gym	O&M
I	Black sink insulation	Unquantified	Unit(s)	Assumed	Science lab	O&M
J	Sink Tops	0	Unit(s)	Assumed	Science lab	Removed
K	Fume hood bases	Unquantified	Unit(s)	Assumed	Science lab	O&M

Greater Clark County School Corporation

Remaining Materials Report

11/13/2018

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
L	Kiln insulation	Unquantified	LF	Assumed	Kiln insulation in D206 (33 year old Kiln)	O&M
M	Duct wrap/tape	Unquantified	SF	Assumed	Painted green in upper gym mechanical areas	O&M

Greater Clark County School Corporation

Remaining Materials Report

5/2/2018

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>Charlestown Middle School</u>						
03	Floor Tile Mastic	2229	SF	Assumed	Throughout building	O&M
A	Cove base molding (color other than black)	4100	LF	Assumed	Throughout the building, some classrooms, library and mechanical area and upper gym.	O&M
B	Cove Base Mastic	1370	SF	Assumed	Throughout building	O&M
D	Fire Doors-Metal clad	Unquantified	Unit(s)	Assumed	Mechanical wing, kitchen area, gym wing and throughout the building.	O&M
E	Stage light wiring	11	Unit(s)	Assumed	Stage	O&M
F	Orange vinyl stair treads	Unquantified	SF	Assumed	Stage near gym	O&M
G	Stair tread mastic	Unquantified	LF	Assumed	Stage near gym	O&M
H	AHU expansion joints	Unquantified	Unit(s)	Assumed	On older ductwork painted green above gym & upper gym	O&M
I	Black sink insulation	Unquantified	Unit(s)	Assumed	Science lab	O&M
J	Sink Tops	Unquantified	Unit(s)	Assumed	Science lab	O&M
K	Fume hood bases	Unquantified	Unit(s)	Assumed	Science lab	O&M

Greater Clark County School Corporation

Remaining Materials Report

5/2/2018

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
L	Kiln insulation	Unquantified	LF	Assumed	Kiln insulation in D206 (33 year old Kiln)	O&M
M	Duct wrap/tape	Unquantified	SF	Assumed	Painted green in upper gym mechanical areas	O&M

Greater Clark County School Corporation

Remaining Materials Report

10/18/2017

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>Charlestown Middle School</u>						
03	Floor Tile Mastic	2229	SF	Assumed	Throughout building	O&M
A	Cove base molding (color other than black)	4100	LF	Assumed	Throughout the building, some classrooms, library and mechanical area and upper gym.	O&M
B	Cove Base Mastic	1370	SF	Assumed	Throughout building	O&M
D	Fire Doors-Metal clad	Unquantified	Unit(s)	Assumed	Mechanical wing, kitchen area, gym wing and throughout the building.	O&M
E	Stage light wiring	11	Unit(s)	Assumed	Stage	O&M
F	Orange vinyl stair treads	Unquantified	SF	Assumed	Stage near gym	O&M
G	Stair tread mastic	Unquantified	LF	Assumed	Stage near gym	O&M
H	AHU expansion joints	Unquantified	Unit(s)	Assumed	On older ductwork painted green above gym & upper gym	O&M
I	Black sink insulation	Unquantified	Unit(s)	Assumed	Science lab	O&M
J	Sink Tops	Unquantified	Unit(s)	Assumed	Science lab	O&M
K	Fume hood bases	Unquantified	Unit(s)	Assumed	Science lab	O&M

Greater Clark County School Corporation

Remaining Materials Report

10/18/2017

HA ID	HA Description	Quantity		Asbestos	HA Location	Plannned Response Action
L	Kiln insulation	Unquantified	LF	Assumed	Kiln insulation in D206 (33 year old Kiln)	O&M
M	Duct wrap/tape	Unquantified	SF	Assumed	Painted green in upper gym mechanical areas	O&M

Greater Clark County School Corporation

Remaining Materials Report

4/13/2017

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>Charlestown Middle School</u>						
03	Floor Tile Mastic	2229	SF	Assumed	Throughout building	O&M
A	Cove base molding (color other than black)	4100	LF	Assumed	Throughout the building, some classrooms, library and mechanical area and upper gym.	O&M
B	Cove Base Mastic	1370	SF	Assumed	Throughout building	O&M
D	Fire Doors-Metal clad	Unquantified	Unit(s)	Assumed	Mechanical wing, kitchen area, gym wing and throughout the building.	O&M
E	Stage light wiring	11	Unit(s)	Assumed	Stage	O&M
F	Orange vinyl stair treads	Unquantified	SF	Assumed	Stage near gym	O&M
G	Stair tread mastic	Unquantified	LF	Assumed	Stage near gym	O&M
H	AHU expansion joints	Unquantified	Unit(s)	Assumed	On older ductwork painted green above gym & upper gym	O&M
I	Black sink insulation	Unquantified	Unit(s)	Assumed	Science lab	O&M
J	Sink Tops	Unquantified	Unit(s)	Assumed	Science lab	O&M
K	Fume hood bases	Unquantified	Unit(s)	Assumed	Science lab	O&M

Greater Clark County School Corporation

Remaining Materials Report

4/13/2017

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
L	Kiln insulation	Unquantified	LF	Assumed	Kiln insulation in D206 (33 year old Kiln)	O&M
M	Duct wrap/tape	Unquantified	SF	Assumed	Painted green in upper gym mechanical areas	O&M

Greater Clark County School Corporation

Remaining Materials Report

11/3/2016

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>Charlestown Middle School</u>						
03	Floor Tile Mastic	2229	SF	Assumed	Throughout building	O&M
A	Cove base molding (color other than black)	4100	LF	Assumed	Throughout the building, some classrooms, library and mechanical area and upper gym.	O&M
B	Cove Base Mastic	1370	SF	Assumed	Throughout building	O&M
D	Fire Doors-Metal clad	Unquantified	Unit(s)	Assumed	Mechanical wing, kitchen area, gym wing and throughout the building.	O&M
E	Stage light wiring	11	Unit(s)	Assumed	Stage	O&M
F	Orange vinyl stair treads	Unquantified	SF	Assumed	Stage near gym	O&M
G	Stair tread mastic	Unquantified	LF	Assumed	Stage near gym	O&M
H	AHU expansion joints	Unquantified	Unit(s)	Assumed	On older ductwork painted green above gym & upper gym	O&M
I	Black sink insulation	Unquantified	Unit(s)	Assumed	Science lab	O&M
J	Sink Tops	Unquantified	Unit(s)	Assumed	Science lab	O&M
K	Fume hood bases	Unquantified	Unit(s)	Assumed	Science lab	O&M

Greater Clark County School Corporation

Remaining Materials Report

11/3/2016

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
L	Kiln insulation	Unquantified	LF	Assumed	Kiln insulation in D206 (33 year old Kiln)	O&M
M	Duct wrap/tape	Unquantified	SF	Assumed	Painted green in upper gym mechanical areas	O&M

Greater Clark County School Corporation

Remaining Materials Report

4/28/2016

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>Charlestown Middle School</u>						
03	Floor Tile Mastic	2229	SF	Assumed	Throughout building	O&M
A	Cove base molding (color other than black)	4100	LF	Assumed	Throughout the building, some classrooms, library and mechanical area and upper gym.	O&M
B	Cove Base Mastic	1370	SF	Assumed	Throughout building	O&M
D	Fire Doors-Metal clad	Unquantified	Unit(s)	Assumed	Mechanical wing, kitchen area, gym wing and throughout the building.	O&M
E	Stage light wiring	11	Unit(s)	Assumed	Stage	O&M
F	Orange vinyl stair treads	Unquantified	SF	Assumed	Stage near gym	O&M
G	Stair tread mastic	Unquantified	LF	Assumed	Stage near gym	O&M
H	AHU expansion joints	Unquantified	Unit(s)	Assumed	On older ductwork painted green above gym & upper gym	O&M
I	Black sink insulation	Unquantified	Unit(s)	Assumed	Science lab	O&M
J	Sink Tops	Unquantified	Unit(s)	Assumed	Science lab	O&M
K	Fume hood bases	Unquantified	Unit(s)	Assumed	Science lab	O&M

Greater Clark County School Corporation

Remaining Materials Report

4/28/2016

HA ID	HA Description	Quantity		Asbestos	HA Location	Plannned Response Action
L	Kiln insulation	Unquantified	LF	Assumed	Kiln insulation in D206 (33 year old Kiln)	O&M
M	Duct wrap/tape	Unquantified	SF	Assumed	Painted green in upper gym mechanical areas	O&M

Greater Clark County School Corporation

Remaining Materials Report

10/20/2015

HA ID	HA Description	Quantity		Asbestos	HA Location	Planned Response Action
<u>Charlestown Middle School</u>						
03	Floor Tile Mastic	2229	SF	Assumed	Throughout building	O&M
A	Cove base molding (color other than black)	4100	LF	Assumed	Throughout the building, some classrooms, library and mechanical area and upper gym.	O&M
B	Cove Base Mastic	1370	SF	Assumed	Throughout building	O&M
D	Fire Doors-Metal clad	Unquantified	Unit(s)	Assumed	Mechanical wing, kitchen area, gym wing and throughout the building.	O&M
E	Stage light wiring	11	Unit(s)	Assumed	Stage	O&M
F	Orange vinyl stair treads	Unquantified	SF	Assumed	Stage near gym	O&M
G	Stair tread mastic	Unquantified	LF	Assumed	Stage near gym	O&M
H	AHU expansion joints	Unquantified	Unit(s)	Assumed	On older ductwork painted green above gym & upper gym	O&M
I	Black sink insulation	Unquantified	Unit(s)	Assumed	Science lab	O&M
J	Sink Tops	Unquantified	Unit(s)	Assumed	Science lab	O&M
K	Fume hood bases	Unquantified	Unit(s)	Assumed	Science lab	O&M

Greater Clark County School Corporation

Remaining Materials Report

10/20/2015

HA ID	HA Description	Quantity		Asbestos	HA Location	Plannned Response Action
L	Kiln insulation	Unquantified	LF	Assumed	Kiln insulation in D206 (33 year old Kiln)	O&M
M	Duct wrap/tape	Unquantified	SF	Assumed	Painted green in upper gym mechanical areas	O&M

Greater Clark County Schools
Remaining Materials Report
April 22, 2015

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other than black)	Approx. 4,100 LF	A	Throughout the building, some classrooms, library and mechanical area and upper gym.	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M
D	Fire Doors-Metal clad	Unquantified Eac	A	Mechanical wing, kitchen area, gym wing and throughout the building.	O & M
E	Stage light wiring	11 EA	A	Stage	O & M
F	Orange vinyl stair treads	Unquantified SF	A	Stairs near gym	O & M
G	Stair tread mastic	Unquantified LF	A	Stairs near gym	O & M
H	AHU expansion joints	Unquantified Eac	A	On older ductwork painted green above gym & upper gym	O & M
I	Black sink insulation	Unquantified EA	A	Science lab	O & M
J	Sink tops	Unquantified Eac	A	Science lab	O & M
K	Fume hood bases	Unquantified Eac	A	Science lab	O & M
L	Kiln insulation	Unquantified LF	A	Kiln insulation in D206 (33 year old Kiln)	O & M
M	Duct wrap/tape	Unquantified SF	A	Painted green in upper gym mechanical areas	O & M

Greater Clark County Schools
Remaining Materials Report
October 22, 2014

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other than black)	Approx. 4,100 LF	A	Throughout the building, some classrooms, library and mechanical area and upper gym.	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M
D	Fire Doors-Metal clad	Unquantified Eac	A	Mechanical wing, kitchen area, gym wing and throughout the building.	O & M
E	Stage light wiring	11 EA	A	Stage	O & M
F	Orange vinyl stair treads	Unquantified SF	A	Stairs near gym	O & M
G	Stair tread mastic	Unquantified LF	A	Stairs near gym	O & M
H	AHU expansion joints	Unquantified Eac	A	On older ductwork painted green above gym & upper gym	O & M
I	Black sink insulation	Unquantified EA	A	Science lab	O & M
J	Sink tops	Unquantified Eac	A	Science lab	O & M
K	Fume hood bases	Unquantified Eac	A	Science lab	O & M
L	Kiln insulation	Unquantified LF	A	Kiln insulation in D206 (33 year old Kiln)	O & M
M	Duct wrap/tape	Unquantified SF	A	Painted green in upper gym mechanical areas	O & M

Greater Clark County Schools
Remaining Materials Report
April 21, 2014

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other than black)	Approx. 4,100 LF	A	Throughout the building, some classrooms, library and mechanical area and upper gym.	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M
D	Fire Doors-Metal clad	Unquantified Eac	A	Mechanical wing, kitchen area, gym wing and throughout the building.	O & M
E	Stage light wiring	11 EA	A	Stage	O & M
F	Orange vinyl stair treads	Unquantified SF	A	Stairs near gym	O & M
G	Stair tread mastic	Unquantified LF	A	Stairs near gym	O & M
H	AHU expansion joints	Unquantified Eac	A	On older ductwork painted green above gym & upper gym	O & M
I	Black sink insulation	Unquantified EA	A	Science lab	O & M
J	Sink tops	Unquantified Eac	A	Science lab	O & M
K	Fume hood bases	Unquantified Eac	A	Science lab	O & M
L	Kiln insulation	Unquantified LF	A	Kiln insulation in D206 (33 year old Kiln)	O & M
M	Duct wrap/tape	Unquantified SF	A	Painted green in upper gym mechanical areas	O & M

**Greater Clark County Schools
Remaining Materials Report
October 24, 2013**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other than black)	Approx. 4,100 LF	A	Throughout the building, some classrooms, library and mechanical area and upper gym.	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M
D	Fire Doors-Metal clad	Unquantified Eac	A	Mechanical wing, kitchen area, gym wing and throughout the building.	O & M
E	Stage light wiring	11 EA	A	Stage	O & M
F	Orange vinyl stair treads	Unquantified SF	A	Stairs near gym	O & M
G	Stair tread mastic	Unquantified LF	A	Stairs near gym	O & M
H	AHU expansion joints	Unquantified Eac	A	On older ductwork painted green above gym & upper gym	O & M
I	Black sink insulation	Unquantified EA	A	Science lab	O & M
J	Sink tops	Unquantified Eac	A	Science lab	O & M
K	Fume hood bases	Unquantified Eac	A	Science lab	O & M
L	Kiln insulation	Unquantified LF	A	Kiln insulation in D206 (33 year old Kiln)	O & M
M	Duct wrap/tape	Unquantified SF	A	Painted green in upper gym mechanical areas	O & M

Greater Clark County Schools
Remaining Materials Report
April 24, 2013

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other than black)	Approx. 4,100 LF	A	Throughout the building, some classrooms, library and mechanical area and upper gym.	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M
D	Fire Doors-Metal clad	Unquantified Eac	A	Mechanical wing, kitchen area, gym wing and throughout the building.	O & M
E	Stage light wiring	11 EA	A	Stage	O & M
F	Orange vinyl stair treads	Unquantified SF	A	Stairs near gym	O & M
G	Stair tread mastic	Unquantified LF	A	Stairs near gym	O & M
H	AHU expansion joints	Unquantified Eac	A	On older ductwork painted green above gym & upper gym	O & M
I	Black sink insulation	Unquantified EA	A	Science lab	O & M
J	Sink tops	Unquantified Eac	A	Science lab	O & M
K	Fume hood bases	Unquantified Eac	A	Science lab	O & M
L	Kiln insulation	Unquantified LF	A	Kiln insulation in D206 (33 year old Kiln)	O & M
M	Duct wrap/tape	Unquantified SF	A	Painted green in upper gym mechanical areas	O & M

**Greater Clark County Schools
Remaining Materials Report
October 24, 2012**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other than black)	Approx. 4,100 LF	A	Throughout the building, some classrooms, library and mechanical area and upper gym.	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M
D	Fire Doors-Metal clad	Unquantified Eac	A	Mechanical wing, kitchen area, gym wing and throughout the building.	O & M
E	Stage light wiring	11 EA	A	Stage	O & M
F	Orange vinyl stair treads	Unquantified SF	A	Stairs near gym	O & M
G	Stair tread mastic	Unquantified LF	A	Stairs near gym	O & M
H	AHU expansion joints	Unquantified Eac	A	On older ductwork painted green above gym & upper gym	O & M
I	Black sink insulation	Unquantified EA	A	Science lab	O & M
J	Sink tops	Unquantified Eac	A	Science lab	O & M
K	Fume hood bases	Unquantified Eac	A	Science lab	O & M
L	Kiln insulation	Unquantified LF	A	Kiln insulation in D206 (33 year old Kiln)	O & M
M	Duct wrap/tape	Unquantified SF	A	Painted green in upper gym mechanical areas	O & M

Greater Clark County Schools
Remaining Materials Report
June 25, 2012

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other than black)	Approx. 4,100 LF	A	Throughout the building, some classrooms, library and mechanical area and upper gym.	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M
D	Fire Doors-Metal clad	Unquantified Eac	A	Mechanical wing, kitchen area, gym wing and throughout the building.	O & M
E	Stage light wiring	11 EA	A	Stage	O & M
F	Orange vinyl stair treads	Unquantified SF	A	Stairs near gym	O & M
G	Stair tread mastic	Unquantified LF	A	Stairs near gym	O & M
H	AHU expansion joints	Unquantified Eac	A	On older ductwork painted green above gym & upper gym	O & M
I	Black sink insulation	Unquantified EA	A	Science lab	O & M
J	Sink tops	Unquantified Eac	A	Science lab	O & M
K	Fume hood bases	Unquantified Eac	A	Science lab	O & M
L	Kiln insulation	Unquantified LF	A	Kiln insulation in D206 (33 year old Kiln)	O & M
M	Duct wrap/tape	Unquantified SF	A	Painted green in upper gym mechanical areas	O & M

**Greater Clark County Schools
Remaining Materials Report
December 6, 2010**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
-----	----------	----------	----------	----------	--------------------

Charlestown Middle School

03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other than black)	Approx. 4,100 LF	A	Throughout the building, some classrooms and library.	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M
D	Fire Doors	Unquantified Eac	A	Mechanical wing and kitchen area.	O & M

**Greater Clark County Schools
Remaining Materials Report
June 30, 2010**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other than black)	Approx. 4,100 LF	A	Throughout the building, some classrooms and library.	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M
D	Fire Doors	Unquantified Eac	A	Mechanical wing and kitchen area.	O & M

**Greater Clark County Schools
Remaining Materials Report
December 7, 2009**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other than black)	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

**Greater Clark County Schools
Remaining Materials Report
June 11, 2009**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other than black)	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

**Greater Clark County Schools
Remaining Materials Report
December 10, 2008**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
-----	----------	----------	----------	----------	--------------------

Charlestown Middle School

03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other then black)	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

**Greater Clark County Schools
Remaining Materials Report
June 30, 2008**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other than black)	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

**Greater Clark County Schools
Remaining Materials Report
December 14, 2007**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other than black)	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

**Greater Clark County Schools
Remaining Materials Report
August 1, 2007**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other than black)	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

**Greater Clark County Schools
Remaining Materials Report
July 9, 2007**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other than black)	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

**Greater Clark County Schools
Remaining Materials Report
December 18, 2006**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other than black)	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

**Greater Clark County Schools
Remaining Materials Report
June 28, 2006**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other than black)	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

**Greater Clark County Schools
Remaining Materials Report
January 25, 2006**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding (color other than black)	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
July 20, 2005

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
December 9, 2004

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
July 2, 2004

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
December 9, 2003

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
June 13, 2003

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
December 18, 2003

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

**Greater Clark County Schools
Remaining Materials Report
June 19, 2002**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
December 12, 2001

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
July 12, 2001

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
January 11, 2001

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor tile mastic	2,229 SF	A	Throughout the building	O & M
A	Cove base molding	Approx. 4,100 LF	A	Throughout the building	O & M
B	Cove base mastic	Approx. 1,370 SF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
June 29, 2000

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor Tile Mastic	2,229 SF	A	Throughout the building	O & M
A	Cove Base Molding	Unquantified LF	A	Throughout the building	O & M
B	Cove Base Mastic	Unquantified LF	A	Throughout the building	O & M

**Greater Clark County Schools
Remaining Materials Report
February 23, 2000**

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor Tile Mastic	2229 SF	A	Throughout the building	O & M
A	Cove Base Molding	Unquantified LF	A	Throughout the building	O & M
B	Cove Base Mastic	Unquantified LF	A	Throughout the building	O & M

Greater Clark County Schools
Remaining Materials Report
July 6, 1999

HA#	Material	Quantity	ACBM Y/A	Location	Planned Activities
<u>Charlestown Middle School</u>					
03	Floor Tile Mastic	2229 SF	A	Throughout the building	O & M
A	Cove Base Molding	Unquantified LF	A	Throughout the building	O & M
B	Cove Base Mastic	Unquantified LF	A	Throughout the building	O & M

*PERIODIC SURVEILLANCE
REINSPECTION
ADDITIONAL BULK SAMPLING
INFORMATION*

ASSESSMENTS FOR AHERA

1. Damaged or significantly damaged thermal systems insulation.
2. Damaged friable surfacing ACM.
3. Significantly damaged friable surfacing ACM.
4. Damaged or significantly damaged friable miscellaneous ACM.
5. ACBM with potential for damage.
6. ACBM with potential for significant damage.
7. Any remaining friable ACBM or friable suspected ACBM.

If a material is non-friable, it does not require an assessment rating under AHERA.

Due to the differences in what is required of the LEA for damaged material compared to significantly damaged material, Alliance has modified the assessment scale to the following:

- 1A. Significantly damaged thermal systems insulation.
- 1B. Damaged thermal systems insulation.
- 4A. Significantly damaged friable miscellaneous ACM.
- 4B. Damaged friable miscellaneous ACM.

PERIODIC SURVEILLANCES

SURVEILLANCE INFORMATION

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

DATE PLANNED	DATE COMPLETED	COMPLETED BY
<u>October 2014</u>	October 22, 2014	
<u>April 2015</u>	April 22, 2015	
<u>October 2015</u>	October 20, 2016	
<u>April 2016</u>	RE-INSPECTION	
<u>October 2016</u>	October 20, 2016	
<u>April 2017</u>	April 13, 2017	
<u>October 2017</u>	October 18, 2017	
<u>April 2018</u>	May 2, 2018	
<u>October 2018</u>	November 13, 2018	
<u>April 2019</u>	RE-INSPECTION	
<u>October 2019</u>	January 14, 2020	
<u>April 2020</u>	April 23, 2020	
<u>October 2020</u>		

SURVEILLANCE INFORMATION

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

<u>April 2021</u>	_____	_____
<u>October 2021</u>	_____	_____
<u>April 2022</u>	RE-INSPECTION	_____
<u>October 2022</u>	_____	_____
<u>April 2023</u>	_____	_____
<u>October 2023</u>	_____	_____
<u>April 2024</u>	_____	_____
<u>October 2024</u>	_____	_____
<u>April 2025</u>	RE-INSPECTION	_____
<u>October 2025</u>	_____	_____
<u>April 2026</u>	_____	_____
<u>October 2026</u>	_____	_____

SURVEILLANCE INFORMATION

PERIODIC SURVEILLANCE PLAN SCHEDULE

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each re-inspection will be maintained in this binder.

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>JUNE 2009</u>	<u>June 2009</u>	<u>Bill Ogle</u>
<u>DECEMBER 2009</u>	<u>Dec 2009</u>	<u>Bill Ogle</u>
<u>JUNE 2010</u>	<u>Reinspection June 2010</u>	<u>Sandy Shadley</u>
<u>DECEMBER 2010</u>	<u>December 2010</u>	<u>Paul Krick</u>
<u>JUNE 2011</u>	_____	_____
<u>DECEMBER 2011</u>	_____	_____
<u>JUNE 2012</u>	<u>June 2012</u>	<u>Jeff Hechtin</u>
<u>DECEMBER 2012</u>	<u>October 2012</u>	<u>Jeff Hechtin</u>
<u>JUNE 2013</u>	<u>Reinspection</u>	<u>Jeff Hechtin</u>
<u>DECEMBER 2013</u>	_____	_____

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long as the material remain in the building, as required by the Asbestos Hazard Emergency Response Act (AHERA). This periodic surveillance shall be conducted on a semi-annual basis as required by law.

Records of each reinspection will be maintained in this binder.

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>JUNE 2003</u>	<u>June '03</u>	<u>C Sparks</u>
<u>DECEMBER 2003</u>	<u>Dec. '03</u>	<u>C Sparks</u>
<u>JUNE 2004</u>	<u>REINSPECTION</u>	<u>C Sparks</u>
<u>DECEMBER 2004</u>	<u>Dec. '04</u>	<u>C Sparks</u>
<u>JUNE 2005</u>	<u>July '05</u>	<u>J Ogle</u>
<u>DECEMBER 2005</u>	<u>June 06</u>	<u>Boyer</u>
<u>JUNE 2006</u>	<u>June 06</u>	<u>C Ans</u>
<u>DECEMBER 2006</u>	<u>Dec 06</u>	<u>Boyer</u>
<u>JUNE 2007</u>	<u>July 2007</u> <u>REINSPECTION</u>	<u>Bill Ogle</u>
<u>DECEMBER 2007</u>	<u>December 2007</u>	<u>Bill Ogle</u>
<u>JUNE 2008</u>	<u>June 2008</u>	<u>Bill Ogle</u>
<u>DECEMBER 2008</u>	<u>December 2008</u>	<u>Bill Ogle</u>

PERIODIC SURVEILLANCE PLAN

GREATER CLARK COUNTY SCHOOLS

CHARLESTOWN MIDDLE SCHOOL

The ACBM in this building will be periodically inspected to determine any change in the condition of the materials for as long they remain in the building. This inspection will be conducted semi-annually.

The following table outlines the dates on which these inspections should take place in this school building.

PERIODIC SURVEILLANCE SCHEDULE

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>DECEMBER 1995</u>	<u>12-95</u>	<u>Alliance</u>
<u>JUNE 1996</u>	<u>6-96</u>	<u>Alliance</u>
<u>DECEMBER 1996</u>	<u>12-96</u>	<u>Alliance</u>
<u>JUNE 1997</u>	<u>7-97</u>	<u>Alliance</u>
<u>DECEMBER 1997</u>	<u>1-98</u>	<u>Alliance</u>
<u>JUNE 1998</u>	<u>REINSPECTION</u>	<u>Alliance</u>
<u>DECEMBER 1998</u>	<u>12-98</u>	<u>Alliance</u>
<u>JUNE 1999</u>	<u>June '99</u>	<u>Alliance</u>
<u>DECEMBER 1999</u>	<u>Dec. '99</u>	<u>Alliance</u>
<u>JUNE 2000</u>	<u>June 2000</u>	<u>Alliance</u>
<u>DECEMBER 2000</u>	<u>Jan. '01</u>	<u>Pat Wilson</u>
<u>JUNE 2001</u>	<u>REINSPECTION</u>	<u>P. Wilson</u>
<u>DECEMBER 2001</u>	<u>Dec. '01</u>	<u>A. Kimbrough</u>
<u>JUNE 2002</u>	<u>June '02</u>	<u>R. Calvert</u>
<u>DECEMBER 2002</u>	<u>Dec. '02</u>	<u>C. Sparks</u>

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID 03
HA Description Floor Tile Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 2229 SF
Comments This material was not exposed to inspect.
Asbestos Assumed
Friable No

Original Inspection 6/1/1988
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID A
HA Description Cove base molding (color other than black)
HA Type Miscellaneous Material
HA Location Throughout the building, some classrooms, library and mechanical area and upper gym.
Quantity 4100 LF
Comments The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID B

HA Description Cove Base Mastic

HA Type Miscellaneous Material

HA Location Throughout building

Quantity 1370 SF

Comments This material was not exposed to inspect except for one column post at doorway of room D-127. The mastic has been painted over.

Asbestos Assumed

Friable No

Original Inspection 5/31/1995

Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID D
HA Description Fire Doors-Metal clad
HA Type Miscellaneous Material
HA Location Mechanical wing, kitchen area, gym wing and throughout the building.

Quantity Unquantified Unit(s)
Comments Fire doors were not assessed in the original inspection and are suspect for asbestos.
These will be assumed to be ACM until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID E
HA Description Stage light wiring
HA Type Miscellaneous Material
HA Location Stage

Quantity 11 Unit(s)
Comments This material was discovered during the June surveillance and will remain in the management plan until properly tested.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration


Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID F
HA Description Orange vinyl stair treads
HA Type Miscellaneous Material
HA Location Stage near gym

Quantity Unquantified SF
Comments Some treads are cracked and chipped around the edges, but still remain in tact.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID G
HA Description Stair tread mastic
HA Type Miscellaneous Material
HA Location Stage near gym

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID H
HA Description AHU expansion joints
HA Type Miscellaneous Material
HA Location On older ductwork painted green above gym & upper gym

Quantity Unquantified Unit(s)
Comments This material was not accessible.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID I

HA Description Black sink insulation

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID J

HA Description Sink Tops

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested. KILN Insulation in D206. (33 yrold kiln) Assumed 12-15-11

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID K

HA Description Fume hood bases

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID L
HA Description Kiln insulation
HA Type Thermal System Insulation (TSI)
HA Location Kiln insulation in D206 (33 year old Kiln)

Quantity Unquantified LF
Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.
Asbestos Assumed
Friable No

Original Inspection 12/15/2011
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID M
HA Description Duct wrap/tape
HA Type Miscellaneous Material
HA Location Painted green in upper gym mechanical areas

Quantity Unquantified SF
Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 12/15/2011
Current Inspection 4/23/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID 03
HA Description Floor Tile Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 2229 SF
Comments This material was not exposed to inspect.
Asbestos Assumed
Friable No

Original Inspection 6/1/1988
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID A
HA Description Cove base molding (color other then black)
HA Type Miscellaneous Material
HA Location Throughout the building, some classrooms, llibrary and mechanical area and upper gym.
Quantity 4100 LF
Comments The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID B

HA Description Cove Base Mastic

HA Type Miscellaneous Material

HA Location Throughout building

Quantity 1370 SF

Comments This material was not exposed to inspect except for one column post at doorway of room D-127. The mastic has been painted over.

Asbestos Assumed

Friable No

Original Inspection 5/31/1995

Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID D
HA Description Fire Doors-Metal clad
HA Type Miscellaneous Material
HA Location Mechanical wing, kitchen area, gym wing and throughout the building.

Quantity Unquantified Unit(s)
Comments Fire doors were not assessed in the original inspection and are suspect for asbestos.
These will be assumed to be ACM until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID E
HA Description Stage light wiring
HA Type Miscellaneous Material
HA Location Stage

Quantity 11 Unit(s)
Comments This material was discovered during the June surveillance and will remain in the management plan until properly tested.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID F
HA Description Orange vinyl stair treads
HA Type Miscellaneous Material
HA Location Stage near gym

Quantity Unquantified SF
Comments Some treads are cracked and chipped around the edges, but still remain in tact.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID G
HA Description Stair tread mastic
HA Type Miscellaneous Material
HA Location Stage near gym

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID H
HA Description AHU expansion joints
HA Type Miscellaneous Material
HA Location On older ductwork painted green above gym & upper gym

Quantity Unquantified Unit(s)
Comments This material was not accessible.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID I
HA Description Black sink insulation
HA Type Miscellaneous Material
HA Location Science lab

Quantity 0 Unit(s)
Comments This material has been removed during 2019 renovations.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action Removed

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID J

HA Description Sink Tops

HA Type Miscellaneous Material

HA Location Science lab

Quantity 0 Unit(s)

Comments This material has been removed during 2019 renovations.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action Removed

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID K

HA Description Fume hood bases

HA Type Miscellaneous Material

HA Location Science lab

Quantity 0 Unit(s)

Comments This material has been removed during 2019 renovations.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action Removed

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID L
HA Description Kiln insulation
HA Type Thermal System Insulation (TSI)
HA Location Kiln insulation in D206 (33 year old Kiln)

Quantity 0 LF
Comments This material has been removed during 2019 renovations.
Asbestos Assumed
Friable No

Original Inspection 12/15/2011
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action Removed

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID M
HA Description Duct wrap/tape
HA Type Miscellaneous Material
HA Location Painted green in upper gym mechanical areas

Quantity Unquantified SF
Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 12/15/2011
Current Inspection 1/14/2020

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Michael J. Ardis

State IN

Accreditation Number 19A007304

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID 03
HA Description Floor Tile Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 0 SF
Comments This material was removed by a licensed abatement contractor in the summer of 2018
Asbestos Assumed
Friable No

Original Inspection 6/1/1988
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action Removed

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID A
HA Description Cove base molding (color other than black)
HA Type Miscellaneous Material
HA Location Throughout the building, some classrooms, library and mechanical area and upper gym.
Quantity 4100 LF
Comments The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 1370 SF
Comments This material was not exposed to inspect except for one column post at doorway of room D-127. The mastic has been painted over.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID D
HA Description Fire Doors-Metal clad
HA Type Miscellaneous Material
HA Location Mechanical wing, kitchen area, gym wing and throughout the building.

Quantity Unquantified Unit(s)
Comments Fire doors were not assessed in the original inspection and are suspect for asbestos.
These will be assumed to be ACM until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID E
HA Description Stage light wiring
HA Type Miscellaneous Material
HA Location Stage

Quantity 11 Unit(s)
Comments This material was discovered during the June surveillance and will remain in the management plan until properly tested.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID F
HA Description Orange vinyl stair treads
HA Type Miscellaneous Material
HA Location Stage near gym

Quantity Unquantified SF
Comments Some treads are cracked and chipped around the edges, but still remain in tact.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID G
HA Description Stair tread mastic
HA Type Miscellaneous Material
HA Location Stage near gym

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID H
HA Description AHU expansion joints
HA Type Miscellaneous Material
HA Location On older ductwork painted green above gym & upper gym

Quantity Unquantified Unit(s)
Comments This material was not accessible.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID I

HA Description Black sink insulation

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration


Low/None

Air

Low/None

Planned Response Action O&M

Inspector

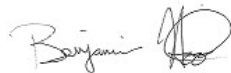

Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID J
HA Description Sink Tops
HA Type Miscellaneous Material
HA Location Science lab

Quantity 0 Unit(s)
Comments This material was removed by a licensed abatement contractor in the summer of 2018
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action Removed

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID K

HA Description Fume hood bases

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID L
HA Description Kiln insulation
HA Type Thermal System Insulation (TSI)
HA Location Kiln insulation in D206 (33 year old Kiln)

Quantity Unquantified LF
Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 12/15/2011
Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID M
HA Description Duct wrap/tape
HA Type Miscellaneous Material
HA Location Painted green in upper gym mechanical areas

Quantity Unquantified SF

Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 12/15/2011

Current Inspection 11/13/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID 03
HA Description Floor Tile Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 2229 SF
Comments This material was not exposed to inspect.
Asbestos Assumed
Friable No

Original Inspection 6/1/1988
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID A
HA Description Cove base molding (color other than black)
HA Type Miscellaneous Material
HA Location Throughout the building, some classrooms, library and mechanical area and upper gym.
Quantity 4100 LF
Comments The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration


Low/None

Air

Low/None

Planned Response Action O&M

Inspector

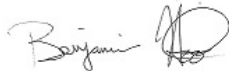

Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 1370 SF
Comments This material was not exposed to inspect except for one column post at doorway of room D-127. The mastic has been painted over.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID D
HA Description Fire Doors-Metal clad
HA Type Miscellaneous Material
HA Location Mechanical wing, kitchen area, gym wing and throughout the building.

Quantity Unquantified Unit(s)
Comments Fire doors were not assessed in the original inspection and are suspect for asbestos.
These will be assumed to be ACM until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID E
HA Description Stage light wiring
HA Type Miscellaneous Material
HA Location Stage

Quantity 11 Unit(s)
Comments This material was discovered during the June surveillance and will remain in the management plan until properly tested.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID F
HA Description Orange vinyl stair treads
HA Type Miscellaneous Material
HA Location Stage near gym

Quantity Unquantified SF
Comments Some treads are cracked and chipped around the edges, but still remain in tact.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 5/2/2018

Material Assessment


Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector

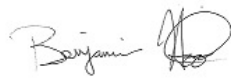

Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID G
HA Description Stair tread mastic
HA Type Miscellaneous Material
HA Location Stage near gym

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 5/2/2018

Material Assessment


Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector

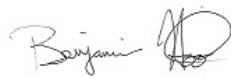

Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID H
HA Description AHU expansion joints
HA Type Miscellaneous Material
HA Location On older ductwork painted green above gym & upper gym

Quantity Unquantified Unit(s)
Comments This material was not accessible.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 5/2/2018

Material Assessment


Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector

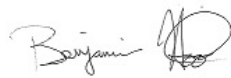

Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID I

HA Description Black sink insulation

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID J

HA Description Sink Tops

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested. KILN Insulation in D206. (33 yrold kiln) Assumed 12-15-11

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration


Low/None

Air

Low/None

Planned Response Action O&M

Inspector

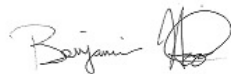

Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID K

HA Description Fume hood bases

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID L

HA Description Kiln insulation

HA Type Thermal System Insulation (TSI)

HA Location Kiln insulation in D206 (33 year old Kiln)

Quantity Unquantified LF

Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 12/15/2011

Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID M
HA Description Duct wrap/tape
HA Type Miscellaneous Material
HA Location Painted green in upper gym mechanical areas

Quantity Unquantified SF
Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 12/15/2011
Current Inspection 5/2/2018

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID 03
HA Description Floor Tile Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 2229 SF
Comments This material was not exposed to inspect.
Asbestos Assumed
Friable No
Original Inspection 6/1/1988
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID A
HA Description Cove base molding (color other then black)
HA Type Miscellaneous Material
HA Location Throughout the building, some classrooms, llibrary and mechanical area and upper gym.
Quantity 4100 LF
Comments The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 1370 SF
Comments This material was not exposed to inspect except for one column post at doorway of room D-127. The mastic has been painted over.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID D
HA Description Fire Doors-Metal clad
HA Type Miscellaneous Material
HA Location Mechanical wing, kitchen area, gym wing and throughout the building.

Quantity Unquantified Unit(s)
Comments Fire doors were not assessed in the original inspection and are suspect for asbestos.
These will be assumed to be ACM until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID E
HA Description Stage light wiring
HA Type Miscellaneous Material
HA Location Stage

Quantity 11 Unit(s)
Comments This material was discovered during the June surveillance and will remain in the management plan until properly tested.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 10/18/2017

Material Assessment


Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector 

Dustin Hawkins

State IN
Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID F
HA Description Orange vinyl stair treads
HA Type Miscellaneous Material
HA Location Stage near gym

Quantity Unquantified SF
Comments Some treads are cracked and chipped around the edges, but still remain in tact.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID G
HA Description Stair tread mastic
HA Type Miscellaneous Material
HA Location Stage near gym

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID H
HA Description AHU expansion joints
HA Type Miscellaneous Material
HA Location On older ductwork painted green above gym & upper gym

Quantity Unquantified Unit(s)
Comments This material was not accessible.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID I

HA Description Black sink insulation

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID J

HA Description Sink Tops

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested. KILN Insulation in D206. (33 yrold kiln) Assumed 12-15-11

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID K

HA Description Fume hood bases

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID L
HA Description Kiln insulation
HA Type Thermal System Insulation (TSI)
HA Location Kiln insulation in D206 (33 year old Kiln)

Quantity Unquantified LF
Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.
Asbestos Assumed
Friable No

Original Inspection 12/15/2011
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID M
HA Description Duct wrap/tape
HA Type Miscellaneous Material
HA Location Painted green in upper gym mechanical areas

Quantity Unquantified SF
Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 12/15/2011
Current Inspection 10/18/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID A
HA Description Cove base molding (color other then black)
HA Type Miscellaneous Material
HA Location Throughout the building, some classrooms, llibrary and mechanical area and upper gym.
Quantity 4100 LF
Comments The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 1370 SF
Comments This material was not exposed to inspect except for one column post at doorway of room D-127. The mastic has been painted over.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector

Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID D
HA Description Fire Doors-Metal clad
HA Type Miscellaneous Material
HA Location Mechanical wing, kitchen area, gym wing and throughout the building.

Quantity Unquantified Unit(s)
Comments Fire doors were not assessed in the original inspection and are suspect for asbestos.
These will be assumed to be ACM until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID E
HA Description Stage light wiring
HA Type Miscellaneous Material
HA Location Stage

Quantity 11 Unit(s)
Comments This material was discovered during the June surveillance and will remain in the management plan until properly tested.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 4/13/2017


Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None
<u>Planned Response Action</u>	O&M		

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID F

HA Description Orange vinyl stair treads

HA Type Miscellaneous Material

HA Location Stage near gym

Quantity Unquantified SF

Comments Some treads are cracked and chipped around the edges, but still remain in tact.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID G
HA Description Stair tread mastic
HA Type Miscellaneous Material
HA Location Stage near gym

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID H
HA Description AHU expansion joints
HA Type Miscellaneous Material
HA Location On older ductwork painted green above gym & upper gym

Quantity Unquantified Unit(s)
Comments This material was not accessible.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID I

HA Description Black sink insulation

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID J

HA Description Sink Tops

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested. KILN Insulation in D206. (33 yrold kiln) Assumed 12-15-11

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID K

HA Description Fume hood bases

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID L
HA Description Kiln insulation
HA Type Thermal System Insulation (TSI)
HA Location Kiln insulation in D206 (33 year old Kiln)

Quantity Unquantified LF
Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.
Asbestos Assumed
Friable No

Original Inspection 12/15/2011
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector

Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID M
HA Description Duct wrap/tape
HA Type Miscellaneous Material
HA Location Painted green in upper gym mechanical areas

Quantity Unquantified SF
Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 12/15/2011
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition	
<u>Physical Contact</u>		<u>Vibration</u>	<u>Air</u>
Low/None		Low/None	Low/None
<u>Planned Response Action</u>	O&M		

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID 03
HA Description Floor Tile Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 2229 SF
Comments This material was not exposed to inspect.
Asbestos Assumed
Friable No
Original Inspection 6/1/1988
Current Inspection 4/13/2017

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Jamie Hosier

State Indiana

Accreditation Number 19A007179

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID 03
HA Description Floor Tile Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 2229 SF
Comments This material was not exposed to inspect.
Asbestos Assumed
Friable No
Original Inspection 6/1/1988
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID A
HA Description Cove base molding (color other than black)
HA Type Miscellaneous Material
HA Location Throughout the building, some classrooms, library and mechanical area and upper gym.
Quantity 4100 LF
Comments The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 1370 SF
Comments This material was not exposed to inspect except for one column post at doorway of room D-127. The mastic has been painted over.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID D
HA Description Fire Doors-Metal clad
HA Type Miscellaneous Material
HA Location Mechanical wing, kitchen area, gym wing and throughout the building.

Quantity Unquantified Unit(s)
Comments Fire doors were not assessed in the original inspection and are suspect for asbestos.
These will be assumed to be ACM until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID E
HA Description Stage light wiring
HA Type Miscellaneous Material
HA Location Stage

Quantity 11 Unit(s)
Comments This material was discovered during the June surveillance and will remain in the management plan until properly tested.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID F

HA Description Orange vinyl stair treads

HA Type Miscellaneous Material

HA Location Stage near gym

Quantity Unquantified SF

Comments Some treads are cracked and chipped around the edges, but still remain in tact.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID G
HA Description Stair tread mastic
HA Type Miscellaneous Material
HA Location Stage near gym

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID H
HA Description AHU expansion joints
HA Type Miscellaneous Material
HA Location On older ductwork painted green above gym & upper gym

Quantity Unquantified Unit(s)
Comments This material was not accessible.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID I

HA Description Black sink insulation

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID J

HA Description Sink Tops

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested. KILN Insulation in D206. (33 yrold kiln) Assumed 12-15-11

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID K

HA Description Fume hood bases

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID L

HA Description Kiln insulation

HA Type Thermal System Insulation (TSI)

HA Location Kiln insulation in D206 (33 year old Kiln)

Quantity Unquantified LF

Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 12/15/2011

Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID M
HA Description Duct wrap/tape
HA Type Miscellaneous Material
HA Location Painted green in upper gym mechanical areas

Quantity Unquantified SF
Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 12/15/2011
Current Inspection 11/3/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M



Inspector

Dustin Hawkins

State IN

Accreditation Number 19A007194

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID 03
HA Description Floor Tile Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 2229 SF
Comments This material was not exposed to inspect.
Asbestos Assumed
Friable No

Original Inspection 6/1/1988
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID A
HA Description Cove base molding (color other then black)
HA Type Miscellaneous Material
HA Location Throughout the building, some classrooms, llibrary and mechanical area and upper gym.
Quantity 4100 LF
Comments The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 1370 SF
Comments This material was not exposed to inspect except for one column post at doorway of room D-127. The mastic has been painted over.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID D
HA Description Fire Doors-Metal clad
HA Type Miscellaneous Material
HA Location Mechanical wing, kitchen area, gym wing and throughout the building.

Quantity Unquantified Unit(s)
Comments Fire doors were not assessed in the original inspection and are suspect for asbestos.
These will be assumed to be ACM until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID E
HA Description Stage light wiring
HA Type Miscellaneous Material
HA Location Stage

Quantity 11 Unit(s)
Comments This material was discovered during the June surveillance and will remain in the management plan until properly tested.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID F
HA Description Orange vinyl stair treads
HA Type Miscellaneous Material
HA Location Stage near gym

Quantity Unquantified SF
Comments Some treads are cracked and chipped around the edges, but still remain in tact.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID G
HA Description Stair tread mastic
HA Type Miscellaneous Material
HA Location Stage near gym

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID H
HA Description AHU expansion joints
HA Type Miscellaneous Material
HA Location On older ductwork painted green above gym & upper gym

Quantity Unquantified Unit(s)
Comments This material was not accessible.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID I

HA Description Black sink insulation

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID J

HA Description Sink Tops

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested. KILN Insulation in D206. (33 yrold kiln) Assumed 12-15-11

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID K

HA Description Fume hood bases

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID L

HA Description Kiln insulation

HA Type Thermal System Insulation (TSI)

HA Location Kiln insulation in D206 (33 year old Kiln)

Quantity Unquantified LF

Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Asbestos Assumed

Friable No

Original Inspection 12/15/2011

Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Periodic Surveillance

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID M
HA Description Duct wrap/tape
HA Type Miscellaneous Material
HA Location Painted green in upper gym mechanical areas

Quantity Unquantified SF
Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 12/15/2011
Current Inspection 10/20/2015

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# 03

Type of Material Miscellaneous Material

Quantity of Material 2,229 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/1/1988

Current Surveillance Date 4/22/2015

Current Assessment Rating NR Not Rated


Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

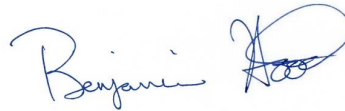

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building, some classrooms, library and mechanical area and upper gym.

Material Description

Cove base molding (color other than black)

Comments

The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 4/22/2015

Current Assessment Rating NR Not Rated


Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

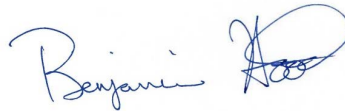

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# B

Type of Material Miscellaneous Material

Quantity of Material Approx. 1,370 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

This material was not exposed to inspect except for one column post at doorway of room D-127. The mastic has been painted over.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 4/22/2015

Current Assessment Rating NR Not Rated


Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

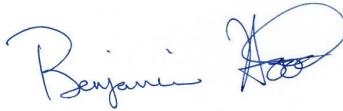

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# D

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location

Mechanical wing, kitchen area, gym wing and throughout the building.

Material Description

Fire Doors-Metal clad

Comments

Fire doors were not assessed in the original inspection and are suspect for asbestos. These will be assumed to be ACM until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/30/2010

Current Surveillance Date 4/22/2015

Current Assessment Rating NR Not Rated


Cause of Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

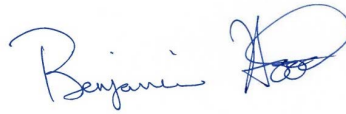

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# E

Type of Material Miscellaneous Material

Quantity of Material 11 EA

Material Location

Stage

Material Description

Stage light wiring

Comments

This material was discovered during the June surveillance and will remain in the management plan until properly tested.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 4/22/2015

Current Assessment Rating 7 Any Remaining Friable ACBM or Friable Suspected ACBM


Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

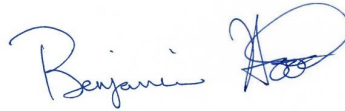

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# F

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Stairs near gym

Material Description

Orange vinyl stair treads

Comments

Some treads are cracked and chipped around the edges, but still remain in tact.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 4/22/2015

Current Assessment Rating NR Not Rated


Cause of Damage Deterioraton & Physical Damage

Accessible Yes

Potential for Damage L

Removed No

Planned Response Action O & M

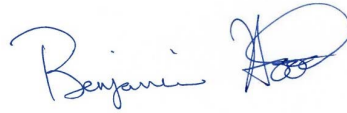

Inspector


Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name	Greater Clark County Schools	
Building Name	Charlestown Middle School	
HA#	G	
Type of Material	Miscellaneous Material	
Quantity of Material	Unquantified LF	
Material Location	Stairs near gym	
Material Description	Stair tread mastic	
Comments	This material was not visible to inspect.	
Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	6/27/2011	
Current Surveillance Date	4/22/2015	
Current Assessment Rating	NR	Not Rated
Cause of Damage		
Accessible	No	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	

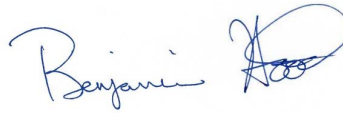

Inspector

Benjamin S. Hood

State	Indiana
Accreditation Number	19A001039


PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# H
Type of Material Miscellaneous Material
Quantity of Material Unquantified Each
Material Location
On older ductwork painted green above gym & upper gym

Material Description
AHU expansion joints

Comments
This material was not accessible.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 4/22/2015
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

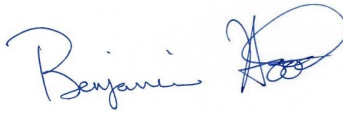

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# I

Type of Material Miscellaneous Material

Quantity of Material Unquantified EA

Material Location
Science lab

Material Description
Black sink insulation

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 4/22/2015

Current Assessment Rating NR Not Rated


Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

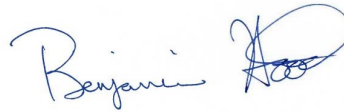

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# J

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location
Science lab

Material Description
Sink tops

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested. KILN Insulation in D206. (33 yrold kiln) Assumed 12-15-11

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 4/22/2015

Current Assessment Rating NR Not Rated


Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

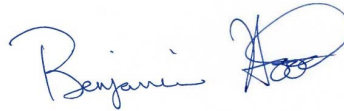

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# K

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location

Science lab

Material Description

Fume hood bases

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 4/22/2015

Current Assessment Rating NR Not Rated


Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

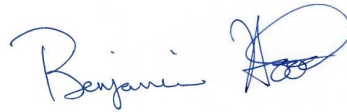

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# L

Type of Material Thermal System Insulation

Quantity of Material Unquantified LF

Material Location

Kiln insulation in D206 (33 year old Kiln)

Material Description

Kiln insulation

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 12/15/2011

Current Surveillance Date 4/22/2015

Current Assessment Rating NR Not Rated


Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

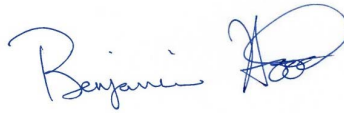

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# M

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Painted green in upper gym mechanical areas

Material Description

Duct wrap/tape

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 12/15/2011

Current Surveillance Date 4/22/2015

Current Assessment Rating 7 Any Remaining Friable ACBM or Friable Suspected ACBM


Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

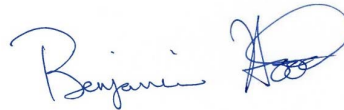

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2,229 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1988
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building, some classrooms, library and mechanical area and upper gym.

Material Description

Cove base molding (color other than black)

Comments

The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 10/22/2014

Current Assessment Rating NR Not Rated


Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

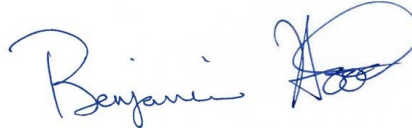

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# B

Type of Material Miscellaneous Material

Quantity of Material Approx. 1,370 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

This material was not exposed to inspect except for one column post at doorway of room D-127. The mastic has been painted over.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 10/22/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M



Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# D

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location

Mechanical wing, kitchen area, gym wing and throughout the building.

Material Description

Fire Doors-Metal clad

Comments

Fire doors were not assessed in the original inspection and are suspect for asbestos. These will be assumed to be ACM until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/30/2010

Current Surveillance Date 10/22/2014

Current Assessment Rating NR Not Rated


Cause of Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

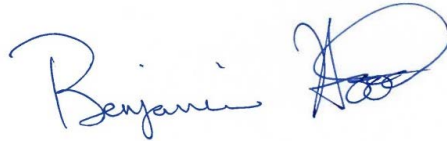

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# E

Type of Material Miscellaneous Material

Quantity of Material 11 EA

Material Location

Stage

Material Description

Stage light wiring

Comments

This material was discovered during the June surveillance and will remain in the management plan until properly tested.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 10/22/2014

Current Assessment Rating 7 Any Remaining Friable ACBM or Friable Suspected ACBM


Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

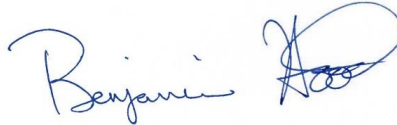

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# F

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Stairs near gym

Material Description

Orange vinyl stair treads

Comments

Some treads are cracked and chipped around the edges, but still remain in tact.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 10/22/2014

Current Assessment Rating NR Not Rated


Cause of Damage Deterioraton & Physical Damage

Accessible Yes

Potential for Damage L

Removed No

Planned Response Action O & M

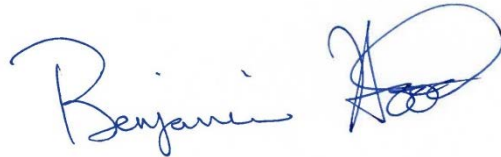

Inspector


Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# G
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Stairs near gym
Material Description
Stair tread mastic
Comments
This material was not visible to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

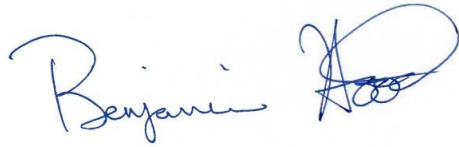

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# H
Type of Material Miscellaneous Material
Quantity of Material Unquantified Each
Material Location
On older ductwork painted green above gym & upper gym


Material Description

AHU expansion joints

Comments

This material was not accessible.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/22/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

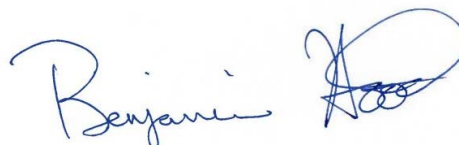

Inspector

Benjamin S. Hood

State Indiana
Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# I

Type of Material Miscellaneous Material

Quantity of Material Unquantified EA

Material Location
Science lab

Material Description
Black sink insulation

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 10/22/2014

Current Assessment Rating NR Not Rated


Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

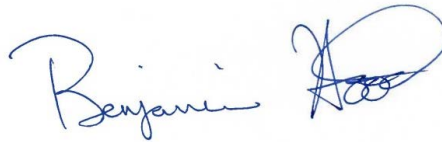

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# J

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location
Science lab

Material Description
Sink tops

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested. KILN Insulation in D206. (33 yrold kiln) Assumed 12-15-11

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 10/22/2014

Current Assessment Rating NR Not Rated


Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

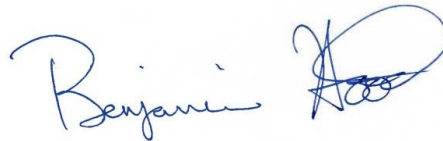

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# K

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location

Science lab

Material Description

Fume hood bases

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 10/22/2014

Current Assessment Rating NR Not Rated


Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

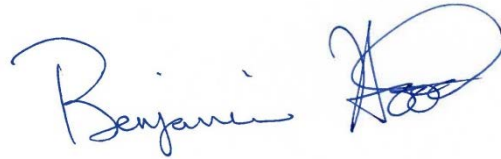

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# L

Type of Material Thermal System Insulation

Quantity of Material Unquantified LF

Material Location

Kiln insulation in D206 (33 year old Kiln)

Material Description

Kiln insulation

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 12/15/2011

Current Surveillance Date 10/22/2014

Current Assessment Rating NR Not Rated


Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

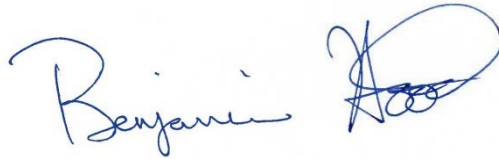

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# M

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Painted green in upper gym mechanical areas

Material Description

Duct wrap/tape

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 12/15/2011

Current Surveillance Date 10/22/2014

Current Assessment Rating 7 Any Remaining Friable ACBM or Friable Suspected ACBM


Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

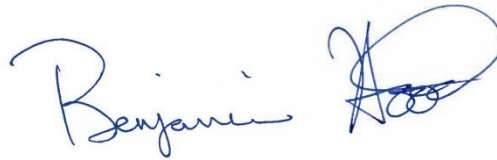

Inspector

Benjamin S. Hood

State Indiana

Accreditation Number 19A001039

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2,229 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1988
Current Surveillance Date 4/21/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building, some classrooms, library and mechanical area and upper gym.

Material Description

Cove base molding (color other than black)

Comments

The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 4/21/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# B

Type of Material Miscellaneous Material

Quantity of Material Approx. 1,370 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

This material was not exposed to inspect except for one column post at doorway of room D-127. The mastic has been painted over.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 4/21/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# D

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location

Mechanical wing, kitchen area, gym wing and throughout the building.

Material Description

Fire Doors-Metal clad

Comments

Fire doors were not assessed in the original inspection and are suspect for asbestos. These will be assumed to be ACM until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/30/2010

Current Surveillance Date 4/21/2014

Current Assessment Rating NR Not Rated

Cause of Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# E

Type of Material Miscellaneous Material

Quantity of Material 11 EA

Material Location

Stage

Material Description

Stage light wiring

Comments

This material was discovered during the June surveillance and will remain in the management plan until properly tested.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 4/21/2014

Current Assessment Rating 7 Any Remaining Friable ACBM or Friable Suspected ACBM

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# F

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Stairs near gym

Material Description

Orange vinyl stair treads

Comments

Some treads are cracked and chipped around the edges, but still remain in tact.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 4/21/2014

Current Assessment Rating NR Not Rated

Cause of Damage Deterioraton & Physical Damage

Accessible Yes

Potential for Damage L

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name	Greater Clark County Schools	
Building Name	Charlestown Middle School	
HA#	G	
Type of Material	Miscellaneous Material	
Quantity of Material	Unquantified LF	
Material Location	Stairs near gym	
Material Description	Stair tread mastic	
Comments	This material was not visible to inspect.	
Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	6/27/2011	
Current Surveillance Date	4/21/2014	
Current Assessment Rating	NR	Not Rated
Cause of Damage		
Accessible	No	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	

Inspector



Jeffrey P. Rechtin

State	Indiana
Accreditation Number	19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# H
Type of Material Miscellaneous Material
Quantity of Material Unquantified Each
Material Location
On older ductwork painted green above gym & upper gym

Material Description
AHU expansion joints

Comments
This material was not accessible.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 4/21/2014
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# I

Type of Material Miscellaneous Material

Quantity of Material Unquantified EA

Material Location
Science lab

Material Description
Black sink insulation

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 4/21/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# J

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location
Science lab

Material Description
Sink tops

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested. KILN Insulation in D206. (33 yrold kiln) Assumed 12-15-11

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 4/21/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# K

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location
Science lab

Material Description
Fume hood bases

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 4/21/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# L

Type of Material Thermal System Insulation

Quantity of Material Unquantified LF

Material Location

Kiln insulation in D206 (33 year old Kiln)

Material Description

Kiln insulation

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 12/15/2011

Current Surveillance Date 4/21/2014

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# M

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Painted green in upper gym mechanical areas

Material Description

Duct wrap/tape

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 12/15/2011

Current Surveillance Date 4/21/2014

Current Assessment Rating 7 Any Remaining Friable ACBM or Friable Suspected ACBM

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2,229 SF
Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	6/1/1988	
Current Surveillance Date	10/24/2013	
Current Assessment Rating	NR	Not Rated
Cause of Damage	No Damage	
Accessible	No	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building, some classrooms, library and mechanical area and upper gym.

Material Description

Cove base molding (color other than black)

Comments

The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 10/24/2013

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# B

Type of Material Miscellaneous Material

Quantity of Material Approx. 1,370 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

This material was not exposed to inspect except for one column post at doorway of room D-127. The mastic has been painted over.

Does Material Contain Asbestos? Assumed

Is It Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 10/24/2013

Current Assessment Rating NR Not Rated

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

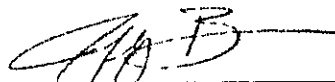

Jeffrey P. Rechtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# D

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location

Mechanical wing, kitchen area, gym wing and throughout the building.

Material Description

Fire Doors-Metal clad

Comments

Fire doors were not assessed in the original inspection and are suspect for asbestos.
These will be assumed to be ACM until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/30/2010

Current Surveillance Date 10/24/2013

Current Assessment Rating NR Not Rated

Cause of Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

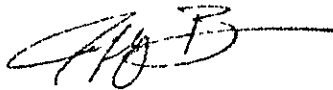

Jeffrey P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# E

Type of Material Miscellaneous Material

Quantity of Material 11 EA

Material Location

Stage

Material Description

Stage light wiring

Comments

This material was discovered during the June surveillance and will remain in the management plan until properly tested.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 10/24/2013

Current Assessment Rating 7

Any Remaining Friable ACBM or Friable Suspected ACBM

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

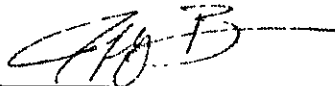

Jeffrey P. Rehtin


State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# F
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF
Material Location
Stairs near gym
Material Description
Orange vinyl stair treads
Comments
Some treads are cracked and chipped around the edges, but still remain in tact.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage Deterioration & Physical Damage
Accessible Yes
Potential for Damage L
Removed No
Planned Response Action O & M

Inspector

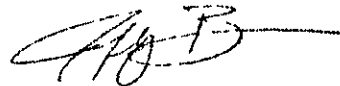

Jeffrey P. Rechtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name	Greater Clark County Schools
Building Name	Charlestown Middle School
HA#	G
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	Stairs near gym
Material Description	Stair tread mastic
Comments	This material was not visible to inspect.
Does Material Contain Asbestos?	Assumed
Is It Friable?	No
Original Inspection Date	6/27/2011
Current Surveillance Date	10/24/2013
Current Assessment Rating	NR Not Rated
Cause of Damage	
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Inspector



Jeffrey P. Rehtin

State

Indiana

Accreditation Number

19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# H
Type of Material Miscellaneous Material
Quantity of Material Unquantified Each
Material Location

On older ductwork painted green above gym & upper gym

Material Description

AHU expansion joints

Comments

This material was not accessible.

Does Material Contain Asbestos? Assumed
Is It Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# I

Type of Material Miscellaneous Material

Quantity of Material Unquantified EA

Material Location

Science lab

Material Description

Black sink insulation

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Does Material Contain Asbestos? Assumed

Is It Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 10/24/2013

Current Assessment Rating NR Not Rated

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

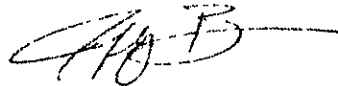

Jeffrey P. Rechtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# J

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location

Science lab

Material Description

Sink tops

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested. KILN Insulation in D206. (33 yrold kiln) Assumed 12-15-11

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 10/24/2013

Current Assessment Rating NR Not Rated

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

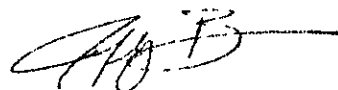

Jeffrey P. Rechtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# K
Type of Material Miscellaneous Material
Quantity of Material Unquantified Each
Material Location

Science lab

Material Description

Fume hood bases

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# L

Type of Material Thermal System Insulation

Quantity of Material Unquantified LF

Material Location

Kiln insulation in D206 (33 year old Kiln)

Material Description

Kiln insulation

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 12/15/2011

Current Surveillance Date 10/24/2013

Current Assessment Rating NR Not Rated


Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

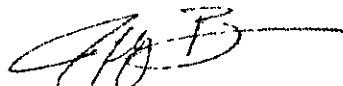

Inspector

Jeffrey P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# M

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Painted green in upper gym mechanical areas

Material Description

Duct wrap/tape

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 12/15/2011

Current Surveillance Date 10/24/2013

Current Assessment Rating 7

Any Remaining Friable ACBM or Friable Suspected ACBM

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

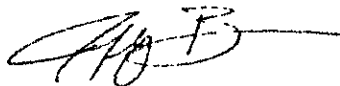

Jeffrey P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2,229 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1988
Current Surveillance Date 10/24/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building, some classrooms, library and mechanical area and upper gym.

Material Description

Cove base molding (color other than black)

Comments

The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 10/24/2012

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# B

Type of Material Miscellaneous Material

Quantity of Material Approx. 1,370 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

This material was not exposed to inspect except for one column post at doorway of room D-127. The mastic has been painted over.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 10/24/2012

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# D

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location

Mechanical wing, kitchen area, gym wing and throughout the building.

Material Description

Fire Doors-Metal clad

Comments

Fire doors were not assessed in the original inspection and are suspect for asbestos.
These will be assumed to be ACM until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/30/2010

Current Surveillance Date 10/24/2012

Current Assessment Rating NR Not Rated

Cause of Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# E

Type of Material Miscellaneous Material

Quantity of Material 11 EA

Material Location

Stage

Material Description

Stage light wiring

Comments

This material was discovered during the June surveillance and will remain in the management plan until properly tested.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 10/24/2012

Current Assessment Rating 7 Any Remaining Friable ACBM or Friable Suspected ACBM

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M



Inspector

Jeffrey P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# F

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Stairs near gym

Material Description

Orange vinyl stair treads

Comments

Some treads are cracked and chipped around the edges, but still remain in tact.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 10/24/2012

Current Assessment Rating NR Not Rated

Cause of Damage Deterioraton & Physical Damage

Accessible Yes

Potential for Damage L

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# G
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Stairs near gym
Material Description
Stair tread mastic
Comments
This material was not visible to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/24/2012
Current Assessment Rating NR Not Rated
Cause of Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# H
Type of Material Miscellaneous Material
Quantity of Material Unquantified Each
Material Location

On older ductwork painted green above gym & upper gym

Material Description

AHU expansion joints

Comments

This material was not accessible.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 10/24/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M



Inspector

Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# I

Type of Material Miscellaneous Material

Quantity of Material Unquantified EA

Material Location

Science lab

Material Description

Black sink insulation

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 10/24/2012

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# J

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location
Science lab

Material Description
Sink tops

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested. KILN Insulation in D206. (33 yrold kiln) Assumed 12-15-11

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 10/24/2012

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# K

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location

Science lab

Material Description

Fume hood bases

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 10/24/2012

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# L

Type of Material Thermal System Insulation

Quantity of Material Unquantified LF

Material Location

Kiln insulation in D206 (33 year old Kiln)

Material Description

Kiln insulation

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 12/15/2011

Current Surveillance Date 10/24/2012

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# M

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Painted green in upper gym mechanical areas

Material Description

Duct wrap/tape

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 12/15/2011

Current Surveillance Date 10/24/2012

Current Assessment Rating 7 Any Remaining Friable ACBM or Friable Suspected ACBM

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M


Inspector

Jeffrey P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

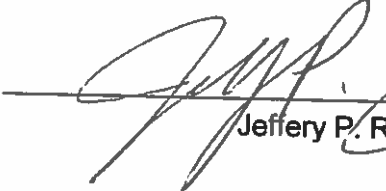LEA Name	Greater Clark County Schools
Building Name	Charlestown Middle School
HA#	03
Type of Material	Miscellaneous Material
Quantity of Material	2,229 SF
Material Location	Throughout the building
Material Description	Floor tile mastic
Comments	This material was not exposed to inspect.
Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	6/1/1988
Current Surveillance Date	6/25/2012
Current Assessment Rating	NR Not Rated
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
Inspector	 Jeffery P. Rehtin
State	Indiana
Accreditation Number	19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building, some classrooms, library and mechanical area and upper gym.

Material Description

Cove base molding (color other than black)

Comments

The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 6/25/2012

Current Assessment Rating NR Not Rated

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

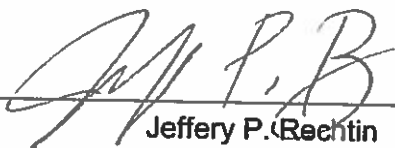
Jeffery P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,370 SF

Material Location
Throughout the building


Material Description
Cove base mastic

Comments

This material was not exposed to inspect except for one column post at doorway of room D-127. The mastic has been painted over.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 6/25/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

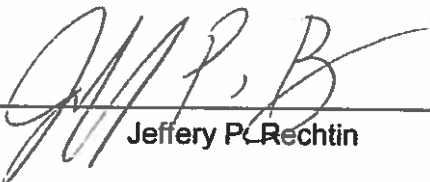

Jeffery P. Rechten

State Indiana
Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# D

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location

Mechanical wing, kitchen area, gym wing and throughout the building.

Material Description

Fire Doors-Metal clad

Comments

Fire doors were not assessed in the original inspection and are suspect for asbestos. These will be assumed to be ACM until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/30/2010

Current Surveillance Date 6/25/2012

Current Assessment Rating NR Not Rated

Cause of Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

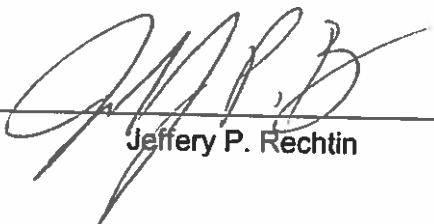
Jeffery P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# E
Type of Material Miscellaneous Material
Quantity of Material 11 EA

Material Location

Stage

Material Description

Stage light wiring

Comments

This material was discovered during the June surveillance and will remain in the management plan until properly tested.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 6/25/2012

Current Assessment Rating 7

Any Remaining Friable ACBM or Friable Suspected ACBM

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Jeffery P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# F

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Stairs near gym

Material Description

Orange vinyl stair treads

Comments

Some treads are cracked and chipped around the edges, but still remain in tact.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 6/25/2012

Current Assessment Rating NR Not Rated

Cause of Damage Deterioraton & Physical Damage

Accessible Yes

Potential for Damage L

Removed No

Planned Response Action O & M


Inspector


Jeffery P. Rechtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name	Greater Clark County Schools
Building Name	Charlestown Middle School
HA#	G
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	Stairs near gym
Material Description	Stair tread mastic
Comments	This material was not visible to inspect.
Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	6/27/2011
Current Surveillance Date	6/25/2012
Current Assessment Rating	NR Not Rated
Cause of Damage	
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
Inspector	 Jeffery P. Rechtin
State	Indiana
Accreditation Number	19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# H

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location

On older ductwork painted green above gym & upper gym

Material Description

AHU expansion joints

Comments

This material was not accessible.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 6/25/2012

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Jeffery P. Rehtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# I

Type of Material Miscellaneous Material

Quantity of Material Unquantified EA

Material Location
Science lab

Material Description
Black sink insulation

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 6/25/2012

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# J
Type of Material Miscellaneous Material
Quantity of Material Unquantified Each
Material Location
Science lab
Material Description
Sink tops
Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested. KILN Insulation in D206. (33 yrold kiln) Assumed 12-15-11

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Surveillance Date 6/25/2012
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Jeffrey P. Rechten

State

Indiana

Accreditation Number

19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# K

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location
Science lab

Material Description
Fume hood bases

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Surveillance Date 6/25/2012

Current Assessment Rating NR Not Rated

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M


Inspector

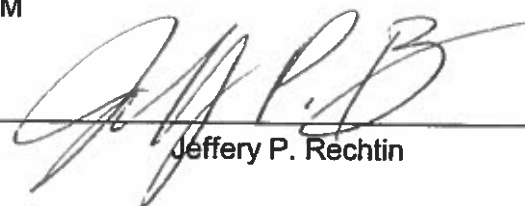
Jeffery P. Rechtin

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name	Greater Clark County Schools
Building Name	Charlestown Middle School
HA#	L
Type of Material	Thermal System Insulation
Quantity of Material	Unquantified LF
Material Location	Kiln insulation in D206 (33 year old Kiln)
Material Description	Kiln insulation
Comments	This material was not assessed in the original inspection and will be added to the management plan until properly sampled.
Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	12/15/2011
Current Surveillance Date	6/25/2012
Current Assessment Rating	NR Not Rated
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
Inspector	 Jeffery P. Rehtin
State	Indiana
Accreditation Number	19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# M

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Painted green in upper gym mechanical areas

Material Description

Duct wrap/tape

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 12/15/2011

Current Surveillance Date 6/25/2012

Current Assessment Rating 7 Any Remaining Friable ACBM or Friable Suspected ACBM

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Jeffery P. Rechten

State Indiana

Accreditation Number 19A003594

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# 03

Type of Material Miscellaneous Material

Quantity of Material 2,229 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/1/1988

Current Surveillance Date 12/6/2010

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

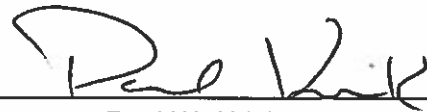

Paul W. Krick

State Indiana

Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building, some classrooms and library.

Material Description

Cove base molding (color other than black)

Comments

The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 12/6/2010

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Paul W. Krick

State Indiana

Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,370 SF

Material Location
Throughout the building

Material Description
Cove base mastic

Comments
This material was not exposed to inspect except for one column post at room D-125 where the cove base is taped. The mastic was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/6/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Paul W. Krick

State Indiana
Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# D

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location

Mechanical wing and kitchen area.

Material Description

Fire Doors

Comments

Fire doors were not assessed in the original inspection and are suspect for asbestos.
These will be assumed to be ACM until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/30/2010

Current Surveillance Date 12/6/2010

Current Assessment Rating NR Not Required

Cause of Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector




Paul W. Krick

State Indiana

Accreditation Number 197812124

PERIODIC SURVEILLANCE REPORT

LEA Name	Greater Clark County Schools	
Building Name	Charlestown Middle School	
HA#	03	
Type of Material	Miscellaneous Material	
Quantity of Material	2,229 SF	
Material Location	Throughout the building	
Material Description	Floor tile mastic	
Comments	This material was not exposed to inspect.	
Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	6/1/1988	
Current Surveillance Date	12/3/2009	
Current Assessment Rating	NR	Not Required
Cause of Damage	No Damage	
Accessible	No	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	
Inspector	 George William Ogle	
State	Indiana	
Accreditation Number	191003027	

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building

Material Description

Cove base molding (color other than black)

Comments

The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 12/3/2009

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# B

Type of Material Miscellaneous Material

Quantity of Material Approx. 1,370 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

This material was not exposed to inspect except for one column post at room D-125 where the cove base is missing. The mastic was not in poor condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 12/3/2009

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2,229 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1988
Current Surveillance Date 6/11/2009
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

IN

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building

Material Description

Cove base molding (color other than black)

Comments

The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 6/11/2009

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State IN

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# B

Type of Material Miscellaneous Material

Quantity of Material Approx. 1,370 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

This material was not exposed to inspect except for one column post at room D-125 where the cove base is missing. The mastic was not in poor condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 6/11/2009

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

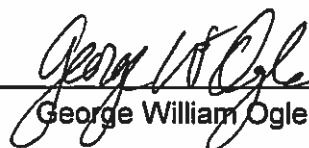
George William Ogle

State IN

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# 03

Type of Material Miscellaneous Material

Quantity of Material 2,229 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/1/1988

Current Surveillance Date 12/10/2008

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building

Material Description

Cove base molding (color other than black)

Comments

The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 12/10/2008

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# B

Type of Material Miscellaneous Material

Quantity of Material Approx. 1,370 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 12/10/2008

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle


State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2,229 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1988
Current Surveillance Date 6/30/2008
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

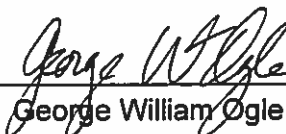
George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building

Material Description

Cove base molding (color other than black)

Comments

The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 6/30/2008

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name	Greater Clark County Schools
Building Name	Charlestown Middle School
HA#	B
Type of Material	Miscellaneous Material
Quantity of Material	Approx. 1,370 SF
Material Location	Throughout the building
Material Description	Cove base mastic
Comments	This material was not exposed to inspect.
Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	5/31/1995
Current Surveillance Date	6/30/2008
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Inspector


George William Ogle

State

Indiana

Accreditation Number

191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# 03

Type of Material Miscellaneous Material

Quantity of Material 2,229 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/1/1988

Current Surveillance Date 12/7/2007

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building

Material Description

Cove base molding (color other than black)

Comments

The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 12/7/2007

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,370 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/7/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2,229 SF
Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos?	Assumed	
Is it Friable?	No	
Original Inspection Date	6/1/1988	
Current Surveillance Date	7/11/2007	
Current Assessment Rating	NR	Not Required
Cause of Damage	No Damage	
Accessible	No	
Potential for Damage	Low	
Removed	No	
Planned Response Action	O & M	

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building

Material Description

Cove base molding (color other than black)

Comments

The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 7/11/2007

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle


State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,370 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 7/11/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Bridgepoint Elementary School
HA# 01
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location

Throughout the building (including but not limited to: entry by pool, storage entry, and art room)

Material Description

12" X 12" floor tile over 9" X 9" floor tile

Comments

There is potential for the existence of floor tile beneath carpeted areas throughout the building. There are two broken tiles on the left hand side of the sink in the art room. Visible floor tile was not in poor condition overall.

Does Material Contain Asbestos?	Yes
Is it Friable?	No
Original Inspection Date	6/1/1992
Current Surveillance Date	7/9/2007
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# 03

Type of Material Miscellaneous Material

Quantity of Material 2,229 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/1/1988

Current Surveillance Date 12/19/2006

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building

Material Description

Cove base molding (color other than black)

Comments

The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 12/19/2006

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

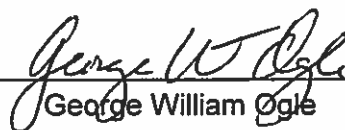
George William Ogle

State Indiana

Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,370 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/19/2006
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State Indiana
Accreditation Number 191003027

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# 03

Type of Material Miscellaneous Material

Quantity of Material 2,229 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/1/1988

Current Surveillance Date 6/28/2006

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Christopher Ames

State Indiana

Accreditation Number 198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# A
Type of Material Miscellaneous Material
Quantity of Material Approx. 4,100 LF
Material Location

Throughout the building

Material Description

Cove base molding (color other than black)

Comments

There are damaged pieces in several areas throughout the building, but this material was not in poor condition overall. The black color base has been recently installed to replace sections of the old molding.

Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	5/31/1995
Current Surveillance Date	6/28/2006
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	Yes
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Inspector



Christopher Ames

State

Indiana

Accreditation Number

198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,370 SF
Material Location

Throughout the building

Material Description

Cove base mastic

Comments

Where exposed in only one location, this material was not in poor condition.

Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	5/31/1995
Current Surveillance Date	6/28/2006
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Inspector



Christopher Ames

State

Indiana

Accreditation Number

198612124

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# 03

Type of Material Miscellaneous Material

Quantity of Material 2,229 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/1/1988

Current Surveillance Date 1/24/2006

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building

Material Description

Cove base molding (color other than black)

Comments

There are damaged pieces in several areas throughout the building, but this material was not in poor condition overall. The black color base has been recently installed to replace sections of the old molding.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 1/24/2006

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# B

Type of Material Miscellaneous Material

Quantity of Material Approx. 1,370 SF

Material Location

Throughout the building

Material Description

Cove base mastic

Comments

Where exposed in only one location, this material was not in poor condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 1/24/2006

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No


Planned Response Action O & M

Inspector


George William Ogle


State Indiana

Accreditation Number 191523030

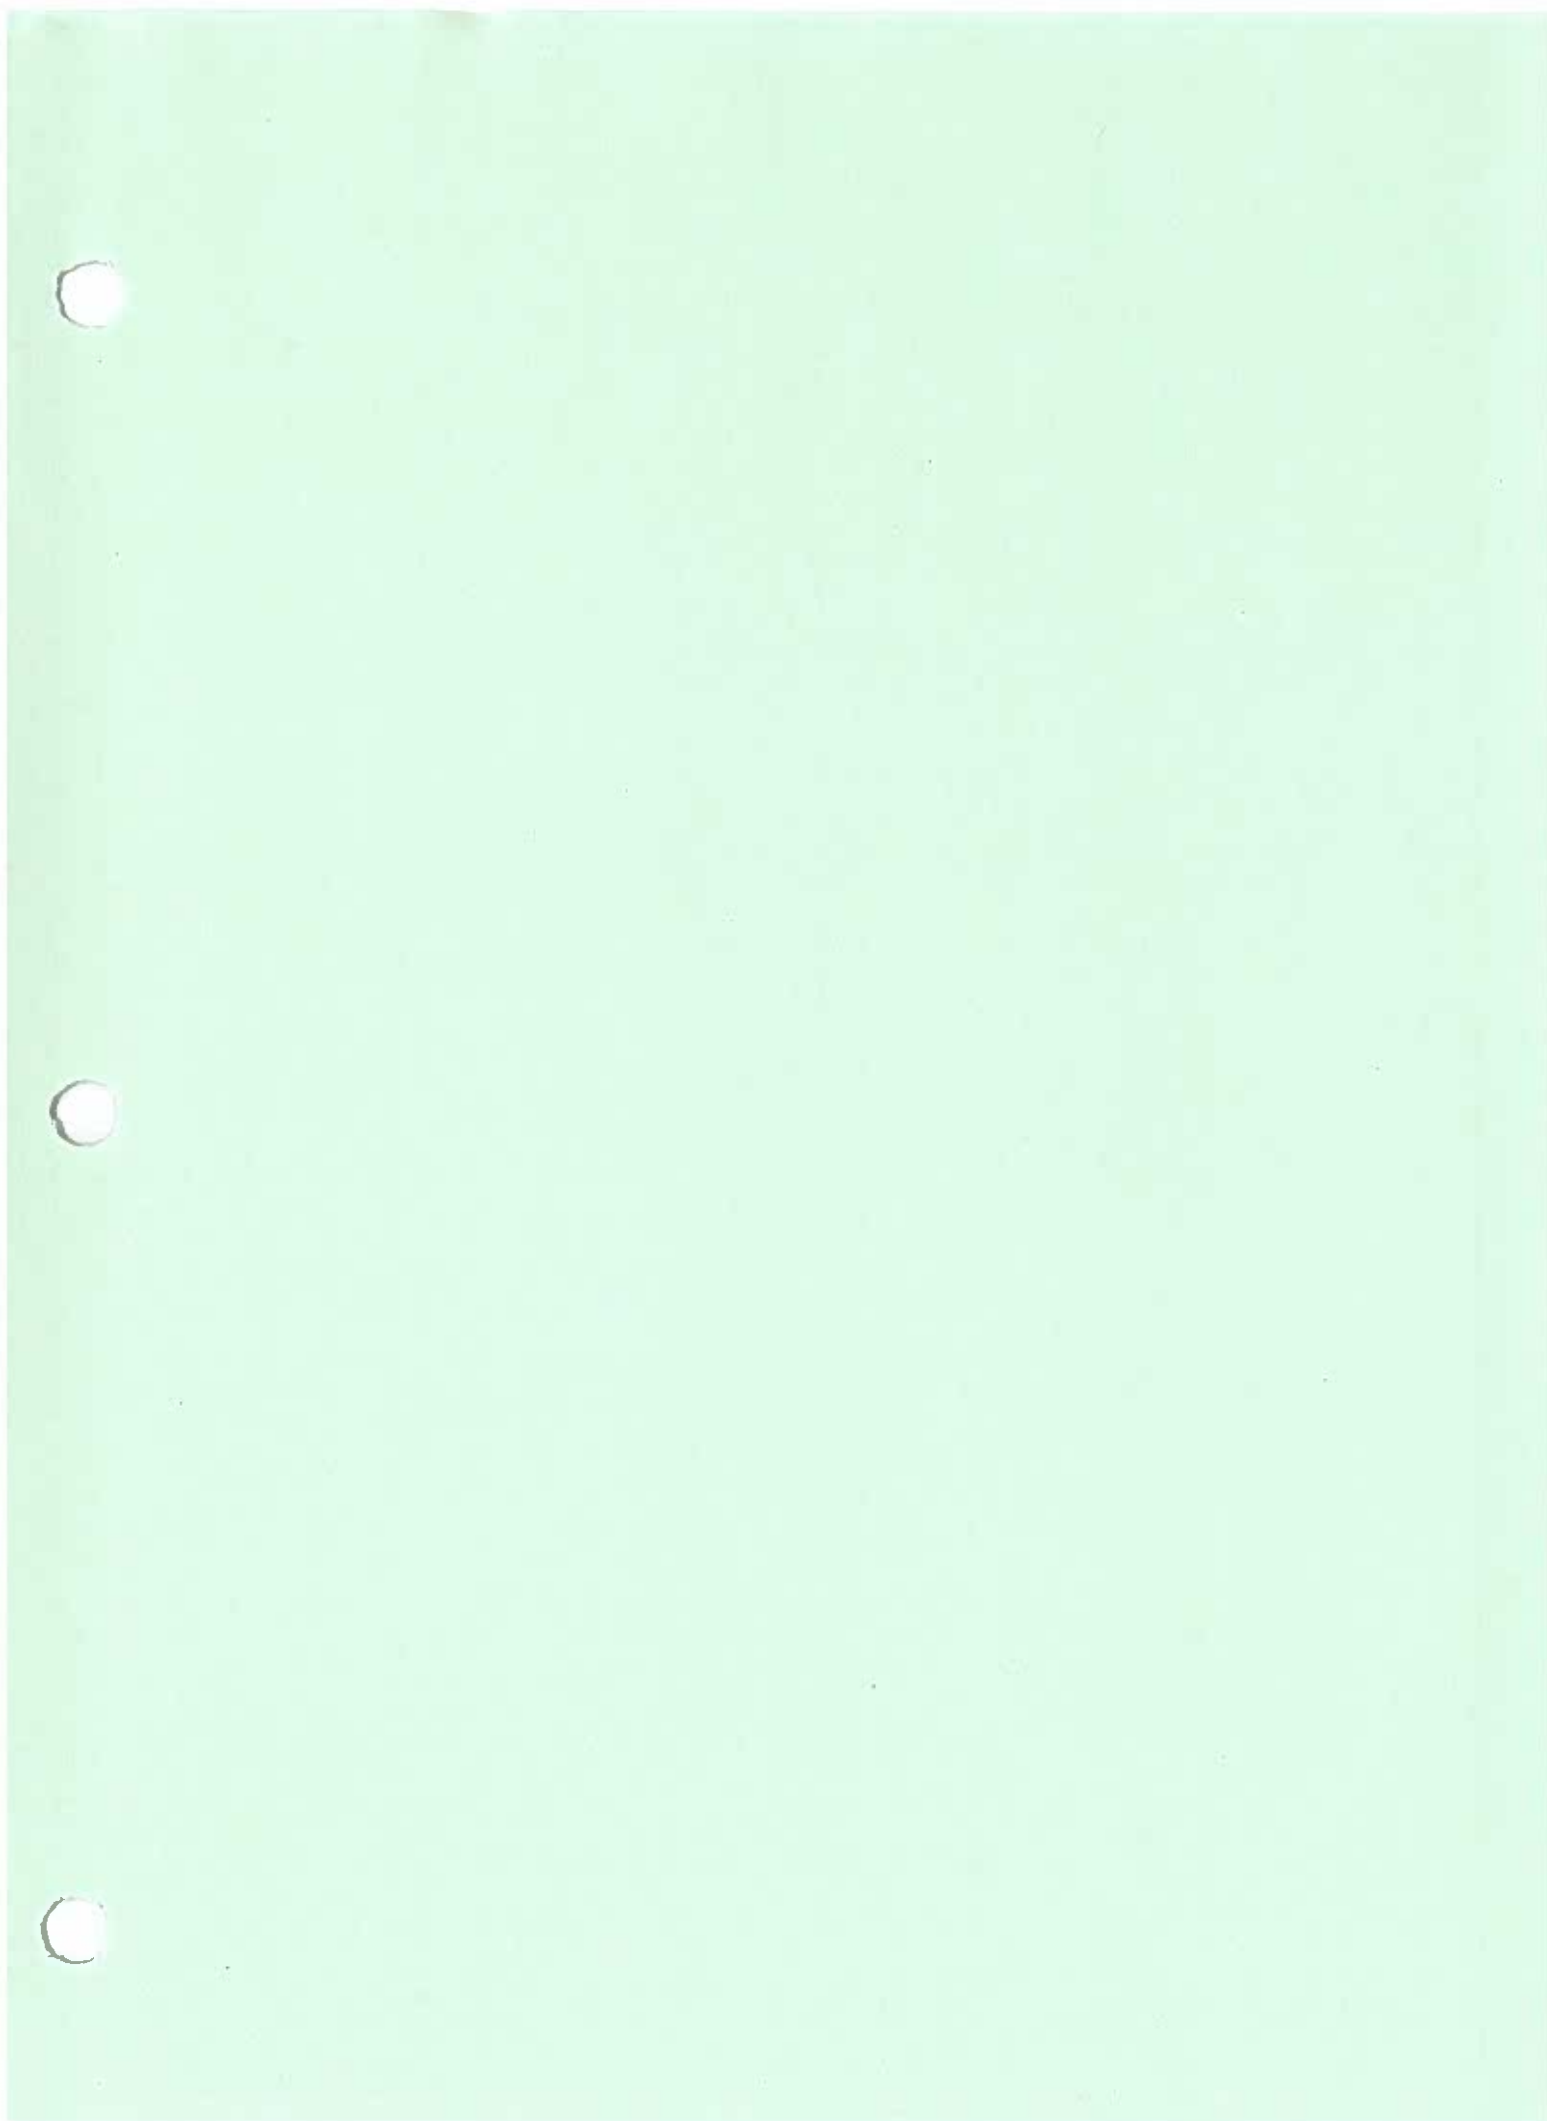

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2,229 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/1/1988
Current Surveillance Date 7/19/2005
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

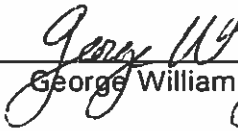Inspector _____

George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location
Throughout the building

Material Description
Cove base molding

Comments
There are missing and damaged pieces in several areas throughout the building, but this material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 7/19/2005

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

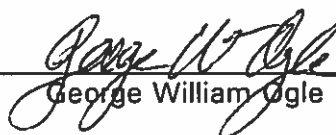
George William Ogle

State Indiana

Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,370 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 7/19/2005
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



George William Ogle

State

Indiana

Accreditation Number

191523030

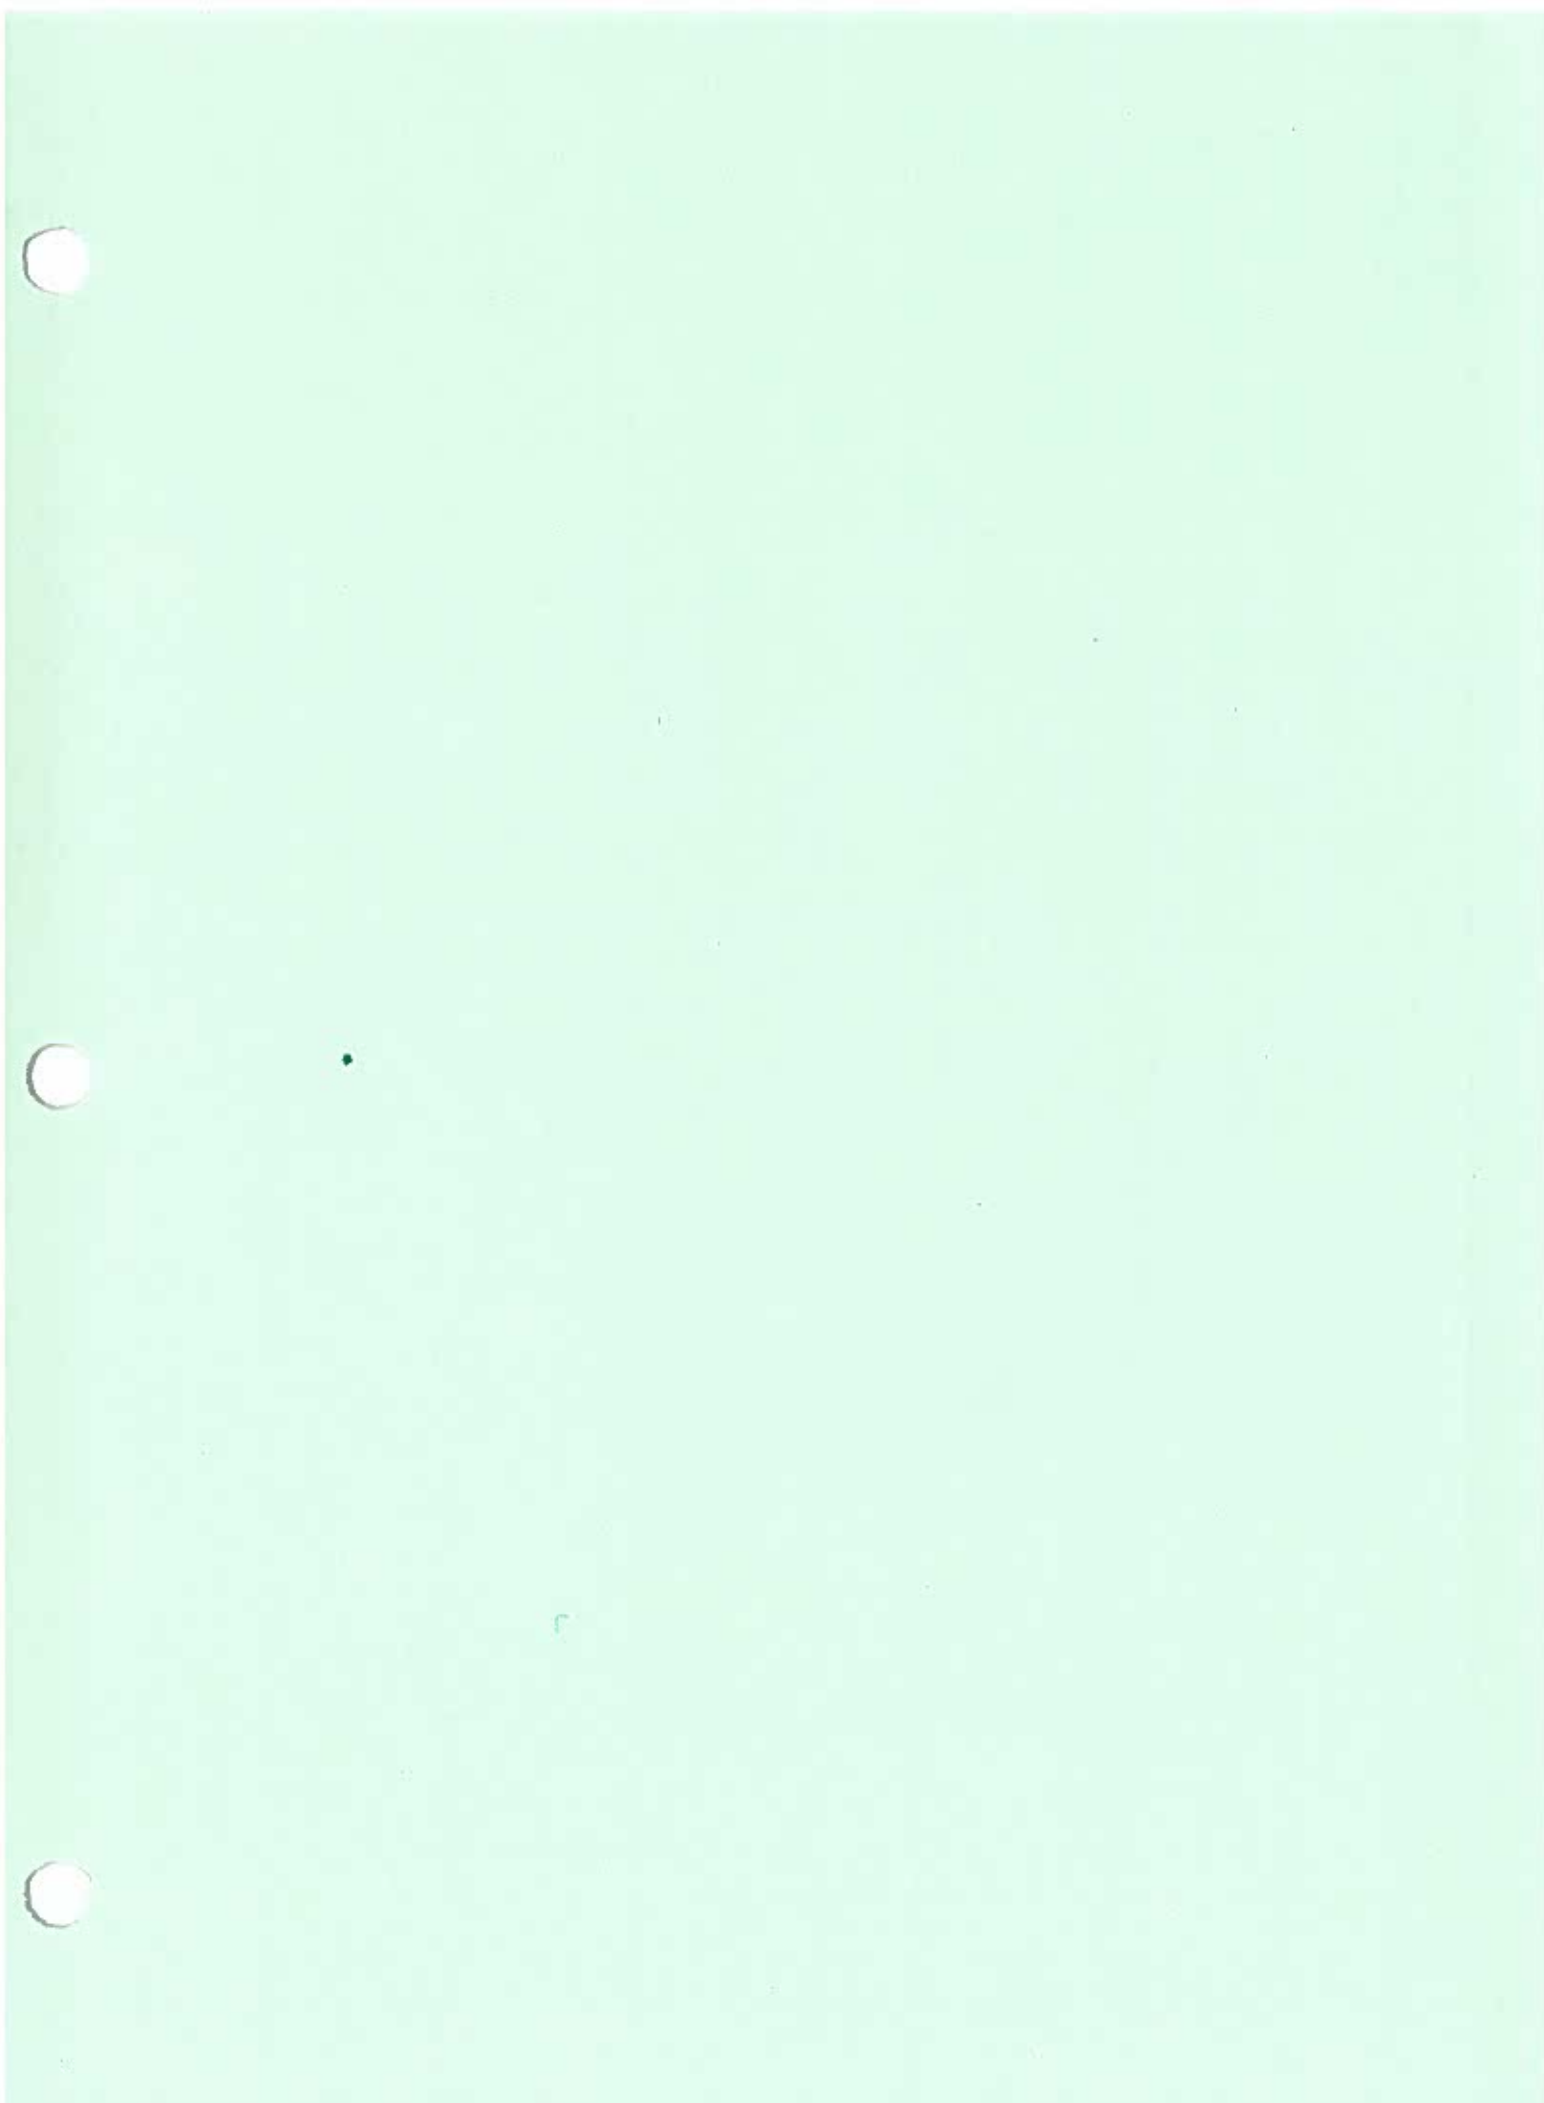

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# 03

Type of Material Miscellaneous Material

Quantity of Material 2,229 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/1/1988

Current Surveillance Date 12/8/2004

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Christiaan Sparks

State Indiana

Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location
Throughout the building

Material Description
Cove base molding

Comments
There are missing and damaged pieces in several areas throughout the building. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Surveillance Date 12/8/2004

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector




Christiaan Sparks

State Indiana

Accreditation Number 190804103


PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,370 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Surveillance Date 12/8/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Christiaan Sparks

State Indiana
Accreditation Number 190804103

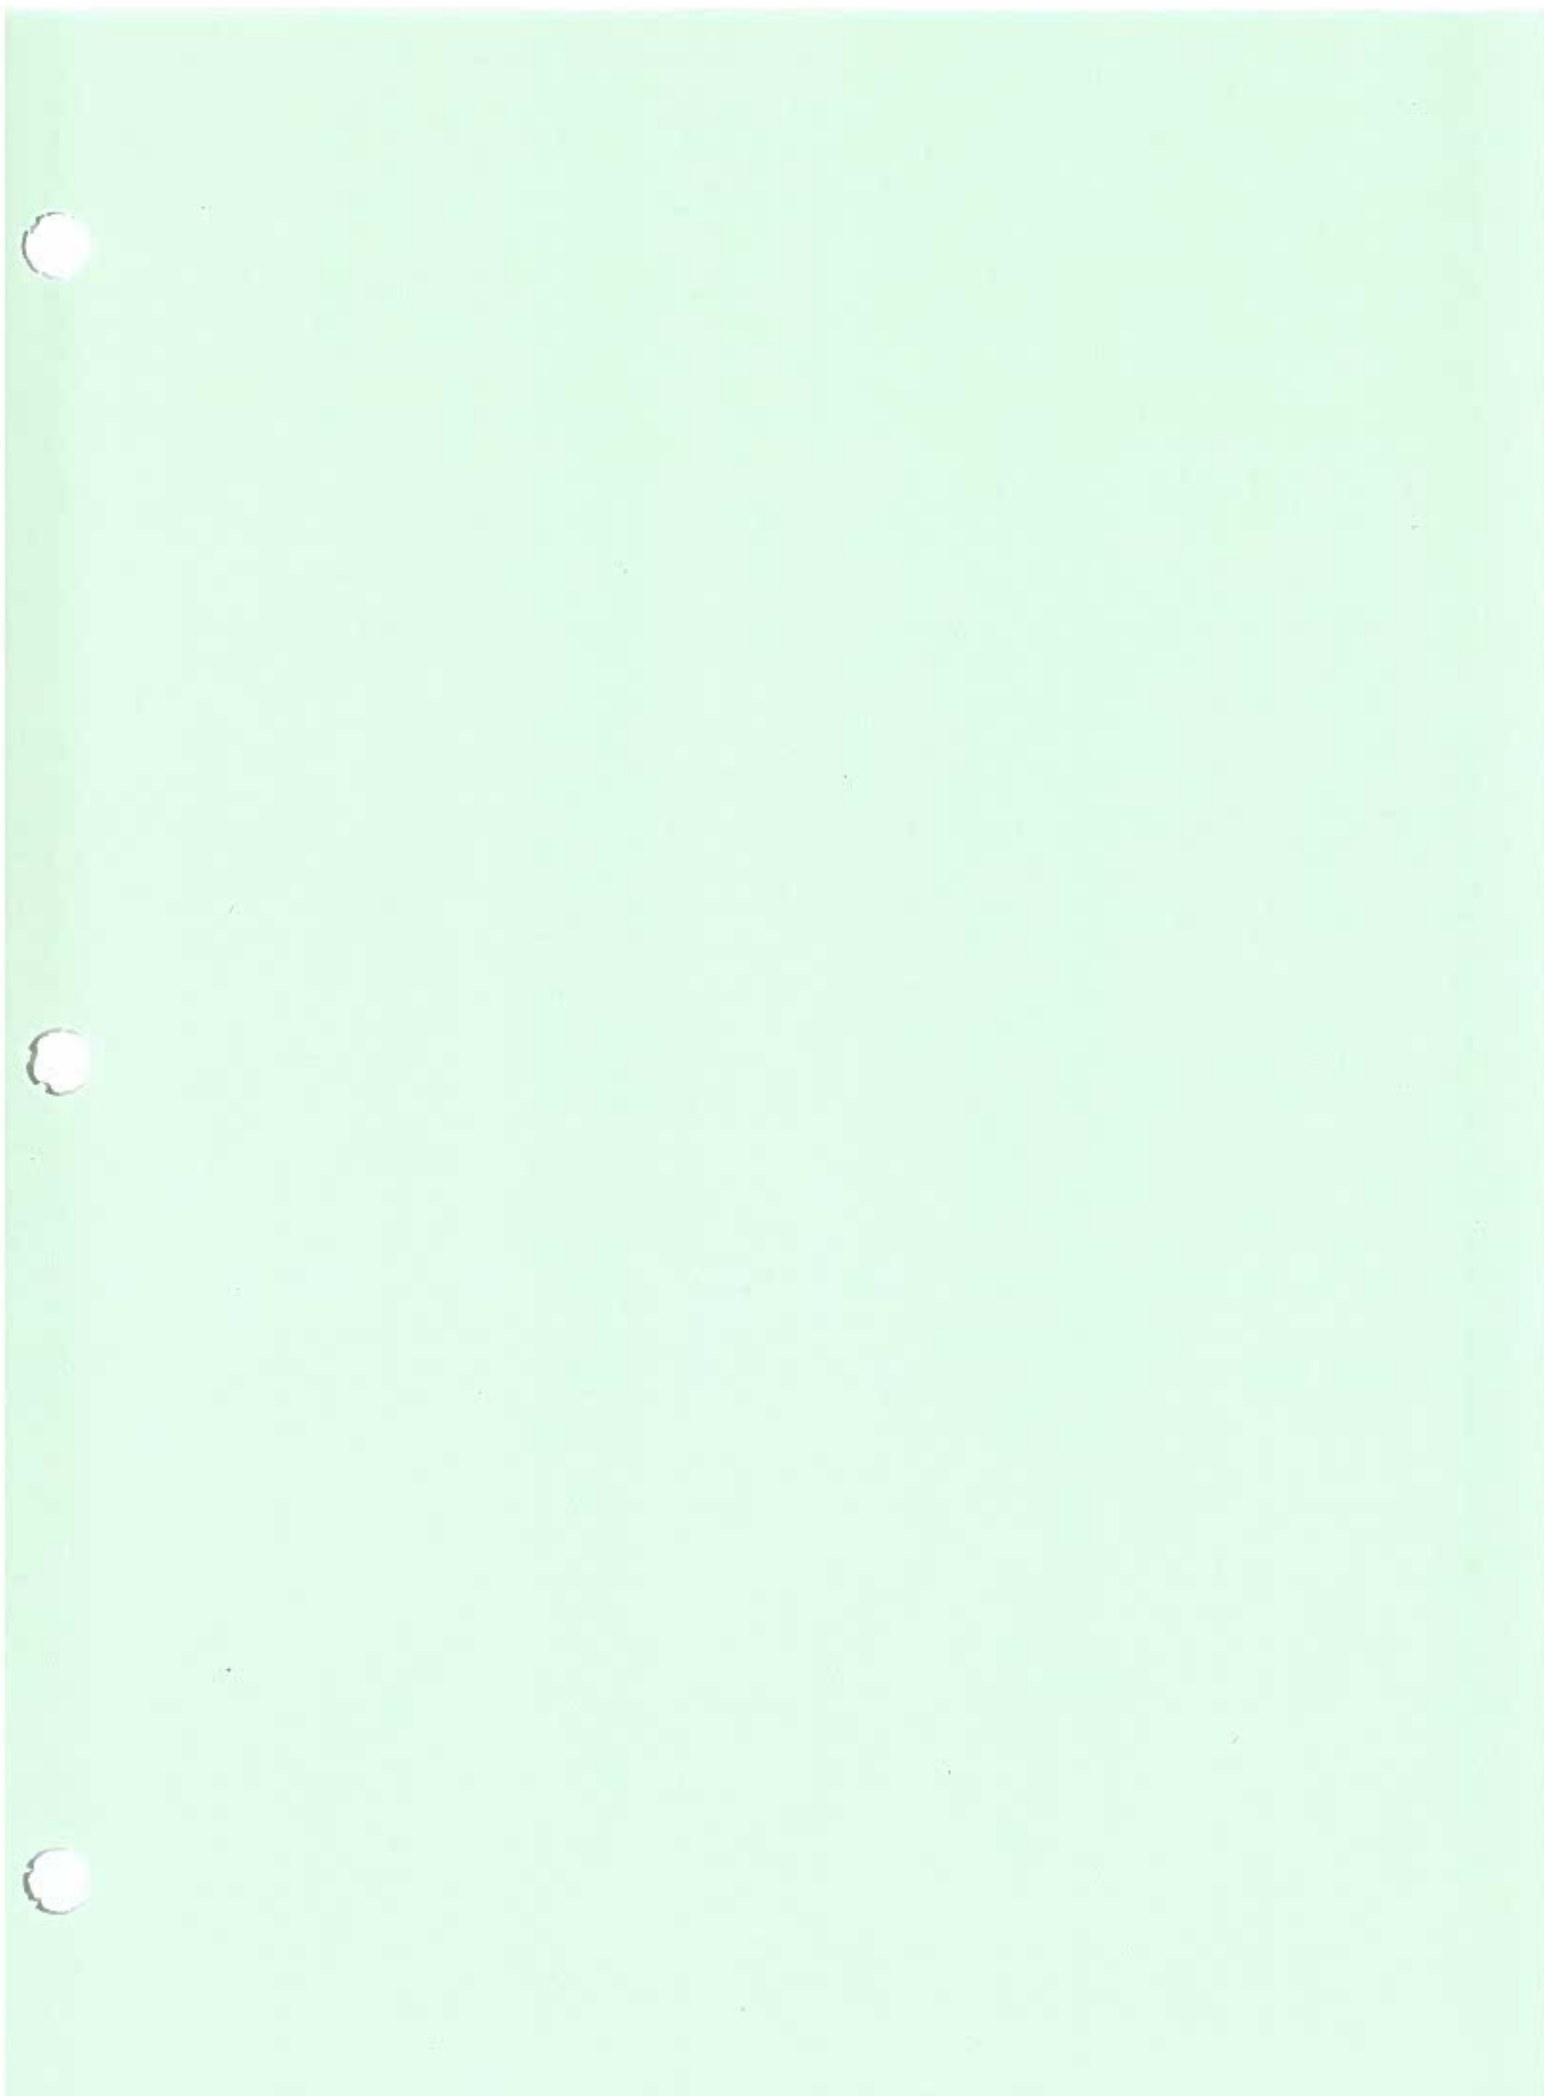

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# 03

Type of Material Miscellaneous Material

Quantity of Material 2,229 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 06/01/1988

Current Surveillance Date 12/08/2003

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Christiaan Sparks

State Indiana

Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

There are missing and damaged pieces in several areas throughout the building. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 12/08/2003

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Christiaan Sparks

State Indiana

Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# B

Type of Material Miscellaneous Material

Quantity of Material Approx. 1,370 SF

Material Location
Throughout the building

Material Description
Cove base mastic

Comments
Where exposed, this material was not in poor condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 12/08/2003

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M


Inspector



Christiaan Sparks

State Indiana

Accreditation Number 190804103

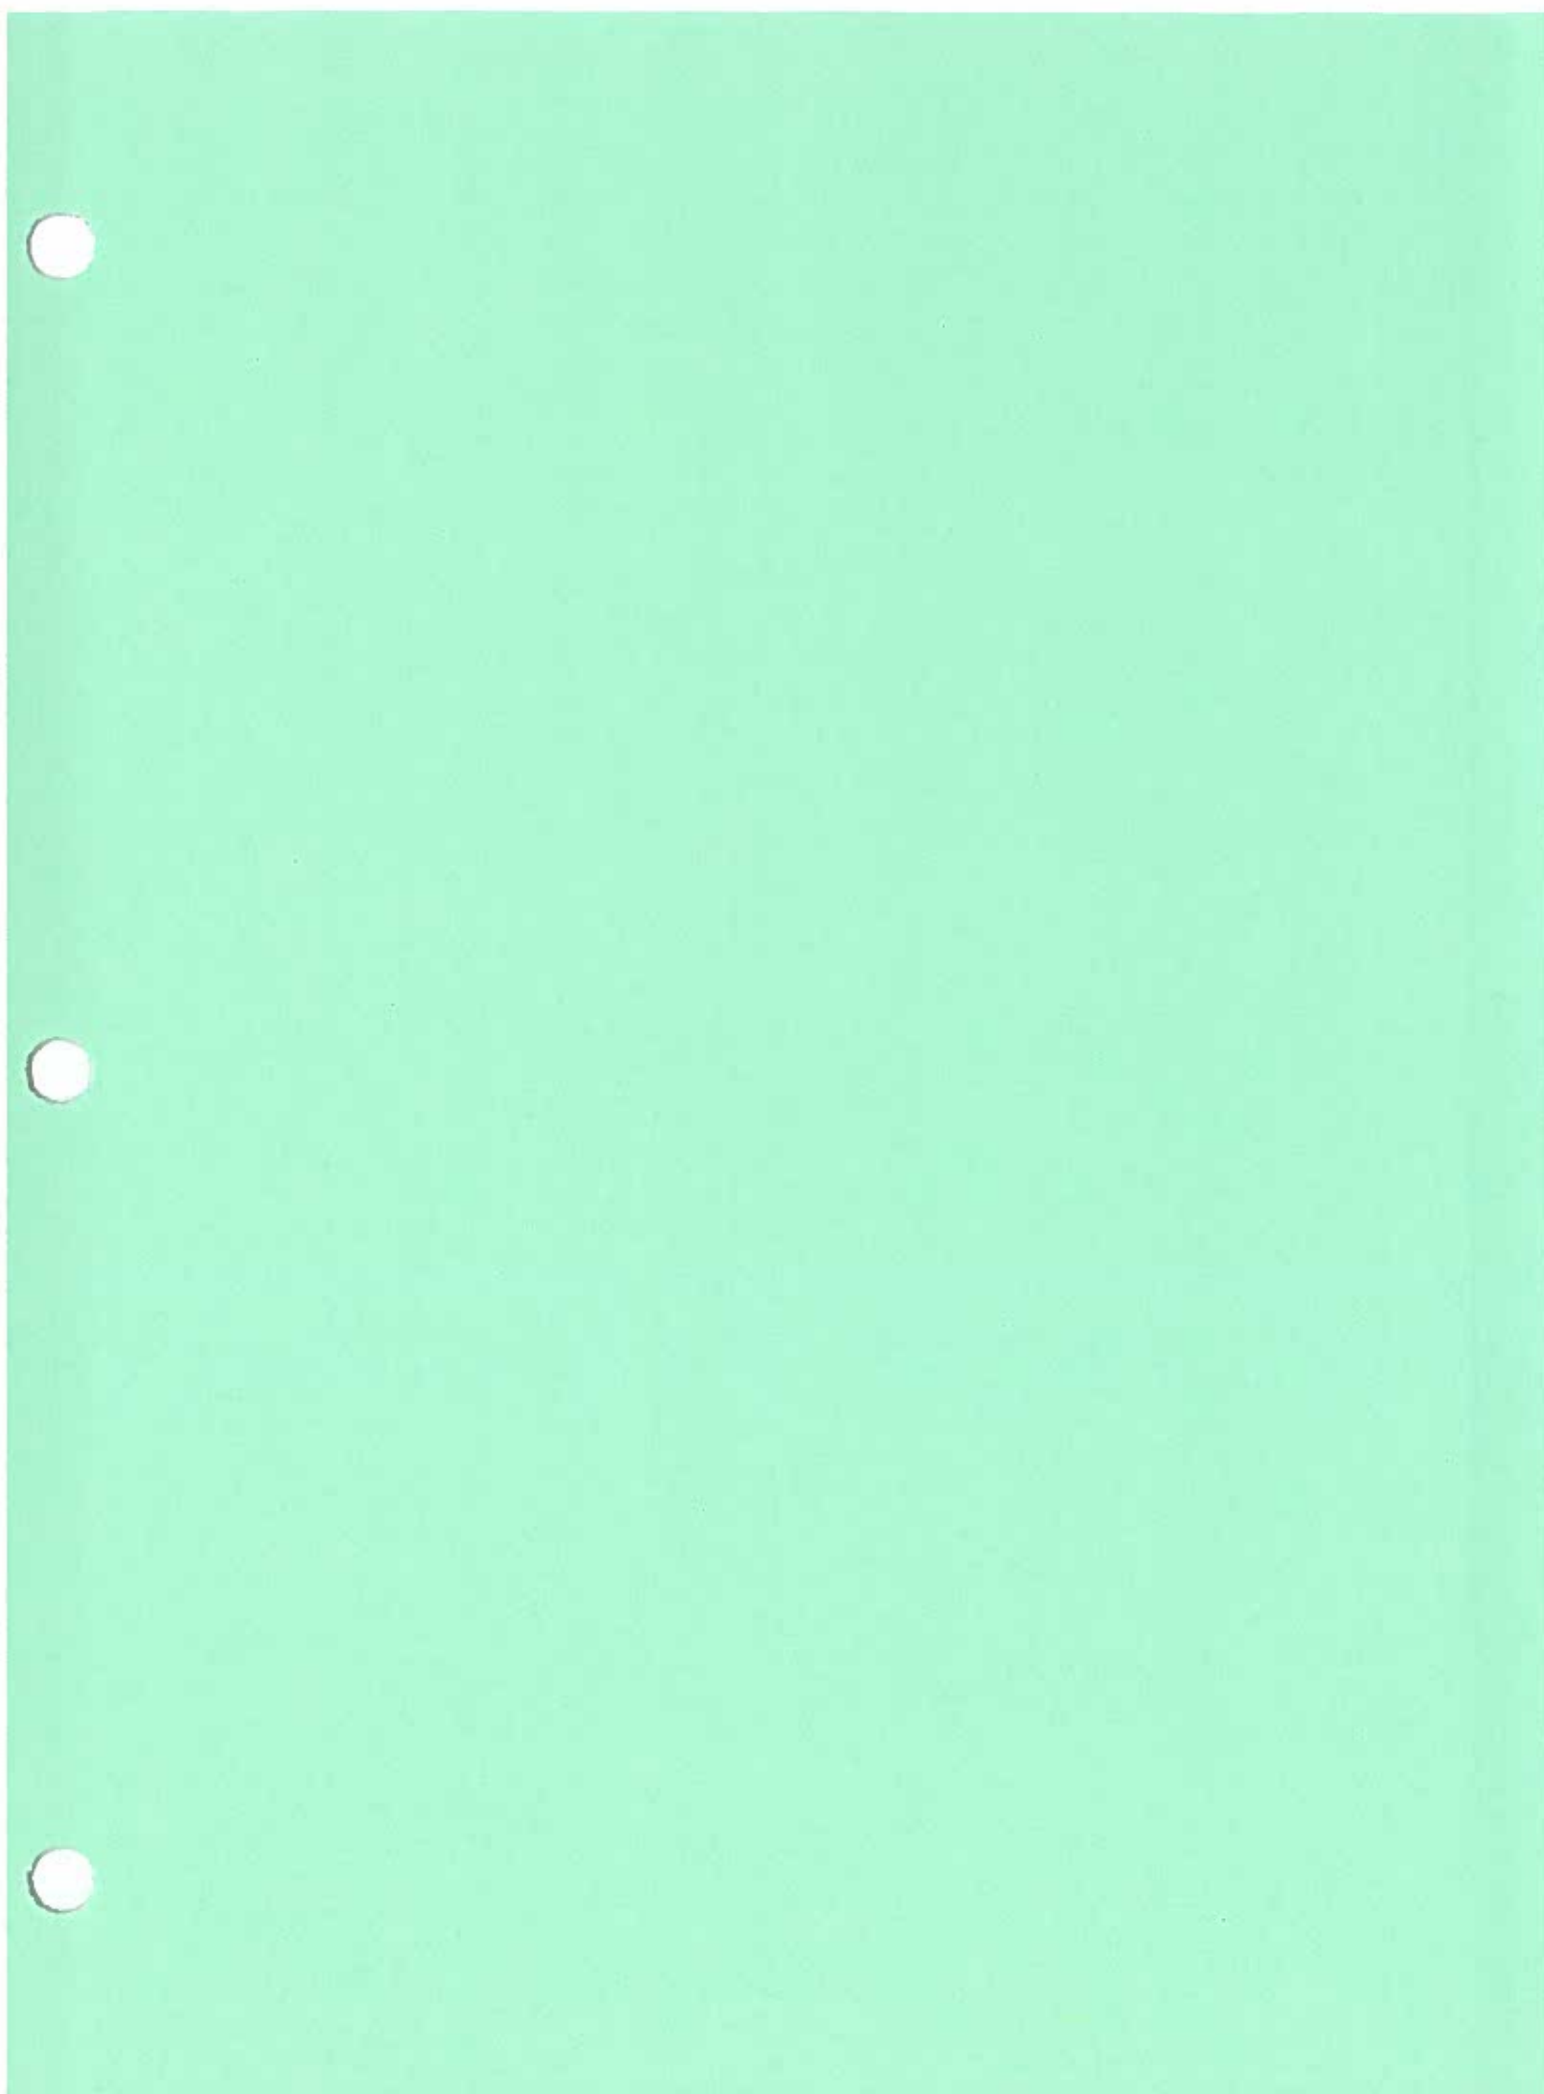

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# 03

Type of Material Miscellaneous Material

Quantity of Material 2,229 SF

Material Location
Throughout the building

Material Description
Floor tile mastic

Comments
This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 06/01/1988

Current Surveillance Date 06/13/2003

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana

Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location
Throughout the building

Material Description
Cove base molding

Comments
There are missing and damaged pieces in several areas throughout the building. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 06/13/2003

Current Assessment Rating NR Not Required

Cause of Damage Physical Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana

Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,370 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/13/2003
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# 03

Type of Material Miscellaneous Material

Quantity of Material 2,229 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 06/01/1988

Current Surveillance Date 12/18/2002

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana

Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

The material in room D-222 was removed non-friable. There is some damage to the remaining material throughout. There are missing pieces in several classrooms throughout the building. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 12/18/2002

Current Assessment Rating NR Not Required

Cause of Damage Physical Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector




Christiaan Sparks

State Indiana

Accreditation Number 190804103

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,370 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/18/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Christiaan Sparks

State Indiana
Accreditation Number 190804103



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2,229 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
No mastic was exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1988
Current Surveillance Date 06/19/2002
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M
Inspector

Richard D. Calvert
State Indiana
Accreditation Number 315989970

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location
Throughout the building

Material Description
Cove base molding

Comments
Material has been removed in room D-222. There is some damage to the material throughout. There are missing pieces in several classrooms throughout the building.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 06/19/2002

Current Assessment Rating NR Not Required

Cause of Damage Physical Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

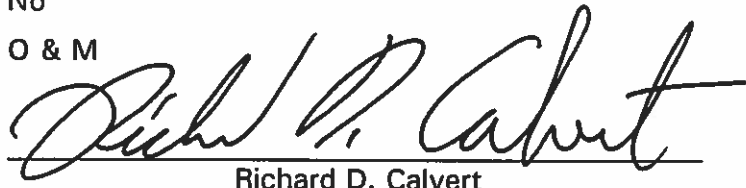

Richard D. Calvert

State Indiana

Accreditation Number 315989970

PERIODIC SURVEILLANCE REPORT

LEA Name	Greater Clark County Schools
Building Name	Charlestown Middle School
HA#	B
Type of Material	Miscellaneous Material
Quantity of Material	Approx. 1,370 SF
Material Location	Throughout the building
Material Description	Cove base mastic
Comments	Material is not in poor condition where exposed.
Does Material Contain Asbestos?	Assumed
Is it Friable?	No
Original Inspection Date	05/31/1995
Current Surveillance Date	06/19/2002
Current Assessment Rating	NR Not Required
Cause of Damage	No Damage
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M
Inspector	 Richard D. Calvert
State	Indiana
Accreditation Number	315989970



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2,229 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
No mastic was exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1988
Current Surveillance Date 12/11/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M
Inspector 
Stephen Kimbrough
State Indiana
Accreditation Number 191914122

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location
Throughout the building

Material Description
Cove base molding

Comments
Material has been removed in room D-222. There is some damage to the material throughout. There are missing pieces in several classrooms throughout the building.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 12/11/2001

Current Assessment Rating NR Not Required

Cause of Damage Physical Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

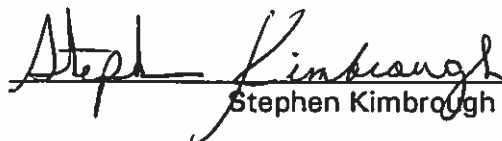
Stephen Kimbrough


State Indiana

Accreditation Number 191914122

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,370 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
Material is not in poor condition where exposed.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/11/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector




Stephen Kimbrough

State

Indiana

Accreditation Number

191914122

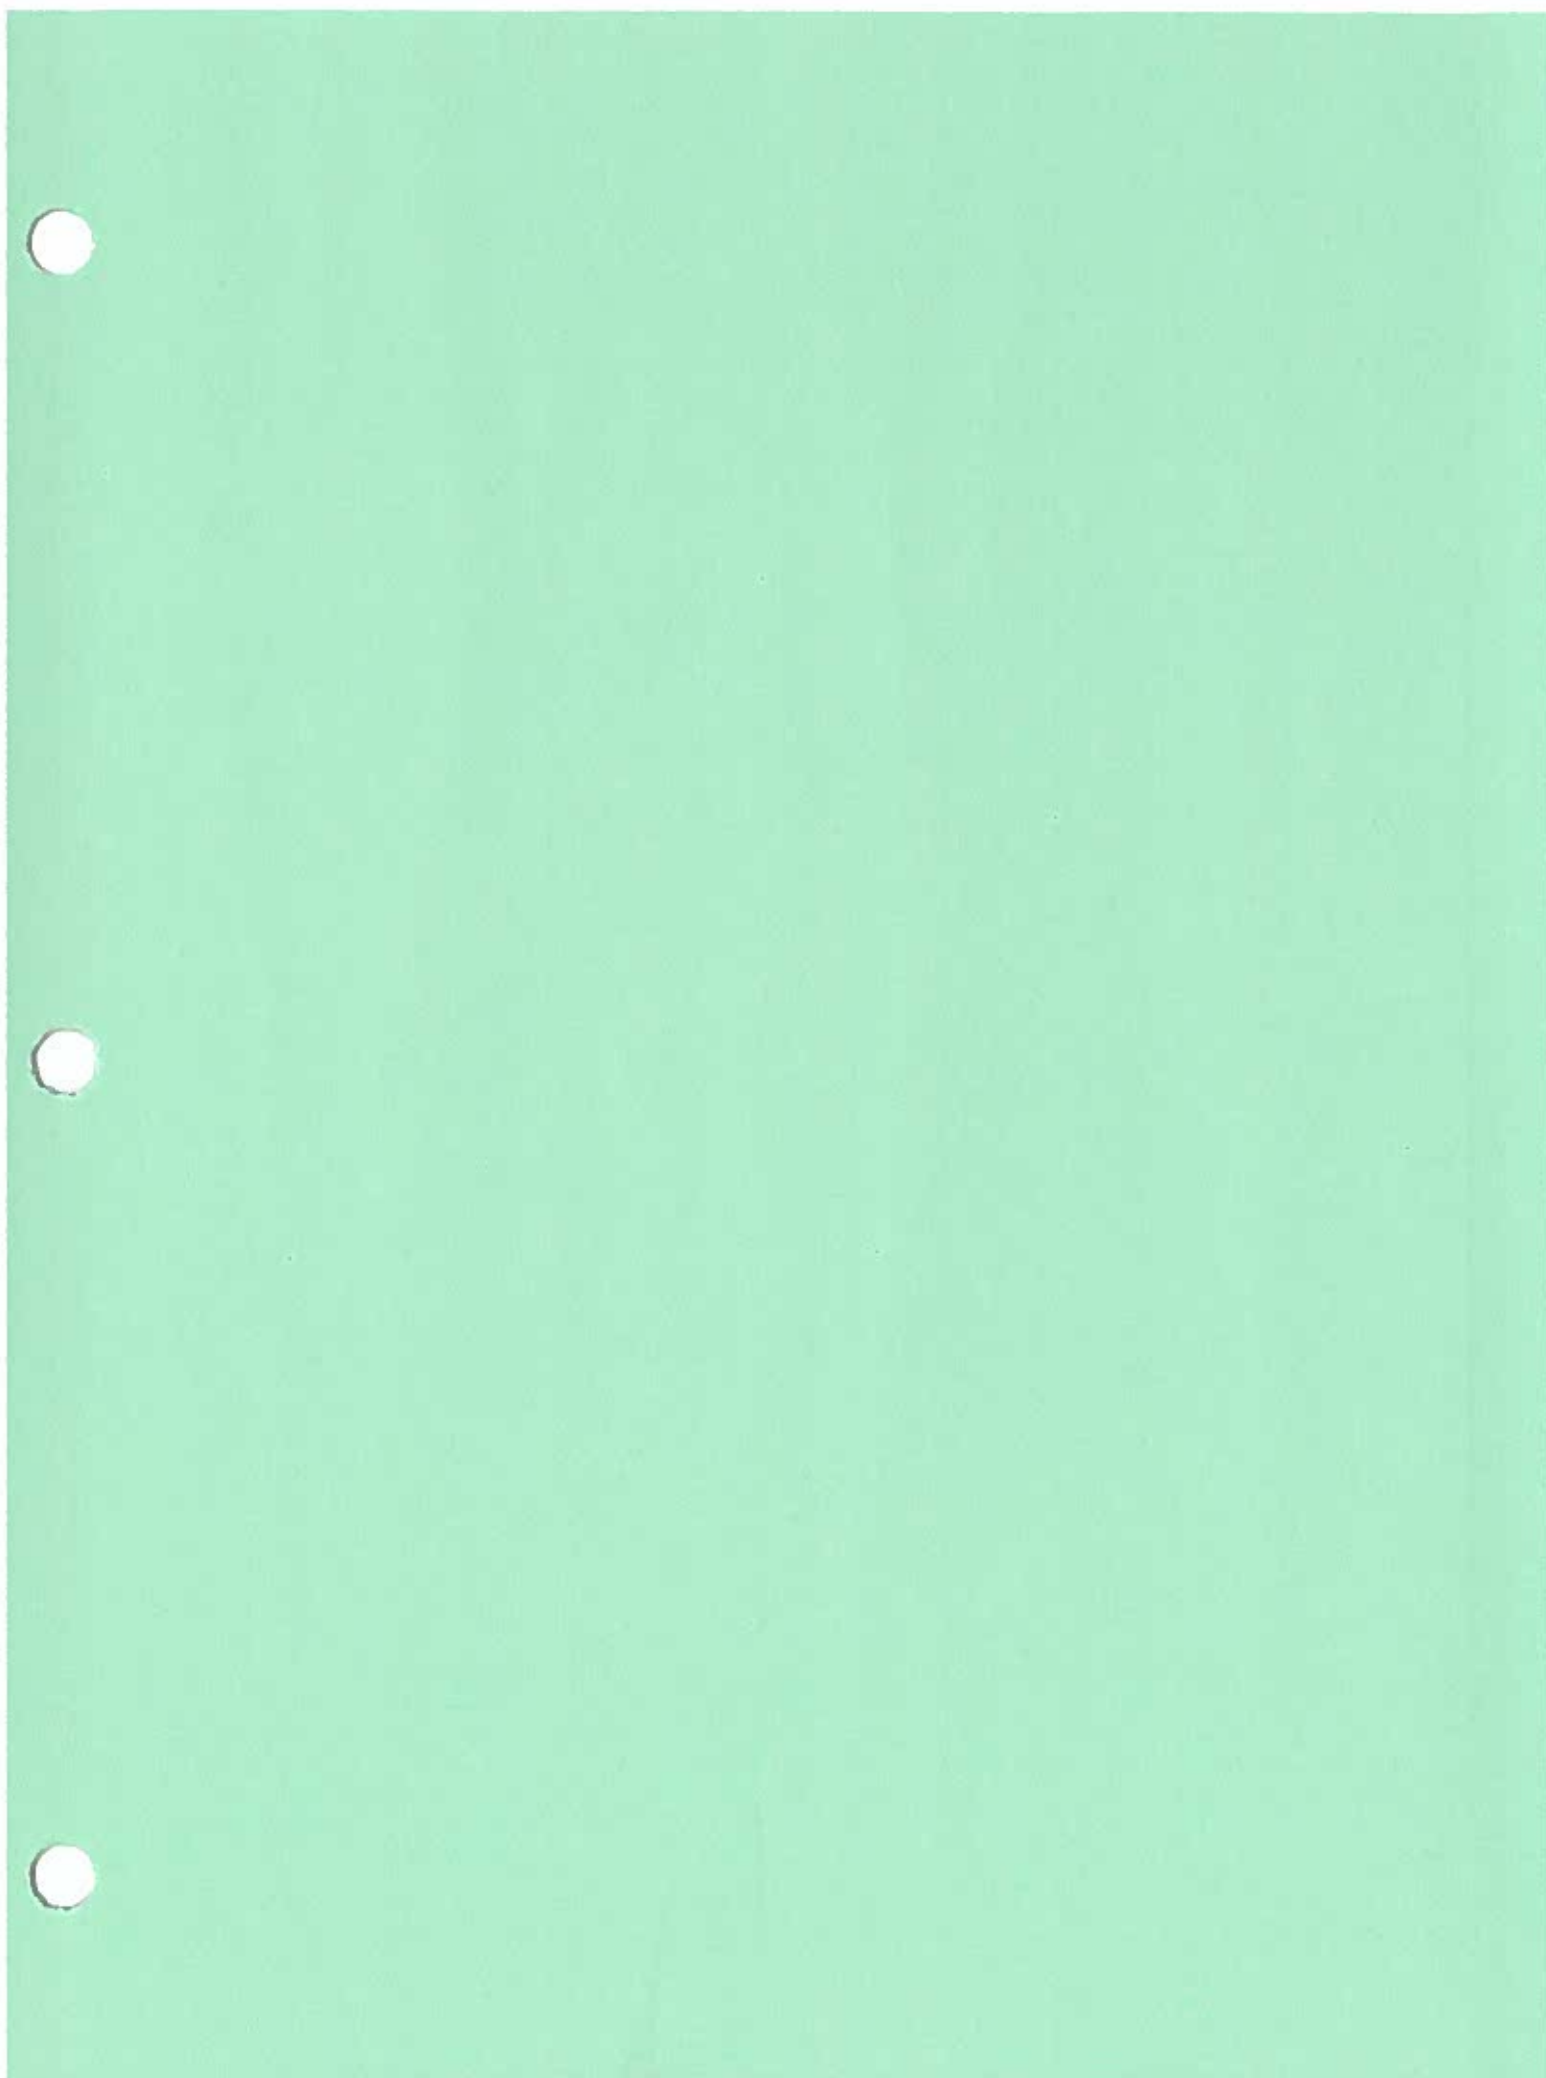

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2,229 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
No mastic was exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1988
Current Surveillance Date 01/11/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Patrick E. Wilson

State Indiana
Accreditation Number 190824065

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building

Material Description

Cove base molding

Comments

Material has been removed in room D-222. There is some damage to the material throughout. There are missing pieces in several classrooms throughout the building.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 01/11/2001

Current Assessment Rating NR Not Required

Cause of Damage Physical Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Patrick E. Wilson

State Indiana

Accreditation Number 190824065

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,370 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
Material is in good condition where exposed.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 01/11/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector 
Patrick E. Wilson

State Indiana
Accreditation Number 190824065



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2,229 SF
Material Location
Throughout the building
Material Description
Floor Tile Mastic
Comments
No mastic was exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1988
Current Surveillance Date 06/29/2000
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector _____

George William Ogle

State Indiana
Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Unquantified LF

Material Location
Throughout the building

Material Description
Cove Base Molding

Comments
Material has been removed in room D-222. There is some damage to the material throughout. There are missing pieces in several classrooms throughout the building.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 06/29/2000

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191523030

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove Base Mastic
Comments
Material is in good condition where exposed.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/29/2000
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector _____

George William Ogle

State Indiana
Accreditation Number 191523030



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2229 SF
Material Location
Throughout the building
Material Description
Floor Tile Mastic
Comments
No exposed material found. Assumed to be in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1988
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Unquantified LF

Material Location

Throughout the building

Material Description

Cove Base Molding

Comments

Material has been removed in room D-222. There is some damage to the material in the gymnasium. There are missing pieces in some classrooms.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 12/08/1999

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Matthew Wallace

State Indiana

Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove Base Mastic
Comments
Some exposure found, but material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 12/08/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Matthew Wallace

State Indiana
Accreditation Number 191219020



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2229 SF
Material Location
Throughout the building
Material Description
Floor Tile Mastic
Comments
No exposed material found. Assumed to be in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1988
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Matthew Wallace

State Indiana
Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Unquantified LF

Material Location
Throughout the building

Material Description
Cove Base Molding

Comments
Material has been removed in room D-222. There is some damage to the material in the gymnasium. There are missing pieces in some classrooms.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 06/24/1999

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Matthew Wallace

State Indiana

Accreditation Number 191219020

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Unquantified LF
Material Location
Throughout the building
Material Description
Cove Base Mastic
Comments
Some exposure found, but material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Surveillance Date 06/24/1999
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

Matthew Wallace

State Indiana
Accreditation Number 191219020



PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# 03

Type of Material Miscellaneous Material

Quantity of Material 2229 SF

Material Location
Throughout the building

Material Description
Floor Tile Mastic

Comments
No exposed material found. Assumed to be in good condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 06/01/1988

Current Surveillance Date 12/29/1998

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

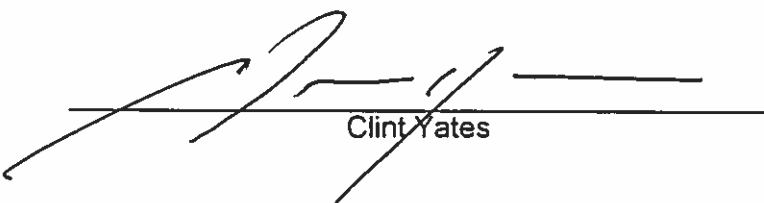
Clint Yates

State Indiana

Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Unquantified LF

Material Location
Throughout the building

Material Description
Cove Base Molding

Comments

Material has been removed in room D-222. There is some damage to the material in the gymnasium. There are missing pieces in some classrooms.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 12/29/1998

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Clint Yates

State Indiana

Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# B

Type of Material Miscellaneous Material

Quantity of Material Unquantified LF

Material Location
Throughout the building

Material Description
Cove Base Mastic

Comments
Some exposure found, but material is in good condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Surveillance Date 12/29/1998

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M


Inspector

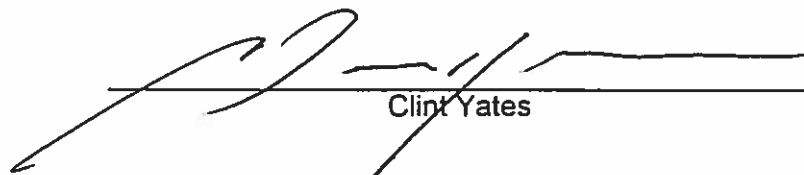

Clint Yates

State Indiana

Accreditation Number 193804035

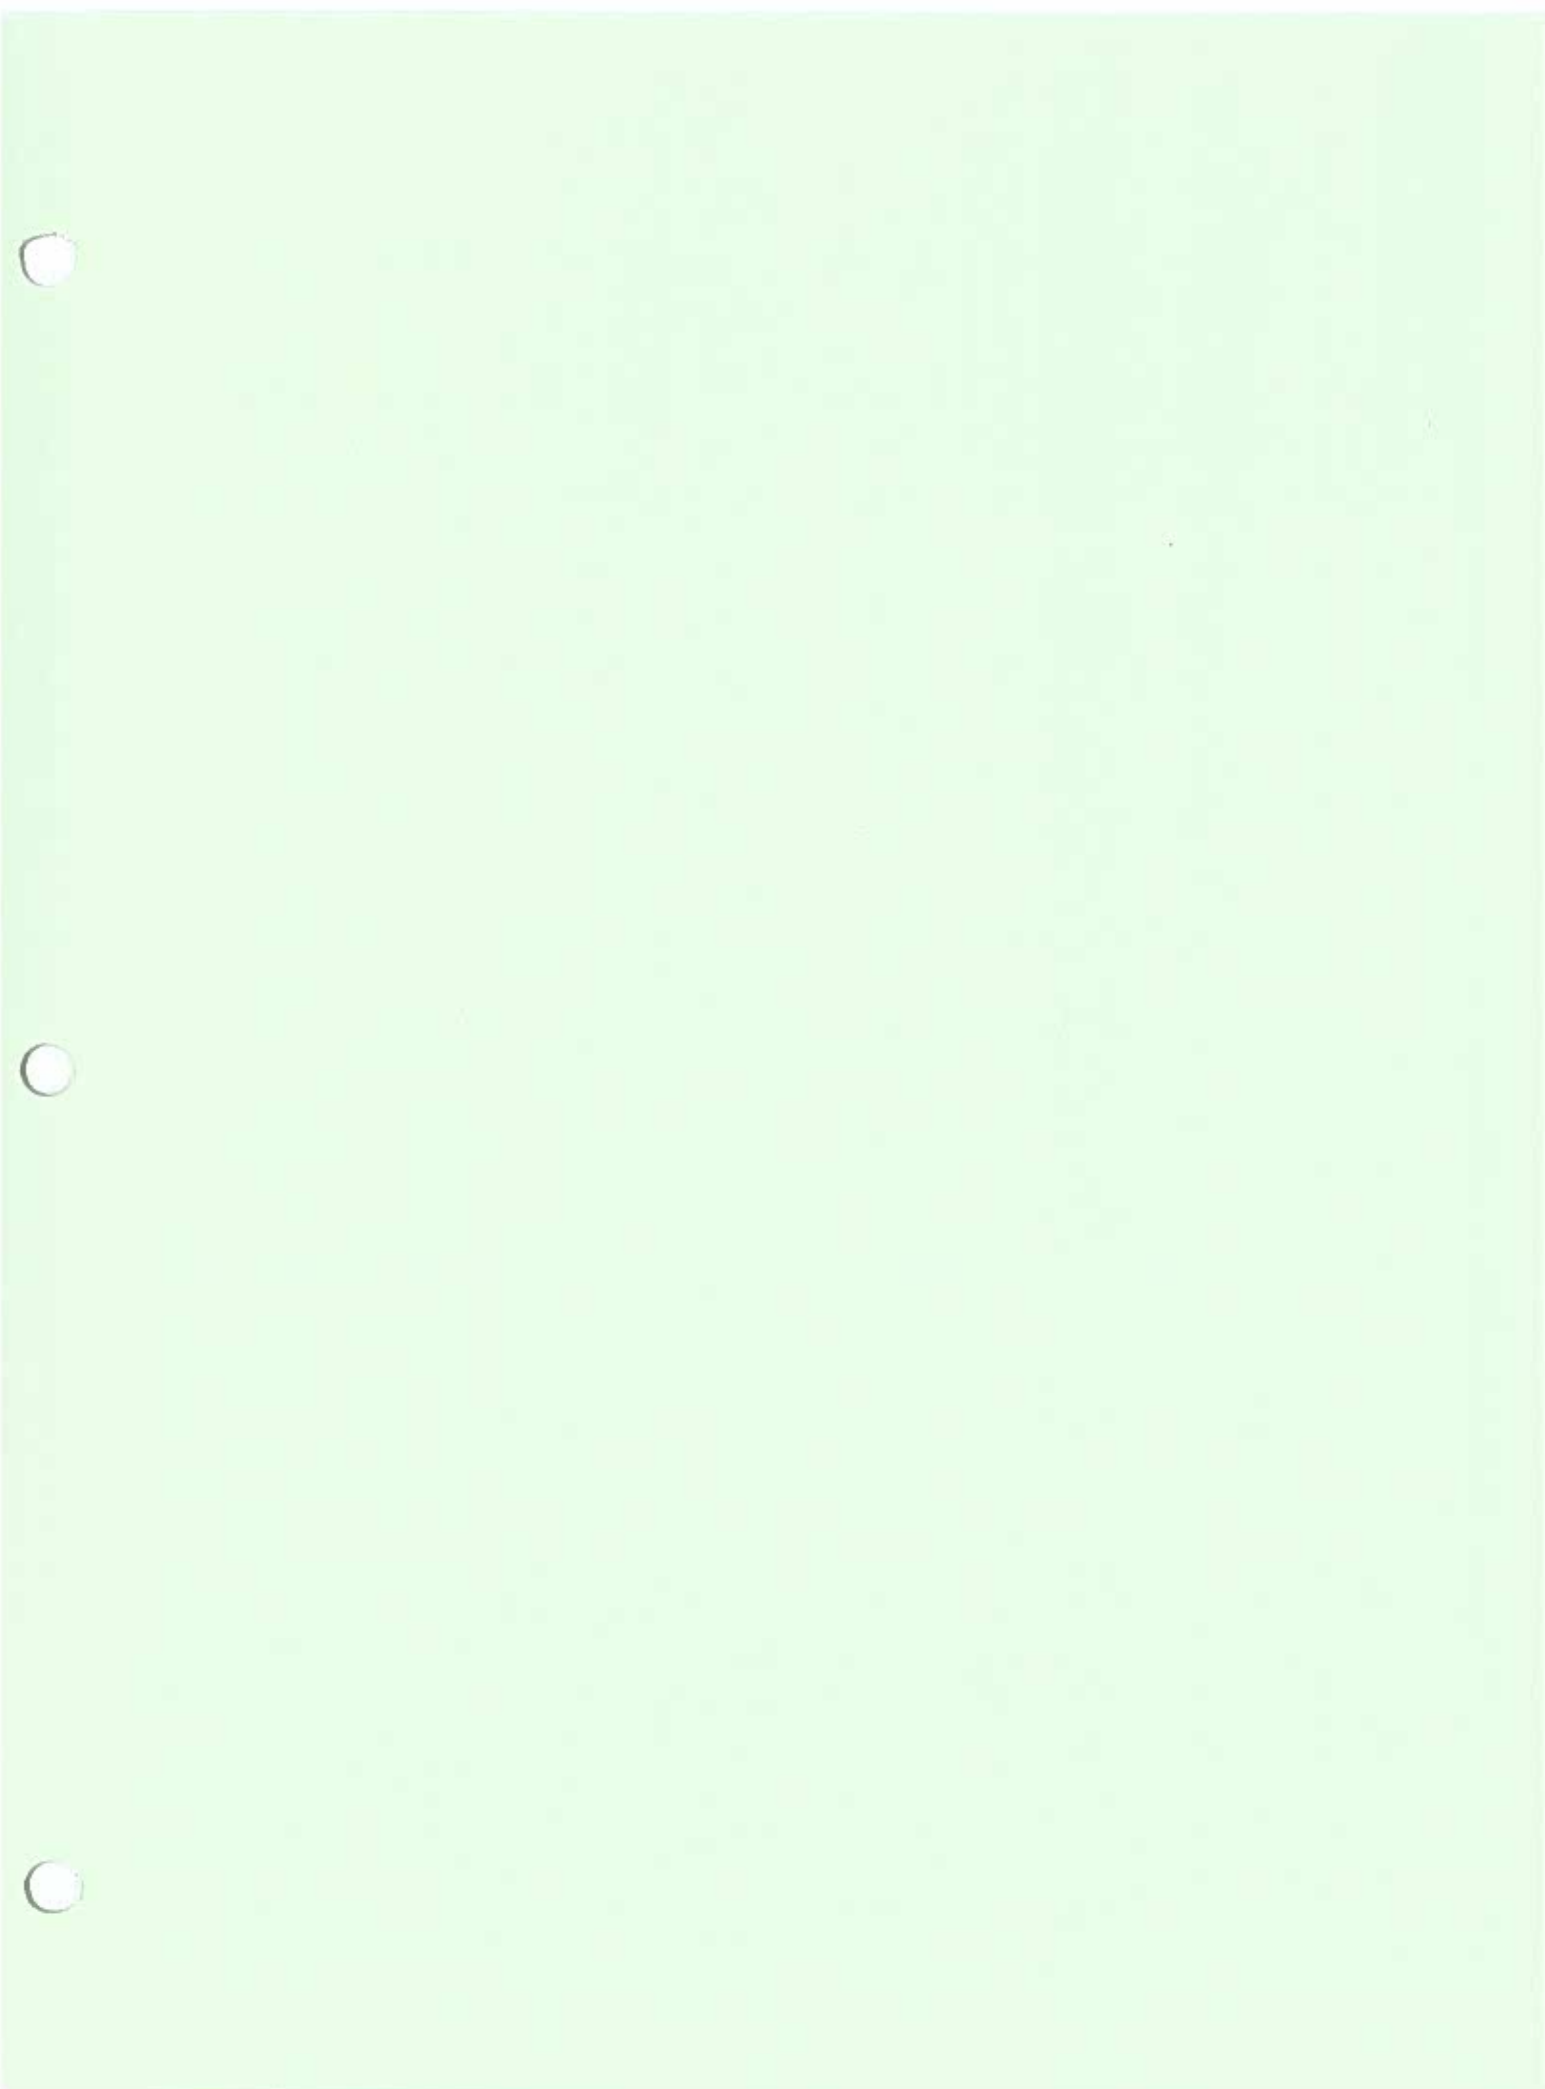

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2,229 SF
Material Location
Throughout the building
Material Description
Floor Tile Mastic
Comments
No exposed material found. Assumed to be in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/ 1/88
Current Surveillance Date 1/15/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material LF

Material Location
Throughout the building

Material Description
Cove Base Molding

Comments

Material has been removed in room D-222. There is some damage to the material in the gymnasium. There are missing pieces in some classrooms.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/95

Current Surveillance Date 1/15/98

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Karen Foxx

State Indiana

Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout the building
Material Description
Cove Base Mastic
Comments
Some exposure found, but material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 1/15/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT


LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Each
Material Location
Boiler Room
Material Description
Boiler Gaskets
Comments
Material has been removed.
Does Material Contain Asbestos? No
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 1/15/98
Current Assessment Rating NA Not Applicable
Cause of Damage Not Applicable
Accessible No
Potential for Damage NA
Removed Yes
Planned Response Action None

Inspector



Karen Foyx


State Indiana
Accreditation Number 191129014

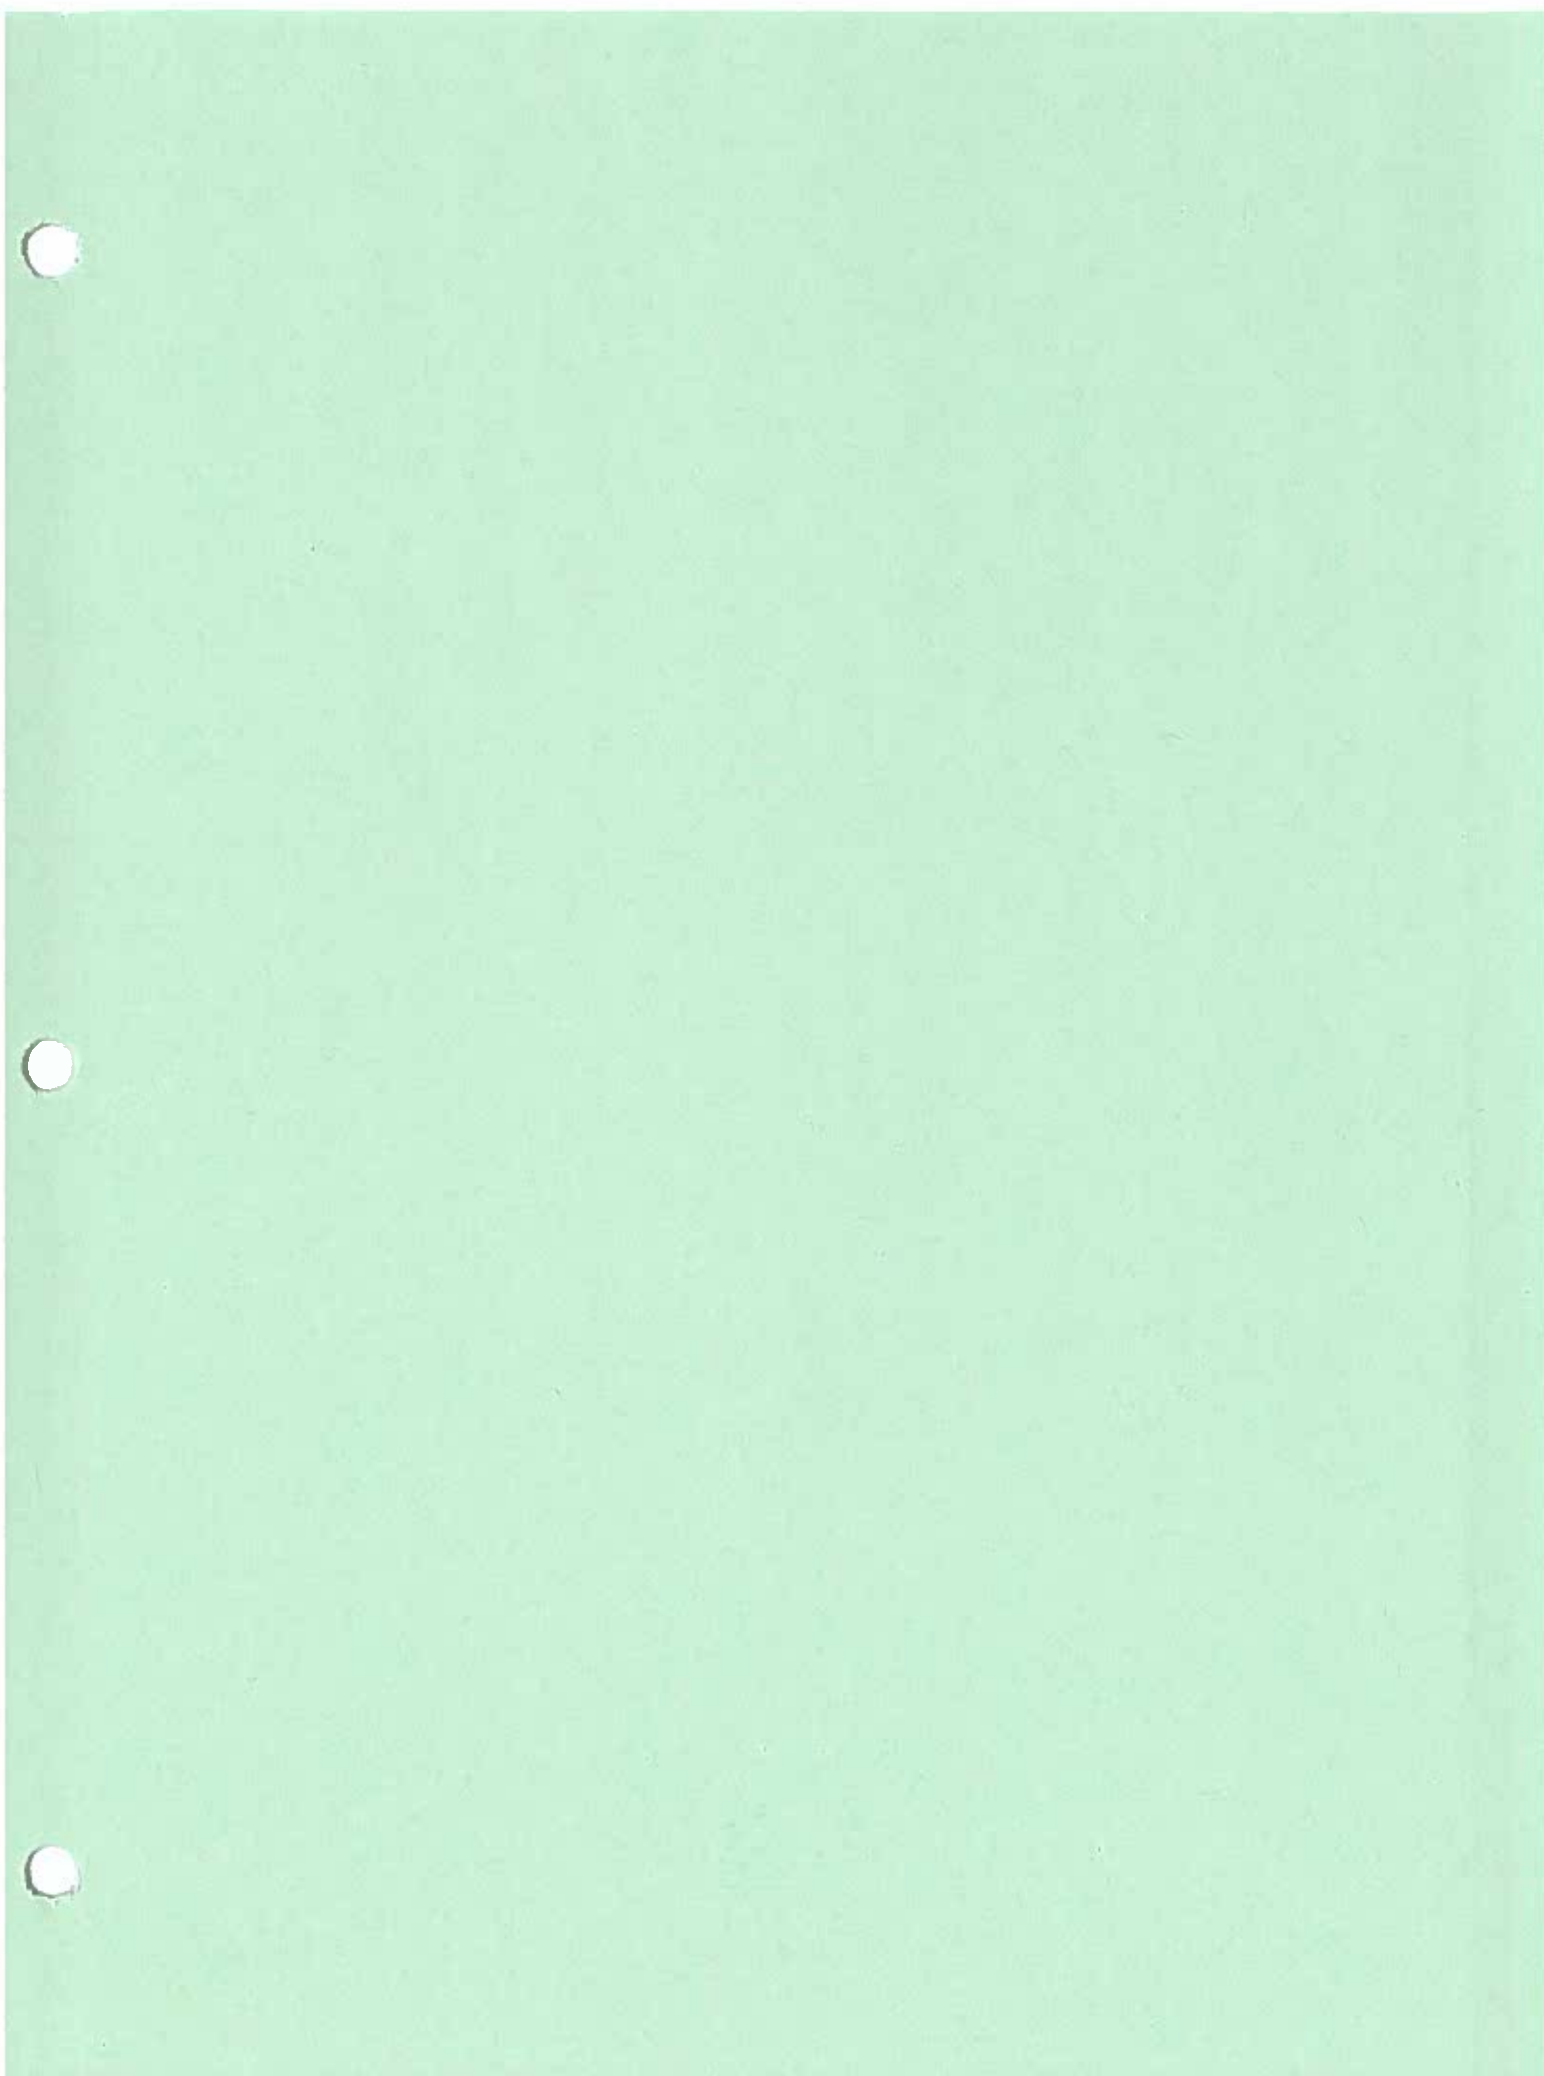

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2,229 SF
Material Location
Throughout the building
Material Description
Floor Tile Mastic
Comments
No exposed material found. Assumed to be in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/ 1/88
Current Surveillance Date 7/ 2/97
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material LF

Material Location
Throughout the building

Material Description
Cove Base Molding

Comments

Material has been removed in room D-222. There is some damage to the material in the gymnasium. There are missing pieces in some classrooms.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/95

Current Surveillance Date 7/ 2/97

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

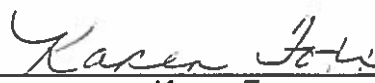

Karen Foxx

State Indiana

Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout the building
Material Description
Cove Base Mastic
Comments
Some exposure found, but material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 7/ 2/97
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State Indiana
Accreditation Number 191129014

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# C
Type of Material Miscellaneous Material
Quantity of Material Each
Material Location
Boiler Room
Material Description
Boiler Gaskets
Comments
Boiler being removed at time of surveillance by accredited contractor.
Does Material Contain Asbestos? Yes
Is it Friable? No
Original Inspection Date 5/31/95
Current Surveillance Date 7/ 2/97
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Karen Foxx

State

Indiana

Accreditation Number

191129014




PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2,229 SF
Material Location
Throughout the building
Material Description
Floor Tile Mastic
Comments
Material is assumed to contain asbestos. No change.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/ 1/88
Current Surveillance Date 12/16/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

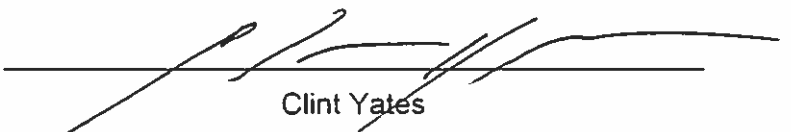
Clint Yates

State

Indiana

Accreditation Number

193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material LF

Material Location

Throughout the building

Material Description

Cove Base Molding

Comments

Good Condition. Material was not addressed in the original inspection and is assumed to contain asbestos. No change.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/95

Current Surveillance Date 12/16/96

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Clint Yates

State Indiana

Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# B

Type of Material Miscellaneous Material

Quantity of Material LF

Material Location
Throughout the building

Material Description
Cove Base Mastic

Comments
Good Condition. Material was not addressed in the original inspection and is assumed to be asbestos containing. No change.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/95

Current Surveillance Date 12/16/96

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

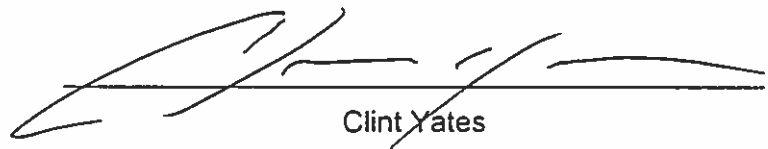

Clint Yates

State Indiana

Accreditation Number 193804035

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# C

Type of Material Miscellaneous Material

Quantity of Material Each

Material Location
Boiler Room

Material Description
Boiler Gaskets

Comments

Good condition. Material was not addressed in the original inspection and is assumed to be asbestos containing. No change.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/95

Current Surveillance Date 12/16/96

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M


Inspector



Clint Yates

State Indiana

Accreditation Number 193804035

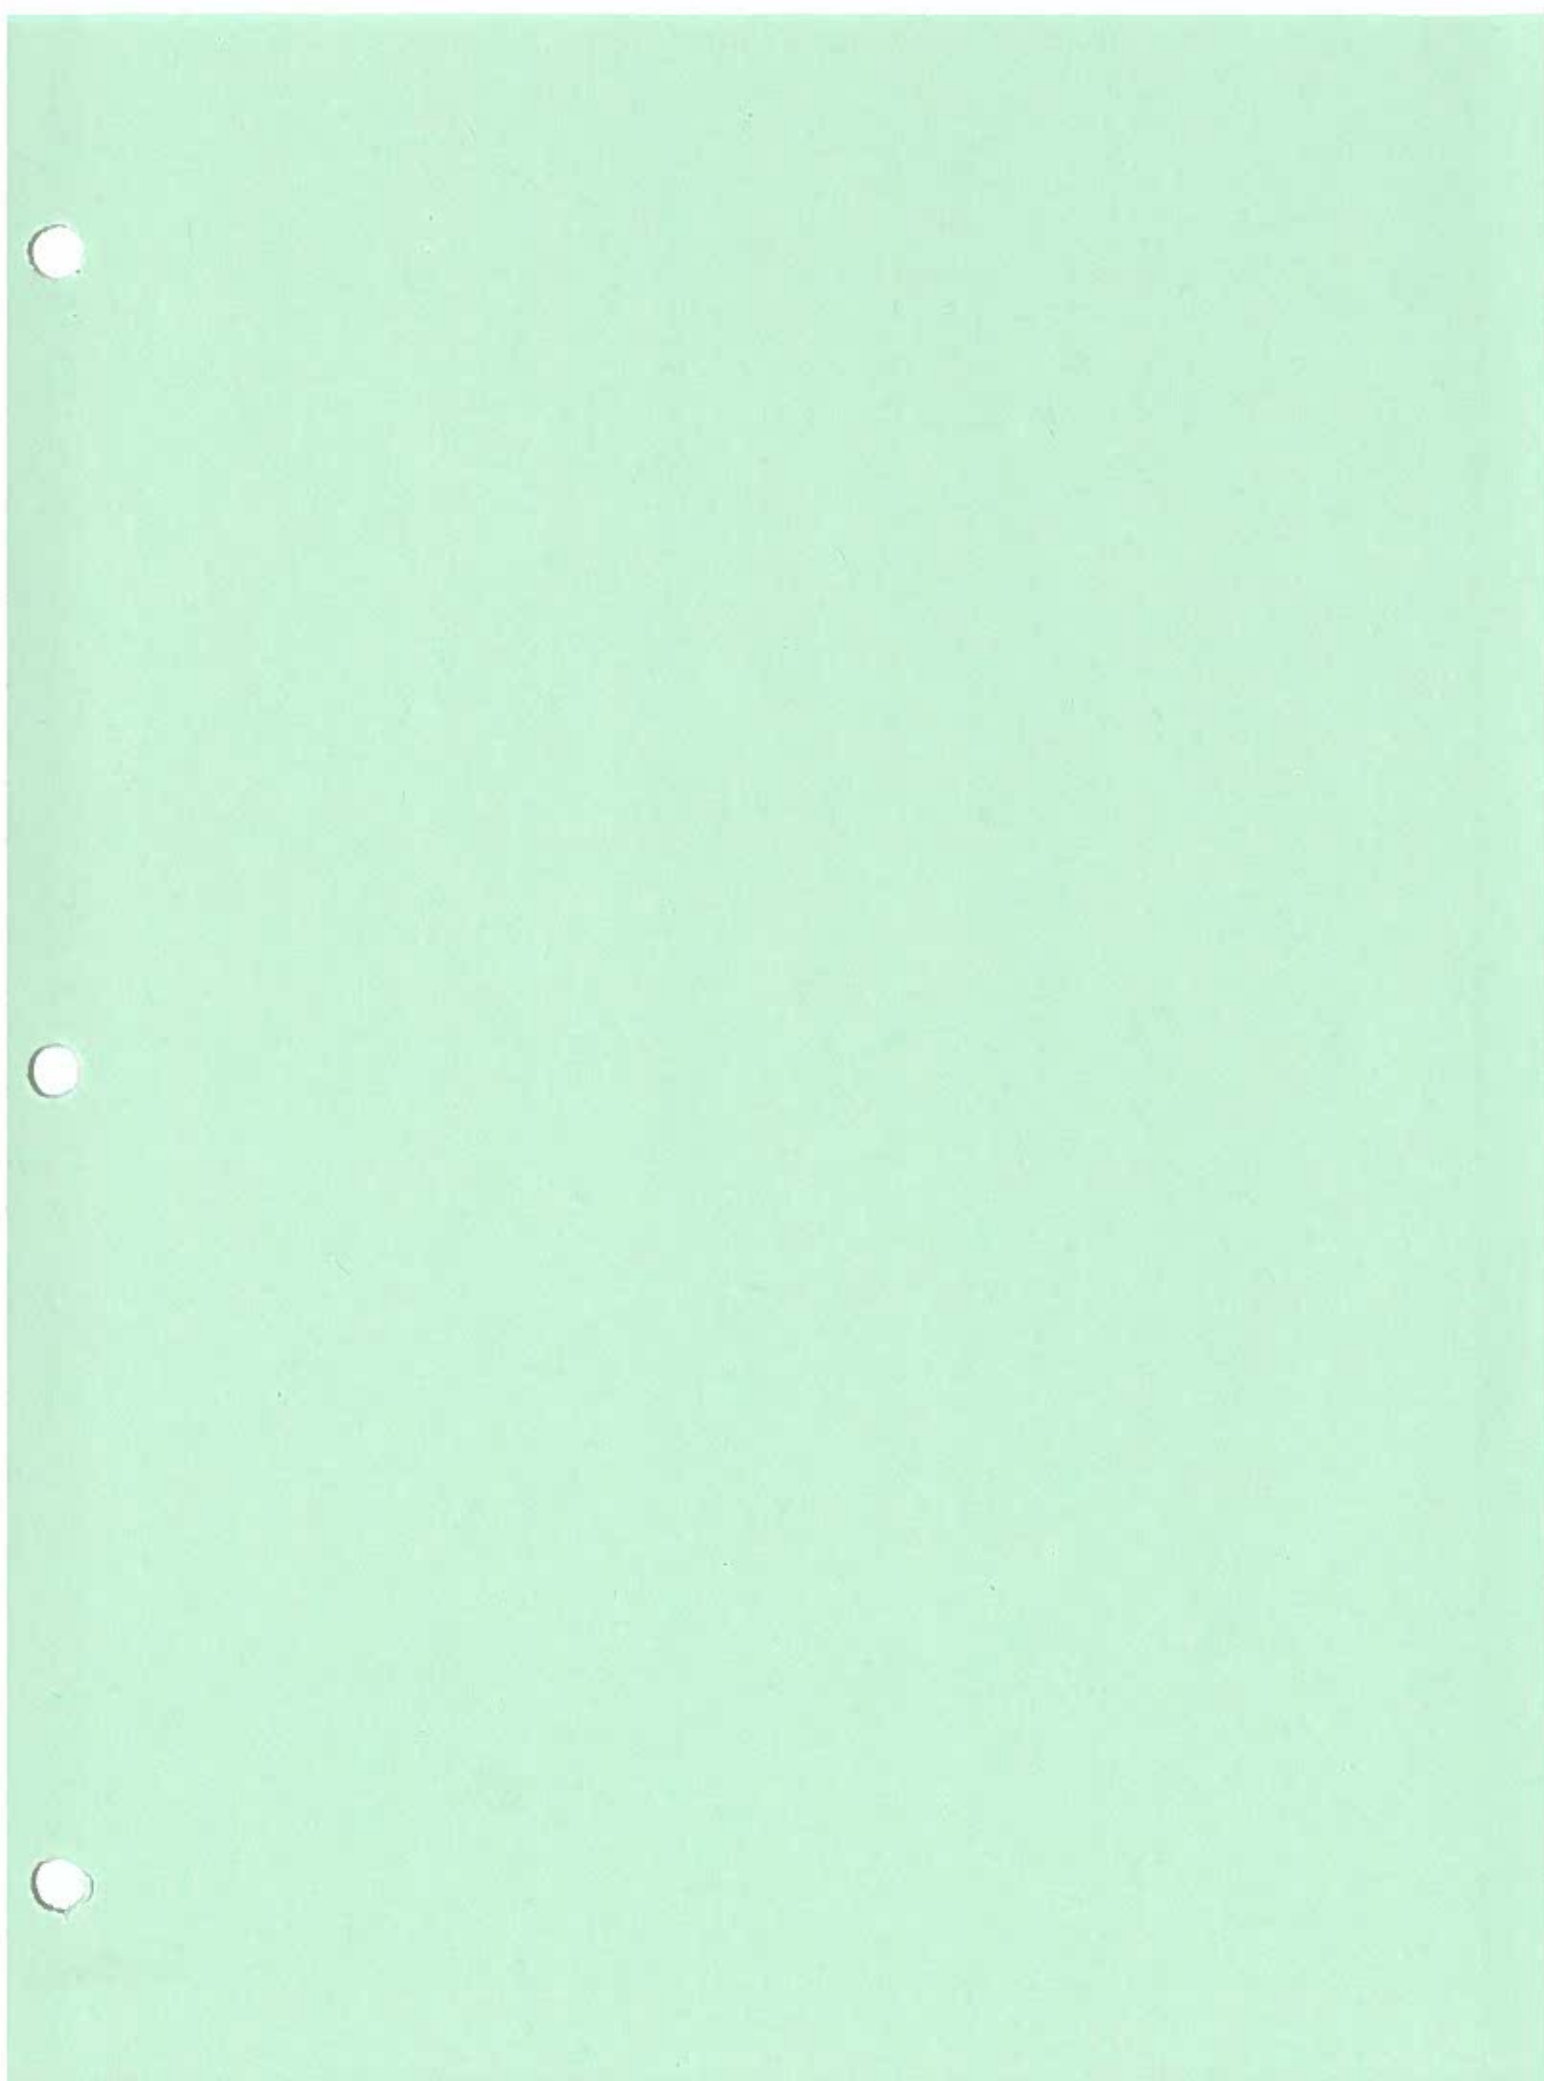


PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2,229 SF
Material Location
Throughout the building
Material Description
Floor Tile Mastic
Comments
Material is assumed to contain asbestos. No change.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/ 1/88
Current Surveillance Date 6/20/96
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Rex Gaddis

State Indiana
Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material LF

Material Location
Throughout the building

Material Description
Cove Base Molding

Comments

Good Condition. Material was not addressed in the original inspection and is assumed to contain asbestos. No change.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/95

Current Surveillance Date 6/20/96

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

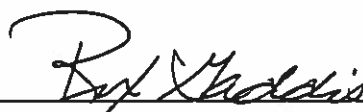

Rex Gaddis

State Indiana

Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# B

Type of Material Miscellaneous Material

Quantity of Material LF

Material Location

Throughout the building

Material Description

Cove Base Mastic

Comments

Good Condition. Material was not addressed in the original inspection and is assumed to be asbestos containing. No change.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/95

Current Surveillance Date 6/20/96

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Rex Gaddis

State Indiana

Accreditation Number 190908032

PERIODIC SURVEILLANCE REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# C

Type of Material Miscellaneous Material

Quantity of Material Each

Material Location
Boiler Room

Material Description
Boiler Gaskets

Comments

Good condition. Material was not addressed in the original inspection and is assumed to be asbestos containing. No change.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/95

Current Surveillance Date 6/20/96

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M


Inspector

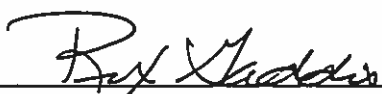

Rex Gaddis

State Indiana

Accreditation Number 190908032

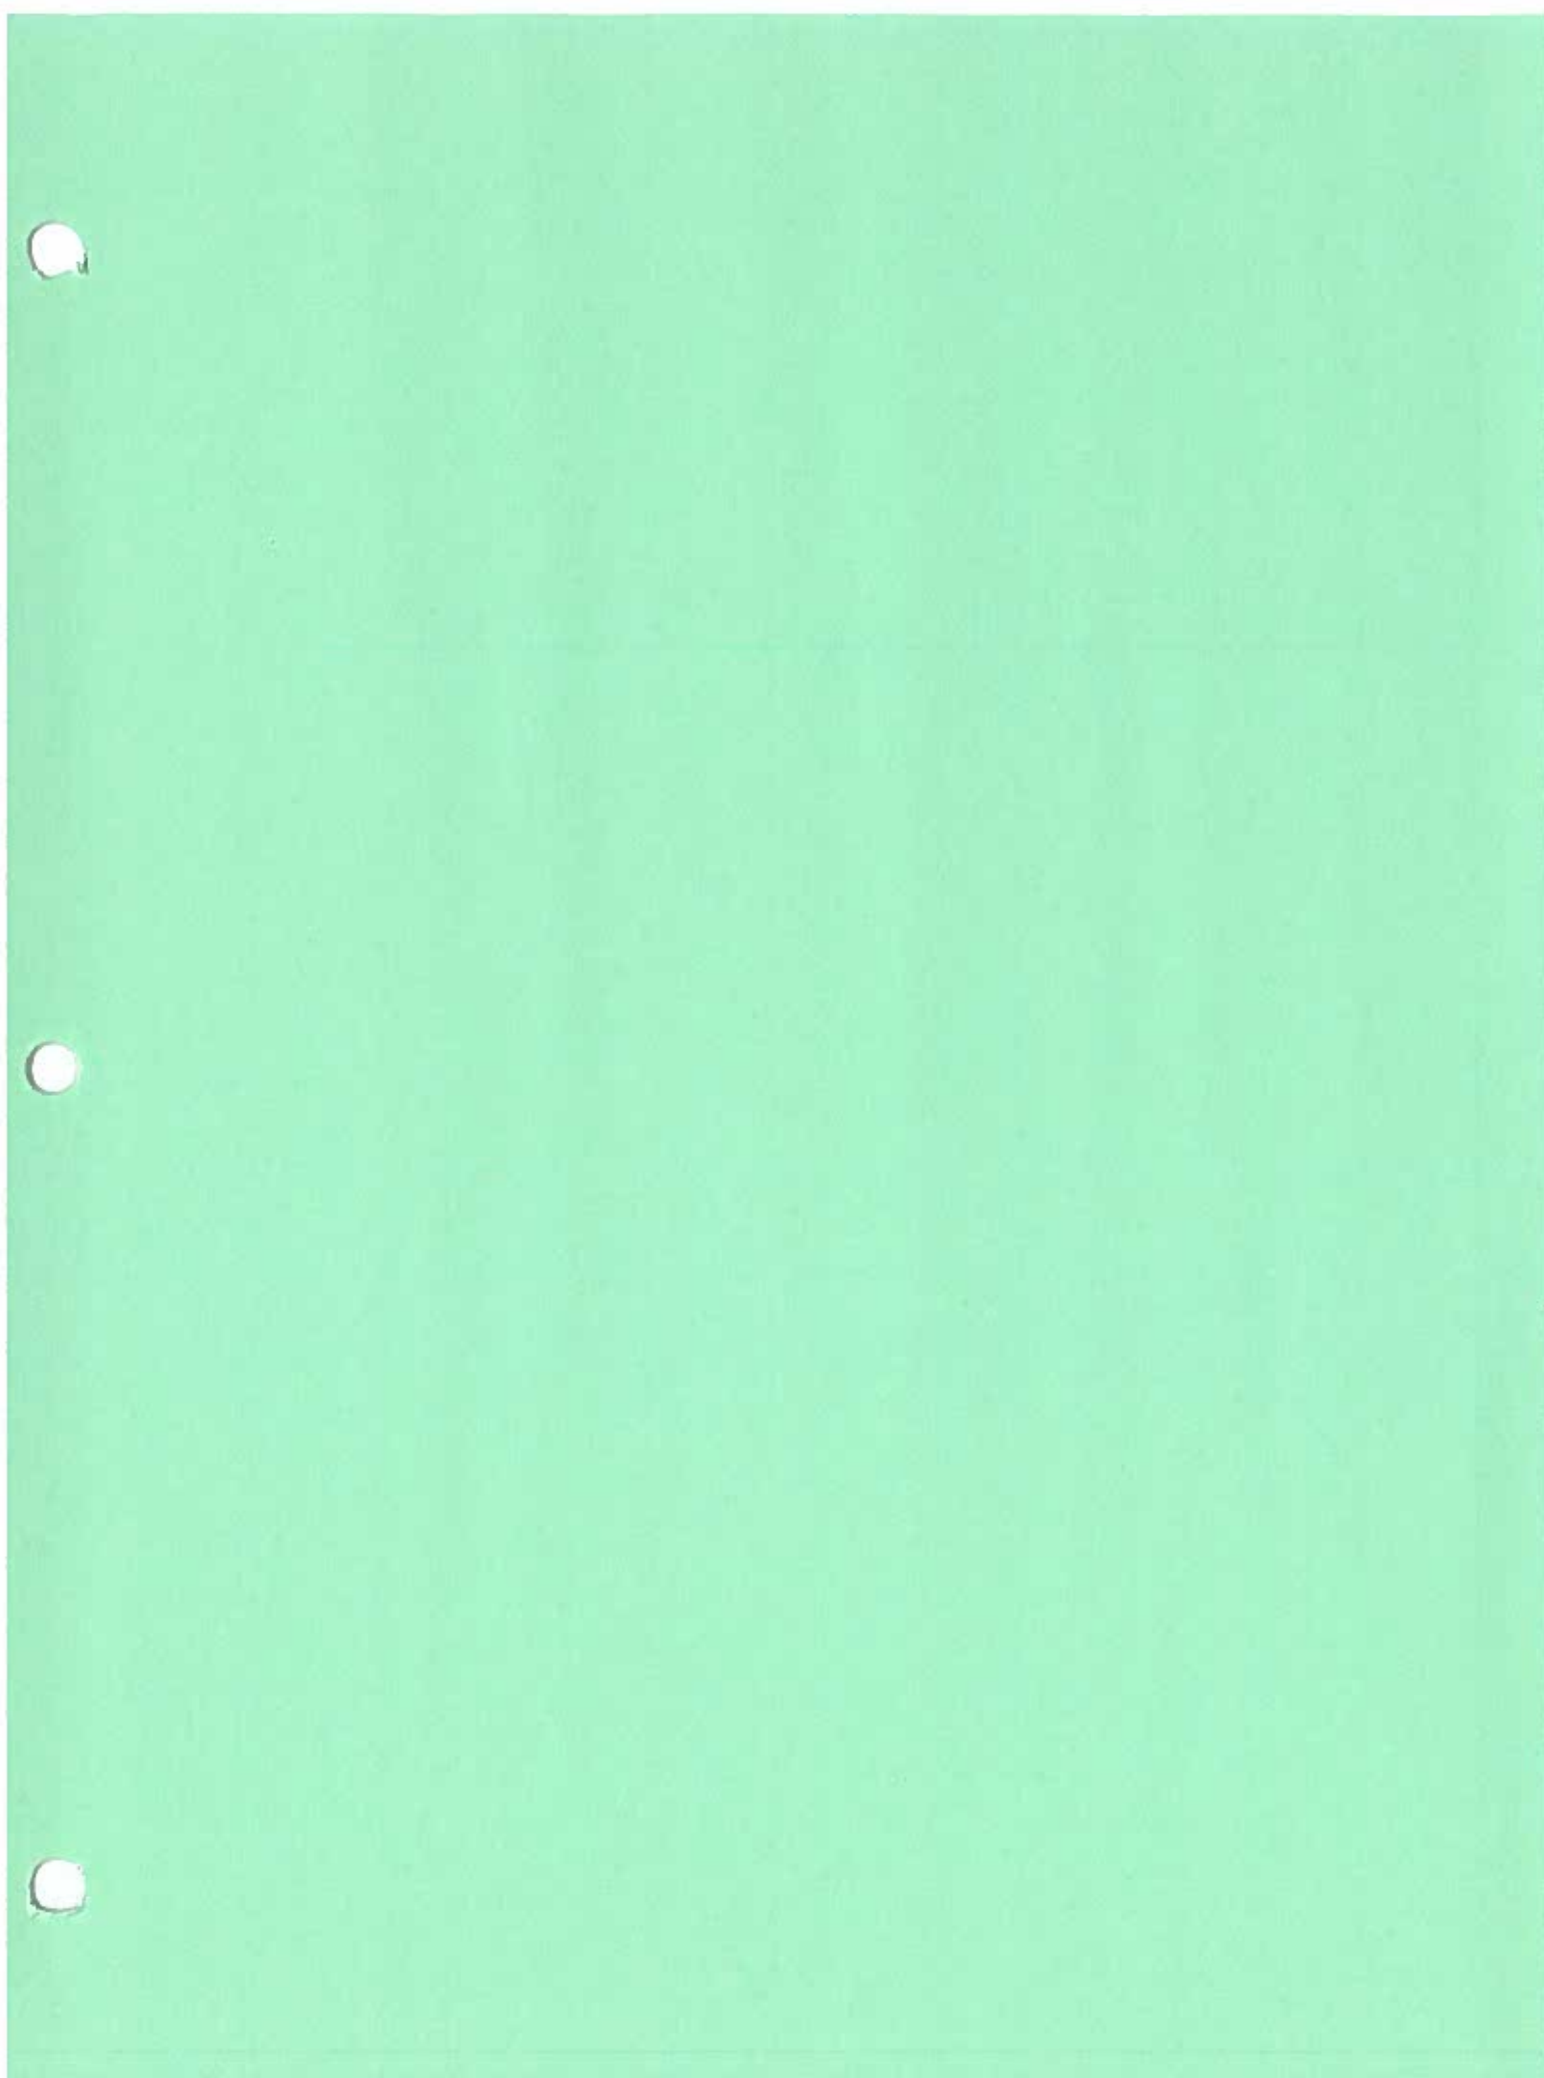

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools
BUILDING NAME: Charlestown Middle School
HA#: 03
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL: 2,229SF
MATERIAL LOCATION:

Throughout the Building

MATERIAL DESCRIPTION:


Floor Tile Mastic

COMMENTS:

Material is assumed to contain asbestos.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE: 06/01/88
CURRENT SURVEILLANCE DATE: 12/07/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
STATE: Indiana

INSPECTOR NAME:

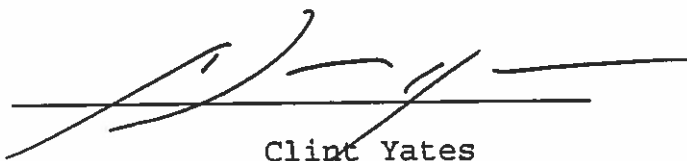
Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools

BUILDING NAME: Charlestown Middle School

HA#: A

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout the Building

MATERIAL DESCRIPTION:

Cove-base Molding

COMMENTS:

Good Condition. Material was not addressed in the original inspection and is assumed to contain asbestos.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT SURVEILLANCE DATE: 12/07/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: YES

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

STATE: Indiana

INSPECTOR NAME:


Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools

BUILDING NAME: Charlestown Middle School

HA#: B

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout the Building

MATERIAL DESCRIPTION:

Cove-base Mastic

COMMENTS:

Good Condition. Material was not addressed in the original inspection and is assumed to be asbestos containing.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT SURVEILLANCE DATE: 12/07/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage


ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

STATE: Indiana

INSPECTOR NAME:

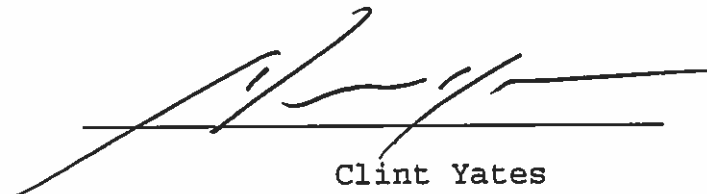
Clint Yates

PERIODIC SURVEILLANCE REPORT

LEA NAME: Greater Clark County Schools

BUILDING NAME: Charlestown Middle School

HA#: C

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Boiler Room

MATERIAL DESCRIPTION:

Boiler Gaskets

COMMENTS:

Good condition. Material was not addressed in the original inspection and is assumed to be asbestos containing.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT SURVEILLANCE DATE: 12/07/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage


ACCESSIBLE: YES

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

STATE: Indiana

INSPECTOR NAME:

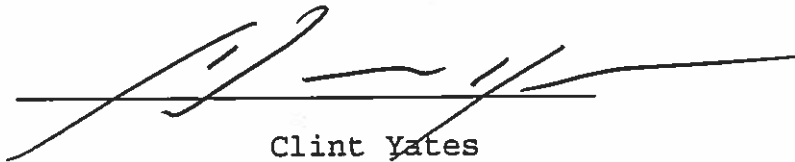
Clint Yates

THIRD YEAR REINSPECTIONS

REINSPECTION PLAN**GREATER CLARK COUNTY SCHOOLS**

Reinspection by an accredited building inspector will be scheduled to be performed not more than three years from the date of the original inspection. The reinspection report will then be made a permanent part of this Management Plan. Reinspections will be performed every three years for as long as the building contains ACBM, and will be reinspected once within three years from the date that all ACBM has been removed.

Records of each reinspection should be maintained in this binder.

DATE PLANNED**DATE COMPLETED****COMPLETED BY**JUNE 2007July 2007Bill OgleJUNE 2010June 2010Sandy ShadleyJUNE 2013April 2013Jeff HechtinJUNE 2016April 2016BenjaminJUNE 2019May 16, 2019SEJUNE 2022JUNE 2025

REINSPECTION PLAN**GREATER CLARK COUNTY SCHOOLS****CHARLESTOWN MIDDLE SCHOOL**

The ACBM in this building shall be reinspected every three years to determine any change in the condition of the materials for as long they remain in the building. This reinspection will be conducted tri-annually by an accredited inspector.

The following table outlines the dates on which these inspections should take place in this school building.

REINSPECTION SCHEDULE

<u>DATE PLANNED</u>	<u>DATE COMPLETED</u>	<u>COMPLETED BY</u>
<u>JUNE 1992</u>	<u>JUNE 1992</u>	<u>ASBESTECH</u>
<u>JUNE 1995</u>	<u>June '95</u>	<u>Alliance</u>
<u>JUNE 1998</u>	<u>June '98</u>	<u>Alliance</u>
<u>JUNE 2001</u>	<u>July '01</u>	<u>P. Wilson</u>
<u>JUNE 2004</u>	<u>July '04</u>	<u>C. Spacks</u>

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID 03
HA Description Floor Tile Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 2229 SF
Comments This material was not exposed to inspect.
Asbestos Assumed
Friable No

Original Inspection 6/1/1988
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID A
HA Description Cove base molding (color other than black)
HA Type Miscellaneous Material
HA Location Throughout the building, some classrooms, library and mechanical area and upper gym.
Quantity 4100 LF
Comments The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 1370 SF
Comments This material was not exposed to inspect except for one column post at doorway of room D-127. The mastic has been painted over.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID D
HA Description Fire Doors-Metal clad
HA Type Miscellaneous Material
HA Location Mechanical wing, kitchen area, gym wing and throughout the building.

Quantity Unquantified Unit(s)
Comments Fire doors were not assessed in the original inspection and are suspect for asbestos.
These will be assumed to be ACM until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID E
HA Description Stage light wiring
HA Type Miscellaneous Material
HA Location Stage

Quantity 11 Unit(s)
Comments This material was discovered during the June surveillance and will remain in the management plan until properly tested.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID F

HA Description Orange vinyl stair treads

HA Type Miscellaneous Material

HA Location Stage near gym

Quantity Unquantified SF

Comments Some treads are cracked and chipped around the edges, but still remain in tact.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID G

HA Description Stair tread mastic

HA Type Miscellaneous Material

HA Location Stage near gym

Quantity Unquantified LF

Comments This material was not visible to inspect.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID H
HA Description AHU expansion joints
HA Type Miscellaneous Material
HA Location On older ductwork painted green above gym & upper gym

Quantity Unquantified Unit(s)
Comments This material was not accessible.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID I

HA Description Black sink insulation

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID J

HA Description Sink Tops

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested. KILN Insulation in D206. (33 yrold kiln) Assumed 12-15-11

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID K

HA Description Fume hood bases

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID L
HA Description Kiln insulation
HA Type Thermal System Insulation (TSI)
HA Location Kiln insulation in D206 (33 year old Kiln)

Quantity Unquantified LF
Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 12/15/2011
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID M
HA Description Duct wrap/tape
HA Type Miscellaneous Material
HA Location Painted green in upper gym mechanical areas

Quantity Unquantified SF
Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.
Asbestos Assumed
Friable No

Original Inspection 12/15/2011
Current Inspection 5/16/2019

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Sean Stults

State IN

Accreditation Number 19A007184

Triennial Reinspection

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID I

HA Description Black sink insulation

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID J

HA Description Sink Tops

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested. KILN Insulation in D206. (33 yrold kiln) Assumed 12-15-11

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation

Building Name Charlestown Middle School

Building Number 13

HA ID K

HA Description Fume hood bases

HA Type Miscellaneous Material

HA Location Science lab

Quantity Unquantified Unit(s)

Comments This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Asbestos Assumed

Friable No

Original Inspection 6/27/2011

Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID L
HA Description Kiln insulation
HA Type Thermal System Insulation (TSI)
HA Location Kiln insulation in D206 (33 year old Kiln)

Quantity Unquantified LF
Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.
Asbestos Assumed
Friable No

Original Inspection 12/15/2011
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID M
HA Description Duct wrap/tape
HA Type Miscellaneous Material
HA Location Painted green in upper gym mechanical areas

Quantity Unquantified SF
Comments This material was not assessed in the original inspection and will be added to the management plan until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 12/15/2011
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID 03
HA Description Floor Tile Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 2229 SF
Comments This material was not exposed to inspect.
Asbestos Assumed
Friable No
Original Inspection 6/1/1988
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID A
HA Description Cove base molding (color other than black)
HA Type Miscellaneous Material
HA Location Throughout the building, some classrooms, library and mechanical area and upper gym.
Quantity 4100 LF
Comments The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration

Low/None

Air

Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID B
HA Description Cove Base Mastic
HA Type Miscellaneous Material
HA Location Throughout building

Quantity 1370 SF
Comments This material was not exposed to inspect except for one column post at doorway of room D-127. The mastic has been painted over.
Asbestos Assumed
Friable No
Original Inspection 5/31/1995
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID D
HA Description Fire Doors-Metal clad
HA Type Miscellaneous Material
HA Location Mechanical wing, kitchen area, gym wing and throughout the building.

Quantity Unquantified Unit(s)
Comments Fire doors were not assessed in the original inspection and are suspect for asbestos.
These will be assumed to be ACM until properly sampled.
Asbestos Assumed
Friable No
Original Inspection 6/30/2010
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID E
HA Description Stage light wiring
HA Type Miscellaneous Material
HA Location Stage

Quantity 11 Unit(s)
Comments This material was discovered during the June surveillance and will remain in the management plan until properly tested.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID F
HA Description Orange vinyl stair treads
HA Type Miscellaneous Material
HA Location Stage near gym

Quantity Unquantified SF
Comments Some treads are cracked and chipped around the edges, but still remain in tact.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID G
HA Description Stair tread mastic
HA Type Miscellaneous Material
HA Location Stage near gym

Quantity Unquantified LF
Comments This material was not visible to inspect.
Asbestos Assumed
Friable No
Original Inspection 6/27/2011
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

Percent Damaged % Good Condition

Physical Contact

Low/None

Vibration


Low/None

Air

Low/None

Planned Response Action O&M

Inspector

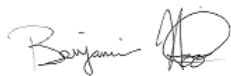

Benjamin S. Hood

State IN

Accreditation Number 19A001039

Triennial Reinspection

LEA Name Greater Clark County School Corporation
Building Name Charlestown Middle School
Building Number 13
HA ID H
HA Description AHU expansion joints
HA Type Miscellaneous Material
HA Location On older ductwork painted green above gym & upper gym

Quantity Unquantified Unit(s)
Comments This material was not accessible.
Asbestos Assumed
Friable No

Original Inspection 6/27/2011
Current Inspection 4/27/2016

Material Assessment

Assessment Rating 5 ACBM with potential for damage

Damage Assessment and Potential for Damage

<u>Percent Damaged</u>	%	Good Condition
<u>Physical Contact</u>	<u>Vibration</u>	<u>Air</u>
Low/None	Low/None	Low/None

Planned Response Action O&M

Inspector



Benjamin S. Hood

State IN

Accreditation Number 19A001039

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03

Type of Material Miscellaneous Material

Quantity of Material 2,229 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/1/1988

Current Reinspection Date 4/24/2013

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana

Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building, some classrooms, library and mechanical area and upper gym.

Material Description

Cove base molding (color other then black)

Comments

The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Reinspection Date 4/24/2013

Current Assessment Rating NR Not Rated

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

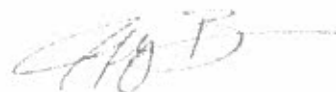

Jeffrey P. Rechten

State Indiana

Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B

Type of Material Miscellaneous Material

Quantity of Material Approx. 1,370 SF

Material Location
Throughout the building

Material Description
Cove base mastic

Comments

This material was not exposed to inspect except for one column post at doorway of room D-127. The mastic has been painted over.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# D

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location

Mechanical wing, kitchen area, gym wing and throughout the building.

Material Description

Fire Doors-Metal clad

Comments

Fire doors were not assessed in the original inspection and are suspect for asbestos.
These will be assumed to be ACM until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/30/2010

Current Reinspection Date 4/24/2013

Current Assessment Rating NR Not Rated

Cause of Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana

Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# E
Type of Material Miscellaneous Material
Quantity of Material 11 EA

Material Location

Stage

Material Description

Stage light wiring

Comments

This material was discovered during the June surveillance and will remain in the management plan until properly tested.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Reinspection Date 4/24/2013

Current Assessment Rating 7

Any Remaining Friable ACBM or Friable Suspected ACBM

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechtin

State Indiana

Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# F
Type of Material Miscellaneous Material
Quantity of Material Unquantified SF

Material Location

Stairs near gym

Material Description

Orange vinyl stair treads

Comments

Some treads are cracked and chipped around the edges, but still remain in tact.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage Deterioraton & Physical Damage
Accessible Yes
Potential for Damage L
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name	Greater Clark County Schools
Building Name	Charlestown Middle School
HA#	G
Type of Material	Miscellaneous Material
Quantity of Material	Unquantified LF
Material Location	Stairs near gym
Material Description	Stair tread mastic
Comments	This material was not visible to inspect.
Does Material Contain Asbestos?	Assumed
Is It Friable?	No
Original Inspection Date	6/27/2011
Current Reinspection Date	4/24/2013
Current Assessment Rating	NR Not Rated
Cause of Damage	
Accessible	No
Potential for Damage	Low
Removed	No
Planned Response Action	O & M

Inspector



Jeffrey P. Rehtin

State	Indiana
Accreditation Number	19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# H
Type of Material Miscellaneous Material
Quantity of Material Unquantified Each
Material Location

On older ductwork painted green above gym & upper gym

Material Description

AHU expansion joints

Comments

This material was not accessible.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 1
Type of Material Miscellaneous Material
Quantity of Material Unquantified EA

Material Location
Science lab

Material Description
Black sink insulation

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# J

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location
Science lab

Material Description
Sink tops

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested. KILN Insulation in D206. (33 yrold kiln) Assumed 12-15-11

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/27/2011

Current Reinspection Date 4/24/2013

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechten

State Indiana

Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# K
Type of Material Miscellaneous Material
Quantity of Material Unquantified Each
Material Location

Science lab

Material Description

Fume hood bases

Comments

This material was not noted in the original inspection and is suspect material; therefore is added to the Management Plan until properly tested.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 6/27/2011
Current Reinspection Date 4/24/2013
Current Assessment Rating NR Not Rated
Cause of Damage No Damage
Accessible Yes
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

Jeffrey P. Rehtin

State Indiana
Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# L

Type of Material Thermal System Insulation

Quantity of Material Unquantified LF

Material Location

Kiln insulation in D206 (33 year old Kiln)

Material Description

Kiln insulation

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 12/15/2011

Current Reinspection Date 4/24/2013

Current Assessment Rating NR Not Rated

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector



Jeffrey P. Rechtin

State Indiana

Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# M

Type of Material Miscellaneous Material

Quantity of Material Unquantified SF

Material Location

Painted green in upper gym mechanical areas

Material Description

Duct wrap/tape

Comments

This material was not assessed in the original inspection and will be added to the management plan until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 12/15/2011

Current Reinspection Date 4/24/2013

Current Assessment Rating 7 Any Remaining Friable ACBM or Friable Suspected ACBM

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

Jeffrey P. Rechtin

State Indiana

Accreditation Number 19A003594

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# 03

Type of Material Miscellaneous Material

Quantity of Material 2,229 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/1/1988

Current Reinspection Date 6/30/2010

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Sandra Shadley

State IN

Accreditation Number 19A002323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building, some classrooms and library.

Material Description

Cove base molding (color other then black)

Comments

The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Reinspection Date 6/30/2010

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Sandra Shadley

State IN

Accreditation Number 19A002323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School -
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,370 SF

Material Location
Throughout the building

Material Description
Cove base mastic

Comments

This material was not exposed to inspect except for one column post at room D-125 where the cove base is taped. The mastic was not in poor condition.

Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 6/30/2010
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Sandra Shadley

State IN
Accreditation Number 19A002323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# D

Type of Material Miscellaneous Material

Quantity of Material Unquantified Each

Material Location

Mechanical wing and kitchen area.

Material Description

Fire Doors

Comments

Fire doors were not assessed in the original inspection and are suspect for asbestos.
These will be assumed to be ACM until properly sampled.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/30/2010

Current Reinspection Date 6/30/2010

Current Assessment Rating NR Not Required

Cause of Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Sandra Shadley

State Indiana

Accreditation Number 19A002323

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# 03

Type of Material Miscellaneous Material

Quantity of Material 2,229 SF

Material Location

Throughout the building

Material Description

Floor tile mastic

Comments

This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/1/1988

Current Reinspection Date 7/11/2007

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location

Throughout the building

Material Description

Cove base molding (color other then black)

Comments

The black color base has been recently installed to replace sections of the old molding that were missing. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Reinspection Date 7/11/2007

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


George William Ogle

State Indiana

Accreditation Number 191003027

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,370 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
This material was not exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 7/11/2007
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


George William Ogle

State

Indiana

Accreditation Number

191003027



THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# 03

Type of Material Miscellaneous Material

Quantity of Material 2,229 SF

Material Location
Throughout the building

Material Description
Floor tile mastic

Comments
This material was not exposed to inspect.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/1/1988

Current Reinspection Date 6/28/2004

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

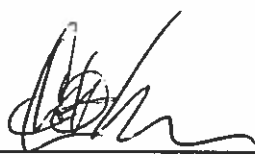

Christiaan Sparks

State Indiana

Accreditation Number 190804103

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location
Throughout the building

Material Description
Cove base molding

Comments
There are missing and damaged pieces in several areas throughout the building. This material was not in poor condition overall.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/1995

Current Reinspection Date 6/28/2004

Current Assessment Rating NR Not Required

Cause of Damage No Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Christiaan Sparks

State Indiana

Accreditation Number 190804103

THIRD YEAR REINSPECTION REPORT


LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,370 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
Where exposed, this material was not in poor condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/1995
Current Reinspection Date 6/28/2004
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector



Christiaan Sparks

State Indiana
Accreditation Number 190804103

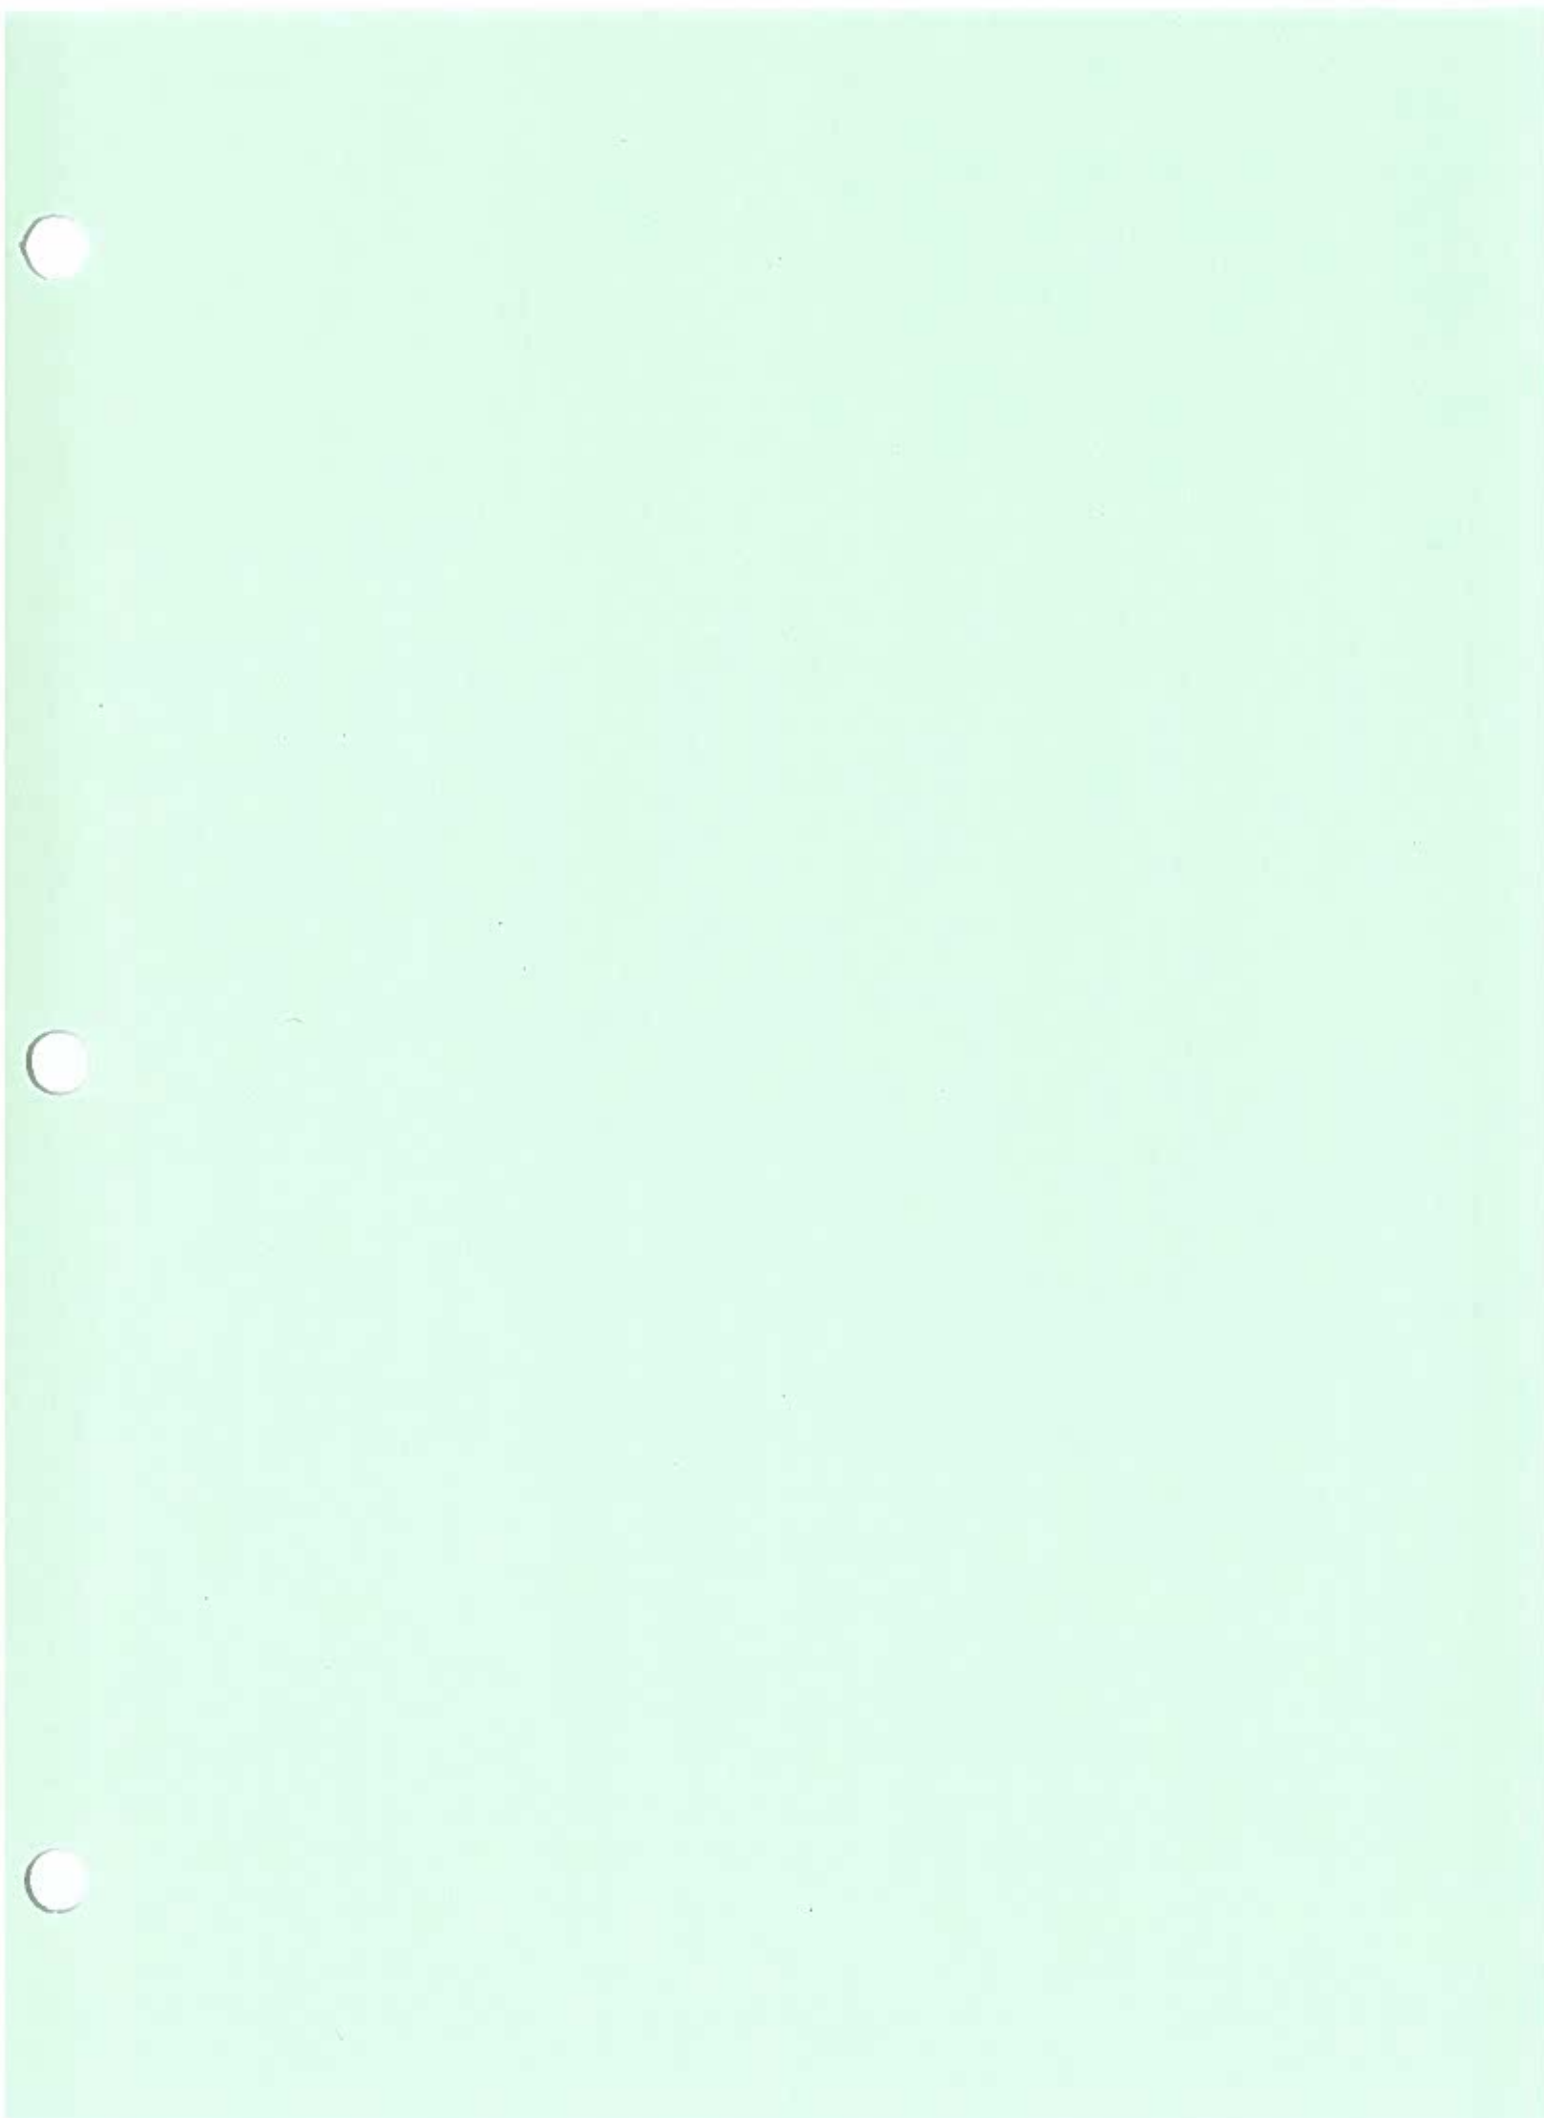

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# 03
Type of Material Miscellaneous Material
Quantity of Material 2,229 SF
Material Location
Throughout the building
Material Description
Floor tile mastic
Comments
No mastic was exposed to inspect.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 06/01/1988
Current Reinspection Date 07/12/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector


Patrick E. Wilson

State Indiana
Accreditation Number 190824065

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material Approx. 4,100 LF

Material Location
Throughout the building

Material Description
Cove base molding

Comments
Material has been removed in room D-222. There is some damage to the material throughout. There are missing pieces in several classrooms throughout the building.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 05/31/1995

Current Reinspection Date 07/12/2001

Current Assessment Rating NR Not Required

Cause of Damage Physical Damage

Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector


Patrick E. Wilson

State Indiana

Accreditation Number 190824065

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material Approx. 1,370 SF
Material Location
Throughout the building
Material Description
Cove base mastic
Comments
Material is in good condition where exposed.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 05/31/1995
Current Reinspection Date 07/12/2001
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector




Patrick E. Wilson

State

Indiana

Accreditation Number

190824065

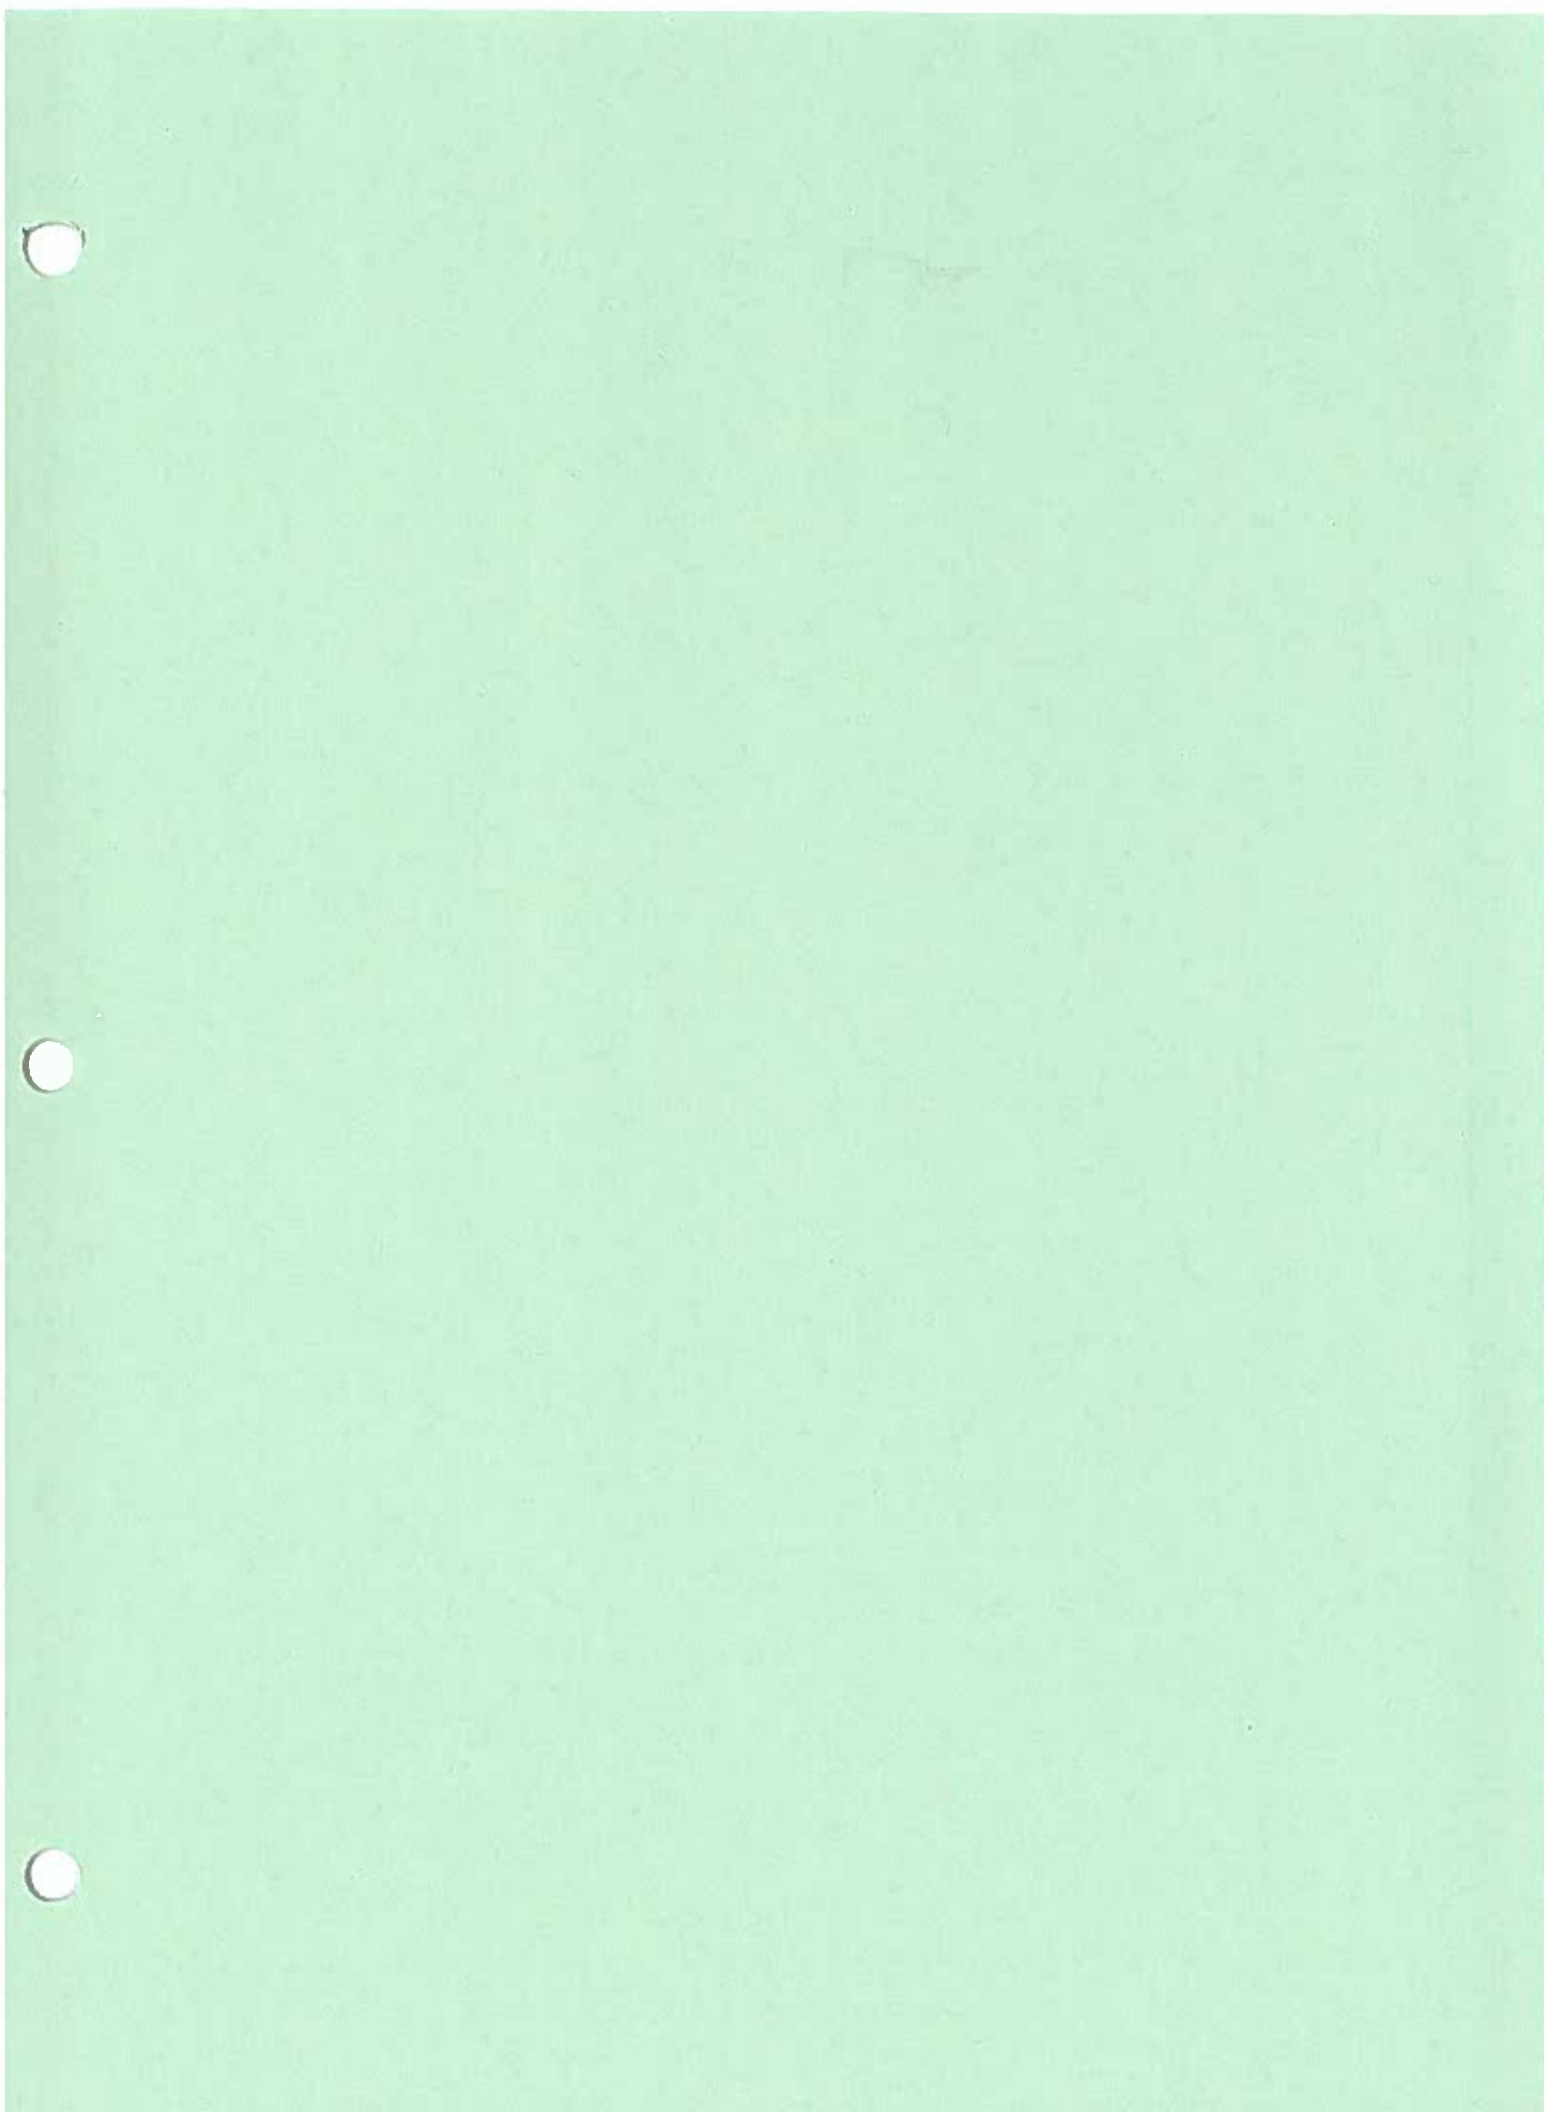

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# 03

Type of Material Miscellaneous Material

Quantity of Material 2,229 SF

Material Location
Throughout the building

Material Description
Floor Tile Mastic

Comments
No exposed material found. Assumed to be in good condition.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 6/ 1/88

Current Reinspection Date 6/ 1/98

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible No

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

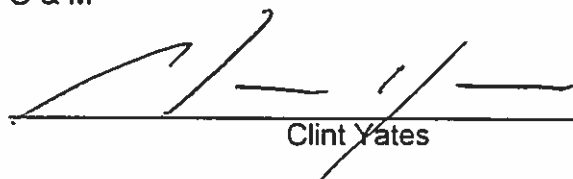
Clint Yates

State Indiana

Accreditation Number 193804035

THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools

Building Name Charlestown Middle School

HA# A

Type of Material Miscellaneous Material

Quantity of Material LF

Material Location
Throughout the building

Material Description
Cove Base Molding

Comments

Material has been removed in room D-222. There is some damage to the material in the gymnasium. There are missing pieces in some classrooms.

Does Material Contain Asbestos? Assumed

Is it Friable? No

Original Inspection Date 5/31/95

Current Reinspection Date 6/ 1/98

Current Assessment Rating NR Not Required

Cause of Damage No Damage


Accessible Yes

Potential for Damage Low

Removed No

Planned Response Action O & M

Inspector

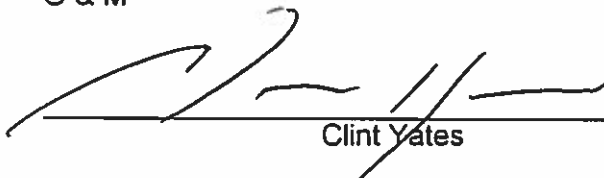
Clint Yates


State Indiana

Accreditation Number 193804035


THIRD YEAR REINSPECTION REPORT

LEA Name Greater Clark County Schools
Building Name Charlestown Middle School
HA# B
Type of Material Miscellaneous Material
Quantity of Material LF
Material Location
Throughout the building
Material Description
Cove Base Mastic
Comments
Some exposure found, but material is in good condition.
Does Material Contain Asbestos? Assumed
Is it Friable? No
Original Inspection Date 5/31/95
Current Reinspection Date 6/ 1/98
Current Assessment Rating NR Not Required
Cause of Damage No Damage
Accessible No
Potential for Damage Low
Removed No
Planned Response Action O & M

Inspector

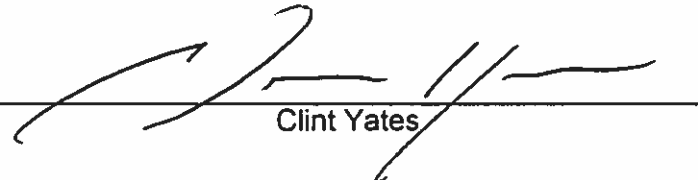
Clint Yates

State Indiana
Accreditation Number 193804035

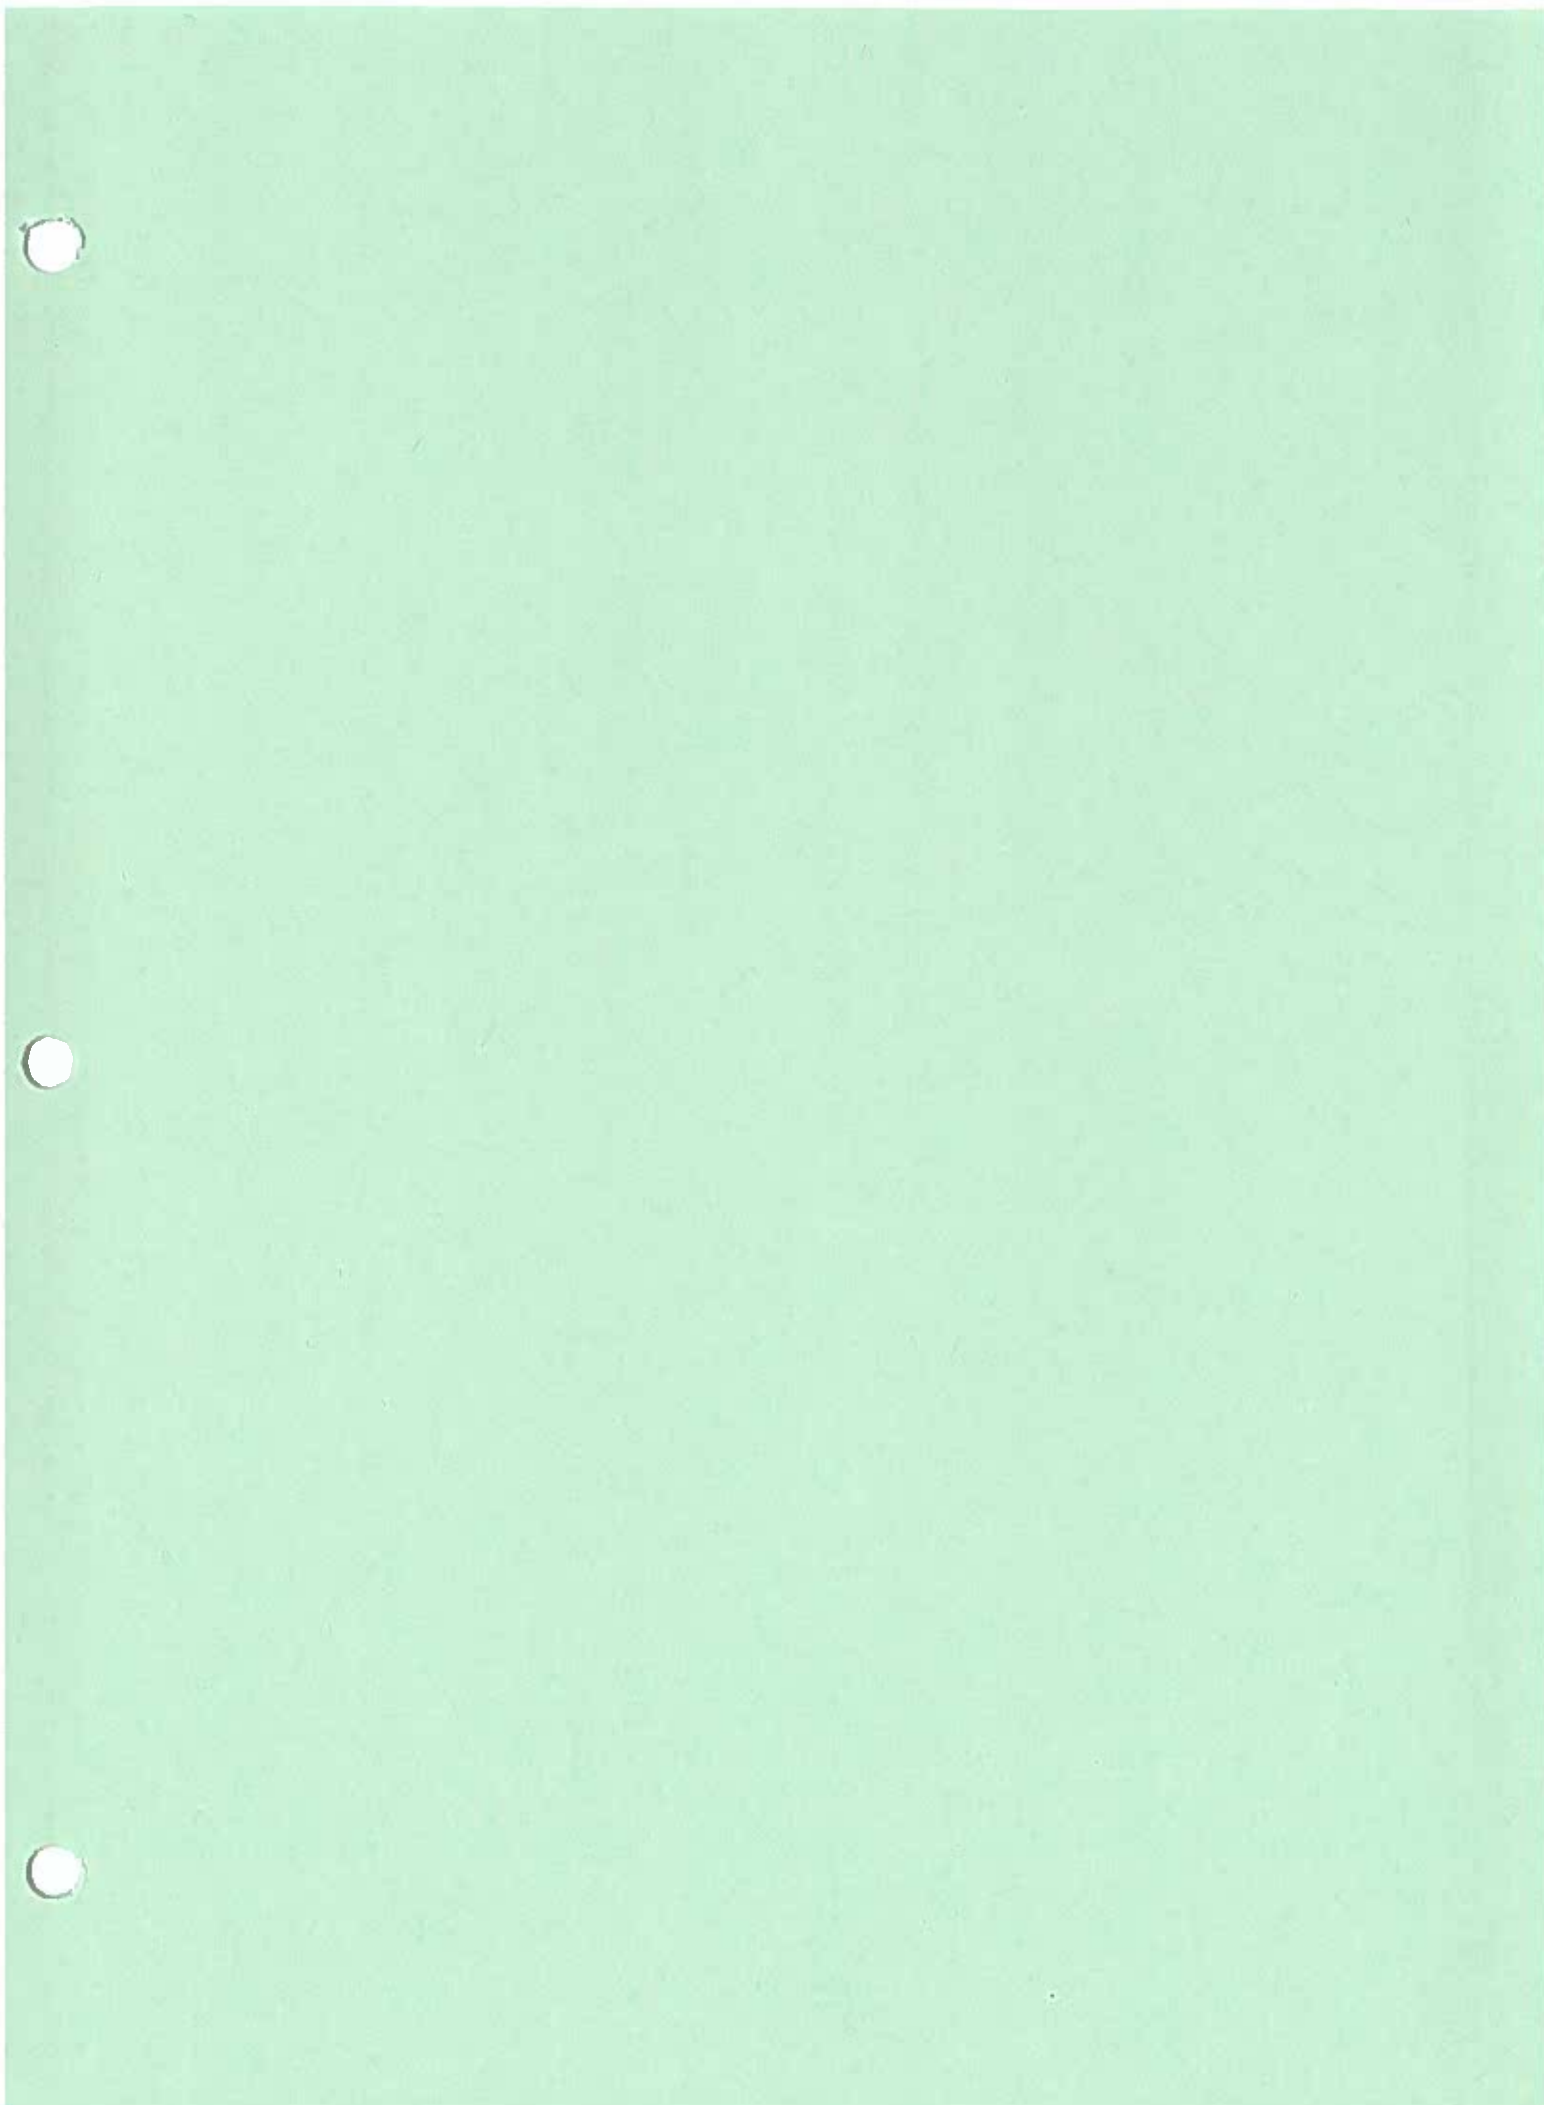

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.
BUILDING NAME: Charlestown Middle School
HA#: 03
TYPE OF MATERIAL: Miscellaneous Material
QUANTITY OF MATERIAL: 2,229SF
MATERIAL LOCATION:

Throughout the Building

MATERIAL DESCRIPTION:

Floor Tile Mastic

COMMENTS:

Material is assumed to contain asbestos.

IS MATERIAL FRIABLE? NO
ORIGINAL INSPECTION DATE: 06/01/88
CURRENT REINSPECTION DATE: 06/27/95
CURRENT ASSESSMENT RATING: NR Not Required
CAUSE OF DAMAGE: No Damage
ACCESSIBLE: NO
POTENTIAL FOR DAMAGE: Low
REMOVED: NO
CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:



Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.

BUILDING NAME: Charlestown Middle School

HA#: A

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout the Building

MATERIAL DESCRIPTION:

Cove-base Molding

COMMENTS:

Good Condition. Material was not addressed in the original inspection and is assumed to contain asbestos.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT REINSPECTION DATE: 06/27/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

CURRENT VIDEO TAPE:
(TAPE NO/FOOTAGE)

/

INSPECTOR NAME:


Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.

BUILDING NAME: Charlestown Middle School

HA#: B

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Throughout the Building

MATERIAL DESCRIPTION:

Cove-base Mastic

COMMENTS:

Good Condition. Material was not addressed in the original inspection and is assumed to be asbestos containing.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT REINSPECTION DATE: 06/27/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:


Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

THIRD YEAR REINSPECTION REPORT

LEA NAME: Greater Clark County School Corp.

BUILDING NAME: Charlestown Middle School

HA#: C

TYPE OF MATERIAL: Miscellaneous Material

QUANTITY OF MATERIAL:

MATERIAL LOCATION:

Boiler Room

MATERIAL DESCRIPTION:

Boiler Gaskets

COMMENTS:

Good condition. Material was not addressed in the original inspection and is assumed to be asbestos containing.

IS MATERIAL FRIABLE? NO

ORIGINAL INSPECTION DATE:

CURRENT REINSPECTION DATE: 06/27/95

CURRENT ASSESSMENT RATING: NR Not Required

CAUSE OF DAMAGE: No Damage

ACCESSIBLE: NO

POTENTIAL FOR DAMAGE: Low

REMOVED: NO

CURRENT VIDEO TAPE: /
(TAPE NO/FOOTAGE)

INSPECTOR NAME:


Rex Gaddis

STATE: Indiana

ACCREDITATION NO.: 190908032

ADDITIONAL BULK SAMPLES

ATC ASSOCIATES INC.
BULK SAMPLE ANALYSIS REPORT
NVLAP Accredited
NVLAP Code Number 101265-00


Date: June 17, 1997

Client: Alliance Indiana, Inc.

Project Identification: NHW-03A01 - Charlestown Middle School
Date Sample Received: June 3, 1997
ATC Lab Batch Number: 970919

Lab ID	Client ID	Color / Description	Layer(s)	Asbestos Type	%	Other Fibrous Material %	Non-Fibrous Material
001	CMS-01	White Insulation	1	Chrysotile	80-90	None Detected	Binder
002	CMS-02	White Insulation	1	Chrysotile	80-90	None Detected	Binder


Patrick Stanford, Analyst


Patrick Stanford, Group Leader

- Analytical Methods: EPA 600/M4-82-020, December 82, EPA 600/R-93/116, July 1993
- Enclosed test results relates only to items tested.
- This report shall not be reproduced, except in full without written approval of the laboratory.
- This report can not be used to claim product endorsement by NVLAP or any agency of the U.S. Government.
- Method limitations: Analysis of floor tile and other resinously bound materials by Polarized Light Microscopy (PLM) may yield false negative results due to method limitations. In these cases ATC recommends alternative methods of analysis.
- For all heterogeneous samples easily separated into sub-samples each component will be analyzed separately. When layers cannot be separated without compromising the layer they will be analyzed as one sample. When a heterogeneous sample contains no asbestos in any layer reported results will be combined in one. When asbestos is detected in a layer or layers of a heterogeneous sample each individual layer will be reported separately.

ALLIANCE INDIANA, INC.

1433 Sadler Circle West Dr.

Indianapolis, IN 46239

317/351-5600 Fax 317/351-5610

970919

4/3

Project Name- CHARLESTOWN MIDDLE SCHOOLProject Location- BOILER ROOMCity/State- CHARLESTOWN INDIANAProject Number- ~~4567~~ - NHW-03A01 Date- 03 JUNE 1997Samples Collected By- BILL OGLE

SAMPLE I.D. NUMBER	LOCATION OF SAMPLE	DESCRIPTION OF SAMPLE MATERIAL
CMS-01	FRONT PLATE ON BURNER	WHITE FIBROUS ROPE GASKET
CMS-02	BETWEEN BOILER SECTIONS	TAN FIBROUS ROPE GASKET
CMS-01	Chr 80-90	
CMS-02	Chr 80-90	

CHAIN OF CUSTODYSample By: BILL OGLEDate: 03 JUNE 1997Signature: Bill OgleDate Shipped: 03 June 97

Received By: _____

Date: _____

Signature: _____

Shipped Via: _____

Recorded By: _____

Date: _____ Log#: _____

Signature: Bill OgleShipped To: 9/3/97

ALLIANCE INDIANA, INC.

1433 Sadlier Circle West Dr.

Indianapolis, IN 46239

317/351-5600 Fax 317/351-5610

Project Name- CHARLESTOWN MIDDLE SCHOOLProject Location- BOILER ROOMCity/State- CHARLESTOWN INDIANAProject Number- ~~155~~ - NHW-03A01 Date- 03 JUNE 1997Samples Collected By- BILL OGLE

SAMPLE I.D. NUMBER	LOCATION OF SAMPLE	DESCRIPTION OF SAMPLE MATERIAL
CMS-01	FRONT PLATE ON BURNER	WHITE FIBROUS ROPE GASKET
CMS-02	BETWEEN BOILER SECTIONS	TAN FIBROUS ROPE GASKET

CHAIN OF CUSTODYSample By: BILL OGLEDate: 03 JUNE 1997Signature: BILL OGLEDate Shipped: 03 June 97

Received By: _____

Date: _____

Signature: _____

Shipped Via: _____

Recorded By: _____

Date: _____ Log#: _____

Signature: [Signature]Shipped To: 6/3/97

ALLIANCE INDIANA, INC.
1433 Sadler Circle West Dr.
Indianapolis, IN 46239
317/351-5600 Fax 317/351-5610

4 10417
4/3

Project Name- CHARLESTOWN MIDDLE SCHOOL
Project Location- BOILER ROOM
City/State- CHARLESTOWN INDIANA
Project Number- ~~1111~~ - NHW-03A01 Date- 03 JUNE 1997
Samples Collected By- BILL OGLE

SAMPLE I.D. NUMBER	LOCATION OF SAMPLE	DESCRIPTION OF SAMPLE MATERIAL
CMS-01	FRONT PLATE ON BURNER	WHITE FIBROUS ROPE GASKET
CMS-02	BETWEEN BOILER SECTIONS	TAN FIBROUS ROPE GASKET
CMS-01	Chr 80-90	
CMS-02	Chr 80-90	

CHAIN OF CUSTODY

Sample By: BILL OGLE
Date: 03 JUNE 1997
Signature: BILL OGLE
Date Shipped: 03 June 97

Received By: _____
Date: _____
Signature: _____
Shipped Via: _____

Recorded By: _____
Date: _____ Log#: _____
Signature: [Signature]
Shipped To: 6/2/97

Form F-013

**ANNUAL NOTIFICATIONS
ACCREDITATIONS
TRAINING
INFORMATION**

Indiana Department of Environmental Management
100 N. Senate Avenue
Mail Code 61-52 IGCN 1003
Indianapolis, IN 46204-2251



April 17, 2014

RECEIVED APR 22 2014

Benjamin S. Hood
Alliance Environmental Group
5340 Commerce Circle, Ste E
Indianapolis IN 46237

Re: Asbestos Inspector # 19A001039

Based upon the review of your license application, the Office of Air Quality has determined that you have fulfilled the requirements of 326 IAC 18 and are eligible for licensing in the following discipline:

Asbestos Inspector

Your Asbestos Inspector license is attached below. The license is waterproof and tear resistant. Please sign your license and do not laminate or alter your license in anyway. Your license must be available for review at all times while implementing an asbestos project. This license may be revoked, pursuant to 326 IAC 18-1-7, if you:

- (1) Violate any requirements of these rules (326 IAC 18), 326 IAC 14-10, or any requirement of the Asbestos-Containing Materials in Schools Rule or any other federal, state, or local regulation pertaining to asbestos in buildings or to asbestos projects.
- (2) Falsify information on your application for licensing.
- (3) Fail to meet any qualifications specified in 326-IAC 18-1-4.
- (4) Conduct asbestos project, or related asbestos handling activity, in a manner which is hazardous to the public health.

Your license is valid effective 05/05/2014, and will expire on 05/05/2015, as indicated on your card. We suggest that you attend the required training and submit an application for license renewal early to insure your license does not lapse. NOTE: 326 IAC 18-1-4(h) and 326 IAC 18-1-6(e) require that any individual who has an eighteen (18) month lapse between any two training courses of the same discipline to attend an initial training course for the discipline in which they are seeking a license. In order to avoid re-taking the initial training course you must have attended a refresher in the discipline you are seeking a license within eighteen (18) months from the date of issuance of your last training course certificate.

Office of Air Quality, Asbestos Licensing Section (317) 233-3861



Indiana Dept. of Environmental Management

Benjamin S. Hood

Asbestos Inspector License #: 19A001039

Effective: 05/05/2014	Expiration: 05/05/2015
Birth Date: 04/10/1978	Gender: M
Height: 6-00	Eye Color: Brown
Weight: 285	Hair Color: Brown

NOTICES

NOTIFICATION LOG

GREATER CLARK COUNTY SCHOOLS

DATE OF NOTIFICATION

COPY IN BOOK

YEAR

(X)

2009

✓

2010

✓

2011

2012

2013

✓

2014

✓

2015

✓

2016

2017

2018

2019

2020

2021

2022

2023

2024

2025

2026

2027

2028

2029

2030

NOTIFICATION LOG

LEA Name - Greater Clark County Schools

<u>Date of Notification</u>	<u>Copy of Notification in Supplemental Book?</u>
<u>1989</u>	<u></u>
<u>1990</u>	<u></u>
<u>1991</u>	<u></u>
<u>1992</u>	<u></u>
<u>1993</u>	<u></u>
<u>1994</u>	<u></u>
<u>1995</u>	<u>✓</u>
<u>1996</u>	<u>✓</u>
<u>1997</u>	<u>✓</u>
<u>1998</u>	<u>✓</u>
<u>1999</u>	<u>✓</u>
<u>2000</u>	<u>✓</u>
<u>2001</u>	<u>✓</u>
<u>2002</u>	<u>✓</u>
<u>2003</u>	<u>✓</u>
<u>2004</u>	<u>✓</u>
<u>2005</u>	<u>✓</u>
<u>2006</u>	<u>✓</u>
<u>2007</u>	<u>✓</u>
<u>2008</u>	<u>✓</u>

March 2015

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services at River Valley Middle School, which is located at 2220 Veteran's Parkway, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, Service Center, Corden Porter Storage, Auto Tech Program- Witten Property, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2015/2016 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

* The required triennial re-inspection will be performed in April 2016.

* The required six month periodic surveillance was performed in October 2014.

* The required six month periodic surveillance activities are scheduled for April and October each year.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

March 2014

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2220 Veteran's Parkway, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, Corden Porter Storage, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2014/2015 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

* The required triennial re-inspection will be performed in April 2013.

* The required six month periodic surveillance was performed in October 2013.

* The required six month periodic surveillance activities are scheduled for April and October each year.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

March 2013

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763, Subpart E, Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the initial inspection, triennial reinspections, and 6 month periodic surveillance of asbestos-containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the plans should contact the individual school office. Master copies of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxiliary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Greater Clark County Schools, school facilities, and buildings which contain asbestos-containing materials (ACMs) and must comply with the 40 CFR 763, Subpart E (AHERA) regulations include:

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools, the Auxiliary Services Building, Service Center, Corden Porter Storage, and Corden Porter Center with Gym.

Listed is a brief description of asbestos projects currently ongoing and completed at our facilities this past school year, as well as activities currently scheduled for the 2013/2014 school year. Detailed reports of each activity will become a part of each school's asbestos management plan and may be reviewed in the school office.

- * The required triennial re-inspection will be performed in April 2013.
- * The required six month periodic surveillance was performed in October 2012.
- * The required six month periodic surveillance activities are scheduled for April and October each year.
- * Projects completed in 2012: Parkview Middle School.

School facilities and buildings that are asbestos free and require no surveillance or reinspection are:

Pleasant Ridge Elementary School, Utica Elementary School, Cordon Porter former Options Building and the Administration Building

**AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Auxillary Services building, which is located at 2710 E 10th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection will be performed in June 2010.
- * The required six month periodic surveillance was performed in December 2009.
- * The next scheduled activity is the required six month periodic surveillance in December 2010.

Charlestown High School is an ongoing asbestos removal project which will be complete prior to partial demolition.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -
These buildings are asbestos free and **Riverside Elementary** was demolished in 2006.
No surveillances or reinspections are required for these buildings.

March 2010

**AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E Asbestos Containing Materials in Schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number (812) 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown and New Washington High Schools; Parkview, River Valley and Charlestown Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2007.
- * The required six month periodic surveillance was performed in December 2008.
- * The next scheduled activities are the required six month periodic surveillance in June 2009 and Dec 2009. Charlestown High School has undergone an asbestos removal project prior to partial demolition.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -
These buildings are asbestos free and **Riverside Elementary** was demolished in 2006.
No surveillances or re-inspections are required for these buildings.

April 2009

AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number (812)288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Hobgood at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2007.
- * The required six month periodic surveillance was performed in December 2007.
- * The next scheduled activities are the required six month periodic surveillance in June 2008 and Dec 2008.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building – These buildings are asbestos free. **Riverside Elementary** was Demolition in 2006. No surveillances or reinspections are required.

April 2008

**AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

* The required six month periodic surveillance was performed in June 2006.

* The required six month periodic surveillance was performed in December 2006.

* The next scheduled activities are the required six month periodic surveillance in June 2007 and Dec 2007.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building - These buildings are asbestos free. **Riverside Elementary** was Demolition in 2006. No surveillances or reinspections are required.

March 2007

**AHERA ANNUAL NOTICE
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2005.
- * The required six month periodic surveillance was performed in December 2005.
- * The next scheduled activities are the required six month periodic surveillance in June 2006 and Dec 2006.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building --
These buildings are asbestos free. No surveillances or reinspections are required.

March 2006

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Chuck Graves at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in June 2004.
- * The required six month periodic surveillance was performed in December 2004.
- * The next scheduled activities are the required six month periodic surveillance in June 2005 and December 2005.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

- * These buildings are asbestos free. No surveillances or reinspections are required.

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required six month periodic surveillance was performed in June 2003.
- * The required six month periodic surveillance was performed in December 2003.
- * The next scheduled activities are the required triennial reinspection in June 2004 and a required six month periodic surveillance in December 2004.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

- * These buildings are asbestos free. No surveillances or reinspections are required.

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the former Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required six month periodic surveillance was performed in June 2002.
- * The required six month periodic surveillance was performed in December 2002.
- * The next scheduled activity is the required periodic surveillance in June 2003.

Pleasant Ridge Elementary School, Utica Elementary School and the (New) Administration Building -

- * These buildings are asbestos free. No surveillances or reinspections are required.

May 2003

**AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS**

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center Buildings -

- * The required triennial reinspection was performed in July 2001.
- * The required six month periodic surveillance was performed in December 2001.
- * The next scheduled activities are the required periodic surveillances in June 2002 and December 2002.

Pleasant Ridge Elementary School and (New) Utica Elementary School -

- * These buildings are asbestos free. No surveillances or reinspections are required.

(Old) Utica Elementary School -

- * In accordance with information collected from the GCCS this building has been deeded to the town of Utica. No further AHERA periodic surveillances or triennial reinspections will be conducted by the designated person.

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, (Old) Utica, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center -

- * The required six month periodic surveillance was performed in June 2000.
- * The required six month periodic surveillance was performed in January 2001.
- * The next scheduled activity is a required triennial reinspection in June 2001.

Pleasant Ridge Elementary School and (New) Utica Elementary School -

- * This building is asbestos free. No surveillances or reinspections are required.

June 2001

AHERA Annual Notice
GREATER CLARK COUNTY SCHOOLS

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Tony Nauert at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

Jeffersonville, Charlestown, and New Washington High Schools; Parkview, Charlestown, and River Valley Middle Schools; Wilson, Thomas Jefferson, Northaven, Utica, New Washington, Jonathan Jennings, Bridgepoint, Maple, Riverside, Spring Hill, and Parkwood Elementary Schools; the Administration Building, Service Center, and Corden Porter Center -

- * The required six month periodic surveillance was performed in June 1999.
- * The required six month periodic surveillance was performed in December 1999.
- * The next scheduled activity is a required periodic surveillance in June 2000.

Pleasant Ridge Elementary School -

- * This building is asbestos free. No surveillances or reinspections are required.

June 2000

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required six month periodic surveillance was performed in June 1998.
- * The required six month periodic surveillance was performed in December 1998.
- * The next scheduled activity is a required periodic surveillance in June 1999.

Parkwood Elementary School

- * O & M was performed in the boiler room in May 1998.

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1997 and December 1997.
- * Next activity scheduled activity is a required third year reinspection in June 1998.

AHERA Annual Notice

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available, should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Steve Meredith at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1996 and December 1996.
- * The next required periodic surveillance will be performed in June 1997 and December 1997.

June 97

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Denny Johanson at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All buildings where it is required -

- * The required third year reinspection was performed in June 1995.
- * The required periodic surveillance was performed in December 1995.
- * Next activity scheduled is a periodic surveillance in June 1996.

Charlestown High School -

- * Transite panels were compliantly removed from the exterior of the building.

Corden Porter Building #3 -

- * TSI was compliantly removed from the boiler room.

June 96

This information is being published to comply with the requirements of 40 CFR 763 Subpart E asbestos containing materials in schools. This regulation, commonly known as the "AHERA" rule, requires local education agencies, such as this one, to perform certain tasks in regards to the presence and control of asbestos containing materials in the buildings under the jurisdiction of the local education agency.

These include but are not limited to:

1. Developing an asbestos management plan which is designed to outline procedures and guidelines for the inspection, reinspection and periodic surveillance of asbestos containing materials that are present in the buildings.
2. Provide awareness training and additional training to selected school employees.
3. Periodically notify all workers and occupants, or their local guardians, parent teacher organizations, and collective bargaining organizations of the availability of asbestos management plans, the location of same and the times that the plans may be reviewed.

This notification is to advise all patrons, occupants, or their legal guardians, collective bargaining organizations, and parent-teachers organizations, that the asbestos management plans required under this act are available for review upon request. A copy of the plans for all buildings under the jurisdiction of this local education agency are available in the Service Center building, which is located at 301 E. 11th Street, Jeffersonville, Indiana 47130; telephone number 288-4821. Plans for individual schools and other buildings are located in the administration office of each school. The plans can be viewed by any person during normal business hours of the particular school. Interested parties wishing to inquire about the hours and times that the plans are available, should call the above number.

At this time, the management plans can provide information regarding inspections, response actions, and post-response action activities, including periodic reinspection and surveillance activities that are planned or in progress. Inquiries regarding any facet of the regulation or the management plans should be directed to Mr. Dennis Johanson at the above telephone number during regular business hours.

Listed is a brief description of asbestos work that has been completed in our schools this year. Detailed reports have become part of each school's asbestos management plan and may be reviewed in the school office.

All school and support buildings where it is required -

- * The required periodic surveillance was performed in June 1995 and December 1995.
- * The required triennial reinspection was performed in June 1995.
- * The next required periodic surveillance will be performed in June 1996 and December 1996.

June 95

ACCREDITATIONS



Environmental Management Institute

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846

www.envtlmgmt.org

This confirms that

Sandy Shadley

Completed the Required Initial Training for
Asbestos Accreditation Under TSCA Title II
and has
passed with a Score of 70 or Greater the Examination for

Asbestos Management Planner

Course Date
December 10 - 11, 2009

Examination Date
December 11, 2009



Jack E. Leonard, President

Certificate: MP(I) 2248
Expires: December 11, 2010

Approved by:: Illinois Department of Public Health
Indiana Department of Environmental Management

Indiana Department of Environmental Management
100 N. Senate Avenue
Mail Code 61-52 IGCN 1003
Indianapolis, IN 46204-2251



January 21, 2010

RECEIVED JAN 23 2010

Sandra S. Shadley
Alliance Environmental Grp
5340 Commerce Circle Ste E
Indianapolis IN 46237

Re: Asbestos Management Planner # 19A002720

Based upon the review of your license application, the Office of Air Quality has determined that you have fulfilled the requirements of 326 IAC 18 and are eligible for licensing in the following discipline:

Asbestos Management Planner

Your Asbestos Management Planner license is attached below. The license is waterproof and tear resistant. Please sign your license and do not laminate or alter your license in anyway. Your license must be available for review at all times while implementing an asbestos project. This license may be revoked, pursuant to 326 IAC 18-1-7, if you:

- (1) Violate any requirements of these rules (326 IAC 18), 326 IAC 14-10, or any requirement of the Asbestos-Containing Materials in Schools Rule or any other federal, state, or local regulation pertaining to asbestos in buildings or to asbestos projects.
- (2) Falsify information on your application for licensing.
- (3) Fail to meet any qualifications specified in 326-IAC 18-1-4.
- (4) Conduct asbestos project, or related asbestos handling activity, in a manner which is hazardous to the public health.

Your license is valid effective 01/21/2010, and will expire on 01/21/2011, as indicated on your card. We suggest that you attend the required training and submit an application for license renewal early to insure your license does not lapse. NOTE: 326 IAC 18-1-4(h) and 326 IAC 18-1-6(e) require that any individual who has an eighteen (18) month lapse between any two training courses of the same discipline to attend an initial training course for the discipline in which they are seeking a license. In order to avoid re-taking the initial training course you must have attended a refresher in the discipline you are seeking a license within eighteen (18) months from the date of issuance of your last training course certificate.

Office of Air Quality, Asbestos Licensing Section (317) 233-3861



Indiana Dept. of Environmental Management

Sandra S. Shadley

Asbestos Management Planner License #: 19A002720

Effective: 01/21/2010
Birth Date: 04/21/1959
Height: 5-08
Weight: 140

Expiration: 01/21/2011
Gender: F
Eye Color: Blue
Hair Color: Brown

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE
1435 Sadler Circle West Drive
Indianapolis, Indiana 46239
(317) 352 -1270 / (317) 352 - 0669

CHRISTIAAN SPARKS
306 - 04 - 2616

Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better

For
ASBESTOS BUILDING INSPECTOR REFRESHER

Accredited by the
Indiana Department of Environmental Management.

Certificate # ES03/BIR755

Course Dates: 09/26/2003
Test Date: 09/26/ 2003 Expires: 09/26/2004



Sharyn Reyes
Sharyn Reyes
Instructor / Manager

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE
1435 Sadlier Circle West Drive
Indianapolis, Indiana 46239
(317) 352-1270 / (317) 352-06

GEORGE Wm. (BILL) OGLE

Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better
For

**ASBESTOS MANAGEMENT PLANNER
REFRESHER**

Accredited by the
Indiana Department of Environmental Management.

Certificate # ES03/MPR045

Course Dates: 09/05/2003
Test Date: 09/05/2003 Expires: 09/05/2004




Sharyn Reyes
Instructor

ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE

**1435 Sadlier Circle West Drive
Indianapolis, Indiana 46236
(317) 352-1270 / (317) 352 - 0669**

PATRICK E. WILSON

309 - 90 - 6909


**Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better
For**

ASBESTOS BUILDING INSPECTOR REFRESHER

**Accredited by the
Indiana Department of Environmental Management.**

Certificate # ES00/BIR482

**Course Dates: 11/29/2000
Test Date: 11/29/2000 Expires: 11/29/2001**

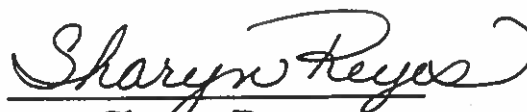

**Sharyn Reyes
Instructor**



Environmental Management Institute

5610 Crawfordsville Road, Suite 15, Indianapolis, Indiana 46224-3714

317/248-4848 • 800/488-8842 • FAX 317/248-4846

www.spea.iupui.edu/Envtl_mgmt

This confirms that

George Wm. (Bill) Ogle



Completed the Requisite Initial Training for
Asbestos Accreditation Under TSCA Title II
and has
Passed with a Score of 70 or Greater the Examination for
Asbestos Management Planner

Course date
March 2 - 3, 2000

Examination Date
March 3, 2000

Jack E. Leonard, President

Certificate: MP(I) 2157
Expires March 3, 2001

Approved by: Illinois Department of Public Health
Indiana Department of Environmental Management



ENVIRONMENTAL SAFETY ASSURANCE INSTITUTE
1435 Sadler Circle West Drive
Indianapolis, Indiana 46239
(317) 352-1270 / (317) 352-0669

CLINT YATES

316 - 92 - 7065


Has Successfully Completed The Course
Required Under TSCA Title II
And Passed The Written Examination
With a Score of 70% or Better
For

ASBESTOS BUILDING INSPECTOR REFRESHER

Accredited by the
Indiana Department of Environmental Management.

Certificate # ES/BIR98/004.

Course Dates: 01/22/98 - 01/22/98
Test Date: 01/22/98 Expires: 01/22/99



Sharyn Reyes
Assistant / Instructor

Environmental Management Institute

Environmental and Occupational Training Service

5610 Crawfordsville Road, Suite 15

Indianapolis, Indiana 46224-3714

317/248-4848

This confirms that

Rex Gaddis


Completed the Requisite Refresher Training for
Asbestos Accreditation Under TSCA Title II
and has

Passed with a Score of 70 or Greater the Examination for

Asbestos Building Inspector

Course date
November 22, 1994

Examination Date
November 22, 1994

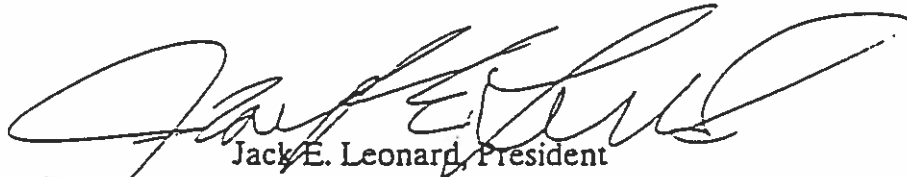

Jack E. Leonard, President

Certificate: IN(R) 2713
Expires November 22, 1995

Approved by: Illinois Department of Public Health
Indiana Department of Environmental Management

INDIANA DEPARTMENT OF
ENVIRONMENTAL MANAGEMENT
ASBESTOS CERTIFICATE OF ACCREDITATION
CERTIFICATE # 102288026 EXPIRATION DATE 2/13/96
Rex Gaddis
IS CERTIFIED IN THE FOLLOWING DISCIPLINE(S)
INSPECTOR ☐ PLANNER ☒ DESIGNER ☐
SUPERVISOR ☐ WORKER ☐
WASTE DISPOSAL MANAGER ☐
BIRTHDATE: 3/24/52 SEX: M EYES: BLU
HEIGHT: 5-10 WEIGHT: 220 HAIR: BRO

INDIANA DEPARTMENT OF
ENVIRONMENTAL MANAGEMENT
ASBESTOS CERTIFICATE OF ACCREDITATION
CERTIFICATE # 190908032 EXPIRATION DATE 3/16/96
Rex Gaddis
IS CERTIFIED IN THE FOLLOWING DISCIPLINE(S)
INSPECTOR ☒ PLANNER ☐ DESIGNER ☐
SUPERVISOR ☐ WORKER ☐
WASTE DISPOSAL MANAGER ☐
BIRTHDATE: 3/24/52 SEX: M EYES: BLU
HEIGHT: 5-10 WEIGHT: 220 HAIR: BRO

TRAINING

***OPERATIONS AND MAINTENANCE
INFORMATION***

MINOR FIBER RELEASE EPISODE

The local education agency shall ensure that the procedures described below are followed in the event of a minor fiber release episode (i.e., the falling or dislodging of not more than 3 square or linear feet of friable ACBM):

1. Thoroughly saturate the debris using wet methods.
2. Clean the area using wet methods, protective clothing, HEPA-vacuums, mini-enclosures, glove bags, as necessary to inhibit the spread of any released fibers. At a minimum, workers should use air-purifying respirators with HEPA filters.
3. Place the asbestos debris in a sealed, leak-tight container, preferably a 6 mil. labeled plastic bag.
4. Repair the area of damaged ACM with materials such as asbestos-free spackling, plaster, cement, or insulation, or seal with latex paint or an encapsulant, or immediately have the appropriate response action implemented.
5. Each fiber release episode should be documented.

MAJOR FIBER RELEASE EPISODE

The local education agency shall ensure that the procedures described below are followed in the event of a major fiber release episode (i.e., the falling or dislodging of more than 3 square or linear feet of friable ACM):

1. Restrict entry into the area and post signs to prevent entry into the area by persons other than those necessary to perform the response action.
2. Shut off or temporarily modify the air-handling system to prevent the distribution of fibers to other areas in the building.
3. AHERA requires that major fiber release episodes be designed by accredited Project Designers. However, the following response procedures should form the basis for response actions.
4. All the procedures recommended by EPA and required by OSHA for large-scale removal of ACM should be used. These include containment barrier, negative pressure ventilation, personal respiratory protection and protective clothing, decontamination facilities, and air testing.
5. Workers should wear "type C" respirators and protective clothing, including a body suit, hood, boots and gloves. Personal air monitoring may be conducted on representative workers, but is not required by OSHA when "type C" respirators are used.
6. Fallen debris should be sprayed with amended water and placed in plastic bags for disposal. Shovels are useful for collecting the debris. The floor should be thoroughly cleaned with a HEPA vacuum cleaner.
7. Walls, ceiling, pipes, boilers, or other surfaces where ACM was damaged or delaminated should be repaired temporarily. This might involve replastering with asbestos-free material, spraying with an encapsulant, or taping with duct tape. In some cases, ACM beyond the immediate area of damage may need to be removed to prevent additional episodes.
8. The air should be tested for asbestos fibers before the plastic barriers are removed and the area reoccupied. Testing should follow guidelines in Chapter 6 of the Purple Book and Chapter 4 of the Silver Book. That is, air should be sampled at the specified number of locations and analyzed by either phase contrast microscopy or transmission electron microscopy. However, sampling should not be done aggressively since the use of blowers and fans may dislodge fibers from the remaining ACM.

9. After the barriers have been taken down, a decontamination of the entire building or a portion of it should be considered. The need for this will depend on how rapidly the response team reacted to the episode and, in particular, how quickly the HVAC system was turned off. A thorough decontamination includes HEPA-vacuuming and/or wet wiping all carpets, furniture, and other surfaces. Decontamination of the HVAC system would involve disassembling and cleaning (HEPA-vacuuming or wet wiping) ducts, ventilators, registers, and other system parts. System filters should also be removed and replaced.

10. All equipment used in the cleanup operation should be washed or wiped with damp cloths. All disposable materials (e.g., cloths, mop heads, filters, coveralls) should be discarded as asbestos wastes.

11. Each fiber release episode should be documented.

OPERATIONS AND MAINTENANCE REPORT
(Use only for O&M work less than 3 square or 3 linear feet)

L.E.A.: _____

BUILDING: _____

DATE: _____

The following information is provided in accordance with 40 CFR 763.91 and 763.94.

1. Location: _____

Homogeneous Area/Material Description _____

2. Response: Clean _____ Repair _____ Encapsulation _____

Enclosure _____ Removal _____

Reason: _____

3. Work Description: _____

4. Date: Start _____ Stop _____

Time: Start _____ Stop _____

5. Material: Surface _____ SF Thermal _____ LF

Other: _____ SF or _____ LF

6. Asbestos Control Method: Wet Methods _____ HEPA Vacuum _____

Glovebag _____ Mini-Enclosure _____

7. Respiratory Protection: N.A.P.R. _____ P.A.P.R. _____

Were all employees properly fit tested? YES NO NOT APPLICABLE

8. Equipment Used:

Low Vol. Pumps
FAM
HEPA Vac

High Vol. Pumps
AFD

Other: _____

9. Material Used:

6 Mil. Disposable Bags
Glovebags
Duct Tape
Disposable Coveralls
Sponges

Poly
HEPA Filters
Spray Glue
3M Pads

Encapsulants: Penetrating _____ Bridging _____

Other: _____

10. Work Personnel:

NAME **16 HOUR TRAINED - IDEM ACCREDITED**

Supervisor: _____ YES NO YES NO

Worker(s): _____ YES NO YES NO

_____ YES NO YES NO

_____ YES NO YES NO

_____ YES NO YES NO

_____ YES NO YES NO

11. ACBM Disposal: Storage: YES NO, If yes, where stored: _____

If no, where disposed: Landfill: _____

12. Final Visual Inspection Approved: _____
(LEA Designated Person - Printed Name)

(LEA Designated Person - Signature)

**REMOVAL PROJECT
INFORMATION**

SHORT TERM WORKER PROGRAM

GREATER CLARK COUNTY SCHOOLS

SHORT-TERM WORKER SIGN OFF SHEET

This form should be signed each and every time before a "short-term worker" (telephone repair worker, utility worker, etc.) performs work that may cause him to come in contact with ACBM or suspected ACBM assumed to be ACM. One copy of this form should then be forwarded to the LEA designated person, and one copy should be maintained in the school building's copy of the supplemental binder provided by Alliance Indiana, Inc., in order to fulfill the LEA's recordkeeping requirements. The third copy should be forwarded to Alliance Indiana, Inc. for placement in its copy of the supplemental binder.

School Building Name - Charlestown Middle School Date

I certify that before performing any work which would possibly cause me to come in contact with Asbestos Containing Building Materials (ACBM), I was provided with adequate information regarding the locations of ACBM and suspected ACBM assumed to be ACM in the above-mentioned school building where I performed the work.

Signature - _____

Company - _____

Description of work (including number of days on site) - _____

Alliance Indiana, Inc. AHERA Program

AHERA Program

GREATER CLARK COUNTY SCHOOLS

SHORT-TERM WORKER SIGN IN LOG

ALL SHORT-TERM WORKERS MUST SIGN THIS LOG CONFIRMING THAT THEY HAVE SIGNED A "SHORT-TERM WORKER SIGN OFF SHEET"

BUILDING NAME - Charlestown Middle School

DATE	NAME(print)	COMPANY	SIGNATURE
------	-------------	---------	-----------

NAME(print) COMPANY SIGNATURE

COMPANY _____ SIGNATURE _____

SIGNATURE

Greater Clark County Schools Short Term Worker

Short Term Worker